

# **MELSEC System Q**

Programmable Logic Controllers

User's Manual

## **Positioning Modules QD75M1, QD75M2, QD75M4**

## ● SAFETY INSTRUCTIONS ●

(Always read these instructions before using this equipment.)

Before using this product, please read this manual and the relevant manuals introduced in this manual carefully and pay full attention to safety to handle the product correctly.

The instructions given in this manual are concerned with this product. For the safety instructions of the programmable logic controller system, please read the CPU module User's Manual.


In this manual, the safety instructions are ranked as "DANGER" and "CAUTION".



Indicates that incorrect handling may cause hazardous conditions, resulting in death or severe injury.



Indicates that incorrect handling may cause hazardous conditions, resulting in medium or slight personal injury or physical damage.

Note that the  CAUTION level may lead to a serious consequence according to the circumstances. Always follow the instructions of both levels because they are important to personal safety.

Please save this manual to make it accessible when required and always forward it to the end user.

### [Design Instructions]

#### DANGER

- Provide a safety circuit outside the programmable logic controller so that the entire system will operate safely even when an external power supply error or PLC fault occurs.  
Failure to observe this could lead to accidents for incorrect outputs or malfunctioning.
  - (1) Configure an emergency stop circuit and interlock circuit such as a positioning upper limit/lower limit to prevent mechanical damage outside the PLC.
  - (2) The machine OPR operation is controlled by the OPR direction and OPR speed data. Deceleration starts when the near-point dog turns ON. Thus, if the OPR direction is incorrectly set, deceleration will not start and the machine will continue to travel. Configure an interlock circuit to prevent mechanical damage outside the PLC.
  - (3) When the module detects an error, normally deceleration stop or sudden stop will take place according to the parameter stop group settings. Set the parameters to the positioning system specifications.  
Make sure that the OPR parameter and positioning data are within the parameter setting values.

## [Design Instructions]

### CAUTION

- Do not bundle or adjacently lay the control wire or communication cable with the main circuit or power wire.  
Separate these by 100mm (3.94in.) or more.  
Failure to observe this could lead to malfunctioning caused by noise.

## [Mounting Instructions]

### CAUTION

- Use the PLC within the general specifications environment given in this manual.  
Using the PLC outside the general specification range environment could lead to electric shocks, fires, malfunctioning, product damage or deterioration.
- Hold down the module loading lever at the bottom of the module and insert the module fixing hooks into the base unit fixing holes securely to load the module. Improper loading of the module can cause a malfunction, failure or drop.  
For use in vibratory environment, tighten the module with screws.  
Tighten the screws within the specified torque range.  
Undertightening can cause a drop, short circuit or malfunction.  
Overtightening can cause a drop, short circuit or malfunction due to damage to the screws or module.
- Always load or unload the module after switching power off externally in all phases. Not doing so may damage the product.
- Make sure that the connectors for the servo amplifier and peripheral devices have been securely installed until a click is heard.  
Not doing so could lead to a poor connection, resulting in erroneous input and output.
- When the servo amplifier is not installed, install the connector cover without fail.  
Failure to observe this could lead to a malfunction.

## [Wiring Instructions]

### DANGER

- Always confirm the terminal layout before connecting the wires to the module.

## [Startup/Maintenance Instructions]

### DANGER

- Always turn all phases of the power supply OFF externally before cleaning or tightening the screws.  
Failure to turn all phases OFF could lead to electric shocks.

## [Startup/Maintenance Instructions]

### CAUTION

- Never disassemble or modify the module.  
Failure to observe this could lead to trouble, malfunctioning, injuries or fires.
- Always turn all phases of the power supply OFF externally before installing or removing the module.  
Failure to turn all phases OFF could lead to module trouble or malfunctioning.
- Before starting test operation, set the parameter speed limit value to the slowest value, and make sure that operation can be stopped immediately if a hazardous state occurs.
- Always make sure to touch the grounded metal to discharge the electricity charged in the body, etc., before touching the module.  
Failure to do so may cause a failure or malfunctions of the module.

## [Precautions for use]

### CAUTION

- Note that when the reference axis speed is designated for interpolation operation, the speed of the partner axis (2nd axis, 3rd axis and 4th axis) may be larger than the set speed (larger than the speed limit value).

## [Disposal Instructions]

### CAUTION

- When disposing of the product, handle it as industrial waste.



REVISIONS

\* The manual number is given on the bottom left of the back cover.

Print Date	* Manual Number	Revision
Dec., 2002	IB (NA) 0300062-A	First edition
Apr., 2004	IB (NA) 0300062-B	<div style="border: 1px solid black; padding: 2px;">Partial corrections and additions</div> SAFETY INSTRUCTIONS, CONTENTS, Generic Terms and Abbreviations, Section 1.1.1, Section 1.1.4 to Section 1.1.6, Section 1.2, Section 2.1, Section 2.2 to Section 2.4, Section 3.1 to Section 3.5, Section 4.1.1, Section 4.1.2, Section 4.3.1, Section 4.4.1, Section 5.1.1 to Section 5.1.3, Section 5.1.5 to Section 5.1.9, Section 5.2.1 to Section 5.2.10, Section 5.3 to Section 5.6, Section 6.1 to Section 6.3, Section 6.5.1 to Section 6.5.6, Section 7.1 to Section 7.2, Section 8.1 to Section 8.2, Section 9.1.1 to Section 9.1.3, Section 9.1.5, Section 9.1.6, Section 9.2, Section 10.1 to Section 10.6, Section 11.1.1 to Section 11.2.4, Section 11.3 to Section 11.4, Section 12.1 to Section 12.7, Section 13.1 to Section 13.4, Section 14.1 to Section 14.6, Section 15.1 to Section 15.3, Appendix 1 to Appendix 8, INDEX

Japanese Manual Version IB-0300030

This manual confers no industrial property rights or any rights of any other kind, nor does it confer any patent licenses. Mitsubishi Electric Corporation cannot be held responsible for any problems involving industrial property rights which may occur as a result of using the contents noted in this manual.

© 2002 MITSUBISHI ELECTRIC CORPORATION

## INTRODUCTION

Thank you for purchasing the Mitsubishi general-purpose programmable logic controller MELSEC-Q Series. Always read through this manual, and fully comprehend the functions and performance of the Q Series PLC before starting use to ensure correct usage of this product.

## CONTENTS

SAFETY INSTRUCTIONS.....	A- 1
REVISIONS .....	A- 4
INTRODUCTION.....	A- 5
CONTENTS.....	A- 5
About Manuals .....	A- 13
Using This Manual.....	A- 13
Conformation to the EMC Directive .....	A- 13
Generic Terms and Abbreviations .....	A- 14
Component List .....	A- 14

### Section 1 Product Specifications and Handling

#### 1. Product Outline 1- 1 to 1- 28

1.1 Positioning control.....	1- 2
1.1.1 Features of QD75.....	1- 2
1.1.2 Purpose and applications of positioning control.....	1- 5
1.1.3 Mechanism of positioning control .....	1- 7
1.1.4 Overview of positioning control functions.....	1- 8
1.1.5 Outline design of positioning system .....	1- 18
1.1.6 Communicating signals between QD75 and each module.....	1- 19
1.2 Flow of system operation.....	1- 22
1.2.1 Flow of all processes.....	1- 22
1.2.2 Outline of starting .....	1- 24
1.2.3 Outline of stopping .....	1- 26
1.2.4 Outline for restarting.....	1- 27

#### 2. System Configuration 2- 1 to 2- 8

2.1 General image of system.....	2- 2
2.2 Component list .....	2- 4
2.3 Applicable system .....	2- 6
2.4 How to check the function version and SERIAL No. ....	2- 8

#### 3. Specifications and Functions 3- 1 to 3- 22

3.1 Performance specifications.....	3- 2
3.2 List of functions .....	3- 4
3.2.1 QD75 control functions.....	3- 4
3.2.2 QD75 main functions.....	3- 6

3.2.3 QD75 sub functions and common functions .....	3- 8
3.2.4 Combination of QD75 main functions and sub functions.....	3- 12
3.3 Specifications of input/output signals with PLC CPU .....	3- 14
3.3.1 List of input/output signals with PLC CPU.....	3- 14
3.3.2 Details of input signals (QD75 → PLC CPU) .....	3- 15
3.3.3 Details of output signals (PLC CPU → QD75).....	3- 17
3.4 Specifications of interfaces with external devices.....	3- 18
3.4.1 Electrical specifications of input signals .....	3- 18
3.4.2 Signal layout for external device connection connector.....	3- 19
3.4.3 List of input signal details.....	3- 20
3.4.4 Interface internal circuit.....	3- 21
3.5 External circuit design.....	3- 22

<b>4. Installation, Wiring and Maintenance of the Product</b>	<b>4- 1 to 4- 16</b>
---------------------------------------------------------------	----------------------

4.1 Outline of installation, wiring and maintenance.....	4- 2
4.1.1 Installation, wiring and maintenance procedures.....	4- 2
4.1.2 Names of each part.....	4- 3
4.1.3 Handling precautions .....	4- 5
4.2 Installation .....	4- 7
4.2.1 Precautions for installation.....	4- 7
4.3 Wiring.....	4- 9
4.3.1 Precautions for wiring.....	4- 9
4.4 Confirming the installation and wiring.....	4- 14
4.4.1 Items to confirm when installation and wiring are completed .....	4- 14
4.5 Maintenance.....	4- 15
4.5.1 Precautions for maintenance .....	4- 15
4.5.2 Disposal instructions .....	4- 15

<b>5. Data Used for Positioning Control (List of buffer memory addresses)</b>	<b>5- 1 to 5-162</b>
-------------------------------------------------------------------------------	----------------------

5.1 Types of data.....	5- 2
5.1.1 Parameters and data required for control.....	5- 2
5.1.2 Setting items for positioning parameters.....	5- 4
5.1.3 Setting items for OPR parameters.....	5- 6
5.1.4 Setting items for servo parameters.....	5- 7
5.1.5 Setting items for positioning data.....	5- 9
5.1.6 Setting items for block start data .....	5- 12
5.1.7 Setting items for condition data .....	5- 13
5.1.8 Types and roles of monitor data .....	5- 14
5.1.9 Types and roles of control data .....	5- 18
5.2 List of parameters .....	5- 22
5.2.1 Basic parameters 1 .....	5- 22
5.2.2 Basic parameters 2 .....	5- 26
5.2.3 Detailed parameters 1.....	5- 28
5.2.4 Detailed parameters 2.....	5- 36
5.2.5 OPR basic parameters.....	5- 48
5.2.6 OPR detailed parameters .....	5- 54

5.2.7 Servo basic parameters .....	5- 58
5.2.8 Servo adjustment parameters.....	5- 64
5.2.9 Servo expansion parameters.....	5- 74
5.2.10 Servo expansion parameters 2.....	5- 78
5.3 List of positioning data .....	5- 82
5.4 List of block start data .....	5- 98
5.5 List of condition data .....	5-104
5.6 List of monitor data.....	5-110
5.6.1 System monitor data .....	5-110
5.6.2 Axis monitor data.....	5-120
5.7 List of control data .....	5-138
5.7.1 System control data .....	5-138
5.7.2 Axis control data .....	5-140

<b>6. Sequence Program Used for Positioning Control</b>	<b>6- 1 to 6- 72</b>
---------------------------------------------------------	----------------------

6.1 Precautions for creating program .....	6- 2
6.2 List of devices used.....	6- 5
6.3 Creating a program .....	6- 15
6.3.1 General configuration of program .....	6- 15
6.3.2 Positioning control operation program.....	6- 16
6.4 Positioning program examples .....	6- 20
6.5 Program details .....	6- 53
6.5.1 Initialization program .....	6- 53
6.5.2 Start details setting program .....	6- 54
6.5.3 Start program.....	6- 56
6.5.4 Continuous operation interrupt program.....	6- 65
6.5.5 Restart program .....	6- 67
6.5.6 Stop program.....	6- 70

<b>7. Memory Configuration and Data Process</b>	<b>7- 1 to 7- 20</b>
-------------------------------------------------	----------------------

7.1 Configuration and roles of QD75 memory .....	7- 2
7.1.1 Configuration and roles of QD75 memory.....	7- 2
7.1.2 Buffer memory area configuration .....	7- 5
7.2 Data transmission process .....	7- 8

Section 2 Control Details and Setting

8. OPR Control

8- 1 to 8- 14

8.1 Outline of OPR control ..... 8- 2  
8.1.1 Two types of OPR control ..... 8- 2  
8.2 Machine OPR ..... 8- 4  
8.2.1 Outline of the machine OPR operation ..... 8- 4  
8.2.2 Machine OPR method ..... 8- 5  
8.2.3 OPR method (1): Near-point dog method ..... 8- 6  
8.2.4 OPR method (2): Count method 1) ..... 8- 8  
8.2.5 OPR method (3): Count method 2) ..... 8- 10  
8.2.6 OPR method (4): Data set method ..... 8- 12  
8.3 Fast OPR ..... 8- 13  
8.3.1 Outline of the fast OPR operation ..... 8- 13

9. Major Positioning Control

9- 1 to 9-116

9.1 Outline of major positioning controls ..... 9- 2  
9.1.1 Data required for major positioning control ..... 9- 4  
9.1.2 Operation patterns of major positioning controls ..... 9- 5  
9.1.3 Designating the positioning address ..... 9- 15  
9.1.4 Confirming the current value ..... 9- 16  
9.1.5 Control unit "degree" handling ..... 9- 18  
9.1.6 Interpolation control ..... 9- 21  
9.2 Setting the positioning data ..... 9- 25  
9.2.1 Relation between each control and positioning data ..... 9- 25  
9.2.2 1-axis linear control ..... 9- 27  
9.2.3 2-axis linear interpolation control ..... 9- 29  
9.2.4 3-axis linear interpolation control ..... 9- 33  
9.2.5 4-axis linear interpolation control ..... 9- 39  
9.2.6 1-axis fixed-feed control ..... 9- 44  
9.2.7 2-axis fixed-feed control (interpolation) ..... 9- 46  
9.2.8 3-axis fixed-feed control (interpolation) ..... 9- 48  
9.2.9 4-axis fixed-feed control (interpolation) ..... 9- 52  
9.2.10 2-axis circular interpolation control with sub point designation ..... 9- 54  
9.2.11 2-axis circular interpolation control with center point designation ..... 9- 60  
9.2.12 1-axis speed control ..... 9- 68  
9.2.13 2-axis speed control ..... 9- 71  
9.2.14 3-axis speed control ..... 9- 74  
9.2.15 4-axis speed control ..... 9- 78  
9.2.16 Speed-position switching control (INC mode) ..... 9- 83  
9.2.17 Speed-position switching control (ABS mode) ..... 9- 91  
9.2.18 Position-speed switching control ..... 9- 99  
9.2.19 Current value changing ..... 9-106  
9.2.20 NOP instruction ..... 9-111

9.2.21 JUMP instruction .....	9-112
9.2.22 LOOP .....	9-114
9.2.23 LEND .....	9-115

<b>10. High-Level Positioning Control</b>	<b>10- 1 to 10- 26</b>
-------------------------------------------	------------------------

10.1 Outline of high-level positioning control .....	10- 2
10.1.1 Data required for high-level positioning control.....	10- 3
10.1.2 "Block start data" and "condition data" configuration .....	10- 4
10.2 High-level positioning control execution procedure .....	10- 6
10.3 Setting the block start data .....	10- 7
10.3.1 Relation between various controls and block start data .....	10- 7
10.3.2 Block start (normal start) .....	10- 8
10.3.3 Condition start .....	10- 10
10.3.4 Wait start.....	10- 11
10.3.5 Simultaneous start .....	10- 12
10.3.6 Repeated start (FOR loop) .....	10- 13
10.3.7 Repeated start (FOR condition) .....	10- 14
10.3.8 Restrictions when using the NEXT start.....	10- 15
10.4 Setting the condition data .....	10- 16
10.4.1 Relation between various controls and the condition data .....	10- 16
10.4.2 Condition data setting examples .....	10- 19
10.5 Multiple axes simultaneous start control .....	10- 20
10.6 Start program for high-level positioning control .....	10- 23
10.6.1 Starting high-level positioning control.....	10- 23
10.6.2 Example of a start program for high-level positioning control .....	10- 24

<b>11. Manual Control</b>	<b>11- 1 to 11- 36</b>
---------------------------	------------------------

11.1 Outline of manual control .....	11- 2
11.1.1 Three manual control methods.....	11- 2
11.2 JOG operation.....	11- 4
11.2.1 Outline of JOG operation .....	11- 4
11.2.2 JOG operation execution procedure .....	11- 7
11.2.3 Setting the required parameters for JOG operation.....	11- 8
11.2.4 Creating start programs for JOG operation.....	11- 10
11.2.5 JOG operation example .....	11- 13
11.3 Inching operation.....	11- 17
11.3.1 Outline of inching operation .....	11- 17
11.3.2 Inching operation execution procedure .....	11- 20
11.3.3 Setting the required parameters for inching operation .....	11- 21
11.3.4 Creating a program to enable/disable the inching operation.....	11- 22
11.3.5 Inching operation example.....	11- 25
11.4 Manual pulse generator operation.....	11- 27
11.4.1 Outline of manual pulse generator operation.....	11- 27
11.4.2 Manual pulse generator operation execution procedure .....	11- 31
11.4.3 Setting the required parameters for manual pulse generator operation .....	11- 32
11.4.4 Creating a program to enable/disable the manual pulse generator operation.....	11- 33

**12. Control Sub Functions**

12- 1 to 12- 98

12.1 Outline of sub functions .....	12- 2
12.1.1 Outline of sub functions .....	12- 2
12.2 Sub functions specifically for machine OPR .....	12- 4
12.2.1 OPR retry function.....	12- 4
12.2.2 OP shift function .....	12- 8
12.3 Functions for compensating the control .....	12- 11
12.3.1 Backlash compensation function .....	12- 11
12.3.2 Electronic gear function .....	12- 13
12.3.3 Near pass function .....	12- 20
12.4 Functions to limit the control .....	12- 23
12.4.1 Speed limit function.....	12- 23
12.4.2 Torque limit function.....	12- 25
12.4.3 Software stroke limit function.....	12- 29
12.4.4 Hardware stroke limit function .....	12- 35
12.5 Functions to change the control details.....	12- 37
12.5.1 Speed change function .....	12- 37
12.5.2 Override function .....	12- 44
12.5.3 Acceleration/deceleration time change function .....	12- 47
12.5.4 Torque change function .....	12- 51
12.6 Absolute position system .....	12- 54
12.7 Other functions .....	12- 56
12.7.1 Step function.....	12- 56
12.7.2 Skip function .....	12- 61
12.7.3 M code output function.....	12- 64
12.7.4 Teaching function.....	12- 68
12.7.5 Target position change function .....	12- 74
12.7.6 Command in-position function .....	12- 78
12.7.7 Acceleration/deceleration processing function.....	12- 81
12.7.8 Pre-reading start function.....	12- 84
12.7.9 Deceleration start flag function.....	12- 89
12.7.10 Stop command processing for deceleration stop function .....	12- 93
12.8 Servo ON/OFF .....	12- 96
12.8.1 Servo ON/OFF .....	12- 96
12.8.2 Follow up function .....	12- 97
12.9 Precautions for MR-J2M-B connection .....	12- 98

**13. Common Functions**

13- 1 to 13- 8

13.1 Outline of common functions .....	13- 2
13.2 Parameter initialization function.....	13- 3
13.3 Execution data backup function .....	13- 5
13.4 External I/O signal logic switching function .....	13- 7
13.5 External I/O signal monitor function .....	13- 8

14. Dedicated Instructions	14- 1 to 14- 18
----------------------------	-----------------

14.1 List of dedicated instructions .....	14- 2
14.2 Interlock during dedicated instruction is executed .....	14- 2
14.3 PSTRT1, PSTRT2, PSTRT3, PSTRT4.....	14- 3
14.4 TEACH1, TEACH2, TEACH 3, TEACH 4 .....	14- 7
14.5 PFWRT .....	14- 11
14.6 PINIT.....	14- 15

15. Troubleshooting	15- 1 to 15-106
---------------------	-----------------

15.1 Error and warning details .....	15- 2
15.2 List of errors .....	15- 6
15.2.1 QD75 detection error.....	15- 6
15.2.2 MR-H-BN detection error .....	15- 34
15.2.3 MR-J2-B detection error.....	15- 46
15.2.4 MR-J2S-B detection error .....	15- 56
15.2.5 MR-J2-Jr detection error .....	15- 66
15.2.6 MR-J2M-B detection error .....	15- 76
15.3 List of warnings .....	15- 90
15.3.1 QD75 detection warning .....	15- 90
15.3.2 MR-H-BN detection warning.....	15- 96
15.3.3 MR-J2-B detection warning .....	15- 98
15.3.4 MR-J2S-B detection warning.....	15-100
15.3.5 MR-J2-Jr detection warning.....	15-102
15.3.6 MR-J2M-B detection warning .....	15-104
15.4 LED display functions .....	15-106

Appendices	Appendix- 1 to Appendix-76
------------	----------------------------

Appendix 1 Functions.....	Appendix- 3
Appendix 1.1 Multiple CPU correspond function.....	Appendix- 3
Appendix 1.2 The combination of software package for QD75 and QCPU .....	Appendix- 3
Appendix 2 Positioning data (No.1 to 600) List of buffer memory addresses.....	Appendix- 4
Appendix 3 Connection with servo amplifiers .....	Appendix- 28
Appendix 3.1 Connection of SSCNET cables .....	Appendix- 28
Appendix 3.2 Wiring of SSCNET cables .....	Appendix- 30
Appendix 4 Connection with external device connector .....	Appendix- 34
Appendix 4.1 Connector.....	Appendix- 34
Appendix 4.2 Wiring of manual pulse generator cable .....	Appendix- 36
Appendix 5 Comparisons with conventional positioning modules.....	Appendix- 37
Appendix 5.1 Comparisons with QD75P model.....	Appendix- 37
Appendix 5.2 Comparisons with A1SD75M1/A1SD75M2/ A1SD75M3 models .....	Appendix- 38



Appendix 6 Positioning control troubleshooting .....Appendix- 57  
Appendix 7 List of buffer memory addresses.....Appendix- 63  
Appendix 8 External dimension drawing .....Appendix- 75

INDEX	Index- 1 to Index - 10
-------	------------------------

INDEX..... Index - 1

## About Manuals

The following manuals are also related to this product.  
In necessary, order them by quoting the details in the tables below.

### Related Manuals

Manual Name	Manual Number (Model Code)
Type QD75M Positioning Module User's Manual (Hardware) Describes the performance, specifications, Input interface, component names, and startup procedure of the respective positioning modules: Type QD75M (The manual is supplied with the module.)	IB-0300031 (1CT750)
GX Configurator-QP Operating Manual Describes how to use GX Configurator-QP for the following and other purposes: creating data (parameters, positioning data, etc.), sending the data to the module, monitoring the positioning operations, and testing. (The manual is supplied with the software.)	SH-080172 (13JU19)

## Using This Manual

■ The symbols used in this manual are shown below.

<b>Pr. *</b>	.....	Symbol indicating positioning parameter and OPR parameter item.
<b>Da. *</b>	.....	Symbol indicating positioning data, block start data and condition data item.
<b>Md. *</b>	.....	Symbol indicating monitor data item.
<b>Cd. *</b>	.....	Symbol indicating control data item.

(A serial No. is inserted in the \* mark.)

## Conformation to the EMC Directive

The CE logo is printed on the rating plate on the main body of the PLC that conforms to the EMC directive and low voltage instruction.  
To make this product conform to the EMC directive and low voltage instruction, please refer to section 4.3.1 "Precautions for wiring" of the chapter 4 "Installation, Wiring and Maintenance of the Product" and the EMC Installation Guidelines (IB(NA)67339).

■ Representation of numerical values used in this manual.

- Buffer memory addresses, error codes and warning codes are represented in decimal.
- X/Y devices are represented in hexadecimal.
- Setting data and monitor data are represented in decimal or hexadecimal. Data ended by "H" or "h" are represented in hexadecimal.  
(Example) 10.....Decimal  
10H.....Hexadecimal

## Generic Terms and Abbreviations

Unless specially noted, the following generic terms and abbreviations are used in this manual.

Generic term/abbreviation	Details of generic term/abbreviation
PLC CPU	Generic term for PLC CPU on which QD75 can be mounted.
QD75	Generic term for positioning module QD75M1, QD75M2 and QD75M4. The module type is described to indicate a specific module.
MR-H-BN	Servo amplifier: Abbreviation for MR-H-BN/MR-H $\ddot{Y}$ B.
MR-J2-Jr	Servo amplifier: Abbreviation for MR-J2-03B5.
MR-J2 $\ddot{Y}$ -B	Servo amplifier: Abbreviation for MR-J2- $\ddot{Y}$ B/MR-J2S- $\ddot{Y}$ B/MR-J2-Jr/MR-J2M-B.
Peripheral device	Generic term for DOS/V personal computer that can run the following "GX Developer" and "GX Configurator-QP".
GX Developer	Abbreviation for GX Developer (SW4D5C-GPPW-E or later).
GX Configurator-QP	Abbreviation for GX Configurator-QP (SW2D5C-QD75P-E or later).
Servo amplifier (drive unit)	Abbreviation for SSCNET compatible servo amplifier (drive unit).
Manual pulse generator	Abbreviation for manual pulse generator (MR-HDP01) (prepared by user).
DOS/V personal computer	IBM PC/AT <sup>®</sup> and compatible DOS/V compliant personal computer.
Personal computer	Generic term for DOS/V personal computer.
Workpiece	Generic term for moving body such as workpiece and tool, and for various control targets.
Axis 1, axis 2, axis 3, axis 4	Indicates each axis connected to QD75.
1-axis, 2-axis, 3-axis, 4-axis	Indicates the number of axes. (Example: 2-axis = Indicates two axes such as axis 1 and axis 2, axis 2 and axis 3, and axis 3 and axis 1.)
OPR	Generic term for "Home position return".
OP	Generic term for "Home position".
SSCNET <sup>(Note)</sup>	High speed synchronous communication network between QD75 and servo amplifier.

(Note): SSCNET: Servo System Controller NETwork

## Component List

The table below shows the component included in respective positioning modules:

Module name	Quantity		
	QD75M1	QD75M2	QD75M4
QD75M1 positioning module	1		
QD75M2 positioning module		1	
QD75M4 positioning module			1

# Section 1 Product Specifications and Handling

Section 1 is configured for the following purposes (1) to (5).

- (1) To understand the outline of positioning control, and the QD75 specifications and functions
- (2) To carry out actual work such as installation and wiring
- (3) To set parameters and data required for positioning control
- (4) To create a PLC program required for positioning control
- (5) To understand the memory configuration and data transmission process

Read "Section 2" for details on each control.

Chapter 1	Product outline .....	1- 1 to 1- 28
Chapter 2	System configuration .....	2- 1 to 2- 8
Chapter 3	Specifications and Functions.....	3- 1 to 3- 22
Chapter 4	Installation, Wiring and Maintenance of the Product .....	4- 1 to 4- 16
Chapter 5	Data Used for Positioning Control .....	5- 1 to 5-162
Chapter 6	PLC Program Used for Positioning Control .....	6- 1 to 6- 72
Chapter 7	Memory Configuration and Data Process .....	7- 1 to 7- 20



# Chapter 1 Product Outline

The purpose and outline of positioning control using QD75 are explained in this chapter. Reading this chapter will help you understand what can be done using the positioning system and which procedure to use for a specific purpose.

By understanding "What can be done", and "Which procedure to use" beforehand, the positioning system can be structured smoothly.

1.1	Positioning control .....	1- 2
1.1.1	Features of QD75 .....	1- 2
1.1.2	Purpose and applications of positioning control .....	1- 5
1.1.3	Mechanism of positioning control.....	1- 7
1.1.4	Overview of positioning control functions.....	1- 8
1.1.5	Outline design of positioning system.....	1- 18
1.1.6	Communicating signals between QD75 and each module .....	1- 19
1.2	Flow of system operation .....	1- 22
1.2.1	Flow of all processes .....	1- 22
1.2.2	Outline of starting.....	1- 24
1.2.3	Outline of stopping .....	1- 26
1.2.4	Outline for restarting .....	1- 27

## 1.1 Positioning control

### 1.1.1 Features of QD75

The features of the QD75 are shown below.

#### (1) Availability of one, two, and four axis modules

- (a) One, two and four axis positioning modules are available.

They can be selected according to the PLC CPU type and the number of required control axes. (Refer to Section 2.2.)

- (b) For connecting any of the QD75 modules to the base unit, a single slot and 32 dedicated I/O channels are required.

Within the limit imposed by the maximum number of inputs and outputs supported by the PLC CPU, up to 64 modules can be used. (Refer to Section 3.1.)

#### (2) Wide variety of positioning control functions

- (a) A wide variety of positioning control functions essential to any positioning system are supported: positioning to an arbitrary position, fixed-feed control, equal-speed control, and so on. (Refer to Section 5.3 and 9.2.)

- 1) Up to 600 positioning data items, including such information as positioning addresses, control systems, and operation patterns, can be prepared for each axis.

Using the prepared positioning data, the positioning control is performed independently for each axis. (In addition, such controls as interpolation involving two to four axes and simultaneous startup of multiple axes are possible.)

- 2) Independent control of each axis can be achieved in linear control mode (executable simultaneously over four axes).

Such control can either be the independent positioning control using a single positioning data or the continuous positioning control enabled by the continuous processing of multiple positioning data.

- 3) Coordinated control over multiple axes can take the form of either the linear interpolation through the speed or position control of two to four axes or the circular interpolation involving two axes.

Such control can either be the independent positioning control using a single positioning data or the continuous positioning control enabled by the continuous processing of multiple positioning data.

- (b) For each positioning data, the user can specify any of the following control systems: position control, speed control, speed-position switching control, position-speed switching control, and so on. (Refer to Section 5.3 and 9.2.)

- (c) Continuous positioning control using multiple positioning data can be executed in accordance with the operation patterns the user assigned to the positioning data. (Refer to Section 5.3 and 9.1.2.)  
Continuous positioning control can be executed over multiple blocks, where each block consists of multiple positioning data. (Refer to Section 10.3.2.)
  - (d) OPR control is given additional features (Refer to Section 8.2.)  
Four different machine OPR methods are provided: the near point dog method, two count methods, and the data set method.
  - (e) Two acceleration/deceleration control methods are provided: automatic trapezoidal acceleration/deceleration and S-pattern acceleration/deceleration. (Refer to Section 12.7.7.)
- (3) Quick startup (Refer to Section 3.1.)  
A positioning operation starts up quickly taking as little as 6 ms to 7.  
When operation using simultaneous start function or interpolation operation is executed, the axes start without delay.  
(Example) Axis 1 and Axis 3 are started by the simultaneous start function : No delay in Axis 1 and Axis 3 start  
Axis 2 and Axis 4 are started by the interpolation operation : No delay in Axis 2 and Axis 4 start
- (4) SSCNET makes the connection to the servo amplifier possible
- (a) The QD75 can be directly connected to the servo amplifier using the MELSERVO (Mitsubishi's servo amplifier: MR-H-BN, MR-H-BN4, MR-J2-B, MR-J2S-B, MR-J2-Jr, MR-J2M-B) and SSCNET.
  - (b) Because the SSCNET cable is used to connect the QD75 and the servo amplifier, or servo amplifiers, saving wiring can be realized. The cable between the QD75 and servo amplifier or servo amplifiers can be extended up to 30m.
  - (c) The servo parameters can be set on the QD75 side to write or read them to/from the servo amplifier using the SSCNET.
  - (d) The actual current value and error description contained in the servo can be checked by the buffer memory of the QD75.
- (5) Easy application to the absolute position system
- (a) The absolute position-corresponding servo amplifier is connected to have an application to the absolute position system.
  - (b) Once the OP have been established, the OPR operation can also be made unnecessary when the power is supplied.
  - (c) With the absolute position system, the data set method OPR is used to establish the OP.
  - (d) When the setting unit is "degree", the absolute position system with unlimited length feed can be configured.



- (6) **Control can be realized with the mechanical system input**  
The external inputs, such as external start, stop, and speed/position switching is used to perform the positioning control without using the PLC program.
- (7) **Easy maintenance**  
Each QD75 positioning module incorporates the following improvements in maintainability:
  - (a) Data such as the positioning data and parameters can be stored on a flash ROM inside the QD75, eliminating the need of a battery for retaining data. (Refer to Section 7.1.1.)
  - (b) Error messages are classified in more detail to facilitate the initial troubleshooting procedure. (Refer to Section 15.1.)
  - (c) The module retains 16 error messages and 16 warning messages recently output, offering more complete error and warning histories. (Refer to Section 5.6.1.)
- (8) **Support of intelligent function module dedicated instructions**  
Dedicated instructions such as the positioning start instruction, and teaching instruction are provided.  
The use of such dedicated instruction simplifies PLC programs.(Refer to Chapter 14.)
- (9) **Setups, monitoring, and testing through GX Configurator-QP**  
Using GX Configurator-QP, the user can control the QD75 parameters and positioning data without having to be conscious of the buffer memory addresses. Moreover, GX Configurator-QP has a test function which allows the user to check the wiring before creating a PLC program for positioning control, or test operation the QD75 using created parameters and positioning data for checking their integrity.  
The control monitor function of GX Configurator-QP allows the user to debug programs efficiently.

1.1.2 Purpose and applications of positioning control

"Positioning" refers to moving a moving body, such as a workpiece or tool (hereinafter, generically called "workpiece") at a designated speed, and accurately stopping it at the target position. The main application examples are shown below.

**■ Punch press (X, Y feed positioning)**

Y axis servomotor, Gear and ball screw, X axis, Y axis, 320mm, 160mm, 15m/min (2000r/min), Press punching 12s, 15m/min (1875r/min), Press head, X axis Gear and rack & pinion, PLC MELSEC-Q QD75, X axis servomotor, Servo amplifier, Y axis, X axis

- € To punch insulation material or leather, etc., as the same shape at a high yield, positioning is carried out with the X axis and Y axis servos.
- € After positioning the table with the X axis servo, the press head is positioned with the Y axis servo, and is then punched with the press.
- € When the material type or shape changes, the press head die is changed, and the positioning pattern is changed.

**■ Palletizer**

Conveyor control, Conveyor, Servomotor (with brakes), Servo amplifier, Reduction gears, Ball screw (From QD75), Position detector, Palletizer, Unloader control, PLC MELSEC-Q QD75

- € Using the servo for one axis, the palletizer is positioned at a high accuracy.
- € The amount to lower the palletizer according to the material thickness is saved.

**■ Compact machining center (ATC magazine positioning)**

Servomotor, Coupling, Reduction gears, ATC tool magazine, Positioning pin, Tool (12 pcs., 20 pcs.), Servo amplifier, PLC MELSEC-Q QD75

Rotation direction for calling 11, 12, 1, 2 or 3  
 Rotation direction for calling 17 to 20, 1 to 5  
 Current value retrieval position  
 Current value retrieval position  
 Rotation direction for calling 5, 6, 7, 8, 9 or 10  
 Rotation direction for calling 7 to 16

<No. of tools: 12>      <No. of tools: 20>

- € The ATC tool magazine for a compact machining center is positioned.
- € The relation of the magazine's current value and target value is calculated, and positioning is carried out with forward run or reverse run to achieve the shortest access time.

**■ Lifter (Storage of Braun tubes onto aging rack)**

€ During the aging process of Braun tubes, storage onto the rack is carried out by positioning with the AC servo.

€ The up/down positioning of the lifter is carried out with the 1-axis servo, and the horizontal position of the aging rack is positioned with the 2-axis servo.

**■ Index table (High-accuracy indexing of angle)**

€ The index table is positioned at a high accuracy using the 1-axis servo.

**■ Inner surface grinder**

€ The grinding of the workpiece's inner surface is controlled with the servo and inverter.

€ The rotation of the workpiece is controlled with the 1-axis inverter, and the rotation of the grinding stone is controlled with the 2-axis inverter. The workpiece is fed and ground with the 3-axis servo.

220VAC 60Hz


PLC MELSEC-Q QD75

Operation panel

- a. Total feed amount (σm)
- b. Finishing feed amount (σm)
- c. Compensation amount (σm)
- d. Rough grinding speed (σm/s)
- e. Fine grinding speed (σm/s)

1.1.3 Mechanism of positioning control

In the positioning system using the QD75, various software and devices are used for the following roles. The QD75 realizes complicated positioning control when it reads in various signals, parameters and data and is controlled with the PLC CPU.

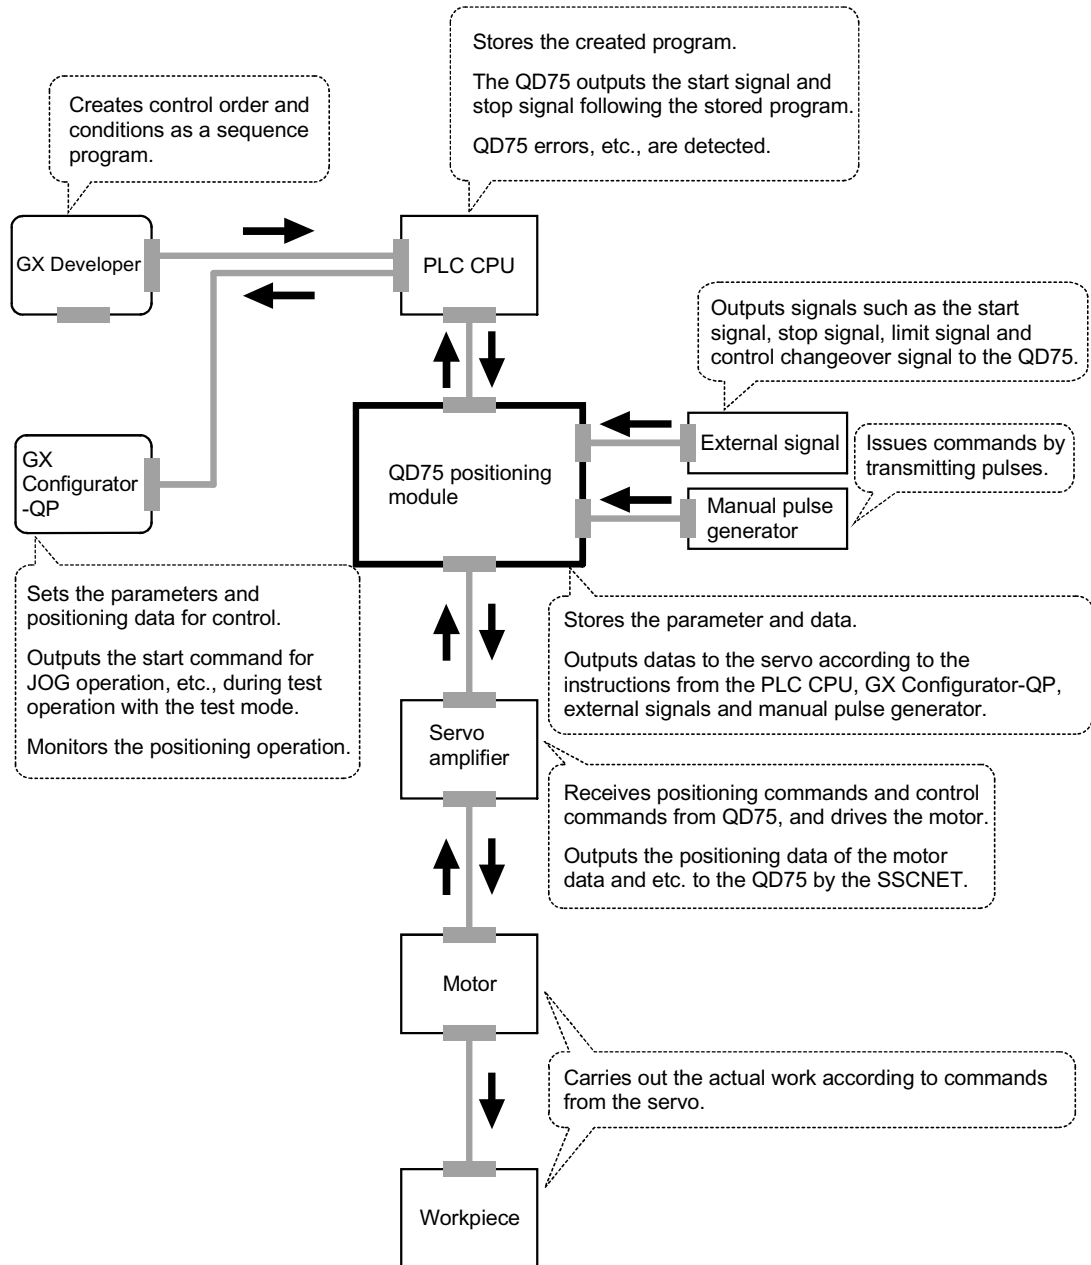

(Note): For QD75M1, 2 and 4, use SW2D5C-QD75P or later of the GX Configurator.

1.1.4 Overview of positioning control functions

The outline of the "overview of positioning control" and "overview of individual positioning control and continuous positioning control", "overview of block positioning control" and "overview of acceleration/deceleration processing control" is shown below.

■ Positioning control

An overview of positioning using positioning data described below.

(1) Linear control

(a) 1-axis linear control


This performs positioning from the start point address (location the axis is presently stopped) defined on the specified axis to the specified position.

[Control using the absolute system]

- 1) This performs positioning from the start point address to the specified position.
- 2) The start point address and the specified address determine the movement direction.

[Example]

The following figure shows the operations when the start point address is 5000 and the positioning address are 2000 and 8000:

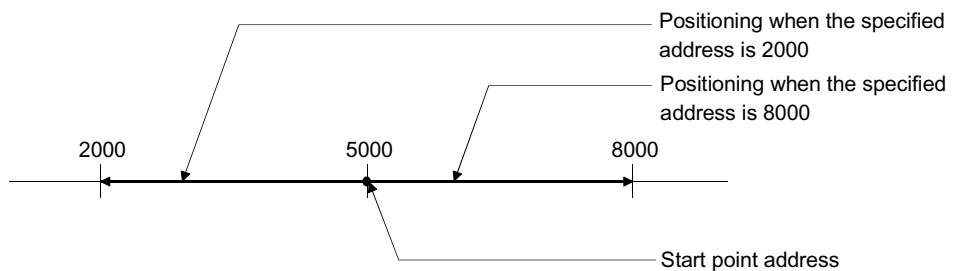


[Control using the increment system]

- 1) This performs positioning from the specified increment of travel from the start point address.
- 2) The sign of the travel increment determines the direction of travel.
  - For positive travel increment.....Positioning in the positive direction (direction of address increase)
  - For negative travel increment.....Positioning in the negative direction (direction of address decrease)

[Example]

The following figure shows the operations when the start point address is 5000 and the travel increments are 3000 and -3000:

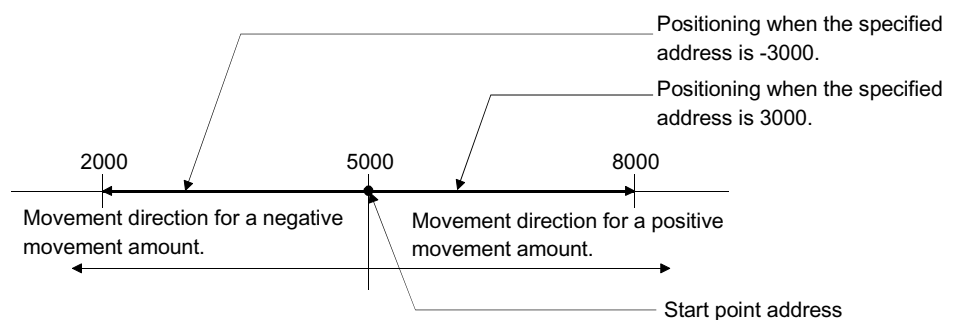

(b) 2-axis linear interpolation control <sup>(Note)</sup>


This controls interpolation along a linear locus from the start point address (current stop position) defined by two axes.

[Control using the absolute system]

- 1) This performs linear interpolation using two axes from the start point address to the endpoint address.
- 2) The start point address and the specified address determine the direction of travel.

[Example]

The operation when the start point address is 800 for axis 1 and 2000 for axis 2 and the positioning address specified to 2000 for axis 1 and 8000 for axis 2, is shown below.

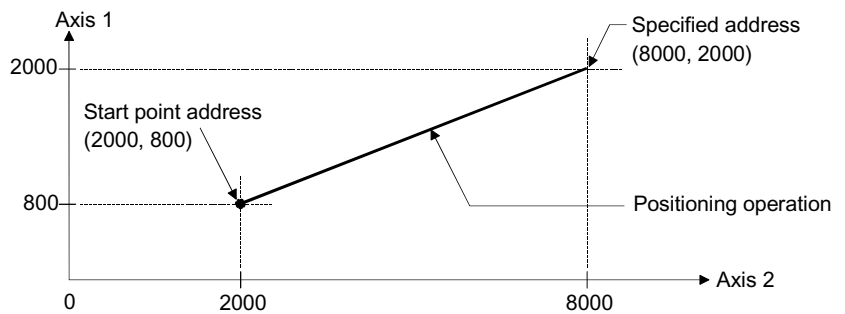


[Control using the increment system]

- 1) This performs positioning from the specified increment of travel from the start point address.
  - For positive travel increment.....Positioning in the positive direction (direction of address increase)
  - For negative travel increment.....Positioning in the negative direction (direction of address decrease)
- 2) The sign of the travel increment determines the direction of travel.

[Example]

The operation when the start point address is 800 for axis 1 and 2000 for axis 2 and the positioning address specified to 1200 for axis 1 and 6000 for axis 2, is shown below.

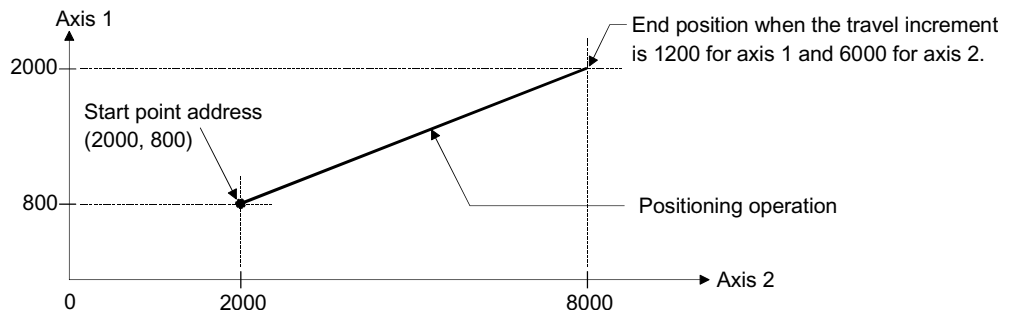

**REMARK**

(Note): The interpolation speed during linear interpolation control can be selected from "synthesized axis" and "reference-axis speed" using the detailed parameter 1. (Refer to the Section 5.2.3 information about setting "Pr.20 Interpolation speed designation method" of the detailed parameter 1.)


(2) Circular interpolation control <sup>(Note)</sup>

There are two types of circular interpolation controls: circular interpolation with a specified sub point and circular interpolation with the specified center point.

(a) Circular interpolation with a specified sub point

Circular interpolation is performed using the specified endpoint address and sub point (passing point) address.

Two methods are available: absolute system and increment system.

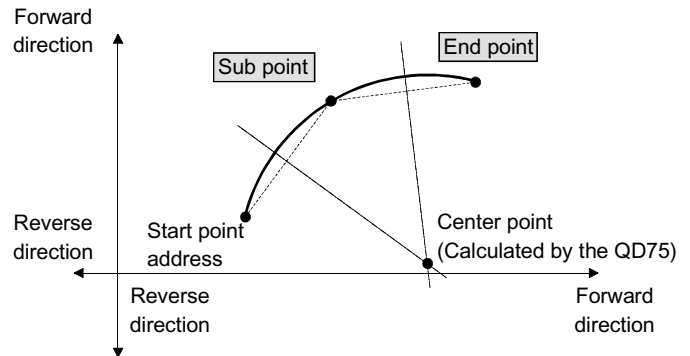


(b) Circular interpolation with the specified center point

Circular interpolation is performed using the specified endpoint address and center point address.

Two methods are available: absolute system and increment system.

Also, the direction of movement can be selected from clockwise or counterclockwise.

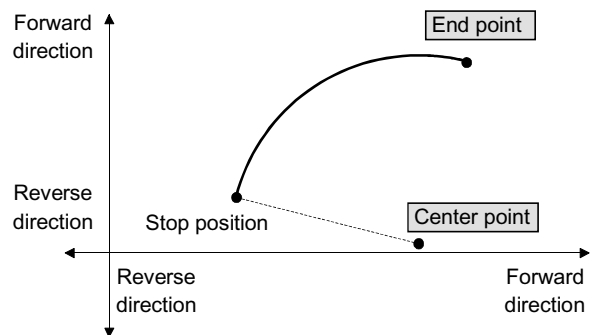


**REMARK**

(Note): The interpolation speed during circular interpolation control may only be set to "synthesized speed" for the interpolation speed of the detailed parameter 1. (Refer to the Section 5.2.3 information about setting "Pr.20 Interpolation speed designation method" of the detailed parameter 1.)


(3) Fixed-feed control

This performs positioning for the specified increment of travel. The fixed-feed control includes 1-axis control and 2-axis control through linear interpolation using the specified two axes.

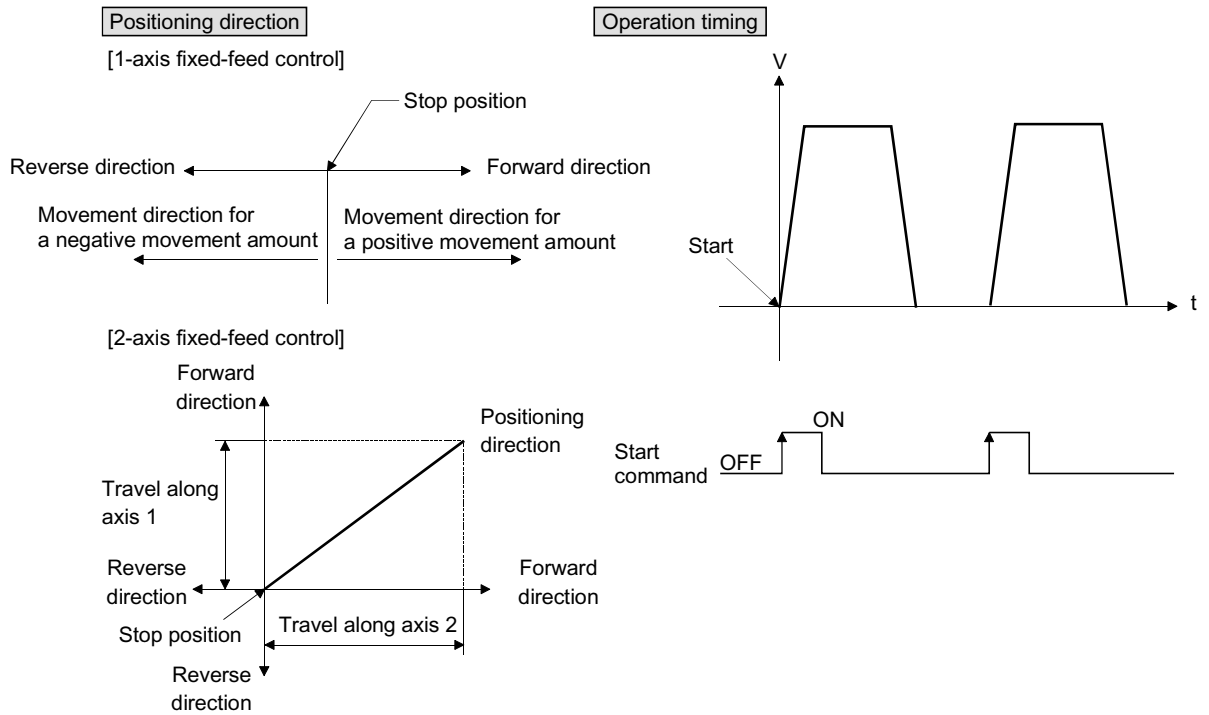

(4) Speed control


After command is executed, control continues with the command speed until the stop command is input.

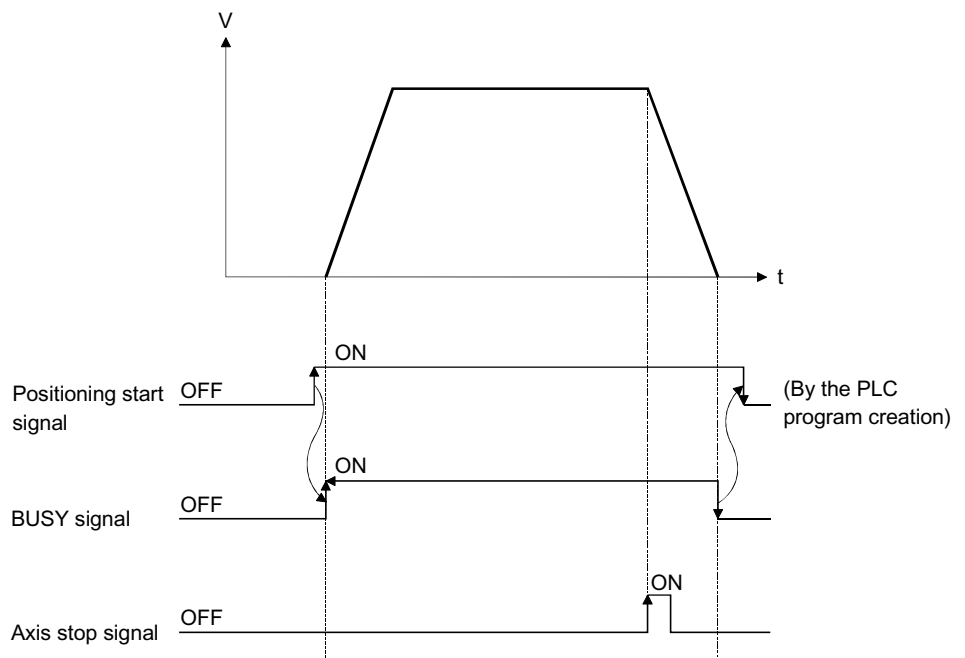



(5) Speed-position switching control

This starts positioning under speed control, and switches to position control according to the input of the QD75 speed-position switching signal and perform positioning for the specified increment of travel.

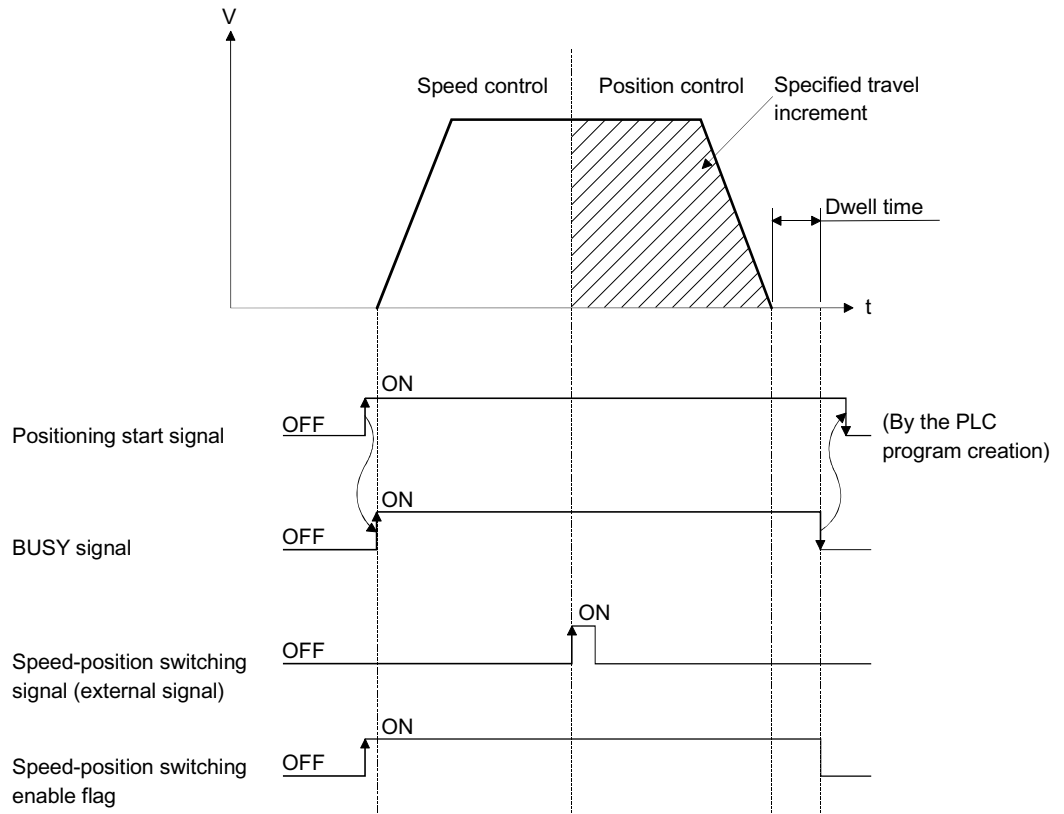

■ Individual positioning control and continuous positioning control


The QD75 performs positioning according to the user-set positioning data, which is a set of information comprised of the control method (position control, speed control, speed-position switching control), positioning address, operation pattern, and so on. Up to 600 of positioning data are assigned respectively to positioning data Nos. 1 to 600 per axis and registered to the QD75.

The operation pattern set in each positioning data by the user determines whether to perform positioning operation with one positioning data item or to perform continuous positioning operation with multiple positioning data items.

(1) Independent positioning control (operation pattern = 00: positioning complete)

The operation completed upon completion of positioning for the specified positioning data. The positioning completion of this operation pattern is also used as the operation pattern for the last positioning data of continuous positioning and continuous-locus positioning.


The operation when the start point address is 5000 and the positioning address specified to 2000 and 8000.

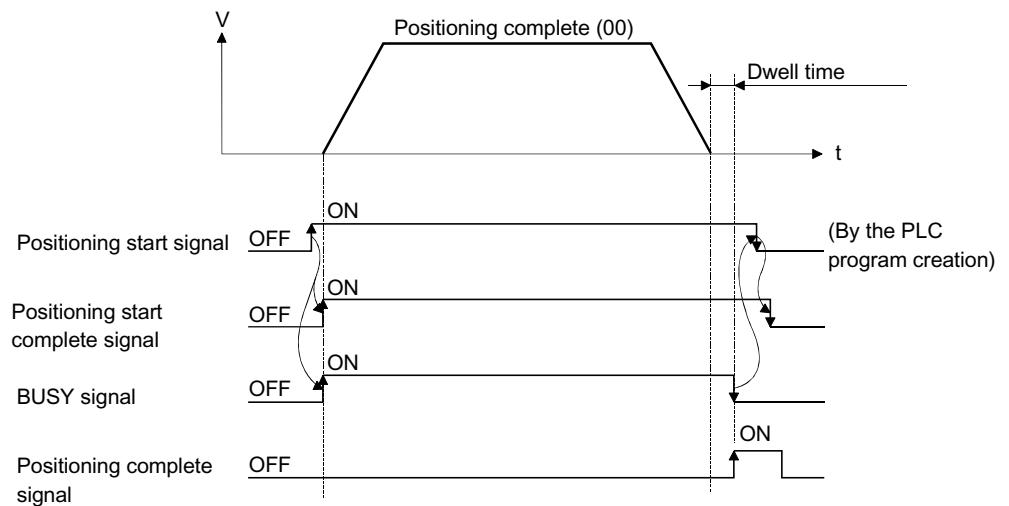

(2) Continuous positioning control (operation pattern = 01: positioning continues)

The operation stops temporarily upon the completion of positioning for the specified positioning data, and then continues with the next positioning data number.


This is specified when performing positioning in which the direction changes because of multiple positioning data items having consecutive positioning data numbers.

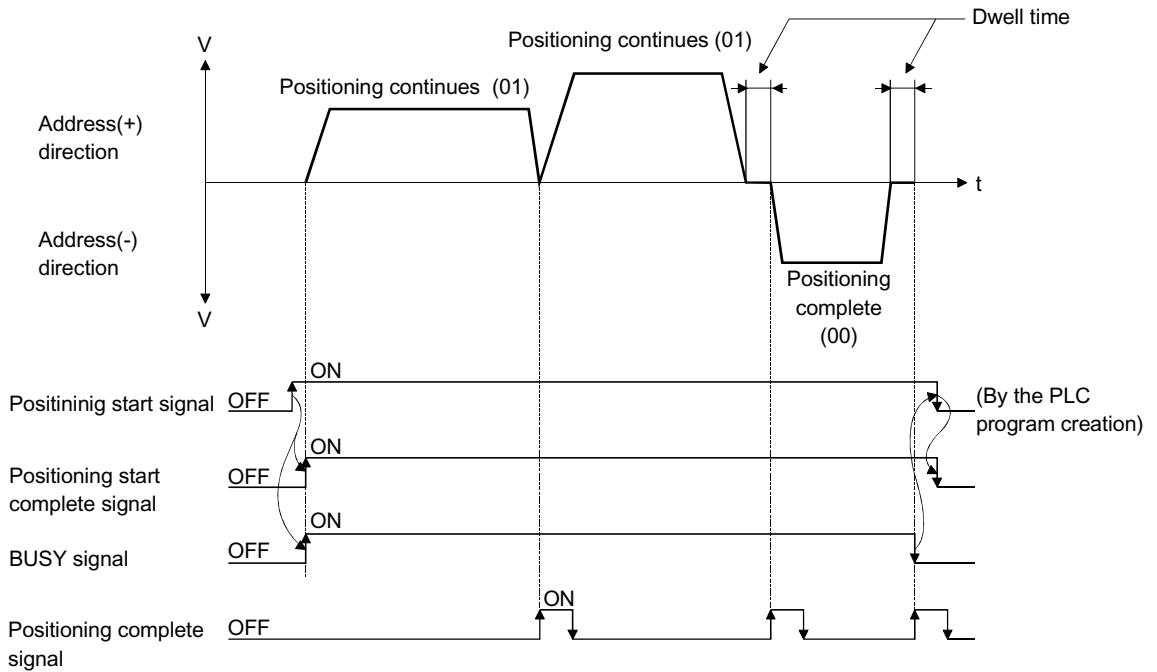

(3) Continuous path control (operation pattern = 11: positioning continue)

After executing positioning using the specified positioning data, the operation changes its speed to that of the next positioning data number and continues positioning.

This is specified when continuously executing multiple positioning data items having consecutive positioning data numbers at a specified speed.

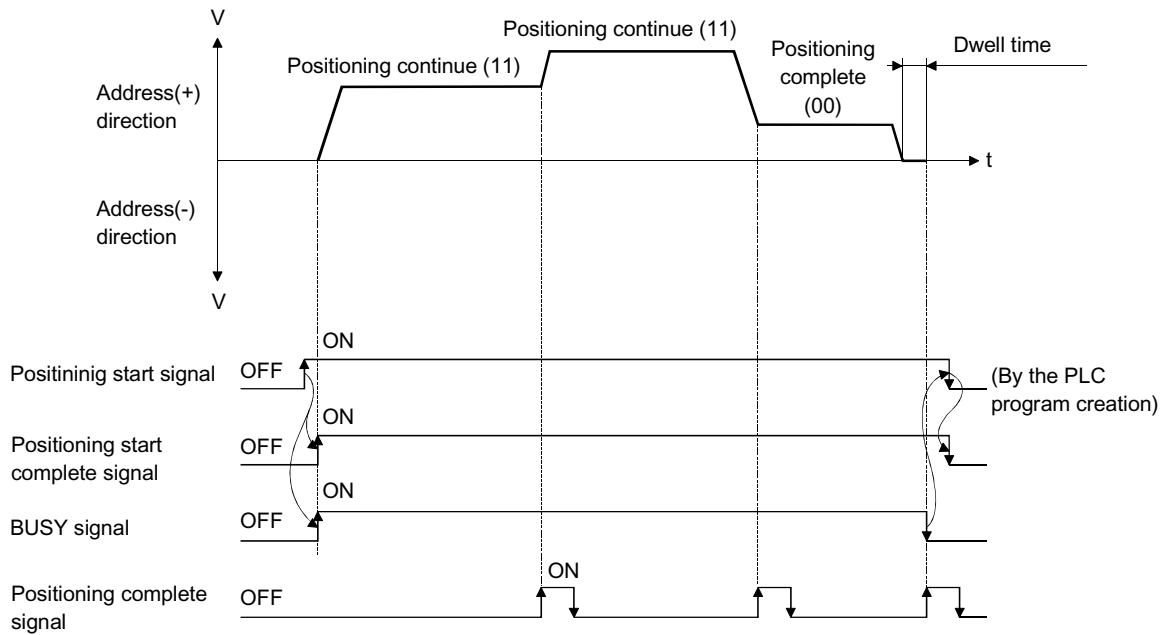


■ Block positioning control

Block positioning is a control that continuously executes the positioning of specified blocks. One block equivalent to a series of positioning data up to the completion of positioning (operation pattern = 00) by Independent or continuous positioning control. A maximum of 50 blocks per axis can be specified.

Using a one-time start command from the QCPU or external, complex positioning control can be performed.

The block positioning control can be performed by specifying the positioning start number and positioning start information in the buffer memory.

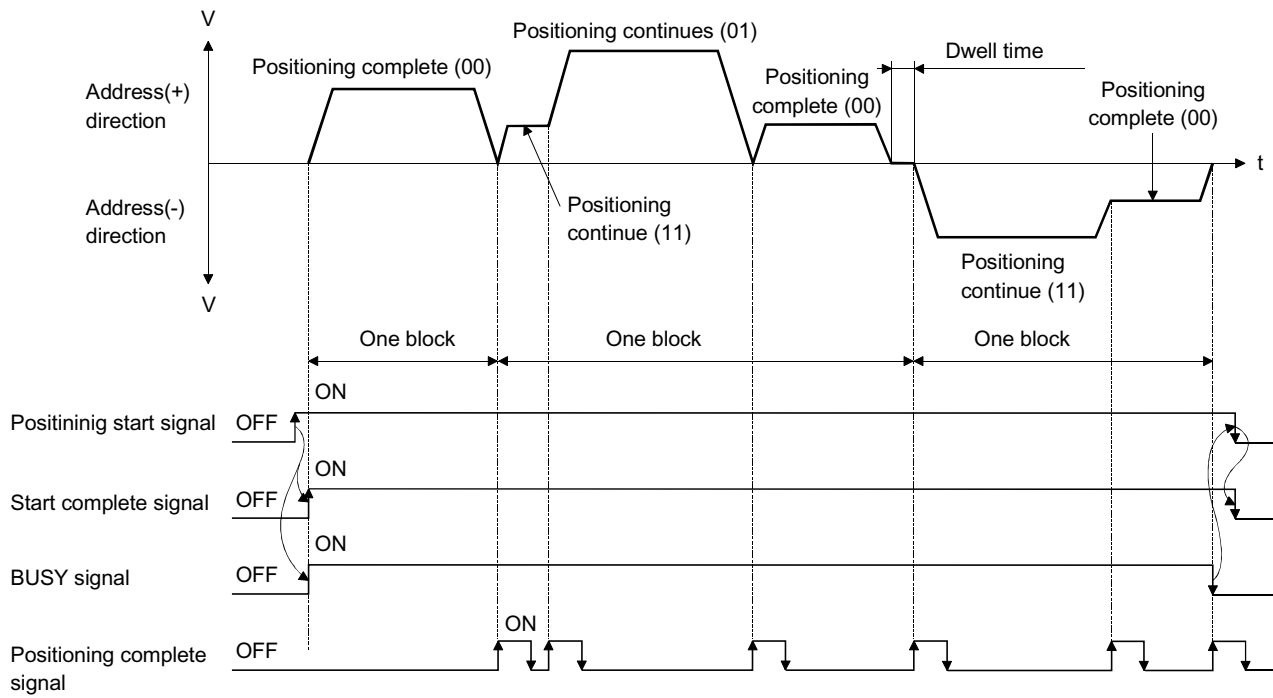

## ■ Overview of acceleration/deceleration processing control


Acceleration/deceleration processing for the positioning processing, manual pulse-generator processing, OPR processing and JOG processing is performed using the user-specified method, acceleration time and deceleration time.

### (1) Acceleration/deceleration method

There are two types of acceleration and deceleration processing: the automatic trapezoidal acceleration/deceleration processing method and S-pattern acceleration/deceleration processing method. A detailed parameter is used to set which method is used. The specified acceleration/deceleration method is applied to all accelerations and decelerations when starting and completing positioning processing, OPR processing and JOG processing, as well as when changing the speed.


#### (a) Automatic trapezoidal acceleration/deceleration processing method

This is a method in which linear acceleration/deceleration is carried out based on the acceleration time, deceleration time, and speed limit value set by the user.

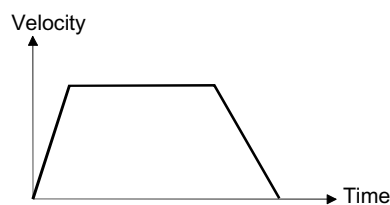

#### (b) S-pattern acceleration/deceleration processing method

This method reduces the load on the motor when starting and stopping. This is a method in which acceleration/deceleration is carried out gradually, based on the acceleration time, deceleration time, speed limit value, and "Pr.35 S-pattern proportion" (1 to 100%) set by the user.

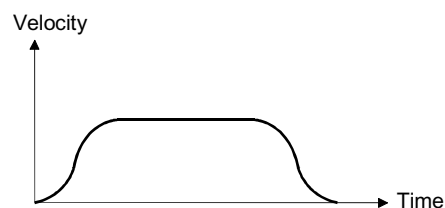

### (2) Acceleration time, deceleration time, sudden-stop deceleration time

(a) For types each of the acceleration time and deceleration time for positioning control can be set using basic parameters 2 and detailed parameters 2.

- Acceleration time.....The time elapses before the speed of 0 reaches the limit value.
- Deceleration time.....The time elapses before the speed at the limit value reaches 0.

(b) The sudden-stop deceleration time (1 to 8388608 ms) is set using the acceleration time/deceleration time setting size selection of detailed parameters 2.

1.1.5 Outline design of positioning system

The outline of the positioning system operation and design, using the QD75, is shown below.

(1) Positioning system using QD75


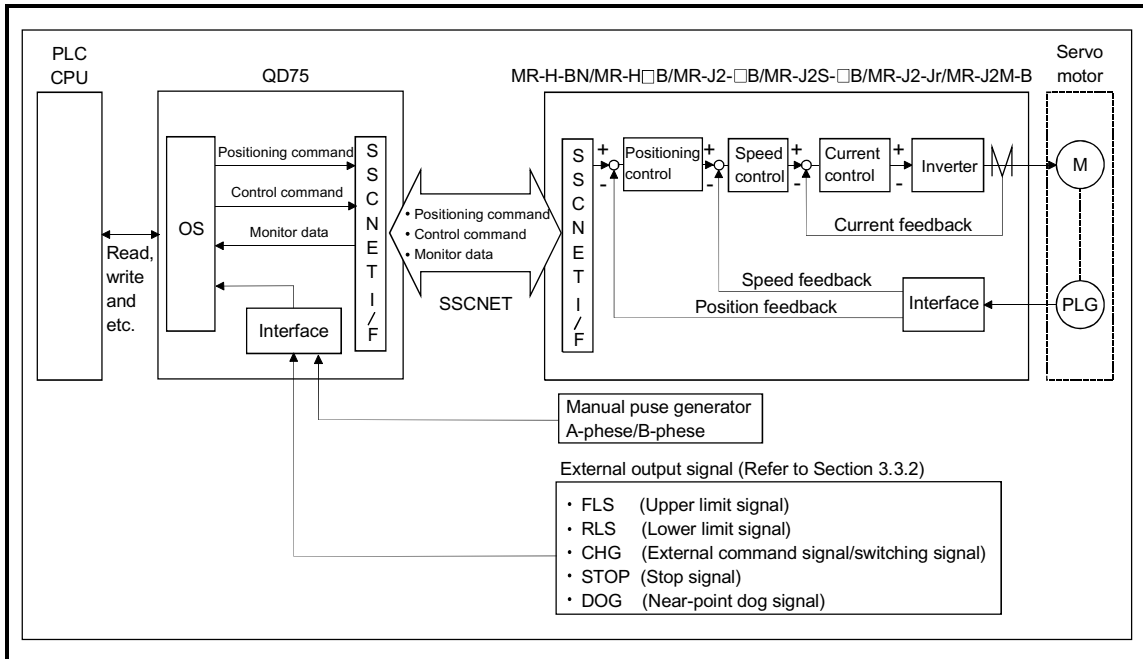


Fig. 1.2 Outline of the operation of positioning system using QD75

1.1.6 Communicating signals between QD75 and each module

The outline of the signal communication between the QD75 (positioning module) and PLC CPU, peripheral device and servo amplifier, etc., is shown below.  
 (A peripheral device communicates with the QD75 via the PLC CPU to which it is connected)



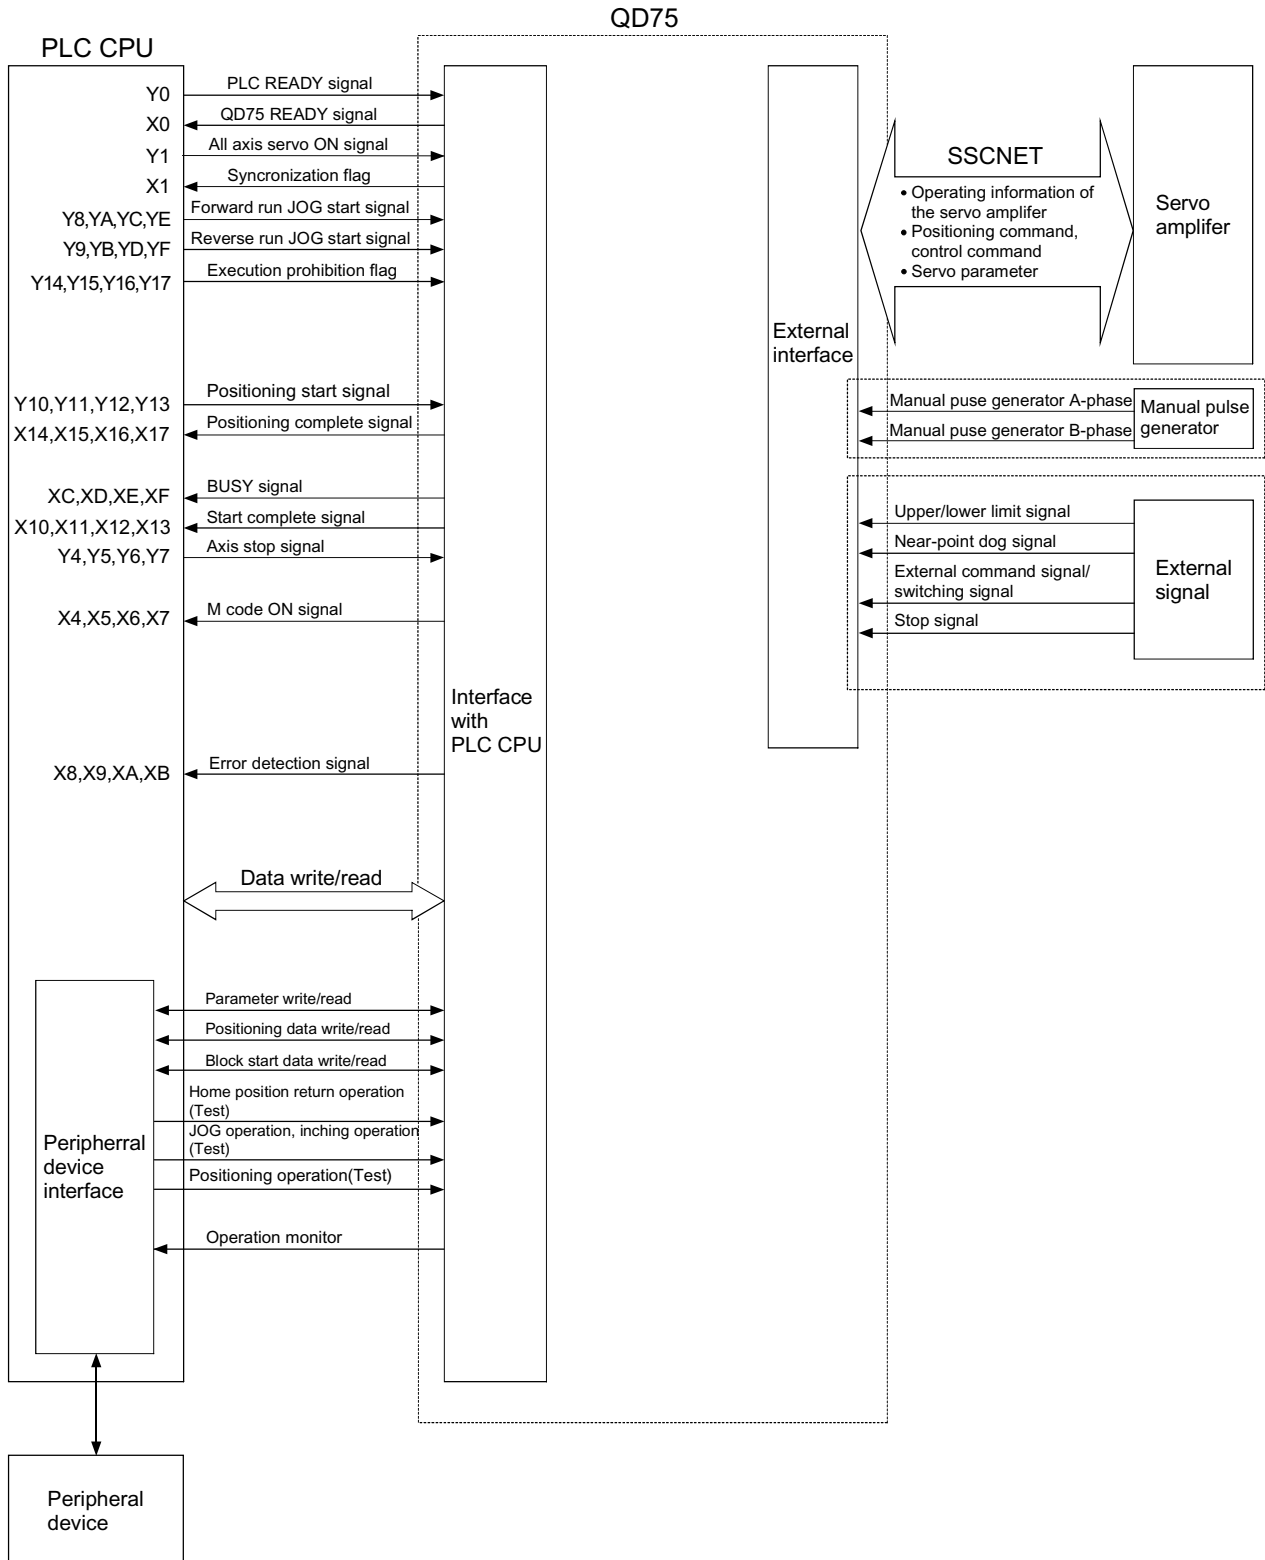

■ QD75 ↔ PLC CPU

The QD75 and PLC CPU communicate the following data via the base unit.

Direction Communication	QD75 → PLC CPU	PLC CPU → QD75
Control signal *	Signal indicating QD75 state • QD75 READY signal • BUSY signal and etc.	Signal related to commands • PLC READY signal • Various start signals • Stop signals • All axis servo ON signal and etc.
Data (read/write)	• Parameter • Positioning data • Block start data • Control data • Monitor data	• Parameter • Positioning data • Block start data • Control data

\* Refer to Section 3.3 "Specifications of input/output signals with PLC CPU" for details.

■ QD75 ↔ Peripheral device

The QD75 and peripheral device communicate the following data via the PLC CPU:

Direction Communication	QD75 → Peripheral device	Peripheral device → QD75
Data (read/write)	• Parameter • Positioning data	• Parameter • Positioning data
Test operation	-	• OPR control start command • Positioning control start command • JOG/Inching operation start command • Teaching start command • Manual pulse generator operation enable/disable command
Operation monitor	• Monitor data	-

■ QD75 ↔ Servo amplifier

The QD75 and servo amplifier communicate the following data via the SSCNET.

Direction Communication	QD75 → Servo amplifier	Servo amplifier → QD75
SSCNET	• Positioning commands • Control commands • Servo parameter	• Operating information of the servo amplifier • Servo parameter

■ QD75 ↔ Manual pulse generator

The QD75 and manual pulse generator communicate the following data via the external device connection connector.

(The manual pulse generator should be connected to an external device connection connector for axis 1 or for axes 1 and 2.)

Direction Communication	QD75 → Manual pulse generator	Manual pulse generator → QD75
Pulse signal	–	<ul style="list-style-type: none"> <li>• Manual pulse generator A-phase</li> <li>• Manual pulse generator B-phase</li> </ul>

■ QD75 ↔ External signal


The QD75 and external signal communicate the following data via the external device connection connector.

Direction Communication	QD75 → External signal	External signal → QD75
Control signal	–	<ul style="list-style-type: none"> <li>∄ Upper/lower limit signal</li> <li>∄ External command signal/switching signal</li> <li>∄ Stop signal</li> <li>∄ Near-point dog signal</li> </ul>

1.2 Flow of system operation

1.2.1 Flow of all processes

The positioning control processes, using the QD75, are shown below.

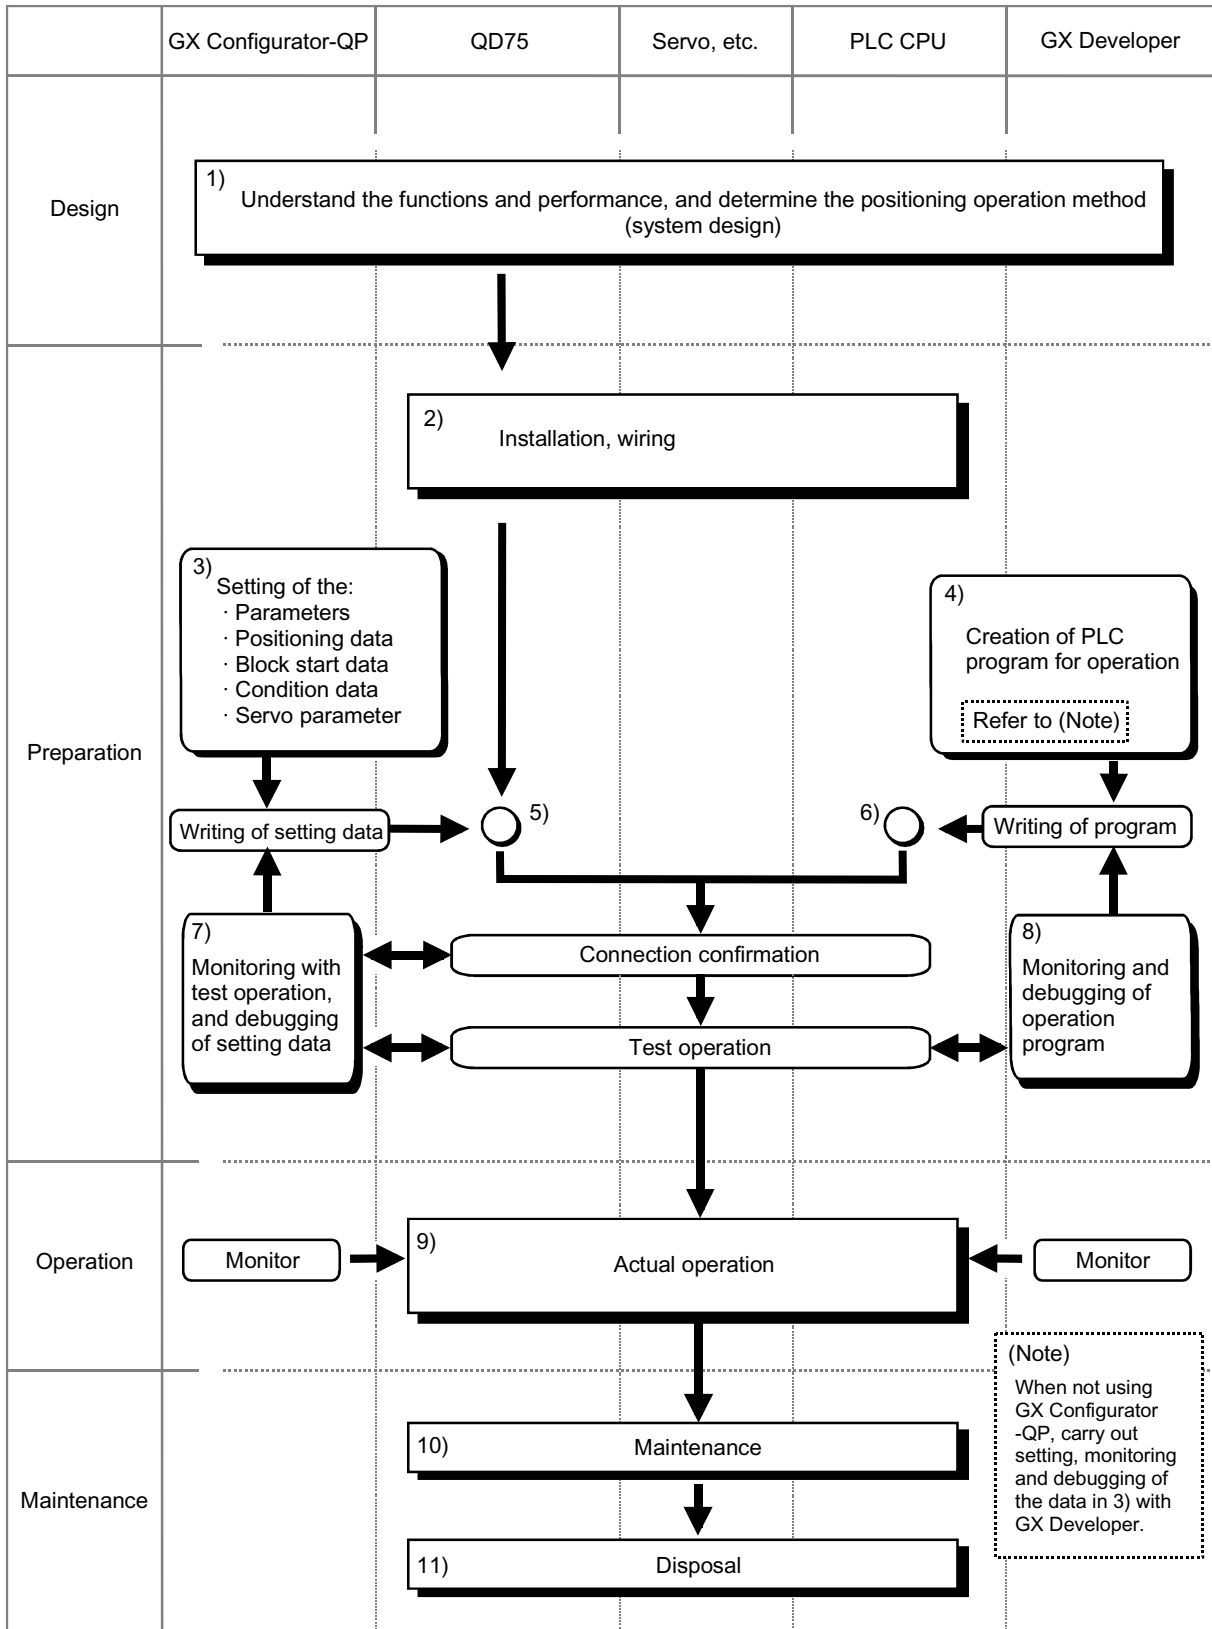


The following work is carried out with the processes shown on the previous page.

	Details	Reference
1)	Understand the product functions and usage methods, the configuration devices and specifications required for positioning control, and design the system.	€ Chapter 1 € Chapter 2 € Chapter 3 € Chapter 8 to Chapter 13
2)	Install the QD75 onto the base unit, wire the QD75 and external connection devices (drive unit, etc.).	€ Chapter 4
3)	Using GX Configurator-QP, set the parameter, servo parameters, positioning data, block start data and condition data required for the positioning control to be executed.	€ Chapter 5 € Chapter 8 to Chapter 13 € GX Configurator-QP Operating Manual
4)	Using GX Developer, create the PLC program required for positioning operation. (When not using GX Configurator-QP, also create the PLC program for setting data.)	€ Chapter 6 € GX Developer Operating Manual
5)	Write the parameters and positioning data, etc., created with GX Configurator-QP into the QD75.	€ Chapter 7 € GX Configurator-QP Operating Manual
6)	Using GX Developer, write the created PLC program into the PLC CPU. (When not using GX Configurator-QP, also write in the PLC program for setting data.)	€ Chapter 7 € GX Developer Operating Manual
7)	Carry out test operation and adjustments in the test mode to check the connection with the QD75 and external connection device, and to confirm that the designated positioning operation is executed correctly. (Debug the set "parameters" and "positioning data", etc.)	€ GX Configurator-QP Operating Manual € Chapter 13 € GX Developer Operating Manual
8)	Carry out test operation and adjustment to confirm that the designated positioning operation is executed correctly. (Debug the created PLC program. When not using GX Configurator-QP, also debug the set data.)	€ GX Developer Operating Manual
9)	Actually operate the positioning operation. At this time, monitor the operation state as required. If an error or warning occurs, remedy.	€ Chapter 5 € Chapter 15 € GX Configurator-QP Operating Manual € GX Developer Operating Manual
10)	Service the QD75 as required.	€ Chapter 4
11)	Dispose of the QD75.	€ Chapter 4


1.2.2 Outline of starting




The outline for starting each control is shown with the following flowchart.

\*It is assumed that each module is installed, and the required system configuration, etc., has been prepared.

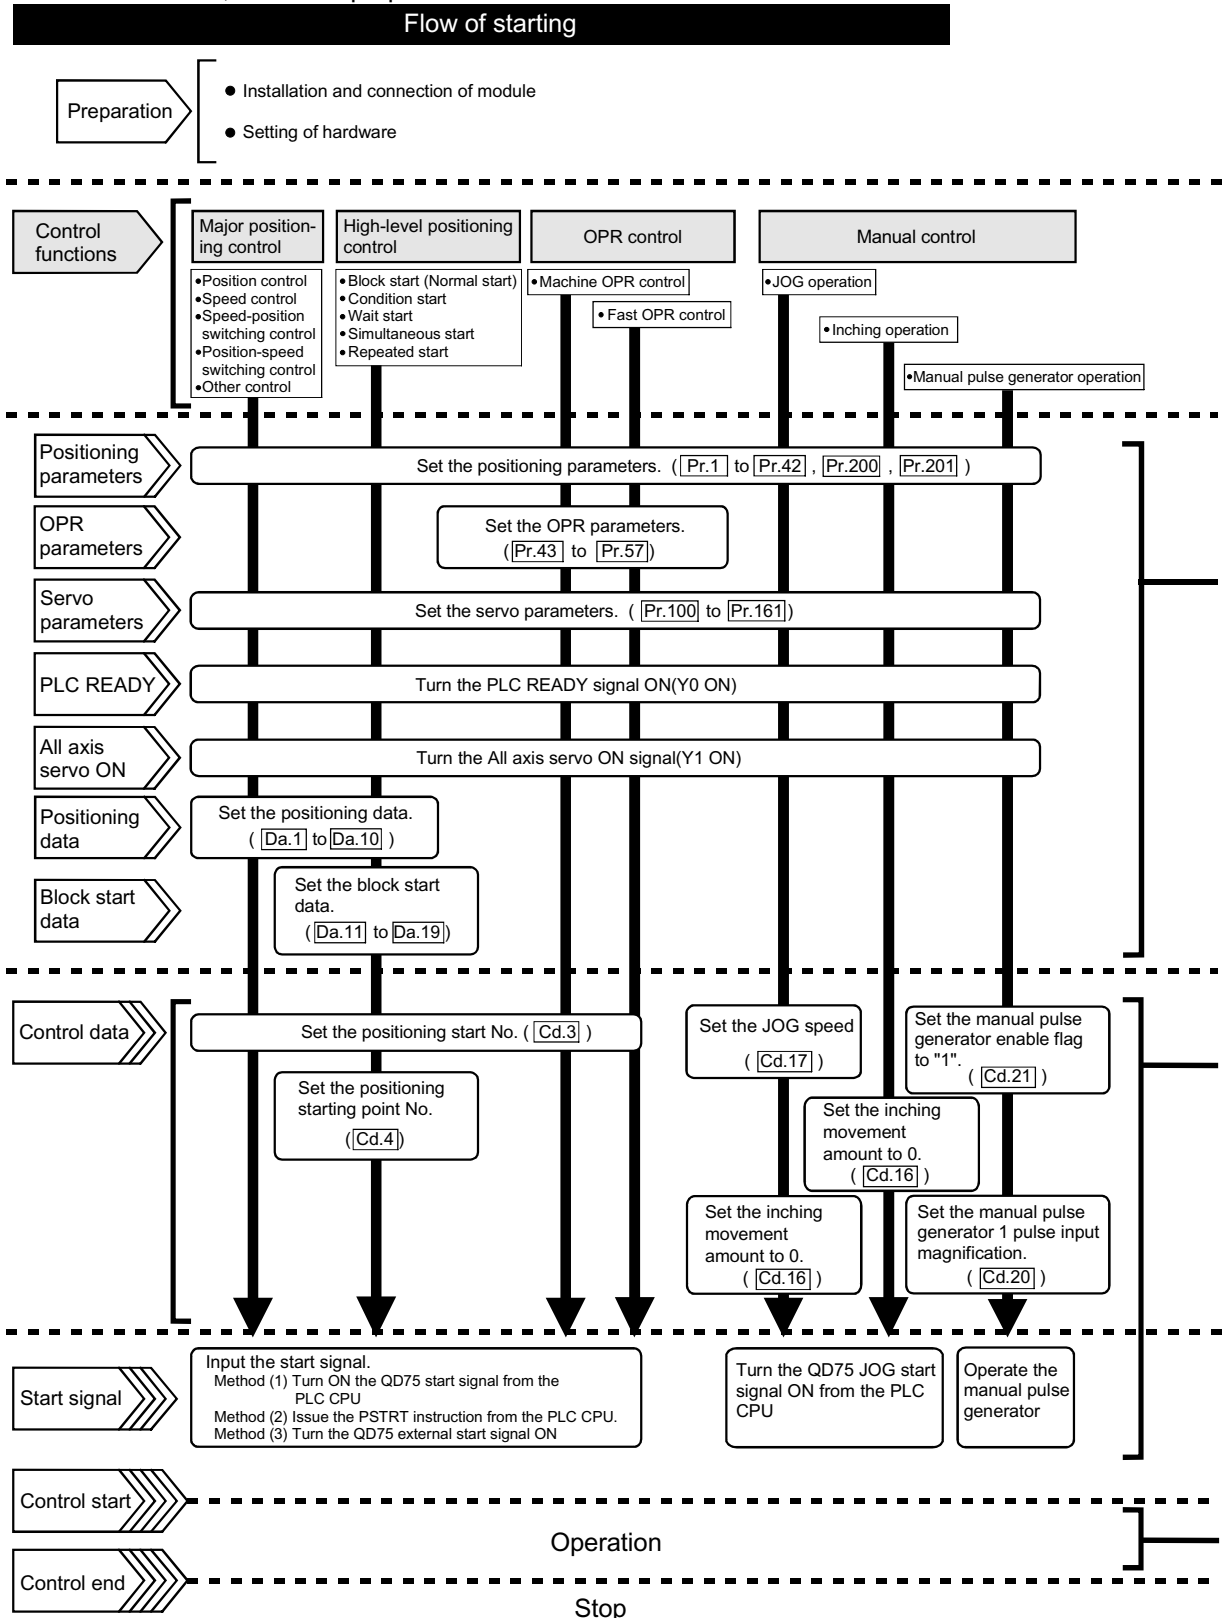

Setting method

 : Indicates the PLC program that must be created.

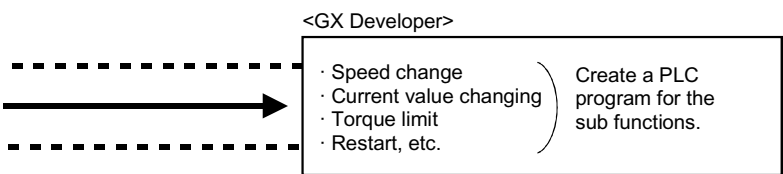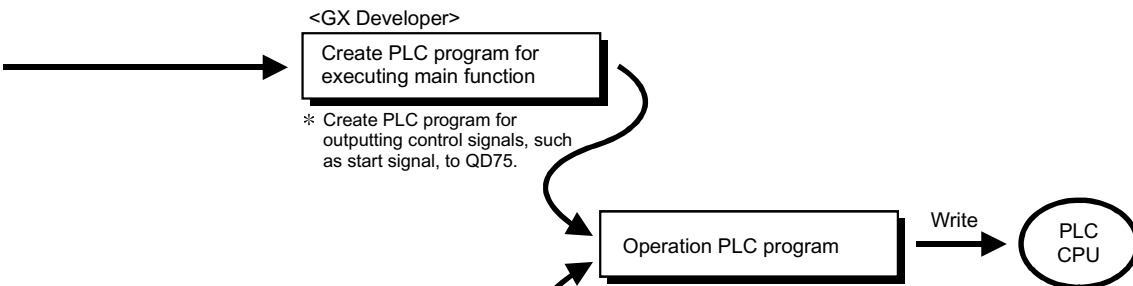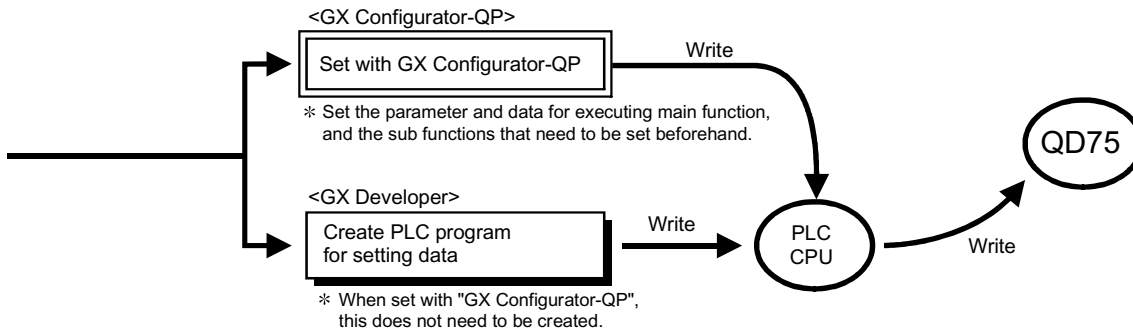

1.2.3 Outline of stopping

Each control is stopped in the following cases.

- (1) When each control is completed normally.
- (2) When the Servo READY signal is turned OFF.
- (3) When a PLC CPU error occurs.
- (4) When the PLC READY signal is turned OFF.
- (5) When an error occurs in the QD75.
- (6) When control is intentionally stopped (Stop signal from PLC CPU turned ON, stop signal from an external device, etc.).

The outline for the stopping process in these cases is shown below. (Excluding (1) for normal stopping.)

Stop cause		Stop axis	M code ON signal after stop	Axis operation status after stopping (Md.26)	Stop process					
					OPR control		Major positioning control	High-level positioning control	Manual control	
					Machine OPR control	Fast OPR control			JOG/Inching operation	Manual pulse generator operation
Forced stop	Servo READY OFF • Servo amplifier power supply OFF • Servo alarm • Emergency stop to the servo amplifier	Each axis	No change	During error	Servo OFF or free run (The operation stops with dynamic brake or electromagnetic brake.)					
Fatal stop (Stop group 1)	Hardware stroke limit upper/lower limit error occurrence	Each axis	No change	During error	Deceleration stop/sudden stop (Select with "Pr.37 Sudden stop group1 sudden stop selection" )					
Emergency stop (Stop group 2)	Error occurs in PLC CPU PLC READY signal OFF Error in test mode	All axes	No change Turns OFF No change	During error	Deceleration stop/sudden stop (Select with "Pr.38 Sudden stop group2 sudden stop selection" )					
Relatively safe stop (Stop group 3)	Axis error detection (Error other than stop group 1 or 2) "Stop signal" from peripheral device	Each axis	No change	During error	Deceleration stop/sudden stop (Select with "Pr.39 Sudden stop group3 sudden stop selection" )					
Intentional stop (Stop group 3)	"Stop signal" ON from external source "Axis stop signal" ON from PLC CPU	Each axis	No change	When stopped (While waiting)						

■ Reference

Provide the emergency stop circuits external to the servo system to prevent cases where danger may result from abnormal operation of the overall in the event of a power supply fault or servo system failure.

1.2.4 Outline for restarting

When a stop cause has occurred during operation with position control causing the axis to stop, positioning to the end point of the positioning data can be restarted from the stopped position by using the "Cd.6 Restart command".


If issued during a continuous positioning or continuous path control operation, the restart command will cause the positioning to be re-executed using the current position (pointed by the positioning data No. associated with the moment when the movement was interrupted) as the start point.

■ When "Cd.6 Restart command" is ON

- (1) If the "Md.26 Axis operation status" is stopped, positioning to the end point of the positioning data will be restarted from the stopped position regardless of the absolute system or incremental system.
- (2) When "Md.26 Axis operation status" is not stopped, the warning "Restart not possible" (warning code: 104) will be applied, and the restart command will be ignored.

[Example for incremental system]

- (a) The restart operation when the axis 1 movement amount is 300, and the axis 2 movement amount is 600 is shown below.

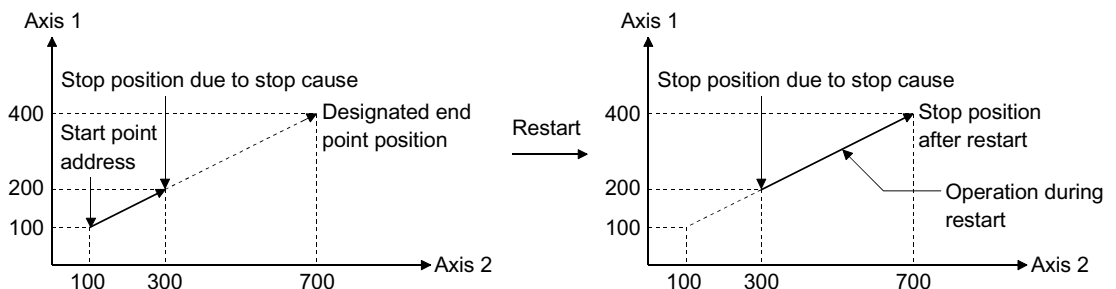


■ Reference

If the positioning start signal [Y10 to Y13]/external command signal\* is turned ON while the "Md.26 Axis operation status" is waiting or stopped, positioning will be restarted from the start of the positioning start data regardless of the absolute system or incremental system. (\*: When the external command signal is set to "External positioning start")  
(Same as normal positioning.)



[Example for incremental system]

(a) The positioning start operation when the axis 1 movement amount is 300 and the axis 2 movement amount is 600 is shown below.

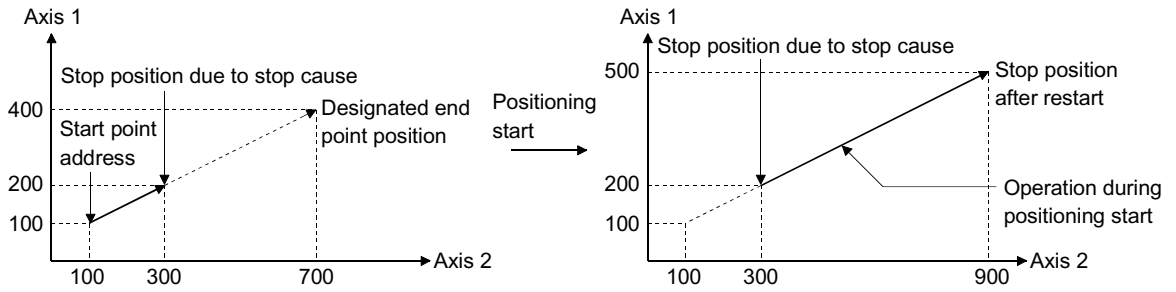

# Chapter 2 System Configuration


In this chapter, the general image of the system configuration of the positioning control using QD75, the configuration devices, applicable CPU and the precautions of configuring the system are explained.  
Prepare the required configuration devices to match the positioning control system.

- 2.1 General image of system .....2- 2
- 2.2 Component list.....2- 4
- 2.3 Applicable system.....2- 6
- 2.4 How to check the function version and SERIAL No. ....2- 8

2.1 General image of system


The general image of the system, including the QD75, PLC CPU and peripheral devices is shown below.

(The Nos. in the illustration refer to the "No." in Section 2.2 "Component list".

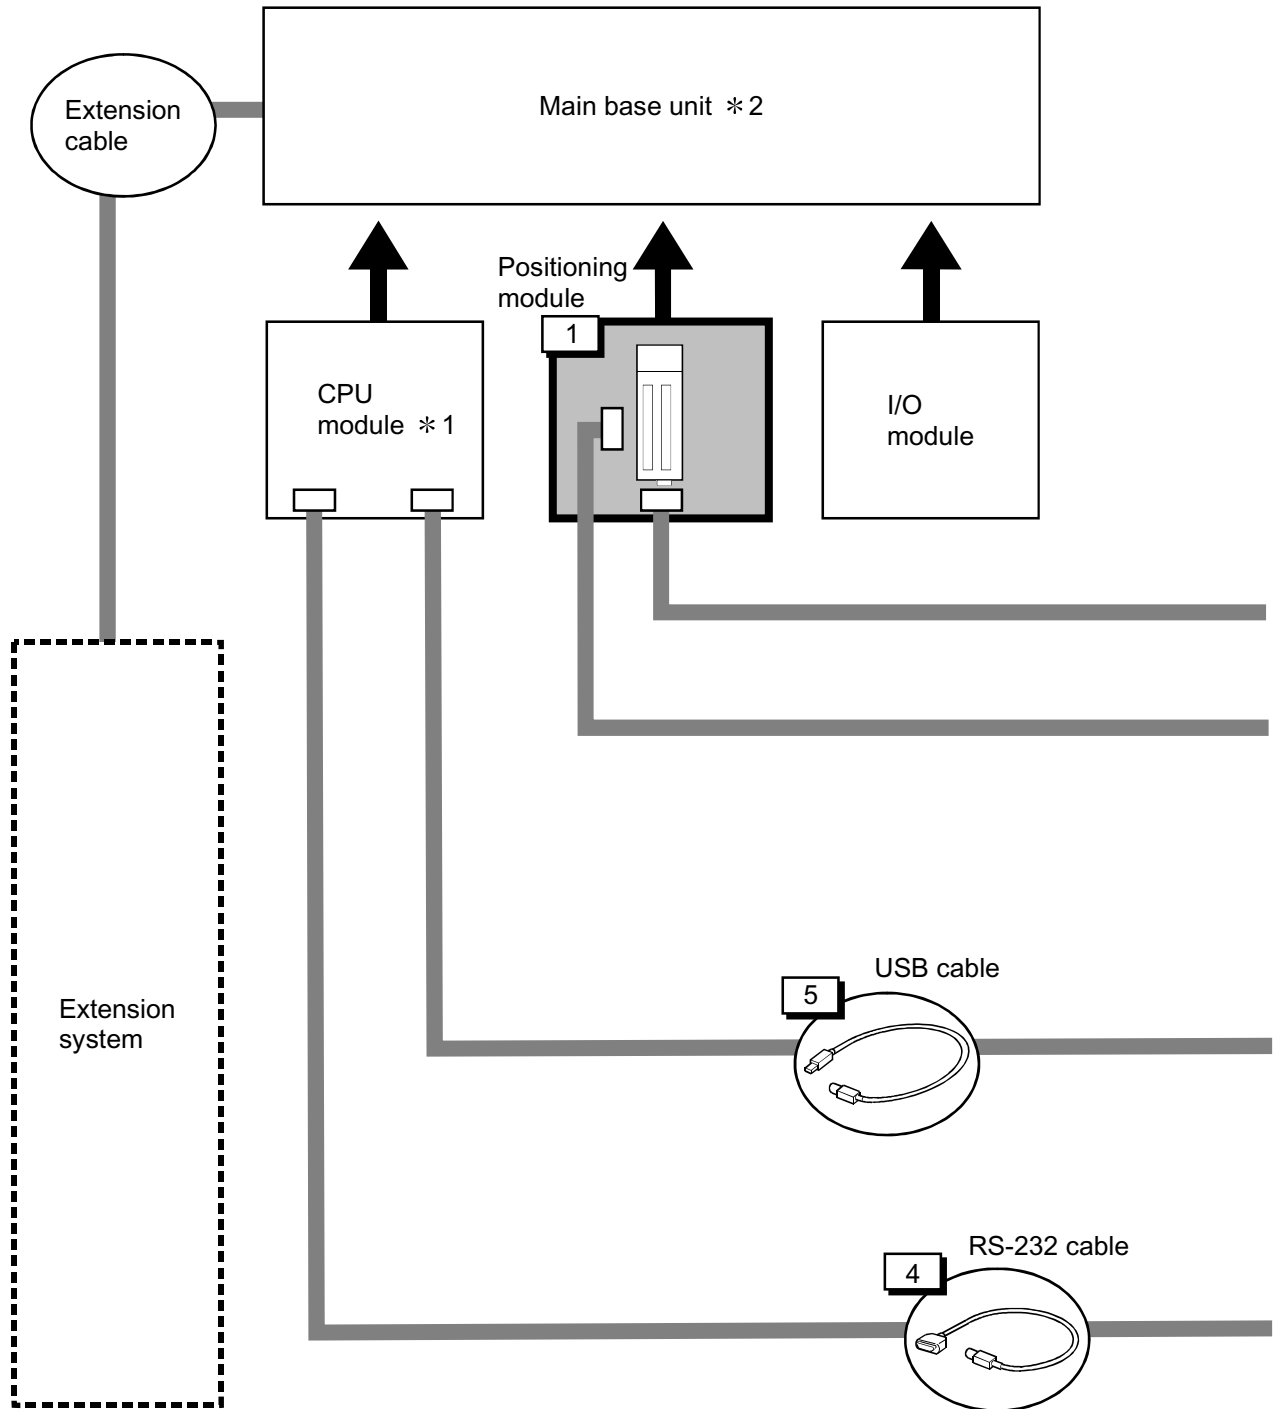


**REMARK**

- \*1 Refer to Section "2.3 Applicable system" for the CPU modules that can be used.
- \*2 Refer to the CPU module User's Manual for the base units that can be used.
- \*3 For the items with ÿ , use the software package of "2" or later.

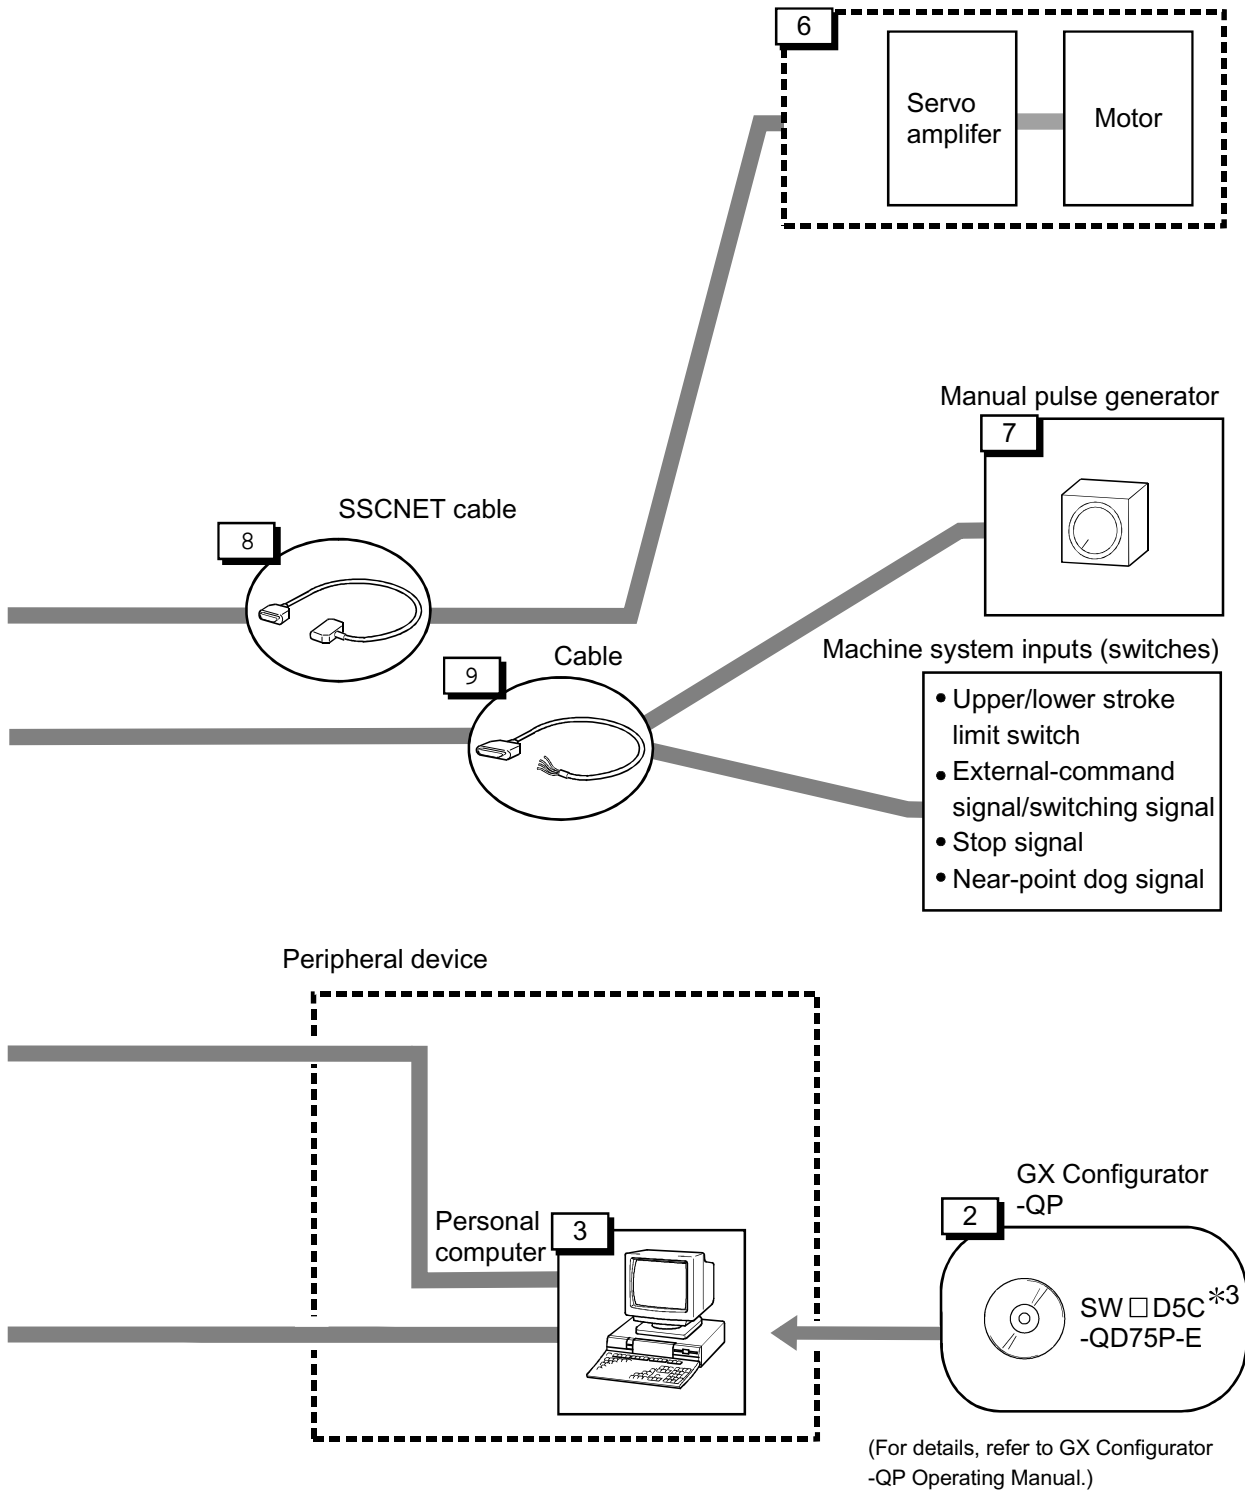

2.2 Component list

The positioning system using the QD75 is configured of the following devices.

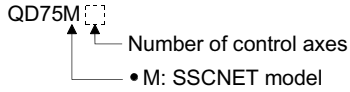No.	Part name	Type	Remarks
1	Positioning module	QD75M1 QD75M2 QD75M4	
2	GX Configurator-QP	SWD5C-QD75P-E	Refer to GX Configurator-QP Operating Manual for details.
3	Personal computer	DOS/V personal computer	(Prepared by user) Refer to GX Configurator-QP Operating Manual for details.
4	RS-232 cable	QC30R2	(Prepared by user) An RS-232 cable is needed for connecting the CPU module with a personal computer (DOS/V). For details, refer to GX Configurator-QP Operating Manual.
5	USB cable	—	(Prepared by user) A USB cable is needed for connecting the CPU module with a personal computer (DOS/V). For details, refer to GX Configurator-QP Operating Manual.
6	Servo amplifier	—	(Prepared by user)
7	Manual pulse generator	—	(Prepared by user) Recommended: MR-HDP01 (Mitsubishi Electric)
8	SSCNET cable *1 (For connecting between the QD75 and the servo amplifier)	—	(Prepared by user) Cables are needed to connect the QD75 with the servo amplifier.
9	Cable *1 (For connecting between the QD75 and the external device)	—	(Prepared by user) Cables are needed to connect the QD75 with the external device. (Prepare them referring to the manuals for the connected devices and information given in 3.4.2 of this manual.)

\*1: The SSCNET cable connecting the QD75 and servo amplifier, external device connection connector has been prepared. Refer to the below table.

Part name	Type	Remarks
SSCNET cable	MR-J2HBUS $\ddot{Y}$ M	<ul style="list-style-type: none"> <li>• Connection between QD75M<math>\ddot{Y}</math> and (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M)</li> <li>• Connection between (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M) and (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M). (0.5m(1.64ft.), 1m(3.28ft.), 5m(16.4ft.))</li> <li>• MR-J2CN1: connector set (sold separately)</li> </ul>
	MR-J2HBUS $\ddot{Y}$ M-A	<ul style="list-style-type: none"> <li>• Connection between QD75M<math>\ddot{Y}</math> /MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M and MR-H-BN/MR-H-BN4. (0.5m(1.64ft.), 1m(3.28ft.), 5m(16.4ft.))</li> <li>• MR-J2CN1-A: connector set (sold separately)</li> </ul>
	MR-HBUS $\ddot{Y}$ M	<ul style="list-style-type: none"> <li>• Connection between MR-H-BN/MR-H-BN4 and MR-H-BN/MR-H-BN4 (0.5m(1.64ft.), 1m(3.28ft.), 5m(16.4ft.))</li> <li>• MR-HBCNS: connector set (sold separately)</li> </ul>
Applicable connector	A6CON1, A6CON2, A6CON3, A6CON4 (sold separately)	
Applicable wire size	0.3 mm <sup>2</sup> (when A6CON1 and A6CON4 are used), AWG#24 to 28 (when A6CON2 is used), AWG#28 (twisted)/AWG#30 (single wire) (when A6CON3 is used)	

(Note): The overall extension of the SSCNET cable is up to 30m.

■ Specifications of recommended manual pulse generator

Item	Specification
Model name	MR-HDP01
Pulse resolution	25PLS/rev (100 PLS/rev after magnification by 4)
Output method	Voltage-output (power supply voltage -1V or more), Output current Max. 20mA
Power supply voltage	4.5 to 13.2VDC
Current consumption	60mA
Life time	100 revolutions (at 200r/min)
Permitted axial loads	Radial load: Max. 19.6N
	Thrust load: Max. 9.8N
Operation temperature	-10 to 60°C (14 to 140°F )
Weight	0.4 (0.88) [kg(lb)]
Number of max. revolution	Instantaneous Max. 600r/min. normal 200r/min
Pulse signal status	2 signals: A phase, B: phase, 90° phase difference
Friction torque	0.1N/m (at 20°C (68°F))

## 2.3 Applicable system

The QD75 can be used in the following system.

### (1) Applicable modules and the number of installable modules

The following table indicates the CPU modules and network modules (for remote I/O station) usable with the QD75 and the number of installable modules.

Applicable modules	Number of installable modules	Remarks	
CPU module	Q00JCPU	Max. 16 modules	(*1)
	Q00CPU Q01CPU	Max. 24 modules	
	Q02CPU Q02HCPU Q06HCPU Q12HCPU Q25HCPU	Max. 64 modules	Installable in the Q mode only (*1)
	Q12PHCPU Q25PHCPU	Max. 64 modules	(*1)
Network module	QJ72LP25-25 QJ72BR15 QJ72LP25G QJ72LP25GE	Max. 64 modules	MELSECNET/H remote I/O station (*2)

\*1 Refer to the User's Manual (Function Explanation, Program Fundamentals) of the CPU module used.

\*2 Refer to the Q Corresponding MELSECNET/H Network System Reference Manual (Remote I/O Network).

### (2) Usable base unit

The QD75 can be installed in any of the I/O slots (\*3) of a base unit.

When installing the QD75, always consider the power supply capacity since a shortage of the power supply capacity may occur depending on the combination with the other installed module and the number of installed module.

\*3 Within the I/O point range of the CPU module and network module (for remote I/O station).

### (3) Compatibility with Multiple PLC system

When using the QD75 in a Multiple PLC system, first refer to the QCPU (Q mode) User's Manual (Function Explanation, Program Fundamentals).

## (4) Supported software packages

The following table lists the compatibility between the systems using the QD75 and the software packages. GX Developer is required for use of the QD75.

		Software version	
		GX Developer	GX Configurator-QP
Q00J/Q00/Q01CPU	Single PLC system	Version 7 or more	Version 2.10L or more
	Multiple PLC system	Version 8 or more	
Q02/Q02H/Q06H/ Q12H/Q25HCPU	Single PLC system	Version 4 or more	
	Multiple PLC system	Version 6 or more	
Q12PH/Q25PHCPU	Single PLC system	Version 7.10L or more	Version 2.13P or more
	Multiple PLC system		
For use on MELSECNET/H remote I/O station		Version 6 or more	Version 2.10L or more




2.4 How to check the function version and SERIAL No.

The function version and the SERIAL No. of the QD75 can be checked in the following methods.


- [1] Method using the rated plate on the module side face
- [2] Method using the software

[1] Method using the rated plate on the module side face  
Check the alphabet of "SERIAL".

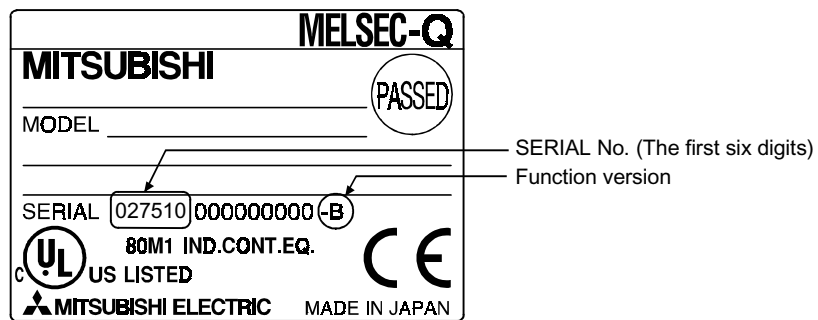

[2] Method using the software

Check the alphabet at the end of "Product information" displayed on System monitor "Module's Detailed Information" of GX Developer \*1 or on "OS information" of GX Configurator-QP \*2.

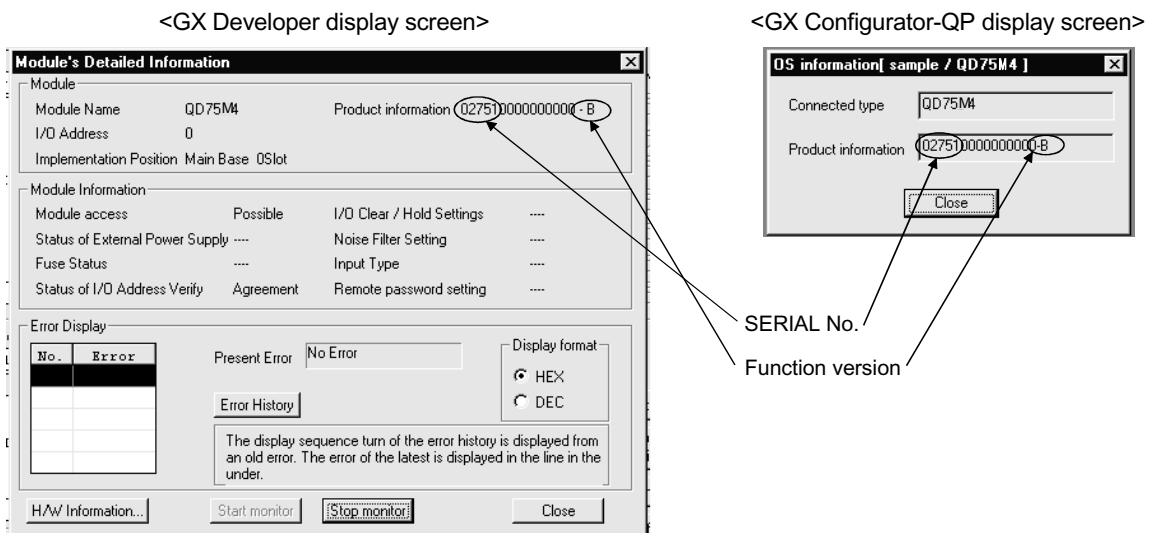

\*1: This check can be made using the version of SW4D5C-GPPW-E or more. For details, refer to GX Developer Operating Manual.

\*2: For details, refer to GX Configurator-QP Operating Manual.

# Chapter 3 Specifications and Functions

The various specifications of the QD75 are explained in this chapter.

The "General specifications", "Performance specifications", "List of functions", "Specifications of input/output signals with PLC CPU", and the "Specifications of input/output interfaces with external devices", etc., are described as information required when designing the positioning system.

Confirm each specification before designing the positioning system.

- 3.1 Performance specifications ..... 3- 2
- 3.2 List of functions ..... 3- 4
  - 3.2.1 QD75 control functions ..... 3- 4
  - 3.2.2 QD75 main functions ..... 3- 6
  - 3.2.3 QD75 sub functions and common functions ..... 3- 8
  - 3.2.4 Combination of QD75 main functions and sub functions ..... 3- 12
- 3.3 Specifications of input/output signals with PLC CPU ..... 3- 14
  - 3.3.1 List of input/output signals with PLC CPU ..... 3- 14
  - 3.3.2 Details of input signals (QD75 → PLC CPU) ..... 3- 15
  - 3.3.3 Details of output signals (PLC CPU → QD75) ..... 3-17
- 3.4 Specifications of input/output interfaces with external devices ..... 3- 18
  - 3.4.1 Electrical specifications of input signals ..... 3- 18
  - 3.4.2 Signal layout for external device connection connector ..... 3- 19
  - 3.4.3 List of input signal details ..... 3- 20
  - 3.4.4 Interface internal circuit ..... 3- 21
- 3.5 External circuit design ..... 3- 22

3.1 Performance specifications

Item \ Model		QD75M1	QD75M2	QD75M4
No. of control axes		1 axis	2 axes	4 axes
Interpolation function		None	2-axis linear interpolation 2-axis circular interpolation	2-, 3-, or 4-axis linear interpolation 2-axis circular interpolation
Control system		PTP (Point To Point) control, path control (both linear and arc can be set), speed control, speed-position switching control, position-speed switching control		
Control unit		mm, inch, degree, PLS		
Positioning data		600 data (positioning data Nos. 1 to 600)/axis (Can be set with peripheral device or PLC program.)		
Backup		Parameters, positioning data, and block start data can be saved on flash ROM (battery-less backup)		
Positioning	Positioning system	PTP control: Incremental system/absolute system Speed-position switching control: Incremental system/absolute system * 1 Position-speed switching control: Incremental system Path control: Incremental system/absolute system		
	Positioning range	<div style="border: 1px solid black; padding: 2px;">In absolute system</div> <ul style="list-style-type: none"> <li>• -214748364.8 to 214748364.7 (μm)</li> <li>• -21474.83648 to 21474.83647 (inch)</li> <li>• 0 to 359.99999 (degree)</li> <li>• -2147483648 to 2147483647 (PLS)</li> </ul> <div style="border: 1px solid black; padding: 2px;">In incremental system</div> <ul style="list-style-type: none"> <li>• -214748364.8 to 214748364.7 (μm)</li> <li>• -21474.83648 to 21474.83647 (inch)</li> <li>• -21474.83648 to 21474.83647 (degree)</li> <li>• -2147483648 to 2147483647 (PLS)</li> </ul> <div style="border: 1px solid black; padding: 2px;">In speed-position switching control (INC mode) / position-speed switching control</div> <ul style="list-style-type: none"> <li>• 0 to 214748364.7 (μm)</li> <li>• 0 to 21474.83647 (inch)</li> <li>• 0 to 21474.83647 (degree)</li> <li>• 0 to 2147483647 (PLS)</li> </ul> <div style="border: 1px solid black; padding: 2px;">In speed-position switching control (ABS mode) * 1</div> <ul style="list-style-type: none"> <li>• 0 to 359.99999 (degree)</li> </ul>		
	Speed command	0.01 to 20000000.00 (mm/min) 0.001 to 2000000.000 (inch/min) 0.001 to 2000000.000 (degree/min) 1 to 10000000 (PLS/s)		
	Acceleration/ deceleration process	Automatic trapezoidal acceleration/deceleration, S-pattern acceleration/deceleration		
	Acceleration/ deceleration time	1 to 8388608 (ms) Four patterns can be set for each of acceleration time and deceleration time		
	Sudden stop deceleration time	1 to 8388608 (ms)		

\* 1: In speed-position switching control (ABS mode), the control unit available is "degree" only. (For details, refer to "Section 9.2.17 Speed-position switching control (ABS mode)".

Item	Model	QD75M1	QD75M2	QD75M4
Starting time (ms) *2		1-axis linear control	6	Factors in starting time extension The following times will be added to the starting time in the described conditions: • S-pattern acceleration/ deceleration is selected: 0.5 • Other axis is in operation: 1.5 • During continuous positioning control: 0.2 • During continuous path control: 1.0
		1-axis speed control	6	
		2-axis linear interpolation control (Composite speed)	7	
		2-axis linear interpolation control (Reference axis speed)	7	
		2-axis circular interpolation control	7	
		2-axis speed control	6	
		3-axis linear interpolation control (Composite speed)	7	
		3-axis linear interpolation control (Reference axis speed)	7	
		3-axis speed control	6	
		4-axis linear interpolation control	7	
		4-axis speed control	7	
External wiring connection system		40-pin connector		
Applicable wire size		0.3 mm <sup>2</sup> (when A6CON1 and A6CON4 are used), AWG#24 to 28 (when A6CON2 is used), AWG#28 (twisted)/AWG#30 (single wire) (when A6CON3 is used)		
Applicable connector for external device		A6CON1, A6CON2, A6CON3, A6CON4 (sold separately)		
SSCNET cable	MR-HBUS <sup>Y</sup> M	<ul style="list-style-type: none"> <li>• Connection between MR-H-BN/MR-H-BN4 and MR-H-BN/MR-H-BN4 (0.5m(1.64ft.), 1m(3.28ft.), 5m(16.4ft.))</li> <li>• MR-HBCNS: connector set (sold separately)</li> </ul>		
	MR-J2HBUS <sup>Y</sup> M	<ul style="list-style-type: none"> <li>• Connection between QD75M<sup>Y</sup> and (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B)</li> <li>• Connection between (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B) and (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B). (0.5m(1.64ft.), 1m(3.28ft.), 5m(16.4ft.))</li> <li>• MR-J2CN1: connector set (sold separately)</li> </ul>		
	MR-J2HBUS <sup>Y</sup> M-A	<ul style="list-style-type: none"> <li>• Connection between QD75M<sup>Y</sup> /MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B and MR-H-BN/MR-H-BN4. (0.5m(1.64ft.), 1m(3.28ft.), 5m(16.4ft.))</li> <li>• MR-J2CN1-A: connector set (sold separately)</li> </ul>		
SSCNET cable over all length (m)		30		
Internal current consumption (5VDC)		QD75M1 :0.40A	QD75M2 :0.40A	QD75M4 :0.40A
Flash ROM write count		Max. 100000 times		
No. of occupied I/O points (points)		32 (I/O assignment: 32 points for intelligent function module)		
Outline dimensions (mm(inch))		98 (3.86) (H) Δ 27.4 (1.08) (W) Δ 90 (3.54) (D)		
Weight (kg)		0.15	0.15	0.16

\*2: Using the "Pre-reading start function", the virtual start time can be shortened. (For details, refer to "Section 12.7.8 Pre-reading start function".

## 3.2 List of functions

### 3.2.1 QD75 control functions

The QD75 has several functions. In this manual, the QD75 functions are categorized and explained as follows.

#### ■ Main functions

##### (1) OPR control

"OPR control" is a function that established the start point for carrying out positioning control, and carries out positioning toward that start point. This is used to return a workpiece, located at a position other than the OP when the power is turned ON or after positioning stop, to the OP. The "OPR control" is preregistered in the QD75 as the "Positioning start data No. 9001 (Machine OPR)", and "Positioning start data No. 9002 (Fast OPR)". (Refer to Chapter 8 "OPR Control".)

##### (2) Major positioning control

This control is carried out using the "Positioning data" stored in the QD75. Positioning control, such as position control and speed control, is executed by setting the required items in this "positioning data" and starting that positioning data. An "operation pattern" can be set in this "positioning data", and with this whether to carry out control with continuous positioning data (ex.: positioning data No. 1, No. 2, No. 3, ...) can be set. (Refer to Chapter 9 "Major Positioning Control".)

##### (3) High-level positioning control

This control executes the "positioning data" stored in the QD75 using the "block start data". The following types of applied positioning control can be carried out.

- € Random blocks, handling several continuing positioning data items as "blocks", can be executed in the designated order.
- € "Condition judgment" can be added to position control and speed control.
- € The operation of the designated positioning data No. that is set for multiple axes can be started simultaneously. (Pulses are output simultaneously to multiple servos.)
- € The designated positioning data can be executed repeatedly, etc., (Refer to Chapter 10 "High-level Positioning Control".)

##### (4) Manual control


By inputting a signal into the QD75 from an external source, the QD75 will output a random pulse train and carry out control. Use this manual control to move the workpiece to a random position (JOG operation), and to finely adjust the positioning (inching operation, manual pulse generator operation), etc. (Refer to Chapter 11 "Manual Control".)

#### ■ Sub functions

When executing the main functions, control compensation, limits and functions can be added. (Refer to Chapter 12 "Control Sub Functions".)

#### ■ Common functions

Common control using the QD75 for "parameter initialization" or "backup of execution data" can be carried out. (Refer to Chapter 13 "Common Functions".)

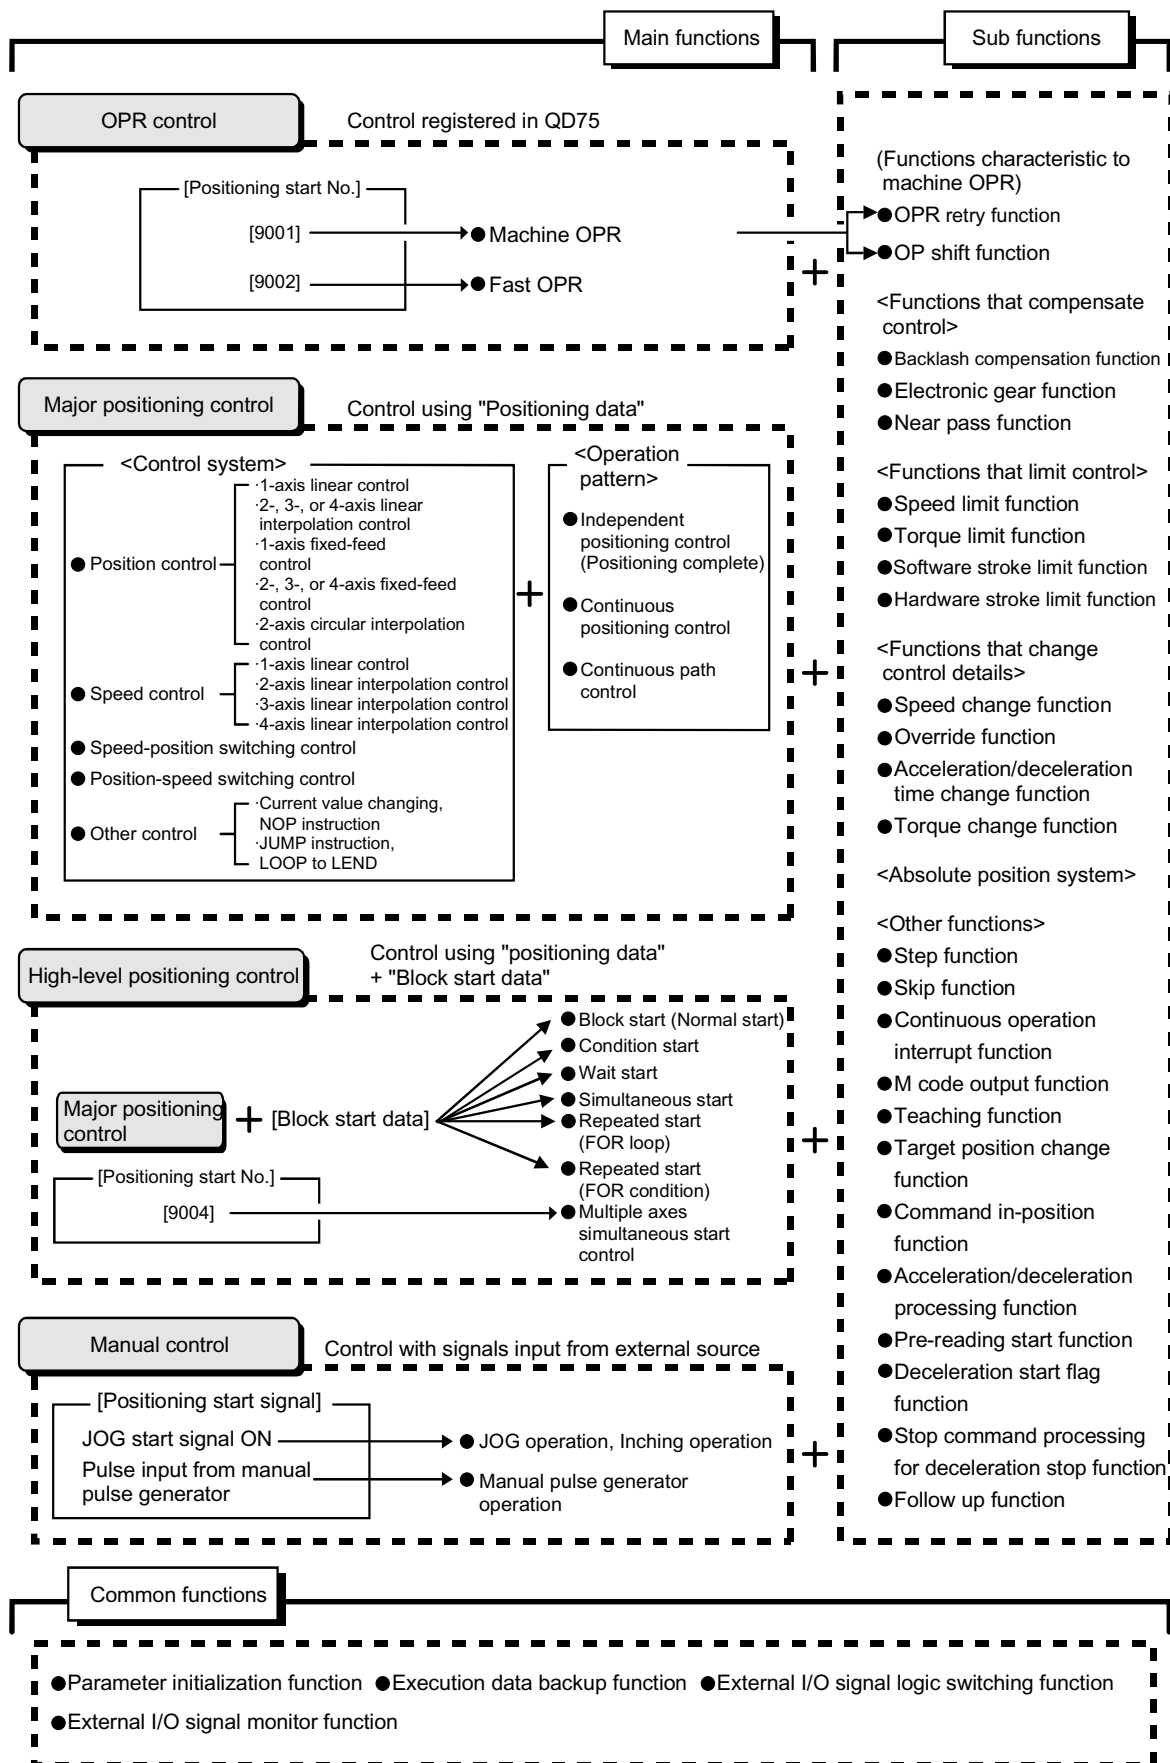

3.2.2 QD75 main functions

The outline of the main functions for positioning control with the QD75 is described below. (Refer to "Section 2" for details on each function.)

Main functions		Details	Reference section
OPR control	Machine OPR control	Mechanically establishes the positioning start point using a near-point dog or stopper. (Positioning start No. 9001)	8.2
	Fast OPR control	Positions a target to the OP address ( <a href="#">Md.21</a> Machine feed value) stored in the QD75 using machine OPR. (Positioning start No. 9002)	8.3
Major positioning control	Position control	Linear control (1-axis linear control) (2-axis linear interpolation control) (3-axis linear interpolation control) (4-axis linear interpolation control)	9.2.2 9.2.3 9.2.4 9.2.5
		Fixed-feed control (1-axis fixed-feed control) (2-axis fixed-feed control) (3-axis fixed-feed control) (4-axis fixed-feed control)	9.2.6 9.2.7 9.2.8 9.2.9
		2-axis circular interpolation control	9.2.10 9.2.11
	Speed control	Linear control (1-axis linear control) (2-axis linear interpolation control) (3-axis linear interpolation control) (4-axis linear interpolation control)	9.2.12 9.2.13 9.2.14 9.2.15
		Speed-position switching control	9.2.16 9.2.17
	Position-speed switching control	9.2.18	
	Other control	Current value changing	9.2.19
		NOP instruction	9.2.20
		JUMP instruction	9.2.21
		LOOP	9.2.22
		LEND	9.2.23

Main functions		Details	Reference section
High-level positioning control	Block start (Normal start)	With one start, executes the positioning data in a random block with the set order.	10.3.2
	Condition start	Carries out condition judgment set in the "condition data" for the designated positioning data, and then executes the "block start data". When the condition is established, the "block start data" is executed. When not established, that "block start data" is ignored, and the next point's "block start data" is executed.	10.3.3
	Wait start	Carries out condition judgment set in the "condition data" for the designated positioning data, and then executes the "block start data". When the condition is established, the "block start data" is executed. When not established, stops the control until the condition is established. (Waits.)	10.3.4
	Simultaneous start	Simultaneously executes the positioning data having the No. for the axis designated with the "condition data". (Outputs pulses at the same timing.)	10.3.5
	Repeated start (FOR loop)	Repeats the program from the block start data set with the "FOR loop" to the block start data set in "NEXT" for the designated No. of times.	10.3.6
	Repeated start (FOR condition)	Repeats the program from the block start data set with the "FOR condition" to the block start data set in "NEXT" until the conditions set in the "condition data" are established.	10.3.7
	Multiple axes simultaneous start control	Starts the operation of multiple axes simultaneously according to the pulse output level. (Positioning start No. 9004, same as the "simultaneous start" above)	10.5
Manual control	JOG operation	Outputs a pulse to servo amplifier while the JOG start signal is ON.	11.2
	Inching operation	Outputs pulses corresponding to minute movement amount by manual operation to servo amplifier. (Performs fine adjustment with the JOG start signal.)	11.3
	Manual pulse generator operation	Outputs pulses commanded with the manual pulse generator to servo amplifier. (Carry out fine adjustment, etc., at the pulse level.)	11.4

With the "major positioning control" ("high-level positioning control"), whether or not to continuously execute the positioning data can be set with the "operation pattern".

Outlines of the "operation patterns" are given below.

Da.1 Operation pattern	Details	Reference section
Independent positioning control (positioning complete)	When "independent positioning control" is set for the operation pattern of the started positioning data, only the designated positioning data will be executed, and then the positioning will end.	9.1.2
Continuous positioning control	When "continuous positioning control" is set for the operation pattern of the started positioning data, after the designated positioning data is executed, the program will stop once, and then the next following positioning data will be executed.	
Continuous path control	When "continuous path control" is set for the operation pattern of the started positioning data, the designated positioning data will be executed, and then without decelerating, the next following positioning data will be executed.	



## 3.2.3 QD75 sub functions and common functions

## ■ Sub functions

The functions that assist positioning control using the QD75 are described below.  
(Refer to Section 2 for details on each function.)

Sub function		Details	Reference section
Functions characteristic to machine OPR	OPR retry function	This function retries the machine OPR with the upper/lower limit switches during OPR. This allows machine OPR to be carried out even if the axis is not returned to before the near-point dog with JOG operation, etc.	12.2.1
	OP shift function	After returning to the machine OP, this function compensates the position by the designated distance from the machine OP position and sets that position as the OP address.	12.2.2
Functions that compensate control	Backlash compensation function	This function compensates the mechanical backlash. Feed pulses equivalent to the set backlash amount are output each time the movement direction changes.	12.3.1
	Electronic gear function	By setting the movement amount per pulse, this function can freely change the machine movement amount per commanded pulse. When the movement amount per pulse is set, a flexible positioning system that matches the machine system can be structured.	12.3.2
	Near pass function *1	This function suppresses the machine vibration when the speed changes during continuous path control in the interpolation control.	12.3.3
Functions that limit control	Speed limit function	If the command speed exceeds " [Pr.8] Speed limit value" during control, this function limits the commanded speed to within the " [Pr.8] Speed limit value" setting range.	12.4.1
	Torque limit function	If the torque generated by the servomotor exceeds " [Pr.17] Torque limit setting value" during control, this function limits the generated torque to within the " [Pr.17] Torque limit setting value" setting range.	12.4.2
	Software stroke limit function	If a command outside of the upper/lower limit stroke limit setting range, set in the parameters, is issued, this function will not execute positioning for that command.	12.4.3
	Hardware stroke limit function	This function carries out deceleration stop with the limit switch connected to the QD75 external device connector.	12.4.4
Functions that change control details	Speed change function	This function changes the speed during positioning. Set the new speed in the speed change buffer memory ( [Cd.14] New speed value), and change the speed with the Speed change request ( [Cd.15] ).	12.5.1
	Override function	This function changes the speed within a percentage of 1 to 300% during positioning. This is executed using " [Cd.13] Positioning operation speed override".	12.5.2
	Acceleration/deceleration time change function	This function changes the acceleration/deceleration time during speed change.	12.5.3
	Torque change function	This function changes the "torque limit value" during control.	12.5.4
Absolute position system		This function restores the absolute position.	12.6

\*1: The near pass function is featured as standard and is valid only for position control. It cannot be set to be invalid with parameters.

Sub function	Details	Reference section	
Other functions	Step function	This function temporarily stops the operation to confirm the positioning operation during debugging, etc. The operation can be stopped at each "automatic deceleration" or "positioning data".	12.7.1
	Skip function	This function stops (decelerates to a stop) the positioning being executed when the skip signal is input, and carries out the next positioning.	12.7.2
	M code output function	This function issues a command for a sub work (clamp or drill stop, tool change, etc.) corresponding to the M code No. (0 to 65535) that can be set for each positioning data.	12.7.3
	Teaching function	This function stores the address positioned with manual control into the positioning address having the designated positioning data No. ( [Cd.39] ).	12.7.4
	Target position change function	This function changes the target position during positioning. Position and speed can be changed simultaneously.	12.7.5
	Command in-position function	At each automatic deceleration, this function calculates the remaining distance for the QD75 to reach the positioning stop position. When the value is less than the set value, the "command in-position flag" is set to "1". When using another auxiliary work before ending the control, use this function as a trigger for the sub work.	12.7.6
	Acceleration/deceleration process function	This function adjusts the control acceleration/deceleration.	12.7.7
	Continuous operation interrupt function	This function interrupts continuous operation. When this request is accepted, the operation stops when the execution of the current positioning data is completed.	6.5.4
	Pre-reading start function	This function shortens the virtual start time.	12.7.8
	Deceleration start flag function	Function that turns ON the flag when the constant speed status or acceleration status switches to the deceleration status during position control, whose operation pattern is "Positioning complete", to make the stop timing known.	12.7.9
	Stop command processing for deceleration stop function	Function that selects a deceleration curve when a stop cause occurs during deceleration stop processing to speed 0.	12.7.10
Follow up function	This function monitors the motor rotation amount with the servo turned OFF, and reflects it on the current feed value.	12.8.2	

### ■ Common functions

The outline of the functions executed as necessary are described below.  
(Refer to Section 2 for details on each function.)

Common functions	Details	Reference section
Parameter initialization function	This function returns the "parameters" stored in the QD75 buffer memory and flash ROM to the default values. The following two methods can be used. 1) Method using PLC program 2) Method using GX Configurator-QP	13.2
Execution data backup function	This functions stores the "setting data", currently being executed, into the flash ROM. 1) Method using PLC program 2) Method using GX Configurator-QP	13.3
External I/O signal logic switching function	This function switches I/O signal logic according to externally connected devices. This function enables the use of the system that does not use b (N.C.)-contact signals, such as Upper/lower limit signal, by setting parameters to positive logic.	13.4
External I/O signal monitor function	This function monitors the external I/O signal monitor information in the module's detailed information which can be displayed on the system monitor of GX Developer* 1.	13.5

\* 1: Usable on GX Developer (SW6D5C-GPPW-E or later).



3.2.4 Combination of QD75 main functions and sub functions

With positioning control using the QD75, the main functions and sub functions can be combined and used as necessary. A list of the main function and sub function combinations is given below.

Main functions		Sub functions	Functions characteristic to machine OPR		
			OPR retry function	OP shift function	
		Combination with operation pattern. *1			
OPR control	Machine OPR control	×	○	○	
	Fast OPR control	×	×	×	
Major positioning control	Position control	1-axis linear control	○	×	×
		2-, 3-, or 4-axis linear interpolation control	○	×	×
		1-axis fixed-feed control	△ (Continuous path control cannot be set)	×	×
		2-, 3-, or 4-axis fixed-feed control (interpolation)	△ (Continuous path control cannot be set)	×	×
		2-axis circular interpolation control	○	×	×
	Speed control (1- to 4-axis)	△ (Only independent positioning control can be set)	×	×	
	Speed-position switching control	△ (Continuous path control cannot be set)	×	×	
	Position-speed switching control	△ (Only independent positioning control can be set)			
	Other control	Current value changing	△ (Continuous path control cannot be set)	×	×
		NOP instruction	×		
		JUMP instruction	×		
LOOP to LEND					
Manual control	JOG operation, inching operation	×	×	×	
	Manual pulse generator operation	×	×	×	

◎: Always combine, ○: Combination possible, △: Combination limited, ×: Combination not possible

\*1 The operation pattern is one of the "positioning data" setting items.

\*2 The near pass function is featured as standard and is valid only for setting continuous path control for position control.

\*3 Invalid during creep speed.

\*4 Invalid during continuous path control.

\*5 Inching operation does not perform acceleration/deceleration processing.

\*6 Valid for the reference axis only.

\*7 Valid for only the case where a deceleration start is made during position control.

\*8 Disabled for a start of positioning start No. 9003.

	Functions that compensate control			Functions that limit control				Functions that change control details				Other functions									
	Backlash compensation function	Electronic gear function	Near pass function	Speed limit function	Torque limit function	Software stroke limit function	Hardware stroke limit function	Speed change function	Override function	Acceleration/deceleration time change function	Torque change function	Step function	Skip function	M code output function	Teaching function	Target position change function	Command in-position function	Acceleration/deceleration process function	Pre-reading start function	Deceleration start flag function	Stop command processing for deceleration stop function
	○	○		○	○	×	⊙	△*3	△*3	×	○	×	×	×	×	×	○	×	×	×	○
	○	○		○	○	×	⊙	○	○	×	○	×	×	×	×	×	○	×	×	×	○
	○	○		○	○	○	⊙	○	○	○	○	○	○	○	×	△*4	○	○	○	○	○
	○	○		○	○	○	⊙	○	○	○	○	○	○	○	×	×	○	○	○	△*6	○
	○	○		○	○	○	⊙	○	○	○	○	○	○	○	×	×	○	○	○	○	○
	○	○		○	○	○	⊙	○	○	○	○	○	○	○	×	×	○	○	○	△*6	○
	○	○		○	○	○	⊙	○	○	○	○	○	○	○	×	×	○	○	○	×	○
	○	○	*2	○	○	○	⊙	○	○	○	○	×	×	○	×	×	×	○	○	×	○
	○	○		○	○	○	⊙	○	○	○	○	×	○	×	×	○	○	○	○	△*7	○
	×	×		×	×	×	⊙	×	×	×	×	○	×	×	×	×	×	×	×	×	×
	×	×		×	×	×	⊙	×	×	×	×	×	×	×	×	×	×	×	×	×	×
	○	○		○	○	○	⊙	○	○	×	○	×	×	×	○	×	×	△*5	×	×	×
	○	○		×	○	○	⊙	×	×	×	○	×	×	×	○	×	×	×	×	×	×

**REMARK**

≠ The "common functions" are functions executed as necessary. (These are not combined with the control.)

≠ "High-level positioning control" is a control used in combination with the "major positioning control". For combinations with the sub functions, refer to the combinations of the "major positioning control" and sub functions.

3.3 Specifications of input/output signals with PLC CPU

3.3.1 List of input/output signals with PLC CPU

The QD75 uses 32 input points and 32 output points for exchanging data with the PLC CPU.

The input/output signals when the QD75 is mounted in slot No. 0 of the main base unit are shown below.

Device X refers to the signals input from the QD75 to the PLC CPU, and device Y refers to the signals output from the PLC CPU to the QD75.

Signal direction: QD75 → PLC CPU			Signal direction: PLC CPU → QD75		
Device No.	Signal name		Device No.	Signal name	
X0	QD75 READY		Y0	PLC READY	
X1	Synchronization flag		Y1	All axis servo ON	
X2	Use prohibited		Y2	Use prohibited	
X3			Y3		
X4	Axis 1	M code ON	Y4	Axis 1	Axis stop
X5	Axis 2		Y5	Axis 2	
X6	Axis 3		Y6	Axis 3	
X7	Axis 4		Y7	Axis 4	
X8	Axis 1	Error detection	Y8	Axis 1	Forward run JOG start
X9	Axis 2		Y9	Axis 1	Reverse run JOG start
XA	Axis 3		YA	Axis 2	Forward run JOG start
XB	Axis 4		YB	Axis 2	Reverse run JOG start
XC	Axis 1	BUSY	YC	Axis 3	Forward run JOG start
XD	Axis 2		YD	Axis 3	Reverse run JOG start
XE	Axis 3		YE	Axis 4	Forward run JOG start
XF	Axis 4		YF	Axis 4	Reverse run JOG start
X10	Axis 1	Start complete	Y10	Axis 1	Positioning start
X11	Axis 2		Y11	Axis 2	
X12	Axis 3		Y12	Axis 3	
X13	Axis 4		Y13	Axis 4	
X14	Axis 1	Positioning complete	Y14	Axis 1	Execution prohibition flag
X15	Axis 2		Y15	Axis 2	
X16	Axis 3		Y16	Axis 3	
X17	Axis 4		Y17	Axis 4	
X18	Use prohibited		Y18	Use prohibited	
X19			Y19		
X1A			Y1A		
X1B			Y1B		
X1C			Y1C		
X1D			Y1D		
X1E			Y1E		
X1F			Y1F		

**Important**

[Y2 to Y3], [Y18 to Y1F], [X2, X3], and [X18 to X1F] are used by the system, and cannot be used by the user.

If these devices are used, the operation of the QD75 will not be guaranteed.

3.3.2 Details of input signals (QD75 → PLC CPU)

The ON/OFF timing and conditions of the input signals are shown below.

Device No.	Signal name		Details
X0	QD75 READY		<p>ON: READY OFF: Not READY/ Watch dog timer error</p> <ul style="list-style-type: none"> <li>When the PLC READY signal [Y0] turns from OFF to ON, the parameter setting range is checked. If no error is found, this signal turns ON.</li> <li>When the PLC READY signal [Y0] turns OFF, this signal turns OFF.</li> <li>When watch dog timer error occurs, this signal turns OFF.</li> <li>This signal is used for interlock in a PLC program, etc.</li> </ul>
X1	Synchronization flag		<p>OFF: Module access disabled ON: Module access enabled</p> <ul style="list-style-type: none"> <li>After the PLC is turned ON or the CPU module is reset, this signal turns ON if the access from the CPU module to the QD75 is possible.</li> <li>When "Asynchronous" is selected in the module synchronization setting of the CPU module, this signal can be used as interlock for the access from a PLC program to the QD75.</li> </ul>
X4 X5 X6 X7	Axis 1 Axis 2 Axis 3 Axis 4	M code ON	<p>OFF: M code is not set ON: M code is set</p> <ul style="list-style-type: none"> <li>In the WITH mode, this signal turns ON when the positioning data operation is started. In the AFTER mode, this signal turns ON when the positioning data operation is completed.</li> <li>This signal turns OFF with the "Cd.7 M code OFF request".</li> <li>When M code is not designated (when "Da.10 M code" is "0"), this signal will remain OFF.</li> <li>With using continuous path control for the positioning operation, the positioning will continue even when this signal does not turn OFF. However, a warning will occur. (Warning code: 503)</li> <li>When the PLC READY signal [Y0] turns OFF, the M code ON signal will also turn OFF.</li> <li>If operation is started while the M code is ON, an error will occur.</li> </ul>
X8 X9 XA XB	Axis 1 Axis 2 Axis 3 Axis 4	Error detection	<p>OFF: No error ON: Error occurrence</p> <ul style="list-style-type: none"> <li>This signal turns ON when an error listed in Section 15.1 occurs, and turns OFF when the error is reset on "Cd.5 Axis error rest".</li> </ul>
XC XD XE XF	Axis 1 Axis 2 Axis 3 Axis 4	BUSY *1	<p>OFF: Not BUSY ON: BUSY</p> <ul style="list-style-type: none"> <li>This signal turns ON at the start of positioning, OPR or JOG operation. It turns OFF when the "Da.9 Dwell time" has passed after positioning stops. (This signal remains ON during positioning.) This signal turns OFF when the positioning is stopped with step operation.</li> <li>During manual pulse generator operation, this signal turns ON while the "Cd.21 Manual pulse generator enable flag" is ON.</li> <li>This signal turns OFF at error completion or positioning stop.</li> </ul>
X10 X11 X12 X13	Axis 1 Axis 2 Axis 3 Axis 4	Start complete	<p>OFF: Start incomplete ON: Start complete</p> <ul style="list-style-type: none"> <li>This signal turns ON when the positioning start signal turns ON and the QD75 starts the positioning process. (The start complete signal also turns ON during OPR control.)</li> </ul>
X14 X15 X16 X17	Axis 1 Axis 2 Axis 3 Axis 4	Positioning complete *2	<p>OFF: Positioning incomplete ON: Positioning complete *</p> <ul style="list-style-type: none"> <li>This signal turns ON for the time set in "Pr.40 Positioning complete signal output time" from the instant when the positioning control for each positioning data No. is completed. (It does not turn ON when "Pr.40 Positioning complete signal output time" is "0".)</li> <li>If positioning (including OPR), JOG/Inching operation, or manual pulse generator operation is started while this signal is ON, the signal will turn OFF.</li> <li>This signal will not turn ON when speed control or positioning is canceled midway.</li> </ul>



**Important**

- \*1: The BUSY signal turns ON even when position control of movement amount 0 is executed. However, since the ON time is short, the ON status may not to be detected in the PLC program.
- \*2: "Positioning complete" of the QD75 refers to the point when the pulse output from QD75 is completed.  
Thus, even if the QD75's positioning complete signal turns ON, the system may continue operation.

3.3.3 Detail of output signals (PLC CPU → QD75)



The ON/OFF timing and conditions of the output signals are shown below.

Device No.	Signal name		Details
Y0	PLC READY		<p>OFF: PLC READY OFF</p> <p>ON: PLC READY ON</p> <p>(a) This signal notifies the QD75 that the PLC CPU is normal.</p> <ul style="list-style-type: none"> <li>It is turned ON/OFF with the PLC program.</li> <li>The PLC READY signal is turned ON during positioning control, OPR control, JOG operation, inching operation, and manual pulse generator operation, unless the system is in the peripheral device test mode.</li> </ul> <p>(b) When the data (parameter etc.) are changed, the PLC READY signal is turned OFF depending on the parameter (Refer to Chapter 7.).</p> <p>(c) The following processes are carried out when the PLC READY signal turns from OFF to ON.</p> <ul style="list-style-type: none"> <li>The parameter setting range is checked.</li> <li>The QD75 READY signal [X0] turns ON.</li> </ul> <p>(d) The following processes are carried out when the PLC READY signal turns from ON to OFF.</p> <p>In these cases, the OFF time should be set to 100ms or more.</p> <ul style="list-style-type: none"> <li>The QD75 READY signal [X0] turns OFF.</li> <li>The operating axis stops.</li> <li>The M code ON signal [X4 to X7] for each axis turns OFF, and "0" is stored in "Md.25" Valid M code".</li> </ul> <p>(e) When parameters or positioning data (No. 1 to 600) are written from the peripheral device or PLC CPU to the flash ROM, the PLC READY signal will turn OFF.</p>
Y1	All axis servo ON		<p>OFF: Servo OFF</p> <p>ON: Servo ON</p> <ul style="list-style-type: none"> <li>The servo for all the servo amplifiers connected to the QD75 is turned ON or OFF.</li> </ul>
Y4 Y5 Y6 Y7	Axis 1 Axis 2 Axis 3 Axis 4	Axis stop	<p>OFF: Axis stop not requested</p> <p>ON: Axis stop requested</p> <ul style="list-style-type: none"> <li>When the axis stop signal turns ON, the OPR control, positioning control, JOG operation, inching operation and manual pulse generator operation will stop.</li> <li>By turning the axis stop signal ON during positioning operation, the positioning operation will be "stopped".</li> <li>Whether to decelerate or suddenly stop can be selected with "Pr.39" Stop group 3 sudden stop selection".</li> <li>During interpolation control of the positioning operation, if the axis stop signal of any axis turns ON, all axes in the interpolation control will decelerate and stop.</li> </ul>
Y8 Y9 YA YB YC YD YE YF	Axis 1 Axis 1 Axis 2 Axis 2 Axis 3 Axis 3 Axis 4 Axis 4	Forward run JOG start Reverse run JOG start Forward run JOG start Reverse run JOG start Forward run JOG start Reverse run JOG start Forward run JOG start Reverse run JOG start	<p>OFF: JOG not started</p> <p>ON: JOG started</p> <ul style="list-style-type: none"> <li>When the JOG start signal is ON, JOG operation will be carried out at the "Cd.17" JOG speed". When the JOG start signal turns OFF, the operation will decelerate and stop.</li> <li>When inching movement amount is set, the designated movement amount is output for one control cycle and then the operation stops.</li> </ul>
Y10 Y11 Y12 Y13	Axis 1 Axis 2 Axis 3 Axis 4	Positioning start	<p>OFF: Positioning start not requested</p> <p>ON: Positioning start requested</p> <ul style="list-style-type: none"> <li>OPR operation or positioning operation is started.</li> <li>The positioning start signal is valid at the rising edge, and the operation is started.</li> <li>When the positioning start signal turns ON during BUSY, the operation starting warning will occur (warning code: 100).</li> </ul>
Y14 Y15 Y16 Y17	Axis 1 Axis 2 Axis 3 Axis 4	Execution prohibition flag	<p>OFF: Not during execution prohibition</p> <p>ON: During execution prohibition</p> <ul style="list-style-type: none"> <li>If the execution prohibition flag is ON when the positioning start signal turns ON, positioning control does not start until the execution prohibition flag turns OFF.</li> <li>Used with the "Pre-reading start function". (Refer to Section 12.7.8)</li> </ul>

3.4 Specifications of interfaces with external devices

3.4.1 Electrical specifications of input signals


■ Input specifications

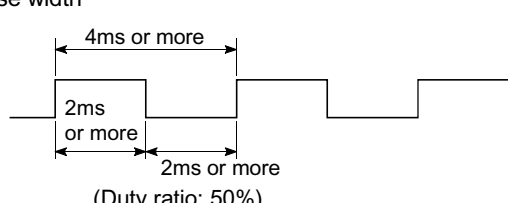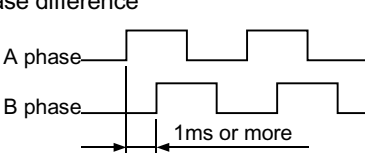Signal name	Rated input voltage/current	Working voltage range	ON voltage/current	OFF voltage/current	Input resistance	Response time
Stop signal (STOP) Upper limit signal (FLS) Lower limit signal (RLS)	24VDC/5mA	19.2 to 26.4VDC	17.5VDC or more/ 3.5mA or more	7VDC or less/ 1.0mA or less	Approx. 6.8k $\Omega$	4ms or less
Manual pulse generator A phase (PULSE GENERATOR A) Manual pulse generator B phase (PULSE GENERATOR B)	5VDC/5mA	4.5 to 6.1VDC	2.5VDC or more/ 1mA or more	1VDC or less/ 0.1mA or less	Approx. 1.2k $\Omega$	1ms or less
	<p>① Pulse width</p>  <p>(Duty ratio: 50%)</p> <p>② Phase difference</p>  <p>When the A phase leads the B phase, the positioning address (current value) increases.</p>					
Near-point dog signal (DOG) External command signal (CHG)	24VDC/5mA	19.2 to 26.4VDC	17.5VDC or more/ 3.5mA or more	7VDC or less/ 1.0mA or less	Approx. 6.8k $\Omega$	1ms or less

3.4.2 Signal layout for external device connection connector

The specifications of the connector section, which is the input/output interface for the QD75 and external device, are shown below.

The signal layout for the QD75 external device connection connector is shown.

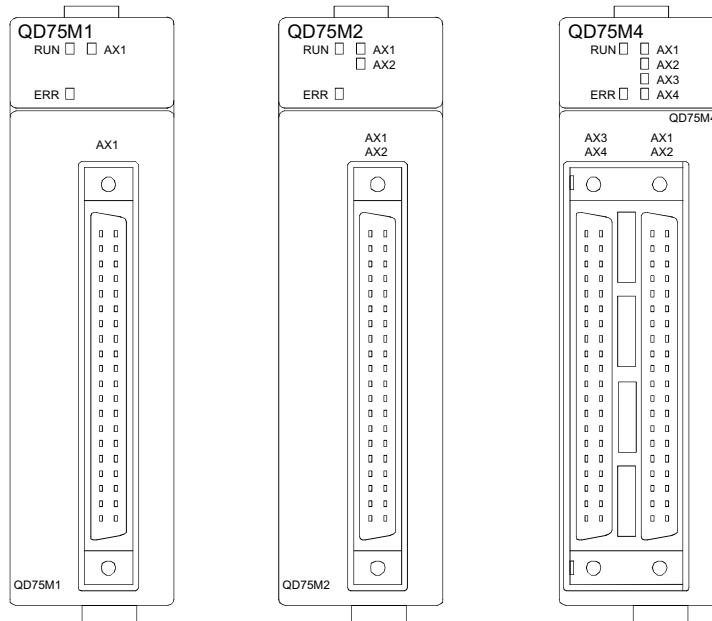

Pin layout	Axis 4(AX4)		Axis 3(AX3)		Axis 2(AX2)		Axis 1(AX1)	
	Pin No.	Signal name	Pin No.	Signal name	Pin No.	Signal name	Pin No.	Signal name
B20 ○ ○ A20 B19 ○ ○ A19 B18 ○ ○ A18 B17 ○ ○ A17 B16 ○ ○ A16 B15 ○ ○ A15 B14 ○ ○ A14 B13 ○ ○ A13 B12 ○ ○ A12 B11 ○ ○ A11 B10 ○ ○ A10 B9 ○ ○ A9 B8 ○ ○ A8 B7 ○ ○ A7 B6 ○ ○ A6 B5 ○ ○ A5 B4 ○ ○ A4 B3 ○ ○ A3 B2 ○ ○ A2 B1 ○ ○ A1  Front view of the module	2B20	No connect	2A20	No connect	1B20	PULSER B-	1A20	PULSER B+
	2B19	No connect	2A19	No connect	1B19	PULSER A-	1A19	PULSER A+
	2B18	No connect	2A18	No connect	1B18	No connect	1A18	No connect
	2B17	No connect	2A17	No connect	1B17	No connect	1A17	No connect
	2B16	No connect	2A16	No connect	1B16	No connect	1A16	No connect
	2B15	No connect	2A15	No connect	1B15	No connect	1A15	No connect
	2B14	No connect	2A14	No connect	1B14	No connect	1A14	No connect
	2B13	No connect	2A13	No connect	1B13	No connect	1A13	No connect
	2B12	No connect	2A12	No connect	1B12	No connect	1A12	No connect
	2B11	No connect	2A11	No connect	1B11	No connect	1A11	No connect
	2B10	No connect	2A10	No connect	1B10	No connect	1A10	No connect
	2B9	No connect	2A9	No connect	1B9	No connect	1A9	No connect
	2B8	No connect	2A8	No connect	1B8	No connect	1A8	No connect
	2B7	COM	2A7	COM	1B7	COM	1A7	COM
	2B6	COM	2A6	COM	1B6	COM	1A6	COM
	2B5	CHG	2A5	CHG	1B5	CHG	1A5	CHG
	2B4	STOP	2A4	STOP	1B4	STOP	1A4	STOP
	2B3	DOG	2A3	DOG	1B3	DOG	1A3	DOG
	2B2	RLS	2A2	RLS	1B2	RLS	1A2	RLS
	2B1	FLS	2A1	FLS	1B1	FLS	1A1	FLS

\* 1: Pin No. "1□□□" indicates the pin No. for the right connector. Pin No. "2□□□" indicates the pin No. for the left connector.

\* 2: When a 1-axis module is used, pin Nos. 1B1 to 1B18 are "No connect".

\* 3: For 1-axis module and 2-axis module do not have AX3 and AX4 connector of the left side.

3.4.3 List of input signal details

The details of each QD75 external device connection connector are shown below:

Signal name	Pin No.				Signal details (Negative logic is selected by external input signal logic selection)
	AX1	AX2	AX3	AX4	
Manual pulse generator A phase Manual pulse generator B phase	1A19 1A20	—			<ul style="list-style-type: none"> <li>Input the pulse signal from the manual pulse generator A phase and B phase.</li> <li>If the A phase leads the B phase, the positioning address will increase at the rising and falling edges of each phase.</li> <li>If the B phase leads the A phase, the positioning address will decrease at the rising and falling edges of each phase.</li> </ul>
Manual pulse generator A common Manual pulse generator B common	1B19 1B20	—			<p>[When increased]</p> <p>[When decreased]</p> <p>Positioning address +1+1+1+1+1+1+1</p> <p>Positioning address -1 -1 -1 -1 -1 -1 -1</p>
Upper limit signal	1A1	1B1	2A1	2B1	<ul style="list-style-type: none"> <li>This signal is input from the limit switch installed at the upper limit position of the stroke.</li> <li>Positioning will stop when this signal turns OFF.</li> <li>When OPR retry function is valid, this will be the upper limit for finding the near-point dog signal.</li> </ul>
Lower limit signal	1A2	1B2	2A2	2B2	<ul style="list-style-type: none"> <li>This signal is input from the limit switch installed at the lower limit position of the stroke.</li> <li>Positioning will stop when this signal turns OFF.</li> <li>When OPR retry function is valid, this will be the lower limit for finding the near-point dog signal.</li> </ul>
Near-point dog signal	1A3	1B3	2A3	2B3	<ul style="list-style-type: none"> <li>This signal is used for detecting the near-point dog during OPR.</li> <li>The near-point dog OFF → ON is detected at the rising edge.</li> <li>The near-point dog ON → OFF is detected at the falling edge.</li> </ul>
Stop signal	1A4	1B4	2A4	2B4	<ul style="list-style-type: none"> <li>Input this signal to stop positioning.</li> <li>When this signal turns ON, the QD75 will stop the positioning being executed.</li> <li>After that, even if this signal is turned from ON to OFF, the system will not start.</li> </ul>
External command signal/ switching signal	1A5	1B5	2A5	2B5	<ul style="list-style-type: none"> <li>Input a control switching signal during speed-position or position-speed switching control.</li> <li>Use this signal as the input signal of positioning start, speed change request, and skip request from an external source.</li> <li>Set the function to use this signal in " Pr.42 External command function selection".</li> </ul>
Common	1A6 1A7	1B6 1B7	2A6 2A7	2B6 2B7	<ul style="list-style-type: none"> <li>Common for upper/lower limit, near-point dog, stop, and external command signal/switching signals.</li> </ul>

3.4.4 Interface internal circuit

The outline diagrams of the internal circuits for the QD75M1 external device connection interface are shown below.

(1) Input

External wiring	Pin No.	Internal circuit	Signal name		Need for wiring *1
	1A1		Upper-limit LS signal	FLS	○
	1A2		Lower-limit LS signal	RLS	○
	1A3		Near-point dog signal	DOG	△
	1A4		Stop signal	STOP	△
	1A5		External command signal/switching signal	CHG	△
	1A6		Common	COM	○
	1A7				
	(+) 1A19		Manual pulse generator A phase	PULSER A+	△
	(-) 1B19			PULSER A-	
	(+) 1A20		Manual pulse generator B phase	PULSER B+	
	(-) 1B20			PULSER B-	
	1A11		—	—	—
	1A12		—	—	—
	1A8		—	—	—
1A9		—	—	—	
1A10		—	—	—	


\*1: The symbols in Need for wiring column indicate the following meanings:

- ○ : Wiring is necessary for positioning.
- △ : Wiring is necessary depending on the situation.

\*2: Either polarity can be connected to the common (COM).

3.5 External circuit design

The outline diagrams of the internal circuits for the QD75M1 external device connection interface are shown below.

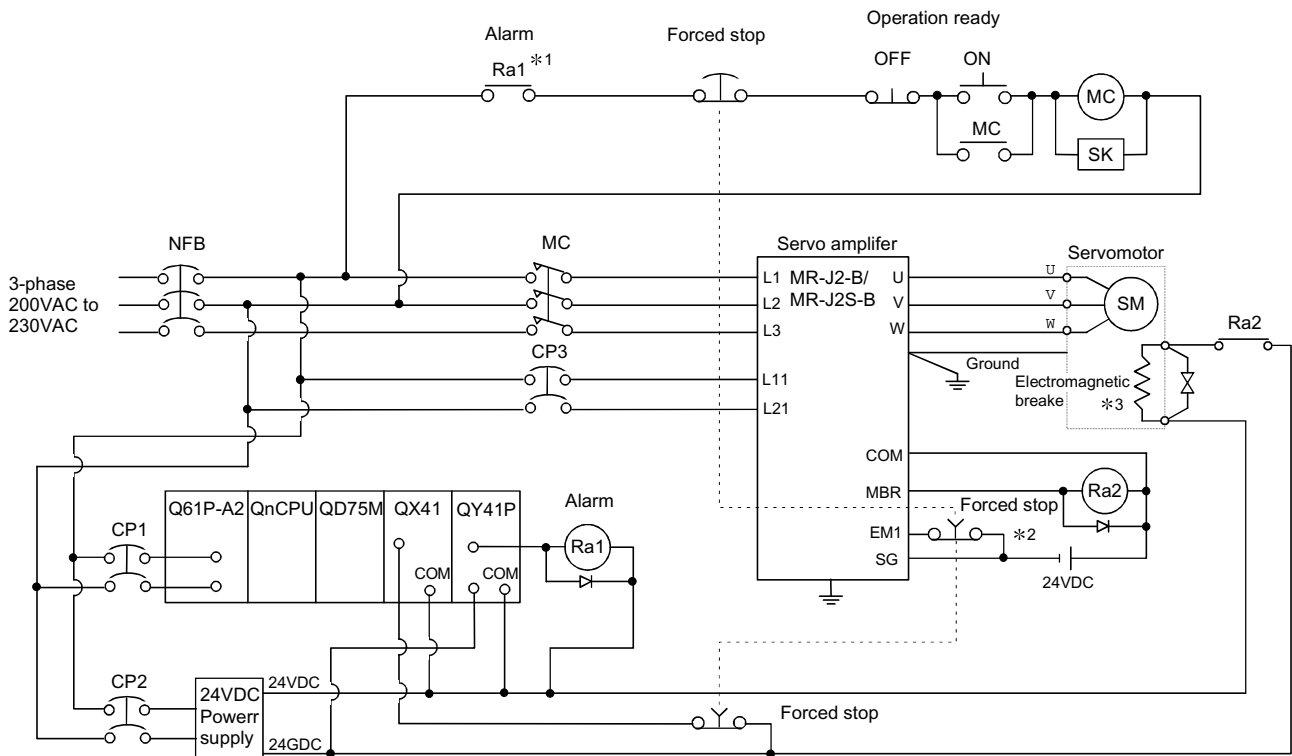

\*1: Configure up the power supply circuit which switch off the electromagnetic contactor (MC) after detection alarm occurrence on the PLC CPU.

\*2: The dynamic brake is operated, and servomotor occurs to the free run when EM1 (forced stop) of servo amplifier turn OFF. At the time, the display shows the servo forced stop warning (E6).  
During ordinary operation, do not used forced stop signal to alternate stop and run.  
The service life of the servo amplifier may be shortened.

\*3: Power supply for the electromagnetic brake is possible to use a full wave rectified power supply.

# Chapter 4 Installation, Wiring and Maintenance of the Product

The installation, wiring and maintenance of the QD75 are explained in this chapter. Important information such as precautions to prevent malfunctioning of the QD75, accidents and injuries as well as the proper work methods are described. Read this chapter thoroughly before starting installation, wiring or maintenance, and always following the precautions.


- 4.1 Outline of installation, wiring and maintenance ..... 4- 2
  - 4.1.1 Installation, wiring and maintenance procedures ..... 4- 2
  - 4.1.2 Names of each part ..... 4- 3
  - 4.1.3 Handling precautions ..... 4- 5
- 4.2 Installation ..... 4- 7
  - 4.2.1 Precautions for installation ..... 4- 7
- 4.3 Wiring ..... 4- 9
  - 4.3.1 Precautions for wiring ..... 4- 9
- 4.4 Confirming the installation and wiring ..... 4- 14
  - 4.4.1 Items to confirm when installation and wiring are completed..... 4- 14
- 4.5 Maintenance ..... 4- 15
  - 4.5.1 Precautions for maintenance..... 4- 15
  - 4.5.2 Disposal instructions ..... 4- 15



4.1 Outline of installation, wiring and maintenance


4.1.1 Installation, wiring and maintenance procedures

The outline and procedures for QD75 installation, wiring and maintenance are shown below.

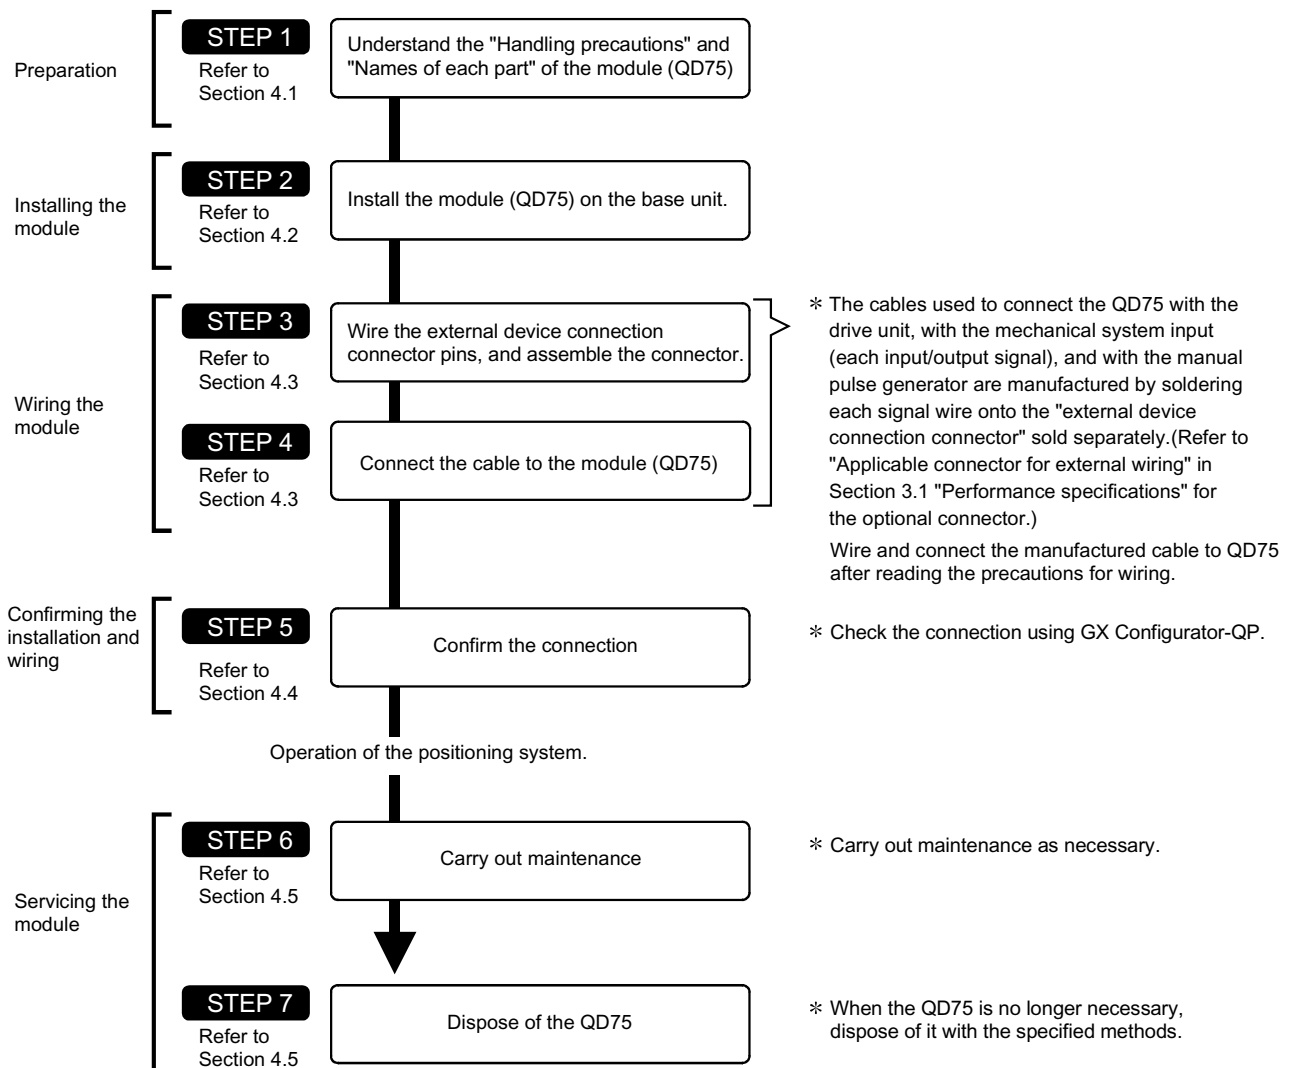


4.1.2 Names of each part

(1) The part names of the QD75 are shown below:

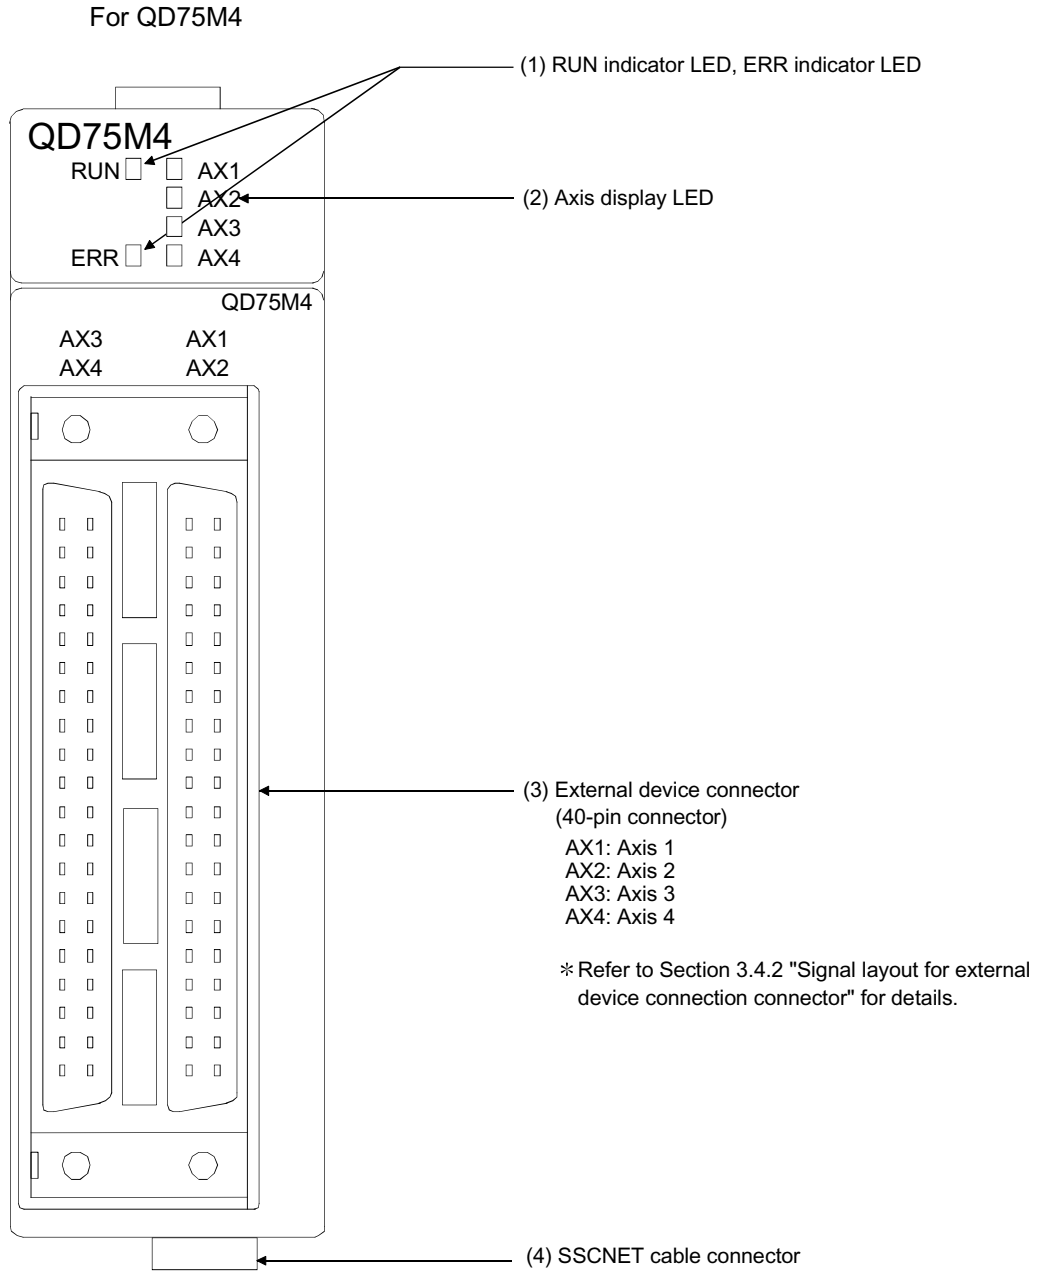

No.	Name	Details
(1)	RUN indicator LED, ERR indicator LED	Refer to the next page.
(2)	Axis display LED (AX1 to AX4)	
(3)	External device connector	A connector connected with a drive unit, mechanical system input, or manual pulse generator.
(4)	SSCNET cable connector	A connector connected with servo amplifier.

(2) The LED display indicates the following operation statuses of the QD75 and axes.

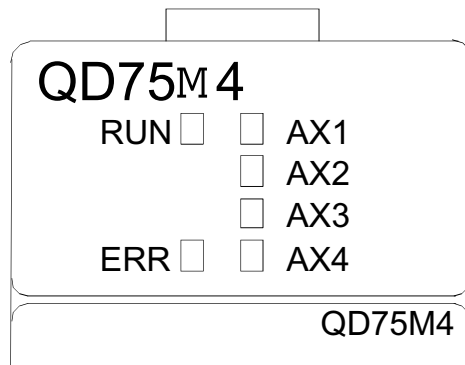


Display	Attention point	Description	Display	Attention point	Description
RUN <input type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	RUN is OFF.	Hardware failure, watch dog timer error	RUN <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 <input type="checkbox"/> AX4 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	AX1 (or other axis) illuminates.	The corresponding axis is in operation.
RUN <input checked="" type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 <input type="checkbox"/> AX4 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	RUN illuminates. ERR is OFF.	The module operates normally.	RUN <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 <input type="checkbox"/> AX4 ERR <input checked="" type="checkbox"/> <input type="checkbox"/> AX4	ERR flashes. AX1 (or other axis) flashes.	An error occurs on the corresponding axis.
RUN <input checked="" type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 <input type="checkbox"/> AX4 ERR <input checked="" type="checkbox"/> <input type="checkbox"/> AX4	ERR illuminates.	System error	RUN <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX1 <input checked="" type="checkbox"/> AX2 <input checked="" type="checkbox"/> AX3 <input checked="" type="checkbox"/> AX4 ERR <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX4	All LEDs illuminate.	Hardware failure
RUN <input checked="" type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 <input type="checkbox"/> AX4 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	AX1 to AX4 are OFF.	The axes are stopped or on standby.			

The symbols in the Display column indicate the following statuses:

: Turns OFF. : Illuminates. : Flashes.

(3) The interface for each QD75 is shown below:

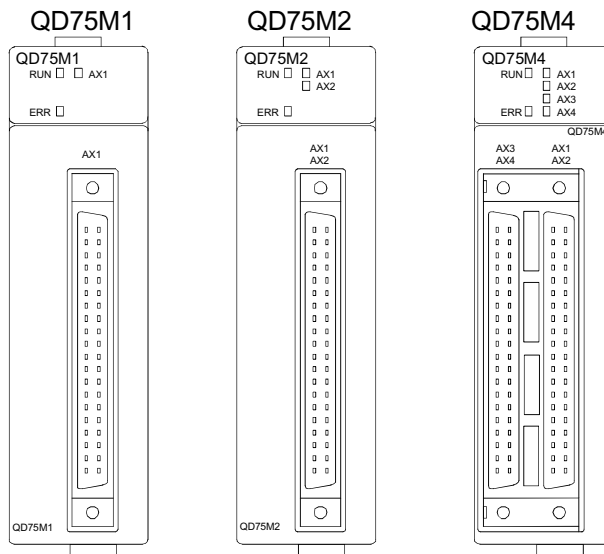

### 4.1.3 Handling precautions

Handle the QD75 and cable while observing the following precautions.

#### [1] Handling precautions

#### CAUTION

- Use the PLC within the general specifications environment given in this manual.  
Using the PLC outside the general specification range environment could lead to electric shocks, fires, malfunctioning, product damage or deterioration.
- Do not directly touch the conductive section and electronic parts of the module.  
Failure to observe this could lead to module malfunctioning or trouble.
- Make sure that foreign matter, such as cutting chips or wire scraps, do not enter the module.  
Failure to observe this could lead to fires, trouble or malfunctioning.
- Never disassemble or modify the module.  
Failure to observe this could lead to trouble, malfunctioning, injuries or fires.
- Completely turn off all lines of power supply externally before loading or unloading the module. Not doing so could result in electric shock or damage to the product.
- Because the connector has its orientation, check it before attaching or detaching the connector straight from the front.  
Unless it is properly installed, a poor contact may occur, resulting in erroneous input and output.
- Do not directly touch the module's conductive parts and electronic components of the module.  
Touching the conductive parts and electronic components of the module could cause an operation failure or give damage to the module.

## [2] Other precautions

### (1) Main body

- € The main body case is made of plastic. Take care not to drop or apply strong impacts onto the case.
- € Do not remove the QD75 PCB from the case. Failure to observe this could lead to faults.

### (2) Cable

- € Do not press on the cable with a sharp object.
- € Do not twist the cable with force.
- € Do not forcibly pull on the cable.
- € Do not step on the cable.
- € Do not place objects on the cable.
- € Do not damage the cable sheath.

### (3) Installation environment

Do not install the module in the following type of environment.

- € Where the ambient temperature exceeds the 0 to 55°C range.
- € Where the ambient humidity exceeds the 5 to 95%RH range.
- € Where there is sudden temperature changes, or where dew condenses.
- € Where there is corrosive gas or flammable gas.
- € Where there are high levels of dust, conductive powder, such as iron chips, oil mist, salt or organic solvents.
- € Where the module will be subject to direct sunlight.
- € Where there are strong electric fields or magnetic fields.
- € Where vibration or impact could be directly applied onto the main body.


## 4.2 Installation

### 4.2.1 Precautions for installation

The precautions for installing the QD75 are given below. Refer to this section as well as "4.1.3 Handling precautions" when carrying out the work.

#### [1] Precautions for SSCNET cable wiring

If the duct is below the bottom of the module, leave sufficient clearance to eliminate effects on the SSCNET cable, limit the space height to 70 mm (2.76 inch) MIN.

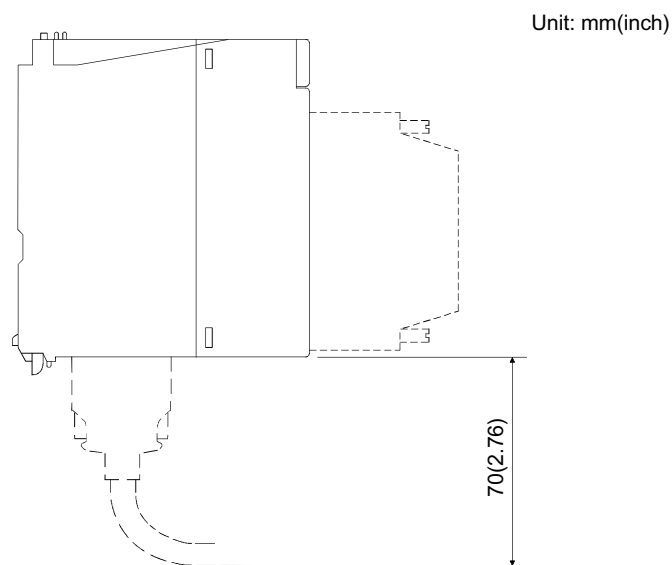

## [2] Precautions for installation

 **DANGER**

- Always turn all phases of the power supply OFF externally before cleaning or tightening the screws.  
Failure to turn all phases OFF could lead to electric shocks.

 **CAUTION**

- Never disassemble or modify the module.  
Failure to observe this could lead to trouble, malfunctioning, injuries or fires.
- Always turn all phases of the power supply OFF externally before installing or removing the module.  
Failure to turn all phases OFF could lead to module trouble or malfunctioning.
- Use the PLC within the general specifications environment given in CPU module User's manual.  
Using the PLC outside the general specification range environment could lead to electric shocks, fires, malfunctioning, product damage or deterioration.
- Don't directly touch the conductive area or electronic components of the module.  
Failure to observe this could lead to trouble or malfunctioning.
- Hold down the module mounting lever at the bottom of the module and securely insert the module fixing projection into the fixing holes of the base module. Improper mounting of the module may lead to malfunctioning, faults, or dropping.  
When using the module in the environment subject to much vibration, secure the module with a screw.  
Tighten the screw within the range of the specified tightening torque.  
Insufficient tightening may lead to dropping, short-circuit, or malfunctioning.  
Excessive tightening may damage the screw or module, leading to dropping, short-circuit, or malfunctioning.

### 4.3 Wiring

The precautions for wiring the QD75 are given below. Refer to this section as well as "4.1.3 Handling precautions" when carrying out the work.

#### 4.3.1 Precautions for wiring

##### DANGER

- Switch all phases of the external power supply off when installing or placing wiring. Not doing so may cause electric shock or damage to the product.

##### CAUTION

- Check the layout of the terminals and then properly route the wires to the module.
- Solder connector for external input signal cable and SSCNET cable device properly. Insufficient soldering may cause malfunction.
- Be careful not to let foreign matter such as sawdust or wire chips get inside the module. These may cause fires, failure or malfunction.
- The top surface of the module is covered with protective films to prevent foreign objects such as cable off cuts from entering the module when wiring. Do not remove this film until the wiring is complete. Before operating the system, be sure to remove the film to provide adequate ventilation.
- Securely connect the connector for the SSCNET cable to the bottom connector on the module.
- When removing the cable or power supply cable from the module, do not pull the cable. When removing the cable with a connector, hold the connector on the side that is connected to the module. Pulling the cable that is still connected to the module may cause malfunction or damage to the module or cable.
- The cable used for connecting the QD75 external input signal cable and SSCNET cable should not be routed near or bundled with the main circuit cable, power cable and/or other such load – carrying cables other than those for the PLC. These cables should be separated by at least 100 mm (3.94 inch) They can cause electrical interference, surges and inductance that can lead to mis-operation.




## [1] Precautions for wiring

- (1) Use separate cables for connecting to the QD75 and for the power cable that create surge and inductance.
- (2) The shielded cable for connecting QD75 can be secured in place. If the shielded cable is not secured, unevenness or movement of the shielded cable or careless pulling on it could result in damage to the QD75 or drive unit or shielded cable or defective cable connections could cause mis-operation of the unit.
- (3) If a duct is being used and cables to connect to QD75 are separated from the power line duct, use metal piping. Ground the pipes securely after metal piping.
- (4) The cable is to use the twisted pair shielded cable (wire size  $0.3 \text{ mm}^2$ ). The shielded must be grounded on the QD75 side.



## [Wiring example of shielded cable]

The following shows a wiring example for noise reduction in the case where the connector A6CON1 is used.


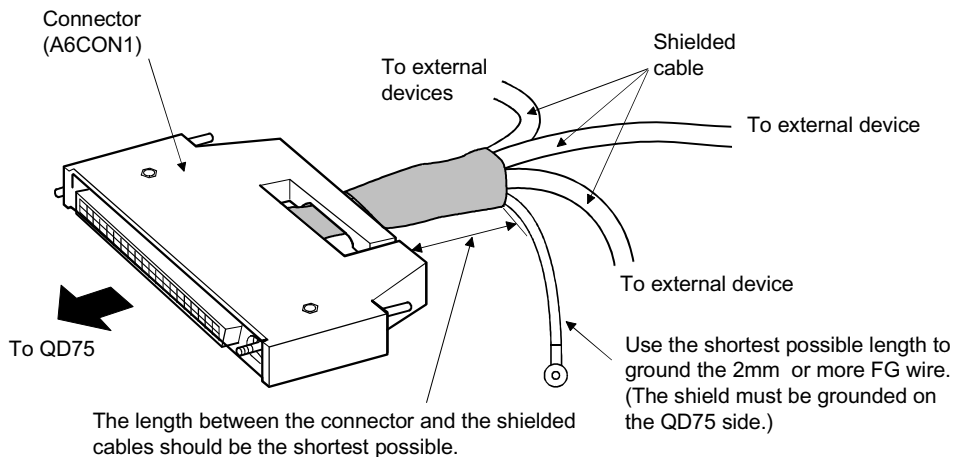


[Processing example of shielded cables]


Connections of FG wire and each shielded cable

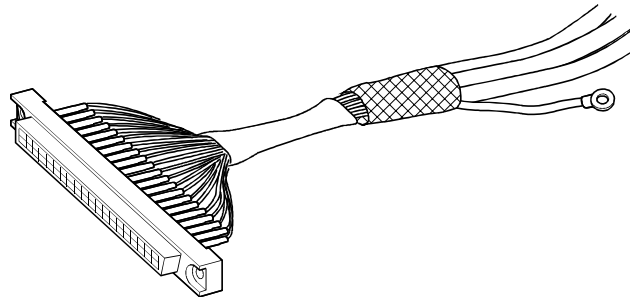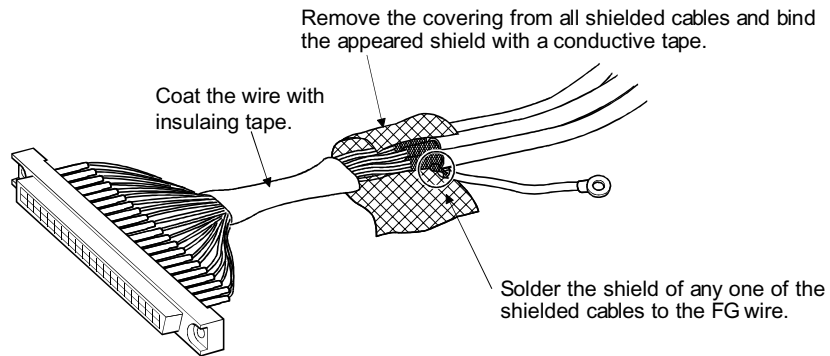


Assembling of connector (A6CON1)

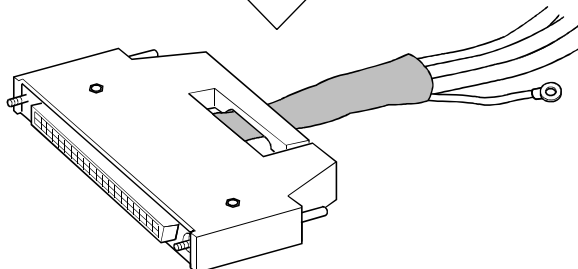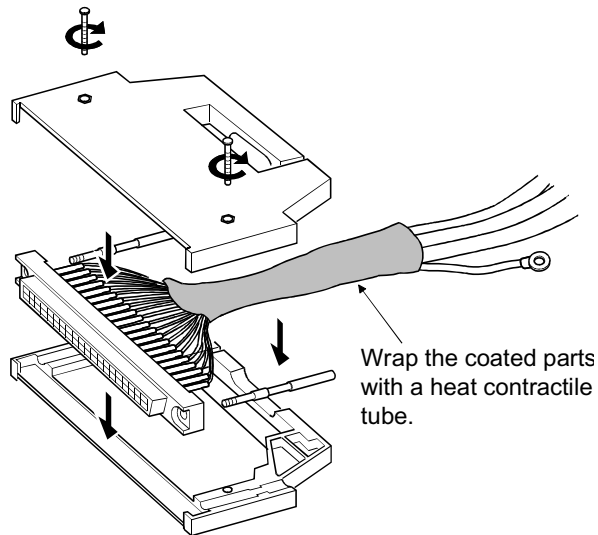

- (5) To make this product conform to the EMC directive and low voltage instruction, be sure to use of a AD75CK type cable clamp (manufactured by Mitsubishi Electric) for grounding connected to the control box and the shielded cable/ the SSCNET cable.

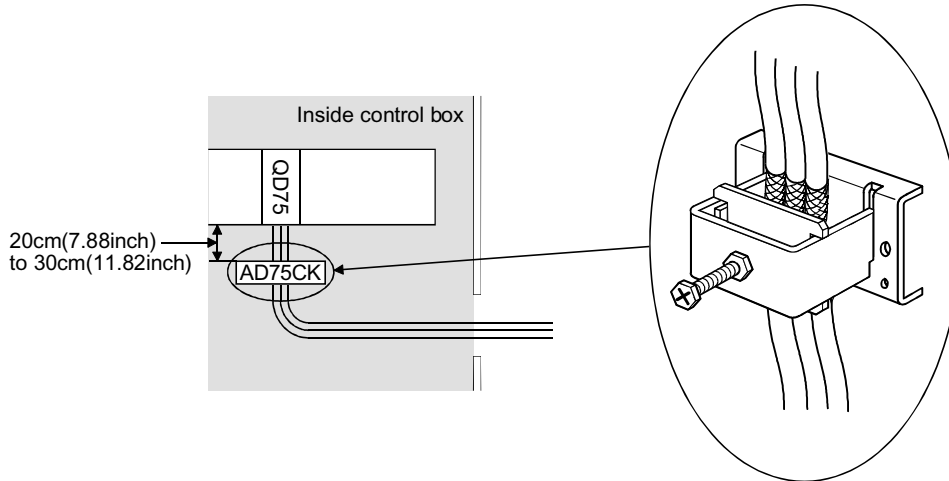


[How to ground shielded cable using AD75CK]

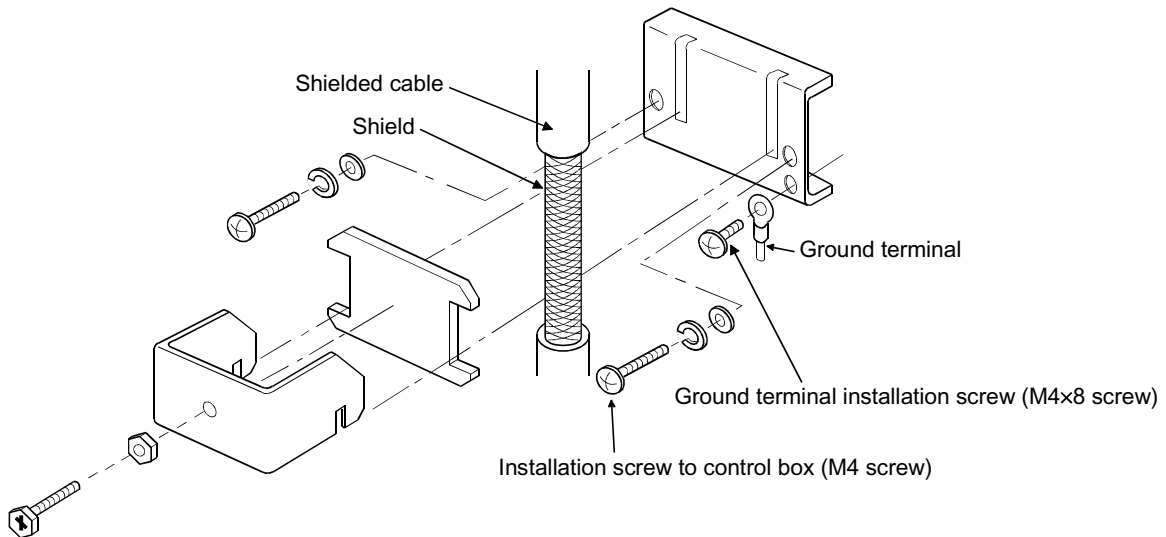

Using the AD75CK, you can tie four cables of about 7mm outside diameter together for grounding.

[Wiring examples using duct (incorrect example and corrected example)]

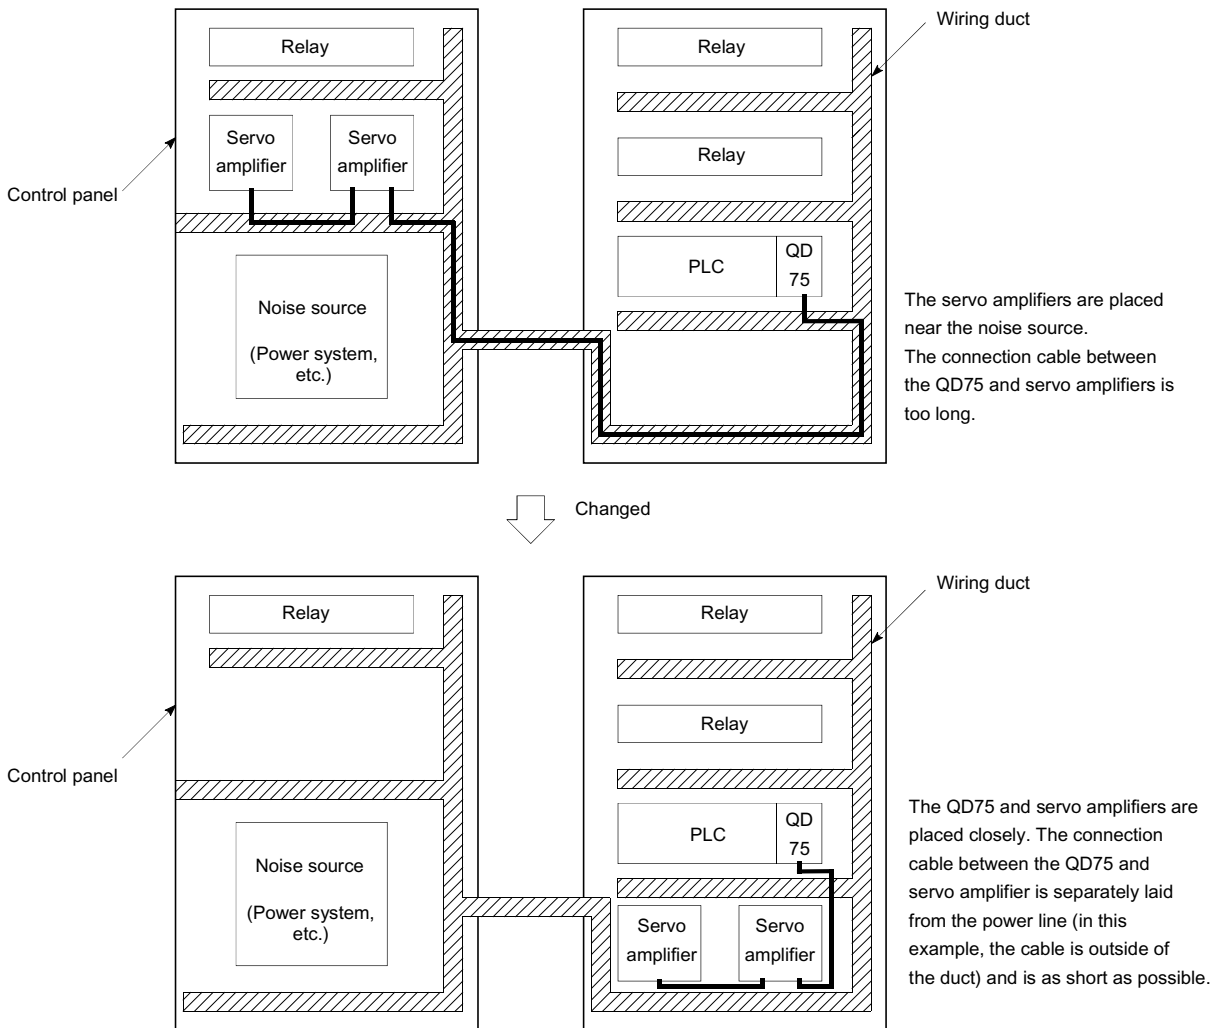

## 4.4 Confirming the installation and wiring

### 4.4.1 Items to confirm when installation and wiring are completed

Check the following points when completed with the QD75 installation and wiring.

☒ Is the module correctly wired? ... "Connection confirmation"

With "connection confirmation", the following three points are confirmed using GX Configurator-QP's connection confirmation function. (GX Configurator-QP is required for this "connection confirmation".)

- ☒ Are the QD75 and servo amplifier correctly connected?
- ☒ Are the servo amplifier and servomotor correctly connected?
- ☒ Are the QD75 and external device (input/output signal) correctly connected?

With this "connection confirmation", "whether the direction that the QD75 recognizes as forward run matches the address increment direction in the actual positioning work", and "whether the QD75 recognizes the external input/output signals such as the near-point dog signal and stop signal" can be checked.

Refer to GX Configurator-QP Operating Manual for details on "Connection confirmation".

Note that GX Developer may also be used to "confirm the connection between the QD75 and external device (I/O signals).

For details, refer to Section 13.5 "External I/O signal monitor function" and GX Developer Operating Manual (SW6D5C-GPPW-E or later).

<b>Important</b>
------------------

<p>If the QD75 is faulty, or when the required signals such as the near-point dog signal and stop signal are not recognized, unexpected accidents such as "not decelerating at the near-point dog during machine OPR and colliding with the stopper", or "not being able to stop with the stop signal" may occur.</p>
-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

<p>The "connection confirmation" must be carried out not only when structuring the positioning system, but also when the system has been changed with module replacement or rewiring, etc.</p>
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

## 4.5 Maintenance

### 4.5.1 Precautions for maintenance

The precautions for servicing the QD75 are given below. Refer to this section as well as "4.1.3 Handling precautions" when carrying out the work.

#### DANGER

- Always turn all phases of the power supply OFF externally before cleaning or tightening the screws.  
Failure to turn all phases OFF could lead to electric shocks.

#### CAUTION

- Never disassemble or modify the module.  
Failure to observe this could lead to trouble, malfunctioning, injuries or fires.
- Always turn all phases of the power supply OFF externally before installing or removing the module.  
Failure to turn all phases OFF could lead to module trouble or malfunctioning.

### 4.5.2 Disposal instructions

#### CAUTION

- When disposing of the product, handle it as industrial waste.



## Chapter 5 Data Used for Positioning Control

The parameters and data used to carry out positioning control with the QD75 are explained in this chapter.

With the positioning system using the QD75, the various parameters and data explained in this chapter are used for control. The parameters and data include parameters set according to the device configuration, such as the system configuration, and parameters and data set according to each control. Read this section thoroughly and make settings according to each control or application.

\*Refer to Section 2 for details on each control.


5.1	Types of data .....	5- 2
5.1.1	Parameters and data required for control .....	5- 2
5.1.2	Setting items for positioning parameters.....	5- 4
5.1.3	Setting items for OPR parameters .....	5- 6
5.1.4	Setting items for servo parameters .....	5- 7
5.1.5	Setting items for positioning data .....	5- 9
5.1.6	Setting items for block start data .....	5- 12
5.1.7	Setting items for condition data .....	5- 13
5.1.8	Types and roles of monitor data.....	5- 14
5.1.9	Types and roles of control data .....	5- 18
5.2	List of parameters.....	5- 22
5.2.1	Basic parameters 1 .....	5- 22
5.2.2	Basic parameters 2 .....	5- 26
5.2.3	Detailed parameters 1 .....	5- 28
5.2.4	Detailed parameters 2 .....	5- 36
5.2.5	OPR basic parameters .....	5- 48
5.2.6	OPR detailed parameters .....	5- 54
5.2.7	Servo basic parameters.....	5- 58
5.2.8	Servo adjustment parameters .....	5- 64
5.2.9	Servo expansion parameters .....	5- 74
5.2.10	Servo expansion parameters 2 .....	5- 78
5.3	List of positioning data.....	5- 82
5.4	List of block start data .....	5- 98
5.5	List of condition data.....	5-104
5.6	List of monitor data .....	5-110
5.6.1	System monitor data.....	5-110
5.6.2	Axis monitor data .....	5-120
5.7	List of control data .....	5-138
5.7.1	System control data .....	5-138
5.7.2	Axis control data .....	5-140



5.1 Types of data

5.1.1 Parameters and data required for control

The parameters and data required to carry out control with the QD75 include the "setting data", "monitor data" and "control data" shown below.

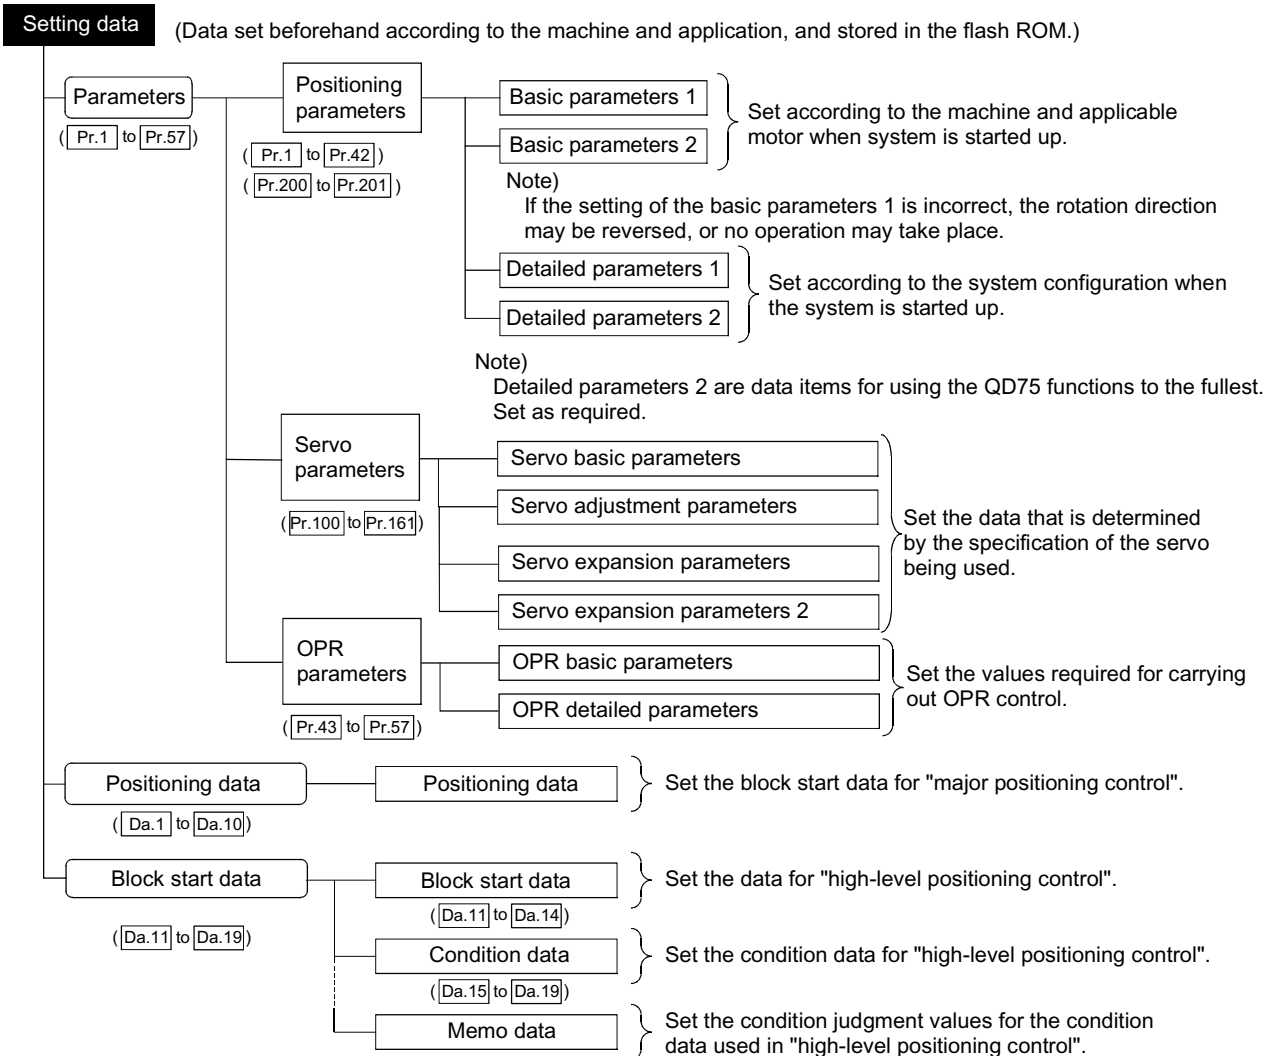

- ◇ The data is set with the PLC program or peripheral device.  
In this chapter, the method using the peripheral device will be explained.  
(Refer to "Point" on the next page.)
- ◇ The basic parameters 1, detailed parameters 1, and OPR parameters become valid when the PLC READY signal [Y0] turns from OFF to ON.
- ◇ The basic parameters 2 and detailed parameters 2 become valid immediately when they are written to the buffer memory, regardless of the state of the PLC READY signal [Y0].
- ◇ Even when the PLC READY signal [Y0] is ON, the values or contents of the following can be changed: basic parameters 2, detailed parameters 2, positioning data, and block start data.

◇ The only valid data assigned to these parameters are the data read at the moment when a positioning or JOG operation is started. Once the operation has started, any modification to the data is ignored.


Exceptionally, however, modifications to the following are valid even when they are made during a positioning operation: acceleration time 0 to 3, deceleration time 0 to 3, and external start command.

- Acceleration time 0 to 3 and deceleration time 0 to 3:

Positioning data are pre-read and pre-analyzed. Modifications to the data four or more steps after the current step are valid.


- External command function selection: The value at the time of detection is valid.

**Monitor data** (Data that indicates the control state. Stored in the buffer memory, and monitors as necessary.) : [Md.1] to [Md.48]

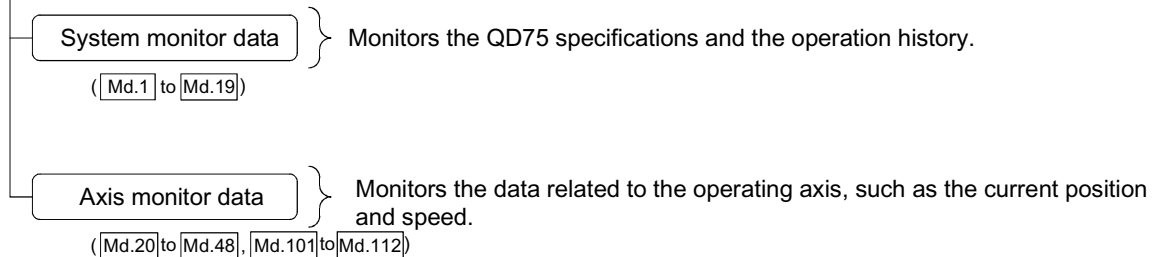

◇ The data is monitored with the PLC program or peripheral device. In this chapter, the method using the peripheral device will be explained.

**Control data** (Data for user to control positioning system.) : ([Cd.1] to [Cd.42], [Cd.100] to [Cd.104])

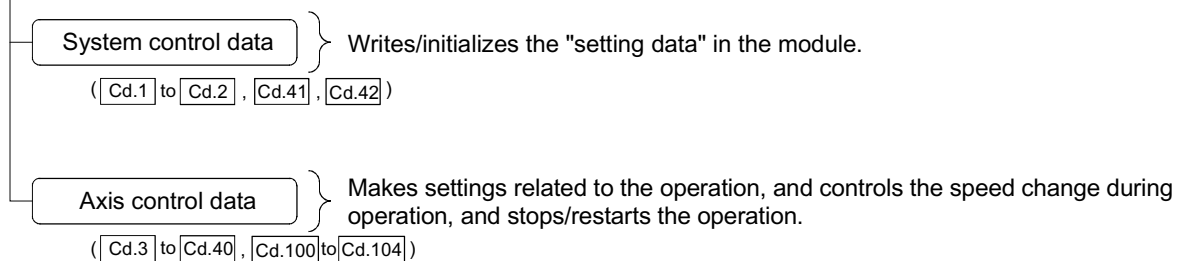

◇ Control using the control data is carried out with the PLC program.

"[Cd.40] Deceleration start flag valid" is valid for only the value at the time when the PLC READY signal [Y0] turns from OFF to ON.

#### POINT

- (1) The "setting data" is created for each axis.
- (2) The "setting data" parameters have determined default values, and are set to the default values before shipment from the factory. (Parameters related to axes that are not used are left at the default value.)
- (3) The "setting data" can be initialized with GX Configurator-QP or the PLC program.
- (4) It is recommended to set the "setting data" with GX Configurator-QP. When executed with the PLC program, many PLC programs and devices must be used. This will not only complicate the program, but will also increase the scan time.

5.1.2 Setting items for positioning parameters

The table below lists items set to the positioning parameters. Setting of positioning parameters is similarly done for individual axes for all controls achieved by the QD75. For details of controls, refer to Section 2. For details of setting items, refer to "5.2 List of parameters".

Positioning parameter		Control	OPR control	Major positioning control							Manual control		Related sub function	
				Position control				1 to 4 axis speed control	Speed-position or position-speed control	Other control		Manual pulse generator operation		JOG operation Inching operation
				1-axis linear control 2/3/4-axis linear interpolation control	1-axis fixed-feed control 2/3/4-axis fixed-feed control	2-axis circular interpolation control	Current value changing			JUMP instruction, NOP instruction, LOOP to LEND				
Basic parameters 1	Pr.1	Unit setting	⊙	⊙	⊙	△	⊙	⊙	⊙	⊙	⊙	⊙	-	
	Pr.2	No. of pulses per rotation (AP) (Unit: PLS)	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	12.3.2	
	Pr.3	Movement amount per rotation (AL)	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙		
	Pr.4	Unit magnification (AM)	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙		
	Pr.7	Bias speed at start	×	×	×	×	×	×	×	×	×	×	-	
Basic parameters 2	Pr.8	Speed limit value	⊙	⊙	⊙	⊙	⊙	⊙	-	-	-	⊙	12.4.1	
	Pr.9	Acceleration time 0	⊙	⊙	⊙	⊙	⊙	⊙	-	-	-	⊙	12.7.7	
	Pr.10	Deceleration time 0	⊙	⊙	⊙	⊙	⊙	⊙	-	-	-	⊙		
Detailed parameters 1	Pr.11	Back compensation amount	○	○	○	○	○	○	-	-	○	○	12.3.1	
	Pr.12	Software stroke limit upper limit value	-	○	○	○	○	○	-	-	○	○	12.4.3	
	Pr.13	Software stroke limit lower limit value	-	○	○	○	○	○	-	-	○	○		
	Pr.14	Software stroke limit selection	-	○	○	○	○	○	-	-	○	○		
	Pr.15	Software stroke limit valid/invalid selection	-	-	-	-	-	-	○	○	○	○		
	Pr.16	Command in-position width	-	○	○	○	-	○	-	-	-	-	12.7.6	
	Pr.17	Torque limit setting value	△	○	○	○	○	○	-	-	△	△	12.4.2	
	Pr.18	M code ON signal output timing	-	○	○	○	○	○	○	-	-	-	12.7.3	
	Pr.19	Speed switching mode	-	○	○	○	-	○	-	-	-	-	-	
	Pr.20	Interpolation speed designation method	-	△	△	△	△	-	-	-	-	-	-	
	Pr.21	Current feed value during speed control	-	-	-	-	○	○	-	-	-	-	-	
Pr.22	Input signal logic selection	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	⊙	-		
Pr.24	Manual pulse generator input selection	-	-	-	-	-	-	-	-	⊙	-	-		
Pr.200	Speed-position function selection	-	-	-	-	-	⊙	-	-	-	-	-		

- ⊙ : Always set
- : Set as required (Read "-" when not required.)
- × : Setting not possible
- △ : Setting restricted
- : Setting not required. (This is an irrelevant item, so the set value will be ignored. If the value is the default value or within the setting range, there is no problem.)

Positioning parameter	Control	Major positioning control								Manual control		Related sub function	
		OPR control	Position control			1 to 4 axis speed control	Speed-position or position-speed control	Other control		Manual pulse generator operation	JOG operation Inching operation		
			1-axis linear control 2/3/4-axis linear interpolation control	1-axis fixed-feed control 2/3/4-axis fixed-feed control	2-axis circular interpolation control			Current value changing	JUMP instruction, NOP instruction, LOOP to LEND				
Detailed parameters 2	Pr.25	Acceleration time 1	○	○	○	○	○	○	-	-	-	○	12.7.7
	Pr.26	Acceleration time 2	○	○	○	○	○	○	-	-	-	○	
	Pr.27	Acceleration time 3	○	○	○	○	○	○	-	-	-	○	
	Pr.28	Deceleration time 1	○	○	○	○	○	○	-	-	-	○	
	Pr.29	Deceleration time 2	○	○	○	○	○	○	-	-	-	○	
	Pr.30	Deceleration time 3	○	○	○	○	○	○	-	-	-	○	
	Pr.31	JOG speed limit value	-	-	-	-	-	-	-	-	-	⊙	12.4.1
	Pr.32	JOG operation acceleration time selection	-	-	-	-	-	-	-	-	-	⊙	-
	Pr.33	JOG operation deceleration time selection	-	-	-	-	-	-	-	-	-	⊙	-
	Pr.34	Acceleration/deceleration process selection	○	○	○	○	○	○	-	-	-	○	12.7.7
	Pr.35	S-pattern proportion	○	○	○	○	○	○	-	-	-	○	
	Pr.36	Sudden stop deceleration time	○	○	○	○	○	○	-	-	-	○	
	Pr.37	Stop group 1 sudden stop selection	○	○	○	○	○	○	-	-	-	○	
	Pr.38	Stop group 2 sudden stop selection	○	○	○	○	○	○	-	-	-	○	
	Pr.39	Stop group 3 sudden stop selection	○	○	○	○	○	○	-	-	-	○	
	Pr.40	Positioning complete signal output time	○	○	○	○	○	○	○	-	-	-	-
	Pr.41	Allowable circular interpolation error width	-	-	-	○	-	-	-	-	-	-	-
	Pr.42	External command function selection	○	○	○	○	○	⊙	○	-	-	○	12.5.1 12.7.2
Pr.201	Restart allowable range when servo OFF to ON	○	○	○	○	○	○	○	○	○	○	5.2.4	

- ⊙: Always set
- : Set as required ("—" when not set)
- : Setting not required (This is an irrelevant item, so the setting value will be ignored. If the value is the default value or within the setting range, there is no problem.)

■ Checking the positioning parameters

Pr.1 to Pr.42 are checked with the following timing.

- (1) When the "PLC READY signal [Y0]" output from the PLC CPU to the QD75 changes from OFF to ON
- (2) When the test operation button is turned ON in the test mode using GX Configurator-QP
- (3) When an error check is carried out with GX Configurator-QP

**REMARK**

ε "High-level positioning control" is carried out in combination with the "major positioning control". Refer to the "major positioning control" parameter settings for details on the parameters required for "high-level positioning control".

5.1.3 Setting items for OPR parameters

When carrying out "OPR control", the "OPR parameters" must be set. The setting items for the "OPR parameters" are shown below.

The "OPR parameters" are set commonly for each axis.

Refer to Chapter 8 "OPR control" for details on the "OPR control", and to Section 5.2 "List of parameters" for details on each setting item.

OPR parameters		OPR control				Machine OPR control		Fast OPR control
		Near-point dog method	Count method 1)	Count method 2)	Data set method			
OPR basic parameters	Pr.43	OPR method						○
	Pr.44	OPR direction	◎	◎	◎	◎		
	Pr.45	OP address	◎	◎	◎	◎		
	Pr.46	OPR speed	◎	◎	◎	-		
	Pr.47	Creep speed	◎	◎	◎	-		
	Pr.48	OPR retry	R	R	R	-		
OPR detailed parameters	Pr.49	OPR dwell time	-	-	-	-		
	Pr.50	Setting for the movement amount after near-point dog ON	-	◎	◎	-		
	Pr.51	OPR acceleration time selection	◎	◎	◎	-		
	Pr.52	OPR deceleration time selection	◎	◎	◎	-		
	Pr.53	OP shift amount	S	S	S	-		
	Pr.54	OPR torque limit value	-	-	-	-		
	Pr.56	Speed designation during OP shift	S	S	S	-		
	Pr.57	Dwell time during OPR retry	R	R	R	-		

◎ : Always set

○ : Preset parameters are used for machine OPR control.

- : Setting not required (This is an irrelevant item, so the setting value will be ignored. If the value is the default value or within the setting range, there is no problem.)

R : Set when using the "12.2.1 OPR retry function". ("-" when not set.)

S : Set when using the "12.2.2 OP shift function". ("-" when not set.)

■ Checking the OPR parameters.

Pr.43 to Pr.57 are checked with the following timing.

- (1) When the "PLC READY signal [Y0]" output from the PLC CPU to the QD75 changes from OFF to ON
- (2) When the test operation button is turned ON in the test mode using GX Configurator-QP
- (3) When an error check is carried out with GX Configurator-QP

5.1.4 Setting items for servo parameters

The servo parameters are used to control the servomotor and the data that is determined by the specification of the servo being used.

The table below lists items set to the servo parameters.

Servo amplifier		MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B	Remark
Servo parameters								
Servo basic parameters	Pr.100	Servo series	⊙	⊙	⊙	⊙	⊙	Refer to the section 5.2.7
	Pr.101	Amplifier setting	⊙	⊙	⊙	⊙	⊙	
	Pr.102	Regenerative brake resistor	⊙	⊙	⊙	⊙	⊙	
	Pr.103	Motor type	○	○	○	○	○	
	Pr.104	Motor capacity	⊙	⊙	⊙	⊙	⊙	
	Pr.105	Servo motor speed	○	○	○	○	○	
	Pr.106	Feed back pulse	⊙	⊙	⊙	⊙	⊙	
	Pr.107	Rotation direction selection	⊙	⊙	⊙	⊙	⊙	
	Pr.108	Auto tuning	○	○	○	○	○	
	Pr.109	Servo response	○	○	○	○	○	
Servo adjustment parameters	Pr.112	Load inertia ratio	△	△	△	△	△	
	Pr.113	Position loop gain 1	△	△	△	△	△	
	Pr.114	Speed loop gain 1	△	△	△	△	△	
	Pr.115	Position loop gain 2	△	△	△	△	△	
	Pr.116	Speed loop gain 2	△	△	△	△	△	
	Pr.117	Speed integral compensation	△	△	△	△	△	
	Pr.118	Machine resonance suppression filter	○	○	○	○	○	
	Pr.119	Feed forward gain	○	○	○	○	○	
	Pr.120	In-position range	○	○	○	○	○	
	Pr.121	Electromagnetic brake sequence output	○	○	○	○	○	
	Pr.122	Analog monitor output	○	○	○	○	- ○	
	Pr.123	Optional function 1	○	○	○	○	○ ○	
	Pr.124	Optional function 2	○	○	○	○	○ ○	
	Pr.125	Adaptive vibration suppression control/ low pass filter	-	-	-	○	- ○	

- ⊙: Always set
- : Set as required ("-" when not set)
- △: Setting restricted
- : Setting not required (This is an irrelevant item, so the setting value will be ignored. If the value is the default value or within the setting range, there is no problem.)

		Servo amplifier						Remark	
		MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B		
Servo parameters									
Servo expansion parameters 1	Pr.127	Monitor output 1 offset	○	○	○	○	-	○	
	Pr.128	Monitor output 2 offset	○	○	○	○	-	○	
	Pr.129	Pre-alarm data selection	○	○	-	-	-	-	
	Pr.130	Zero speed	○	○	○	○	○	○	
	Pr.131	Error excessive alarm level	○	○	○	○	○	○	
	Pr.132	Optional function 5	○	○	○	○	○	○	
	Pr.133	Optional function 6	-	-	-	○	-	○	
	Pr.134	PI-PID control switch-over position droop	○	○	○	○	○	○	
	Pr.136	Speed differential compensation	○	○	○	○	○	○	
	Pr.138	Encoder output pulses	-	-	-	○	-	○	
Servo expansion parameters 2	Pr.143	Slight vibration suppression control selection 1	-	-	-	○	-	○	Refer to the section 5.2.7
	Pr.144	Slight vibration suppression control selection 2	-	-	-	○	-	○	
	Pr.145	Induction voltage compensation	-	-	-	○	-	○	
	Pr.149	Gain changing selection	-	-	-	○	-	○	
	Pr.150	Gain changing condition	-	-	-	○	-	○	
	Pr.151	Gain changing time constant	-	-	-	○	-	○	
	Pr.152	Ratio of load inertia moment to servomotor inertia moment 2	-	-	-	○	-	○	
	Pr.153	Position loop gain 2 changing ratio	-	-	-	○	-	○	
	Pr.154	Speed loop gain 2 changing ratio	-	-	-	○	-	○	
	Pr.155	Speed integral compensation changing ratio	-	-	-	○	-	○	
Pr.160	Optional function C	-	-	-	○	-	○		
Pr.161	Machine resonance suppression filter 2	-	-	-	○	-	○		

- ⊙: Always set
- : Set as required ("—" when not set)
- △: Setting restricted
- : Setting not required (This is an irrelevant item, so the setting value will be ignored. If the value is the default value or within the setting range, there is no problem.)

5.1.5 Setting items for positioning data

Positioning data must be set for carrying out any "major positioning control". The table below lists the items to be set for producing the positioning data.

One to 600 positioning data items can be set for each axis.

For details of the major positioning controls, refer to Chapter 9 "Major Positioning Control". For details of the individual setting items, refer to Section 5.3 "List of positioning data".

Major positioning control			Position control					Other control					
			1-axis linear control 2/3/4-axis linear interpolation control	1-axis fixed-feed control 2/3/4-axis fixed-feed control	2-axis circular interpolation control	1 to 4 axis speed control	Speed-position switching control	Position-speed switching control	NOP instruction	Current value changing	JUMP instruction	LOOP	LEND
Positioning data													
Da.1	Operation pattern	Independent positioning control	⊙	⊙	⊙	⊙	⊙	⊙	-	⊙	-	-	-
		Continuous positioning control	⊙	⊙	⊙	×	⊙	×	-	⊙	-	-	-
		Continuous path control	⊙	×	⊙	×	×	×	-	×	-	-	-
Da.2	Control system	Linear 1 Linear 2 Linear 3 Linear 4 *	Fixed-feed 1 Fixed-feed 2 Fixed-feed 3 Fixed-feed 4	Circular sub Circular right Circular left *	Forward run speed 1 Reverse run speed 1 Forward run speed 2 Reverse run speed 2 Forward run speed 3 Reverse run speed 3 Forward run speed 4 Reverse run speed 4	Forward run speed/position Reverse run speed/position	Forward run position/speed Reverse run position/speed	NOP instruction	Current value changing	JUMP instruction	LOOP	LEND	
Da.3	Acceleration time No.	○	○	○	○	○	○	-	-	-	-	-	
Da.4	Deceleration time No.	○	○	○	○	○	○	-	-	-	-	-	
Da.5	Axis to be interpolated	⊙ : 2 axes - : 1/3/4 axes	-	-	-	-	-	-	-	-	-	-	
Da.6	Positioning address/movement amount	⊙	⊙	⊙	-	⊙	⊙	-	New address	-	-	-	
Da.7	Arc address	-	-	⊙	-	-	-	-	-	-	-	-	
Da.8	Command speed	⊙	⊙	⊙	⊙	⊙	⊙	-	-	-	-	-	
Da.9	Dwell time (JUMP destination positioning data No.)	○	○	○	○	○	○	-	-	JUMP destination positioning data No.	-	-	
Da.10	M code (JUMP condition data No.)	○	○	○	○	○	○	-	○	JUMP condition data No.	No. of LOOP to LEND repetitions	-	

- ⊙ : Always set
  - : Set as required (Read "-" when not required.)
  - × : Setting not possible
  - : Setting not required.
- (This is an irrelevant item, so the set value will be ignored. If the value is the default value or within the setting range, there is no problem.)
- \* : Two control systems are available: the absolute (ABS) system and incremental (INC) system.



**■ Checking the positioning data**

The items Da.1 to Da.10 are checked at the following timings:

- (1) Startup of a positioning operation
- (2) Error check performed by GX Configurator-QP



## 5.1.6 Setting items for block start data

The "block start data" must be set when carrying out "high-level positioning control".

The setting items for the " block start data" are shown below.

Up to 50 points of " block start data" can be set for each axis.

Refer to Chapter 10 "High-level Positioning Control" for details on the "high-level positioning control", and to Section 5.4 "List of block start data" for details on each setting item.

High-level positioning control		Block start (Normal start)	Condition start	Wait start	Simultaneous start	Repeated start (FOR loop)	Repeated start (FOR condition)
Block start data							
Da.11	Shape (end/continue)	○	○	○	○	○	○
Da.12	Start data No.	○	○	○	○	○	○
Da.13	Special start instruction	—	○	○	○	○	○
Da.14	Parameter	—	○	○	○	○	○

○ : Set as required ("—" when not set)

— : Setting not required (This is an irrelevant item, so the setting value will be ignored. If the value is the default value or within the setting range, there is no problem.)

#### ■ Checking the block start data

Da.11 to Da.14 are checked with the following timing.

- (1) When the "Block start data" starts
- (2) When an error check is carried out with GX Configurator-QP

## 5.1.7 Setting items for condition data

When carrying out "high-level positioning control" or using the JUMP instruction in the "major positioning control", the "condition data" must be set as required. The setting items for the "condition data" are shown below.

Up to 10 "condition data" items can be set for each axis.

Refer to Chapter 10 "High-level Positioning Control" for details on the "high-level positioning control", and to Section 5.5 "List of condition data" for details on each setting item.

Control		Major positioning control		High-level positioning control					
		Other than JUMP instruction	JUMP instruction	Block start (Normal start)	Condition start	Wait start	Simultaneous start	Repeated start (FOR loop)	Repeated start (FOR condition)
Da.15	Condition target	—	○	—	○	○	○	—	○
Da.16	Condition operator	—	○	—	○	○	○	—	○
Da.17	Address	—	△	—	△	△	—	—	△
Da.18	Parameter 1	—	○	—	○	○	△	—	○
Da.19	Parameter 2	—	△	—	△	△	△	—	△

○ : Set as required ("—" when not set)

△ : Setting limited

— : Setting not required (This is an irrelevant item, so the setting value will be ignored. If the value is the default value or within the setting range, there is no problem.)

#### ■ Checking the condition data

Da.15 to Da.19 are checked with the following timing.

- (1) When the "Block start data" starts
- (2) When "JUMP instruction" starts
- (3) When an error check is carried out with GX Configurator-QP

## 5.1.8 Types and roles of monitor data

The monitor data area in the buffer memory stores data relating to the operating state of the positioning system, which are monitored as required while the positioning system is operating.

The following data are available for monitoring.

≠ System monitoring:

Monitoring of the QD75 configuration and operation history (through the system monitor data [Md.1] through [Md.19] )

≠ Axis operation monitoring:

Monitoring of the current position and speed, and other data related to the movements of axes (through the axis monitor data [Md.20] through [Md.48] )

\* The axis monitor data are refreshed every 3.5 ms. Note that "[Md.21] Machine feed value" and "[Md.22] Feedrate" are refreshed every 56.8ms. Also, "[Md.23] Valid M code", is updated when the "M code ON signal [X4, X5, X6, X7]" turns ON.

## [1] Monitoring the system

## ■ Monitoring the positioning system operation history

Monitoring details		Corresponding item		
Whether the system is in the test mode or not		[Md.1]	In test mode flag	
History of data that started an operation	Start information	[Md.3]	Start information	
	Start No.	[Md.4]	Start No.	
	Start	Hour	[Md.5]	Start (Hour)
		Minute:second	[Md.6]	Start (Minute:second)
	Error upon starting		[Md.7]	Error judgment
	Latest pointer No.		[Md.8]	Start history pointer
History of all errors	Axis in which the error occurred		[Md.9] Axis in which the error occurred	
	Axis error No.		[Md.10] Axis error No.	
	Axis error occurrence	Hour	[Md.11]	Axis error occurrence (Hour)
		Minute:second	[Md.12]	Axis error occurrence (Minute:second)
	Latest pointer No.		[Md.13]	Error history pointer
History of all warnings	Axis in which the warning occurred		[Md.14] Axis in which the warning occurred	
	Axis warning No.		[Md.15] Axis warning No.	
	Axis warning occurrence	Hour	[Md.16]	Axis warning occurrence (Hour)
		Minute:second	[Md.17]	Axis warning occurrence (Minute:second)
	Latest pointer No.		[Md.18]	Warning history pointer
Number of write accesses to the flash ROM after the power is switched ON	Number of write accesses to flash ROM	[Md.19]	No. of write accesses to flash ROM	

[2] Monitoring the axis operation state

■ Monitoring the position

Monitor details	Corresponding item
Monitor the current machine feed value	<a href="#">Md.21</a> Machine feed value
Monitor the current "current feed value"	<a href="#">Md.20</a> Current feed value
Monitor the current target value	<a href="#">Md.32</a> Target value

■ Monitoring the speed

Monitor details		Corresponding item	
Monitor the current speed	During independent axis control	Indicates the speed of each axis	
	During interpolation control	When "0: Composite speed" is set for " <a href="#">Pr.20</a> Interpolation speed designation method"	Indicates the composite speed <a href="#">Md.22</a> Feedrate
		When "1: Reference axis speed" is set for " <a href="#">Pr.20</a> Interpolation speed designation method"	Indicates the reference axis speed
	Constantly indicates the speed of each axis		<a href="#">Md.28</a> Axis feedrate
Monitor the current target speed		<a href="#">Md.33</a> Target speed	

■ Monitoring the state

Monitor details	Corresponding item
Monitor the axis operation state	Md.26 Axis operation status
Monitor the latest error code that occurred with the axis	Md.23 Axis error No.
Monitor the latest warning code that occurred with the axis	Md.24 Axis warning No.
Monitor the external input/output signal and flag	Md.30 External input/output signal Md.31 Status
Monitor the valid M codes	Md.25 Valid M code
Monitor whether the speed is being limited	Md.39 In speed control flag
Monitor whether the speed is being changed	Md.40 In speed change processing flag
Monitor the "start data" point currently being executed	Md.43 Start data pointer being executed
Monitor the "positioning data No." currently being executed	Md.44 Positioning data No. being executed
Monitor the remaining No. of repetitions (special start)	Md.41 Special start repetition counter
Monitor the remaining No. of repetitions (control system)	Md.42 Control system repetition counter
Monitor the block No.	Md.45 Block No. being executed
Monitor the current torque limit value	Md.35 Torque limit stored value
Monitor the "instruction code" of the special start data when using special start	Md.36 Special start data instruction code setting value
Monitor the "instruction parameter" of the special start data when using special start	Md.37 Special start data instruction parameter setting value
Monitor the "start data No." of the special start data when using special start	Md.38 Start positioning data No. setting value
Monitor the "positioning data No." executed last	Md.46 Last executed positioning data No.
Monitor the positioning data currently being executed	Md.47 Positioning data being executed
Monitor the movement amount after the current position control switching when using "speed-position switching control (INC mode)".	Md.29 Speed-position switching control positioning amount
Monitor switching from the constant speed status or acceleration status to the deceleration status during position control whose operation pattern is "Positioning complete"	Md.48 Deceleration start flag





## 5.1.9 Types and roles of control data

Operation of the positioning system is achieved through the execution of necessary controls. (Data required for controls are given through the default values when the power is switched ON, which can be modified as required by the PLC program.) Controls are performed over system data or machine operation.

≠ Controlling the system data :

Setting and resetting QD75 setting data (through the system control data Cd.1 , Cd.2 and Cd.41 )

≠ Controlling the operation :

Setting operation parameters, changing speed during operation, interrupting or restarting operation (through the axis control data Cd.3 to Cd.42 )

## [1] Controlling the system data

## ■ Setting and resetting the setting data

Control details	Controlled data item
Write setting data from buffer memory to flash ROM.	<span style="border: 1px solid black; padding: 0 2px;">Cd.1</span> Flash ROM write request
Reset (initialize) parameters.	<span style="border: 1px solid black; padding: 0 2px;">Cd.2</span> Parameter initialization request

## [2] Controlling the operation

## ■ Controlling the operation

Control details	Corresponding item
Set which positioning to execute (start No.).	Cd.3 Positioning start No.
Clear (reset) the axis error ( Md.23 ) and warning ( Md.24 ).	Cd.5 Axis error reset
Issue instruction to restart (When axis operation is stopped).	Cd.6 Restart command
End current positioning (deceleration stop), and start next positioning.	Cd.37 Skip command
Set start point No. for executing block start.	Cd.4 Positioning starting point No.
Stop continuous control.	Cd.18 Interrupt request during continuous operation
Set start data Nos. for axes that start up simultaneously.	Cd.30 Simultaneous starting axis start data No. (axis 1 start data No.)
	Cd.31 Simultaneous starting axis start data No. (axis 2 start data No.)
	Cd.32 Simultaneous starting axis start data No. (axis 3 start data No.)
	Cd.33 Simultaneous starting axis start data No. (axis 4 start data No.)
Specify write destination for teaching results.	Cd.38 Teaching data selection
Specify data to be taught.	Cd.39 Teaching positioning data No.

## ■ Controlling operation per step

Control details	Corresponding item
Stop positioning operation after each operation.	Cd.35 Step valid flag
Set unit to carry out step.	Cd.34 Step mode
Issue instruction to continuous operation or restart from stopped step.	Cd.36 Step start information

## ■ Controlling the speed

Control details	Corresponding item
Set new speed when changing speed during operation.	Cd.14 New speed value
Issue instruction to change speed in operation to Cd.14 value. (Only during positioning operation and JOG operation).	Cd.15 Speed change request
Change positioning operation speed between 1 and 300% range.	Cd.13 Positioning operation speed override
Set inching movement amount.	Cd.16 Inching movement amount
Set JOG speed.	Cd.17 JOG speed
When changing acceleration time during speed change, set new acceleration time.	Cd.10 New acceleration time value
When changing deceleration time during speed change, set new deceleration time.	Cd.11 New deceleration time value
Set acceleration/deceleration time validity during speed change.	Cd.12 Acceleration/deceleration time change during speed change, enable/disable selection


■ Making settings related to operation

Control details	Corresponding item
Turn M code ON signal OFF.	<a href="#">Cd.7</a> M code OFF request
Set new value when changing current value.	<a href="#">Cd.9</a> New current value
Validate speed-position switching signal from external source.	<a href="#">Cd.24</a> Speed-position switching enable flag
Change movement amount for position control during speed-position switching control (INC mode).	<a href="#">Cd.23</a> Speed-position switching control movement amount change register
Validate external position-speed switching signal.	<a href="#">Cd.26</a> Position-speed switching enable flag
Change speed for speed control during position-speed switching control.	<a href="#">Cd.25</a> Position-speed switching control speed change register
Set up a flag when target position is changed during positioning.	<a href="#">Cd.29</a> Target position change request flag
Set new positioning address when changing target position during positioning.	<a href="#">Cd.27</a> Target position change value(new address)
Set new speed when changing target position during positioning.	<a href="#">Cd.28</a> Target position change value(new speed)
Set absolute (ABS) moving direction in degrees.	<a href="#">Cd.40</a> ABS direction in degrees
Set manual pulse generator operation validity.	<a href="#">Cd.21</a> Manual pulse generator enable flag
Set scale per pulse of No. of input pulses from manual pulse generator.	<a href="#">Cd.20</a> Manual pulse generator 1 pulse input magnification
Change OPR request flag from "ON to OFF".	<a href="#">Cd.19</a> OPR request flag OFF request
Validate external command signal.	<a href="#">Cd.8</a> External command valid
Change <a href="#">Md.35</a> Torque limit stored value.	<a href="#">Cd.22</a> New torque value
Set whether " <a href="#">Md.48</a> Deceleration start flag" is valid or invalid	<a href="#">Cd.41</a> Deceleration start flag valid
Set the stop command processing for deceleration stop function (deceleration curve re-processing/deceleration curve continuation)	<a href="#">Cd.42</a> Stop command processing for deceleration stop selection
Turn Servo ON/OFF command ON by the buffer memory ON.	<a href="#">Cd.100</a> Servo OFF command
Set torque limit value	<a href="#">Cd.101</a> Torque output setting



5.2 List of parameters

5.2.1 Basic parameters 1

Item	Setting value, setting range		Default value	Setting value buffer memory address					
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4		
<b>Pr.1</b> Unit setting	0 : mm 1 : inch 2 : degree 3 : PLS	0 1 2 3	3	0	150	300	450		
Movement amount per pulse	<b>Pr.2</b> No. of pulses per rotation (AP) (Unit : PLS)	1 to 200000000	20000	2 3	152 153	302 303	452 453	*	
	<b>Pr.3</b> Movement amount per rotation (AL)	The setting value range differs according to the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set.  [Table 1] on right page		20000	4 5	154 155	304 305	454 455	*
	<b>Pr.4</b> Unit magnification (AM)	1 : 1 times 10 : 10 times 100 : 100 times 1000 : 1000 times	1 10 100 1000	1	1	151	301	451	*
<b>Pr.7</b> Bias speed at start	Not used		0	6 7	156 157	306 307	456 457		

\*: This buffer memory address in QD75M is different from QD75P.

**Pr.1** Unit setting

Set the unit used for defining positioning operations. Choose from the following units depending on the type of the control target: mm, inch, degree, or PLS. Different units can be defined for different axes (axis 1 to 4).

(Example) Different units (mm, inch, degree, and PLS) are applicable to different systems:

- mm or inch .... X-Y table, conveyor (Select mm or inch depending on the machine specifications.)
- degree ..... Rotating body (360 degrees/rotation)
- PLS..... X-Y table, conveyor

- When you change the unit, note that the values of other parameters and data will not be changed automatically. After changing the unit, check if the parameter and data values are within the allowable range. Set "degree" to exercise speed-position switching control (ABS mode).

**Pr.2** to **Pr.4** Electronic gear

Mechanical system value used when the QD75 performs positioning control.

The settings are made using **Pr.2** to **Pr.4**.

The electronic gear is expressed by the following equation.

$$\text{Electronic gear} = \frac{\text{No. of pulses per rotation (AP)}}{\text{Movement amount per rotation (AL)} \times \text{Unit magnification (AM)}}$$

- When positioning has been performed, an error (mechanical system error) may be produced between the specified movement amount and the actual movement amount. (Refer to Section 12.3.2 "Electronic gear function".)

**Pr.2** No. of pulses per rotation (AP)

Set the number of pulses required for a complete rotation of the motor shaft.

If you are using the Mitsubishi servo amplifier MR-H-BN/MR-J2-B/MR-J2S-B/MR-J2-03B5 set the value given as the "resolution per servomotor rotation" in the speed/position detector specifications.

No. of pulses per rotation (AP) = Resolution per servomotor rotation

[Table 1]

<b>Pr.1</b> setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)*1
0 : mm	0.1 to 2000000.0 (σm)	1 to 200000000 (Δ10 <sup>-1</sup> σm)
1 : inch	0.00001 to 2000.00000 (inch)	1 to 200000000 (Δ10 <sup>-5</sup> inch)
2 : degree	0.00001 to 2000.00000 (degree)	1 to 200000000 (Δ10 <sup>-5</sup> degree)
3 : PLS	1 to 200000000 (PLS)	1 to 200000000 (PLS)

**Pr.3** Movement amount per rotation (AL), **Pr.4** Unit magnification (AM)

The amount how the workpiece moves with one motor rotation is determined by the mechanical structure.

If the worm gear lead (σm/rev) is PB and the deceleration rate is 1/n, then

$$\text{Movement amount per rotation (AL)} = \text{PB} \Delta 1/n$$

However, the maximum value that can be set for this "movement amount per rotation (AL)" parameter is 20000000.0σm (20m). Set the "movement amount per rotation (AL)" as shown below so that the "movement amount per rotation (AL)" does not exceed this maximum value.

$$\begin{aligned} \text{Movement amount per rotation (AL)} \\ &= \text{PB} \Delta 1/n \\ &= \text{Movement amount per rotation (AL)} \Delta \text{Unit magnification (AM)} \end{aligned}$$

Note) The unit magnification (AM) is a value of 1, 10, 100 or 1000. If the "PB Δ 1/n" value exceeds 20000000.0σm (20m), adjust with the unit magnification so that the "movement amount per rotation (AL)" does not exceed 20000000.0σm (20m).

\*1: Refer to the section 12.3.2 Electric gear function information about electric gear.


**Pr.7** Bias speed at start

Do not set other than the default value "0".





## 5.2.2 Basic parameters 2

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
[Pr.8] Speed limit value	The setting range differs depending on the " [Pr.1] Unit setting". Here, the value within the [Table 1] range is set. <div style="border: 1px solid gray; padding: 5px; display: inline-block;">  [Table 1] on right page           </div>		200000	10 11	160 161	310 311	460 461
[Pr.9] Acceleration time 0	1 to 8388608 (ms)	1 to 8388608 (ms)	1000	12 13	162 163	312 313	462 463
[Pr.10] Deceleration time 0	1 to 8388608 (ms)	1 to 8388608 (ms)	1000	14 15	164 165	314 315	464 465

[Table 1]

[Pr.1] setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0.01 to 20000000.00 (mm/min)	1 to 2000000000 ( $\times 10^{-2}$ mm/min)
1 : inch	0.001 to 2000000.000 (inch/min)	1 to 2000000000 ( $\times 10^{-3}$ inch/min)
2 : degree	0.001 to 2000000.000 (degree/min)	1 to 2000000000 ( $\times 10^{-3}$ degree/min)
3 : PLS	1 to 10000000 (PLS/s)	1 to 10000000 (PLS/s)

**[Pr.8] Speed limit value**

Set the maximum speed during positioning and OPR operations.

The maximum speed during positioning control has to be limited in consideration of the drive unit and control target specifications.


Take account of the following when determining the speed limit value:

- 1) Motor speed
- 2) Workpiece movement speed

**[Pr.9] Acceleration time 0, [Pr.10] Deceleration time 0**



"[Pr.9] Acceleration time 0" specifies the time for the speed to increase from zero to the speed limit value ( [Pr.8] ).

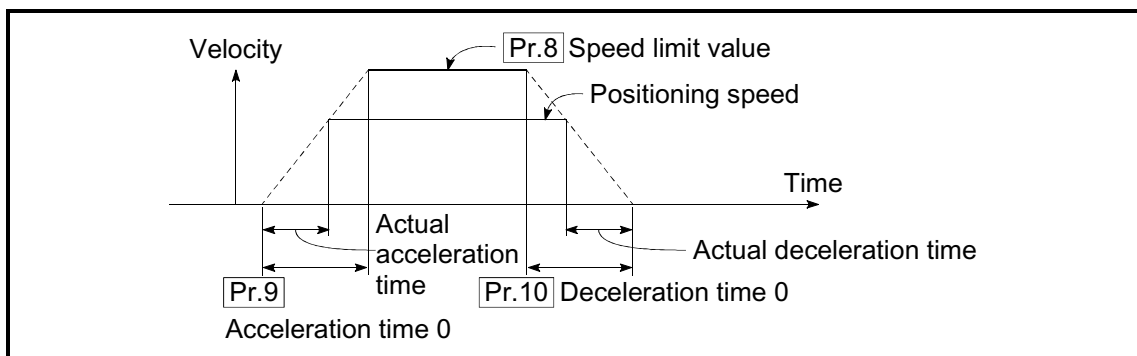"[Pr.10] Deceleration time 0" specifies the time for the speed to decrease from the speed limit value ( [Pr.8] ) to zero.



- 1) If the positioning speed is set lower than the parameter-defined speed limit value, the actual acceleration/deceleration time will be relatively short. Thus, set the maximum positioning speed equal to or only a little lower than the parameter-defined speed limit value.
- 2) These settings are valid for OPR, positioning and JOG operations.
- 3) When the positioning involves interpolation, the acceleration/deceleration time defined for the reference axis is valid.


5.2.3 Detailed parameters 1

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Pr.11</b> Backlash compensation amount	The setting value range differs according to the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set. 		0	17	167	317	467
<b>Pr.12</b> Software stroke limit upper limit value	The setting value range differs according to the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 2] range is set.		2147483647	18 19	168 169	318 319	468 469
<b>Pr.13</b> Software stroke limit lower limit value			-2147483648	20 21	170 171	320 321	470 471
<b>Pr.14</b> Software stroke limit selection	0 : Apply software stroke limit on current feed value	0	0	22	172	322	472
	1 : Apply software stroke limit on machine feed value	1					
<b>Pr.15</b> Software stroke limit valid/invalid setting	0 : Software stroke limit valid during JOG operation, inching operation and manual pulse generator operation	0	0	23	173	323	473
	1 : Software stroke limit invalid during JOG operation, inching operation and manual pulse generator operation	1					

**Pr.11** Backlash compensation amount

The error that occurs due to backlash when moving the machine via gears can be compensated.

When the backlash compensation amount is set, pulses equivalent to the compensation amount will be output each time the direction changes during positioning.

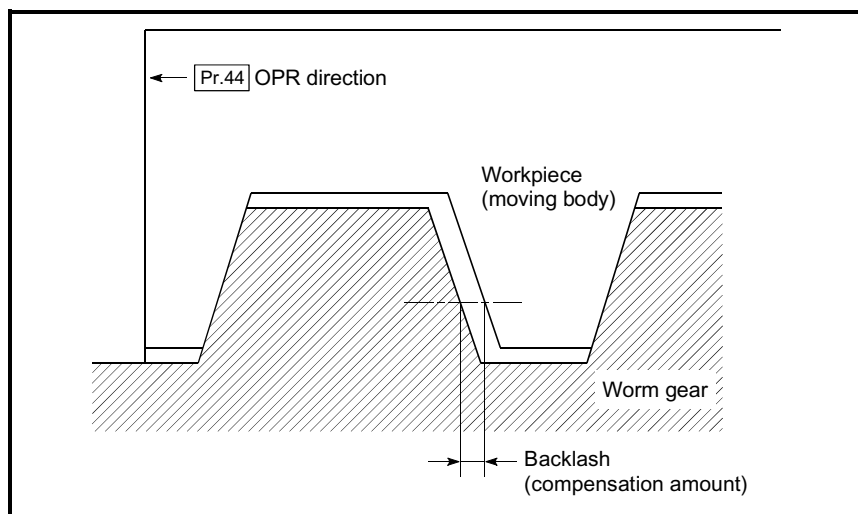

- 1) The backlash compensation is valid after machine OPR. Thus, if the backlash compensation amount is set or changed, always carry out machine OPR once.
- 2) " **Pr.2** No. of pulses per rotation", " **Pr.3** Movement amount per pulse" and " **Pr.11** Backlash compensation amount" which satisfies the following (1) can be set up.

$$0 \Omega \frac{(\text{Pr.11 Backlash compensation amount}) \times (\text{Pr.2 No. of pulses per rotation})}{(\text{Pr.3 Movement amount per pulse})} (= A) \Omega 65535 \text{ (PLS) } \dots(1)$$

An error (error code: 920) occurs when " Pr.2 No. of pulses per rotation", " Pr.3 Movement amount per pulse" and " Pr.11 Backlash compensation amount" setting range is 0 to 65535. (the calculation result of the following (1) ) A servo alarm (error code: 2032, 2035 etc.) may be made to occur by kinds of servo amplifier (servomotor), load inertia and the amount of command of a cycle time (QD75) is set so that the calculation result of the following (1) may satisfy " Pr.2 No. of pulses per rotation", " Pr.3 Movement amount per pulse" and " Pr.11 Backlash compensation amount" setting range is 65536 and lower 0.

$$A \Omega \frac{(\text{Maximum motor speed (r/min)}) \times 1.2 \times (\text{Encoder resolution (PLS/r)}) \times 3.5 \text{ (ms)}}{60(\text{s}) \times 1000 \text{ (ms)}} \text{ (PLS) } \dots(2)$$

[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit) *
0 : mm	0 to 6553.5 (σm)	0 to 65535 (Δ10 <sup>-1</sup> σm)
1 : inch	0 to 0.65535 (inch)	0 to 65535 (Δ10 <sup>-5</sup> inch)
2 : degree	0 to 0.65535 (degree)	0 to 65535 (Δ10 <sup>-5</sup> degree)
3 : PLS	0 to 65535 (PLS)	0 to 65535 (PLS)

\* 1 to 32767 : Set as a decimal  
 32768 to 65535 : Convert into hexadecimal and set

[Table 2]


Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	-214748364.8 to 214748364.7 (σm)	-2147483648 to 2147483647 (Δ10 <sup>-1</sup> σm)
1 : inch	-21474.83648 to 21474.83647 (inch)	-2147483648 to 2147483647 (Δ10 <sup>-5</sup> inch)
2 : degree	0 to 359.99999 (degree)	0 to 359999999 (Δ10 <sup>-5</sup> degree)
3 : PLS	-2147483648 to 2147483647 (PLS)	-2147483648 to 2147483647 (PLS)

**Pr.12 Software stroke limit upper limit value**

Set the upper limit for the machine's movement range during positioning control.

**Pr.13 Software stroke limit lower limit value**

Set the lower limit for the machine's movement range during positioning control.

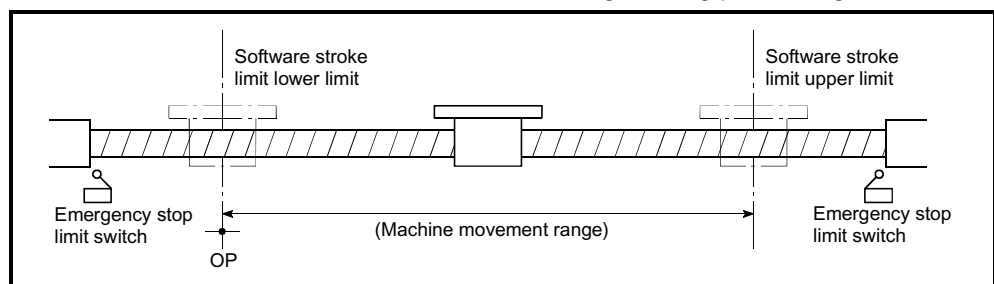

- 1) Generally, the OP is set at the lower limit or upper limit of the stroke limit.
- 2) By setting the upper limit value or lower limit value of the software stroke limit, overrun can be prevented in the software. However, an emergency stop limit switch must be installed nearby outside the range.  
 To invalidate the software stroke limit, set the setting value to "upper limit value = lower limit value". (The setting value can be anything.)  
 When the unit is "degree", the software stroke limit check is invalid during speed control (including speed-position switching control, position-speed switching control) or during manual control.


**Pr.14** Software stroke limit selection

Set whether to apply the software stroke limit on the "current feed value" or the "machine feed value". The software stroke limit will be validated according to the set value.

To invalidate the software stroke limit, set the setting value to "current feed value".


**Pr.15** Software stroke limit valid/invalid setting

Set whether to validate the software stroke limit during JOG/Inching operation and manual pulse generator operation.

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Pr.16</b> Command in-position width	The setting value range differs depending on the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set. 		100	24 25	174 175	324 325	474 475
<b>Pr.17</b> Torque limit setting value	1 to 500 (%)	1 to 500 (%)	300	26	176	326	476
<b>Pr.18</b> M code ON signal output timing	0 : WITH mode	0	0	27	177	327	477
	1 : AFTER mode	1					

**Pr.16** Command in-position width

Set the remaining distance that turns the command in-position ON. The command in-position signal is used as a front-loading signal of the positioning complete signal. When positioning control is started, the "command in-position flag" (3rd flag from right) in " **Md.31** Status" turns OFF, and the "command in-position flag" turns ON at the set position of the command in-position signal.

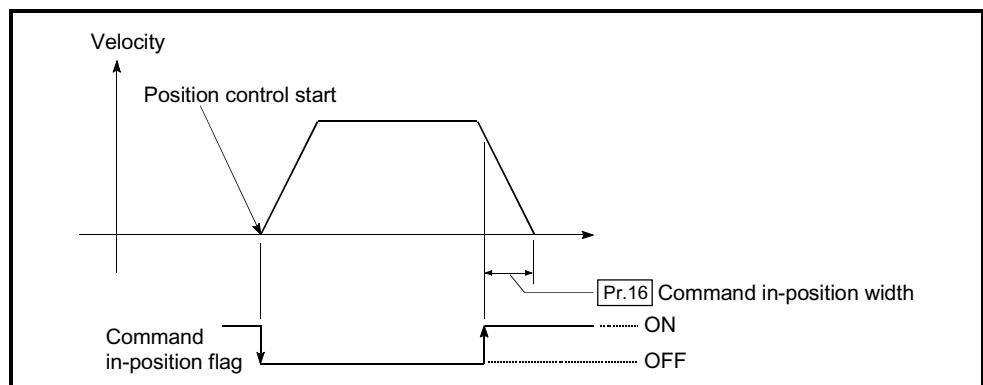

**Pr.17** Torque limit setting value

Set the maximum value of the torque generated by the servomotor as a percentage between 1 and 500%.

\* The torque limit function limits the torque generated by the servomotor within the set range.

If the torque required for control exceeds the torque limit value, it is controlled with the set torque limit value.

(Refer to "12.4.2 Torque limit function ".)


[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0.1 to 214748364.7 (μm)	1 to 2147483647 (×10 <sup>-1</sup> μm)
1 : inch	0.00001 to 21474.83647 (inch)	1 to 2147483647 (×10 <sup>-5</sup> inch)
2 : degree	0.00001 to 21474.83647 (degree)	1 to 2147483647 (×10 <sup>-5</sup> degree)
3 : PLS	1 to 2147483647 (PLS)	1 to 2147483647 (PLS)

**Pr.18** M code ON signal output timing

This parameter sets the M code ON signal output timing.

Choose either WITH mode or AFTER mode as the M code ON signal output timing.

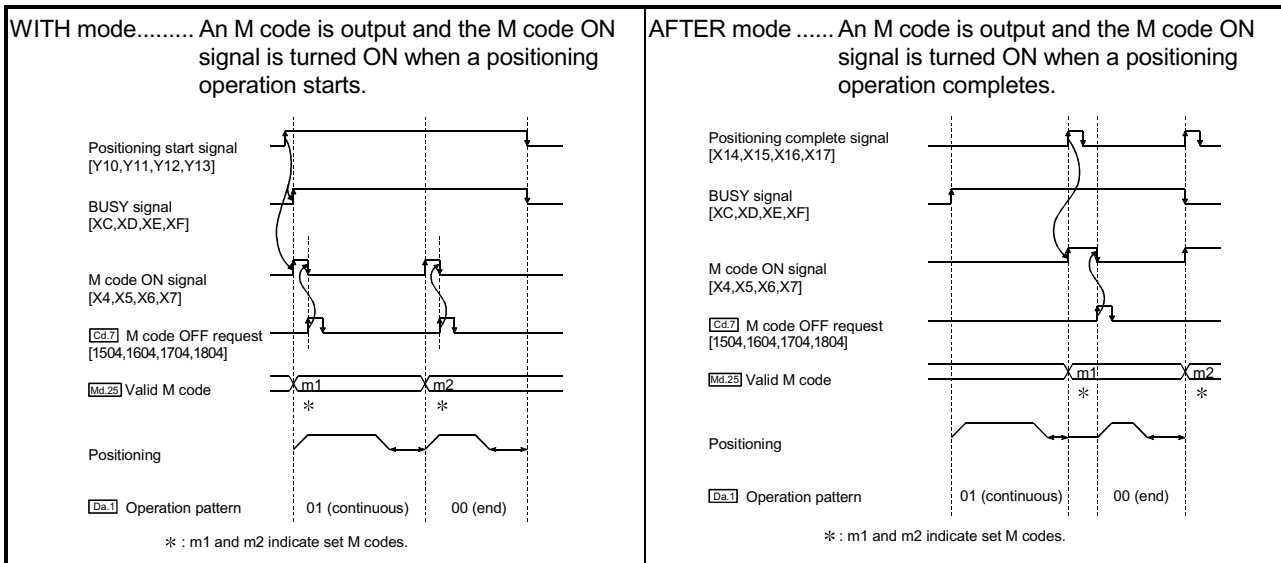

Note: If AFTER mode is used with speed control, an M code will not be output and the M code ON signal will not be turned ON.

An M code is a number between 0 and 65535 that can be assigned to each positioning data ( [Da.10] ).


The sequence program can be coded to read an M code from the buffer memory address specified by " [Md.25] Valid M code" whenever the M code ON signal [X4, X5, X6, X7] turns ON so that a command for the sub work (e.g. clamping, drilling, tool change) associated with the M code can be issued.

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
Pr.19 Speed switching mode	0 : Standard speed switching mode	0	0	28	178	328	478
	1 : Front-loading speed switching mode	1					
Pr.20 Interpolation speed designation method	0 : Composite speed	0	0	29	179	329	479
	1 : Reference axis speed	1					
Pr.21 Current feed value during speed control	0 : Do not update current feed value	0	0	30	180	330	480
	1 : Update current feed value	1					
	2 : Clear current feed value to zero	2					
Pr.22 Input signal logic selection	b0	Lower limit	0	31	181	331	481
	b1	Upper limit					
	b2	Not used					
	b3	Stop signal					
	b4	External command					
	b5	Not used					
	b6	Near-point signal					
	b7	Not used					
	b8	Manual pulse generator input					
	b9 to b15	Not used					
		0: Negative logic 1: Positive logic					
Pr.24 Manual pulse generator input selection	0: A-phase/B-phase multiplied by 4	0	0	33	-	-	-
	1: A-phase/B-phase multiplied by 2	1					
	2: A-phase/B-phase multiplied by 1	2					
	3: PLS/SIGN	3					
Pr.200 Speed-position function selection	0: Speed-position switching control (INC mode)	0	0	34	184	334	484
	2: Speed-position switching control (ABS mode)	2					

**Pr.19** Speed switching mode

Set whether to switch the speed switching mode with the standard switching or front-loading switching mode.


- 0 : Standard switching..... Switch the speed when executing the next positioning data.
- 1 : Front-loading switching..... The speed switches at the end of the positioning data currently being executed.

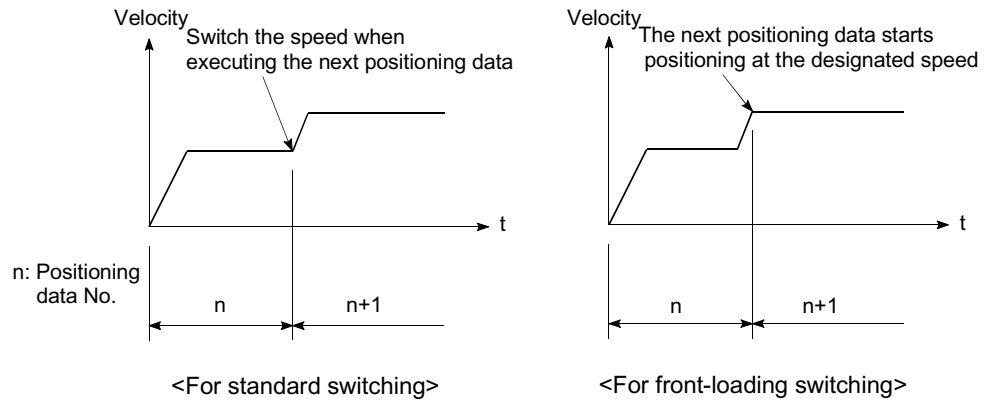

**Pr.20** Interpolation speed designation method

When carrying out linear interpolation/circular interpolation, set whether to designate the composite speed or reference axis speed.

- 0: Composite speed ..... The movement speed for the control target is designated, and the speed for each axis is calculated by the QD75.
- 1: Reference axis speed ..... The axis speed set for the reference axis is designated, and the speed for the other axis carrying out interpolation is calculated by the QD75.

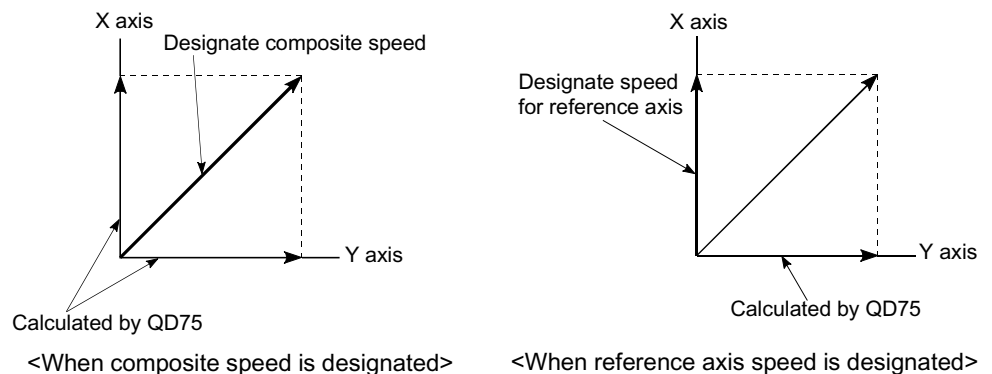

**Note:** Always specify the reference axis speed if the 4-axis linear interpolation or 2 to 4 axis speed control has to be performed.  
 If you specify the composite speed for a positioning operation that involves the 4-axis linear interpolation or 2 to 4 axis speed control, the error code 523 "interpolation mode error" will be output when the positioning operation is attempted.  
 For a positioning operation that involves the circular interpolation, specify the composite speed always.



**Pr.21** Current feed value during speed control

Specify whether you wish to enable or disable the update of " **Md.20** Current feed value" while operations are performed under the speed control (including the speed-position and position-speed switching control).

0: The update of the current feed value is disabled

The current feed value will not change.  
(The value at the beginning of the speed control will be kept.)

1: The update of the current feed value is enabled

The current feed value will be updated.  
(The current feed value will change from the initial.)

2: The current feed value is cleared to zero

The current feed will be set initially to zero and change from zero while the speed control is in effect.

Note1: When the speed control is performed over two to four axes, the choice between enabling and disabling the update of " **Md.20** Current feed value" depends on how the reference axis is set.

Note2: Set "1" to exercise speed-position switching control (ABS mode).

**Pr.22** Input signal logic selection

Set the input signal logic that matches the signaling specification of the connected external device.

Negative logic

(1) When the input signal contact is not flowed with the current.

(a) FLS, RLS → ON (Limit signal turn ON)

(b) DOG, STOP, CHG → OFF

(2) When the input signal contact is flowed with the current.

(a) FLS, RLS → OFF (Limit signal turn OFF)

(b) DOG, STOP, CHG → ON

Positive logic

Opposite the concept of negative logic.

Note1: A mismatch in the signal logic will disable normal operation. Be careful of this when you change from the default value.

Note2: Set the manual pulse generator input logic selection (b8) to axis 1. (Setting of any of axes 2 to 4 is invalid.)

**Pr.24** Manual pulse generator input selection

Set the manual pulse generator input pulse mode. (Only the value specified against the axis 1 is valid.)

- 0: A-phase/B-phase; multiplied by 4
- 1: A-phase/B-phase; multiplied by 2
- 2: A-phase/B-phase; multiplied by 1
- 3: PLS/SIGN


**Pr.200** Speed-position function selection

Select the mode of speed-position switching control.

- 0: INC mode
- 2: ABS mode

Note1: If the setting is other than 0 and 2, operation is performed in the INC mode with the setting regarded as 0.

5.2.4 Detailed parameters 2

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Pr.25</b> Acceleration time 1	1 to 8388608 (ms)	1 to 8388608 (ms)	1000	36	186	336	486
<b>Pr.26</b> Acceleration time 2				37	187	337	487
<b>Pr.27</b> Acceleration time 3				38	188	338	488
<b>Pr.28</b> Deceleration time 1				39	189	339	489
<b>Pr.29</b> Deceleration time 2				40	190	340	490
<b>Pr.30</b> Deceleration time 3				41	191	341	491
				42	192	342	492
	43	193	343	493			
	44	194	344	494			
	45	195	345	495			
	46	196	346	496			
	47	197	347	497			
<b>Pr.31</b> JOG speed limit value	The setting range differs depending on the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set.		20000	48	198	348	498
				49	199	349	499
<b>Pr.32</b> JOG operation acceleration time selection	0: <b>Pr.9</b> Acceleration time 0	0	0	50	200	350	500
	1: <b>Pr.25</b> Acceleration time 1	1					
	2: <b>Pr.26</b> Acceleration time 2	2					
	3: <b>Pr.27</b> Acceleration time 3	3					
<b>Pr.33</b> JOG operation deceleration time selection	0: <b>Pr.10</b> Deceleration time 0	0	0	51	201	351	501
	1: <b>Pr.28</b> Deceleration time 1	1					
	2: <b>Pr.29</b> Deceleration time 2	2					
	3: <b>Pr.30</b> Deceleration time 3	3					

**Pr.25** Acceleration time 1 to **Pr.27** Acceleration time 3

These parameters set the time for the speed to increase from zero to the speed limit value ( **Pr.8** ) during a positioning operation.

**Pr.28** Deceleration time 1 to **Pr.30** Deceleration time 3

These parameters set the time for the speed to decrease from the speed limit value ( **Pr.8** ) to zero during a positioning operation.

[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0.01 to 20000000.00 (mm/min)	1 to 2000000000 ( $\Delta 10^{-2}$ mm/min)
1 : inch	0.001 to 2000000.000 (inch/min)	1 to 2000000000 ( $\Delta 10^{-3}$ inch/min)
2 : degree	0.001 to 2000000.000 (degree/min)	1 to 2000000000 ( $\Delta 10^{-3}$ degree/min)
3 : PLS	1 to 10000000 (PLS/s)	1 to 10000000 (PLS/s)

\*1: For Select type, refer to GX Configurator-QP Operating Manual.

### Pr.31 JOG speed limit value

Set the maximum speed for JOG operation.

Note) ≠ Set the "JOG speed limit value" to less than " Pr.8 Speed limit value".  
If the "speed limit value" is exceeded, the "JOG speed limit value error" (error code: 956) will occur.

### Pr.32 JOG operation acceleration time selection

Set which of "acceleration time 0 to 3" to use for the acceleration time during JOG operation.

- 0 : Use value set in " Pr.9 Acceleration time 0".
- 1 : Use value set in " Pr.25 Acceleration time 1".
- 2 : Use value set in " Pr.26 Acceleration time 2".
- 3 : Use value set in " Pr.27 Acceleration time 3".

### Pr.33 JOG operation deceleration time selection

Set which of "deceleration time 0 to 3" to use for the deceleration time during JOG operation.


- 0 : Use value set in " Pr.10 Deceleration time 0".
- 1 : Use value set in " Pr.28 Deceleration time 1".
- 2 : Use value set in " Pr.29 Deceleration time 2".
- 3 : Use value set in " Pr.30 Deceleration time 3".

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
Pr.34 Acceleration/deceleration process selection	0 : Automatic trapezoid acceleration/deceleration process 1 : S-pattern acceleration/deceleration process	0 1	0	52	202	352	502
Pr.35 S-pattern ratio	1 to 100 (%)	1 to 100 (%)	100	53	203	353	503
Pr.36 Sudden stop deceleration time	1 to 8388608 (ms)	1 to 8388608 (ms)	1000	54 55	204 205	354 355	504 505
Pr.37 Stop group 1 sudden stop selection	0 : Normal deceleration stop 1 : Sudden stop	0 1	0	56	206	356	506
Pr.38 Stop group 2 sudden stop selection				57	207	357	507
Pr.39 Stop group 3 sudden stop selection				58	208	358	508


**Pr.34** Acceleration/deceleration process selection

Set whether to use automatic trapezoid acceleration/deceleration or S-pattern acceleration/deceleration for the acceleration/deceleration process.

Note) Refer to Section 12.7.7 "Acceleration/deceleration process function" for details.

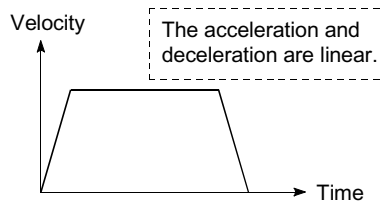

<Automatic trapezoid acceleration/deceleration>

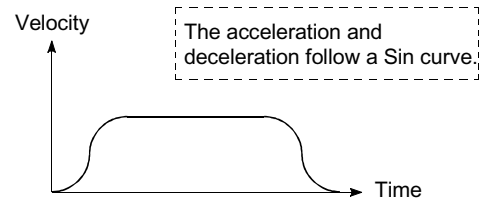


<S-pattern acceleration/deceleration>

**Pr.35** S-pattern ratio

Set the S-pattern ratio (1 to 100%) for carrying out the S-pattern acceleration/deceleration process.


The S-pattern ratio indicates where to draw the acceleration/deceleration curve using the Sin curve as shown below.

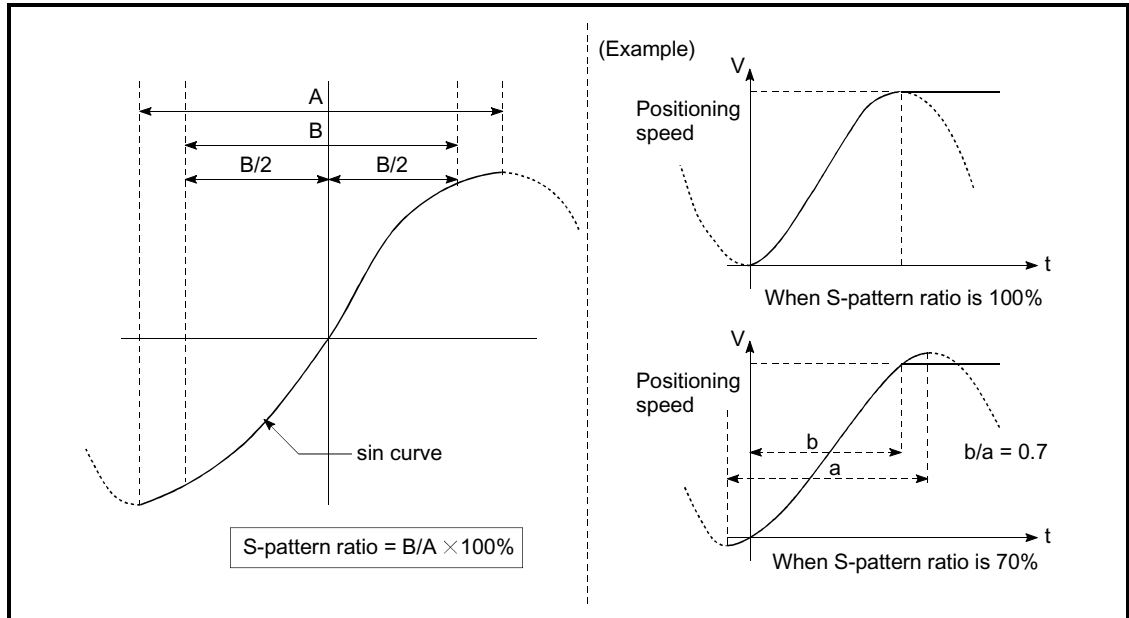

**Pr.36** Sudden stop deceleration time

Set the time to reach speed 0 from " **Pr.8** Speed limit value" during the sudden stop.

The illustration below shows the relationships with other parameters.

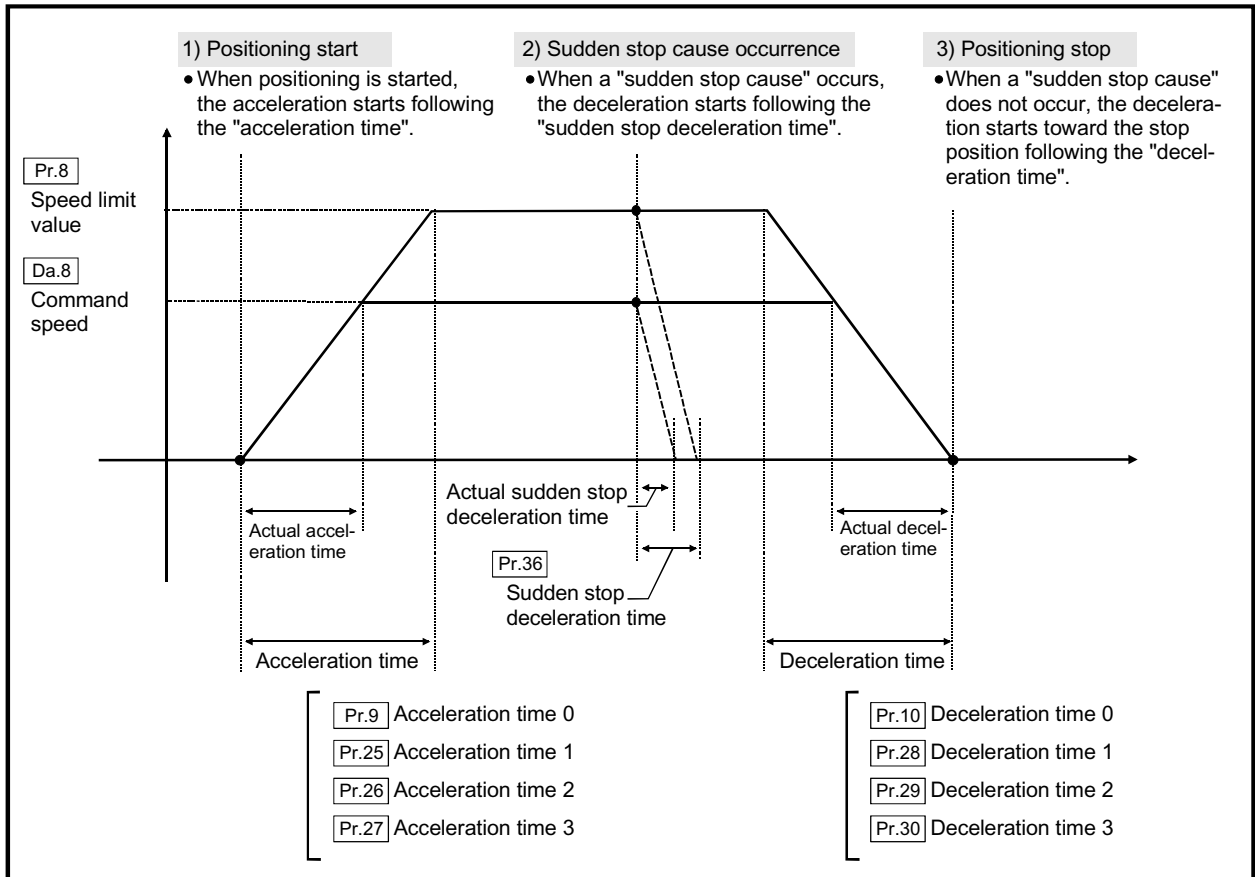

**Pr.37** Stop group 1 sudden stop selection

to

**Pr.39** Stop group 3 sudden stop selection


Set the method to stop when the stop causes in the following stop groups occur.

- ≠ Stop group 1 ..... Stop with hardware stroke limit
- ≠ Stop group 2 ..... Error occurrence of the PLC CPU, PLC READY signal [Y0] OFF, Fault in test mode
- ≠ Stop group 3 ..... External stop signal
  - Stop signal from PLC CPU
  - Stop signal from peripheral device
  - Error occurrence (excludes errors in stop groups 1 and 2: includes only the software stroke limit errors during JOG operation, speed control, speed-position switching control, and position-speed switching control)
  - Stop made when the near-point dog signal turns from OFF to ON in counter method machine OPR

The methods of stopping include "0: Normal deceleration stop" and "1: Sudden stop".

If "1: Sudden stop" is selected, the axis will suddenly decelerate to a stop when the stop signal is input.




Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Pr.40</b> Positioning complete signal output time	0 to 65535 (ms)	0 to 65535 (ms) 0 to 32767 : Set as a decimal 32768 to 65535: Convert into hexadecimal and set	300	59	209	359	509
<b>Pr.41</b> Allowable circular interpolation error width	The setting value range differs depending on the " [Pr.1] Unit setting". Here, the value within the [Table 1] range is set. 		100	60 61	210 211	360 361	510 511
<b>Pr.42</b> External command function selection	0: External positioning start	0	0	62	212	362	512
	1: External speed change request	1					
	2: Speed-position, position-speed switching request	2					
	3: Skip request	3					
<b>Pr.201</b> Restart allowable range when servo OFF to ON	0, 1 to 163840 [PLS] 0: restart not allowed		0	64 65	214 215	364 365	514 515

**Pr.40** Positioning complete signal output time

Set the output time of the positioning complete signal [X14, X15, X16, X17] output from the QD75.

A positioning completes when the specified dwell time has passed after the QD75 had terminated the output.

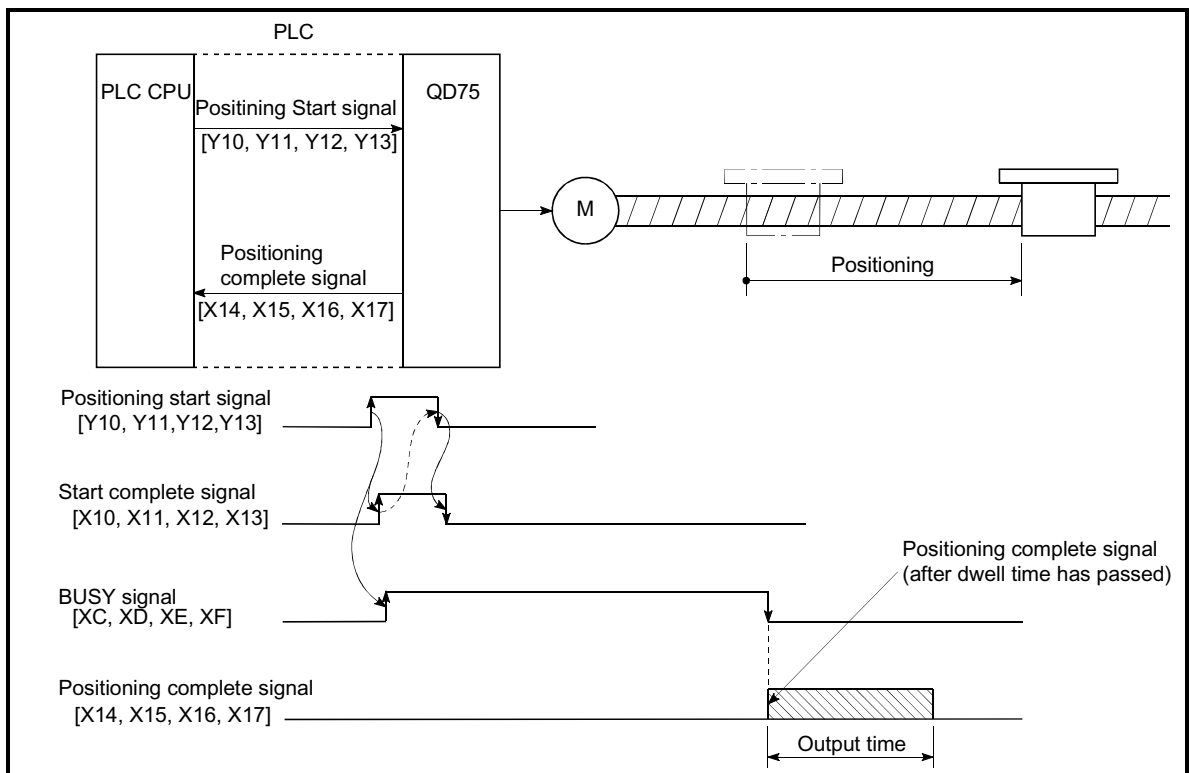

Positioning complete signal output time

[Table 1]


Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0 to 10000.0 ( $\sigma\text{m}$ )	0 to 100000 ( $\Delta 10^{-1}\sigma\text{m}$ )
1 : inch	0 to 1.00000 (inch)	0 to 100000 ( $\Delta 10^{-5}\text{inch}$ )
2 : degree	0 to 1.00000 (degree)	0 to 100000 ( $\Delta 10^{-5}\text{degree}$ )
3 : PLS	0 to 100000 (PLS)	0 to 100000 (PLS)

#### Pr.41 Allowable circular interpolation error width

With the "allowable circular interpolation error width", the allowable error range of the calculated arc path and end point address is set. If the error of the calculated arc path and end point address is within the set range, circular interpolation will be carried out to the set end point address while compensating the error with spiral interpolation.

The allowable circular interpolation error width is set in the following axis buffer memory addresses.

- ≠ If axis 1 is the reference axis, set in the axis 1 buffer memory address [60, 61].
- ≠ If axis 2 is the reference axis, set in the axis 2 buffer memory address [210, 211].
- ≠ If axis 3 is the reference axis, set in the axis 3 buffer memory address [360, 361].
- ≠ If axis 4 is the reference axis, set in the axis 4 buffer memory address [510, 511].

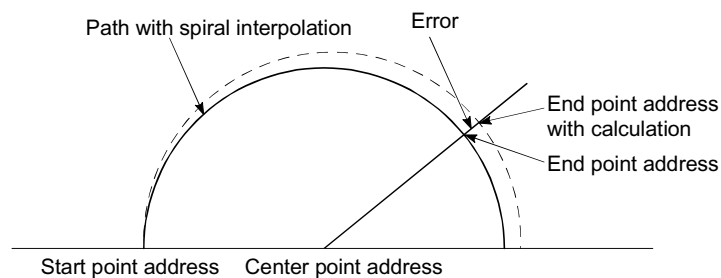

- \* With circular interpolation control using the center point designation, the arc path calculated with the start point address and center point address and the end point address may deviate.

**Pr.42** External command function selection

Select a command with which the external command signal should be associated.

## 0: External positioning start

The external command signal input is used to start a positioning operation.

## 1: External speed change request

The external command signal input is used to change the speed in the current positioning operation. The new speed should be set in the " **Cd.14** Speed change value"

## 2: Speed-position, position-speed switching request

The external command signal input is used to switch from the speed control to the position control while in the speed-position switching control mode, or from the position control to the speed control while in the position-speed switching control mode.

To enable the speed-position switching control, set the " **Cd.24** Speed-position switching enable flag" to "1".

To enable the position-speed switching control, set the " **Cd.26** Position-speed switching enable flag" to "1".

## 3: Skip request

The external command signal input is used skip the current positioning operation.

**POINT**

To enable the external command signal, set the " **Cd.8** External command enable" to "1".

**Pr.201** Restart allowable range when servo OFF to ON

## (1) What is the restart function when servo OFF to ON ?


The QD75 restart function when servo OFF changes to ON, performs continuous positioning operation (positioning start, restart) when the servo is switched from OFF to ON in the stopped state (including servo emergency stop).

Restart when servo OFF changes to ON can be performed when the difference between the last command position for the QD75 when it stopped and the present value when servo OFF changed to ON, is less than the value set in the buffer memory for the restart allowable range setting.


## (a) Servo emergency stop processing

- 1) For stop caused by a servo emergency stop signal, positioning operation is judged as stopped and can be restarted if the difference between the last command position for the QD75 when the servo stop signal turned ON and present value at the time the servo stop signal turned OFF is lower than the value set in the buffer memory for the restart allowable range setting.

- 2) When the difference between the last command position of the QD75 at the time the servo stop signal turned ON and the present value at the time the servo stop signal turned OFF is greater than the value set in the buffer memory for the restart allowable range setting, the positioning operation is judged as on-standby and cannot be restarted.

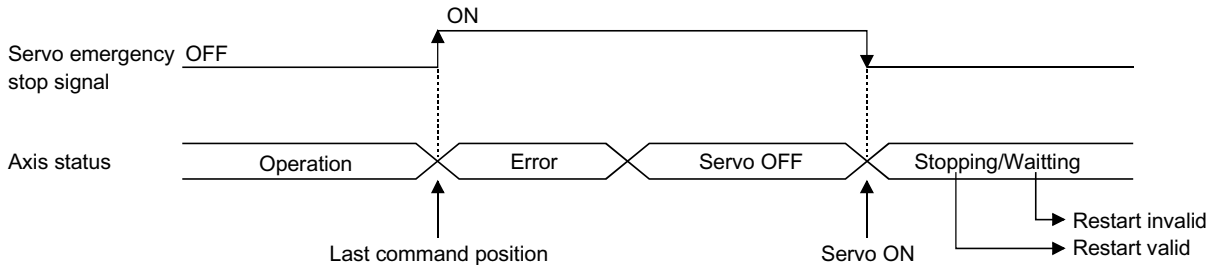

- (b) Processing when the servo ON signal changes from OFF to ON.
  - 1) The positioning operation is stopped and restart can be performed when the difference between the last command position of the QD75 when the servo ON signal went from OFF to ON is lower than the value set in the buffer memory for restart allowable range setting.
  - 2) When the difference between the last command position of the QD75 at the time the servo ON signal when from ON to OFF and the present value at the time the servo ON signal went from OFF to ON is greater than the value set in the buffer memory for the restart allowable range setting, the positioning operation is judged as on-standby and cannot be restarted.

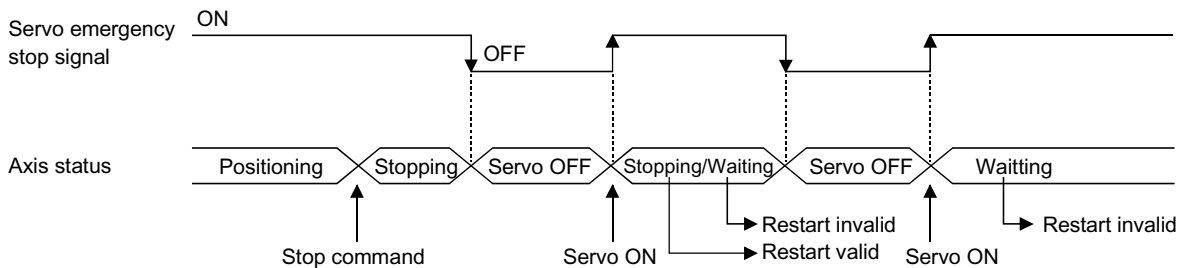


(2) Setting method

When performing restart at the time servo OFF changes to ON, set the restart allowable range in the following buffer memory.

Setting value buffer memory address				Item	Setting range	Default value
Axis 1	Axis 2	Axis 3	Axis 4			
64 65	214 215	364 365	514 515	Pr.201 Restart allowable range setting when servo OFF changes to ON	0, 1 to 163840 (PLS) 0: restart not allowed	0

[Setting example]


A program in which the restart allowable range for axis 1 is set to 10000 PLS is shown below.

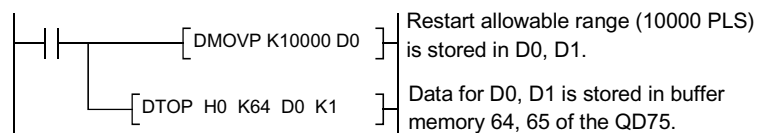


## (3) Precautionary notes

- (a) The setting for the "restart allowable range when servo OFF changes to ON" is validated when the PLC READY signal (Y0) rises (OFF to ON). After setting the "restart allowable range when servo OFF changes to ON", the PLC READY signal (Y0) rises (OFF to ON).
- (b) The difference between the last command position when the servo turned OFF and the present value when the servo turned ON, is output at the first operation of restart. If the restart allowable range is large at this time, an overload may occur on the servo side. Set the "restart allowable range when servo OFF changes to ON" to a value where the mechanical system will not be affected by a signal output.
- (c) The restart servo OFF changes to ON is valid only for the first time servo OFF changes to ON. From the second time servo OFF changes to ON, the setting for restart allowable range when servo OFF changes to ON is disregarded.
- (d) Execute servo OFF when the mechanical system is in complete stop state. The restart when servo OFF changes to ON cannot be applied to a system in which the mechanical system operated by external pressure or other force while the servo is OFF.
- (e) Restart can only be executed while the operating status of the axis is "stop". Restart cannot be executed when the operation status of the axis is other than "stop".
- (f) Do not restart while a stop command is ON. If restart is executed while stopped, an error (error code 106: Started during stop command ON) is generated, and the operating status of the axis becomes "ERR". Therefore, restart cannot be performed even if the error is reset.
- (g) Restart can also be executed while the positioning starts signal is ON. However do not set the positioning start signal from OFF to ON while stopped. If the positioning start signal switches ON from OFF, positioning is performed from the positioning data number set in the buffer memory at 1500 or from the positioning data number of the specified point.
- (h) If positioning is terminated by a continuous-operation interrupt request, restart cannot be performed. If a restart request is made, a warning (warning code 104: Restart disabled) is generated.

[Operation at the time an emergency stop is input]

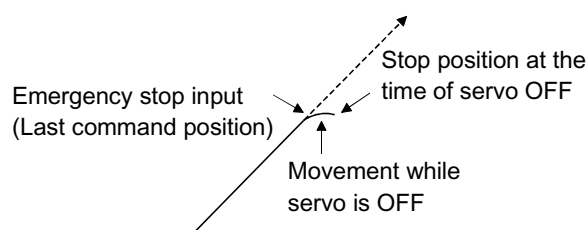

[Operation when a restart is performed]

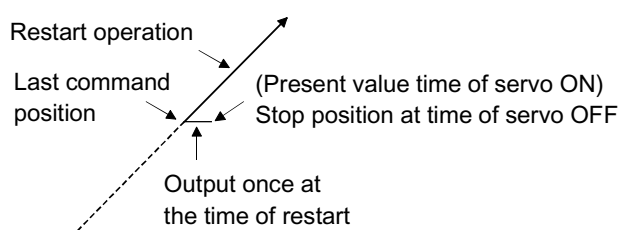



5.2.5 OPR basic parameters

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
Pr.43 OPR method	0 : Near-point dog method	0	0	70	220	370	520
	4 : Count method 1)	4					
	5 : Count method 2)	5					
	6 : Data set method	6					

Pr.43 OPR method

Set the "OPR method" for carrying out machine OPR.

- 0 : Near-point dog method ..... After decelerating at the near-point dog ON, stop at the zero signal and complete the machine OPR.
- 4 : Count method 1) ..... After decelerating at the near-point dog ON, move the designated distance, and complete the machine OPR with the zero signal.
- 5 : Count method 2) ..... After decelerating at the near-point dog ON, move the designated distance, and complete the machine OPR.
- 6 : Data set method..... The position where the machine OPR has been made will be the OP.


Note) Refer to Section 8.2.2 "Machine OPR method" for details on the OPR methods.

OPR method

0 : Near-point dog method

- (1) Start machine OPR.  
(Start movement at the " Pr.46 OPR speed" in the " Pr.44 OPR direction".)
- (2) Detect the near-point dog ON, and start deceleration.
- (3) Decelerate to " Pr.47 Creep speed", and move with the creep speed.  
(At this time, the near-point dog must be ON. If the near-point dog is OFF, the axis will decelerate to a stop.)
- (4) At the first zero signal after the near-point dog turned OFF, machine OPR is completed.


Note) After the servo amplifier has been turned on, the zero point of the encoder must be passed at least once before point A is reached.

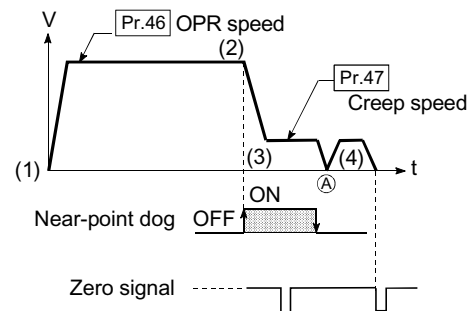

4 : Count method 1)


- (1) Start machine OPR.  
(Start movement at the " [Pr.46] OPR speed" in the " [Pr.44] OPR direction".)
- (2) Detect the near-point dog ON, and start deceleration.
- (3) Decelerate to " [Pr.47] Creep speed", and move with the creep speed.
- (4) After the near-point dog turns ON and the movement amount set in " [Pr.50] Setting for the movement amount after near-point dog ON" has passed, the QD75 stops with the first zero signal, and the machine OPR is completed.

Note) After the servo amplifier has been turned on, the zero point of the encoder must be passed at least once before point A is reached.

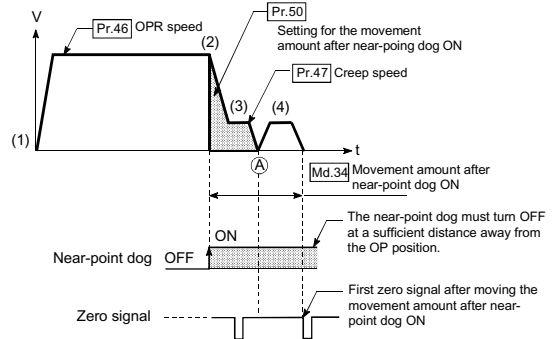

5 : Count method 2)

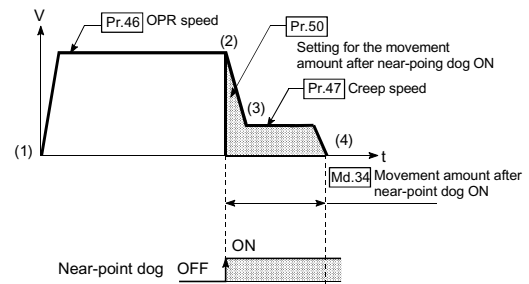

- (1) Start machine OPR.  
(Start movement at the " [Pr.46] OPR speed" in the " [Pr.44] OPR direction".)
- (2) Detect the near-point dog ON, and start deceleration.
- (3) Decelerate to " [Pr.47] Creep speed", and move with the creep speed.
- (4) After the near-point dog turns ON and the movement amount set in " [Pr.50] Setting for the movement amount after near-point dog ON" has passed, machine OPR is completed.



6 : Data set method

The position where the machine OPR has been made will be the OP.  
(Perform after the servo amplifier has been turned ON and the servomotor has been rotated at least once using the JOG or similar operation.)



Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
Pr.44 OPR direction	0 : Positive direction (address increment direction) 1 : Negative direction (address decrement direction)	0 1	0	71	221	371	521
Pr.45 OP address	The setting value range differs depending on the " Pr.1 Unit setting". Here, the value within the [Table 1] range is set. 		0	72 73	222 223	372 373	522 523
Pr.46 OPR speed	The setting value range differs depending on the " Pr.1 Unit setting". Here, the value within the [Table 2] range is set. 		1	74 75	224 225	374 375	524 525

**Pr.44** OPR direction

Set the direction to start movement when starting machine OPR.


0: Positive direction (address increment direction)

Moves in the direction that the address increments. (Arrow 2))

1: Negative direction (address decrement direction)

Moves in the direction that the address decrements. (Arrow 1))

Normally, the OP is set near the lower limit or the upper limit, so " Pr.44 OPR direction" is set as shown below.

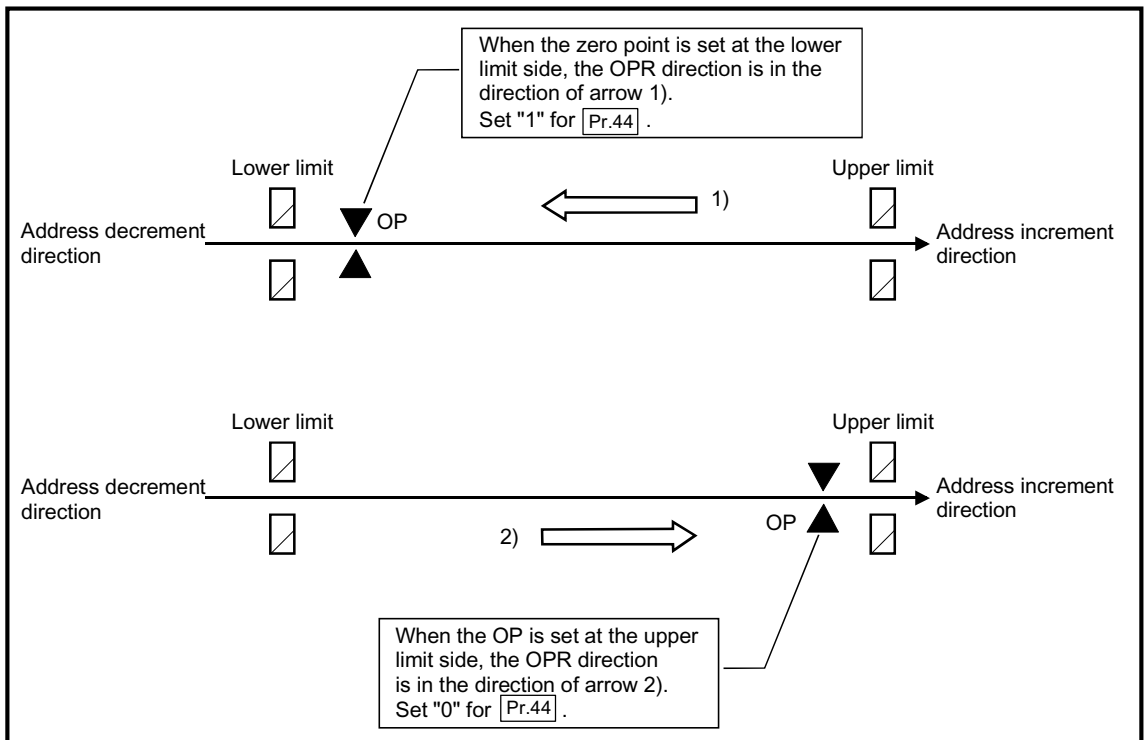

[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	-214748364.8 to 214748364.7 ( $\sigma\text{m}$ )	-2147483648 to 2147483647 ( $\Delta 10^{-1}\sigma\text{m}$ )
1 : inch	-21474.83648 to 21474.83647 (inch)	-2147483648 to 2147483647 ( $\Delta 10^{-5}\text{inch}$ )
2 : degree	0 to 359.99999 (degree)	0 to 35999999 ( $\Delta 10^{-5}\text{degree}$ )
3 : PLS	-2147483648 to 2147483647 (PLS)	-2147483648 to 2147483647 (PLS)

[Table 2]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0.01 to 20000000.00 (mm/min)	1 to 200000000 ( $\Delta 10^{-2}\text{mm/min}$ )
1 : inch	0.001 to 2000000.000 (inch/min)	1 to 200000000 ( $\Delta 10^{-3}\text{inch/min}$ )
2 : degree	0.001 to 2000000.000 (degree/min)	1 to 200000000 ( $\Delta 10^{-3}\text{degree/min}$ )
3 : PLS	1 to 10000000 (PLS/s)	1 to 10000000 (PLS/s)

**Pr.45** OP address

Set the address used as the reference point for positioning control (ABS system). (When the machine OPR is completed, the stop position address is changed to the address set in "Pr.45 OP address". At the same time, the "Pr.45 OP address" is stored in "Md.20 Current feed value" and "Md.21 Machine feed value".)

**Pr.46** OPR speed

Set the speed for OPR.

Note) Set the "OPR speed" to less than "Pr.8 Speed limit value". If the "speed limit value" is exceeded, the "OPR speed" will be limited by "Pr.8 Speed limit value".


The "OPR speed" should be equal to or faster than the "Pr.7 Bias speed at start" and "Pr.47 Creep speed".

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
[Pr.47] Creep speed	The setting value range differs depending on the " [Pr.1] Unit setting". Here, the value within the [Table 1] range is set. <div style="border: 1px solid gray; padding: 5px; margin-top: 10px; display: inline-block;">  [Table 1] on right page                 </div>		1	76 77	226 227	376 377	526 527
[Pr.48] OPR retry	0 : Do not retry OPR with limit switch 1 : Retry OPR with limit switch	0 1	0	78	228	378	528

**[Pr.47] Creep speed**

Set the creep speed after near-point dog ON (the low speed just before stopping after decelerating from the OPR speed).  
 The creep speed is set within the following range.

$$(\text{[Pr.46] OPR speed}) \geq (\text{[Pr.47] Creep speed})$$

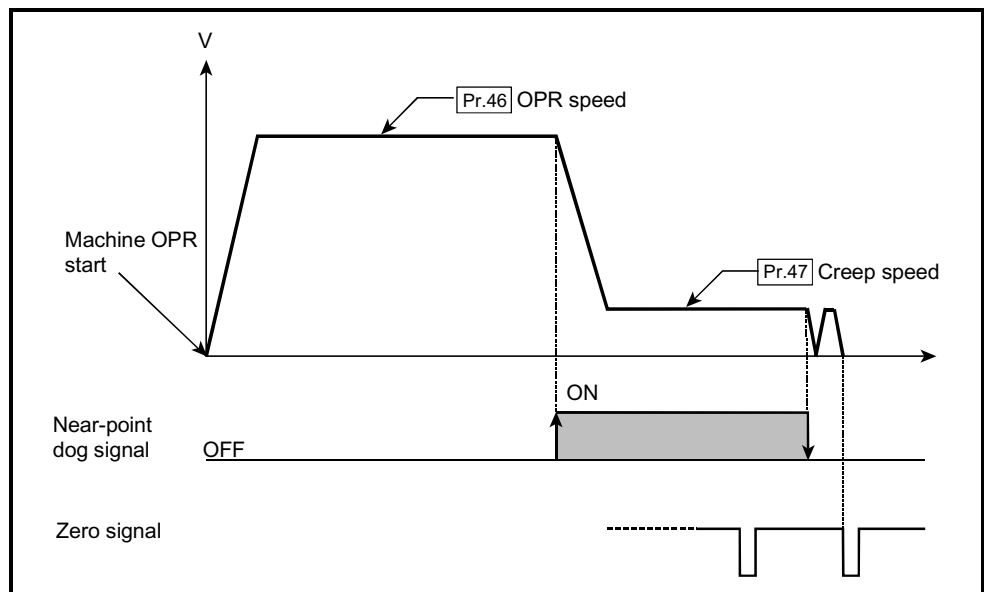


[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0.01 to 20000000.00 (mm/min)	1 to 2000000000 ( $\Delta 10^{-2}$ mm/min)
1 : inch	0.001 to 2000000.000 (inch/min)	1 to 2000000000 ( $\Delta 10^{-3}$ inch/min)
2 : degree	0.001 to 2000000.000 (degree/min)	1 to 2000000000 ( $\Delta 10^{-3}$ degree/min)
3 : PLS	1 to 10000000 (PLS/s)	1 to 10000000 (PLS/s)


**Pr.48 OPR retry**

Set whether to carry out OPR retry.

When the OPR retry function is validated and the machine OPR is started, first the axis will move in the OPR direction (1). If the upper/lower limit signal turns OFF before the near-point dog signal ON is detected (2), the axis will decelerate to a stop, and then will move in the direction opposite the OPR direction (3). If the following edge of the near-point dog signal is detected during movement in the opposite direction, the axis will decelerate to a stop (4), and then will carry out machine OPR again (5, 6)).

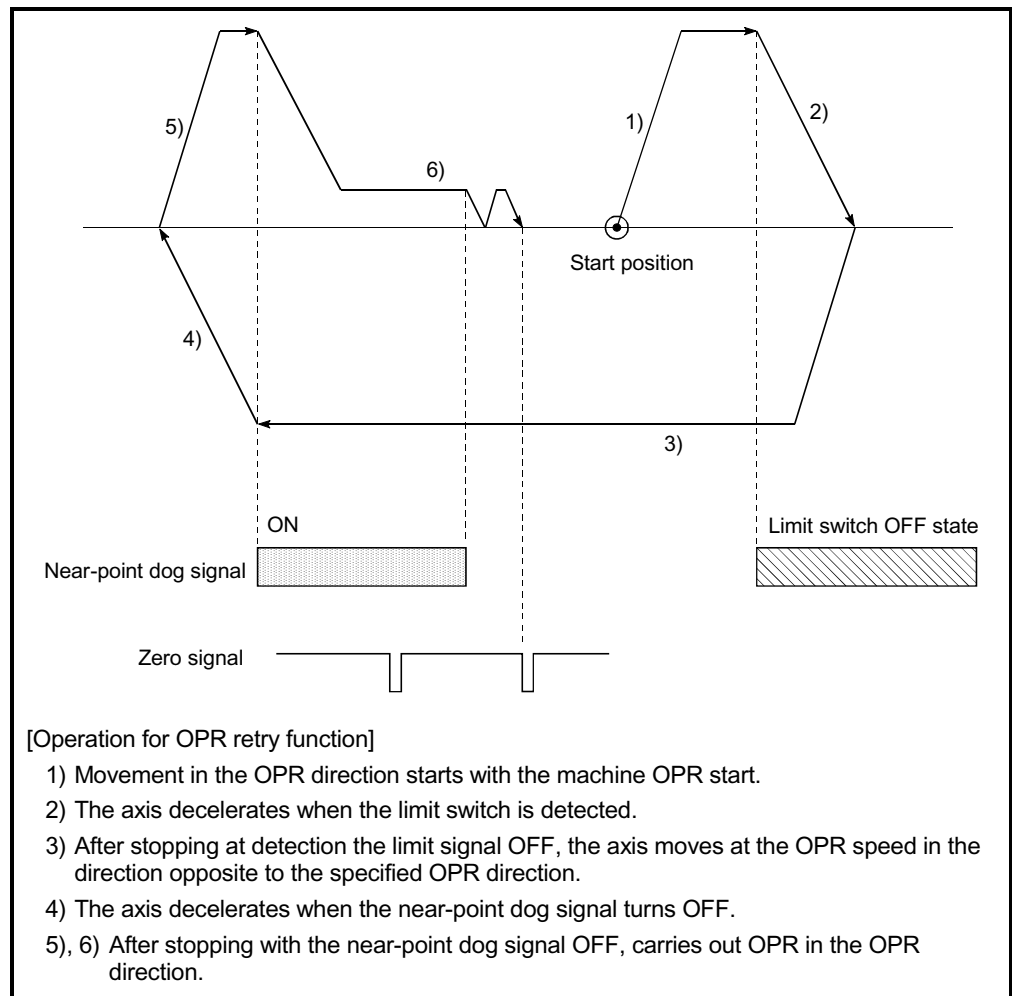

## 5.2.6 OPR detailed parameters

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Pr.50</b> Setting for the movement amount after near-point dog ON	The setting value range differs depending on the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set. <div style="border: 1px solid black; padding: 5px; display: inline-block; margin-top: 10px;">  [Table 1] on right page           </div>		0	80 81	230 231	380 381	530 531
<b>Pr.51</b> OPR acceleration time selection	0 : <b>Pr.9</b> Acceleration time 0	0	0	82	232	382	532
	1 : <b>Pr.25</b> Acceleration time 1	1					
	2 : <b>Pr.26</b> Acceleration time 2	2					
	3 : <b>Pr.27</b> Acceleration time 3	3					
<b>Pr.52</b> OPR deceleration time selection	0 : <b>Pr.10</b> Deceleration time 0	0	0	83	233	383	533
	1 : <b>Pr.28</b> Deceleration time 1	1					
	2 : <b>Pr.29</b> Deceleration time 2	2					
	3 : <b>Pr.30</b> Deceleration time 3	3					

**Pr.50** Setting for the movement amount after near-point dog ON

When using the count method 1) or 2), set the movement amount to the OP after the near-point dog signal turns ON.


(The movement amount after near-point dog ON should be equal to or greater than the sum of the "distance covered by the deceleration from the OPR speed to the creep speed" and "distance of movement in 10 ms at the OPR speed".)

[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0 to 214748364.7 (σm)	0 to 2147483647 (Δ10 <sup>-1</sup> σm)
1 : inch	0 to 21474.83647 (inch)	0 to 2147483647 (Δ10 <sup>-5</sup> inch)
2 : degree	0 to 21474.83647 (degree)	0 to 2147483647 (Δ10 <sup>-5</sup> degree)
3 : PLS	0 to 2147483647 (PLS)	0 to 2147483647 (PLS)

Example of setting for "Pr. 50 Setting for the movement amount after near-point dog ON"

Assuming that the "Pr. 8 Speed limit value" is set to 200 kPLS/s, "Pr. 46 OPR speed" to 10 kPLS/s, "Pr. 47 Creep speed" to 1 kPLS/s, and deceleration time to 300 ms, the minimum value of "Pr. 50 Setting for the Movement amount after near-point dog ON" is calculated as follows:

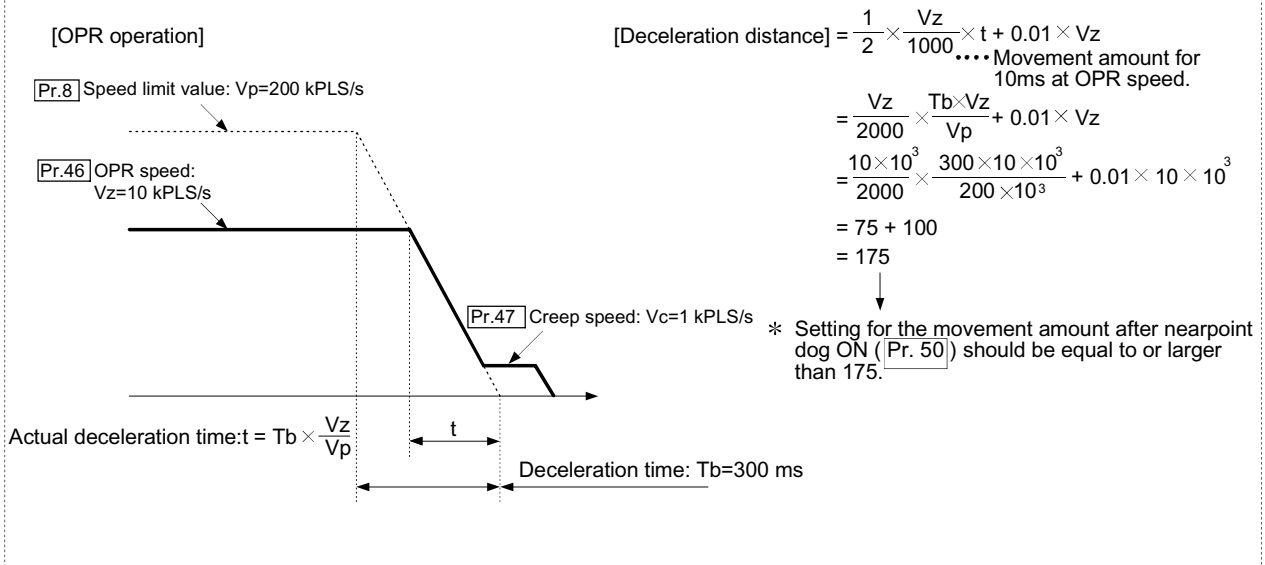

**Pr.51 OPR acceleration time selection**

Set which of "acceleration time 0 to 3" to use for the acceleration time during OPR.

0 : Use the value set in "Pr.9 Acceleration time 0".

1 : Use the value set in "Pr.25 Acceleration time 1".

2 : Use the value set in "Pr.26 Acceleration time 2".

3 : Use the value set in "Pr.27 Acceleration time 3".

**Pr.52 OPR deceleration time selection**

Set which of "deceleration time 0 to 3" to use for the deceleration time during OPR.

0 : Use the value set in "Pr.10 Deceleration time 0".

1 : Use the value set in "Pr.28 Deceleration time 1".

2 : Use the value set in "Pr.29 Deceleration time 2".


3 : Use the value set in "Pr.30 Deceleration time 3".

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Pr.53</b> OP shift amount	The setting value range differs depending on the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set. <div style="border: 1px solid black; padding: 5px; display: inline-block; margin-top: 10px;">  [Table 1] on right page                 </div>		0	84 85	234 235	384 385	534 535
<b>Pr.54</b> OPR torque limit value	1 to 300 (%)	1 to 300 (%)	300	86	236	386	536
<b>Pr.56</b> Speed designation during OP shift	0 : OPR speed	0	0	88	238	388	538
	1 : Creep speed	1					
<b>Pr.57</b> Dwell time during OPR retry	0 to 65535 (ms)	0 to 65535 (ms) 0 to 32767 : Set as a decimal 32768 to 65535 : Convert into hexadecimal and set	0	89	239	389	539

**Pr.53** OP shift amount

Set the amount to shift (move) from the position stopped at with machine OPR.  
 \* The OP shift function is used to compensate the OP position stopped at with machine OPR.

If there is a physical limit to the OP position, due to the relation of the near-point dog installation position, use this function to compensate the OP to an optimum position.

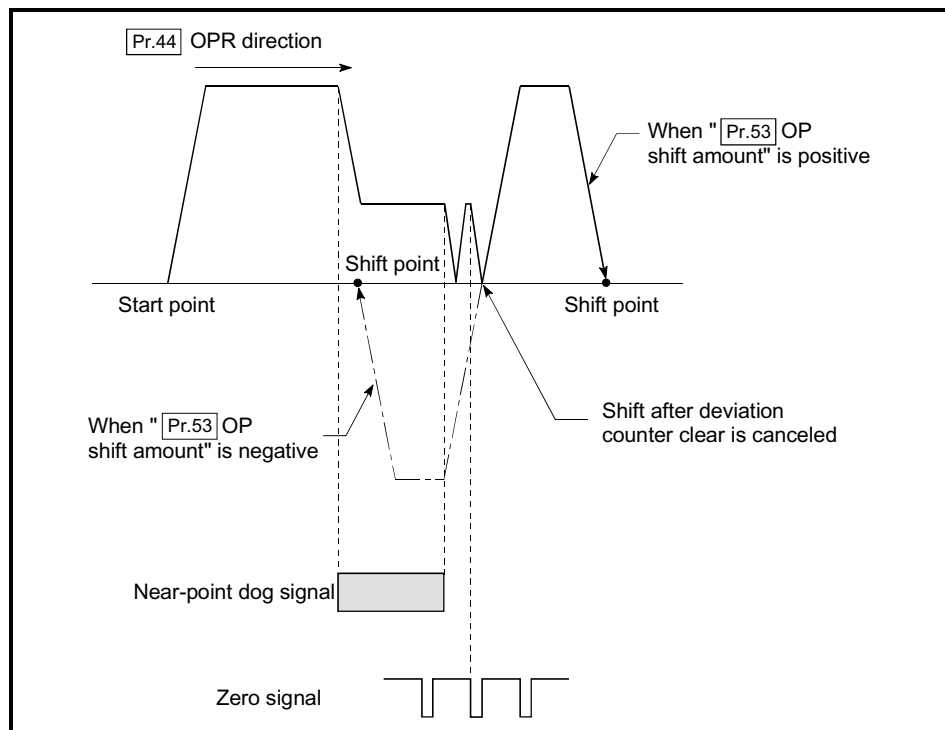

[Table 1]

Pr.1 setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	-214748364.8 to 214748364.7 ( $\sigma\text{m}$ )	-2147483648 to 2147483647 ( $\Delta 10^{-1}\sigma\text{m}$ )
1 : inch	-21474.83648 to 21474.83647 (inch)	-2147483648 to 2147483647 ( $\Delta 10^{-5}\text{inch}$ )
2 : degree	-21474.83648 to 21474.83647 (degree)	-2147483648 to 2147483647 ( $\Delta 10^{-5}\text{degree}$ )
3 : PLS	-2147483648 to 2147483647 (PLS)	-2147483648 to 2147483647 (PLS)

**Pr.54** OPR torque limit value

Set the value to limit the servomotor torque after reaching the creep speed during machine OPR.

Refer to Section 12.4.2 "Torque limit function" for details on the torque limits.

**Pr.56** Speed designation during OP shift


Set the operation speed for when a value other than "0" is set for "Pr.53 OP shift amount". Select the setting from "Pr.46 OPR speed" or "Pr.47 Creep speed".

0 : Designate "Pr.46 OPR speed" as the setting value.

1 : Designate "Pr.47 Creep speed" as the setting value.

**Pr.57** Dwell time during OPR retry

When OPR retry is validated (when "1" is set for Pr.48 ), set the stop time after decelerating in 2) and 4) in the following drawing.

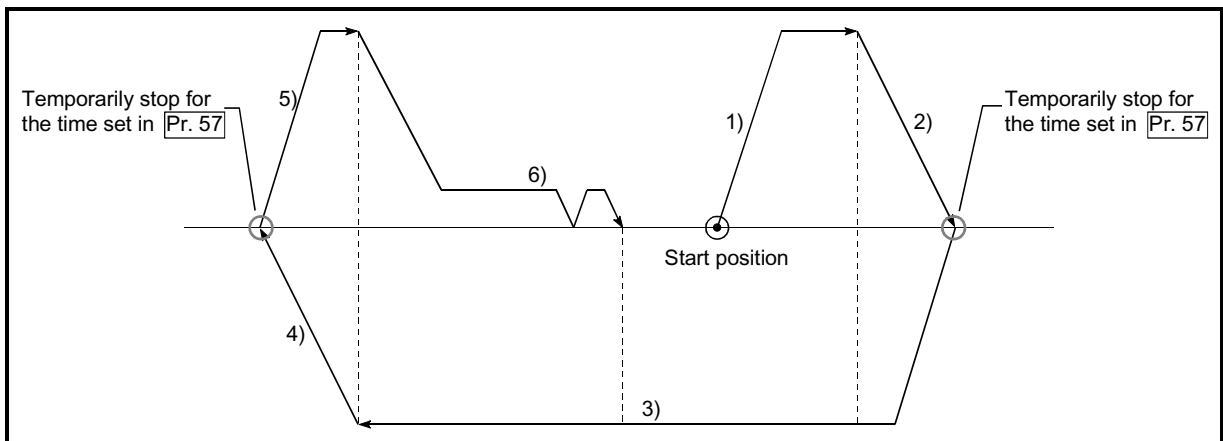





5.2.7 Servo basic parameters

The **Pr.101** correspond with "parameter No.1 of the servo amplifier". The following parameter correspond with "servo amplifier parameters No." in the same way.

Item		Setting details	Setting value *1
Servo basic parameters	<b>Pr.100</b> Servo series	Used to select the servo amplifier series, which is connected to the QD75. Example) For used MR-J2-B Set up "2: MR-J2-B".	0: MR-H-BN 1: MR-H-BN4-B 2: MR-J2-B 3: MR-J2S-B/MR-J2M-B 4: MR-J2-Jr
	<b>Pr.101</b> *2 Amplifier setting	Used to select the absolute position detection system. When used to the incremental: "0: invalid" When used to the absolute position detection system: "1: valid" <b>POINT</b> When absolute position detection selection invalid is selected with incremental encoder, a parameter error occurs.	Absolute position detection selection 0: Invalid 1: Valid
	<b>Pr.102</b> *2 Regenerative brake resistor	Regenerative selection brake option  Select the external dynamic brake	Used to select the regenerative selection brake option and external dynamic brake.

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, - : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	○	○	○	○	○		0 to 4	3	30100	30200	30300	30400
○	○	○	○	○	○		0 to 1	0	30101	30201	30301	30401
○	○	○	○	-	○		0 <input type="text"/> <input type="text"/> <input type="text"/> H ↑ Select the external dynamic brake ↑ Regenerative selection brake option * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	0000H	30102	30202	30302	30402
○	-	-	-	-	-							
○	-	-	-	-	-							
○	-	-	-	-	-							
○	-	○	○	-	-							
○	-	-	-	-	○							
○	-	-	-	-	○							
○	-	○	○	-	-							
○	-	○	○	-	-							
○	-	-	○	-	-							
○	-	-	○	-	-							
○	-	-	-	-	-							
-	-	○	○	-	○							
-	-	○	○	-	-							
-	-	-	-	○	-							
-	-	-	○	-	-							
-	-	-	○	-	-							
-	-	-	○	-	-							
-	-	-	○*3	-	-							
-	-	-	○*3	-	-							
-	-	-	○*3	-	-							
-	-	-	○*3	-	-							
○	○	○	○	-	○							

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.  
 \*3: Servo amplifier type of 400V is made the target.

Item		Setting details	Setting value * 1
Servo basic parameters	Pr.103	Motor type  Used to select the motor type. Use it "0080H: Automatic setting" usually. <b>POINT</b> Set up a motor type in "FFH" with PLC program when servo amplifier is MR-J2B-A15 (Motor: HC-KF).	00: HA-SH Standard 01: HA-LH Low inertia 02: HA-UH Flat 03: HA-FH/HA-FF 05: HA-MH 07: HC-SF 08: HC-RF 09: HC-UF 0A: HA-FF 0B: HC-MF 0C: HA-LF(400V[Class]) 0E: HA-LF(200V[Class]) 10: HA-LF $\ddot{Y}$ IM(400V[Class]) 13: HA-LF $\ddot{Y}$ IM(200V[Class]) 80: Automatic setting
	Pr.104	Motor capacity  Used to select 100 times of the output capacity (kW) of the motor by the number of hexadecimal. Refer to the instruction manual of servo amplifier to use for the output capacity of the motor. Example 1) For used motor capacity is 50W $0.05(\text{kW}) \times 100 = 5$ Set up "5H". Example 2) For used motor capacity is 22kW $22(\text{kW}) \times 100 = 2200$ Set up "2200H". <b>POINT</b> Be sure to set up motor capacity. Communication with servo amplifier isn't started by the initial value "0" in default value. (The LED indication of servo amplifier indicates "Ab".)	0000 to FFFF
	Pr.105	Servo motor speed  Used to select the rated speed[r/min] of the servomotor. Refer to the instruction manual of servomotor to use for the rated rotation speed of servomotor.	1: 1000[r/min] 2: 2000[r/min] 3: 3000[r/min]
	Pr.106 *2	Feed back pulse  Used to select the feed back pulse. (The servomotor resolution of a per rotation)	000: 16384[PLS] 001: 8192[PLS] 006: 32768[PLS] 007: 131072[PLS] 255: Depending on the number of motor resolution pulses.
	Pr.107 *2	Rotation direction selection  Used to set the rotation direction of the servomotor.	0: Forward rotation (CCW) with the increase of the positioning address.  1: Reverse rotation (CW) with the increase of the positioning address. 

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	—	—	—	—	—	0 0 <input type="text"/> <input type="text"/> H Motor type selection * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	80H	30103	30203	30303	30403	
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	—	—	—	—	—							
○	○	○	○	○	○							
○	○	○	○	○	○	0000 to FFFF	0000H	30104	30204	30304	30404	
○	○	○	○	○	○	1 to 3	1	30105	30205	30305	30405	
○	○	○	○	○	○	0 <input type="text"/> <input type="text"/> <input type="text"/> Feedback pulse number * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	0255	30106	30206	30306	30406	
○	○	○	○	○	○							
○	○	○	○	○	○							
○	○	○	○	○	○	0 to 1	0	30107	30207	30307	30407	

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.

Item		Setting details	Setting value * 1
Servo basic parameters	Pr.108	Auto tuning	Used to select the auto tuning.
	Pr.109	Servo response	Used to set the response of auto tuning. (When "Pr.108 Auto tuning" is valid) Optimum response can be selected according to the rigidity of the machine. As machine rigidity is higher, faster response can be set to improve tracking performance in response to a command and to reduce setting time.
			0: Auto tuning selected for use of interpolation axis control, etc. in position
			1: Auto tuning for ordinary operation.
			2: Invalid (No auto tuning)
			0: Interpolation mode
			1: Auto tuning mode 1
			2: Manual mode 2
			3: Auto tuning mode 2
			4: Manual mode 1
			1: Normal mode
			2: Normal mode
			3: Normal mode
			4: Normal mode
			5: Normal mode
			8: Large friction mode
			9: Large friction mode
			A: Large friction mode
			B: Large friction mode
			C: Large friction mode
			1: Low response (15Hz)
			2: Low response (20Hz)
			3: Low response (25Hz)
			4: Low response (30Hz)
			5: Low response (35Hz)
			6: Low response (45Hz)
			7: Low response (55Hz)
			8: Middle response (70Hz)
			9: High response (85Hz)
			A: High response (105Hz)
			B: High response (130Hz)
			C: High response (160Hz)
			D: High response (200Hz)
			E: High response (240Hz)
			F: High response (300Hz)

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, - : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	○	○	-	○	-	0 to 2	1	30108	30208	30308	30408	
-	-	-	○	-	○	0 to 4						
○	○	○	-	○	-	1 to 5, 8 to C	5H	30109	30209	30309	30409	
-	-	-	○	-	○	1 to F						

5.2.8 Servo adjustment parameters

Item		Setting details	Setting value * 1
Servo adjustment parameters	Pr.112	<p>Load inertia ratio</p> <p>Used to set the ratio of the load inertia to the inertia moment of the servomotor. When auto tuning is selected, the result of auto tuning is automatically used.</p> <p><b>POINT</b></p> <p>Pr.112 Load inertia ratio to Pr.117 Speed integral compensation is transferred to servo amplifier in PLC CPU power on, reset and PLC READY signal (Y0) on. When auto tuning is executed, it is changed to the optimum value inside servo amplifier. The result of auto tuning is transferred to QD75 at this time.</p> <p>When auto tuning is invalid and wants to keep gain adjustment result by "GX Configurator-QP", a reading stock is executed by Cd.102 Servo amplifier read to QD75. After that, execute Cd.1 Flash ROM write request, and keep it in the flash ROM.</p>	<p>0 to 100.0[times]</p> <p>0 to 300.0[times]</p>
	Pr.113	<p>Position loop gain 1</p> <p>Used to set the gain of position loop 1. Increase the gain to improve trackability performance in response to the position command.</p>	<p>4 to 1000[rad/s]</p> <p>4 to 2000[rad/s]</p>
	Pr.114	<p>Speed loop gain 1</p> <p>Normally this parameter setting need not be changed. Higher setting increases the response level but is liable to generate vibration and/or noise.</p>	<p>20 to 5000[rad/s]</p> <p>20 to 8000[rad/s]</p>
	Pr.115	<p>Position loop gain 2</p> <p>Used to set the gain of the position loop. Set this parameter to increase position response to load disturbance. Higher setting increases the response level but is liable to generate vibration and/or noise.</p>	<p>1 to 500[rad/s]</p> <p>1 to 1000[rad/s]</p>
	Pr.116	<p>Speed loop gain 2</p> <p>Set this parameter when vibration occurs on machines of lowrigidity or large backlash. Higher setting increases the response level but is liable to generate vibration and/or noise.</p>	<p>20 to 8000[rad/s]</p> <p>20 to 20000[rad/s]</p>
	Pr.117	<p>Speed integral compensation</p> <p>Used to set the constant of integral compensation.</p>	<p>1 to 1000[ms]</p>

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	○	○	—	○	—	0 to 1000	70	30112	30212	30312	30412	
—	—	—	○	—	○	0 to 3000						
○	○	○	—	○	—	4 to 1000	35	30113	30213	30313	30413	
—	—	—	○	—	○	4 to 2000						
○	○	○	—	○	—	20 to 5000	177	30114	30214	30314	30414	
—	—	—	○	—	○	20 to 8000						
○	○	○	—	○	—	1 to 500	35	30115	30215	30315	30415	
—	—	—	○	—	○	1 to 1000						
○	○	○	—	○	—	20 to 8000	817	30116	30216	30316	30416	
—	—	—	○	—	○	20 to 20000						
○	○	○	○	○	○	1 to 1000	20	30117	30217	30317	30417	



Item		Setting details	Setting value * 1
Servo adjustment parameters	Pr.118	Machine resonance suppression filter	00: Not used 01: 1125[Hz] 02: 563[Hz] 03: 375[Hz] 04: 282[Hz] 05: 225[Hz] 06: 188[Hz] 07: 161[Hz]
		Notch filter selection	00: Invalid    08: 141[Hz] 01: 1125[Hz]    09: 125[Hz] 02: 563[Hz]    10: 113[Hz] 03: 375[Hz]    11: 102[Hz] 04: 282[Hz]    12: 94[Hz] 05: 563[Hz]    13: 87[Hz] 06: 375[Hz]    14: 80[Hz] 07: 282[Hz]    15: 75[Hz]
	Notch depth selection	00: Invalid    10: 281.3[Hz] 01: 4500[Hz]    11: 264.7[Hz] 02: 2250[Hz]    12: 250[Hz] 03: 1500[Hz]    13: 236.8[Hz] 04: 1125[Hz]    14: 225[Hz] 05: 900[Hz]    15: 214.3[Hz] 06: 750[Hz]    16: 204.5[Hz] 07: 642.9[Hz]    17: 195.7[Hz] 08: 562.5[Hz]    18: 187.5[Hz] 09: 500[Hz]    19: 180[Hz] 0A: 450[Hz]    1A: 173.1[Hz] 0B: 409.1[Hz]    1B: 166.7[Hz] 0C: 375[Hz]    1C: 160.1[Hz] 0D: 346.2[Hz]    1D: 155.2[Hz] 0E: 321.4[Hz]    1E: 150[Hz] 0F: 300[Hz]    1F: 145.2[Hz]	
Pr.119	Feed forward gain	Used to set the notch frequency to match the response frequency of the mechanical system.	0: Deep (-40db) 1: ↑ (-14db) 2: ↓ (-8db) 3: Shallow (-4db)
		Used to set the feed forward gain for position control. Set "100" to nearly zero the droop pulse value when operation is performed at constant speed. Note that sudden acceleration/deceleration will increase overshoot. POINT Be sure to set up this parameter "2: Invalid (No auto tuning) when you set up Pr.108 Auto tuning.	0 to 100[%]

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	—	○	—	○	—							
—	○	—	—	—	—							
						0 <input type="text"/> <input type="text"/> <input type="text"/> H ↑ Notch depth selection      ↑ Notch filter selection * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	0000H	30118	30218	30318	30418	
—	—	—	○	—	○							
—	—	—	○	—	○							
○	○	○	○	○	○	0 to 100	0	30119	30219	30319	30419	

Item		Setting details	Setting value*1	
Servo adjustment parameters	Pr.120	In-position range	Used to set the droop pulse range in which the in-position signal will be output to the servo system controller. POINT Only MR-J2S-B sets up "Pr.106 Feed back pulse" in the feed back pulse unit.	0 to 50000[PLS]
	Pr.121	Electromagnetic brake sequence output	Used to set a time delay from when the electromagnetic brake interlock signal (MBR) turns off until the base circuit is shut off.	0 to 1000[ms]
	Pr.122	Analog monitor output Monitor output mode selection (ch1, ch2)	Used to set the output signal from analog monitor ch1 and ch2 of the servo amplifier.	0: Speed (± output) 1: Torque (± output) 2: Speed (± output) 3: Torque (+ output) 4: Current command (± output) 5: Command speed (± output) 6: Droop pulses 1/1 (± output) 7: Droop pulses 1/4 (± output) 8: Droop pulses 1/16 (± output) 9: Droop pulses 1/32 (± output) A: Droop pulses 1/64 (± output)
			0: Speed (± output) 1: Torque (± output) 2: Speed (± output) 3: Torque (+ output) 4: Current command (± output) 5: Command speed (± output) 6: Droop pulses 1/1 (± output) 7: Droop pulses 1/16 (± output) 8: Droop pulses 1/64 (± output) 9: Droop pulses 1/256 (± output) A: Droop pulses 1/1024 (± output)	

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	○	○	○	○	○		0 to 50000	100	30120	30220	30320	30420
○	○	○	○	○	○		0 to 1000	0	30121	30221	30321	30421
○	○	—	—	—	—							
—	—	○	—	—	—		0 <input type="text"/> 0 <input type="text"/> H ↑                      ↑ Monitor 1          Monitor 2 output setting    output setting * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	0001H	30122	30222	30322	30422

		Item	Setting details	Setting value*1	
Servo adjustment parameters	Pr.122	Analog monitor output	Monitor output mode selection (ch1, ch2)	Used to set the output signal from analog monitor ch1 and ch2 of the servo amplifier.	0: Servo motor speed ( ± 8V/max. speed) 1: Generated torque ( ± 8V/max. torque) 2: Motor speed ( + 8V/max. speed) 3: Generated torque ( + 8V/max. torque) 4: Current command ( ± 8V/max. current command) 5: Command speed ( ± 8V/max. command speed) 6: Droop pulses ( ± 10V/128 pulses) 7: Droop pulses ( ± 10V/2048 pulses) 8: Droop pulses ( ± 10V/8192 pulses) 9: Droop pulses ( ± 10V/32768 pulses) A: Droop pulses ( ± 10V/131072 pulses) B: Bus voltage (servo amplifier of 100V/200V: + 8V/400V, servo amplifier of 400V: + 8V/800V)
	Pr.123 *2	Optional function 1	Servo forced stop selection	Used to set the optional function 1 (Carrier frequency (Low acoustic noise mode selection) ) • Carrier frequency (Low acoustic noise mode selection)	0: Valid (Use the forced stop signal.) 1: Invalid (Do not use the forced stop signal.)
			Low acoustic noise mode selection	20[dB] can decrease the electromagnetic noise which occurs from servomotor when "1: 9.0[KHz]" is selection.	0: 2.25[KHz] 2: 6.375[KHz] 3: 9.0[KHz]
		Serial encoder cable	• Used to set serial encoder cable selection.	0: 2-wire 1: 4-wire (Supports long distance cables)	



		Item	Setting details	Setting value *1	
Servo adjustment parameters	Pr.124 *2	Optional function 2	Used to set the optional function 2. • Motor operation-less When the motor operation-less is made effective, without connecting servomotor, a signal is outputted, condition indication can be executed.	0: Invalid 1: Valid (Gain adjustment mode: Manual mode <span style="border: 1px solid black; padding: 0 2px;">Pr.108</span> is set up "2" )	
		Slight vibration suppression control selection		0: Invalid 1: Valid	
		Motor-less operation selection		0: There are no relations in motor rotation speed, and it is outputted under the next condition. 1) Servo OFF 2) Alarm occurs 3) Emergency stop input turn off (Valid) 1: Output is executed when status of 1) to 3) and rotation speed of the servomotor are less than <span style="border: 1px solid black; padding: 0 2px;">Pr.130</span> .	
	Pr.125	Adaptive vibration suppression control/ low pass filter	Low pass filter selection	Used to set the low pass filter and the adaptive vibration suppression control.	0: Valid (Automatic adjustment) 1: Invalid (But, the selection of manual low pass filter frequency is effective.)
			Adaptive vibration suppression control selection		0: Invalid 1: Valid (Machine resonance frequency is always detected and the filter is generated in response to resonance to suppress machine vibration. 2: Held (The characteristics of the filter generated so far are held, and detection of machine resonance is stopped.
			Adaptive vibration suppression control sensitivity		0: Normal 1: Large sensitivity

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
—	—	○	○	○	○							
○	○	○	○	○	○							
○	○	—	—	—	—	<div style="display: flex; align-items: center;"> <div style="margin-right: 10px;"> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> <div style="margin-right: 10px;">0 H</div> </div> <div style="margin-left: 20px;"> <p>↑ Slight vibration suppression control setting</p> <p>↑ Motor-less operation selection</p> <p>↑ Electromagnetic brake interlock output timing setting</p> <p>* 1: <input type="checkbox"/> is used to set up the setting value. (Hexadecimal)</p> </div>	0000H	30124	30224	30224	30424	
—	—	—	○	—	○							
—	—	—	○	—	○	<div style="display: flex; align-items: center;"> <div style="margin-right: 10px;"> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> </div> <div style="margin-right: 10px;">0 H</div> </div> <div style="margin-left: 20px;"> <p>↑ Adaptive vibration suppression control sensitivity selection</p> <p>↑ Adaptive vibration suppression control selection</p> <p>↑ Low pass filter selection</p> <p>* 1: <input type="checkbox"/> is used to set up the setting value. (Hexadecimal)</p> </div>	0000H	30125	30225	30325	30425	
—	—	—	○	—	○							

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.



5.2.9 Servo expansion parameters

Item		Setting details	Setting value *1	
Servo expansion parameters	Pr.127	Monitor output 1 offset (Analog monitor 1 offset)	Used to set the offset voltage for monitor output 1. -9999 to 9999 -999 to 999	
	Pr.128	Monitor output 2 offset (Analog monitor 2 offset)	Used to set the offset voltage for monitor output 2. -9999 to 9999 -999 to 999	
	Pr.129	Pre-alarm data selection 1	Used to set the pre-alarm data selection.	0: Speed 1: Torque 2: Speed (+) 3: Torque (+) 4: Current command output 5: Command (FΔT) 6: Droop pulses 1/1 7: Droop pulses 1/4 8: Droop pulses 1/16 9: Droop pulses 1/32 A: Droop pulses 1/64
		Pre-alarm data selection 2		
		Pre-alarm data sampling time selection		0: 1.77[ms] 1: 3.55[ms] 2: 7.11[ms] 3: 14.22[ms] 4: 28.44[ms]
	Pr.130	Zero speed	Used to set the output range of the Zero speed signal (ZSP). 0 to 10000[r/min]	
	Pr.131	Error excessive alarm level	Used to set the output range of the error excessive alarm. 0 to 1000[PLS] 0.1 to 100.0[0.25rev] *6	
	Pr.132	Optional function 5 PI-PID control switch-over	Used to select the PI-PID control switch-over. 0: PI control is always valid. 1: Switched to PI control when the droop value is reached or exceeded. 2: PID control is always valid.	
		Servo reading character (Servo retrieve character) *5	Use to read the reason after the amplifier 0400H why it doesn't rotate, data, parameter item and alarm item. 0: Japanese 1: English	

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, - : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
○	○	-	-	-	-	-9999 to 9999	0000	30127	30227	30327	30427	
-	-	○	○	-	- *3	-999 to 999						
○	○	-	-	-	-	-9999 to 9999	0000	30128	30228	30328	30428	
-	-	○	○	-	- *3	-999 to 999						
○	○	-	-	-	-	<div style="display: flex; align-items: center;"> <span style="margin-right: 10px;">0</span> <div style="display: flex; gap: 10px;"> <div style="border: 1px dashed black; padding: 2px;"> </div> <div style="border: 1px dashed black; padding: 2px;"> </div> <div style="border: 1px dashed black; padding: 2px;"> </div> </div> <span style="margin-left: 10px;">H</span> </div> <div style="margin-top: 5px;"> <span style="font-size: small;">Pre-alarm data selection 2</span>  <span style="font-size: small;">Pre-alarm data selection 1</span>  <span style="font-size: small;">Pre-alarm data sampling time selection</span> </div> <div style="font-size: x-small;">* 1: <span style="border: 1px dashed black; padding: 0 2px;"> </span> is used to set up the setting value. (Hexadecimal)</div>	0001H	30129	30229	30329	30429	
○	○	-	-	-	-							
○	○	○	○	○	○	0 to 10000	50	30130	30230	30330	30430	
○	○	○	-	○	-	1 to 1000	80	30131	30231	30331	30431	
-	-	-	○	-	○							
○	○	○	○	○	○	<div style="display: flex; align-items: center;"> <div style="border: 1px dashed black; padding: 2px;"> </div> <span style="margin: 0 5px;">00</span> <div style="border: 1px dashed black; padding: 2px;"> </div> <span style="margin-left: 5px;">H</span> </div> <div style="margin-top: 5px;"> <span style="font-size: small;">PI-PID control switch over selection</span>  <span style="font-size: small;">Servo reading character selection</span> </div> <div style="font-size: x-small;">* 1: <span style="border: 1px dashed black; padding: 0 2px;"> </span> is used to set up the setting value. (Hexadecimal)</div>	0000H	30132	30232	30332	30432	
○	○	-	-	-	-							

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.

\*3: Don't change setting value "0000H".

\*4: You cannot change parameter "Serial communication response delay time setting" and "Serial communication baud rate setting".

\*5: Don't use to the parameter (normal). Don't change setting value "Default value" by any means.

\*6: The unit setting differs according to the software version of the servo amplifier. Refer to the "Servo Amplifier Instruction Manual".

		Item	Setting details	Setting value*1
Servo expansion parameters	Optional function 6	Serial communication baud rate selection	A communication baud rate selection and communication answer delay time and encoder output pulse setup selection.	0: 9600[bps] 2: 38400[bps] 1: 19200[bps] 3: 57600[bps]
		Serial communication response delay time selection		0: Invalid 1: Valid (It answer after delay time of more than 888·s)
		Pr.133 *2 Encoder output pulse setting selection		0: Output pulse setting selection 1: Divided perimeter ratio
		OPR set condition selection (Zeroing condition setting selection)		0: It is necessary to pass through the Z phase after the power on. 1: It is not necessary to pass through the Z phase after the power on.
	Pr.134	PI-PID control switch-over position droop	Used to select the position droop value (Number of pulse) which PI control is switched over to PID control. Pr.132 becomes effective when a parameter is made "0001H".	0 to 50000[PLS]
Pr.136	Speed differential compensation	Used to select the differential compensation value. Setting speed integral compensation value to 1000 in PI (proportionally integral) control specifies the ordinary P (proportional) control range, setting the value to less than 1000 increase the P control range.	0 to 1000	
Pr.138 *2	Encoder output pulses	Used to set the encoder pulse (A-phase, B-phase) output by the servo amplifier. (after the 4 times ) You can use Pr.133 to choose the output pulse setting or output division ratio setting. The number of A-phase and B-phase pulse actually output 1/4 times greater than the present number of pulse. The maximum output frequency is 1.3Mpps (after multiplication by 4). Use this parameter within this range.	0 to 65535	

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)									Axis 1	Axis 2	Axis 3	Axis 4
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
—	—	—	○	—	○ *4	<p>Serial communication baud rate selection Serial communication response delay time selection Encoder output pulse setting selection OPR set condition selection * 1: <input type="checkbox"/> is used to set up the setting value. (Hexadecimal)</p>	0000H	30133	30233	30333	30433	
○	○	○	○	○	○	0 to 50000	0	30134	30234	30334	30434	
○	○	○	○	○	○	0 to 1000	980	30136	30236	30336	30436	
—	—	—	○	—	○	0 to 65535	4000	30138	30238	30338	30438	

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.

\*4: You cannot change parameter "Serial communication response delay time setting" and "Serial communication baud rate setting".

5.2.10 Servo expansion parameters 2

Item		Setting details	Setting value * 1							
Servo expansion parameters 2	<table border="1"> <tr> <td rowspan="3" style="writing-mode: vertical-rl; transform: rotate(180deg);">Slight vibration suppression control selection 1</td> <td>Pr.143 *3</td> <td>Position gain 2 shift value</td> <td rowspan="3">Used to set each of the gain shift value which the slight vibration suppression control selected.</td> <td rowspan="3">0: 1.0[times] 1: 0.75[times] 2: 0.5[times] 3: 0.25[times]</td> </tr> <tr> <td>Speed gain 2 shift value</td> </tr> <tr> <td>Speed integral compensation shift value</td> </tr> </table>	Slight vibration suppression control selection 1	Pr.143 *3	Position gain 2 shift value	Used to set each of the gain shift value which the slight vibration suppression control selected.	0: 1.0[times] 1: 0.75[times] 2: 0.5[times] 3: 0.25[times]	Speed gain 2 shift value	Speed integral compensation shift value		
	Slight vibration suppression control selection 1		Pr.143 *3	Position gain 2 shift value			Used to set each of the gain shift value which the slight vibration suppression control selected.	0: 1.0[times] 1: 0.75[times] 2: 0.5[times] 3: 0.25[times]		
			Speed gain 2 shift value							
		Speed integral compensation shift value								
	Pr.144 *3	Slight vibration suppression control selection 2	Used to set the time after in-position completion gain shift value which the slight vibration suppression control selected.	0 to 1000[ms]						
	Pr.145 *3	Induction voltage compensation	Use to set the induction voltage compensation range.	0 to 100[%]						
	Pr.149 *2	Gain changing selection	Used to set the gain changing selection. The gain changing function becomes effective when the gain adjustment mode is used manual mode 2. (Pr.108 is set "2").	0: Invalid 2: (Effective in more than) Command frequency [KPPS] 3: (Effective in more than) Droop pulse [PLS] 4: (Effective in more than) Model speed [r/min]						
	Pr.150	Gain changing condition	Used to set the ratio of changing Pr.152 to Pr.155 when gain changing is valid. Used to set Pr.149 when command frequency, droop pulse or model speed is selection.	0 to 9999						
Pr.151	Gain changing time constant	Used to set the time constant at which the gains will change in response to the conditions set in Pr.149 and Pr.150.	0 to 100[ms]							
Pr.152	Ratio of load inertia moment to servomotor inertia moment 2 (Load moment of inertia ratio 2)	Used to set the ratio of load inertia moment to servo motor inertia moment when gain changing is valid. Made valid when auto tuning is invalid.	0 to 300.0[times]							
Pr.153	Position loop gain 2 changing ratio	Used to set the ratio of changing the position loop gain 2 when gain changing is valid. Made valid when auto tuning is invalid.	10 to 200[%]							
Pr.154	Speed loop gain 2 changing ratio	Used to set the ratio of changing the speed loop gain 2 when gain changing is valid. Made valid when auto tuning is invalid.	10 to 200[%]							

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, - : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
-	-	-	○	-	○		011H	30143	30243	30343	30443	
-	-	-	○	-	○	0 to 1000	20	30144	30244	30344	30444	
-	-	-	○	-	○	0 to 100	50	30145	30245	30345	30445	
-	-	-	○	-	○	0, 2 to 4H	0000H	30149	30249	30349	30449	
-	-	-	○	-	○	0 to 9999	10	30150	30250	30350	30450	
-	-	-	○	-	○	0 to 100	1	30151	30251	30351	30451	
-	-	-	○	-	○	0 to 3000	70	30152	30252	30352	30452	
-	-	-	○	-	○	10 to 200	100	30153	30253	30353	30453	
-	-	-	○	-	○	10 to 200	100	30154	30254	30354	30454	

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.

\*3: Don't use to the parameter (normal). Don't change setting value "Default value" by any means.

		Item	Setting details	Setting value * 1
Servo expansion parameters 2	Pr.155	Speed integral compensation changing ratio (VEL. INTGRL. COMPS. Gain 2 change ratio.)	Used to set the ratio of changing the speed integral compensation when gain changing is valid. Made valid when auto tuning is invalid.	50 to 1000[%]
	Pr.160 *2	Optional function C Encoder output pulse direction	Used to set the encoder output pulse direction	0: CCW progress to A phases 90° 1: CW progress to A phases 90°
	Pr.161	Machine resonance suppression filter 2 Notch filter frequency selection	Used to set the machine resonance suppression filter. About adaptive vibration suppression control, "Valid" or when it is set as "Held" ( Pr.125: $\ddot{Y} 1 \ddot{Y} \ddot{Y}$ or $\ddot{Y} 2 \ddot{Y} \ddot{Y}$ ), a Machine resonance suppression filter becomes invalid.	00: Invalid      10: 281.3[Hz] 01: 4500[Hz]    11: 264.7[Hz] 02: 2250[Hz]    12: 250[Hz] 03: 1500[Hz]    13: 236.8[Hz] 04: 1125[Hz]    14: 225[Hz] 05: 900[Hz]     15: 214.3[Hz] 06: 750[Hz]     16: 204.5[Hz] 07: 642.9[Hz]   17: 195.7[Hz] 08: 562.5[Hz]   18: 187.5[Hz] 09: 500[Hz]     19: 180[Hz] 0A: 450[Hz]     1A: 173.1[Hz] 0B: 409.1[Hz]   1B: 166.7[Hz] 0C: 375[Hz]     1C: 160.1[Hz] 0D: 346.2[Hz]   1D: 155.2[Hz] 0E: 321.4[Hz]   1E: 150[Hz] 0F: 300[Hz]     1F: 145.2[Hz]
		Notch depth selection		0: Deep    (-40db) 1: ↑        (-14db) 2: ↓        (-8db) 3: Shallow (-4db)

Setting Value, setting range							Value set with PLC program	Default value	Setting value buffer memory address			
Value set with peripheral device									Axis 1	Axis 2	Axis 3	Axis 4
Servo amplifier setting invalid (○ : Invalid, — : Valid)												
MR-H-BN	MR-H-BN4	MR-J2-B	MR-J2S-B	MR-J2-Jr	MR-J2M-B							
—	—	—	○	—	○	50 to 1000	100	30155	30255	30355	30455	
—	—	—	○	—	○	0 <input type="text"/> 00 H ↑ Encoder output pulse direction selection * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	0000H	30160	30260	30360	30460	
—	—	—	○	—	○	0 <input type="text"/> <input type="text"/> <input type="text"/> H ↑ Notch filter frequency selection ↑ Notch depth selection * 1: <input type="text"/> is used to set up the setting value. (Hexadecimal)	0000H	30161	30261	30361	30461	

\*2: Set the parameter value and switch power off once (The parameter is transferred to servo amplifier from QD75), then switch it on again to make that parameter setting valid.



5.3 List of positioning data


Before explaining the positioning data setting items **Da.1** to **Da.10**, the configuration of the positioning data will be shown below.



The positioning data stored in the QD75 buffer memory has the following type of configuration.

Positioning data No.		1	2	3	...	599	600
Axis 1	Positioning identifier <b>Da.1</b> to <b>Da.5</b>	2000	2010	2020	...	7980	7990
	<b>Da.10</b> M code	2001	2011	2021	...	7981	7991
	<b>Da.9</b> Dwell time	2002	2012	2022	...	7984 7985	7994 7995
	<b>Da.8</b> Command speed	2004 2005	2014 2015	2024 2025	...	7986 7987	7996 7997
	<b>Da.6</b> Positioning address/ movement amount	2006 2007	2016 2017	2026 2027	...	7988 7989	7998 7999
	<b>Da.7</b> Arc address	2008 2009	2018 2019	2028 2029	...		

- Up to 600 positioning data items can be set (stored) for each axis in the buffer memory address shown on the left. This data is controlled as positioning data No. 1 to 600 for each axis.
- One positioning data item is configured of the items shown in the bold box.

Positioning data No.		1	2	3	...	599	600
Axis 2	Positioning identifier <b>Da.1</b> to <b>Da.5</b>	8000	8010	8020	...	13980	13990
	<b>Da.10</b> M code	8001	8011	8021	...	13981	13991
	<b>Da.9</b> Dwell time	8002	8012	8022	...	13984 13985	13994 13995
	<b>Da.8</b> Command speed	8004 8005	8014 8015	8024 8025	...	13986 13987	13996 13997
	<b>Da.6</b> Positioning address/ movement amount	8006 8007	8016 8017	8026 8027	...	13988 13989	13998 13999
	<b>Da.7</b> Arc address	8008 8009	8018 8019	8028 8029	...		

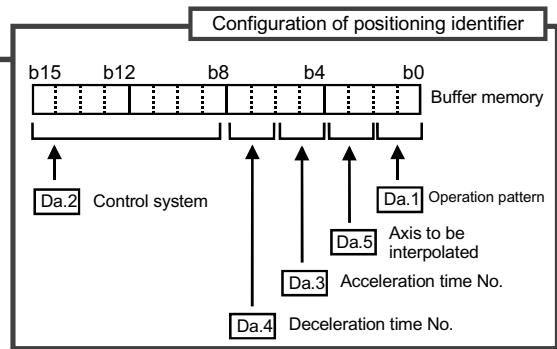

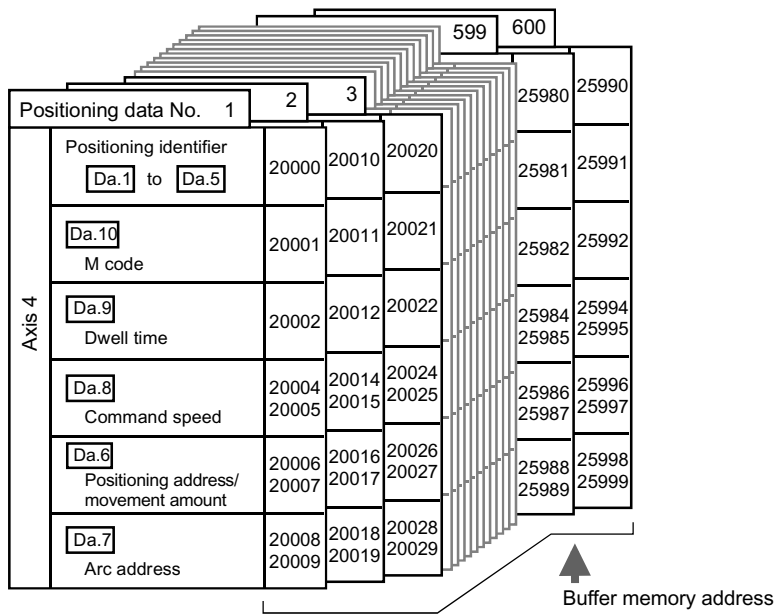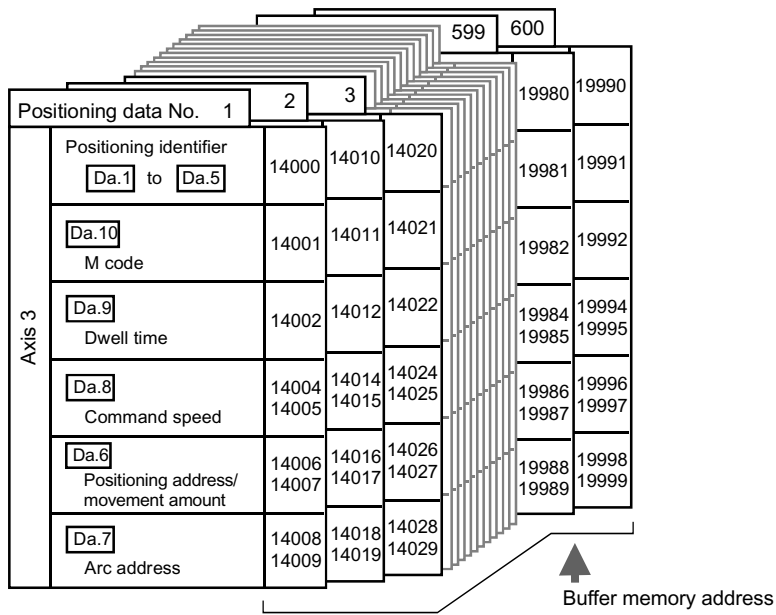


The descriptions that follow relate to the positioning data set items Da.1 to Da.10 .  
 (The buffer memory addresses shown are those of the "positioning data No. 1" for the axes 1 to 4.)

Item	Setting value		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
Da.1 Operation pattern  Da.2 Control system  Positioning identifier	00: Positioning complete	00					
	01: Continuous positioning control	01					
	11: Continuous path control	11					
	ABS1 : 1-axis linear control (ABS)	01H					
	INC1 : 1-axis linear control (INC)	02H					
	FEED1 : 1-axis fixed-feed control	03H					
	VF1 : 1-axis speed control (forward run)	04H					
	VR1 : 1-axis speed control (reverse run)	05H					
	VPF : Speed-position switching control (forward run)	06H					
	VPR : Speed-position switching control (reverse run)	07H					
	PVF : Position-speed switching control (forward run)	08H					
	PVR : Position-speed switching control (reverse run)	09H					
	ABS2 : 2-axis linear interpolation control (ABS)	0AH					
	INC2 : 2-axis linear interpolation control (INC)	0BH					
	FEED2: Fixed-feed control by 2-axis linear interpolation	0CH					
	ABS ~ : Circular interpolation control with sub point specified (ABS)	0DH					
	INC ~ : Circular interpolation control with sub point specified (INC)	0EH					
	ABS . : Circular interpolation control with center point specified (ABS, CW)	0FH					
	ABS . : Circular interpolation control with center point specified (ABS, CCW)	10H					
	INC . : Circular interpolation control with center point specified (INC, CW)	11H					
	INC . : Circular interpolation control with center point specified (INC, CCW)	12H					
	VF2 : 2-axis speed control (forward run)	13H					
	VR2 : 2-axis speed control (reverse run)	14H					
	ABS3 : 3-axis linear interpolation control (ABS)	15H					
	INC3 : 3-axis linear interpolation control (INC)	16H					
	FEED3: Fixed-feed control by 3-axis linear interpolation control	17H					
	VF3 : 3-axis speed control (forward run)	18H					
	VR3 : 3-axis speed control (reverse run)	19H					
	ABS4 : 4-axis linear interpolation control (ABS)	1AH					
	INC4 : 4-axis linear interpolation control (INC)	1BH					
	FEED4: Fixed-feed control by 4-axis linear interpolation control	1CH					
	VF4 : 4-axis speed control (forward run)	1DH					
	VR4 : 4-axis speed control (reverse run)	1EH					
	NOP : NOP instruction	80H					
POS : Current value changing	81H						
JUMP : JUMP instruction	82H						
LOOP : Declares the beginning of LOOP to LEND section	83H						
LEND : Declares the end of LOOP to LEND section	84H						
Da.3 Acceleration time No.	0: [Pr.9] Acceleration time 0	00					
	1: [Pr.25] Acceleration time 1	01					
	2: [Pr.26] Acceleration time 2	10					
	3: [Pr.27] Acceleration time 3	11					
Da.4 Deceleration time No.	0: [Pr.10] Deceleration time 0	00					
	1: [Pr.28] Deceleration time 1	01					
	2: [Pr.29] Deceleration time 2	10					
	3: [Pr.30] Deceleration time 3	11					
Da.5 Axis to be interpolated	0: Axis 1	00					
	1: Axis 2	01					
	2: Axis 3	10					
	3: Axis 4	11					

**Da.1** Operation pattern

The operation pattern designates whether positioning of a certain data No. is to be ended with just that data, or whether the positioning for the next data No. is to be carried out in succession.

[Operation pattern]

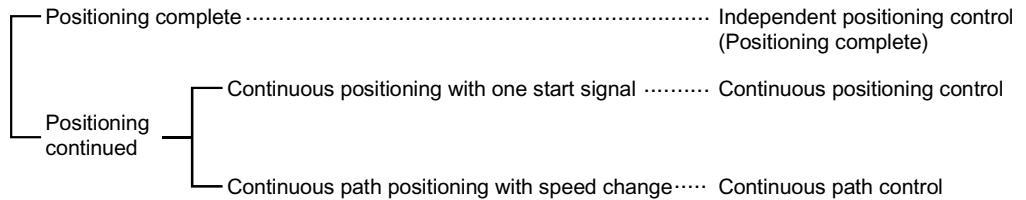

- 1) Positioning complete..... Set to execute positioning to the designated address, and then complete positioning.
- 2) Continuous positioning control ..... Positioning is carried out successively in order of data Nos. with one start signal. The operation halts at each position indicated by a positioning data.
- 3) Continuous path control..... Positioning is carried out successively in order of data Nos. with one start signal. The operation does not stop at each positioning data.

**Da.2** Control system

Set the "control system" for carrying out positioning control.

- Note) € When "JUMP instruction" is set for the control system, the " **Da.9** Dwell time" and " **Da.10** M code" setting details will differ.
- € In case you selected "LOOP" as the control system, the " **Da.10** M code" should be set differently from other cases.
  - € Refer to Chapter 9 "Major positioning control" for details on the control systems.
  - € If "degree" is set for " **Pr.1** Unit setting", circular interpolation control cannot be carried out. (The "Circular interpolation not possible error" will occur when executed (error code: 535).)

**Da.3** Acceleration time No.

Set which of "acceleration time 0 to 3" to use for the acceleration time during positioning.

- 0 : Use the value set in " **Pr.9** Acceleration time 0".
- 1 : Use the value set in " **Pr.25** Acceleration time 1".
- 2 : Use the value set in " **Pr.26** Acceleration time 2".
- 3 : Use the value set in " **Pr.27** Acceleration time 3".

**Da.4** Deceleration time No.

Set which of "deceleration time 0 to 3" to use for the deceleration time during positioning.

- 0 : Use the value set in " Pr.10 Deceleration time 0".
- 1 : Use the value set in " Pr.28 Deceleration time 1".
- 2 : Use the value set in " Pr.29 Deceleration time 2".
- 3 : Use the value set in " Pr.30 Deceleration time 3".

**Da.5** Axis to be interpolated

Set the target axis (partner axis) for operations under the 2-axis interpolation control.

- 0 : Selects the axis 1 as the target axis (partner axis).
- 1 : Selects the axis 2 as the target axis (partner axis).
- 2 : Selects the axis 3 as the target axis (partner axis).
- 3 : Selects the axis 4 as the target axis (partner axis).

Note) ⚠ Do not specify the own axis number or any number except the above. (If you do, the "Illegal interpolation description command error" will occur during the program execution (error code: 521).)

⚠ This item does not need to be set in case 3 or 4-axis interpolation is selected.

Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Da.6</b> Positioning address/ movement amount	The setting value range differs according to the " Da.2 Control system". Here, the value within the following range of [Table 1] range is set.		0	2006 2007	8006 8007	14006 14007	20006 20007



**Da.6** Positioning address/movement amount


Set the address to be used as the target value for positioning control.

The setting value range differs according to the " Da.2 Control system".

((1) to (4))

(1) Absolute (ABS) system, current value changing

⚠ The setting value (positioning address) for the ABS system and current value changing is set with an absolute address (address from OP).

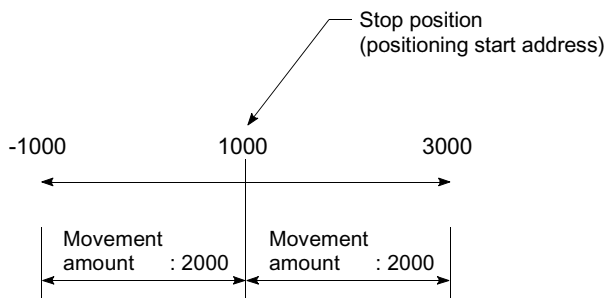


(2) Incremental (INC) system, fixed-feed 1, fixed-feed 2, fixed-feed 3, fixed-feed 4

ε The setting value (movement amount) for the INC system is set as a movement amount with sign.

When movement amount is positive: Moves in the positive direction (address increment direction)

When movement amount is negative: Moves in the negative direction (address decrement direction)

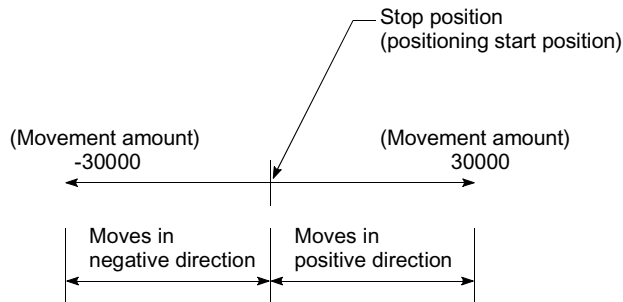

[Table 1]

■ When " Pr.1 Unit Setting" is "mm"

The table below lists the control systems that require the setting of the positioning address or movement amount and the associated setting ranges.  
(With any control system excluded from the table below, neither the positioning address nor the movement amount needs to be set.)

Da.2 setting value	Value set with peripheral device (σm)	Value set with PLC program *1 (Δ10 <sup>-1</sup> σm)
ABS Linear 1 : 01H ABS Linear 2 : 0AH ABS Linear 3 : 15H ABS Linear 4 : 1AH Current value changing : 81H	©Set the address -214748364.8 to 214748364.7	©Set the address -2147483648 to 2147483647
INC Linear 1 : 02H INC Linear 2 : 0BH INC Linear 3 : 16H INC Linear 4 : 1BH Fixed-feed 1 : 03H Fixed-feed 2 : 0CH Fixed-feed 3 : 17H Fixed-feed 4 : 1CH	©Set the movement amount -214748364.8 to 214748364.7	©Set the movement amount -2147483648 to 2147483647
Forward run speed/position : 06H Reverse run speed/position : 07H Forward run position/speed : 08H Reverse run position/speed : 09H	©Set the movement amount 0 to 214748364.7	©Set the movement amount 0 to 2147483647
ABS circular sub : 0DH ABS circular right : 0FH ABS circular left : 10H	©Set the address -214748364.8 to 214748364.7	©Set the address -2147483648 to 2147483647
INC circular sub : 0EH INC circular right : 11H INC circular left : 12H	©Set the movement amount -214748364.8 to 214748364.7	©Set the movement amount -2147483648 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions.  
(The value will be converted properly within the system.)


(3) Speed-position switching control

€ INC mode:

Set the amount of movement after the switching from speed control to position control.

€ ABS mode:

Set the absolute address which will be the target value after speed control is switched to position control. (The unit is "degree" only)

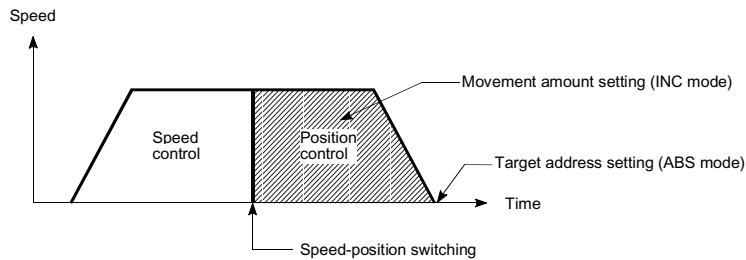

(4) Position-speed switching control

€ Set the amount of movement before the switching from position control to speed control.

■ When " Pr.1 Unit Setting" is "degree"

The table below lists the control systems that require the setting of the positioning address or movement amount and the associated setting ranges. (With any control system excluded from the table below, neither the positioning address nor the movement amount needs to be set.)

Da.2 setting value	Value set with peripheral device (degree)	Value set with PLC program *1 ( $\Delta 10^{-5}$ degree)
ABS Linear 1 : 01H ABS Linear 2 : 0AH ABS Linear 3 : 15H ABS Linear 4 : 1AH Current value changing : 81H	©Set the address 0 to 359.99999	©Set the address 0 to 35999999
INC Linear 1 : 02H INC Linear 2 : 0BH INC Linear 3 : 16H INC Linear 4 : 1BH Fixed-feed 1 : 03H Fixed-feed 2 : 0CH Fixed-feed 3 : 17H Fixed-feed 4 : 1CH	©Set the movement amount -21474.83648 to 21474.83647	©Set the movement amount -2147483648 to 2147483647
Forward run speed/position : 06H Reverse run speed/position : 07H	In INC mode ©Set the movement amount 0 to 21474.83647  In ABS mode ©Set the address 0 to 359.99999	In INC mode ©Set the movement amount 0 to 2147483647  In ABS mode ©Set the address 0 to 35999999
Forward run position/speed : 08H Reverse run position/speed : 09H	©Set the movement amount 0 to 21474.83647	©Set the movement amount 0 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions. (The value will be converted properly within the system.)

■ When " [Pr.1] Unit Setting" is "PLS"

The table below lists the control systems that require the setting of the positioning address or movement amount and the associated setting ranges.

(With any control system excluded from the table below, neither the positioning address nor the movement amount needs to be set.)

[Da.2] setting value	Value set with peripheral device (PLS)	Value set with PLC program *1 (PLS)
ABS Linear 1 : 01H ABS Linear 2 : 0AH ABS Linear 3 : 15H ABS Linear 4 : 1AH Current value changing : 81H	©Set the address -2147483648 to 2147483647	©Set the address -2147483648 to 2147483647
INC Linear 1 : 02H INC Linear 2 : 0BH INC Linear 3 : 16H INC Linear 4 : 1BH Fixed-feed 1 : 03H Fixed-feed 2 : 0CH Fixed-feed 3 : 17H Fixed-feed 4 : 1CH	©Set the movement amount -2147483648 to 2147483647	©Set the movement amount -2147483648 to 2147483647
Forward run speed/position : 06H Reverse run speed/position : 07H Forward run position/speed : 08H Reverse run position/speed : 09H	©Set the movement amount 0 to 2147483647	©Set the movement amount 0 to 2147483647
ABS circular sub : 0DH ABS circular right : 0FH ABS circular left : 10H	©Set the address -2147483648 to 2147483647	©Set the address -2147483648 to 2147483647
INC circular sub : 0EH INC circular right : 11H INC circular left : 12H	©Set the movement amount -2147483648 to 2147483647	©Set the movement amount -2147483648 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions.  
(The value will be converted properly within the system.)



■ When " [Pr.1] Unit Setting" is "inch"

The table below lists the control systems that require the setting of the positioning address or movement amount and the associated setting ranges.

(With any control system excluded from the table below, neither the positioning address nor the movement amount needs to be set.)

[Da.2] setting value	Value set with peripheral device (inch)	Value set with PLC program *1 ( $\Delta 10^{-5}$ inch)
ABS Linear 1 : 01H ABS Linear 2 : 0AH ABS Linear 3 : 15H ABS Linear 4 : 1AH Current value changing : 81H	©Set the address -21474.83648 to 21474.83647	©Set the address -2147483648 to 2147483647
INC Linear 1 : 02H INC Linear 2 : 0BH INC Linear 3 : 16H INC Linear 4 : 1BH Fixed-feed 1 : 03H Fixed-feed 2 : 0CH Fixed-feed 3 : 17H Fixed-feed 4 : 1CH	©Set the movement amount -21474.83648 to 21474.83647	©Set the movement amount -2147483648 to 2147483647
Forward run speed/position : 06H Reverse run speed/position : 07H Forward run position/speed : 08H Reverse run position/speed : 09H	©Set the movement amount 0 to 21474.83647	©Set the movement amount 0 to 2147483647
ABS circular sub : 0DH ABS circular right : 0FH ABS circular left : 10H	©Set the address -21474.83648 to 21474.83647	©Set the address -2147483648 to 2147483647
INC circular sub : 0EH INC circular right : 11H INC circular left : 12H	©Set the movement amount -21474.83648 to 21474.83647	©Set the movement amount -2147483648 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions.  
(The value will be converted properly within the system.)




Item	Setting value, setting range		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
<b>Da.7</b> Arc address	The setting value range differs according to the " <b>Da.2</b> Control system". Here, the value within the [Table 1] range is set.		0	2008 2009	8008 8009	14008 14009	20008 20009

**Da.7** Arc address

The arc address is data required only when carrying out circular interpolation control.

- (1) When carrying out circular interpolation with sub point designation, set the sub point (passing point) address as the arc address.
- (2) When carrying out circular interpolation with center point designation, set the center point address of the arc as the arc address.

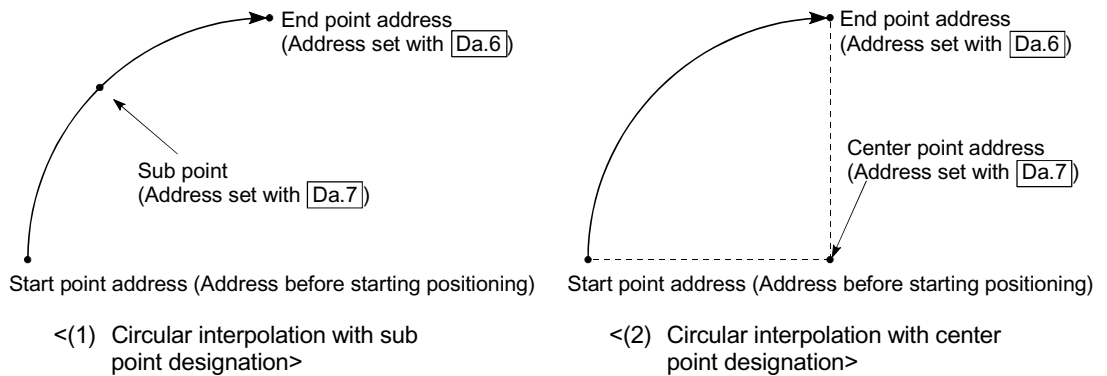

When not carrying out circular interpolation control, the value set in " **Da.7** Arc address" will be invalid.

[Table 1]

■ When " [Pr.1] Unit Setting" is "mm"

The table below lists the control systems that require the setting of the arc address and shows the setting range.

(With any control system excluded from the table below, the arc address does not need to be set.)

[Da.2] setting value	Value set with peripheral device ( $\sigma\text{m}$ )	Value set with PLC program *1 ( $\Delta 10^{-1}\sigma\text{m}$ )
ABS circular sub : 0DH ABS circular right : 0FH ABS circular left : 10H	©Set the address -214748364.8 to 214748364.7	©Set the address -2147483648 to 2147483647
INC circular sub : 0EH INC circular right : 11H INC circular left : 12H	©Set the movement amount -214748364.8 to 214748364.7	©Set the movement amount -2147483648 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions.  
(The value will be converted properly within the system.)

■ When " [Pr.1] Unit Setting" is "degree"

No control system requires the setting of the arc address by "degree".

■ When " [Pr.1] Unit Setting" is "PLS"

The table below lists the control systems that require the setting of the arc address and shows the setting range.

(With any control system excluded from the table below, the arc address does not need to be set.)

[Da.2] setting value	Value set with peripheral device (PLS)	Value set with PLC program *1 (PLS)
ABS circular sub : 0DH ABS circular right : 0FH ABS circular left : 10H	©Set the address -2147483648 to 2147483647	©Set the address -2147483648 to 2147483647
INC circular sub : 0EH INC circular right : 11H INC circular left : 12H	©Set the movement amount -2147483648 to 2147483647	©Set the movement amount -2147483648 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions.  
(The value will be converted properly within the system.)

■ When " [Pr.1] Unit Setting" is "inch"

The table below lists the control systems that require the setting of the arc address and shows the setting range.

(With any control system excluded from the table below, the arc address does not need to be set.)

[Da.2] setting value	Value set with peripheral device (inch)	Value set with PLC program *1 ( $\times 10^{-5}$ inch)
ABS circular sub : 0DH ABS circular right : 0FH ABS circular left : 10H	©Set the address -21474.83648 to 21474.83647	©Set the address -2147483648 to 2147483647
INC circular sub : 0EH INC circular right : 11H INC circular left : 12H	©Set the movement amount -21474.83648 to 21474.83647	©Set the movement amount -2147483648 to 2147483647

\*1: Set an integer because the PLC program cannot handle fractions.  
(The value will be converted properly within the system.)

Item	Setting value, setting range		Default value	Setting value buffer memory address				
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4	
<b>Da.8</b> Command speed	The setting value range differs depending on the " <b>Pr.1</b> Unit setting". Here, the value within the [Table 1] range is set. <div style="border: 1px solid black; padding: 5px; margin: 5px 0; text-align: center;">  [Table 1] on right page                     </div>		0	2004	8004	14004	20004	
	-1: Current speed (Speed set for previous positioning data No.)	-1		2005	8005	14005	20005	
<b>Da.9</b> Dwell time/ JUMP destination positioning data No.	Dwell time	The setting value range differs according to the " <b>Da.2</b> Control system". Here, the value within the [Table 2] range is set. <div style="border: 1px solid black; padding: 5px; margin: 5px 0; text-align: center;">  [Table 2] on right page                     </div>		0	2002	8002	14002	20002
	JUMP destination positioning data No.							
<b>Da.10</b> M code	M code	The setting value range differs according to the " <b>Da.2</b> Control system". Here, the value within the [Table 3] range is set. <div style="border: 1px solid black; padding: 5px; margin: 5px 0; text-align: center;">  [Table 3] on right page                     </div>		0	2001	8001	14001	20001
	Condition data No.							
	No. of LOOP to LEND repetitions							

**Da.8** Command speed

Set the command speed for positioning.

- (1) If the set command speed exceeds " **Pr.8** Speed limit value", positioning will be carried out at the speed limit value.
- (2) If "-1" is set for the command speed, the current speed (speed set for previous positioning data No.) will be used for positioning control. Use the current speed for uniform speed control, etc. If "-1" is set for continuing positioning data, and the speed is changed, the following speed will also change.

(Note that when starting positioning, if the "-1" speed is set for the positioning data that carries out positioning control first, the error "Command speed is not set"(error code: 503) will occur, and the positioning will not start. Refer to Section 15.2 "List of errors" for details on the errors.)

**Da.10** M code (or condition data No./No. of LOOP to LEND repetitions)

Set an "M code", a "condition data No. ", or the "number of LOOP to LEND repetitions" depending on how the " **Da.2** Control system" is set.

≠ If a method other than "JUMP instruction" and "LOOP" is selected as the " **Da.2** Control system"

..... Set an "M code".  
If no "M code" needs to be output, set "0" (default value).

≠ If "JUMP instruction" or "LOOP" is selected as the " **Da.2** Control system"

..... Set the "condition data No." for JUMP.  
0 : Unconditional JUMP to the positioning data specified by **Da.9** .

1 to 10 : JUMP performed according to the condition data No. specified (a number between 1 and 10).

Make sure that you specify the number of LOOP to LEND repetitions by a number other than "0". The "Control system LOOP setting error" will occur if you specify "0". (error code: 545)

\* The condition data specifies the condition for the JUMP instruction to be executed.

(A JUMP will take place when the condition is satisfied.)

[Table 1]

<b>Pr.1</b> setting value	Value set with peripheral device (unit)	Value set with PLC program (unit)
0 : mm	0.01 to 20000000.00 (mm/min)	1 to 2000000000 ( $\Delta 10^{-2}$ mm/min)
1 : inch	0.001 to 2000000.000 (inch/min)	1 to 2000000000 ( $\Delta 10^{-3}$ inch/min)
2 : degree	0.001 to 2000000.000 (degree/min)	1 to 2000000000 ( $\Delta 10^{-3}$ degree/min)
3 : PLS	1 to 10000000 (PLS/s)	1 to 10000000 (PLS/s)

[Table 2]

<b>Da.2</b> setting value	Setting item	Value set with peripheral device	Value set with PLC program
JUMP instruction: 82H	Positioning data No.	1 to 600	1 to 600
Other than JUMP instruction	Dwell time	0 to 65535 (ms)	0 to 65535 (ms)

[Table 3]

<b>Da.2</b> setting value	Setting item	Value set with peripheral device	Value set with PLC program
JUMP instruction: 82H	Condition data No.	0 to 10	0 to 10
Other than JUMP instruction	M code	0 to 65535	0 to 65535
LOOP: 83H	Repetition count	1 to 65535	1 to 65535


**Da.9** Dwell time/JUMP designation positioning data No.

Set the "dwell time" or "positioning data No." corresponding to the "**Da.2** Control system".

≠ When a method other than "JUMP instruction" is set for "**Da.2** Control system"  
 ..... Set the "dwell time".

≠ When "JUMP instruction" is set for "**Da.2** Control system"  
 ..... Set the "positioning data No." for the JUMP destination.

When the "dwell time" is set, the setting details of the "dwell time" will be as follows according to "**Da.1** Operation pattern".

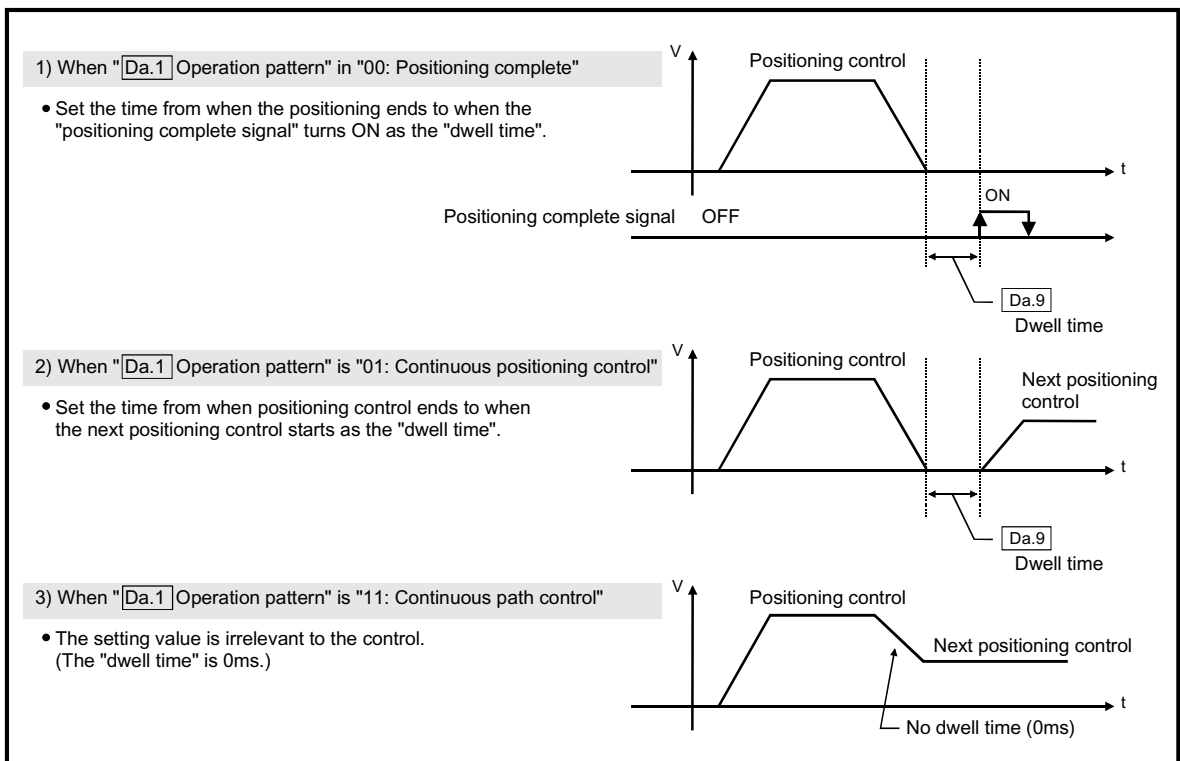







5.4 List of block start data



The illustrations below show the organization of the block start data stored in the QD75 buffer memory. The block start data setting items [Da.11] to [Da.14] are explained in the pages that follow.

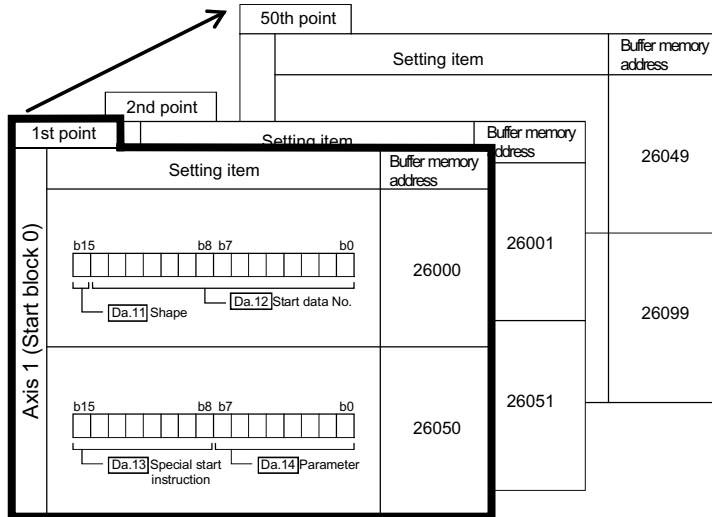

- Up to 50 block start data points can be set (stored) for each axis in the buffer memory addresses shown on the left.
- Items in a single unit of block start data are shown included in a bold frame.
- Each axis has five start blocks (block Nos. 0 to 4).

\* For information on the organization of the buffer memory addresses assigned to the start blocks 1 to 4, refer to Appendix 7 "List of buffer memory addresses".

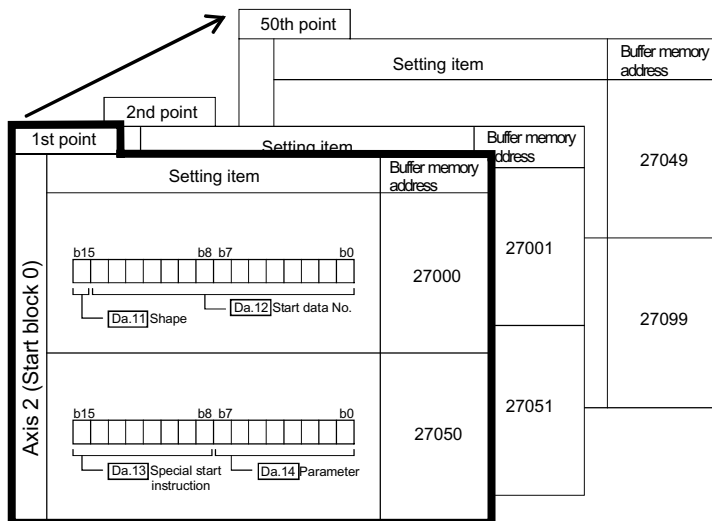

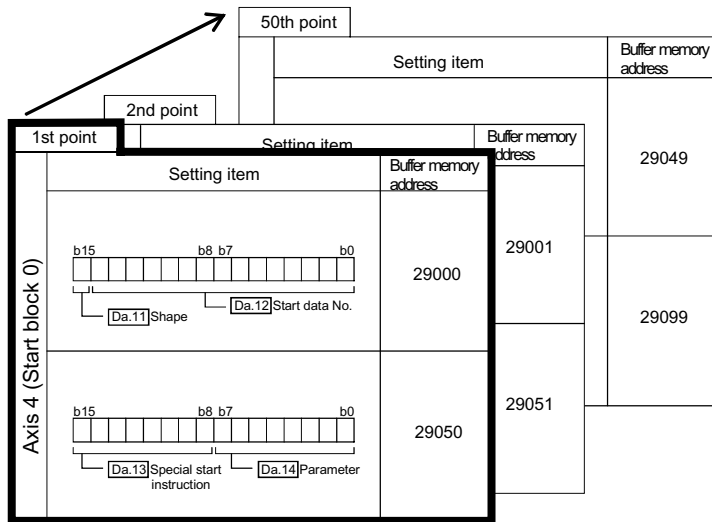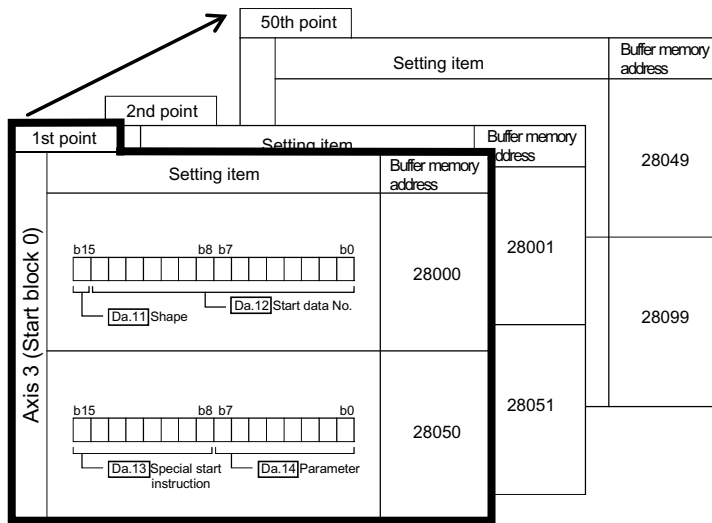

The pages that follow explain the block start data setting items ( [Da.11] to [Da.14] ).  
 (The buffer memory addresses shown are those of the "1st point block start data (block No. 7000)" for the axes 1 to 4.)

**REMARK**

To perform an high-level positioning control using block start data, set a number between 7000 and 7004 to the "Cd.3 Positioning start No." and use the "Cd.4 Positioning starting point No." to specify a point number between 1 and 50, a position counted from the beginning of the block.  
 The number between 7000 and 7004 specified here is called the "block No.". With the QD75, up to 50 "block start data" points and up to 10 "condition data" items can be assigned to each "block No.".

Block No. *	Axis	Block start data	Condition	Buffer memory	GX Configurator-QP
7000	Axis 1	Start block 0	Condition data (1 to 10)	Supports the settings	Supports the settings
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7001	Axis 1	Start block 1	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7002	Axis 1	Start block 2	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7003	Axis 1	Start block 3	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7004	Axis 1	Start block 4	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		

\*: Setting cannot be made when the "Pre-reading start function" is used. If you set any of Nos. 7000 to 7004 and perform the Pre-reading start function, "Outside start No. range error (error code: 543)" will occur.  
 (For details, refer to Section 12.7.8 "Pre-reading start function".)

Item	Setting value		Default value	Setting value buffer memory address			
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4
Da.11 Shape	0 : End  1 : Continue	0  1	0000H	26000	27000	28000	29000
Da.12 Start data No.	Positioning data No.: 1 to 600 (01H to 258H)	01H to 258H	0000H	26050	27050	28050	29050
Da.13 Special start instruction	0 : Block start (normal start)  1 : Condition start  2 : Wait start  3 : Simultaneous start  4 : FOR loop  5 : FOR condition  6 : NEXT start	00H  01H  02H  03H  04H  05H  06H	0000H	26050	27050	28050	29050
Da.14 Parameter	Condition data No.: 1 to 10 (01H to 0AH) No. of repetitions: 0 to 255 (00H to FFH)	00H to FFH	0000H	26050	27050	28050	29050

**Da.11** Shape

Set whether to carry out only the local "block start data" and then end control, or to execute the "block start data" set in the next point.

Setting value	Setting details
0 : End	Execute the designated point's "block start data", and then complete the control.
1 : Continue	Execute the designated point's "block start data", and after completing control, execute the next point's "block start data".

**Da.12** Start data No.

Set the "positioning data No." designated with the "block start data".

**Da.13** Special start instruction

Set the "special start instruction " for using "high-level positioning control". (Set how to start the positioning data set in " **Da.12** Start data No.".)

Setting value	Setting details
00H : Block start (Normal start)	Execute the random block positioning data in the set order with one start.
01H : Condition start	Carry out the condition judgment set in "condition data" for the designated positioning data, and when the conditions are established, execute the "block start data". If not established, ignore that "block start data", and then execute the next point's "block start data".
02H : Wait start	Carry out the condition judgment set in "condition data" for the designated positioning data, and when the conditions are established, execute the "block start data". If not established, stop the control (wait) until the conditions are established.
03H : Simultaneous start	Simultaneous execute (output pulses at same timing) the positioning data with the No. designated for the axis designated in the "condition data". Up to four axes can start simultaneously.
04H : Repeated start (FOR loop)	Repeat the program from the block start data with the "FOR loop" to the block start data with "NEXT" for the designated No. of times.
05H : Repeated start (FOR condition)	Repeat the program from the block start data with the "FOR condition" to the block start data with "NEXT" until the conditions set in the "condition data" are established.
06H : NEXT start	Set the end of the repetition when "05H: Repetition start (FOR loop)" or "06H: Repetition start (FOR condition)" is set.

Refer to Chapter 10 "High-level Positioning Control" for details on the control.

**Da.14** Parameter


Set the value as required for " **Da.13** Special start instruction ".

<b>Da.13</b> Special start instruction	Setting value	Setting details
Block start (Normal start)	—	Not used. (There is no need to set.)
Condition start	1 to 10	Set the condition data No. (Data No. of "condition data" is set up for the condition judgment.)
Wait start		
Simultaneous start		
Repeated start (FOR loop)	0 to 255	Set the No. of repetitions.
Repeated start (FOR condition)	1 to 10	Set the condition data No. (Data No. of "condition data" is set up for the condition judgment.)




5.5 List of condition data

The illustrations below show the organization of the condition data stored in the QD75 buffer memory. The condition data setting items [Da.15] to [Da.19] are explained in the pages that follow.

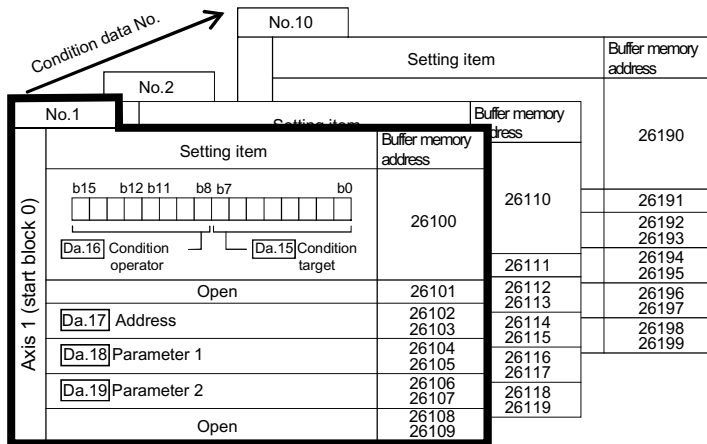

- Up to 10 block start data points can be set (stored) for each axis in the buffer memory addresses shown on the left.
- Items in a single unit of condition data are shown included in a bold frame.
- Each axis has five start blocks (block Nos. 0 to 4).

\* For information on the organization of the buffer memory addresses assigned to the start blocks 1 to 4, refer to Appendix 7 "List of buffer memory addresses".

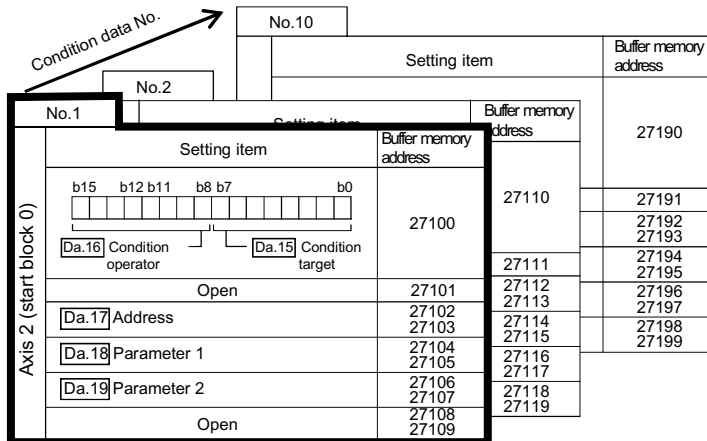

Condition data No. →

		No.10		
		Setting item		Buffer memory address
Axis 3 (start block 0)	No.1			28190
	No.2			
	Setting item		Buffer memory address	
	b15 b12 b11 b8 b7 b0		28110	28191
	Da.16 Condition operator			28192
	Da.15 Condition target			28193
	Open		28101	28194
	Da.17 Address		28102	28195
			28103	28196
	Da.18 Parameter 1		28104	28197
			28105	28198
	Da.19 Parameter 2		28106	28199
		28107		
Open		28108		
		28109		

Condition data No. →

		No.10		
		Setting item		Buffer memory address
Axis 4 (start block 0)	No.1			29190
	No.2			
	Setting item		Buffer memory address	
	b15 b12 b11 b8 b7 b0		29110	29191
	Da.16 Condition operator			29192
	Da.15 Condition target			29193
	Open		29101	29194
	Da.17 Address		29102	29195
			29103	29196
	Da.18 Parameter 1		29104	29197
			29105	29198
	Da.19 Parameter 2		29106	29199
		29107		
Open		29108		
		29109		

The pages that follow explain the condition data setting items ( Da.15 to Da.19 ).

(The buffer memory addresses shown are those of the "condition data No. 1 (block No. 7000)" for the axes 1 to 4.)



**REMARK**

To perform an high-level positioning control using block start data, set a number between 7000 and 7004 to the "Cd.3 Positioning start No." and use the "Cd.4 Positioning starting point No." to specify a point number between 1 and 50, a position counted from the beginning of the block.

The number between 7000 and 7004 specified here is called the "block No."

With the QD75, up to 50 "block start data" points and up to 10 "condition data" items can be assigned to each "block No."

Block No. *	Axis	Block start data	Condition	Buffer memory	GX Configurator-QP
7000	Axis 1	Start block 0	Condition data (1 to 10)	Supports the settings	Supports the settings
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7001	Axis 1	Start block 1	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7002	Axis 1	Start block 2	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7003	Axis 1	Start block 3	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		
7004	Axis 1	Start block 4	Condition data (1 to 10)		
	Axis 2		Condition data (1 to 10)		
	Axis 3		Condition data (1 to 10)		
	Axis 4		Condition data (1 to 10)		

\*: Setting cannot be made when the "Pre-reading start function" is used. If you set any of Nos. 7000 to 7004 and perform the Pre-reading start function, "Outside start No. range error (error code: 543)" will occur.

(For details, refer to Section "12.7.8 Pre-reading start function".)

Item	Setting value		Default value	Setting value buffer memory address					
	Value set with peripheral device	Value set with PLC program		Axis 1	Axis 2	Axis 3	Axis 4		
Condition identifier	Da.15 Condition target	01 : Device X	01H		0000H	26100	27100	28100	29100
		02 : Device Y	02H						
		03 : Buffer memory (1-word)	03H						
		04 : Buffer memory (2-word)	04H						
		05 : Positioning data No.	05H						
	Da.16 Condition operator	01 : I1=P1	01H						
		02 : I1P1	02H						
		03 : I1Q1	03H						
		04 : I1Q1	04H						
		05 : P1Q1I1Q2	05H						
		06 : I1Q1, P2Q1	06H						
		07 : DEV=ON	07H						
		08 : DEV=OFF	08H						
		10 : Axis 1 selected	10H						
		20 : Axis 2 selected	20H						
		30 : Axes 1 and 2 selected	30H						
		40 : Axis 3 selected	40H						
		50 : Axes 1 and 3 selected	50H						
		60 : Axes 2 and 3 selected	60H						
		70 : Axes 1, 2, and 3 selected	70H						
80 : Axis 4 selected	80H								
90 : Axes 1 and 4 selected	90H								
A0 : Axes 2 and 4 selected	A0H								
B0 : Axes 1, 2, and 4 selected	B0H								
C0 : Axes 3 and 4 selected	C0H								
D0 : Axes 1, 3, and 4 selected	D0H								
E0 : Axes 2, 3, and 4 selected	E0H								
Da.17 Address	Buffer memory address	Example) 	0000H	26102 26103	27102 27103	28102 28103	29102 29103		
Da.18 Parameter 1	Value	Example) 	0000H	26104 26105	27104 27105	28104 28105	29104 29105		
Da.19 Parameter 2	Value	Example) 	0000H	26106 26107	27106 27107	28106 28107	29106 29107		

**Da.15** Condition target

Set the condition target as required for each control.

Setting value	Setting details
01H : Device X	Set the input/output signal ON/OFF as the conditions.
02H : Device Y	
03H : Buffer memory (1-word)	Set the value stored in the buffer memory as the condition. 03H: The target buffer memory is "1-word (16 bits)" 04H: The target buffer memory is "2-word (32 bits)"
04H : Buffer memory (2-word)	
05H : Positioning data No.	Select only for "simultaneous start".

**Da.16** Condition operator

Set the condition operator as required for the " **Da.15** Condition target".

<b>Da.15</b> Condition target	Setting value	Setting details
01H: Device X	07H : DEV=ON	The state (ON/OFF) of an I/O signal is defined as the condition. Select ON or OFF as the trigger.
02H: Device Y	08H : DEV=OFF	
03H: Buffer memory (1-word) 04H: Buffer memory (2-word)	01H : 11=P1	Select how to use the value (11) in the buffer memory as a part of the condition.
	02H : 11P1	
	03H : 11P1	
	04H : 11P1	
	05H : P1Q1P2	
05H: Positioning data No.	06H : 11P1, P2Q1	If "simultaneous start" is specified, select the axis (or axes) that should start simultaneously.
	10H : Axis 1 selected	
	20H : Axis 2 selected	
	30H : Axes 1 and 2 selected	
	40H : Axis 3 selected	
	50H : Axes 1 and 3 selected	
	60H : Axes 2 and 3 selected	
	70H : Axes 1, 2, and 3 selected	
	80H : Axis 4 selected	
	90H : Axes 1 and 4 selected	
	A0H : Axes 2 and 4 selected	
	B0H : Axes 1, 2, and 4 selected	
C0H : Axes 3 and 4 selected		
D0H : Axes 1, 3, and 4 selected		
E0H : Axes 2, 3, and 4 selected		

**Da.17** Address

Set the address as required for the " **Da.15** Condition target".

<b>Da.15</b> Condition target	Setting value	Setting details
01H : Device X	-	Not used. (There is no need to set.)
02H : Device Y		
03H : Buffer memory (1-word)	Value (Buffer memory address)	Set the target "buffer memory address". (For 2 word, set the low-order buffer memory address.)
04H : Buffer memory (2-word)		
05H : Positioning data No.	-	Not used. (There is no need to set.)

## Da.18 Parameter 1

Set the parameters as required for the " Da.16 Condition operator".

Da.16 Condition operator	Setting value	Setting details
01H : 1I=P1	Value	The value of P1 should be equal to or smaller than the value of P2. (P1≤P2) If P1 is greater than P2 (P1>P2), the "condition data error" (error code 533) will occur.
02H : 1I]P1		
03H : 1IOP1		
04H : 1IOP1		
05H : P1Ω1ΩP2		
06H : 1IOP1, P2Ω1		
07H : DEV=ON	Value (bit No.)	Set the device bit No. X: 0H to 1H, 4H to 11H Y: 0, 4H to 17H
08H : DEV=OFF		
10H : Axis 1 selected	Value (positioning data No.)	Set the positioning data No. for starting axis 1 and/or axis 2. Low-order 16-bit : Axis 1 positioning data No. 1 to 600 (01H to 258H) High-order 16-bit : Axis 2 positioning data No. 1 to 600 (01H to 258H)
↓		
E0H : Axes 2, 3, and 4 selected		

## Da.19 Parameter 2


Set the parameters as required for the " Da.16 Condition operator".

Da.16 Condition operator	Setting value	Setting details
01H : 1I=P1	—	Not used. (No need to be set.)
02H : 1I]P1		
03H : 1IOP1		
04H : 1IOP1		
05H : P1Ω1ΩP2	Value	The value of P2 should be equal to or greater than the value of P1. (P1≤P2) If P1 is greater than P2 (P1>P2), the "condition data error" (error code 533) will occur.
06H : 1IOP1, P2Ω1		
07H : DEV=ON	—	Not used. (No need to be set.)
08H : DEV=OFF		
10H : Axis 1 selected		
20H : Axis 2 selected		
30H : Axes 1 and 2 selected		
40H : Axis 3 selected	Value (positioning data No.)	Set the positioning data No. for starting axis 3 and/or axis 4. Low-order 16-bit : Axis 3 positioning data No. 1 to 600 (01H to 258H) High-order 16-bit : Axis 4 positioning data No. 1 to 600 (01H to 258H)
50H : Axes 1 and 3 selected		
60H : Axes 2 and 3 selected		
70H : Axes 1, 2, and 3 selected		
80H : Axis 4 selected		
90H : Axes 1 and 4 selected		
A0H : Axes 2 and 4 selected		
B0H : Axes 1, 2, and 4 selected		
C0H : Axes 3 and 4 selected		
D0H : Axes 1, 3, and 4 selected		
E0H : Axes 2, 3, and 4 selected		

## 5.6 List of monitor data

## 5.6.1 System monitor data

Storage item	Storage details0	
Md.1 In test mode flag	Whether the mode is the test mode from the peripheral device or not is stored. ⊖ When not in test mode : OFF ⊖ When in test mode : ON	

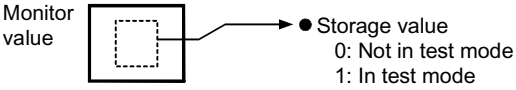	Reading the monitor value	Default value	Storage buffer memory address (common for axis 1 to axis 4)
<p>■ Monitoring is carried out with a decimal.</p>	<p>Monitor value</p>  <p>● Storage value 0: Not in test mode 1: In test mode</p>	0	1200

(Unless noted in particular, the monitor value is saved as binary data.)

Storage item	Storage details	Reading the monitor value																																																																																		
<p style="writing-mode: vertical-rl; transform: rotate(180deg);">Starting history (Up to 16 records can be stored)</p> <p><b>Md.3</b> Start information</p>	<p>[Storage details]</p> <p>[Reading the monitor value]</p>	<p>This area stores the start information (restart flag, start origin, and start axis):</p> <ul style="list-style-type: none"> <li>≠ Restart flag: Indicates whether the operation has or has not been halted and restarted.</li> <li>≠ Start origin : Indicates the source of the start signal.</li> <li>≠ Start axis : Indicates the started axis.</li> </ul> <p>■ Monitoring is carried out with a hexadecimal display.</p> <table border="1" data-bbox="702 772 837 896"> <thead> <tr> <th>Stored contents</th> <th>Storage value</th> </tr> </thead> <tbody> <tr> <td>PLC CPU</td> <td>00</td> </tr> <tr> <td>External signal</td> <td>01</td> </tr> <tr> <td>Peripheral device</td> <td>10</td> </tr> </tbody> </table> <table border="1" data-bbox="1077 739 1428 884"> <thead> <tr> <th>Stored contents</th> <th>Storage value</th> </tr> </thead> <tbody> <tr> <td>Axis 1</td> <td>1</td> </tr> <tr> <td>Axis 2</td> <td>2</td> </tr> <tr> <td>Axis 3</td> <td>3</td> </tr> <tr> <td>Axis 4</td> <td>4</td> </tr> </tbody> </table> <table border="1" data-bbox="518 929 837 1019"> <thead> <tr> <th>Stored contents</th> <th>Storage value</th> </tr> </thead> <tbody> <tr> <td>Restart flag OFF</td> <td>0</td> </tr> <tr> <td>Restart flag ON</td> <td>1</td> </tr> </tbody> </table>	Stored contents	Storage value	PLC CPU	00	External signal	01	Peripheral device	10	Stored contents	Storage value	Axis 1	1	Axis 2	2	Axis 3	3	Axis 4	4	Stored contents	Storage value	Restart flag OFF	0	Restart flag ON	1																																																										
Stored contents	Storage value																																																																																			
PLC CPU	00																																																																																			
External signal	01																																																																																			
Peripheral device	10																																																																																			
Stored contents	Storage value																																																																																			
Axis 1	1																																																																																			
Axis 2	2																																																																																			
Axis 3	3																																																																																			
Axis 4	4																																																																																			
Stored contents	Storage value																																																																																			
Restart flag OFF	0																																																																																			
Restart flag ON	1																																																																																			
<p><b>Md.4</b> Start No.</p>	<p>The starting No. is stored.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <table border="1" data-bbox="837 1220 1372 1534"> <thead> <tr> <th rowspan="2">Stored contents</th> <th colspan="4">Storage value</th> <th rowspan="2">Reference (Decimal)</th> </tr> <tr> <th>A</th> <th>B</th> <th>C</th> <th>D</th> </tr> </thead> <tbody> <tr> <td rowspan="7">Positioning operation</td> <td>0</td> <td>0</td> <td>0</td> <td>1</td> <td>001</td> </tr> <tr> <td colspan="5" style="text-align: center;">to</td> </tr> <tr> <td>0</td> <td>2</td> <td>5</td> <td>8</td> <td>600</td> </tr> <tr> <td>1</td> <td>B</td> <td>5</td> <td>8</td> <td>7000</td> </tr> <tr> <td>1</td> <td>B</td> <td>5</td> <td>9</td> <td>7001</td> </tr> <tr> <td>1</td> <td>B</td> <td>5</td> <td>A</td> <td>7002</td> </tr> <tr> <td>1</td> <td>B</td> <td>5</td> <td>B</td> <td>7003</td> </tr> <tr> <td>JOG operation</td> <td>2</td> <td>3</td> <td>3</td> <td>2</td> <td>9010</td> </tr> <tr> <td>Manual pulse generator</td> <td>2</td> <td>3</td> <td>3</td> <td>3</td> <td>9011</td> </tr> <tr> <td>Machine OPR</td> <td>2</td> <td>3</td> <td>2</td> <td>9</td> <td>9001</td> </tr> <tr> <td>Fast OPR</td> <td>2</td> <td>3</td> <td>2</td> <td>A</td> <td>9002</td> </tr> <tr> <td>Current value changing</td> <td>2</td> <td>3</td> <td>2</td> <td>B</td> <td>9003</td> </tr> <tr> <td>Simultaneous start</td> <td>2</td> <td>3</td> <td>2</td> <td>C</td> <td>9004</td> </tr> </tbody> </table>	Stored contents	Storage value				Reference (Decimal)	A	B	C	D	Positioning operation	0	0	0	1	001	to					0	2	5	8	600	1	B	5	8	7000	1	B	5	9	7001	1	B	5	A	7002	1	B	5	B	7003	JOG operation	2	3	3	2	9010	Manual pulse generator	2	3	3	3	9011	Machine OPR	2	3	2	9	9001	Fast OPR	2	3	2	A	9002	Current value changing	2	3	2	B	9003	Simultaneous start	2	3	2	C	9004
Stored contents	Storage value				Reference (Decimal)																																																																															
	A	B	C	D																																																																																
Positioning operation	0	0	0	1	001																																																																															
	to																																																																																			
	0	2	5	8	600																																																																															
	1	B	5	8	7000																																																																															
	1	B	5	9	7001																																																																															
	1	B	5	A	7002																																																																															
	1	B	5	B	7003																																																																															
JOG operation	2	3	3	2	9010																																																																															
Manual pulse generator	2	3	3	3	9011																																																																															
Machine OPR	2	3	2	9	9001																																																																															
Fast OPR	2	3	2	A	9002																																																																															
Current value changing	2	3	2	B	9003																																																																															
Simultaneous start	2	3	2	C	9004																																																																															
<p><b>Md.5</b> Start Hour</p>	<p>The starting time is stored.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Buffer memory (stored with BCD code)</p> <p>00 to 23 (hour)</p>																																																																																		
<p><b>Md.6</b> Start Minute: second</p>	<p>The starting time is stored.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Buffer memory (stored with BCD code)</p> <p>00 to 59 (minute) 00 to 59 (second)</p>																																																																																		



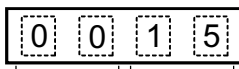
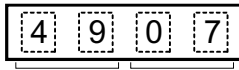
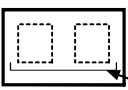
Note: If a start signal is issued against an operating axis, a record relating to this event may be output before a record relating to an earlier start signal is output.

Default value	Storage buffer memory address (common to axes 1 to 4)																																																																																																																																																																																																																											
0000H	<div style="text-align: center;"> <table border="1" style="margin: auto;"> <tr> <td style="padding: 5px;">Md.8</td> <td style="padding: 5px;">1292</td> </tr> <tr> <td style="padding: 5px;">Start history pointer</td> <td></td> </tr> </table> <p style="text-align: center;">↑ Indicates a pointer No. that is next to the Pointer No. assigned to the latest of the existing starting history records.</p> </div> <div style="margin-top: 20px;"> <p>Pointer No. ↓</p> <table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <thead> <tr> <th style="width: 15%;"></th> <th style="width: 5%;">0</th><th style="width: 5%;">1</th><th style="width: 5%;">2</th><th style="width: 5%;">3</th><th style="width: 5%;">4</th><th style="width: 5%;">5</th><th style="width: 5%;">6</th><th style="width: 5%;">7</th><th style="width: 5%;">8</th><th style="width: 5%;">9</th><th style="width: 5%;">10</th><th style="width: 5%;">11</th><th style="width: 5%;">12</th><th style="width: 5%;">13</th><th style="width: 5%;">14</th><th style="width: 5%;">15</th> </tr> </thead> <tbody> <tr> <td style="text-align: left; vertical-align: middle;">Starting history</td> <td colspan="16" style="border: none;">Pointer No.</td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Md.3</td> <td style="border: none;">1212</td><td style="border: none;">1217</td><td style="border: none;">1222</td><td style="border: none;">1227</td><td style="border: none;">1232</td><td style="border: none;">1237</td><td style="border: none;">1242</td><td style="border: none;">1247</td><td style="border: none;">1252</td><td style="border: none;">1257</td><td style="border: none;">1262</td><td style="border: none;">1267</td><td style="border: none;">1272</td><td style="border: none;">1277</td><td style="border: none;">1282</td><td style="border: none;">1287</td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Start information</td> <td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Md.4</td> <td style="border: none;">1213</td><td style="border: none;">1218</td><td style="border: none;">1223</td><td style="border: none;">1228</td><td style="border: none;">1233</td><td style="border: none;">1238</td><td style="border: none;">1243</td><td style="border: none;">1248</td><td style="border: none;">1253</td><td style="border: none;">1258</td><td style="border: none;">1263</td><td style="border: none;">1268</td><td style="border: none;">1273</td><td style="border: none;">1278</td><td style="border: none;">1283</td><td style="border: none;">1288</td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Start No.</td> <td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Md.5</td> <td style="border: none;">1214</td><td style="border: none;">1219</td><td style="border: none;">1224</td><td style="border: none;">1229</td><td style="border: none;">1234</td><td style="border: none;">1239</td><td style="border: none;">1244</td><td style="border: none;">1249</td><td style="border: none;">1254</td><td style="border: none;">1259</td><td style="border: none;">1264</td><td style="border: none;">1269</td><td style="border: none;">1274</td><td style="border: none;">1279</td><td style="border: none;">1284</td><td style="border: none;">1289</td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Start hour</td> <td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Md.6</td> <td style="border: none;">1215</td><td style="border: none;">1220</td><td style="border: none;">1225</td><td style="border: none;">1230</td><td style="border: none;">1235</td><td style="border: none;">1240</td><td style="border: none;">1245</td><td style="border: none;">1250</td><td style="border: none;">1255</td><td style="border: none;">1260</td><td style="border: none;">1265</td><td style="border: none;">1270</td><td style="border: none;">1275</td><td style="border: none;">1280</td><td style="border: none;">1285</td><td style="border: none;">1290</td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Start min: sec</td> <td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Md.7</td> <td style="border: none;">1216</td><td style="border: none;">1221</td><td style="border: none;">1226</td><td style="border: none;">1231</td><td style="border: none;">1236</td><td style="border: none;">1241</td><td style="border: none;">1246</td><td style="border: none;">1251</td><td style="border: none;">1256</td><td style="border: none;">1261</td><td style="border: none;">1266</td><td style="border: none;">1271</td><td style="border: none;">1276</td><td style="border: none;">1281</td><td style="border: none;">1286</td><td style="border: none;">1291</td> </tr> <tr> <td style="border: none;"></td> <td style="border: none;">Error judgement</td> <td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td><td style="border: none;"></td> </tr> </tbody> </table> <p style="margin-top: 10px;">↑      ↑ Item    Buffer memory address</p> </div>		Md.8	1292	Start history pointer			0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	Starting history	Pointer No.																	Md.3	1212	1217	1222	1227	1232	1237	1242	1247	1252	1257	1262	1267	1272	1277	1282	1287		Start information																		Md.4	1213	1218	1223	1228	1233	1238	1243	1248	1253	1258	1263	1268	1273	1278	1283	1288		Start No.																		Md.5	1214	1219	1224	1229	1234	1239	1244	1249	1254	1259	1264	1269	1274	1279	1284	1289		Start hour																		Md.6	1215	1220	1225	1230	1235	1240	1245	1250	1255	1260	1265	1270	1275	1280	1285	1290		Start min: sec																		Md.7	1216	1221	1226	1231	1236	1241	1246	1251	1256	1261	1266	1271	1276	1281	1286	1291		Error judgement																
Md.8	1292																																																																																																																																																																																																																											
Start history pointer																																																																																																																																																																																																																												
	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15																																																																																																																																																																																																												
Starting history	Pointer No.																																																																																																																																																																																																																											
	Md.3	1212	1217	1222	1227	1232	1237	1242	1247	1252	1257	1262	1267	1272	1277	1282	1287																																																																																																																																																																																																											
	Start information																																																																																																																																																																																																																											
	Md.4	1213	1218	1223	1228	1233	1238	1243	1248	1253	1258	1263	1268	1273	1278	1283	1288																																																																																																																																																																																																											
	Start No.																																																																																																																																																																																																																											
	Md.5	1214	1219	1224	1229	1234	1239	1244	1249	1254	1259	1264	1269	1274	1279	1284	1289																																																																																																																																																																																																											
	Start hour																																																																																																																																																																																																																											
	Md.6	1215	1220	1225	1230	1235	1240	1245	1250	1255	1260	1265	1270	1275	1280	1285	1290																																																																																																																																																																																																											
	Start min: sec																																																																																																																																																																																																																											
	Md.7	1216	1221	1226	1231	1236	1241	1246	1251	1256	1261	1266	1271	1276	1281	1286	1291																																																																																																																																																																																																											
	Error judgement																																																																																																																																																																																																																											
0000	<ul style="list-style-type: none"> <li>• Each group of buffer memory addresses storing a complete starting history record is assigned a pointer No. Example: Pointer No. 0 = Buffer memory addresses 1212 to 1216 Pointer No. 1 = Buffer memory addresses 1217 to 1221 Pointer No. 2 = Buffer memory addresses 1222 to 1226                   ⋮ Pointer No. 15 = Buffer memory addresses 1287 to 1291</li> <li>• Each history record is assigned a pointer No. in the range between 0 and 15. If the pointer No. 15 has been assigned to a new record, the next record will be assigned the pointer number 0. (A new record replaces an older record when a pointer No. is reassigned.)</li> </ul>																																																																																																																																																																																																																											
0000																																																																																																																																																																																																																												





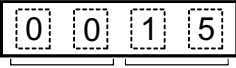
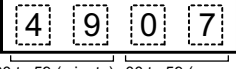

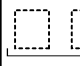
Storage item	Storage details	Reading the monitor value												
<p style="writing-mode: vertical-rl; transform: rotate(180deg);">Starting history (Up to 16 records can be stored)</p> <p><b>Md.7</b> Error judgment</p>	<p>[Storage details] This area stores the following results of the error judgment performed upon starting:</p> <ul style="list-style-type: none"> <li>≠ BUSY start warning flag</li> <li>≠ Error flag</li> <li>≠ Error No.</li> </ul> <p>[Reading the monitor value] ■ Monitoring is carried out with a hexadecimal display.</p>	<p>Buffer memory: b15, b12, b8, b4, b0</p> <p>Monitor value: A, B, C, D</p> <table border="1"> <thead> <tr> <th>Stored contents</th> <th>Storage value</th> </tr> </thead> <tbody> <tr> <td>Error flag OFF</td> <td>0</td> </tr> <tr> <td>Error flag ON</td> <td>1</td> </tr> </tbody> </table> <table border="1"> <thead> <tr> <th>Stored contents</th> <th>Storage value</th> </tr> </thead> <tbody> <tr> <td>BUSY start warning OFF</td> <td>0</td> </tr> <tr> <td>BUSY start warning ON</td> <td>1</td> </tr> </tbody> </table> <p>● Error No. Convert the hexadecimal value "a, B, C, D" into a decimal value and match it with "15.2 List of errors".</p>	Stored contents	Storage value	Error flag OFF	0	Error flag ON	1	Stored contents	Storage value	BUSY start warning OFF	0	BUSY start warning ON	1
Stored contents	Storage value													
Error flag OFF	0													
Error flag ON	1													
Stored contents	Storage value													
BUSY start warning OFF	0													
BUSY start warning ON	1													
<p><b>Md.8</b> Start history pointer</p>	<p>Indicates a pointer No. that is next to the Pointer No. assigned to the latest of the existing starting history records.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value:  ● Storage value (Pointer number) 0 to 15</p>												

Default value	Storage buffer memory address (common to axes 1 to 4)
0000H	<div style="text-align: center;"> </div> <p>             • Each group of buffer memory addresses storing a complete starting history record is assigned a pointer No.              Example: Pointer No. 0 = Buffer memory addresses 1212 to 1216              Pointer No. 1 = Buffer memory addresses 1217 to 1221              Pointer No. 2 = Buffer memory addresses 1222 to 1226              ⋮              Pointer No. 15 = Buffer memory addresses 1287 to 1291         </p> <p>             • Each history record is assigned a pointer No. in the range between 0 and 15.              If the pointer No. 15 has been assigned to a new record, the next record will be assigned the pointer number 0.              (A new record replaces an older record when a pointer No. is reassigned.)         </p>
0	1292


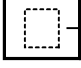
Storage item	Storage details	Reading the monitor value																
<p><b>Md.9</b> Axis in which the error occurred</p>	<p>Stores a number (Axis No.) that indicates the axis that encountered an error.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Storage value                      1: Axis 1                      2: Axis 2                      3: Axis 3                      4: Axis 4</p>																
<p><b>Md.10</b> Axis error No.</p>	<p>Stores an axis error No.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Error No.                      For details on the error Nos. (Error codes), refer to Section 15.2 "List of errors".</p>																
<p><b>Md.11</b> Axis error occurrence (Hour)</p>	<p>Stores the time at which an axis error was detected.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Buffer memory (stored with BCD code)</p> <table border="1" data-bbox="758 974 1005 1064"> <tr> <td>0</td> <td>0</td> <td>1</td> <td>5</td> </tr> <tr> <td>b15</td> <td>b12</td> <td>b8</td> <td>b4</td> </tr> <tr> <td>0:0:0:0</td> <td>0:0:0:0</td> <td>0:0:0:1</td> <td>0:1:0:1</td> </tr> <tr> <td colspan="2">Not used</td> <td>0 to 2</td> <td>0 to 3</td> </tr> </table> <p>→ Monitor value                       00 to 23 (hour)</p>	0	0	1	5	b15	b12	b8	b4	0:0:0:0	0:0:0:0	0:0:0:1	0:1:0:1	Not used		0 to 2	0 to 3
0	0	1	5															
b15	b12	b8	b4															
0:0:0:0	0:0:0:0	0:0:0:1	0:1:0:1															
Not used		0 to 2	0 to 3															
<p><b>Md.12</b> Axis error occurrence (Minute: second)</p>	<p>Stores the time at which an axis error was detected.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Buffer memory (stored with BCD code)</p> <table border="1" data-bbox="758 1254 1005 1344"> <tr> <td>4</td> <td>9</td> <td>0</td> <td>7</td> </tr> <tr> <td>b15</td> <td>b12</td> <td>b8</td> <td>b4</td> </tr> <tr> <td>0:1:0:0</td> <td>0:1:0:1</td> <td>0:0:0:0</td> <td>0:1:1:1</td> </tr> <tr> <td colspan="2">0 to 5</td> <td>0 to 9</td> <td>0 to 9</td> </tr> </table> <p>→ Monitor value                       00 to 59 (minute) 00 to 59 (second)</p>	4	9	0	7	b15	b12	b8	b4	0:1:0:0	0:1:0:1	0:0:0:0	0:1:1:1	0 to 5		0 to 9	0 to 9
4	9	0	7															
b15	b12	b8	b4															
0:1:0:0	0:1:0:1	0:0:0:0	0:1:1:1															
0 to 5		0 to 9	0 to 9															
<p><b>Md.13</b> Error history pointer</p>	<p>Indicates a pointer No. that is next to the Pointer No. assigned to the latest of the existing records.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Storage value (Pointer number)                      0 to 15</p>																

Error history (Up to 16 records can be stored)

Default value	Storage buffer memory address (common to axes 1 to 4)																																																																																											
0	<div style="text-align: center;"> <table border="1" style="margin: auto;"> <tr> <td style="padding: 2px;">Md.13</td> <td style="padding: 2px;">Error history pointer</td> <td style="padding: 2px;">1357</td> </tr> </table> </div>		Md.13	Error history pointer	1357																																																																																							
Md.13	Error history pointer	1357																																																																																										
0	<p style="text-align: center;">↑ Indicates a pointer No. that is next to the Pointer No. assigned to the latest of the existing error history records.</p>																																																																																											
0000	<table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="width: 10%; text-align: left;">Error history</th> <th style="width: 10%;">Pointer No.</th> <th style="width: 10%;">0</th> <th style="width: 10%;">1</th> <th style="width: 10%;">2</th> <th style="width: 10%;">3</th> <th style="width: 10%;">4</th> <th style="width: 10%;">5</th> <th style="width: 10%;">6</th> <th style="width: 10%;">7</th> <th style="width: 10%;">8</th> <th style="width: 10%;">9</th> <th style="width: 10%;">10</th> <th style="width: 10%;">11</th> <th style="width: 10%;">12</th> <th style="width: 10%;">13</th> <th style="width: 10%;">14</th> <th style="width: 10%;">15</th> </tr> </thead> <tbody> <tr> <td style="text-align: center;">Md.9 Axis in which the error occurred</td> <td></td> <td>1293</td> <td>1297</td> <td>1301</td> <td>1305</td> <td>1309</td> <td>1313</td> <td>1317</td> <td>1321</td> <td>1325</td> <td>1329</td> <td>1333</td> <td>1337</td> <td>1341</td> <td>1345</td> <td>1349</td> <td>1353</td> </tr> <tr> <td style="text-align: center;">Md.10 Axis error No.</td> <td></td> <td>1294</td> <td>1298</td> <td>1302</td> <td>1306</td> <td>1310</td> <td>1314</td> <td>1318</td> <td>1322</td> <td>1326</td> <td>1330</td> <td>1334</td> <td>1338</td> <td>1342</td> <td>1346</td> <td>1350</td> <td>1354</td> </tr> <tr> <td style="text-align: center;">Md.11 Axis error occurrence hour</td> <td></td> <td>1295</td> <td>1299</td> <td>1303</td> <td>1307</td> <td>1311</td> <td>1315</td> <td>1319</td> <td>1323</td> <td>1327</td> <td>1331</td> <td>1335</td> <td>1339</td> <td>1343</td> <td>1347</td> <td>1351</td> <td>1355</td> </tr> <tr> <td style="text-align: center;">Md.12 Axis error occurrence min: sec</td> <td></td> <td>1296</td> <td>1300</td> <td>1304</td> <td>1308</td> <td>1312</td> <td>1316</td> <td>1320</td> <td>1324</td> <td>1328</td> <td>1332</td> <td>1336</td> <td>1340</td> <td>1344</td> <td>1348</td> <td>1352</td> <td>1356</td> </tr> </tbody> </table> <p style="text-align: center;">↑ Item    ↑ Buffer memory address</p>		Error history	Pointer No.	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	Md.9 Axis in which the error occurred		1293	1297	1301	1305	1309	1313	1317	1321	1325	1329	1333	1337	1341	1345	1349	1353	Md.10 Axis error No.		1294	1298	1302	1306	1310	1314	1318	1322	1326	1330	1334	1338	1342	1346	1350	1354	Md.11 Axis error occurrence hour		1295	1299	1303	1307	1311	1315	1319	1323	1327	1331	1335	1339	1343	1347	1351	1355	Md.12 Axis error occurrence min: sec		1296	1300	1304	1308	1312	1316	1320	1324	1328	1332	1336	1340	1344	1348	1352	1356
Error history	Pointer No.	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15																																																																											
Md.9 Axis in which the error occurred		1293	1297	1301	1305	1309	1313	1317	1321	1325	1329	1333	1337	1341	1345	1349	1353																																																																											
Md.10 Axis error No.		1294	1298	1302	1306	1310	1314	1318	1322	1326	1330	1334	1338	1342	1346	1350	1354																																																																											
Md.11 Axis error occurrence hour		1295	1299	1303	1307	1311	1315	1319	1323	1327	1331	1335	1339	1343	1347	1351	1355																																																																											
Md.12 Axis error occurrence min: sec		1296	1300	1304	1308	1312	1316	1320	1324	1328	1332	1336	1340	1344	1348	1352	1356																																																																											
0000	<ul style="list-style-type: none"> <li>• Each group of buffer memory addresses storing a complete error history record is assigned a pointer No.                      Example: Pointer No. 0 = Buffer memory addresses 1293 to 1296                      Pointer No. 1 = Buffer memory addresses 1297 to 1300                      Pointer No. 2 = Buffer memory addresses 1301 to 1304                      ⋮                      Pointer No. 15 = Buffer memory addresses 1353 to 1356</li> <li>• Each history record is assigned a pointer No. in the range between 0 and 15. If the pointer No. 15 has been assigned to a new record, the next record will be assigned the pointer number 0.                      (A new record replaces an older record when a pointer No. is reassigned.)</li> </ul>																																																																																											
0	1357																																																																																											

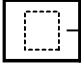Storage item	Storage details	Reading the monitor value																
<p><b>Md.14</b> Axis in which the warning occurred</p>	<p>Stores a number (Axis No.) that indicates the axis that encountered a warning.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Storage value                      1: Axis 1                      2: Axis 2                      3: Axis 3                      4: Axis 4</p>																
<p><b>Md.15</b> Axis warning No.</p>	<p>Stores an axis warning No.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Warning No.                      For details of warning Nos. (warning codes), refer to Section 15.3 "List of warnings".</p>																
<p><b>Md.16</b> Axis warning occurrence (Hour)</p>	<p>Stores the time at which an axis warning was detected.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Buffer memory (stored with BCD code)</p> <table border="1" data-bbox="762 981 1007 1070"> <tr> <td>0</td> <td>0</td> <td>1</td> <td>5</td> </tr> <tr> <td>b15</td> <td>b12</td> <td>b8</td> <td>b4</td> </tr> <tr> <td>0:0:0:0</td> <td>0:0:0:0</td> <td>0:0:0:1</td> <td>0:1:0:1</td> </tr> <tr> <td colspan="2">Not used</td> <td>0 to 2</td> <td>0 to 3</td> </tr> </table> <p>→  → ● Monitor value                      00 to 23 (hour)</p>	0	0	1	5	b15	b12	b8	b4	0:0:0:0	0:0:0:0	0:0:0:1	0:1:0:1	Not used		0 to 2	0 to 3
0	0	1	5															
b15	b12	b8	b4															
0:0:0:0	0:0:0:0	0:0:0:1	0:1:0:1															
Not used		0 to 2	0 to 3															
<p><b>Md.17</b> Axis warning occurrence (Minute: second)</p>	<p>Stores the time at which an axis warning was detected.</p>	<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Buffer memory (stored with BCD code)</p> <table border="1" data-bbox="762 1261 1007 1350"> <tr> <td>4</td> <td>9</td> <td>0</td> <td>7</td> </tr> <tr> <td>b15</td> <td>b12</td> <td>b8</td> <td>b4</td> </tr> <tr> <td>0:1:0:0</td> <td>1:0:0:1</td> <td>0:0:0:0</td> <td>0:0:1:1</td> </tr> <tr> <td colspan="2">0 to 5</td> <td>0 to 9</td> <td>0 to 9</td> </tr> </table> <p>→  → ● Monitor value                      00 to 59 (minute) 00 to 59 (second)</p>	4	9	0	7	b15	b12	b8	b4	0:1:0:0	1:0:0:1	0:0:0:0	0:0:1:1	0 to 5		0 to 9	0 to 9
4	9	0	7															
b15	b12	b8	b4															
0:1:0:0	1:0:0:1	0:0:0:0	0:0:1:1															
0 to 5		0 to 9	0 to 9															
<p><b>Md.18</b> Warning history pointer</p>	<p>Indicates a pointer No. that is next to the Pointer No. assigned to the latest of the existing records.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Storage value (Pointer number)                      0 to 15</p>																
<p><b>Md.19</b> No. of write accesses to flash ROM</p>	<p>Stores the number of write accesses to the flash ROM after the power is switched ON.                      The count is cleared to "0" when the number of write accesses reach 26 and an error reset operation is performed.</p>	<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  → ● Storage value                      0 to 25</p>																

Warning history (Up to 16 records can be stored)

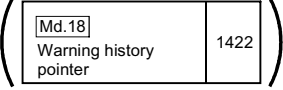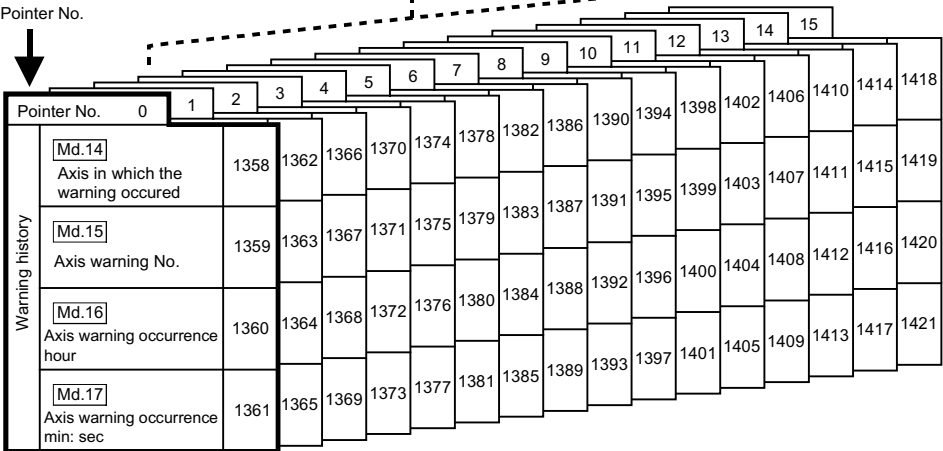Default value	Storage buffer memory address (common to axes 1 to 4)	
0	<div style="text-align: center;">  <p>( Md.18 Warning history pointer 1422 )</p> </div>	
0	<div style="text-align: center;">  <p>Warning history</p> <p>Pointer No. 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15</p> <p>Item Buffer memory address</p> </div>	
0000	<ul style="list-style-type: none"> <li>Each group of buffer memory addresses storing a complete warning history record is assigned a pointer No.</li> <li>Example: Pointer No. 0 = Buffer memory addresses 1358 to 1361                      Pointer No. 1 = Buffer memory addresses 1362 to 1365                      Pointer No. 2 = Buffer memory addresses 1366 to 1369                      ⋮                      Pointer No. 15 = Buffer memory addresses 1418 to 1421</li> <li>Each history record is assigned a pointer No. in the range between 0 and 15. If the pointer No. 15 has been assigned to a new record, the next record will be assigned the pointer number 0. (A new record replaces an older record when a pointer No. is reassigned.)</li> </ul>	
0000		
0	1422	
0	1424 1425	






## 5.6.2 Axis monitor data

Storage item	Storage details
<p><b>Md.20</b> Current feed value</p>	<p>The currently commanded address is stored. (Different from the actual motor position during operation)</p> <p>The current position address is stored.</p> <p>If "degree" is selected as the unit, the addresses will have a ring structure for values between 0 and 359.9999 degrees.</p> <ul style="list-style-type: none"> <li>≠ Update timing : 3.5ms</li> <li>≠ The OP address is stored when the machine OPR is completed.</li> <li>≠ When the current value is changed with the current value changing function, the changed value is stored.</li> </ul>
<p><b>Md.21</b> Machine feed value</p>	<p>The address of the current position according to the machine coordinates will be stored. (Different from the actual motor position during operation)</p> <p>Note that the current value changing function will not change the machine feed value.</p> <p>Under the speed control mode, the machine feed value is constantly updated always, irrespective of the parameter setting.</p> <p>The value will not be cleared to "0" at the beginning of fixed-feed control.</p> <p>Even if "degree" is selected as the unit, the addresses will not have a ring structure for values between 0 and 359.99999 degrees.</p> <ul style="list-style-type: none"> <li>≠ Machine coordinates: Characteristic coordinates determined with machine</li> <li>≠ Update timing: 56.8ms</li> </ul>
<p><b>Md.22</b> Feedrate</p>	<p>The speed of the operating workpiece is stored. (May be different from the actual motor speed during operation)</p> <ul style="list-style-type: none"> <li>≠ During interpolation operation, the speed is stored in the following manner. Reference axis : Composite speed or reference axis speed (Set with <b>Pr.20</b> )</li> <li>Interpolation axis : 0</li> <li>≠ Update timing: 56.8ms</li> </ul> <p><b>POINT</b></p> <p>In case of the single axis operation, <b>Md.22</b> Feedrate and <b>Md.28</b> Axis feedrate are identical.</p> <p>In the composite mode of the interpolation operation, <b>Md.22</b> Feedrate is a speed in a composite direction and <b>Md.28</b> Axis feedrate is that in each axial direction.</p>
<p><b>Md.23</b> Axis error No.</p>	<p>When an axis error is detected, the error code corresponding to the error details is stored.</p> <ul style="list-style-type: none"> <li>≠ The latest error code is always stored. (When a new axis error occurs, the error code is overwritten.)</li> <li>≠ When " <b>Cd.5</b> Axis error reset" (axis control data) turns ON, the axis error No. is cleared (set to 0).</li> </ul>

Reading the monitor value	Default value	Storage buffer memory address																							
		Axis 1	Axis 2	Axis 3	Axis 4																				
<p>■ Monitoring is carried out with a hexadecimal.</p> <p>Low-order buffer memory Example) 800 b15 b12 b8 b4 b0 E F G H</p> <p>High-order buffer memory Example) 801 b31 b28 b24 b20 b16 A B C D</p> <p>Monitor value E F G H A B C D</p> <p>◇ Sorting</p> <p>(High-order buffer memory) (Low-order buffer memory) A B C D E F G H</p> <p>◇ Converted from hexadecimal to decimal</p> <p>Decimal integer value R</p> <p>◇ Unit conversion <math>R \times 10^n</math></p> <p>Actual value Md.20 Current feed value Md.21 Machine feed value Md.22 Feedrate</p> <p>• Unit conversion table (Md.20 Md.21)</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td><math>\mu\text{m}</math></td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table> <p>• Unit conversion table (Md.22)</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table>	n	Unit	-1	$\mu\text{m}$	-5	inch	-5	degree	0	PLS	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	0000H	800 801	900 901	1000 1001	1100 1101
n	Unit																								
-1	$\mu\text{m}$																								
-5	inch																								
-5	degree																								
0	PLS																								
n	Unit																								
-2	mm/min																								
-3	inch/min																								
-3	degree/min																								
0	PLS/s																								
	0000H	802 803	902 903	1002 1003	1102 1103																				
	0000H	804 805	904 905	1004 1005	1104 1105																				
<p>■ Monitoring is carried out with a decimal.</p> <p>Monitor value □ □ □ □ □ □</p> <p>• Error code Refer to Section 15.2 "List of errors" for details on the error Nos. (error codes).</p>	0	806	906	1006	1106																				

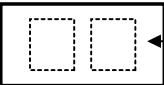

Storage item	Storage details
Md.24 Axis warning No.	<p>Whenever an axis warning is reported, a related warning code is stored.</p> <ul style="list-style-type: none"> <li>≠ This area stores the latest warning code always. (Whenever an axis warning is reported, a new warning code replaces the stored warning code.)</li> <li>≠ When the " Cd.5 Axis error reset" (axis control data) is set to ON, the axis warning No. is cleared to "0".</li> </ul>
Md.25 Valid M code	<p>This area stores an M code that is currently active (i.e. set to the positioning data relating to the current operation).</p> <ul style="list-style-type: none"> <li>≠ Update timing : turning ON of the M code ON signal</li> </ul> <p>When the PLC READY signal (Y0) goes OFF, the value is set to "0".</p>
Md.26 Axis operation status	<p>This area stores the axis operation status.</p>
Md.27 Current speed	<p>The " Da.8 Command speed" used by the positioning data currently being executed is stored. (Stores "0" under the speed control.)</p> <ul style="list-style-type: none"> <li>≠ If " Da.8 Command speed" is set to "-1", this area stores the command speed set by the positioning data used one step earlier.</li> <li>≠ If " Da.8 Command speed" is set to a value other than "-1", this area stores the command speed set by the current positioning data.</li> <li>≠ When speed change function is executed, this area stores " Cd.14 New speed value". (For details of change speed function, refer to section 12.5.1.)</li> </ul>

Reading the monitor value	Default value	Storage buffer memory address													
		Axis 1	Axis 2	Axis 3	Axis 4										
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Warning No. For details of warning Nos. (warning codes), refer to Section 15.3 "List of warnings".</p>	0	807	907	1007	1107										
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● M code No. (0 to 65535)</p>	0	808	908	1008	1108										
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Axis operation status</p> <ul style="list-style-type: none"> <li>-2: Step standby</li> <li>-1: Error</li> <li>0: Standby</li> <li>1: Stopped</li> <li>2: Interpolation</li> <li>3: JOG operation</li> <li>4: Manual pulse generator operation</li> <li>5: Analyzing</li> <li>6: Special start standby</li> <li>7: OPR</li> <li>8: Position control</li> <li>9: Speed control</li> <li>10: Speed control in speed-position switching control</li> <li>11: Position control in speed-position switching control</li> <li>12: Position control in position-speed switching control</li> <li>13: Speed control in position-speed switching control</li> <li>14: Absolute position returning</li> <li>20: Servo amplifier has not been connected/ servo amplifier power OFF</li> <li>21: Servo OFF</li> </ul>	0	809	909	1009	1109										
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  (Decimal integer value)</p> <p>◇ Unit conversion <math>R \times \#10^n</math></p> <p>Actual value </p> <p>● Unit conversion table (Md.27)</p> <table border="1" data-bbox="715 1664 938 1821"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table>	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	0	810 811	910 911	1010 1011	1110 1111
n	Unit														
-2	mm/min														
-3	inch/min														
-3	degree/min														
0	PLS/s														

Storage item	Storage details
<p><b>Md.28</b> Axis feedrate</p>	<p>€ The speed which is actually output as a command at that time in each axis is stored. (May be different from the actual motor speed)                      "0" is stored when the axis is at a stop.                      Update timing: 56.8ms</p> <p><b>POINT</b>                      Refer to <b>Md.22</b> Feedrate</p>
<p><b>Md.29</b> Speed-position switching control positioning amount</p>	<p>€ The value set as the movement amount for the position control to end after changing to position control with the speed-position switching control (INC mode) is stored.</p>
<p><b>Md.30</b> External input signal</p>	<p>The ON/OFF state of the external input/output signal is stored.                      The following items are stored.</p> <ul style="list-style-type: none"> <li>€ Upper limit signal</li> <li>€ Lower limit signal</li> <li>€ Stop signal</li> <li>€ External command signal/switching signal</li> <li>€ Near-point dog signal</li> </ul>

Reading the monitor value	Default value	Storage buffer memory address																									
		Axis 1	Axis 2	Axis 3	Axis 4																						
<p>■ Monitoring is carried out with a hexadecimal.</p> <p>Low-order buffer memory Example) 812 b15 b12 b8 b4 b0 E F G H</p> <p>High-order buffer memory Example) 813 b31 b28 b24 b20 b16 A B C D</p> <p>Monitor value E F G H A B C D</p> <p>◇ Sorting</p> <p>(High-order buffer memory) (Low-order buffer memory) A B C D E F G H</p> <p>◇ Converted from hexadecimal to decimal</p> <p>Decimal integer value R</p> <p>◇ Unit conversion <math>R \times 10^n</math></p> <p>Actual value Md.28 Axis feedrate Md.29 Speed-position switching control positioning amount</p> <p>• Unit conversion table (Md.28)</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table> <p>• Unit conversion table (Md.29)</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td><math>\mu\text{m}</math></td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table>	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	n	Unit	-1	$\mu\text{m}$	-5	inch	-5	degree	0	PLS	0000H	812 813	912 913	1012 1013	1112 1113		
n	Unit																										
-2	mm/min																										
-3	inch/min																										
-3	degree/min																										
0	PLS/s																										
n	Unit																										
-1	$\mu\text{m}$																										
-5	inch																										
-5	degree																										
0	PLS																										
<p>■ Monitoring is carried out with a hexadecimal.</p> <p>Monitor value 0 0</p> <p>Buffer memory b15 b12 b8 b4 b0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0</p> <p>Not used</p> <table border="1"> <thead> <tr> <th>Stored items</th> <th>Default value</th> <th>Meaning</th> </tr> </thead> <tbody> <tr> <td>b0 Lower limit signal</td> <td>0</td> <td rowspan="8">0: OFF 1: ON</td> </tr> <tr> <td>b1 Upper limit signal</td> <td>0</td> </tr> <tr> <td>b2 Not used</td> <td>0</td> </tr> <tr> <td>b3 Stop signal</td> <td>0</td> </tr> <tr> <td>b4 External command signal/switching signal</td> <td>0</td> </tr> <tr> <td>b5 Not used</td> <td>0</td> </tr> <tr> <td>b6 Near-point signal</td> <td>0</td> </tr> <tr> <td>b7 Not used</td> <td>0</td> </tr> <tr> <td>b8 Not used</td> <td>0</td> </tr> </tbody> </table>	Stored items	Default value	Meaning	b0 Lower limit signal	0	0: OFF 1: ON	b1 Upper limit signal	0	b2 Not used	0	b3 Stop signal	0	b4 External command signal/switching signal	0	b5 Not used	0	b6 Near-point signal	0	b7 Not used	0	b8 Not used	0	0000H	816	916	1016	1116
Stored items	Default value	Meaning																									
b0 Lower limit signal	0	0: OFF 1: ON																									
b1 Upper limit signal	0																										
b2 Not used	0																										
b3 Stop signal	0																										
b4 External command signal/switching signal	0																										
b5 Not used	0																										
b6 Near-point signal	0																										
b7 Not used	0																										
b8 Not used	0																										

Storage item	Storage details	
<p><b>[Md.31] Status</b></p>	<p>This area stores the states (ON/OFF) of various flags. Information on the following flags is stored.</p> <ul style="list-style-type: none"> <li>● In speed control flag: This signal that comes ON under the speed control can be used to judge whether the operation is performed under the speed control or position control. The signal goes OFF when the power is switched ON, under the position control, and during JOG operation or manual pulse generator operation. During the speed-position or position-speed switching control, this signal comes ON only when the speed control is in effect. During the speed-position switching control, this signal goes OFF when the speed-position switching signal executes a switching over from speed control to position control. During the position-speed switching control, this signal comes ON when the position-speed switching signal executes a switching over from position control to speed control.</li> <li>● Speed-position switching latch flag: This signal is used during the speed-position switching control (INC mode) for interlocking the movement amount change function. During the speed-position switching control (INC mode), this signal comes ON when position control takes over. This signal goes OFF when the next positioning data is processed, and during JOG operation or manual pulse generator operation.</li> <li>● Command in-position flag: This signal is ON when the remaining distance is equal to or less than the command in-position range (set by a detailed parameter). This signal remains OFF with data that specify the continuous path control (P11) as the operation pattern. The state of this signal is monitored every 3.5 ms except when the monitoring is canceled under the speed control or while the speed control is in effect during the speed-position or position-speed switching control. While operations are performed with interpolation, this signal comes ON only in respect of the starting axis. (This signal goes OFF in respect of all axes upon starting.)</li> <li>● OPR request flag: This signal comes ON when the power is switched ON, when the absolute system has not been set, when the machine OPR has not been executed at the absolute position system, when the PLC READY signal goes ON, when a machine OPR operation starts. This signal goes OFF when a machine OPR operation completes.</li> <li>● OPR complete flag: This signal comes ON when a machine OPR operation completes normally. This signal goes OFF when the operation start.</li> <li>● Position-speed switching latch flag: This signal is used during the position-speed switching control for interlocking the command speed change function. During the position-speed switching control, this signal comes ON when speed control takes over. This signal goes OFF when the next positioning data is processed, and during JOG operation or manual pulse generator operation.</li> <li>● Axis warning detection flag: This signal comes On when an axis warning is reported and goes OFF when the axis error reset signal comes ON.</li> <li>● Speed change 0 flag: This signal comes ON when a speed change request that specifies 0 as the new speed value is issued. This signal comes ON when a speed change request that specifies a new speed value other than 0 is issued.</li> </ul>	
<p><b>[Md.32] Target value</b></p>	<p>This area stores the target value ( [Da.6] Positioning address/movement amount) for a positioning operation.</p> <p>≠ At the beginning of positioning control: Stores the value of " [Da.6] Positioning address/movement amount".</p> <p>≠ At other times : Stores "0".</p>	




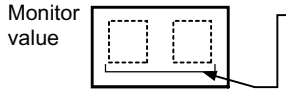
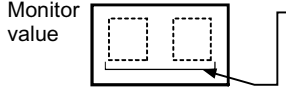
Reading the monitor value	Default value	Storage buffer memory address																							
		Axis 1	Axis 2	Axis 3	Axis 4																				
<p>■ Monitoring is carried out with a hexadecimal display.</p> <table border="1"> <thead> <tr> <th>Stored items</th> <th>Default value</th> <th>Meaning</th> </tr> </thead> <tbody> <tr> <td>b0</td> <td>0</td> <td rowspan="9">0: OFF 1: ON</td> </tr> <tr> <td>b1</td> <td>0</td> </tr> <tr> <td>b2</td> <td>0</td> </tr> <tr> <td>b3</td> <td>0</td> </tr> <tr> <td>b4</td> <td>0</td> </tr> <tr> <td>b5</td> <td>0</td> </tr> <tr> <td>b9</td> <td>0</td> </tr> <tr> <td>b10</td> <td>0</td> </tr> </tbody> </table>	Stored items	Default value	Meaning	b0	0	0: OFF 1: ON	b1	0	b2	0	b3	0	b4	0	b5	0	b9	0	b10	0	0000H	817	917	1017	1117
Stored items	Default value	Meaning																							
b0	0	0: OFF 1: ON																							
b1	0																								
b2	0																								
b3	0																								
b4	0																								
b5	0																								
b9	0																								
b10	0																								
<p>■ Monitoring is carried out with a decimal display.</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td>μm</td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table>	n		Unit	-1	μm	-5	inch	-5	degree	0	PLS	0	818 819	918 919	1018 1019	1118 1119									
n	Unit																								
-1	μm																								
-5	inch																								
-5	degree																								
0	PLS																								

Storage item	Storage details	
<p><b>Md.33</b> Target speed</p>	<p>€ During operation with positioning data : The actual target speed, considering the override and speed limit value, etc., is stored. "0" is stored when positioning is completed.</p> <p>€ During interpolation : The composite speed or reference axis speed is stored in the reference axis address, and "0" is stored in the interpolation axis address.</p> <p>€ During JOG operation : The actual target speed, considering the JOG speed limit value for the JOG speed, is stored.</p> <p>€ During manual pulse generator operation : "0" is stored.</p> <p><b>POINT</b>                      The target speed is when an override is made to the command speed. When the speed limit value is overridden, the target speed is restricted to the speed limit value. The target speed changes every time data is switched, but does not change in an acceleration/deceleration state inside each piece of data (changes with the speed change because the target speed changes.)</p>	
<p><b>Md.34</b> Movement amount after near-point dog ON</p>	<p>€ "0" is stored when machine OPR starts.</p> <p>€ After machine OPR starts, the movement amount from the near-point dog ON to the machine OPR completion is stored. (Movement amount: Movement amount to machine OPR completion using near-point dog ON as "0".)</p> <p>€ "0" is always stored when not using the near-point dog.</p>	
<p><b>Md.35</b> Torque limit stored value</p>	<p>The " <b>Pr.17</b> Torque limit setting value", " <b>Cd.101</b> Torque output setting value" or " <b>Cd.22</b> New torque value", " <b>Pr.54</b> OPR torque limit value" is stored.</p> <p>€ During positioning start, JOG operation start, manual pulse generator operation ...The " <b>Pr.17</b> Torque limit setting value" or " <b>Cd.101</b> Torque output setting value" is stored.</p> <p>€ When value is changed to " <b>Cd.22</b> New torque value" during operation ...The " <b>Cd.22</b> New torque value" is stored.</p> <p>€ When OPR ...The " <b>Pr.17</b> Torque limit setting value" or " <b>Cd.101</b> Torque output setting value" is stored. But " <b>Pr.54</b> OPR torque limit value" is stored after the " <b>Pr.47</b> Creep speed" completion.</p>	


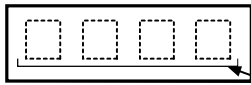
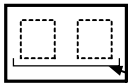



Reading the monitor value	Default value	Storage buffer memory address																							
		Axis 1	Axis 2	Axis 3	Axis 4																				
<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Low-order buffer memory Example) 820 b15 b12 b8 b4 b0 E F G H</p> <p>High-order buffer memory Example) 821 b31 b28 b24 b20 b16 A B C D</p> <p>Monitor value E F G H A B C D</p> <p>◇Sorting</p> <p>(High-order buffer memory) (Low-order buffer memory) A B C D E F G H</p> <p>◇Converted from hexadecimal to decimal</p> <p>Decimal integer value R</p> <p>◇Unit conversion <math>R \times 10^n</math></p> <p>Actual value Md.33 Target speed Md.34 Movement amount after near-point dog ON</p> <p>• Unit conversion table (Md.33)</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table> <p>• Unit conversion table (Md.34)</p> <table border="1"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td>μm</td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table>	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	n	Unit	-1	μm	-5	inch	-5	degree	0	PLS	0000H	820 821	920 921	1020 1021	1120 1121
n	Unit																								
-2	mm/min																								
-3	inch/min																								
-3	degree/min																								
0	PLS/s																								
n	Unit																								
-1	μm																								
-5	inch																								
-5	degree																								
0	PLS																								
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value 0000</p> <p>• Storage value 1 to 500 (%)</p>	300	826	926	1026	1126																				

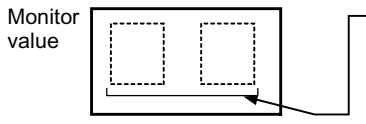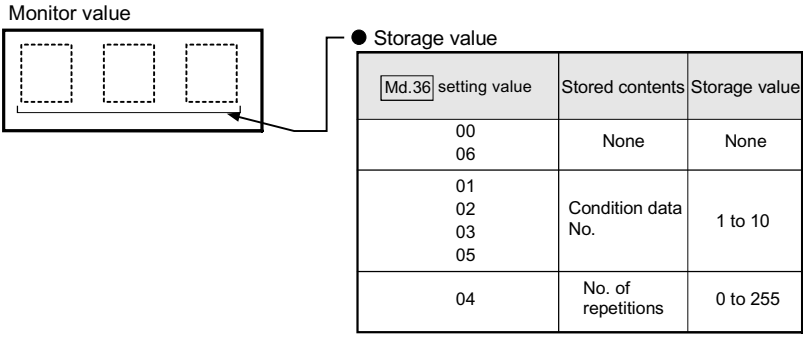

Storage item	Storage details	
<p><b>[Md.36]</b> Special start data instruction code setting value</p>	<p>€ The "instruction code" used with special start and indicated by the start data pointer currently being executed is stored.</p>	
<p><b>[Md.37]</b> Special start data instruction parameter setting value</p>	<p>The "instruction parameter" used with special start and indicated by the start data pointer currently being executed is stored. The stored value differs according to the value set for <b>[Md.36]</b> .</p>	
<p><b>[Md.38]</b> Start positioning data No. setting value</p>	<p>€ The "positioning data No." indicated by the start data pointer currently being executed is stored.</p>	
<p><b>[Md.39]</b> In speed limit flag</p>	<p>€ If the speed exceeds the "<b>[Pr.8]</b> Speed limit value" due to a speed change or override, the speed limit functions, and the in speed limit flag turns ON. € When the speed drops to less than "<b>[Pr.8]</b> Speed limit value", or when the axis stops, the in speed limit flag turns OFF.</p>	
<p><b>[Md.40]</b> In speed change processing flag</p>	<p>€ The speed change process flag turns ON when the speed is changed during positioning control. € After the speed change process is completed or when deceleration starts with the stop signal during the speed change process, the in speed change process flag turns OFF.</p>	

Reading the monitor value	Default value	Storage buffer memory address															
		Axis 1	Axis 2	Axis 3	Axis 4												
<p>■ Monitoring is carried out with a decimal display.</p>  <p>● Storage value                      00: Block start (Normal start)                      01: Condition start                      02: Wait start                      03: Simultaneous start                      04: FOR loop                      05: FOR condition                      06: NEXT</p>	0	827	927	1027	1127												
<p>■ Monitoring is carried out with a decimal display.</p>  <table border="1" data-bbox="539 824 986 1102"> <thead> <tr> <th>Md.36 setting value</th> <th>Stored contents</th> <th>Storage value</th> </tr> </thead> <tbody> <tr> <td>00 06</td> <td>None</td> <td>None</td> </tr> <tr> <td>01 02 03 05</td> <td>Condition data No.</td> <td>1 to 10</td> </tr> <tr> <td>04</td> <td>No. of repetitions</td> <td>0 to 255</td> </tr> </tbody> </table>	Md.36 setting value	Stored contents	Storage value	00 06	None	None	01 02 03 05	Condition data No.	1 to 10	04	No. of repetitions	0 to 255	0	828	928	1028	1128
Md.36 setting value	Stored contents	Storage value															
00 06	None	None															
01 02 03 05	Condition data No.	1 to 10															
04	No. of repetitions	0 to 255															
<p>■ Monitoring is carried out with a decimal display.</p>  <p>● Storage value                      1 to 600</p>	0	829	929	1029	1129												
<p>■ Monitoring is carried out with a decimal display.</p>  <p>● Storage value                      0: Not in speed limit (OFF)                      1: In speed limit (ON)</p>	0	830	930	1030	1130												
<p>■ Monitoring is carried out with a decimal display.</p>  <p>● Storage value                      0: Not in speed change (OFF)                      1: In speed change (ON)</p>	0	831	931	1031	1131												

Storage item	Storage details	
Md.41 Special start repetition counter	<ul style="list-style-type: none"> <li>€ This area stores the remaining number of repetitions during "repetitions" specific to special starting.</li> <li>€ The count is decremented by one (-1) at the loop end.</li> <li>€ The control comes out of the loop when the count reaches "0".</li> <li>€ This area stores "0" within an infinite loop.</li> </ul>	
Md.42 Control system repetition counter	<ul style="list-style-type: none"> <li>€ This area stores the remaining number of repetitions during "repetitions" specific to control system.</li> <li>€ The count is decremented by one (-1) at the loop end.</li> <li>€ The control comes out of the loop when the count reaches "0".</li> <li>€ This area stores "0" within an infinite loop.</li> </ul>	
Md.43 Start data pointer being executed	<ul style="list-style-type: none"> <li>€ This area stores a point No. (1 to 50) attached to the start data currently being executed.</li> <li>€ This area stores "0" after completion of a positioning operation.</li> </ul>	
Md.44 Positioning data No. being executed	<ul style="list-style-type: none"> <li>€ This area stores a positioning data No. attached to the positioning data currently being executed.</li> </ul>	
Md.45 Block No. being executed	<ul style="list-style-type: none"> <li>€ When the operation is controlled by "block start data", this area stores a block number (7000 to 7004) attached to the block currently being executed.</li> <li>€ At other times, this area stores "0".</li> </ul>	
Md.46 Last executed positioning data No.	<ul style="list-style-type: none"> <li>€ This area stores the positioning data No. attached to the positioning data that was executed last time.</li> <li>€ The value is retained until a new positioning operation is executed.</li> </ul>	
Md.47 Positioning data being executed	<ul style="list-style-type: none"> <li>€ The addresses shown to the right store details of the positioning data currently being executed (positioning data No. given by Md.44 ).</li> </ul>	






Reading the monitor value	Default value	Storage buffer memory address																																																																			
		Axis 1	Axis 2	Axis 3	Axis 4																																																																
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Storage value 0 to 255</p>	0	832	932	1032	1132																																																																
<p>■ Monitoring is carried out with a hexadecimal display.</p> <p>Monitor value  ● Storage value 0 to FFFF</p>	0000H	833	933	1033	1133																																																																
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Storage value 1 to 50</p>	0	834	934	1034	1134																																																																
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Storage value 1 to 600</p>	0	835	935	1035	1135																																																																
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Storage value 1 to 50</p>	0	836	936	1036	1136																																																																
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value  ● Storage value 1 to 600</p>	0	837	937	1037	1137																																																																
<p>Information is stored in the following addresses:</p> <table border="1" data-bbox="256 1444 914 1915"> <thead> <tr> <th colspan="4">Stored address (Monitor value)</th> <th rowspan="2">Stored item</th> <th rowspan="2">Reference</th> </tr> <tr> <th>Axis1</th> <th>Axis2</th> <th>Axis3</th> <th>Axis4</th> </tr> </thead> <tbody> <tr> <td>838</td> <td>938</td> <td>1038</td> <td>1138</td> <td>Positioning identifier</td> <td>[Da.1] to [Da.5]</td> </tr> <tr> <td>839</td> <td>939</td> <td>1039</td> <td>1139</td> <td>M code</td> <td>[Da.10]</td> </tr> <tr> <td>840</td> <td>940</td> <td>1040</td> <td>1140</td> <td>Dwell time</td> <td>[Da.9]</td> </tr> <tr> <td>841</td> <td>941</td> <td>1041</td> <td>1141</td> <td>Open</td> <td>—</td> </tr> <tr> <td>842</td> <td>942</td> <td>1042</td> <td>1142</td> <td rowspan="2">Command speed</td> <td rowspan="2">[Da.8]</td> </tr> <tr> <td>843</td> <td>943</td> <td>1043</td> <td>1143</td> </tr> <tr> <td>844</td> <td>944</td> <td>1044</td> <td>1144</td> <td rowspan="2">Positioning address</td> <td rowspan="2">[Da.6]</td> </tr> <tr> <td>845</td> <td>945</td> <td>1045</td> <td>1145</td> </tr> <tr> <td>846</td> <td>946</td> <td>1046</td> <td>1146</td> <td rowspan="2">Arc address</td> <td rowspan="2">[Da.7]</td> </tr> <tr> <td>847</td> <td>947</td> <td>1047</td> <td>1147</td> </tr> </tbody> </table>	Stored address (Monitor value)				Stored item	Reference	Axis1	Axis2	Axis3	Axis4	838	938	1038	1138	Positioning identifier	[Da.1] to [Da.5]	839	939	1039	1139	M code	[Da.10]	840	940	1040	1140	Dwell time	[Da.9]	841	941	1041	1141	Open	—	842	942	1042	1142	Command speed	[Da.8]	843	943	1043	1143	844	944	1044	1144	Positioning address	[Da.6]	845	945	1045	1145	846	946	1046	1146	Arc address	[Da.7]	847	947	1047	1147	0	838 to 847	938 to 947	1038 to 1047	1138 to 1147
Stored address (Monitor value)				Stored item			Reference																																																														
Axis1	Axis2	Axis3	Axis4																																																																		
838	938	1038	1138	Positioning identifier	[Da.1] to [Da.5]																																																																
839	939	1039	1139	M code	[Da.10]																																																																
840	940	1040	1140	Dwell time	[Da.9]																																																																
841	941	1041	1141	Open	—																																																																
842	942	1042	1142	Command speed	[Da.8]																																																																
843	943	1043	1143																																																																		
844	944	1044	1144	Positioning address	[Da.6]																																																																
845	945	1045	1145																																																																		
846	946	1046	1146	Arc address	[Da.7]																																																																
847	947	1047	1147																																																																		

Storage item	Storage details	
Md.48 Deceleration start flag *	€ "1" is stored when the constant speed status or acceleration status switches to the deceleration status during position control whose operation pattern is "Positioning complete". € "0" is stored at the next operation start or manual pulse generator operation enable.	
Md.100 OPR re-travel value	€ This area stores the travel distance during the OPR travel to the zero point that was executed last time. For setting units Example) mm (Buffer memory × 0.1) μm	
Md.101 Real current value	€ This area stores the present value (feed present value – deviation counter droop pulses). € Update timing: 3.5ms Example) mm (Buffer memory × 0.1) μm	
Md.102 Deviation counter value	€ This area stores the difference between the feed present and the actual present value. (Buffer memory details) PLS € Update timing: 3.5ms	
Md.103 Motor rotation speed	€ This area stores the present rotation speed of the servomotor. (Buffer memory × 0.1) rpm € Update timing: 3.5ms	
Md.104 Motor current value	€ This area stores the present motor current value of the motor. (Buffer memory × 0.1) % € Update timing: 3.5ms	
Md.105 Servo parameter	€ This area stores the parameter currently used by the servo amplifier.	Auto tuning
		Load inertia ratio (Buffer memory details × 0.1)
		Position loop gain 1 [rad/s]
		Speed loop gain 1 [rad/s]
		Position loop gain 2 [rad/s]
		Speed loop gain 2 [rad/s]
	Speed integral compensation [ms]	

Reading the monitor value	Default value	Storage buffer memory address			
		Axis 1	Axis 2	Axis 3	Axis 4
<p>■ Monitoring is carried out with a decimal display.</p>	0	899	999	1099	1199
<p>■ Monitoring is carried out with a decimal display.</p>	0	848 849	948 949	1048 1049	1148 1149
	0	850 851	950 951	1050 1051	1150 1151
	0	852 853	952 953	1052 1053	1152 1153
	0	854 855	954 955	1054 1055	1154 1155
	0	856	956	1056	1156
	0	857	957	1057	1157
<p>■ Monitoring is carried out with a decimal display.</p>	0	858	958	1058	1158
	0	859	959	1059	1159
	0	860	960	1060	1160
	0	861	961	1061	1161
	0	862	962	1062	1162
	0	863	963	1063	1163

\*: Usable with the module whose first six digits of SERIAL No. are 050224" or later.

Storage item	Storage details	
Md.106 Servo amplifier Software No.	<ul style="list-style-type: none"> <li>€ This area stores the Software No. of the servo amplifier used.</li> </ul>	
Md.107 Parameter error No.	<ul style="list-style-type: none"> <li>€ When a servo parameter error occurs, the bit that corresponds to the parameter number affected by the error comes ON.</li> </ul>	Parameter error (No.1 to 15)
		Parameter error (No.16 to 31)
		Parameter error (No.32 to 47)
		Parameter error (No.48 to 63)
		Parameter error (No.64 to 75)
		Not used
Md.108 Servo status	<ul style="list-style-type: none"> <li>€ This area stores the servo status.</li> <li>€ READY ON Indicates the ready ON/OFF.</li> <li>€ Servo ON Indicates the servo ON/OFF.</li> <li>€ Zeroing point pass Turns ON if the zero point of the encoder has been passed even once.</li> <li>€ In-position The dwell pulse turns ON within the servo parameter "in-position."</li> <li>€ Zeroing speed Turns ON when the motor speed is lower than the servo parameter "zero speed."</li> <li>€ Torque being restricted Turns ON when the servo amplifier is having the torque restricted.</li> <li>€ Servo alarm Turn ON during the servo alarm.</li> <li>€ Servo warning Turn ON during the servo warning.</li> </ul>	
Md.109 Regenerative load ratio	<ul style="list-style-type: none"> <li>€ The rate of regenerative power to the allowable regenerative power is indicated as a percentage.</li> <li>€ When the regenerative option is used, the rate to the allowable regenerative power of the option is indicated. (Buffer memory × 0.1) %</li> <li>€ Update timing: 1 s</li> </ul>	
Md.110 Effective load torque	<ul style="list-style-type: none"> <li>€ The continuous effective load torque is indicated.</li> <li>€ The average value of the load rates for the past 15 seconds to the rated torque is stored as a percentage, rated torque being 100%. (Buffer memory × 0.1) %</li> <li>€ Update timing: 1s</li> </ul>	
Md.111 Peak torque ratio	<ul style="list-style-type: none"> <li>€ The maximum torque is indicated. (Holding value)</li> <li>€ The peak values for the past 15 seconds are indicated, rated torque being 100%. (Buffer memory × 0.1) %</li> <li>€ Update timing: 1s</li> </ul>	

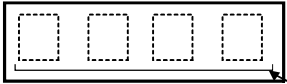
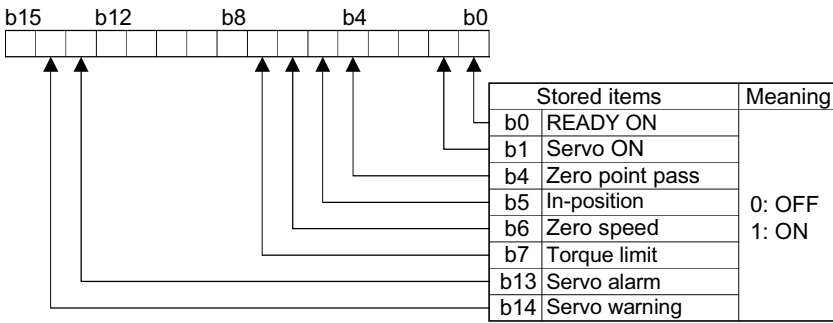
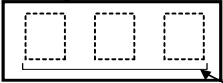
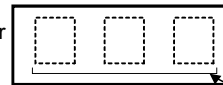
Reading the monitor value	Default value	Storage buffer memory address																								
		Axis 1	Axis 2	Axis 3	Axis 4																					
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value</p>  <p>The monitor value is character code (JIS 8 unit code).</p> <p>Software No. →</p> <p>Example) B20W200-A4</p> <table border="1"> <thead> <tr> <th>Address</th> <th>Monitor value</th> <th>Storing value</th> </tr> </thead> <tbody> <tr> <td>864</td> <td>3242</td> <td>2 B</td> </tr> <tr> <td>865</td> <td>5730</td> <td>W 0</td> </tr> <tr> <td>866</td> <td>3032</td> <td>0 2</td> </tr> <tr> <td>867</td> <td>2D32</td> <td>- 0</td> </tr> <tr> <td>868</td> <td>3441</td> <td>4 A</td> </tr> <tr> <td>869</td> <td>0020</td> <td>NUL SPACE</td> </tr> </tbody> </table>	Address	Monitor value	Storing value	864	3242	2 B	865	5730	W 0	866	3032	0 2	867	2D32	- 0	868	3441	4 A	869	0020	NUL SPACE		864 to 869			
Address	Monitor value	Storing value																								
864	3242	2 B																								
865	5730	W 0																								
866	3032	0 2																								
867	2D32	- 0																								
868	3441	4 A																								
869	0020	NUL SPACE																								
<p>■ Monitoring is carried out with a decimal display.</p>		870	970	1070	1170																					
		871	971	1071	1171																					
		872	972	1072	1172																					
		873	973	1073	1173																					
		874	974	1074	1174																					
		875	975	1075	1175																					
		876	976	1076	1176																					
<p>■ Monitoring is carried out with a decimal display.</p>  <table border="1"> <thead> <tr> <th>Stored items</th> <th>Meaning</th> </tr> </thead> <tbody> <tr> <td>b0</td> <td>READY ON</td> </tr> <tr> <td>b1</td> <td>Servo ON</td> </tr> <tr> <td>b4</td> <td>Zero point pass</td> </tr> <tr> <td>b5</td> <td>In-position</td> </tr> <tr> <td>b6</td> <td>Zero speed</td> </tr> <tr> <td>b7</td> <td>Torque limit</td> </tr> <tr> <td>b13</td> <td>Servo alarm</td> </tr> <tr> <td>b14</td> <td>Servo warning</td> </tr> </tbody> </table> <p>0: OFF 1: ON</p> <p>0</p> <p>877 977 1077 1177</p> <p><b>POINT</b></p> <p>When the servo forced stop occurs, the "b13: servo alarm" and the "b14: servo warning" is turned ON. When the servo forced stop is reset, the "b13: servo alarm" and the "b14: servo warning" is turned OFF.</p>	Stored items	Meaning	b0	READY ON	b1	Servo ON	b4	Zero point pass	b5	In-position	b6	Zero speed	b7	Torque limit	b13	Servo alarm	b14	Servo warning								
Stored items	Meaning																									
b0	READY ON																									
b1	Servo ON																									
b4	Zero point pass																									
b5	In-position																									
b6	Zero speed																									
b7	Torque limit																									
b13	Servo alarm																									
b14	Servo warning																									
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value</p>  <p>Regenerative load ratio</p>	0	878	978	1078	1178																					
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value</p>  <p>Effective load torque</p>	0	879	979	1079	1179																					
<p>■ Monitoring is carried out with a decimal display.</p> <p>Monitor value</p>  <p>Peek torque ratio</p>	0	880	980	1080	1180																					



5.7 List of control data

5.7.1 System control data






Setting item	Setting details			
<p>Cd.1 Flash ROM write request</p>	<p>ε Requests writing of data (parameters, positioning data, and block start data) from the buffer memory to the flash ROM.</p> <p><b>POINT</b></p> <p>(1) Do not turn the power OFF or reset the PLC CPU while writing to the flash ROM. If the power is turned OFF or the PLC CPU is reset to forcibly end the process, the data backed up in the flash ROM will be lost.</p> <p>(2) Do not write the data to the buffer memory before writing to the flash ROM is completed.</p> <p>(3) The number of writes to the flash ROM with the PLC program is 25 max. while the power is turned ON. Writing to the flash ROM beyond 25 times will cause an error (error code: 805). Refer to Section 15.2 "List of errors" for details.</p> <p>(4) Monitoring is the number of writes to the flash ROM by the "Md.19 No. of write accesses to flash ROM".</p>			
<p>Cd.2 Parameter initialization request</p>	<p>ε Requests initialization of setting data. Initialization: Resetting of setting data to default values Note: After completing the initialization of setting data, reset the PLC CPU or reboot the PLC power.</p> <p>Initialized setting data</p> <table border="1" data-bbox="587 1167 1315 1292"> <tr> <td>Parameters ( Pr.1 to Pr.57 , Pr.100 to Pr.161, Pr.200, Pr.201 )</td> </tr> <tr> <td>Positioning data (No. 1 to 600)</td> </tr> <tr> <td>Block start data (No. 7000 to 7004)</td> </tr> </table>	Parameters ( Pr.1 to Pr.57 , Pr.100 to Pr.161, Pr.200, Pr.201 )	Positioning data (No. 1 to 600)	Block start data (No. 7000 to 7004)
Parameters ( Pr.1 to Pr.57 , Pr.100 to Pr.161, Pr.200, Pr.201 )				
Positioning data (No. 1 to 600)				
Block start data (No. 7000 to 7004)				
<p>Cd.41 Deceleration start flag valid *</p>	<p>ε Set whether "Md.48 Deceleration start flag" is made valid or invalid.</p> <p><b>POINT</b></p> <p>The " Cd.41 Deceleration start flag valid" become valid when the PLC READY signal [Y0] turns from OFF to ON.</p>			
<p>Cd.42 Stop command processing for deceleration stop selection *</p>	<p>ε Set the stop command processing for deceleration stop function (deceleration curve re-processing/deceleration curve continuation).</p>			

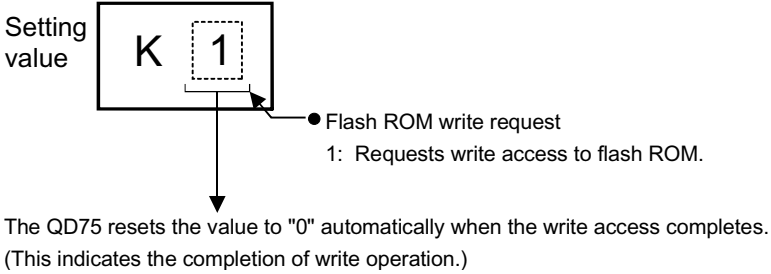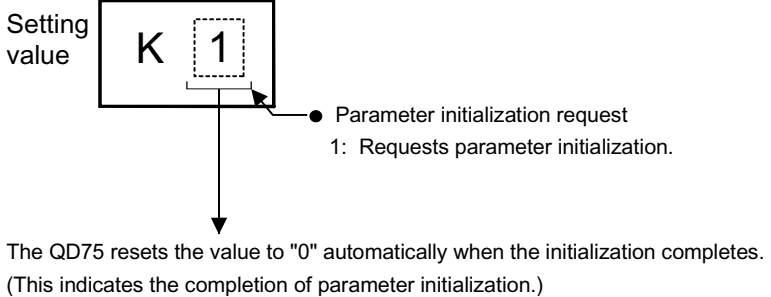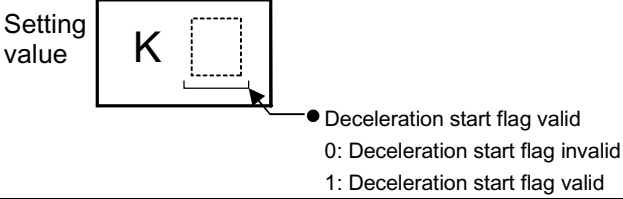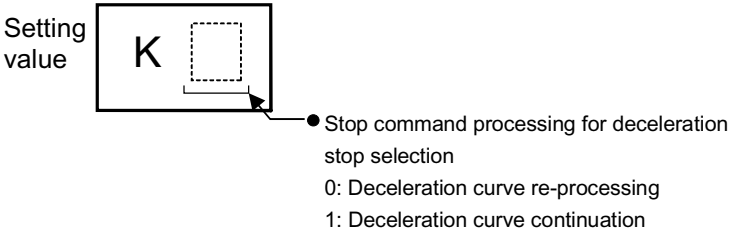	Setting value	Default value	Storage buffer memory address (common to axes 1 to 4)
	<p>■ Set with a decimal.</p> <p>Setting value</p>  <p>Flash ROM write request 1: Requests write access to flash ROM.</p> <p>The QD75 resets the value to "0" automatically when the write access completes. (This indicates the completion of write operation.)</p>	0	1900
	<p>■ Set with a decimal.</p> <p>Setting value</p>  <p>Parameter initialization request 1: Requests parameter initialization.</p> <p>The QD75 resets the value to "0" automatically when the initialization completes. (This indicates the completion of parameter initialization.)</p>	0	1901
	<p>■ Set with a decimal.</p> <p>Setting value</p>  <p>Deceleration start flag valid 0: Deceleration start flag invalid 1: Deceleration start flag valid</p>	0	1905
	<p>■ Set with a decimal.</p> <p>Setting value</p>  <p>Stop command processing for deceleration stop selection 0: Deceleration curve re-processing 1: Deceleration curve continuation</p>	0	1907


\*: Usable with the module whose first six digits of SERIAL No. are 050224" or later.

## 5.7.2 Axis control data

Setting item	Setting details	
Cd.3 Positioning start No.	� Set the positioning start No. (Only 1 to 600 for the Pre-reading start function. For details, refer to Section 12.7.8 "Pre-reading start function".)	
Cd.4 Positioning starting point No.	� Set a " starting point No." (1 to 50) if block start data is used for positioning. (Handled as "1" if the value of other than 1 to 50 is set.)	
Cd.5 Axis error reset	� Clears the axis error detection, axis error No., axis warning detection and axis warning No. � When the QD75 axis operation state is "in error occurrence", the error is cleared and the QD75 is returned to the "waiting" state.	
Cd.6 Restart command	� When positioning is stopped for any reason (when axis operation state is "stopped"), set "1" in Cd.6 . Positioning will be carried out again from the stopped position to the end point of the stopped positioning data.	
Cd.7 M code OFF request	� The M code ON signal turns OFF.	

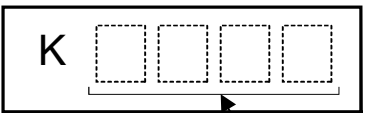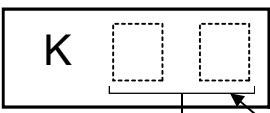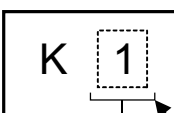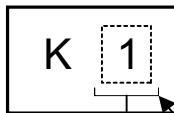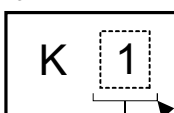Setting value	Default value	Storage buffer memory address			
		Axis 1	Axis 2	Axis 3	Axis 4
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Positioning data No.                     <ul style="list-style-type: none"> <li>• 1 to 600 : Positioning data No.</li> <li>• 7000 to 7004 : Block start designation</li> <li>• 9001 : Machine OPR</li> <li>• 9002 : Fast-OPR</li> <li>• 9003 : Current value changing</li> <li>• 9004 : Simultaneous starting of multiple axes</li> </ul> </li> </ul>	0	1500	1600	1700	1800
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Positioning starting point No. 1 to 50</li> </ul> <p>The value is set to "0" by the QD75 automatically when the continuous operation is interrupted.</p>	0	1501	1601	1701	1801
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Error reset request 1: Axis error is reset.</li> </ul> <p>After the axis error reset is completed, "0" is stored by the QD75 automatically. (Indicates that the axis error reset is completed.)</p>	0	1502	1602	1702	1802
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Restart command 1: Restarts</li> </ul> <p>After restart acceptance is completed, "0" is stored by the QD75 automatically. (Indicates that the restart acceptance is completed.)</p>	0	1503	1603	1703	1803
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● M code OFF request 1: M code ON signal turns OFF</li> </ul> <p>After the M code ON signal turns OFF, "0" is stored by the QD75 automatically. (Indicates that the OFF request is completed.)</p>	0	1504	1604	1704	1804

Setting item	Setting details										
<p><b>Cd.8</b> External command valid</p>	<p>€ Validates or in validates external command signals.</p>										
<p><b>Cd.9</b> New current value</p>	<p>€ When changing the "current feed value" using the start No. "9003", use this data item to specify a new feed value.</p> <p>€ Set a value within the following range:</p> <table border="1" data-bbox="584 786 1407 956"> <thead> <tr> <th data-bbox="584 786 740 860"><b>Pr.1</b></th> <th data-bbox="740 786 896 860">mm (<math>\Delta 10^{-1} \mu\text{m}</math>)</th> <th data-bbox="896 786 1053 860">inch (<math>\Delta 10^{-5}</math> inch)</th> <th data-bbox="1053 786 1209 860">degree (<math>\Delta 10^{-5}</math> degree)</th> <th data-bbox="1209 786 1407 860">PLS (PLS)</th> </tr> </thead> <tbody> <tr> <td data-bbox="584 860 740 956">Setting range</td> <td data-bbox="740 860 896 956">-2147483648 to +2147483647</td> <td data-bbox="896 860 1053 956">-2147483648 to +2147483647</td> <td data-bbox="1053 860 1209 956">0 to 35999999</td> <td data-bbox="1209 860 1407 956">-2147483648 to +2147483647</td> </tr> </tbody> </table>	<b>Pr.1</b>	mm ( $\Delta 10^{-1} \mu\text{m}$ )	inch ( $\Delta 10^{-5}$ inch)	degree ( $\Delta 10^{-5}$ degree)	PLS (PLS)	Setting range	-2147483648 to +2147483647	-2147483648 to +2147483647	0 to 35999999	-2147483648 to +2147483647
<b>Pr.1</b>	mm ( $\Delta 10^{-1} \mu\text{m}$ )	inch ( $\Delta 10^{-5}$ inch)	degree ( $\Delta 10^{-5}$ degree)	PLS (PLS)							
Setting range	-2147483648 to +2147483647	-2147483648 to +2147483647	0 to 35999999	-2147483648 to +2147483647							

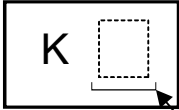
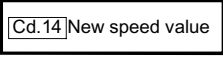
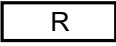

Setting value	Default value	Storage buffer memory address													
		Axis 1	Axis 2	Axis 3	Axis 4										
<p>■ Set with a decimal.</p> <p>Setting value</p>  <p>• External command valid 0: Invalidates an external command. 1: Validates an external command.</p>	0	1505	1605	1705	1805										
<p>■ Set with a decimal.</p> <p>Actual value <span style="border: 1px solid black; padding: 2px;">Cd.9</span> New current value</p> <p>◇ Conversion into an integer value</p> <p>× 10<sup>n</sup> → ● Unit conversion table (<span style="border: 1px solid black; padding: 2px;">Cd.9</span>)</p> <p>Setting value (Decimal) <span style="border: 1px solid black; padding: 2px;">R</span></p> <table border="1" data-bbox="730 860 954 1014"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td>μm</td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table>	n	Unit	-1	μm	-5	inch	-5	degree	0	PLS	0	1506 1507	1606 1607	1706 1707	1806 1807
n	Unit														
-1	μm														
-5	inch														
-5	degree														
0	PLS														

Setting item	Setting details			
<p>Cd.10 New acceleration time value</p>	<p>⚠ When changing the acceleration time during a speed change, use this data item to specify a new acceleration time.</p> <table border="1" data-bbox="584 488 1007 582"> <tr> <td>Cd.10 setting range (unit)</td> </tr> <tr> <td>0 to 8388608 (ms)</td> </tr> </table>	Cd.10 setting range (unit)	0 to 8388608 (ms)	
Cd.10 setting range (unit)				
0 to 8388608 (ms)				
<p>Cd.11 New deceleration time value</p>	<p>⚠ When changing the deceleration time during a speed change, use this data item to specify a new deceleration time.</p> <table border="1" data-bbox="584 745 1007 840"> <tr> <td>Cd.11 setting range (unit)</td> </tr> <tr> <td>0 to 8388608 (ms)</td> </tr> </table>	Cd.11 setting range (unit)	0 to 8388608 (ms)	
Cd.11 setting range (unit)				
0 to 8388608 (ms)				
<p>Cd.12 Acceleration/deceleration time change during speed change, enable/disable selection</p>	<p>⚠ Enables or disables modifications to the acceleration/deceleration time during a speed change.</p>			

Setting value	Default value	Storage buffer memory address							
		Axis 1	Axis 2	Axis 3	Axis 4				
<p>■ Set with a decimal.</p> <p>Setting value</p> <table border="1" style="margin-left: 40px;"> <tr> <td>Cd.10</td> <td>New acceleration time value</td> </tr> <tr> <td>Cd.11</td> <td>New deceleration time value</td> </tr> </table> <p style="margin-left: 40px;">Example: When the "Cd. 10" New acceleration time value" is set as "60000 ms", the buffer memory stores "60000".</p>	Cd.10	New acceleration time value	Cd.11	New deceleration time value	0	1508 1509	1608 1609	1708 1709	1808 1809
Cd.10	New acceleration time value								
Cd.11	New deceleration time value								
	0	1510 1511	1610 1611	1710 1711	1810 1811				
<p>■ Set with a decimal.</p> <p>Setting value</p> <table border="1" style="margin-left: 40px;"> <tr> <td style="text-align: center;">K</td> <td style="border: 1px dashed black; width: 40px; height: 20px;"></td> </tr> </table> <ul style="list-style-type: none"> <li>● Acceleration/deceleration time change during speed change, enable/disable selection</li> <li>1 : Enables modifications to acceleration/deceleration time</li> <li>Other than 1: Disables modifications to acceleration/deceleration time</li> </ul>	K		0	1512	1612	1712	1812		
K									






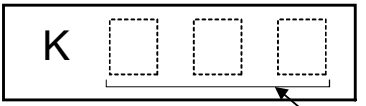
Setting item	Setting details										
<p><b>Cd.13</b> Positioning operation speed override</p>	<p>€ To use the positioning operation speed override function, use this data item to specify an "override" value.                      * For details of the override function, refer to Section 12.5.2 "Override function".</p> <p>If the speed resulting from a small override value (e.g. 1%) includes fractions below the minimum unit, the speed is raised to make a complete unit and the warning No. 110 is output.</p>										
<p><b>Cd.14</b> New speed value</p>	<p>€ When changing the speed, use this data item to specify a new speed.                      € The operation halts if you specify "0".                      € Set a value within the following range:</p> <table border="1" data-bbox="587 763 1426 891"> <thead> <tr> <th data-bbox="587 763 740 831"><b>Pr.1</b></th> <th data-bbox="740 763 911 831">mm (<math>\Delta 10^{-2}</math> mm/min)</th> <th data-bbox="911 763 1082 831">inch (<math>\Delta 10^{-3}</math> inch/min)</th> <th data-bbox="1082 763 1262 831">degree (<math>\Delta 10^{-3}</math> degree/min)</th> <th data-bbox="1262 763 1426 831">PLS (PLS/s)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 831 740 891">Setting range</td> <td data-bbox="740 831 911 891">0 to 2000000000</td> <td data-bbox="911 831 1082 891">0 to 2000000000</td> <td data-bbox="1082 831 1262 891">0 to 2000000000</td> <td data-bbox="1262 831 1426 891">0 to 10000000</td> </tr> </tbody> </table>	<b>Pr.1</b>	mm ( $\Delta 10^{-2}$ mm/min)	inch ( $\Delta 10^{-3}$ inch/min)	degree ( $\Delta 10^{-3}$ degree/min)	PLS (PLS/s)	Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000
<b>Pr.1</b>	mm ( $\Delta 10^{-2}$ mm/min)	inch ( $\Delta 10^{-3}$ inch/min)	degree ( $\Delta 10^{-3}$ degree/min)	PLS (PLS/s)							
Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000							
<p><b>Cd.15</b> Speed change request</p>	<p>€ After setting the "<b>Cd.14</b> New speed value", set this data item to "1" to execute the speed change (through validating the new speed value).</p>										

Setting value	Default value	Storage buffer memory address													
		Axis 1	Axis 2	Axis 3	Axis 4										
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Override value (%) 1 to 300</p>	100	1513	1613	1713	1813										
<p>■ Set with a decimal.</p> <p>Actual value </p> <p>◇ Conversion into an integer value <math>\times 10^n</math></p> <p>● Unit conversion table (Cd.14)</p> <table border="1" data-bbox="730 831 954 987"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table> <p>Setting value (Decimal) </p> <p>Example: When the "Cd. 14" New speed value" is set as "20000.00mm/min", the buffer memory stores "2000000".</p>	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	0	1514 1515	1614 1615	1714 1715	1814 1815
n	Unit														
-2	mm/min														
-3	inch/min														
-3	degree/min														
0	PLS/s														
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Speed change request 1: Executes speed change.</p> <p>The QD75 resets the value to "0" automatically when the speed change request has been processed. (This indicates the completion of speed change request.)</p>	0	1516	1616	1716	1816										

Setting item	Setting details										
<p>Cd.16 Inching movement amount</p>	<p>                     � Use this data item to set the amount of movement by inching.                      � The machine performs a JOG operation if "0" is set.                      � Set a value within the following range:                 </p> <table border="1" data-bbox="587 629 1426 741"> <thead> <tr> <th data-bbox="587 629 740 701">Pr.1</th> <th data-bbox="740 629 911 701">mm (<math>\Delta 10^{-1}</math> <math>\mu</math>m)</th> <th data-bbox="911 629 1082 701">inch (<math>\Delta 10^{-5}</math> inch)</th> <th data-bbox="1082 629 1252 701">degree (<math>\Delta 10^{-5}</math> degree)</th> <th data-bbox="1252 629 1426 701">PLS (PLS)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 701 740 741">Setting range</td> <td data-bbox="740 701 911 741">0 to 65535</td> <td data-bbox="911 701 1082 741">0 to 65535</td> <td data-bbox="1082 701 1252 741">0 to 65535</td> <td data-bbox="1252 701 1426 741">0 to 65535</td> </tr> </tbody> </table>	Pr.1	mm ( $\Delta 10^{-1}$ $\mu$ m)	inch ( $\Delta 10^{-5}$ inch)	degree ( $\Delta 10^{-5}$ degree)	PLS (PLS)	Setting range	0 to 65535	0 to 65535	0 to 65535	0 to 65535
Pr.1	mm ( $\Delta 10^{-1}$ $\mu$ m)	inch ( $\Delta 10^{-5}$ inch)	degree ( $\Delta 10^{-5}$ degree)	PLS (PLS)							
Setting range	0 to 65535	0 to 65535	0 to 65535	0 to 65535							
<p>Cd.17 JOG speed</p>	<p>                     � Use this data item to set the JOG speed.                      � Set a value within the following range:                 </p> <table border="1" data-bbox="587 1238 1426 1368"> <thead> <tr> <th data-bbox="587 1238 740 1310">Pr.1</th> <th data-bbox="740 1238 911 1310">mm (<math>\Delta 10^{-2}</math> mm/min)</th> <th data-bbox="911 1238 1082 1310">inch (<math>\Delta 10^{-3}</math> inch/min)</th> <th data-bbox="1082 1238 1252 1310">degree (<math>\Delta 10^{-3}</math> degree/min)</th> <th data-bbox="1252 1238 1426 1310">PLS (PLS/s)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 1310 740 1368">Setting range</td> <td data-bbox="740 1310 911 1368">0 to 2000000000</td> <td data-bbox="911 1310 1082 1368">0 to 2000000000</td> <td data-bbox="1082 1310 1252 1368">0 to 2000000000</td> <td data-bbox="1252 1310 1426 1368">0 to 10000000</td> </tr> </tbody> </table>	Pr.1	mm ( $\Delta 10^{-2}$ mm/min)	inch ( $\Delta 10^{-3}$ inch/min)	degree ( $\Delta 10^{-3}$ degree/min)	PLS (PLS/s)	Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000
Pr.1	mm ( $\Delta 10^{-2}$ mm/min)	inch ( $\Delta 10^{-3}$ inch/min)	degree ( $\Delta 10^{-3}$ degree/min)	PLS (PLS/s)							
Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000							
<p>Cd.18 Interruption request during continuous operation</p>	<p>                     � To interrupt a continuous operation, set "1" to this data item.                      � After processing the interruption request ("1"), the QD75 automatically resets the value to "0".                 </p>										

Setting value	Default value	Storage buffer memory address													
		Axis 1	Axis 2	Axis 3	Axis 4										
<p>■ Set with a decimal.</p> <p>Actual value <span style="border: 1px solid black; padding: 2px;">Cd.16 Inching movement amount</span></p> <p style="text-align: center;">↓ Conversion into an integer value</p> <p style="text-align: center;"><math>\times 10^n</math></p> <p>Setting value (Decimal) <span style="border: 1px solid black; padding: 2px;">R</span></p> <div style="border: 1px dashed black; padding: 5px; margin-top: 10px;"> <p>Example: When the "Cd. 16 Inching movement amount" is set as "1.0 μm", the buffer memory stores "10".</p> </div> <div style="margin-top: 10px;"> <p>● Unit conversion table (Cd.16)</p> <table border="1" style="display: inline-table;"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td>μm</td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table> </div>	n	Unit	-1	μm	-5	inch	-5	degree	0	PLS	0	1517	1617	1717	1817
n	Unit														
-1	μm														
-5	inch														
-5	degree														
0	PLS														
<p>■ Set with a decimal.</p> <p>Actual value <span style="border: 1px solid black; padding: 2px;">Cd.17 JOG speed</span></p> <p style="text-align: center;">↓ Conversion into an integer value</p> <p style="text-align: center;"><math>\times 10^n</math></p> <p>Setting value (Decimal) <span style="border: 1px solid black; padding: 2px;">R</span></p> <div style="border: 1px dashed black; padding: 5px; margin-top: 10px;"> <p>Example: When the "Cd. 17 JOG speed" is set as "20000.00mm/min", the buffer memory stores "2000000".</p> </div> <div style="margin-top: 10px;"> <p>● Unit conversion table (Cd.17)</p> <table border="1" style="display: inline-table;"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table> </div>	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	0	1518 1519	1618 1619	1718 1719	1818 1819
n	Unit														
-2	mm/min														
-3	inch/min														
-3	degree/min														
0	PLS/s														
<p>■ Set with a decimal.</p> <p>Setting value <span style="border: 1px solid black; padding: 2px;">K <span style="border: 1px dashed black; padding: 2px;">1</span></span></p> <p>● Interruption request continuous operation 1: Interrupts continuous operation control or continuous path control.</p> <p style="margin-top: 10px;">The QD75 resets the value to "0" automatically when the continuous control interruption request is processed. (This indicates the completion of continuous operation interruption request.)</p>	0	1520	1620	1720	1820										

Setting item	Setting details
<p><b>Cd.19</b> OPR request flag OFF request</p>	<p>€ The PLC program can use this data item to forcibly turn the OPR request flag from ON to OFF.</p>
<p><b>Cd.20</b> Manual pulse generator 1 pulse input magnification</p>	<p>€ This data item determines the factor by which the number of pulses from the manual pulse generator is magnified.</p> <p>€ Value "0" : read as "1".</p> <p>€ Value "101" or less: read as "100".</p>
<p><b>Cd.21</b> Manual pulse generator enable flag</p>	<p>€ This data item enables or disables operations using a manual pulse generator.</p>
<p><b>Cd.22</b> New torque value</p>	<p>€ When changing the " <b>Md.35</b> Torque limit stored value", use this data item to specify a new torque limit stored value.</p> <p>€ Set a value within the allowable range of the " <b>Pr.17</b> Torque limit setting value".</p>

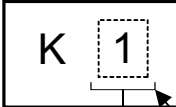
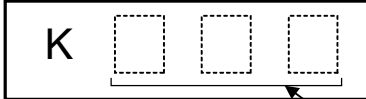

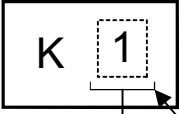
Setting value	Default value	Storage buffer memory address			
		Axis 1	Axis 2	Axis 3	Axis 4
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● OPR request flag OFF request 1: Turns the "OPR request flag" from ON to OFF.</p> <p>The QD75 resets the value to "0" automatically when the OPR request flag is turned OFF. (This indicates the completion of OPR request flag OFF request.)</p>	0	1521	1621	1721	1821
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Manul pulse generator 1 pulse input magnification 1 to 100</p>	1	1522 1523	1622 1623	1722 1723	1822 1823
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Manual pulse generator enable flag 0: Disable manual pulse generator operation. 1: Enable manual pulse generator operation.</p>	0	1524	1624	1724	1824
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Torque change value 1 to <u>Pr.17</u> Torque limit setting value</p>	0	1525	1625	1725	1825

Setting item	Setting details										
<p><b>Cd.23</b> Speed-position switching control movement amount change register</p>	<p>⊘ During the speed control stage of the speed-position switching control (INC mode), it is possible to change the specification of the movement amount during the position control stage. For that, use this data item to specify a new movement amount.</p> <p>⊘ The new movement amount has to be set during the speed control stage of the speed-position switching control (INC mode).</p> <p>⊘ The value is reset to "0" when the next operation starts.</p> <p>⊘ Set a value within the following range:</p> <table border="1" data-bbox="587 698 1428 842"> <thead> <tr> <th data-bbox="587 698 740 775">Pr.1</th> <th data-bbox="740 698 911 775">mm (<math>\Delta 10^{-1} \mu\text{m}</math>)</th> <th data-bbox="911 698 1082 775">inch (<math>\Delta 10^{-5} \text{inch}</math>)</th> <th data-bbox="1082 698 1252 775">degree (<math>\Delta 10^{-5} \text{degree}</math>)</th> <th data-bbox="1252 698 1428 775">PLS (PLS)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 775 740 842">Setting range</td> <td data-bbox="740 775 911 842">0 to 2147483647</td> <td data-bbox="911 775 1082 842">0 to 2147483647</td> <td data-bbox="1082 775 1252 842">0 to 2147483647</td> <td data-bbox="1252 775 1428 842">0 to 2147483647</td> </tr> </tbody> </table>	Pr.1	mm ( $\Delta 10^{-1} \mu\text{m}$ )	inch ( $\Delta 10^{-5} \text{inch}$ )	degree ( $\Delta 10^{-5} \text{degree}$ )	PLS (PLS)	Setting range	0 to 2147483647	0 to 2147483647	0 to 2147483647	0 to 2147483647
Pr.1	mm ( $\Delta 10^{-1} \mu\text{m}$ )	inch ( $\Delta 10^{-5} \text{inch}$ )	degree ( $\Delta 10^{-5} \text{degree}$ )	PLS (PLS)							
Setting range	0 to 2147483647	0 to 2147483647	0 to 2147483647	0 to 2147483647							
<p><b>Cd.24</b> Speed-position switching enable flag</p>	<p>⊘ Set whether the external control signal (external command signal [CHG]: "speed-position, position-speed switching request" is selected) is enabled or not.</p>										
<p><b>Cd.25</b> Position-speed switching control speed change register</p>	<p>⊘ During the position control stage of the position-speed switching control, it is possible to change the specification of the speed during the speed control stage. For that, use this data item to specify a new speed.</p> <p>⊘ The new speed has to be set during the position control stage of the position-speed switching control.</p> <p>⊘ The value is reset to "0" when the next operation starts.</p> <p>⊘ Set a value within the following range:</p> <table border="1" data-bbox="587 1738 1428 1870"> <thead> <tr> <th data-bbox="587 1738 740 1809">Pr.1</th> <th data-bbox="740 1738 911 1809">mm (<math>\Delta 10^{-2} \text{mm/min}</math>)</th> <th data-bbox="911 1738 1082 1809">inch (<math>\Delta 10^{-3} \text{inch/min}</math>)</th> <th data-bbox="1082 1738 1252 1809">degree (<math>\Delta 10^{-3} \text{degree/min}</math>)</th> <th data-bbox="1252 1738 1428 1809">PLS (PLS/s)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 1809 740 1870">Setting range</td> <td data-bbox="740 1809 911 1870">0 to 2000000000</td> <td data-bbox="911 1809 1082 1870">0 to 2000000000</td> <td data-bbox="1082 1809 1252 1870">0 to 2000000000</td> <td data-bbox="1252 1809 1428 1870">0 to 10000000</td> </tr> </tbody> </table>	Pr.1	mm ( $\Delta 10^{-2} \text{mm/min}$ )	inch ( $\Delta 10^{-3} \text{inch/min}$ )	degree ( $\Delta 10^{-3} \text{degree/min}$ )	PLS (PLS/s)	Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000
Pr.1	mm ( $\Delta 10^{-2} \text{mm/min}$ )	inch ( $\Delta 10^{-3} \text{inch/min}$ )	degree ( $\Delta 10^{-3} \text{degree/min}$ )	PLS (PLS/s)							
Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000							

Setting value	Default value	Storage buffer memory address													
		Axis 1	Axis 2	Axis 3	Axis 4										
<p>■ Set with a decimal.</p> <p>Actual value <span style="border: 1px solid black; padding: 2px;">Cd.23 Speed-position switching control movement amount change register</span></p> <p style="text-align: center;">⇩ Conversion into an integer value</p> <p style="text-align: center;"><math>\times 10^n</math></p> <p>Setting value (Decimal) <span style="border: 1px solid black; padding: 2px;">R</span></p> <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 10px auto;"> <p>● Unit conversion table (Cd.23)</p> <table border="1" style="border-collapse: collapse; text-align: center;"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td>μm</td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table> </div> <div style="border: 1px dashed black; padding: 5px; margin-top: 10px;"> <p>Example: If "Cd. 23 Speed-position switching control movement amount change register" is set as "20000.0 μm", the buffer memory stores "200000".</p> </div>	n	Unit	-1	μm	-5	inch	-5	degree	0	PLS	0	1526 1527	1626 1627	1726 1727	1826 1827
n	Unit														
-1	μm														
-5	inch														
-5	degree														
0	PLS														
<p>■ Set with a decimal.</p> <p>Setting value <span style="border: 1px solid black; padding: 2px;">K <span style="border: 1px dashed black; padding: 2px; display: inline-block; width: 15px; height: 15px; vertical-align: middle;"></span></span></p> <p>● Speed-position switching enable flag</p> <p>0: Speed control will not be taken over by position control even when the external command signal comes ON.</p> <p>1: Speed control will be taken over by position control when the external command signal comes ON.</p>	0	1528	1628	1728	1828										
<p>■ Set with a decimal.</p> <p>Actual value <span style="border: 1px solid black; padding: 2px;">Cd.25 Position-speed switching control speed change register</span></p> <p style="text-align: center;">⇩ Conversion into an integer value</p> <p style="text-align: center;"><math>\times 10^n</math></p> <p>Setting value (Decimal) <span style="border: 1px solid black; padding: 2px;">R</span></p> <div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 10px auto;"> <p>● Unit conversion table (Cd.25)</p> <table border="1" style="border-collapse: collapse; text-align: center;"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table> </div> <div style="border: 1px dashed black; padding: 5px; margin-top: 10px;"> <p>Example: If "Cd. 25 Position-speed switching control speed change register" is set as "2000.00 mm/min", the buffer memory stores "200000".</p> </div>	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	0	1530 1531	1630 1631	1730 1731	1830 1831
n	Unit														
-2	mm/min														
-3	inch/min														
-3	degree/min														
0	PLS/s														




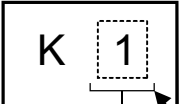

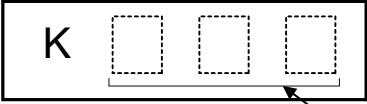

Setting item	Setting details															
<p><b>Cd.26</b> Position-speed switching control enable flag</p>	<p>☒ Set whether the external control signal (external command signal [CHG]: "speed-position, position-speed switching request" is selected) is enabled or not.</p>															
<p><b>Cd.27</b> Target position change value (New address)</p>	<p>☒ When changing the target position during a positioning operation, use this data item to specify a new positioning address.</p> <p>☒ Set a value within the following range:</p> <table border="1" data-bbox="587 927 1426 1189"> <thead> <tr> <th data-bbox="587 927 740 1003">Pr.1</th> <th data-bbox="740 927 911 1003">mm (<math>\Delta 10^{-1} \mu\text{m}</math>)</th> <th data-bbox="911 927 1082 1003">inch (<math>\Delta 10^{-5} \text{inch}</math>)</th> <th data-bbox="1082 927 1252 1003">degree (<math>\Delta 10^{-5} \text{degree}</math>)</th> <th data-bbox="1252 927 1426 1003">PLS (PLS)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 1003 740 1093">ABS</td> <td data-bbox="740 1003 911 1093">-2147483648 to +2147483647</td> <td data-bbox="911 1003 1082 1093">-2147483648 to +2147483647</td> <td data-bbox="1082 1003 1252 1093">0 to 35999999</td> <td data-bbox="1252 1003 1426 1093">-2147483648 to +2147483647</td> </tr> <tr> <td data-bbox="587 1093 740 1189">INC</td> <td data-bbox="740 1093 911 1189">-2147483648 to +2147483647</td> <td data-bbox="911 1093 1082 1189">-2147483648 to +2147483647</td> <td data-bbox="1082 1093 1252 1189">-2147483648 to +2147483647</td> <td data-bbox="1252 1093 1426 1189">-2147483648 to +2147483647</td> </tr> </tbody> </table>	Pr.1	mm ( $\Delta 10^{-1} \mu\text{m}$ )	inch ( $\Delta 10^{-5} \text{inch}$ )	degree ( $\Delta 10^{-5} \text{degree}$ )	PLS (PLS)	ABS	-2147483648 to +2147483647	-2147483648 to +2147483647	0 to 35999999	-2147483648 to +2147483647	INC	-2147483648 to +2147483647	-2147483648 to +2147483647	-2147483648 to +2147483647	-2147483648 to +2147483647
Pr.1	mm ( $\Delta 10^{-1} \mu\text{m}$ )	inch ( $\Delta 10^{-5} \text{inch}$ )	degree ( $\Delta 10^{-5} \text{degree}$ )	PLS (PLS)												
ABS	-2147483648 to +2147483647	-2147483648 to +2147483647	0 to 35999999	-2147483648 to +2147483647												
INC	-2147483648 to +2147483647	-2147483648 to +2147483647	-2147483648 to +2147483647	-2147483648 to +2147483647												
<p><b>Cd.28</b> Target position change value (New speed)</p>	<p>☒ When changing the target position during a positioning operation, use this data item to specify a new speed.</p> <p>☒ The speed will not change if "0" is set.</p> <p>☒ Set a value within the following range:</p> <table border="1" data-bbox="587 1393 1426 1525"> <thead> <tr> <th data-bbox="587 1393 740 1469">Pr.1</th> <th data-bbox="740 1393 911 1469">mm (<math>\Delta 10^{-2} \text{mm/min}</math>)</th> <th data-bbox="911 1393 1082 1469">inch (<math>\Delta 10^{-3} \text{inch/min}</math>)</th> <th data-bbox="1082 1393 1252 1469">degree (<math>\Delta 10^{-3} \text{degree/min}</math>)</th> <th data-bbox="1252 1393 1426 1469">PLS (PLS/s)</th> </tr> </thead> <tbody> <tr> <td data-bbox="587 1469 740 1525">Setting range</td> <td data-bbox="740 1469 911 1525">0 to 2000000000</td> <td data-bbox="911 1469 1082 1525">0 to 2000000000</td> <td data-bbox="1082 1469 1252 1525">0 to 2000000000</td> <td data-bbox="1252 1469 1426 1525">0 to 10000000</td> </tr> </tbody> </table>	Pr.1	mm ( $\Delta 10^{-2} \text{mm/min}$ )	inch ( $\Delta 10^{-3} \text{inch/min}$ )	degree ( $\Delta 10^{-3} \text{degree/min}$ )	PLS (PLS/s)	Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000					
Pr.1	mm ( $\Delta 10^{-2} \text{mm/min}$ )	inch ( $\Delta 10^{-3} \text{inch/min}$ )	degree ( $\Delta 10^{-3} \text{degree/min}$ )	PLS (PLS/s)												
Setting range	0 to 2000000000	0 to 2000000000	0 to 2000000000	0 to 10000000												
<p><b>Cd.29</b> Target position change request flag</p>	<p>☒ Requests a change in the target position during a positioning operation.</p>															

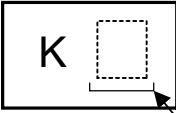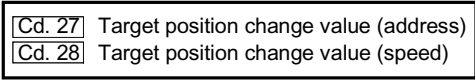Setting value	Default value	Storage buffer memory address																							
		Axis 1	Axis 2	Axis 3	Axis 4																				
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Position-speed switching enable flag                      0: Position control will not be taken over by speed control even when the external command signal comes ON.                      1: Position control will be taken over by speed control when the external command signal comes ON.</p>	0	1532	1632	1732	1832																				
<p>■ Set with a decimal.</p> <p>Actual value </p> <p>◇ Conversion into an integer value</p> <p>Setting value (Decimal) </p> <p>× 10<sup>n</sup></p> <p>● Unit conversion table (Cd.27)</p> <table border="1" data-bbox="735 1133 959 1290"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-1</td> <td>μm</td> </tr> <tr> <td>-5</td> <td>inch</td> </tr> <tr> <td>-5</td> <td>degree</td> </tr> <tr> <td>0</td> <td>PLS</td> </tr> </tbody> </table> <p>● Unit conversion table (Cd.28)</p> <table border="1" data-bbox="735 1350 959 1507"> <thead> <tr> <th>n</th> <th>Unit</th> </tr> </thead> <tbody> <tr> <td>-2</td> <td>mm/min</td> </tr> <tr> <td>-3</td> <td>inch/min</td> </tr> <tr> <td>-3</td> <td>degree/min</td> </tr> <tr> <td>0</td> <td>PLS/s</td> </tr> </tbody> </table> <p>Example: If "Cd. 28 Target position change value (speed) is set as "10000.00 mm/min", the buffer memory stores "1000000".</p>	n	Unit	-1	μm	-5	inch	-5	degree	0	PLS	n	Unit	-2	mm/min	-3	inch/min	-3	degree/min	0	PLS/s	0	1534 1535	1634 1635	1734 1735	1834 1835
n	Unit																								
-1	μm																								
-5	inch																								
-5	degree																								
0	PLS																								
n	Unit																								
-2	mm/min																								
-3	inch/min																								
-3	degree/min																								
0	PLS/s																								
<p>■ Set with a decimal.</p> <p>Setting value </p> <p>● Target position change request flag                      1: Requests a change in the target position</p> <p>The QD75 resets the value to "0" automatically when the new target position value has been written. (This indicates the completion of write operation.)</p>	0	1538	1638	1738	1838																				


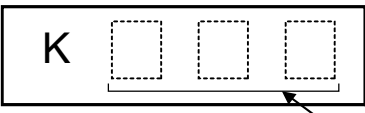

Setting item	Setting details		
Cd.30 Simultaneous starting axis start data No. (axis 1 start data No.)	€ Use these data items to specify a start data No. for each axis that has to start simultaneously. € Set "0" to any axis that should not start simultaneously.		
Cd.31 Simultaneous starting axis start data No. (axis 2 start data No.)			
Cd.32 Simultaneous starting axis start data No. (axis 3 start data No.)			
Cd.33 Simultaneous starting axis start data No. (axis 4 start data No.)			
Cd.34 Step mode	€ To perform a step operation, use this data item to specify the units by which the stepping should be performed.		
Cd.35 Step valid flag	€ This data item validates or invalidates step operations.		

Setting value	Default value	Storage buffer memory address			
		Axis 1	Axis 2	Axis 3	Axis 4
	0	1540	1640	1740	1840
<p>■ Set with a decimal.</p> <p>Setting value</p> <div style="border: 1px solid black; padding: 5px; display: inline-block;"> <p>K <span style="border: 1px dashed black; padding: 2px 10px;"> </span> <span style="border: 1px dashed black; padding: 2px 10px;"> </span> <span style="border: 1px dashed black; padding: 2px 10px;"> </span></p> </div> <p style="margin-left: 150px;"> <span style="border: 1px solid black; padding: 2px;">Cd.30</span> to <span style="border: 1px solid black; padding: 2px;">Cd.33</span>                      Simultaneous starting axis start data No.: 1 to 600                 </p>	0	1541	1641	1741	1841
	0	1542	1642	1742	1842
	0	1543	1643	1743	1843
<p>■ Set with a decimal.</p> <p>Setting value</p> <div style="border: 1px solid black; padding: 5px; display: inline-block;"> <p>K <span style="border: 1px dashed black; padding: 2px 10px;"> </span></p> </div> <p style="margin-left: 100px;">                     ● Step mode                      0: Stepping by deceleration units                      1: Stepping by data No. units                 </p>	0	1544	1644	1744	1844
<p>■ Set with a decimal.</p> <p>Setting value</p> <div style="border: 1px solid black; padding: 5px; display: inline-block;"> <p>K <span style="border: 1px dashed black; padding: 2px 10px;"> </span></p> </div> <p style="margin-left: 100px;">                     ● Step valid flag                      0: Invalidates step operations                      1: Validates step operations                 </p>	0	1545	1645	1745	1845

Setting item	Setting details	
Cd.36 Step start information	<ul style="list-style-type: none"> <li>⊘ During a step operation, this data item determines whether the operation is continued or restarted.</li> </ul>	
Cd.37 Skip command	<ul style="list-style-type: none"> <li>⊘ To skip the current positioning operation, set "1" in this data item.</li> </ul>	
Cd.38 Teaching data selection	<ul style="list-style-type: none"> <li>⊘ This data item specifies the teaching result write destination.</li> </ul>	
Cd.39 Teaching positioning data No.	<ul style="list-style-type: none"> <li>⊘ This data item specifies data to be produced by teaching.</li> <li>⊘ If a value between 1 and 600 is set, a teaching operation is done.</li> <li>⊘ The value is cleared to "0" when the QD75 is initialized, when a teaching operation completes, and when a illegal value (601 or higher) is entered.</li> </ul>	
Cd.40 ABS direction in degrees	<ul style="list-style-type: none"> <li>⊘ This data item specifies the ABS moving direction carrying out the position control when "degree" is selected as the unit.</li> </ul>	

Setting value	Default value	Storage buffer memory address			
		Axis 1	Axis 2	Axis 3	Axis 4
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Step start information                     <ol style="list-style-type: none"> <li>1: Continues step operation</li> <li>2: Restarts operation</li> </ol> </li> </ul> <p>The QD75 resets the value to "0" automatically when processing of the step start request completes.</p>	0	1546	1646	1746	1846
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Skip request                     <ol style="list-style-type: none"> <li>1: Issues a skip request to have the machine decelerate, stop, and then start the next positioning operation.</li> </ol> </li> </ul> <p>The QD75 resets the value to "0" automatically when processing of the skip request completes.</p>	0	1547	1647	1747	1847
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Teaching data selection                     <ol style="list-style-type: none"> <li>0: Takes the current feed value as a positioning address.</li> <li>1: Takes the current feed value as an arc data.</li> </ol> </li> </ul>	0	1548	1648	1748	1848
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● Teaching positioning data No.                     <ol style="list-style-type: none"> <li>1 to 600</li> </ol> </li> </ul>	0	1549	1649	1749	1849
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>● ABS direction in degrees                     <ol style="list-style-type: none"> <li>0: Takes a shortcut. (Specified direction ignored.)</li> <li>1: ABS circular right</li> <li>2: ABS circular left</li> </ol> </li> </ul>	0	1550	1650	1750	1850

Setting item	Setting details
Cd.100 Servo OFF command	<p>☒ Turns OFF each axis servo.</p> <p><b>POINT</b></p> <p>When you want to turn ON the servo for two to four axes with only the servo for one axis turned OFF, write "1" to storage buffer memory address 1551 and then turn ON all axis servo ON (Y1) signal.</p>
Cd.101 Torque output setting value	<p>☒ Sets the torque output value.</p> <p><b>POINT</b></p> <p>☒ If the " Cd.101 Torque output setting value" is "0", the " Pr.17 Torque limit setting value" will be its value.</p> <p>☒ If a value beside "0" is set in the " Cd.101 Torque output setting value", the torque generated by the servomotor will be limited by that value.</p> <p>☒ The " Pr.17 Torque limit setting value" of the servo adjustment parameter torque output setting value becomes effective at the PLC ready signal rising edge.</p> <p>☒ The " Cd.101 Torque output setting value" (refer to the start) axis control data can be changed at all times. Therefore in the " Cd.101 Torque output setting value" is used when you must change. (Refer to Section 12.5.4 "Torque change function ".)</p>
Cd.102 Servo amplifier data read	<p>☒ Reads a servo parameter from the servo amplifier to the buffer memory. (Load inertia ratio/Positional control gain 1, 2/Speed control gain 1, 2/Speed integration compensation)</p>

Setting value	Default value	Storage buffer memory address			
		Axis 1	Axis 2	Axis 3	Axis 4
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>• Servo OFF command</li> <li>0: Servo ON</li> <li>1: Servo OFF</li> </ul> <p>When all axis servo ON is valid.</p>	0	1551	1651	1751	1851
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>• Torque output setting</li> <li>0 to 500</li> </ul>	0	1552	1652	1752	1852
<p>■ Set with a decimal.</p> <p>Setting value</p>  <ul style="list-style-type: none"> <li>• Servo amplifier read request</li> <li>0: Servo amplifier read complete</li> <li>1: Servo amplifier read request</li> </ul>	0	1553	1653	1753	1853





# Chapter 6 PLC Program Used for Positioning Control

The programs required to carry out positioning control with the QD75 are explained in this chapter.

The PLC program required for control is created allowing for the "start conditions", "start time chart", "device settings" and general control configuration. (The parameters, positioning data, block start data and condition data, etc., must be set in the QD75 according to the control to be executed, and program for setting the control data or a program for starting the various control must be created.)

The first half of this chapter explains the program configuration of general control, and the latter half explains the program details. Create the required program while referring to the various control details explained in Section 2, and to Chapter 5 "Data used for positioning control".

- 6.1 Precautions for creating program .....6- 2
- 6.2 List of devices used .....6- 5
- 6.3 Creating a program .....6- 15
  - 6.3.1 General configuration of program .....6- 15
  - 6.3.2 Positioning control operation program .....6- 16
- 6.4 Positioning program examples..... 6- 20
- 6.5 Program details ..... 6- 53
  - 6.5.1 Initialization program..... 6- 53
  - 6.5.2 Start details setting program..... 6- 54
  - 6.5.3 Start program ..... 6- 56
  - 6.5.4 Continuous operation interrupt program ..... 6- 65
  - 6.5.5 Restart program ..... 6- 67
  - 6.5.6 Stop program ..... 6- 70

## 6.1 Precautions for creating program

The common precautions to be taken when writing data from the PLC CPU to the QD75 buffer memory are described below.

### (1) Reading/writing the data

Setting the data explained in this chapter (various parameters, positioning data, block start data) should be set using GX Configurator-QP.

When set with the PLC program, many PLC programs and devices must be used. This will not only complicate the program, but will also increase the scan time.

When rewriting the positioning data during continuous path control or continuous positioning control, rewrite the data four positioning data items before the actual execution. If the positioning data is not rewritten before the positioning data four items earlier is executed, the process will be carried out as if the data was not rewritten.

### (2) Restrictions to speed change execution interval

Provide an interval of 100ms or more when changing the speed with the QD75.

### (3) Process during overrun


Overrun is prevented by the setting of the upper and lower stroke limits with the detail parameter 1.

However, this applies only when the QD75 is operating correctly.

It is recommended to create an external circuit including a boundary limit switch to ensure the whole system safety as follows: the external circuit powers OFF the motor when the boundary limit switch operates.

(4) System configuration

Unless particularly designated, the PLC program for the following system is shown in this chapter and subsequent.  
Refer to Section 6.2 for the application of the devices to be used.

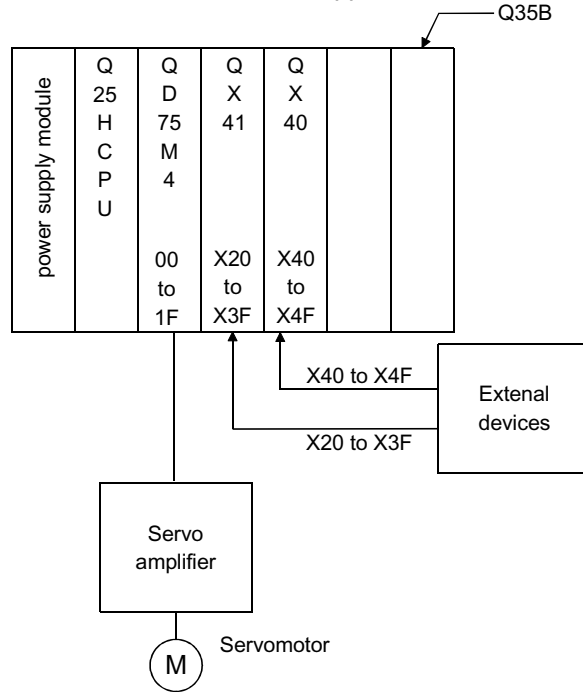

(5) Control unit

In the program, the unit of "0 (mm), 2 (degree)" is set for the basic parameter 1.


(6) Communication with QD75

There are two methods for communication with QD75 using the PLC program: a method using an "intelligent function device" and a method using a FROM/TO command.


In the PLC program in this chapter and subsequent, the program example using the "intelligent function device" is shown without using an FROM/TO command for communication with QD75.

When using the FROM/TO command for communication with QD75, change the circuit incorporating the "intelligent function device" as follows.


- (a) When the circuit uses the "intelligent function device" on the destination (D) side of a MOV command, change the command to a TO command.

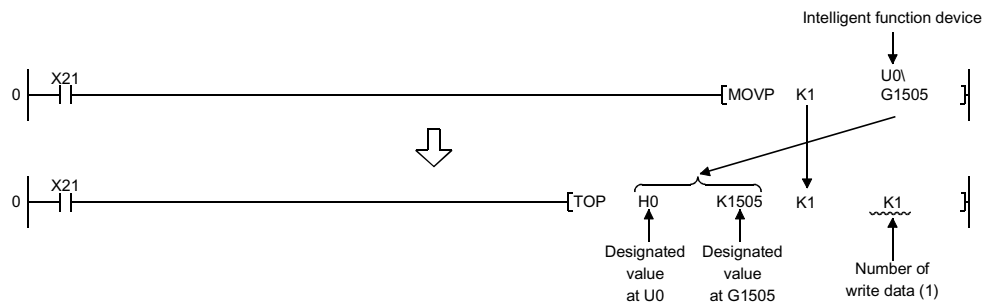


(b) When the circuit uses the "intelligent function device" on the source(s) side and the destination (D) side of a MOV command, change the command to a FROM command and a TO command.

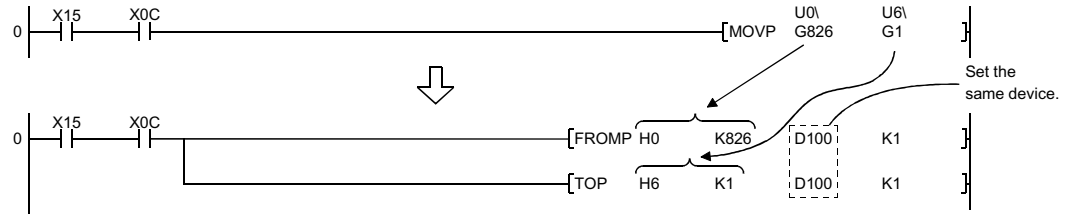

(c) When the circuit uses the "intelligent function device" for a COMPARISON command, change the command to a FROM command and a COMPARISON command.

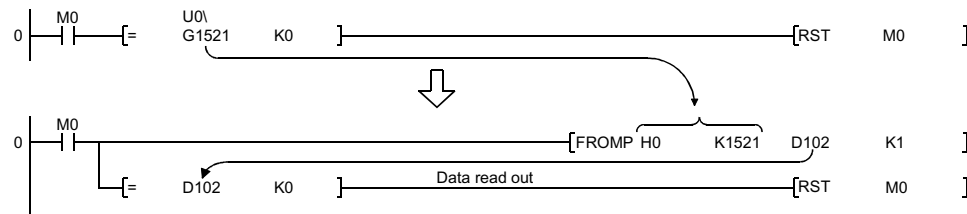

(d) When the circuit uses the "intelligent function device" for a WAND command, change the command to a FROM command and a WAND command.

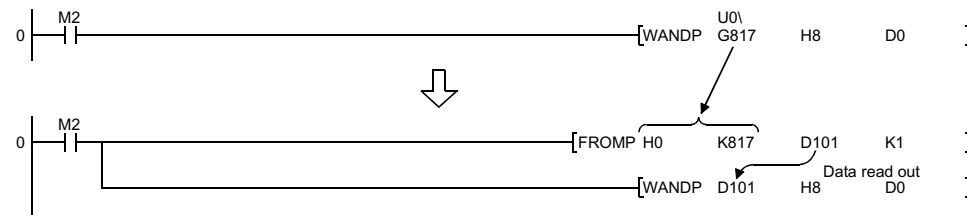

**REMARK**

Refer to QCPU (Q mode) User's Manual (Functions and Programs Basic Part) for the intelligent function devices.  
 Refer to QCPU (Q mode) Programming Manual (Common Commands Part) for detail commands used in those programs shown in this chapter and subsequent.

6.2 List of devices used

In the PLC programs shown in this chapter and subsequent, the application of the devices used are as follows.

The I/O numbers for QD75 indicate those when QD75 is mounted in the 0-slot of the main base.

If it is mounted in the slot other than the 0-slot of the main base, change the I/O number to that for the position where QD75 was installed.

In addition, change the external inputs, external outputs, internal relays, data registers, and timers according to the system used.

(1) Inputs/outputs, external inputs/external outputs, and internal relays of QD75

Device name	Device				Application	Details when ON	
	Axis 1	Axis 2	Axis 3	Axis 4			
Inputs/ outputs of QD75	Input	X0				QD75 READY signal	Preparation completed
		X1				Synchronization flag	QD75 buffer memory accessible
		X4	X5	X6	X7	M code ON signal	M code outputting
		X8	X9	XA	XB	Error detection signal	Error detected
		XC	XD	XE	XF	BUSY signal	BUSY (operating)
		X10	X11	X12	X13	Start complete signal	Start completed
		X14	X15	X16	X17	Positioning complete signal	Positioning completed
	Out- put	Y0				PLC READY signal	PLC CPU preparation completed
		Y1				All axis servo ON signal	All axis servo ON signal
		Y4	Y5	Y6	Y7	Axis stop signal	Requesting stop
		Y8	YA	YC	YE	Forward run JOG start signal	Starting forward run JOG
		Y9	YB	YD	YF	Reverse run JOG start signal	Starting reverse run JOG
		Y10	Y11	Y12	Y13	Positioning start signal	Requesting start
		Y14	Y15	Y16	Y17	Execution prohibition request	Execution prohibition
External input (command)	X20				OPR request OFF command	Commanding OPR request OFF	
	X21				External command valid command	Commanding external command valid setting	
	X22				External command invalid command	Commanding external command invalid	
	X23				Machine OPR command	Commanding machine OPR	
	X24				Fast OPR command	Commanding fast OPR	
	X25				Positioning start command	Commanding positioning start	
	X26	—			Speed-position switching operation command	Commanding speed-position switching operation	
	X27	—			Speed-position switching enable command	Commanding speed-position switching enable command	
	X28	—			Speed-position switching prohibit command	Commanding speed-position switching prohibit	
	X29	—			Movement amount change command	Commanding movement amount change	
	X2A	—			High-level positioning control start command	Commanding high-level positioning control start	
	X2B	—			Positioning start command (dedicated instruction)	Commanding positioning start	

Device name	Device				Application	Details when ON	
	Axis 1	Axis 2	Axis 3	Axis 4			
External input (command)	X2C	—	—	—	M code OFF command	Commanding M code OFF	
	X2D				JOG operation speed setting command	Commanding JOG operation speed setting	
	X2E				Forward run JOG/inching command	Commanding forward run JOG/inching operation	
	X2F				Reverse run JOG/inching command	Commanding reverse run JOG/inching operation	
	X30				Manual pulse generator operation enable command	Commanding manual pulse generator operation enable	
	X31				Manual pulse generator operation disable command	Commanding manual pulse generator operation disable	
	X32				Speed change command	Commanding speed change	
	X33				Override command	Commanding override	
	X34				Acceleration/deceleration time change command	Commanding acceleration/deceleration time change	
	X35				Acceleration/deceleration time change disable command	Commanding acceleration/deceleration time change disable	
	X36				Torque change command	Commanding torque change	
	X37				Step operation command	Commanding step operation	
	X38				Skip operation command	Commanding skip operation	
	X39				Teaching command	Commanding teaching	
	X3A				Continuous operation interrupt command	Commanding continuous operation interrupt command	
	X3B				Restart command	Commanding restart	
	X3C				Parameter initialization command	Commanding parameter initialization	
	X3D				Flash ROM write command	Commanding flash ROM write	
	X3E				Error reset command	Commanding error reset	
	X3F				Stop command	Commanding stop	
	X40				Position-speed switching operation command	Position-speed switching operation command	
	X41				Position-speed switching enable command	Position-speed switching enable command	
	X42				Position-speed switching prohibit command	Position-speed switching prohibit command	
	X43				Speed change command	Speed change command	
	X44				Inching movement amount setting command	Inching movement amount setting command	
	X45				Target position change command	Target position change command	
	X46				Step start information command	Step start information command	
	X47				Positioning start command k10	Positioning start command k10	
	X48				Override initialization value command	Override initialization value command	
	X49				Servo parameter read	Servo parameter read	
	X4A				Servo parameter write	Servo parameter write	
	X4B				PLC READY ON	PLC READY ON	
X4D	For unit (degree)	For unit (degree)					
X4E	Positioning start command (Y start)	Positioning start command being given					
X4F	All axis servo ON command	All axis servo ON command					

Device name	Device				Application	Details when ON			
	Axis 1	Axis 2	Axis 3	Axis 4					
Internal relay	M0	—	—	—	OPR request OFF command	Commanding OPR request OFF			
	M1				OPR request OFF command pulse	OPR request OFF commanded			
	M2				OPR request OFF command storage	OPR request OFF command held			
	M3				Fast OPR command	Commanding fast OPR			
	M4				Fast OPR command storage	Fast OPR command held			
	M5				Positioning start command pulse	Positioning start commanded			
	M6				Positioning start command storage	Positioning start command held			
	M7				In-JOG/Inching operation flag	In-JOG/Inching operation flag			
	M8				Manual pulse generator operation enable command	Commanding manual pulse generator operation enable			
	M9				Manual pulse generator operating flag	Manual pulse generator operating flag			
	M10				Manual pulse generator operation disable command	Commanding manual pulse generator operation disable			
	M11				Speed change command pulse	Speed change commanded			
	M12				Speed change command storage	Speed change command held			
	M13				Override command	Requesting override			
	M14				Acceleration/deceleration time change command	Requesting acceleration/deceleration time change			
	M15				Torque change command	Requesting torque change			
	M16				Step operation command pulse	Step operation commanded			
	M17				Skip command pulse	Skip commanded			
	M18				Skip command storage	Skip command held			
	M19				Teaching command pulse	Teaching commanded			
	M20				Teaching command storage	Teaching command held			
	M21				Continuous operation interrupt command	Requesting continuous operation interrupt			
	M22				Restart command	Requesting restart			
	M23				Restart command storage	Restart command held			
					M24	Parameter initialization command pulse	Parameter initialization commanded		
					M25	Parameter initialization command storage	Parameter initialization command held		
					M26	Flash ROM write command pulse	Flash ROM write commanded		
					M27	Flash ROM write command storage	Flash ROM write command held		
					M28	—	—	Error reset	Error reset completed
					M29			Stop command pulse	Stop commanded
					M30			Target position change command pulse	Target position change commanded
					M31			Target position change command storage	Target position change command held
					M32			PSTRT1 instruction complete device	PSTRT1 instruction completed
	M33	PSTRT1 instruction error complete device	PSTRT1 instruction error completed						



Device name	Device				Application	Details when ON
	Axis 1	Axis 2	Axis 3	Axis 4		
Internal relay	M34	—			TEACH1 instruction complete device	TEACH1 instruction completed
	M35				TEACH1 instruction error complete device	TEACH1 instruction error completed
	M36				PINIT instruction complete device	PINIT instruction completed
	M37				PINIT instruction error complete device	PINIT instruction error completed
	M38				PFWRT instruction complete device	PFWRT instruction completed
	M39				PFWRT instruction error complete device	PFWRT instruction error completed
	M40				Override initialization value	Override initialization value
	M41				Servo parameter read	Servo parameter read
	M42				Unused	—
	M50				Parameter setting complete device	Parameter setting completed
	M54				ERRD complete device	ERRD completed
	M56				ERRCLR complete device	ERRCLR completed

(2) Data registers and timers

Device name	Device				Application	Details of storage
	Axis 1	Axis 2	Axis 3	Axis 4		
Data register	D0	—			OPR request flag	( [Md.31] Status: b3)
	D1				Speed (low-order 16 bits)	( [Cd.25] Position-speed switching control speed change resistor)
	D2				Speed (high-order 16 bits)	
	D3				Movement amount (low-order 16 bits)	( [Cd.23] Speed-position switching control movement amount change resistor)
	D4				Movement amount (high-order 16 bits)	
	D5				Inching movement amount	( [Cd.16] Inching movement amount)
	D6				JOG operation speed (low-order 16 bits)	( [Cd.17] JOG operation speed)
	D7				JOG operation speed (high-order 16 bits)	
	D8				Manual pulse generator 1 pulse input magnification (low-order)	( [Cd.20] Manual pulse generator 1 pulse input magnification)
	D9				Manual pulse generator 1 pulse input magnification (high-order)	
	D10				Manual pulse generator operation enable	( [Cd.21] Manual pulse generator enable flag)
	D11				Speed change value (low-order 16 bits)	( [Cd.14] New speed value)
	D12				Speed change value (high-order 16 bits)	
	D13				Speed change request	( [Cd.15] Speed change request)
	D14				Override value	( [Cd.13] Positioning operation speed override value)

Device name	Device				Application	Details of storage
	Axis 1	Axis 2	Axis 3	Axis 4		
Data register	D15	—	—	—	Acceleration time setting (low-order 16 bits)	( [Cd.10] New acceleration time value)
	D16				Acceleration time setting (high-order 16 bits)	
	D17				Deceleration time setting (low-order 16 bits)	( [Cd.11] New deceleration time value)
	D18				Deceleration time setting (high-order 16 bits)	
	D19				Acceleration/deceleration time change enable	( [Cd.12] Acceleration/deceleration time change enable/disable selection in speed change)
	D20				Step valid flag	( [Cd.35] Step valid flag)
	D21				Step mode	( [Cd.34] Step mode)
	D22				Step start information	—
	D23				Target position (low-order 16 bits)	( [Cd.27] New target position value (address))
	D24				Target position (high-order 16 bits)	
	D25				Target speed (low-order 16 bits)	( [Cd.28] New target position value (speed))
	D26				Target speed (high-order 16 bits)	
	D27				Target position change request	( [Cd.29] New target position change value flag)
	D28				Unused	—
	D29				Unused	—
	D30				PSTRT1 instruction control data	—
	D31				Completion status	—
	D32				Start number	—
	D33				TEACH1 instruction control data	—
	D34				Completion status	—
	D35				Teaching data	—
	D36				Positioning data No.	—
	D37				PINIT instruction control data	—
	D38				Completion status	—
	D39				PFWRT instruction control data	—
	D40				Completion status	—
	D50				Unit setting	( [Pr.1] Unit setting)
D51	Unit magnification	( [Pr.4] Unit magnification)				

Device name	Device				Application	Details of storage	
	Axis 1	Axis 2	Axis 3	Axis 4			
Data register	D52	—	—	—	No. of pulses per rotation (low-order 16 bits)	( [Pr.2] No. of pulses per rotation)	
	D53				No. of pulses per rotation (high-order 16 bits)		
	D54				Movement amount per rotation (low-order 16 bits)	( [Pr.3] Movement amount per rotation)	
	D55				Movement amount per rotation (high-order 16 bits)		
	D56				Bias speed at start (low-order 16 bits)	( [Pr.7] Bias speed at start)	
	D57				Bias speed at start (high-order 16 bits)		
	D68				Block start data (Block 0)	Point 1 (shape, start No.)	( [Da.11] Shape)
	D69					Point 2 (shape, start No.)	
	D70					Point 3 (shape, start No.)	
	D71					Point 4 (shape, start No.)	
	D72					Point 5 (shape, start No.)	
	D73					Point 1 (special start instruction)	( [Da.13] Special start instruction)
	D74					Point 2 (special start instruction)	( [Da.14] Parameter)
	D75					Point 3 (special start instruction)	
	D76					Point 4 (special start instruction)	
	D77					Point 5 (special start instruction)	
	D78				Torque change value	—	
	D79				Error code	( [Md.23] Bias speed at start)	
	D80				Servo series	( [Pr.101] Bias speed at start)	
	D81				Absolute position system valid/invalid	( [Pr.101] Bias speed at start)	
	D82				Motor capacity	( [Pr.104] Bias speed at start)	
	D85				Return home position method	( [Pr.43] Bias speed at start)	
	D100				Positioning identifier	Data No. 1	
	D101				M code	( [Da.1] Operation pattern)	
	D102				Dwell time	( [Da.2] Control system)	
	D103				Unused	( [Da.3] Acceleration time No.)	
	D104				Command speed (low-order 16 bits)	( [Da.4] Deceleration time No.)	
	D105				Command speed (high-order 16 bits)	( [Da.5] Axis to be interpolated)	
	D106				Positioning address (low-order 16 bits)	( [Da.6] Positioning address/movement amount)	

Device name	Device				Application	Details of storage
	Axis 1	Axis 2	Axis 3	Axis 4		
Data register	D107				Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)
	D108				Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)
	D109				Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)
	D110				Positioning identifier	Data No.2
	D111				M code	( Da.1 Operation pattern)
	D112				Dwell time	( Da.2 Control system)
	D113				Unused	( Da.3 Acceleration time No.)
	D114				Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)
	D115				Command speed (high-order 16 bits)	( Da.5 Axis to be interpolated)
	D116				Positioning address (low-order 16 bits)	( Da.6 Positioning address/ movement amount)
	D117				Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)
	D118				Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)
	D119				Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)
	D120				Positioning identifier	Data No.3
	D121				M code	( Da.1 Operation pattern)
	D122				Dwell time	( Da.2 Control system)
	D123				Unused	( Da.3 Acceleration time No.)
	D124				Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)
	D125				Command speed (high-order 16 bits)	( Da.5 Axis to be interpolated)
	D126				Positioning address (low-order 16 bits)	( Da.6 Positioning address/ movement amount)
	D127				Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)
	D128				Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)
	D129				Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)
	D130				Positioning identifier	Data No.4
	D131				M code	( Da.1 Operation pattern)
	D132				Dwell time	( Da.2 Control system)
	D133				Unused	( Da.3 Acceleration time No.)
	D134				Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)
	D135				Command speed (high-order 16 bits)	( Da.5 Axis to be interpolated)
	D136				Positioning address (low-order 16 bits)	( Da.6 Positioning address/ movement amount)
D137				Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)	
D138				Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)	
D139				Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)	
D140				Positioning identifier	Data No.5	
D141				M code	( Da.1 Operation pattern)	
D142				Dwell time	( Da.2 Control system)	
D143				Unused	( Da.3 Acceleration time No.)	

Device name	Device				Application	Details of storage
	Axis 1	Axis 2	Axis 3	Axis 4		
Data register	D144	—	—	—	Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)
	D145				Command speed (low-order 16 bits)	( Da.5 Axis to be interpolated)
	D146				Positioning address (low-order 16 bits)	( Da.7 Circular interpolation address)
	D147				Positioning address (high-order 16 bits)	( Da.8 Command speed)
	D148				Circular interpolation address (low-order 16 bits)	( Da.9 Dwell time)
	D149				Circular interpolation address (high-order 16 bits)	( Da.10 M code)
	D150				Positioning identifier	Data No.6
	D151				M code	( Da.1 Operation pattern)
	D152				Dwell time	( Da.2 Control system)
	D153				Unused	( Da.3 Acceleration time No.)
	D154				Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)
	D155				Command speed (high-order 16 bits)	( Da.5 Axis to be interpolated)
	D156				Positioning address (low-order 16 bits)	( Da.6 Positioning address/ movement amount)
	D157				Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)
	D158				Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)
	D159				Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)
	D190				Positioning identifier	Data No10
	D191				M code	( Da.1 Operation pattern)
	D192				Dwell time	( Da.2 Control system)
	D193				Unused	( Da.3 Acceleration time No.)
	D194				Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)
	D195				Command speed (high-order 16 bits)	( Da.5 Axis to be interpolated)
	D196				Positioning address (low-order 16 bits)	( Da.6 Positioning address/ movement amount)
	D197				Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)
	D198				Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)
	D199				Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)
	D200				Positioning identifier	Data No11
	D201				M code	( Da.1 Operation pattern)
	D202				Dwell time	( Da.2 Control system)
	D203				Unused	( Da.3 Acceleration time No.)
D204	Command speed (low-order 16 bits)	( Da.4 Deceleration time No.)				
D205	Command speed (high-order 16 bits)	( Da.5 Axis to be interpolated)				
D206	Positioning address (low-order 16 bits)	( Da.6 Positioning address/ movement amount)				
D207	Positioning address (high-order 16 bits)	( Da.7 Circular interpolation address)				
D208	Circular interpolation address (low-order 16 bits)	( Da.8 Command speed)				
D209	Circular interpolation address (high-order 16 bits)	( Da.9 Dwell time) ( Da.10 M code)				

Device name	Device				Application	Details of storage
	Axis 1	Axis 2	Axis 3	Axis 4		
Data register	D240	—			Positioning identifier	Data No.15
	D241				M code	(Da.1) Operation pattern)
	D242				Dwell time	(Da.2) Control system)
	D243				Unused	(Da.3) Acceleration time No.)
	D244				Command speed (low-order 16 bits)	(Da.4) Deceleration time No.)
	D245				Command speed (high-order 16 bits)	(Da.5) Axis to be interpolated)
	D246				Positioning address (low-order 16 bits)	(Da.6) Positioning address/ movement amount)
	D247				Positioning address (high-order 16 bits)	
	D248				Circular interpolation address (low-order 16 bits)	(Da.7) Circular interpolation address)
	D249				Circular interpolation address (high-order 16 bits)	(Da.8) Command speed)
						(Da.9) Dwell time)
						(Da.10) M code)
SD1026		Day, hour data	—			
SD1026		Minute, second data	—			
Timer	T0	—		PLC READY signal OFF confirmation	PLC READY signal OFF	
	T1			PLC READY signal OFF confirmation		


Device name	Device	Application	Details of storage
Code	U0\G806	Error code	( [Md.23] Axis error No.)
	U0\G809	Axis operation status	( [Md.26] Axis operation status)
	U0\G817	Status	( [Md.31] Status)
	U0\G1500	Positioning start No.	( [Cd.3] Positioning start No.)
	U0\G1502	Axis error reset	( [Cd.5] Axis error reset)
	U0\G1503	Restart command	( [Cd.6] Restart command)
	U0\G1504	M code OFF request (Buffer memory)	( [Cd.7] M code OFF request)
	U0\G1505	External command valid	( [Cd.8] External command valid)
	U0\G1513	Positioning operation speed override	( [Cd.13] Positioning operation speed override)
	U0\G1516	Speed change request	( [Cd.15] Speed change request)
	U0\G1517	Inching movement amount	( [Cd.16] Inching movement amount)
	U0\G1520	Interruption request during continuous operation	( [Cd.18] Interruption request during continuous operation)
	U0\G1521	OPR request flag OFF request	( [Cd.19] OPR request flag OFF request)
	U0\G1524	Manual pulse generator enable flag	( [Cd.21] Manual pulse generator enable flag)
	U0\G1526	Speed-position switching control movement amount change register	( [Cd.23] Speed-position switching control movement amount change register)
	U0\G1528	Speed-position switching control enable flag	( [Cd.24] Speed-position switching control enable flag)
	U0\G1530	Position-speed switching control speed change register	( [Cd.25] Position-speed switching control speed change register)
	U0\G1532	Position-speed switching control enable flag	( [Cd.26] Position-speed switching control enable flag)
	U0\G1538	Target position change request flag	( [Cd.29] Target position change request flag)
	U0\G1545	Step valid flag	( [Cd.35] Step valid flag)
U0\G1547	Skip command	( [Cd.37] Skip command)	

### 6.3 Creating a program

The "positioning control operation program" actually used is explained in this chapter. The functions and programs explained in Section 2 are assembled into the "positioning control operation program" explained here. (To monitor the control, add the required monitor program that matches the system. Refer to Section 5.6 "List of monitor data" for details on the monitor items.)

#### 6.3.1 General configuration of program


The general configuration of the "positioning control operation program" is shown below.

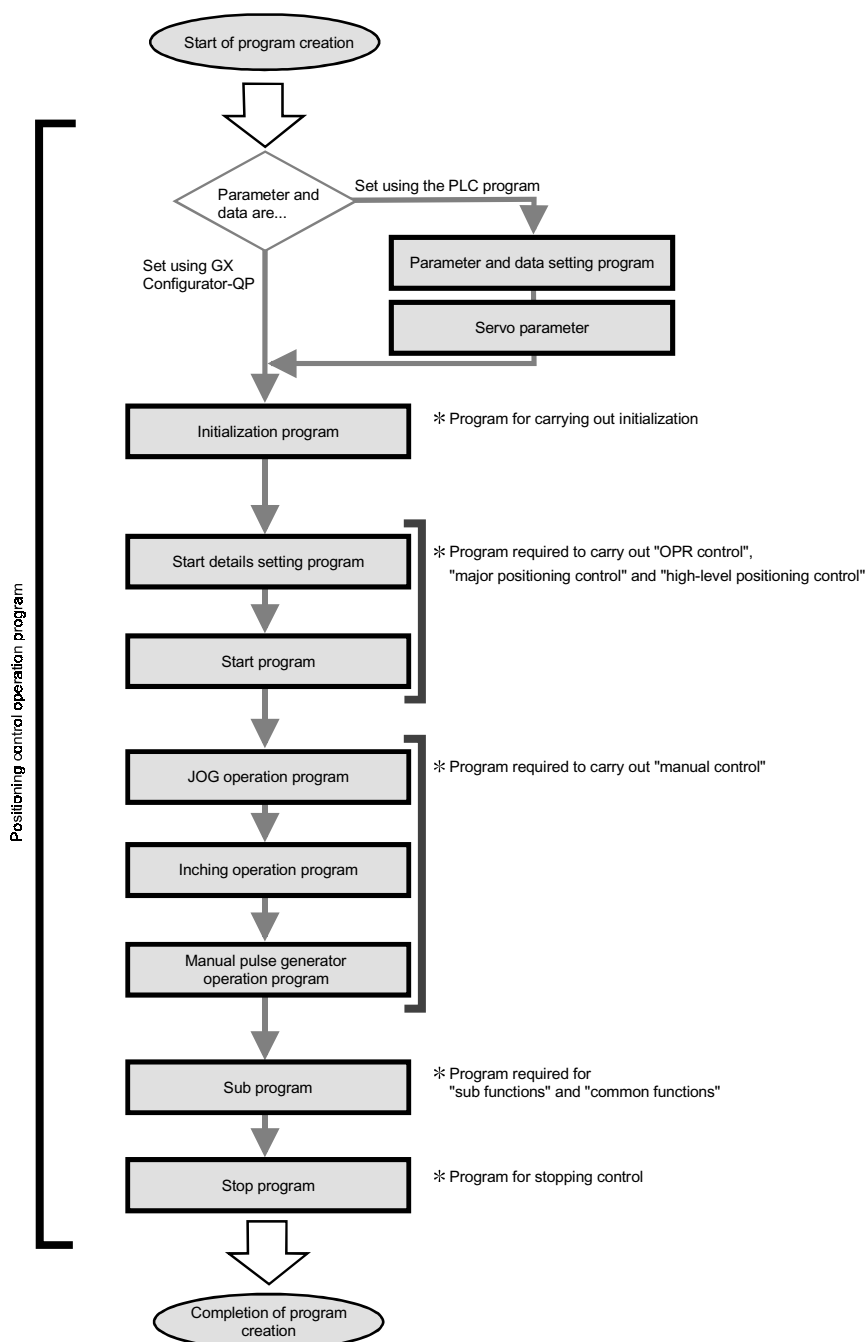





6.3.2 Positioning control operation program

The various programs that configure the "positioning control operation program" are shown below. When creating the program, refer to the explanation of each program and Section 6.4 "Positioning program examples", and create an operation program that matches the positioning system. (Numbers are assigned to the following programs. Configuring the program in the order of these numbers is recommended.)

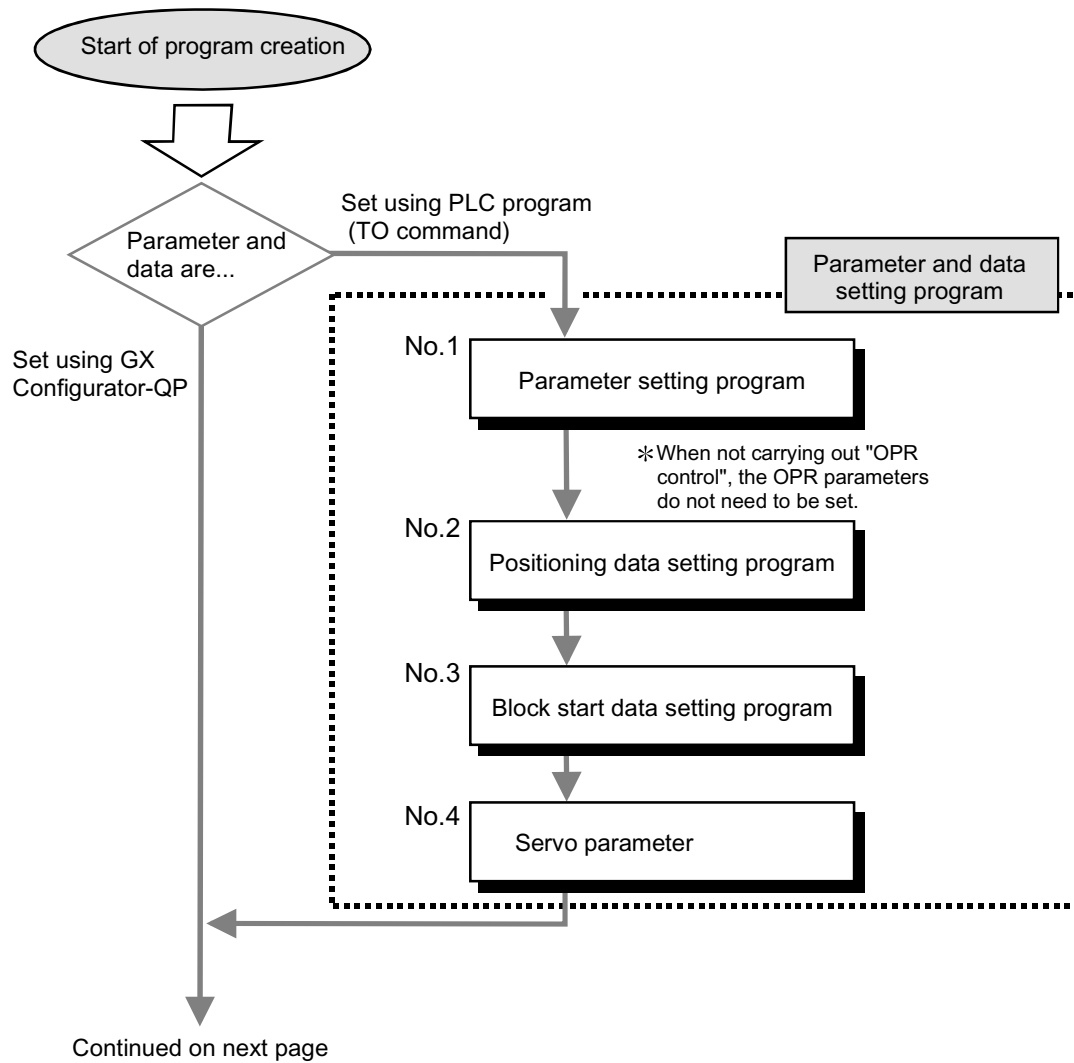

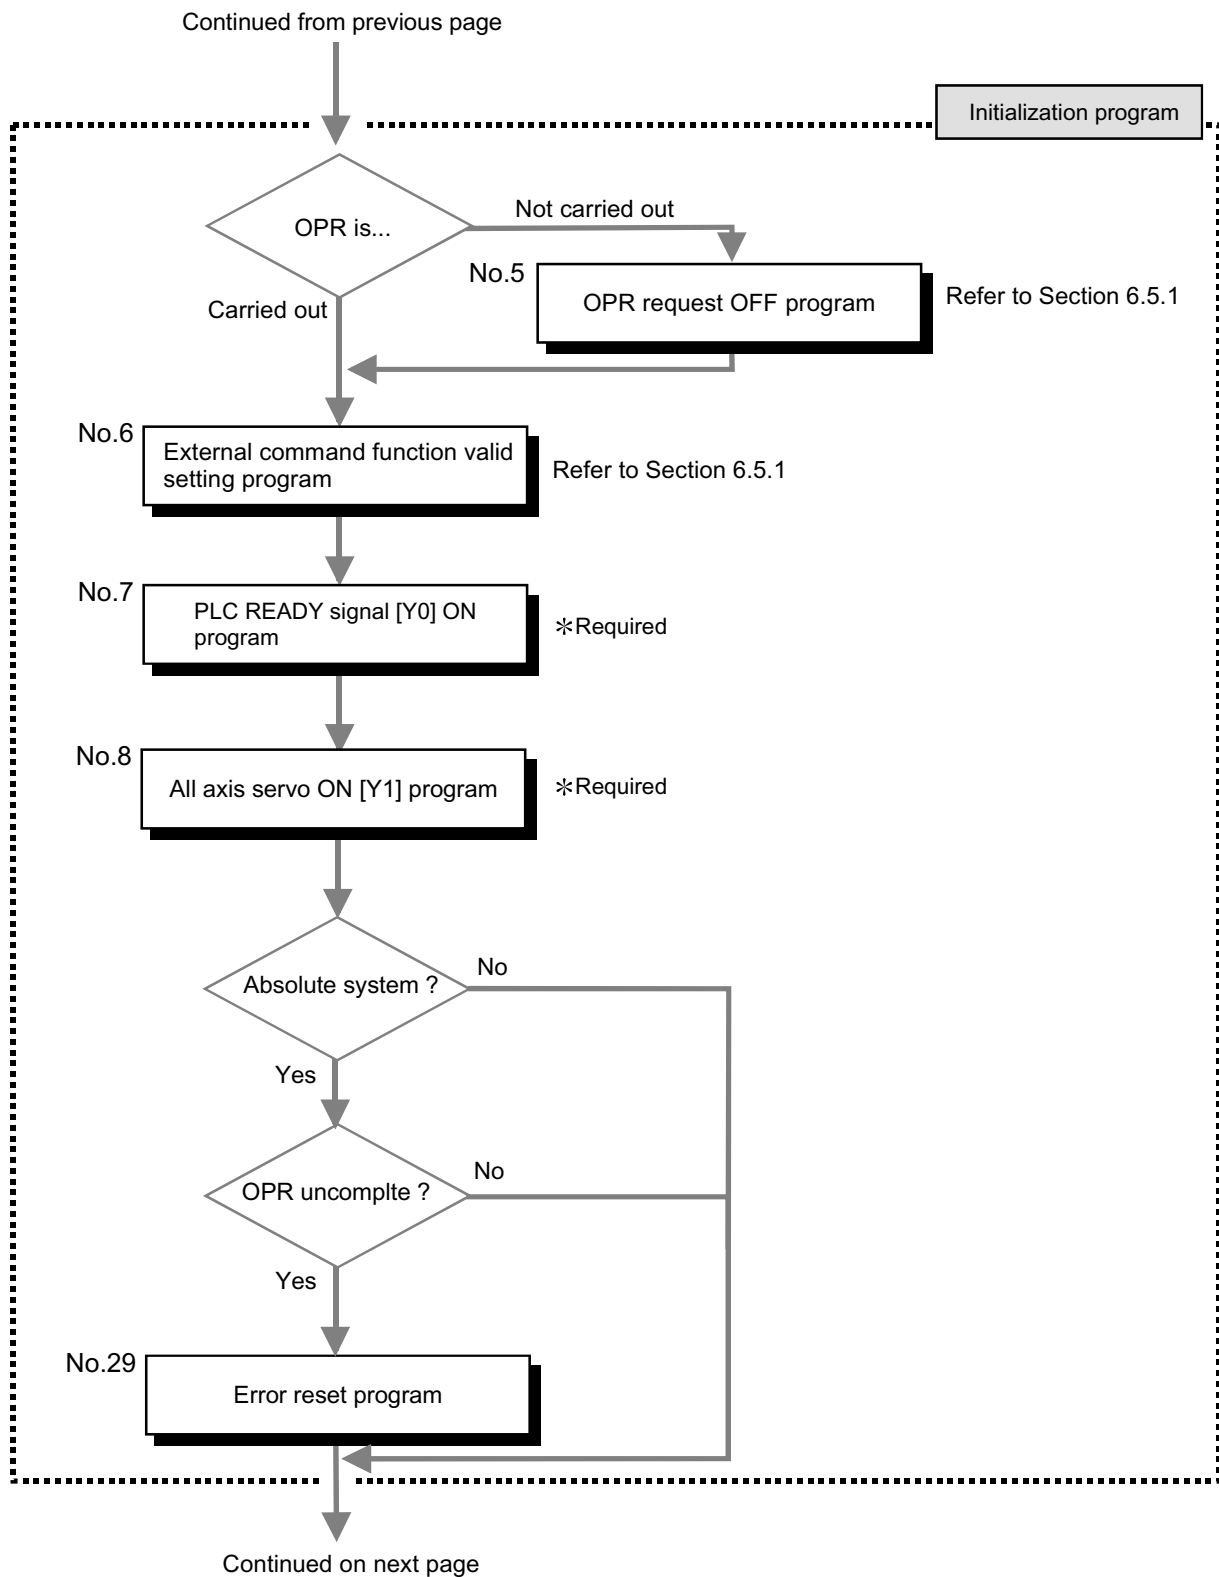


Continued from previous page

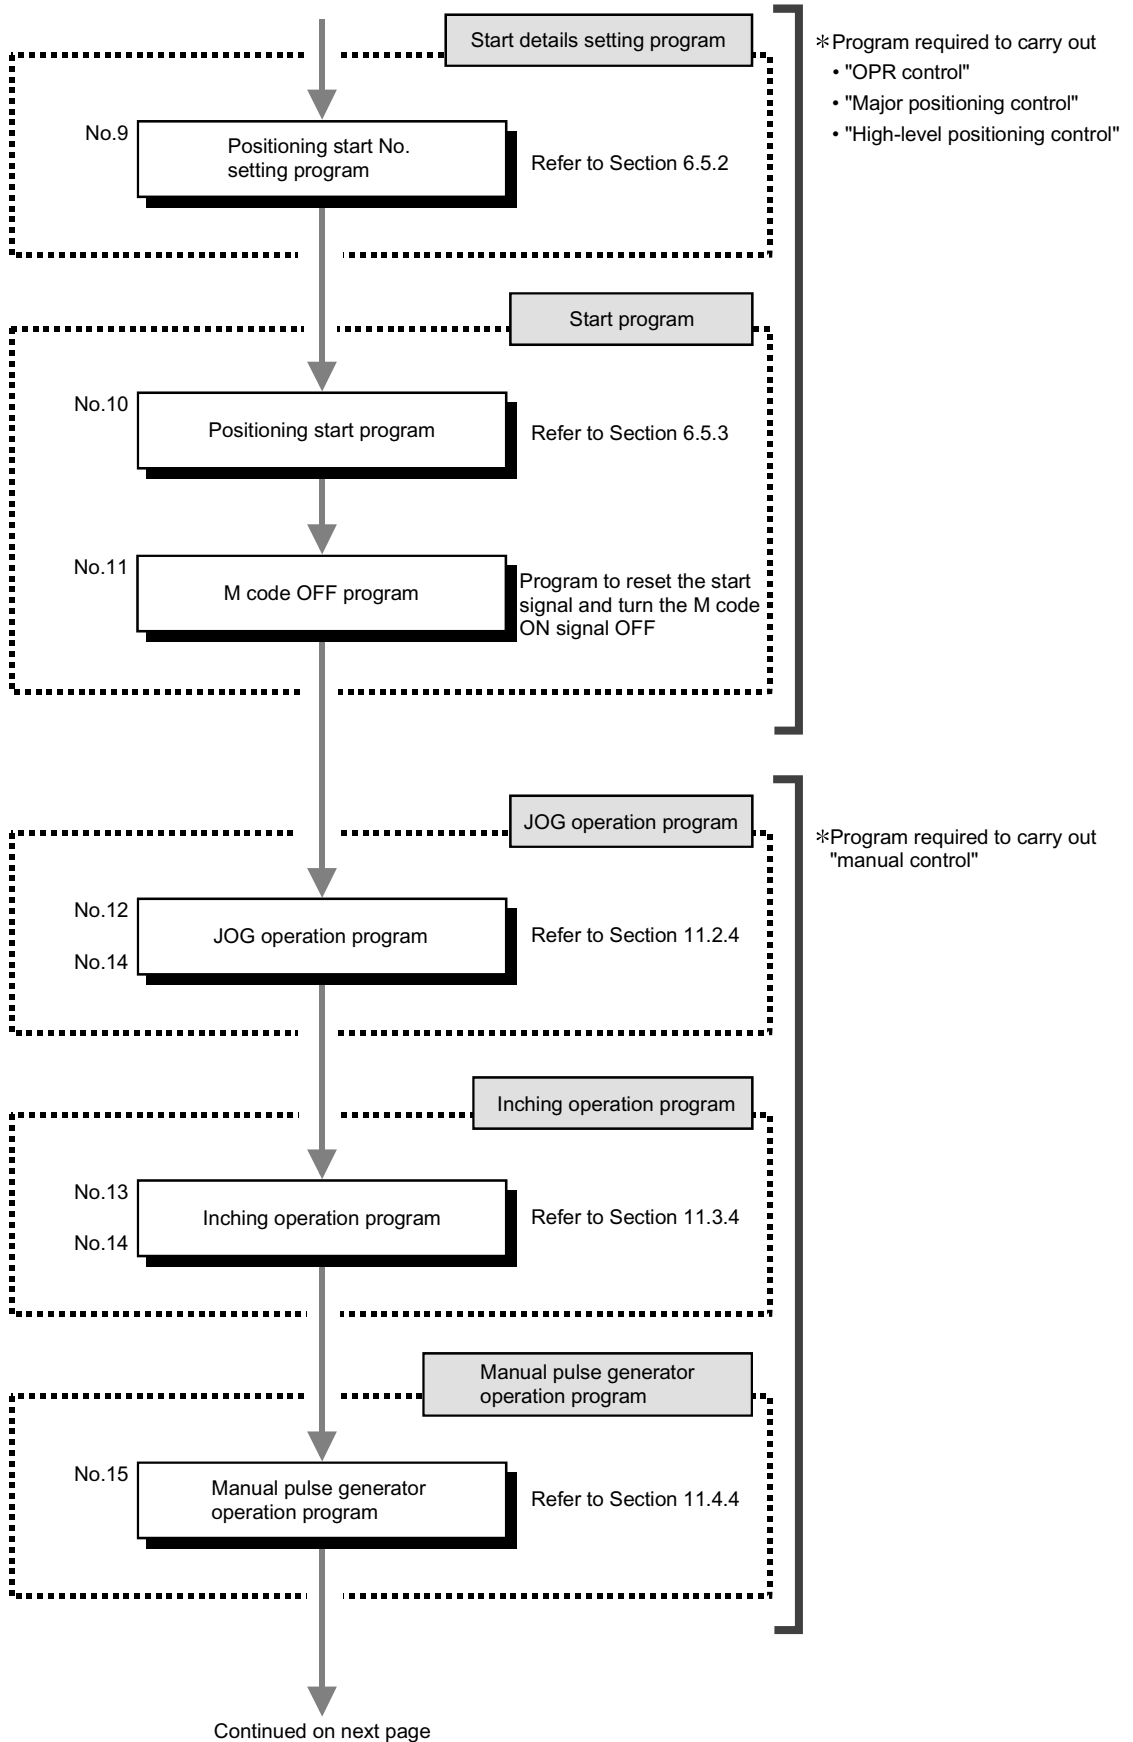

\*Program required to carry out  
 • "OPR control"  
 • "Major positioning control"  
 • "High-level positioning control"

\*Program required to carry out  
 "manual control"

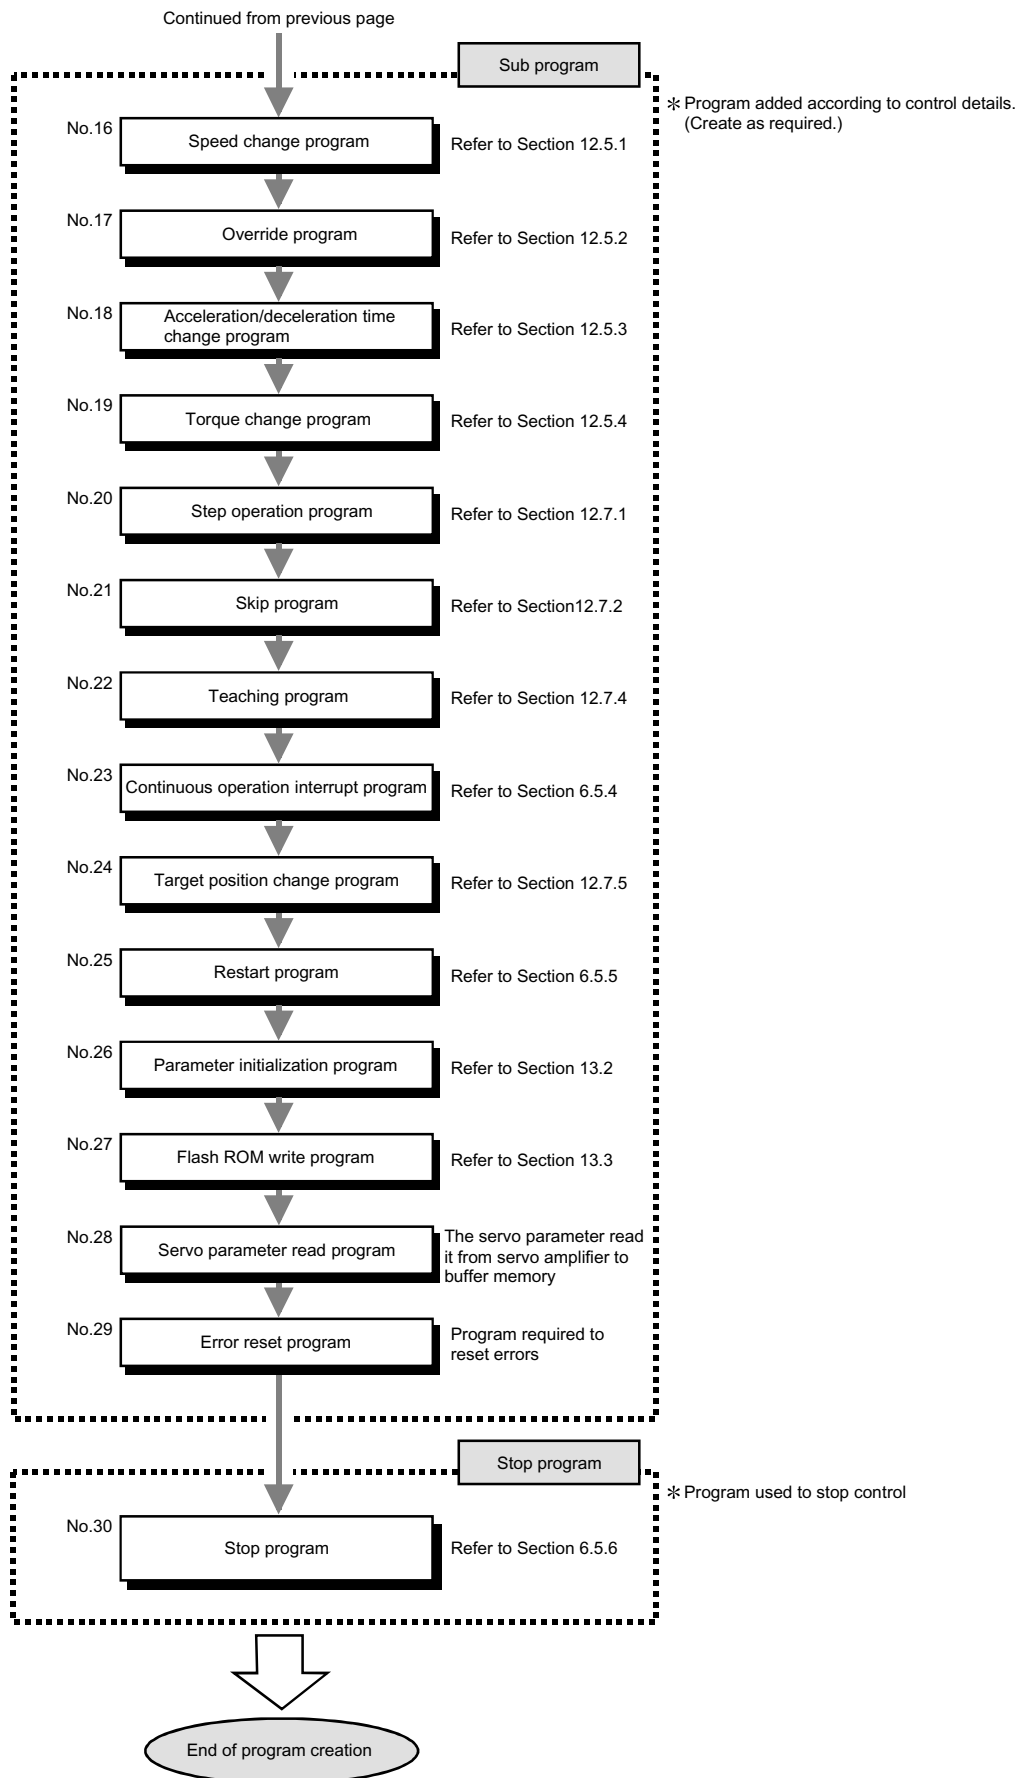


6.4 Positioning program examples


An example of the "Axis 1" positioning program is given in this section.

--- [No. 1] to [No. 3] parameter and data setting program ---


\*When setting the parameters or data with the PLC program, set them in the QD75 using the TO command from the PLC CPU. (Carry out the settings while the PLC READY signal [Y0] is OFF.)


\*When setting the parameters or data with GX Configurator-QP, the [No. 1] to [No. 3] program is not necessary.

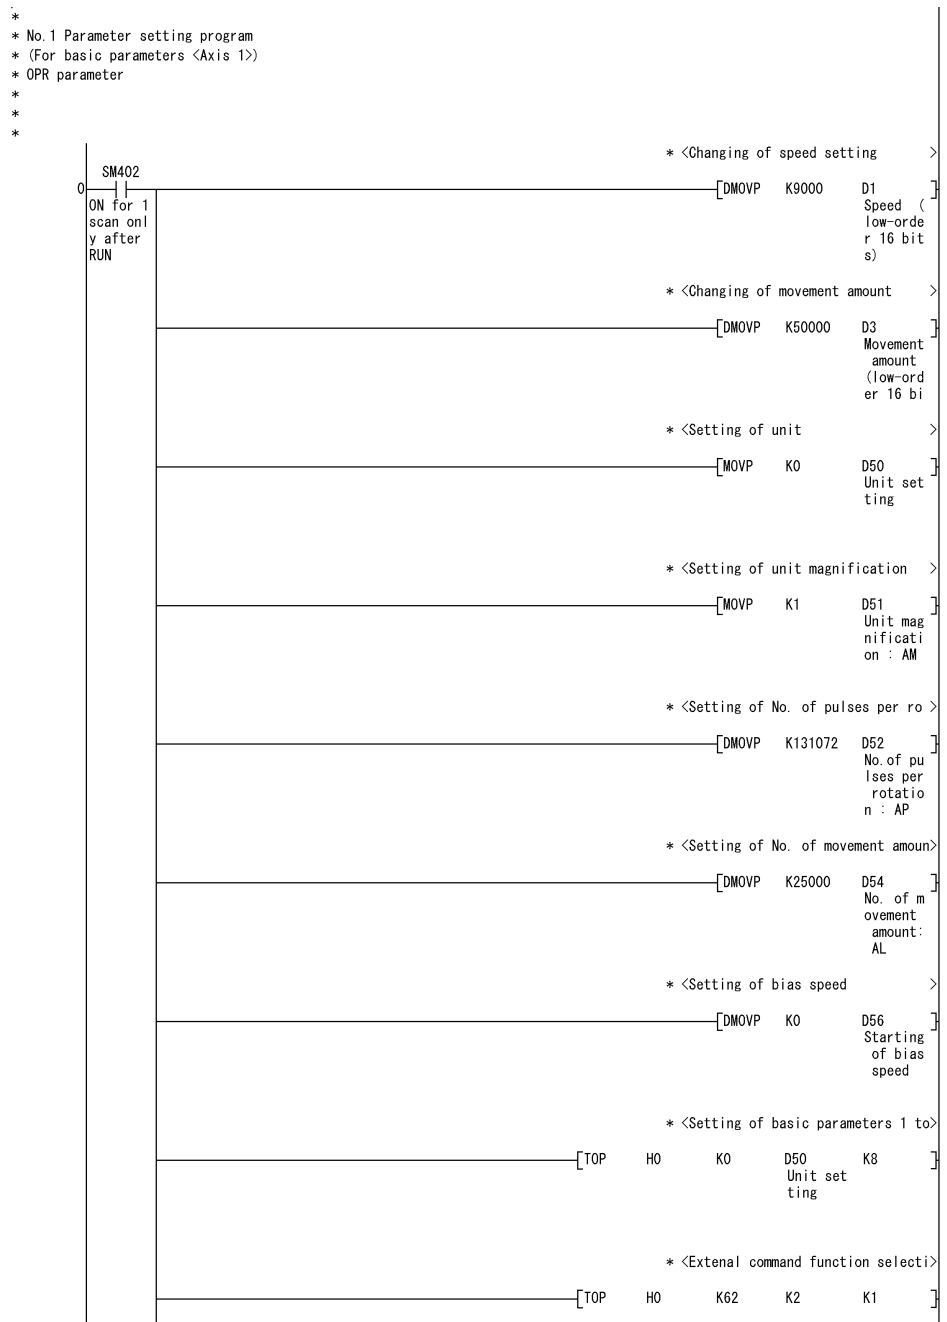


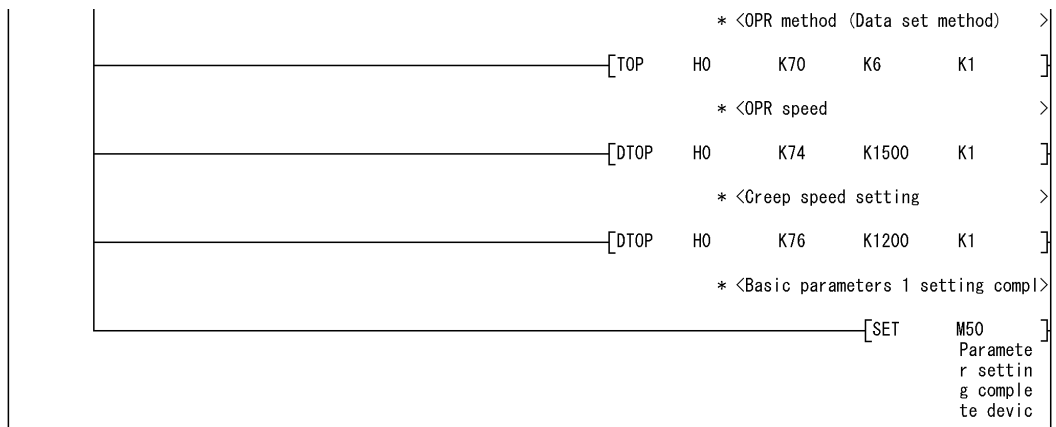


\* Unit "Degree" setting program  
 \* <For axis 1>  
 \* Speed-position change control (ABS mode) execution and etc.  
 \* <X4D turns ON before startup>  
 \*

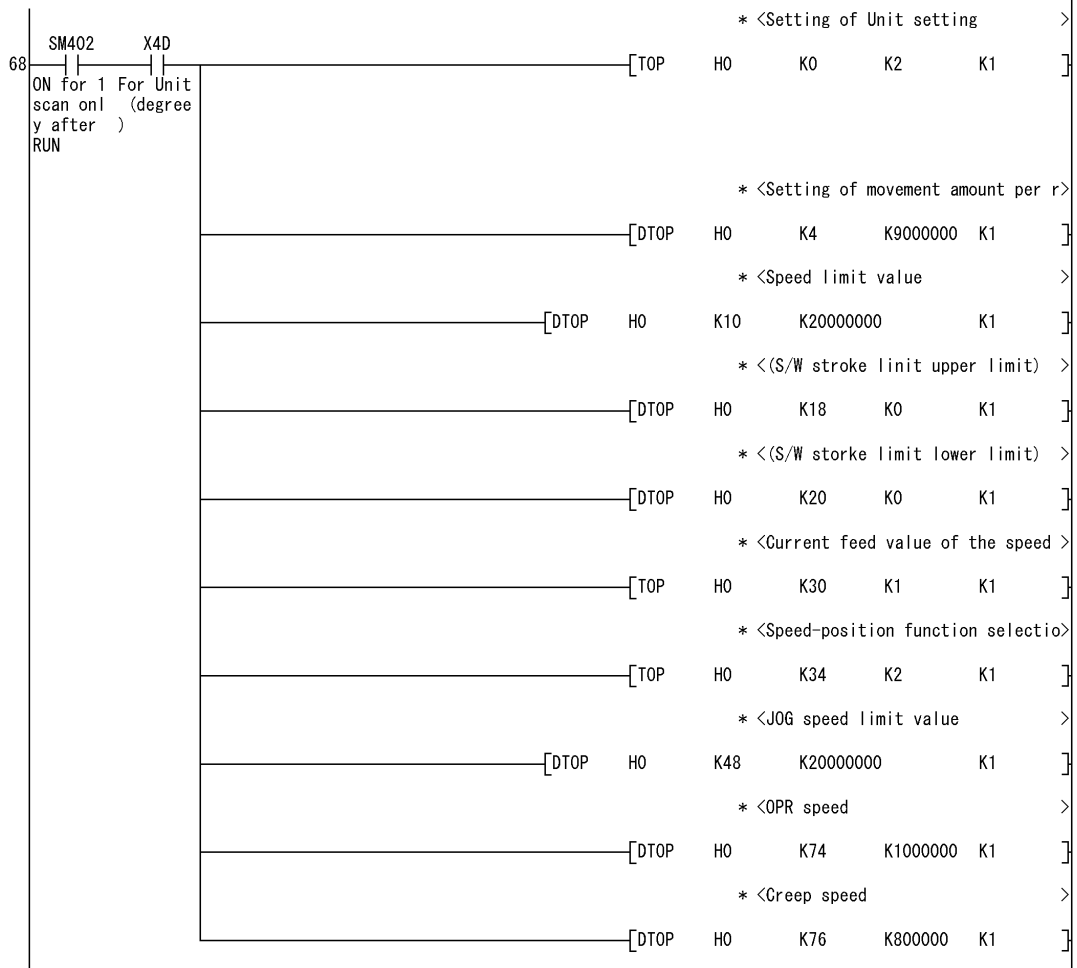


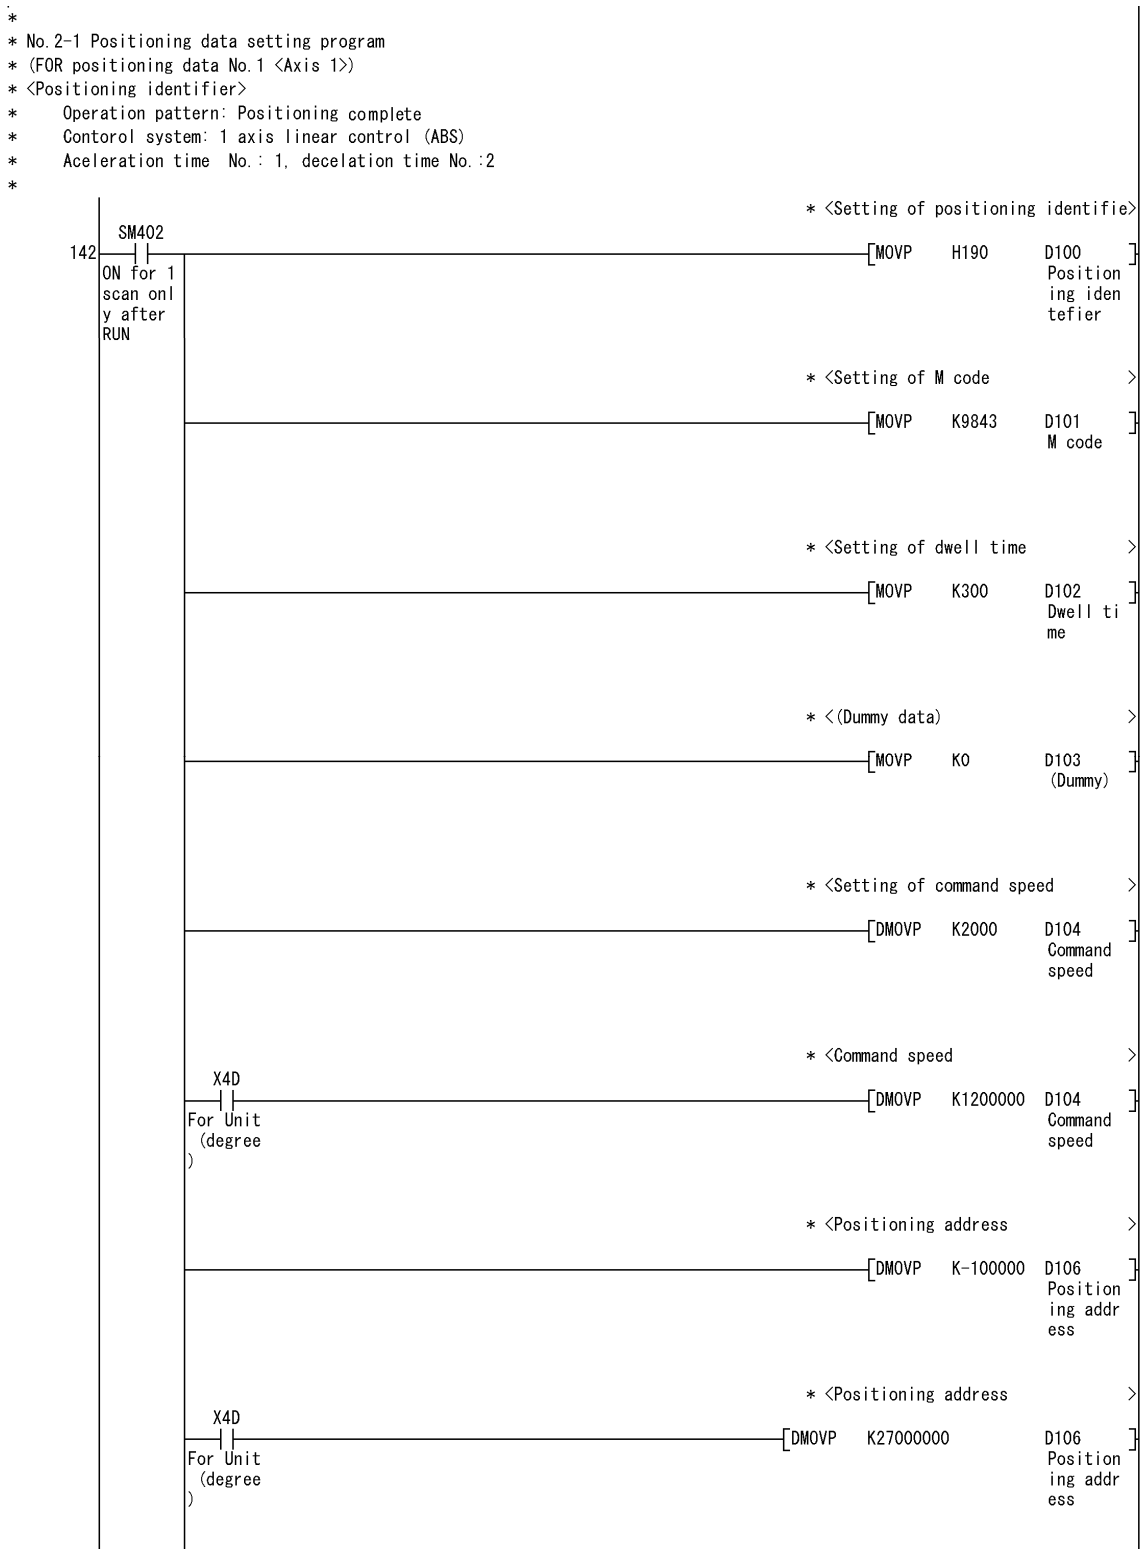


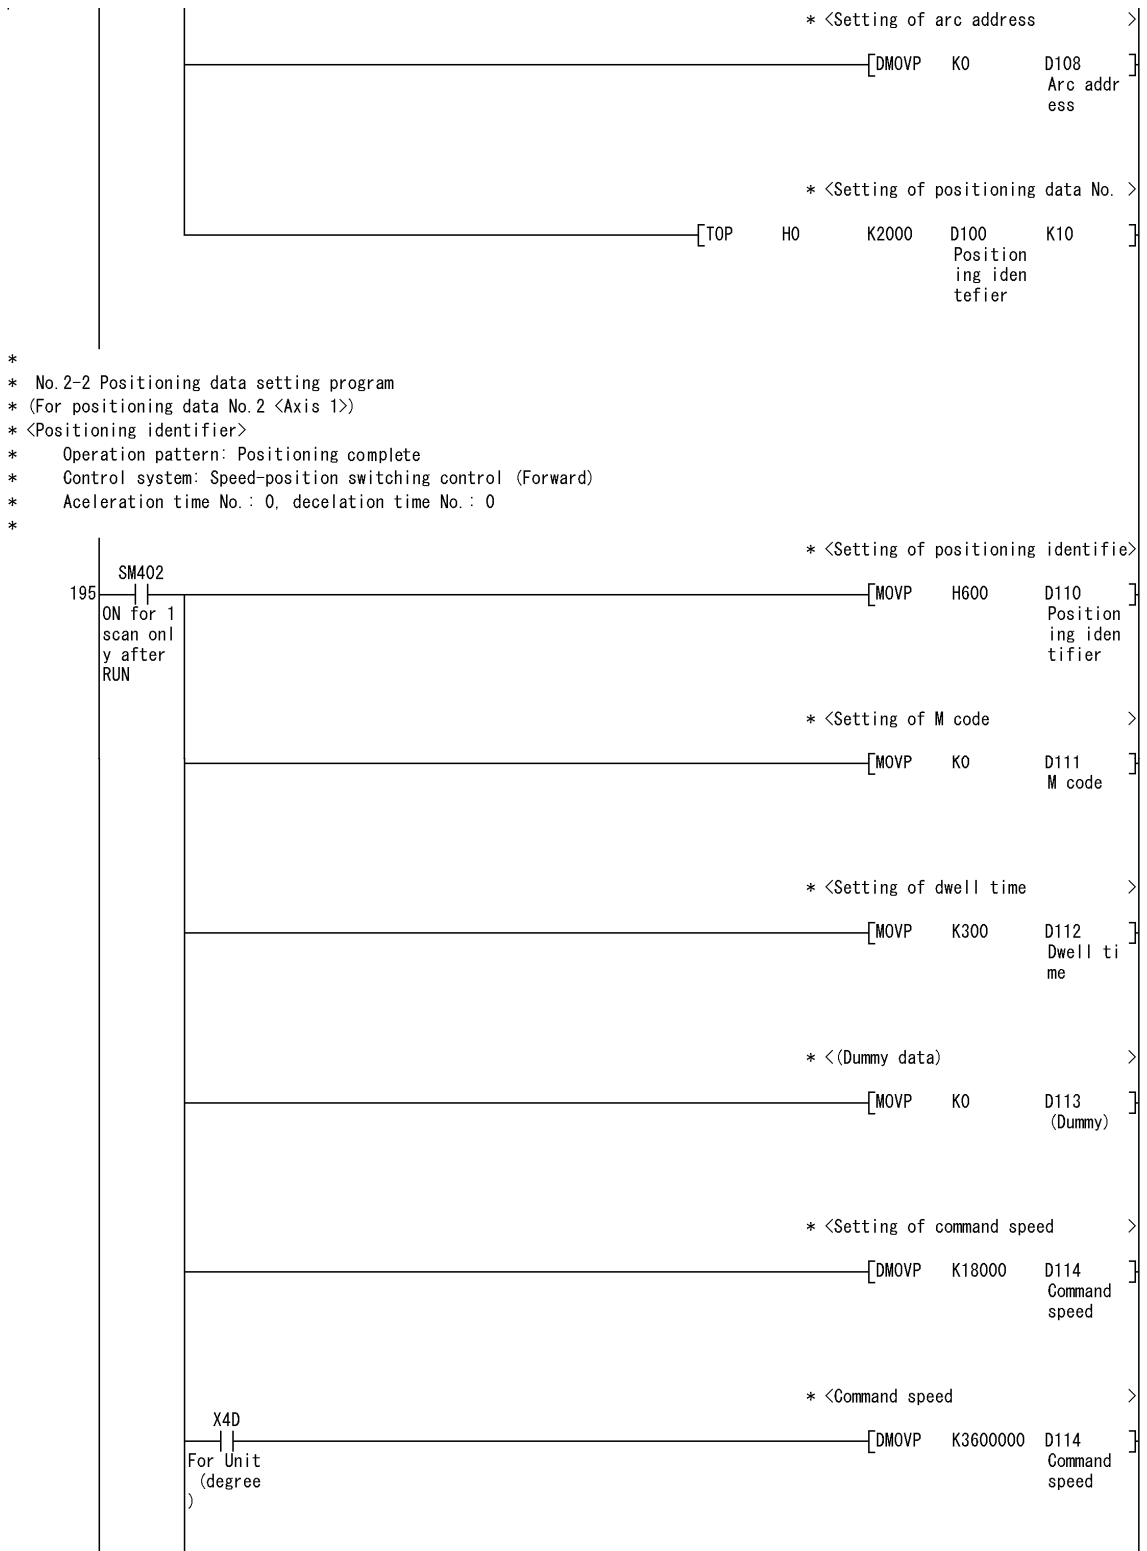





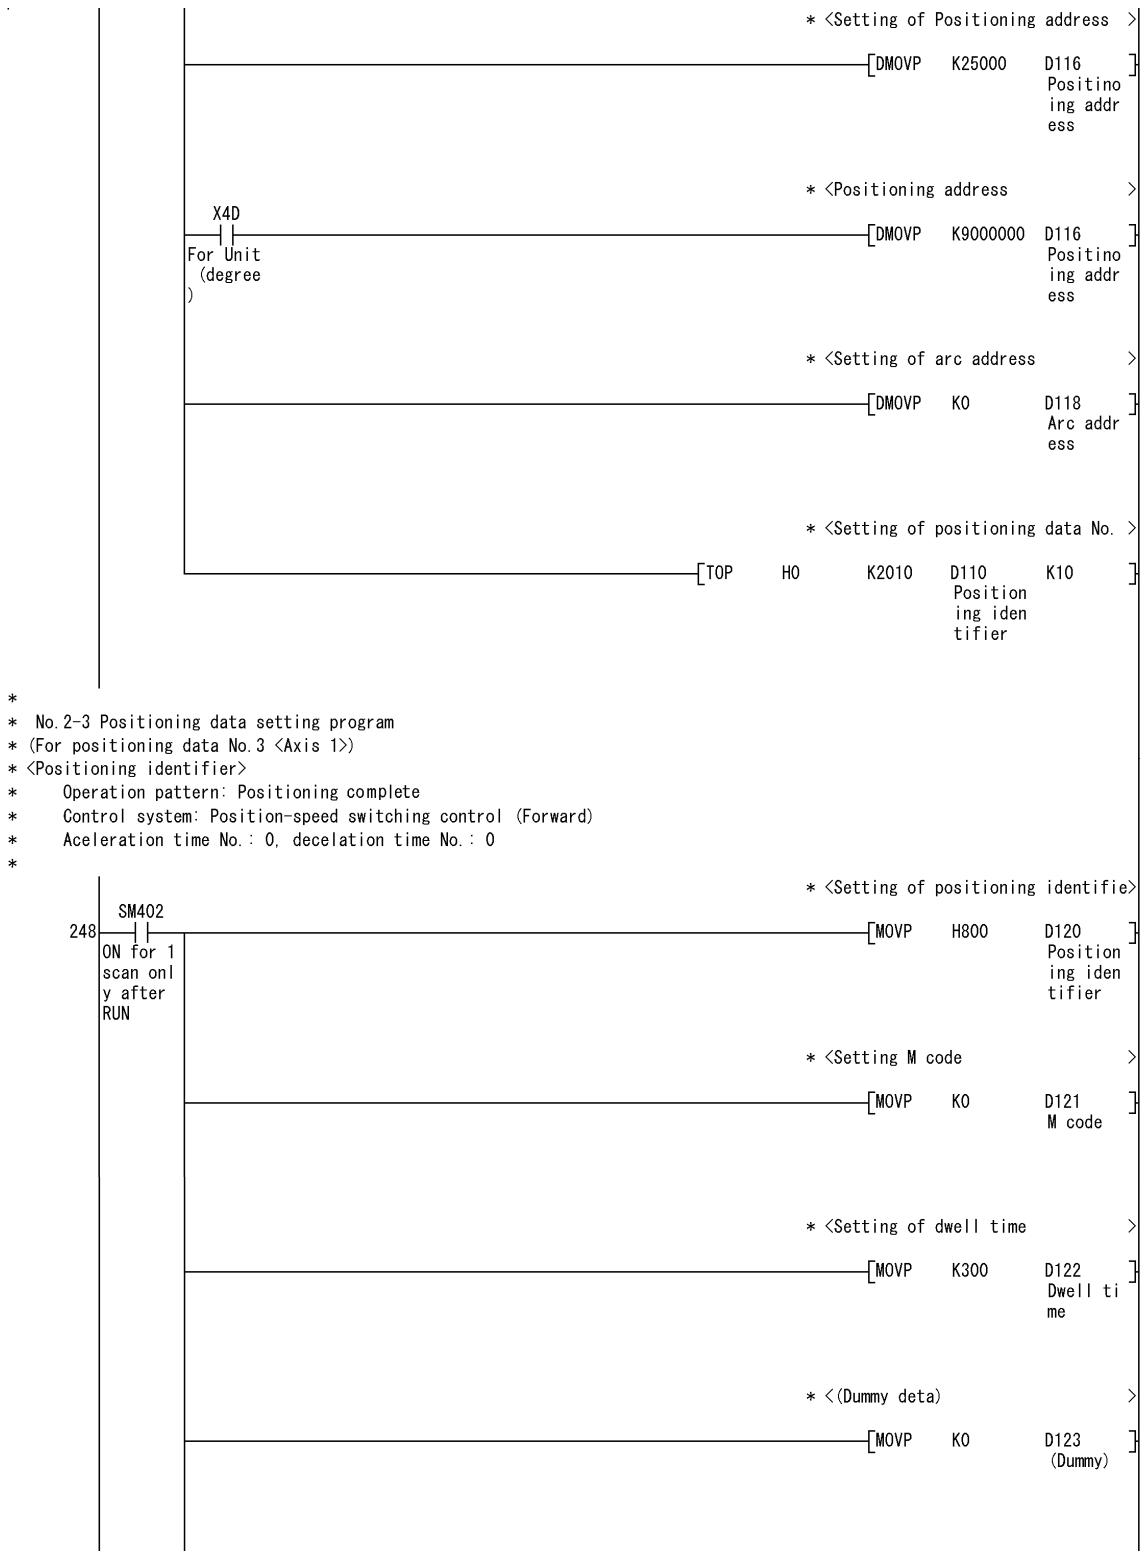


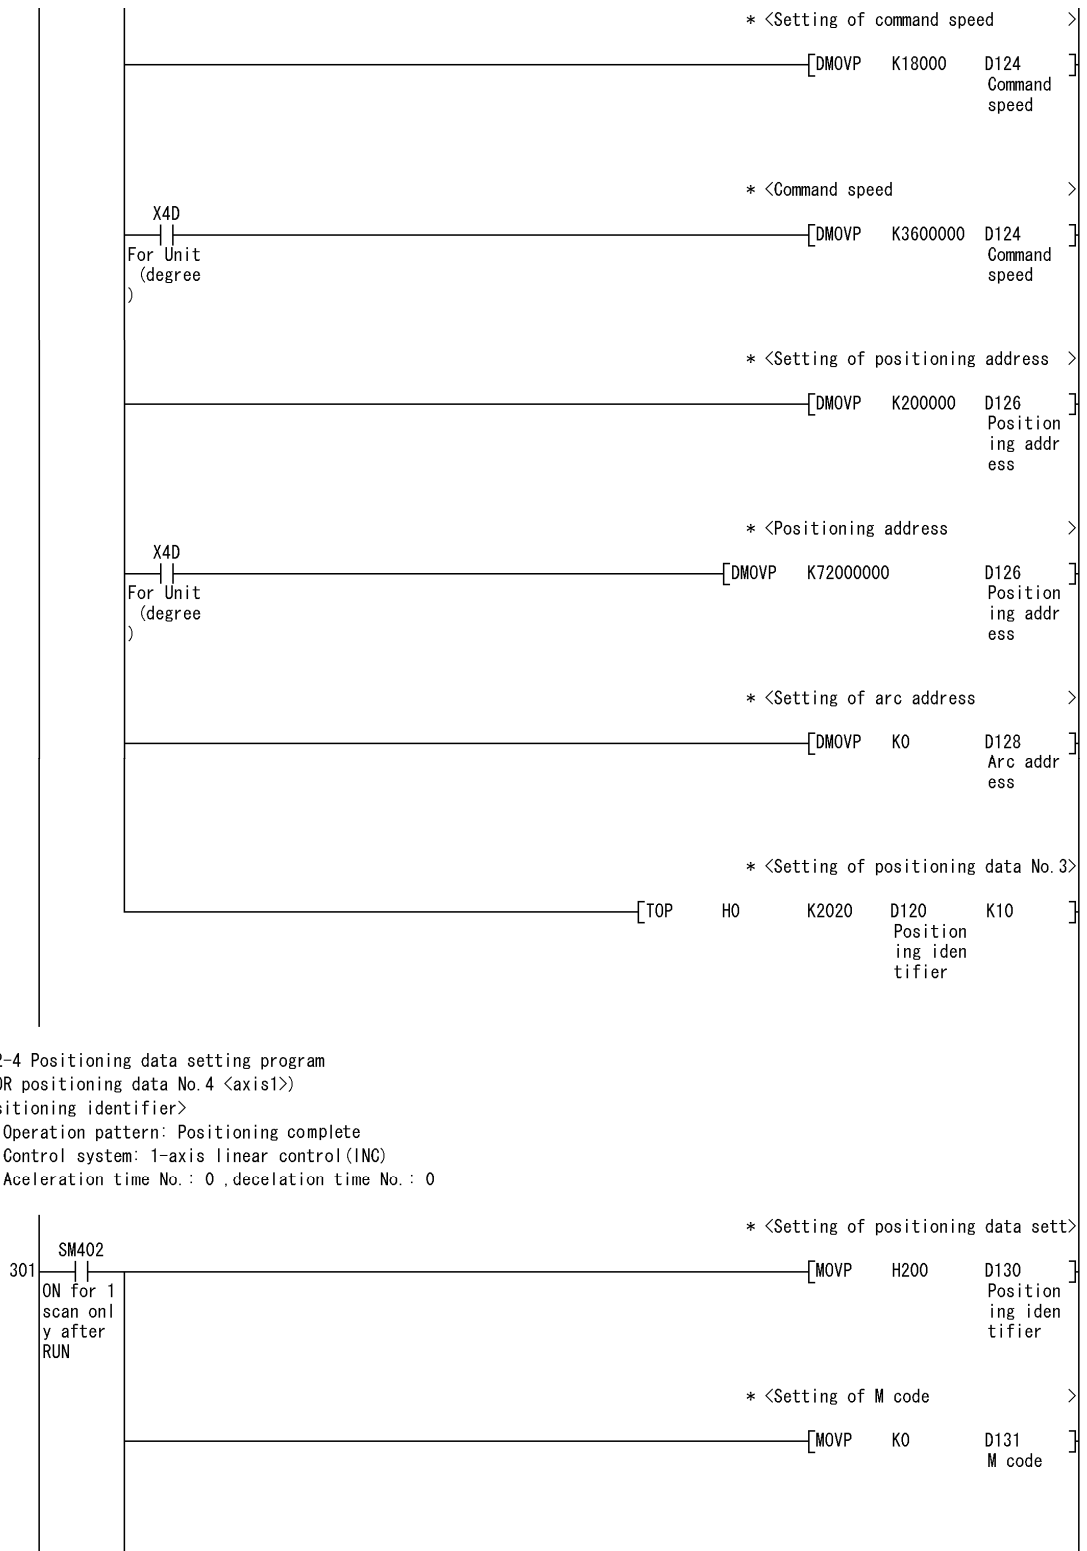

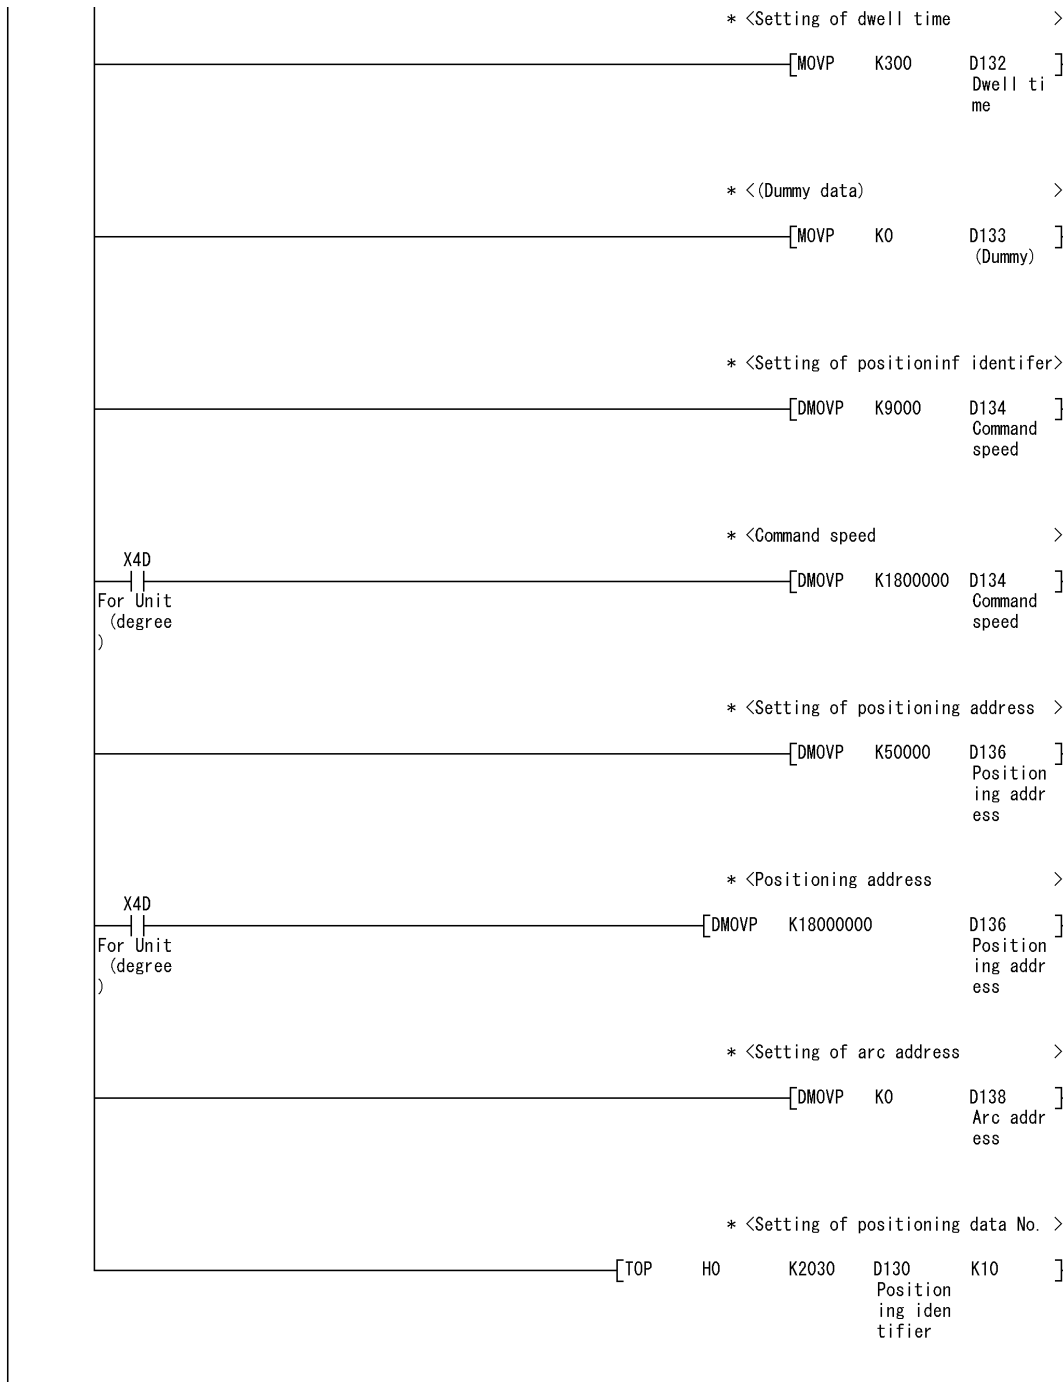


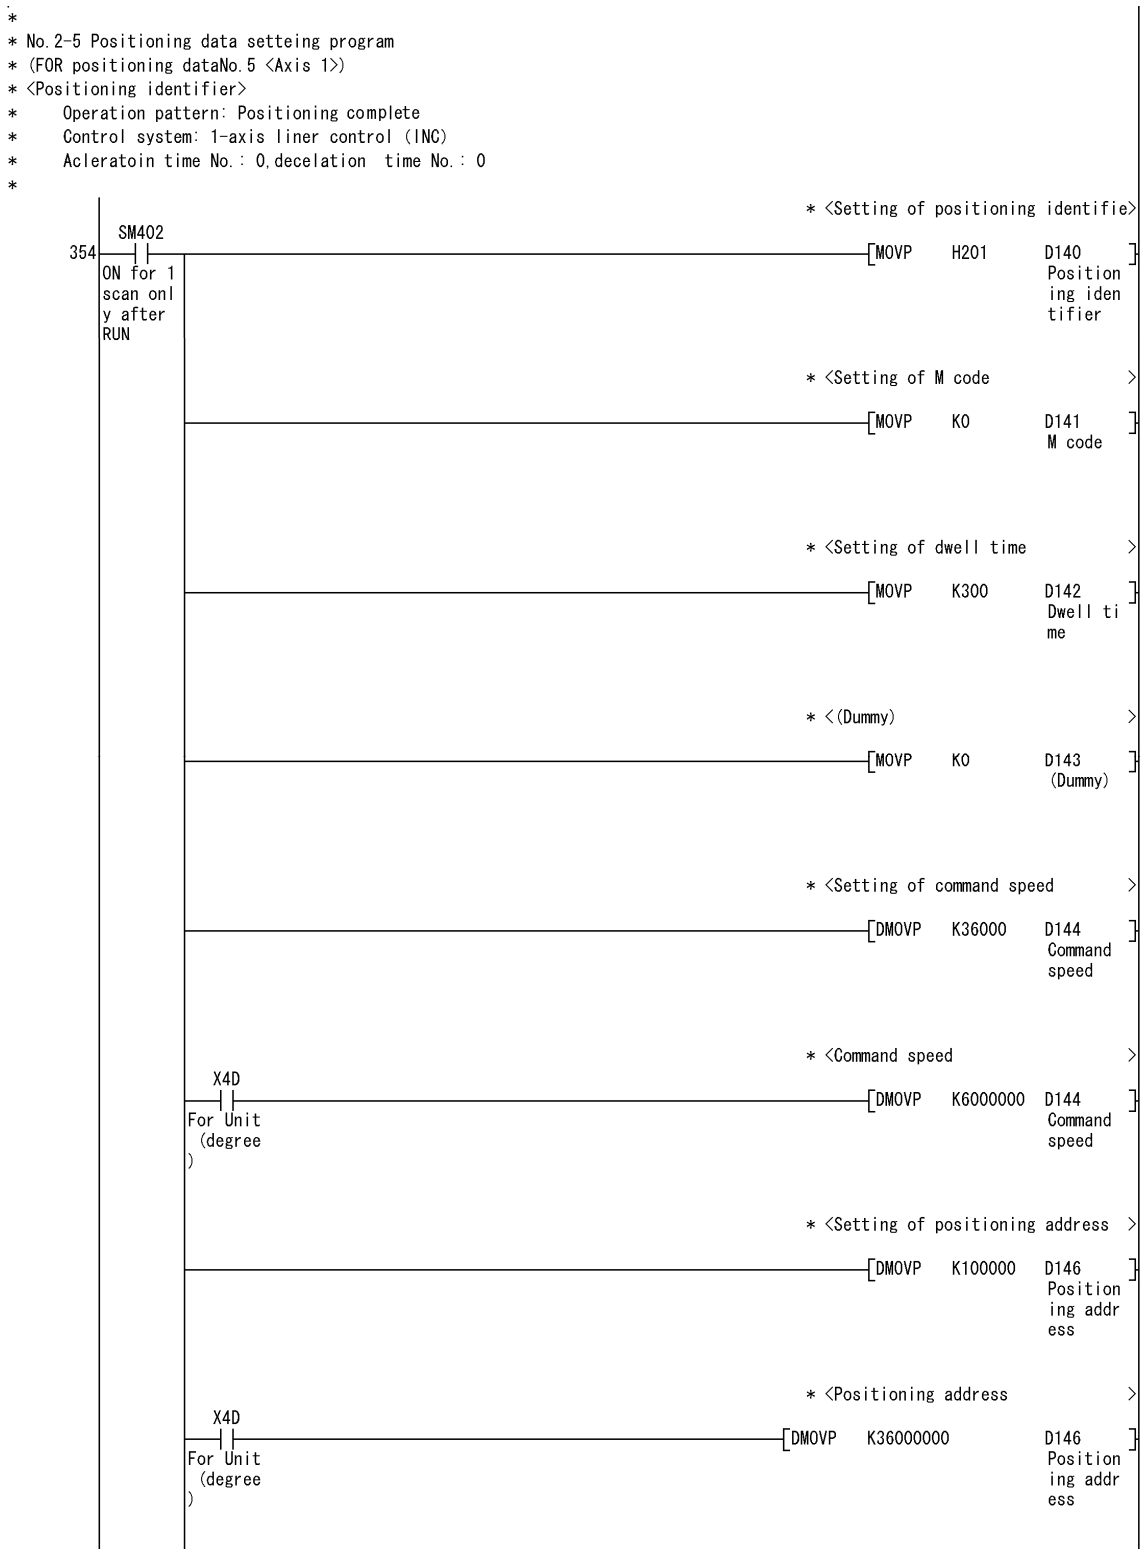


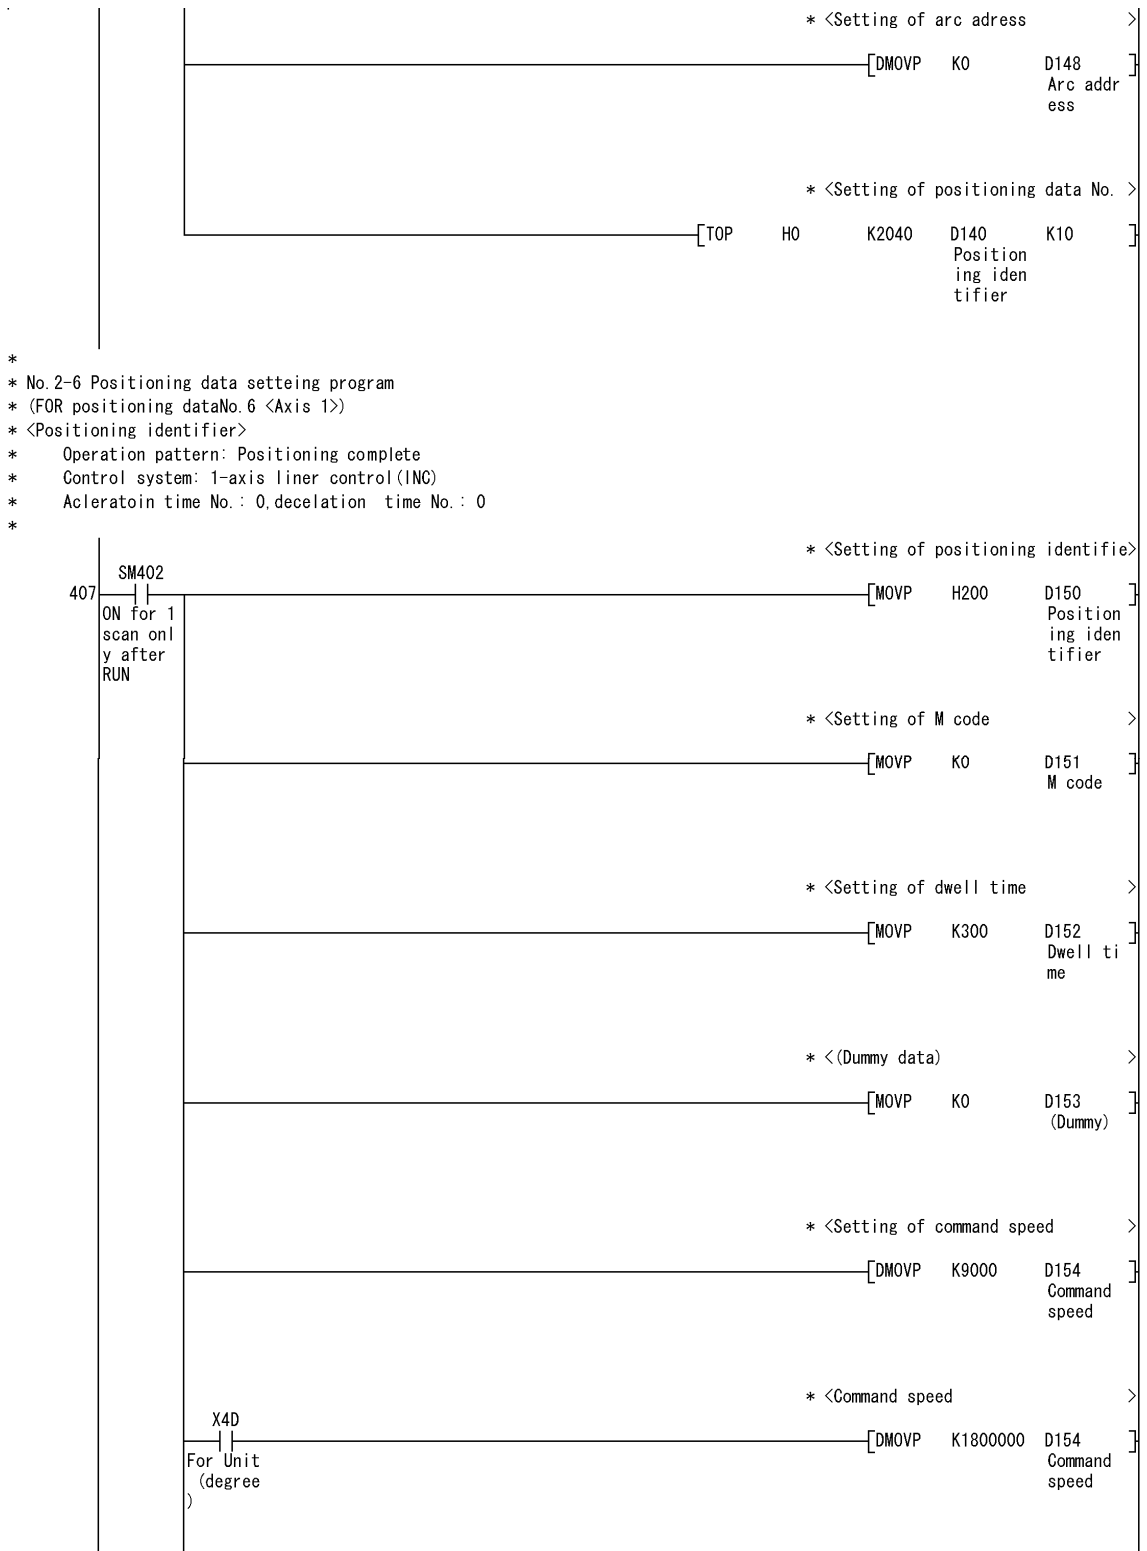


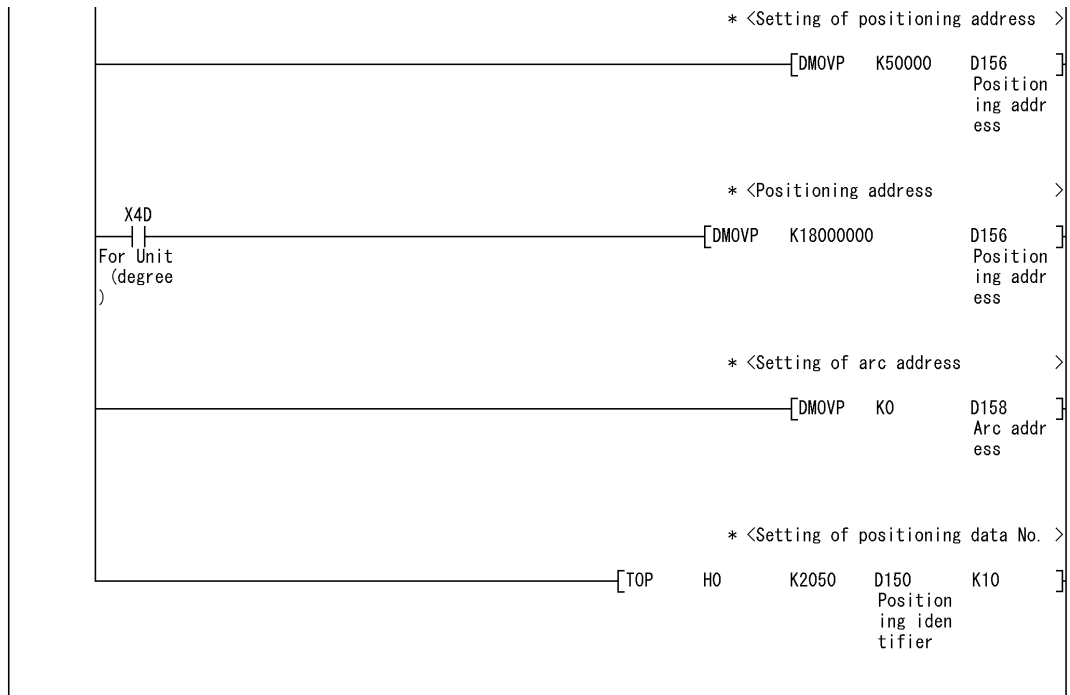


- \*
- \* No. 2-7 Positioning data setting program
- \* (For positioning data No. 10 <Axis 1>)
- \* <Positioning identifier>
- \* Operation pattern: Continuous positioning control
- \* Control system: 1-axis linear control (INC)
- \* Acceleration time No.: 0, deceleration time No.: 0
- \*

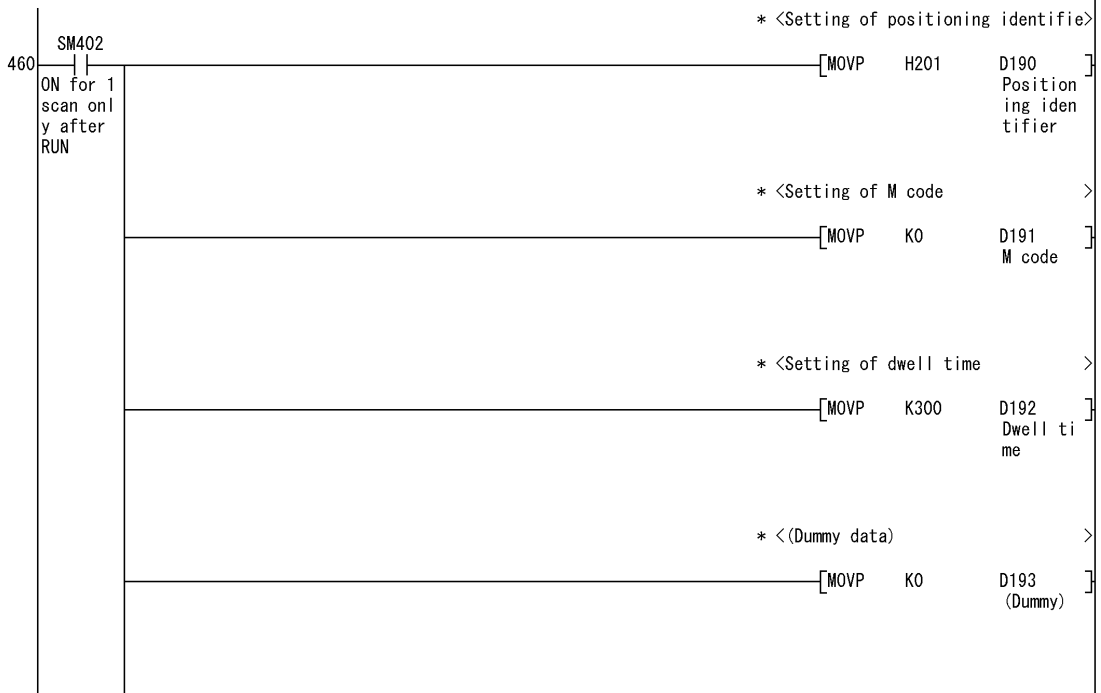


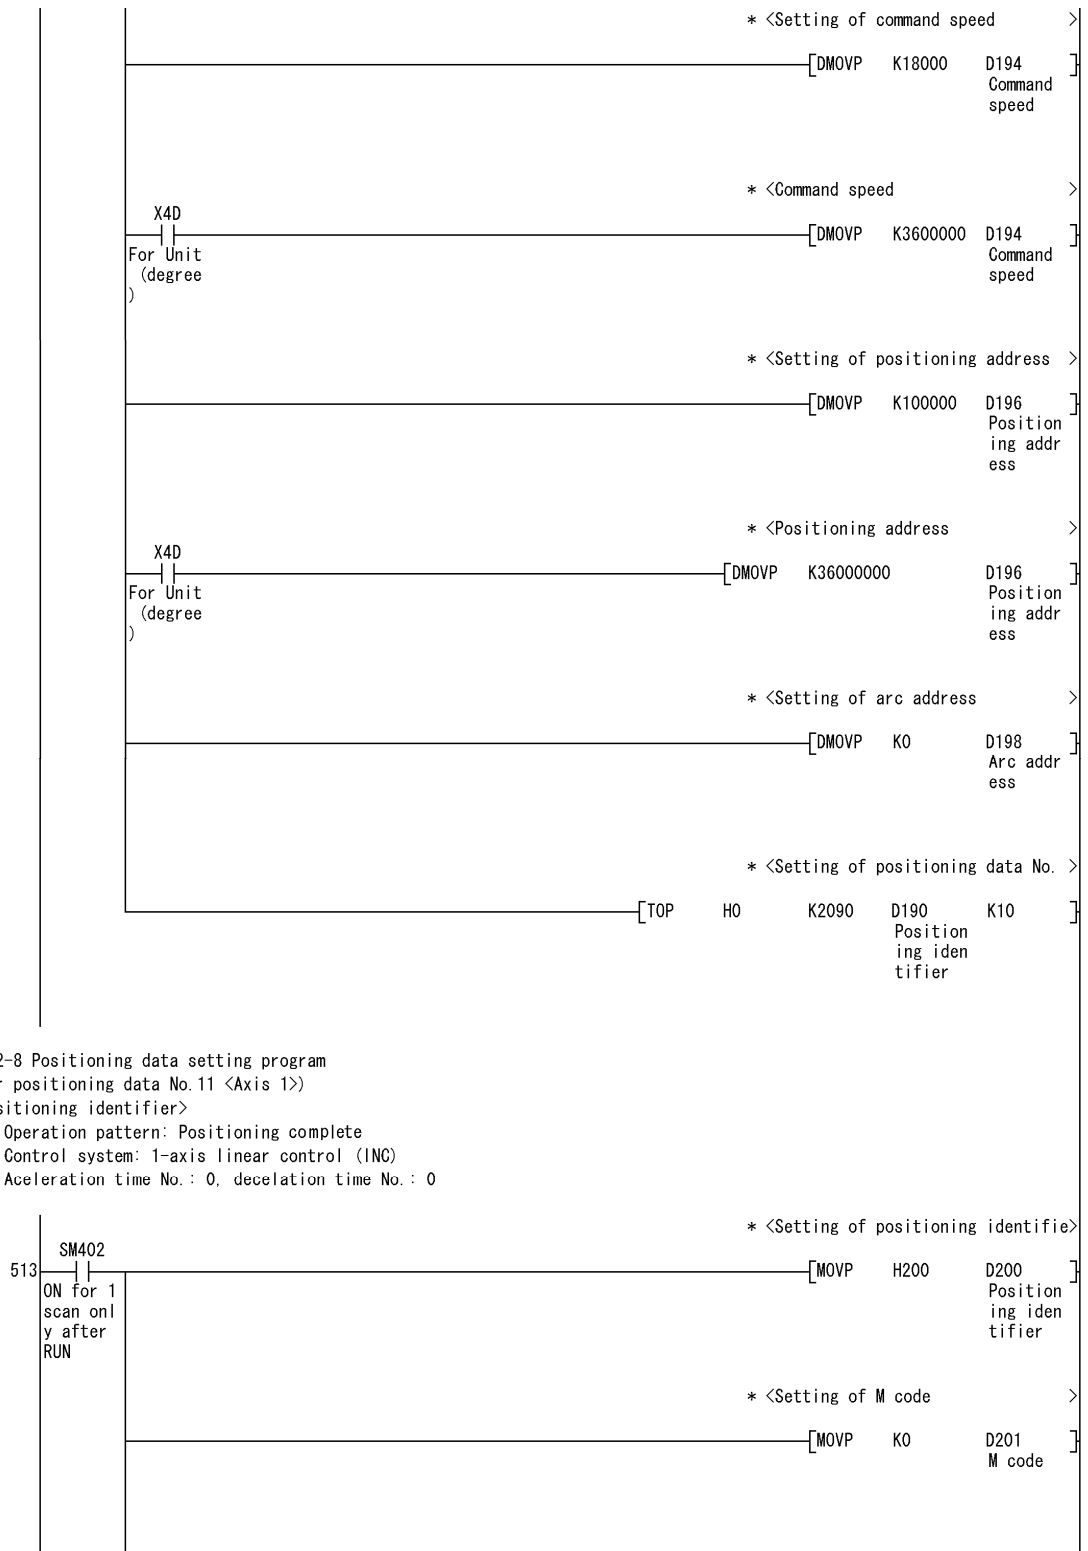


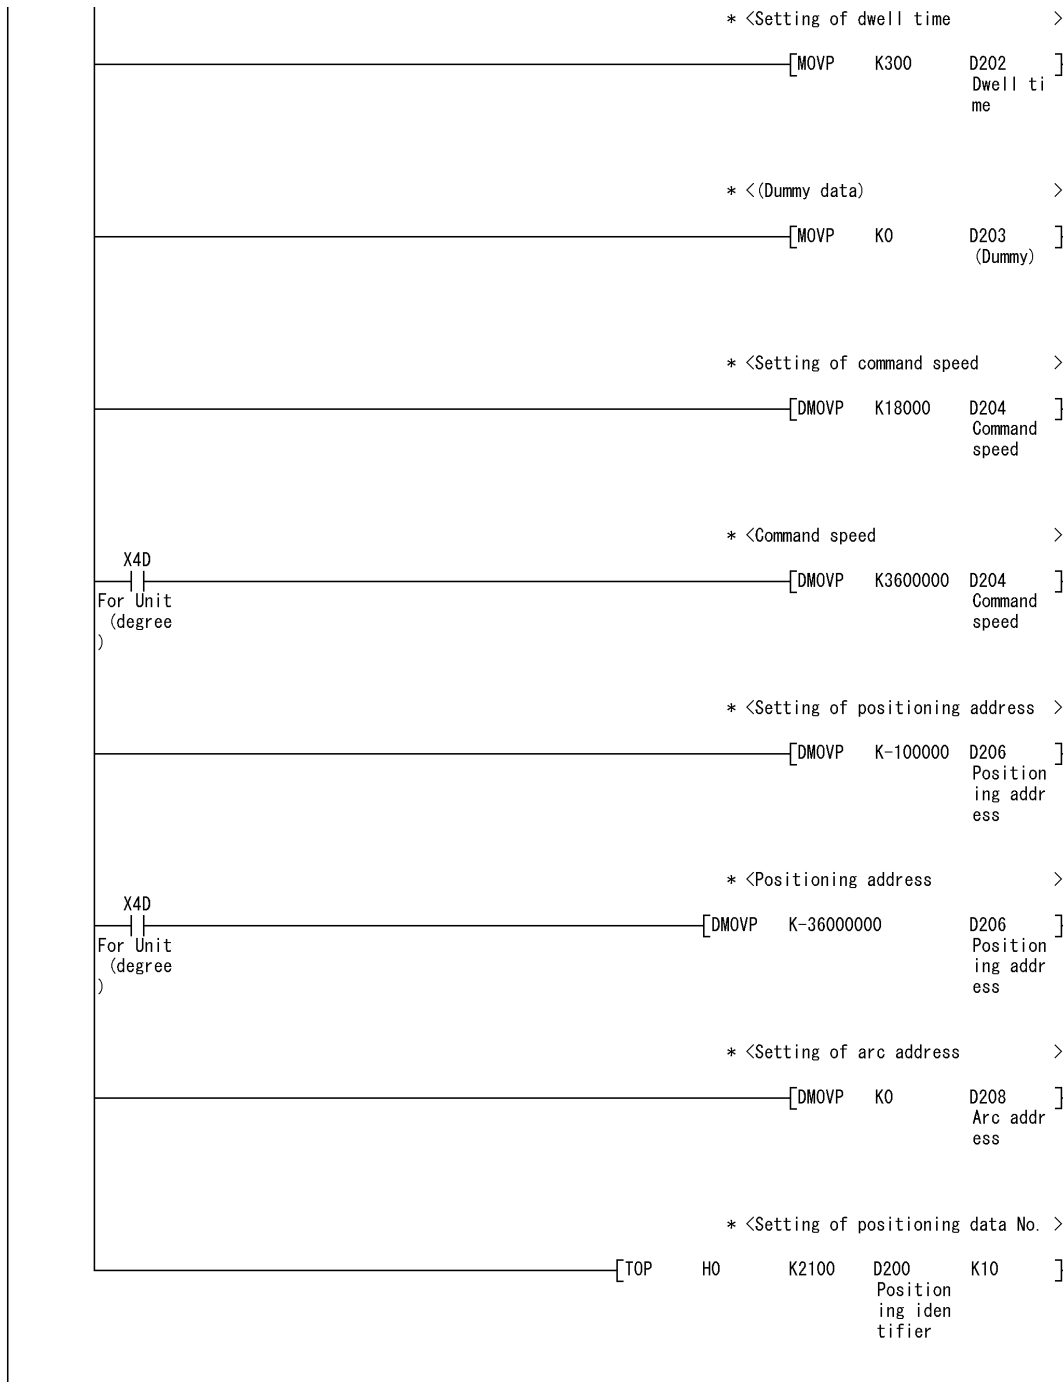




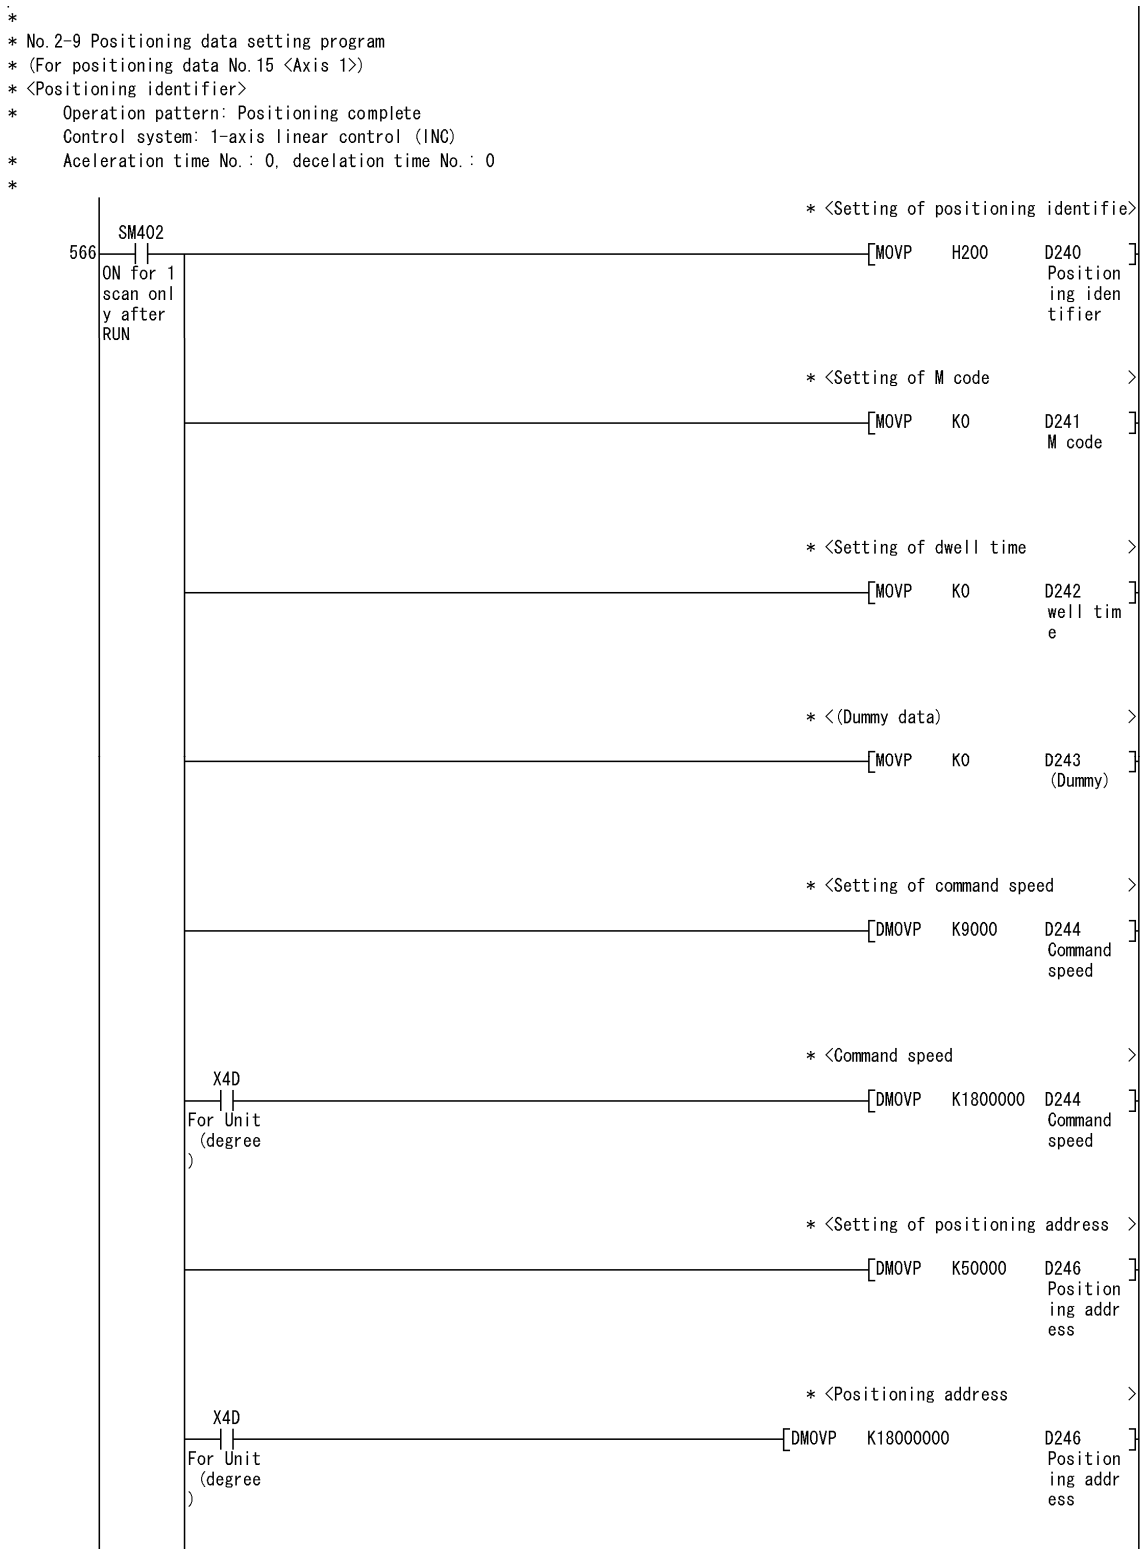


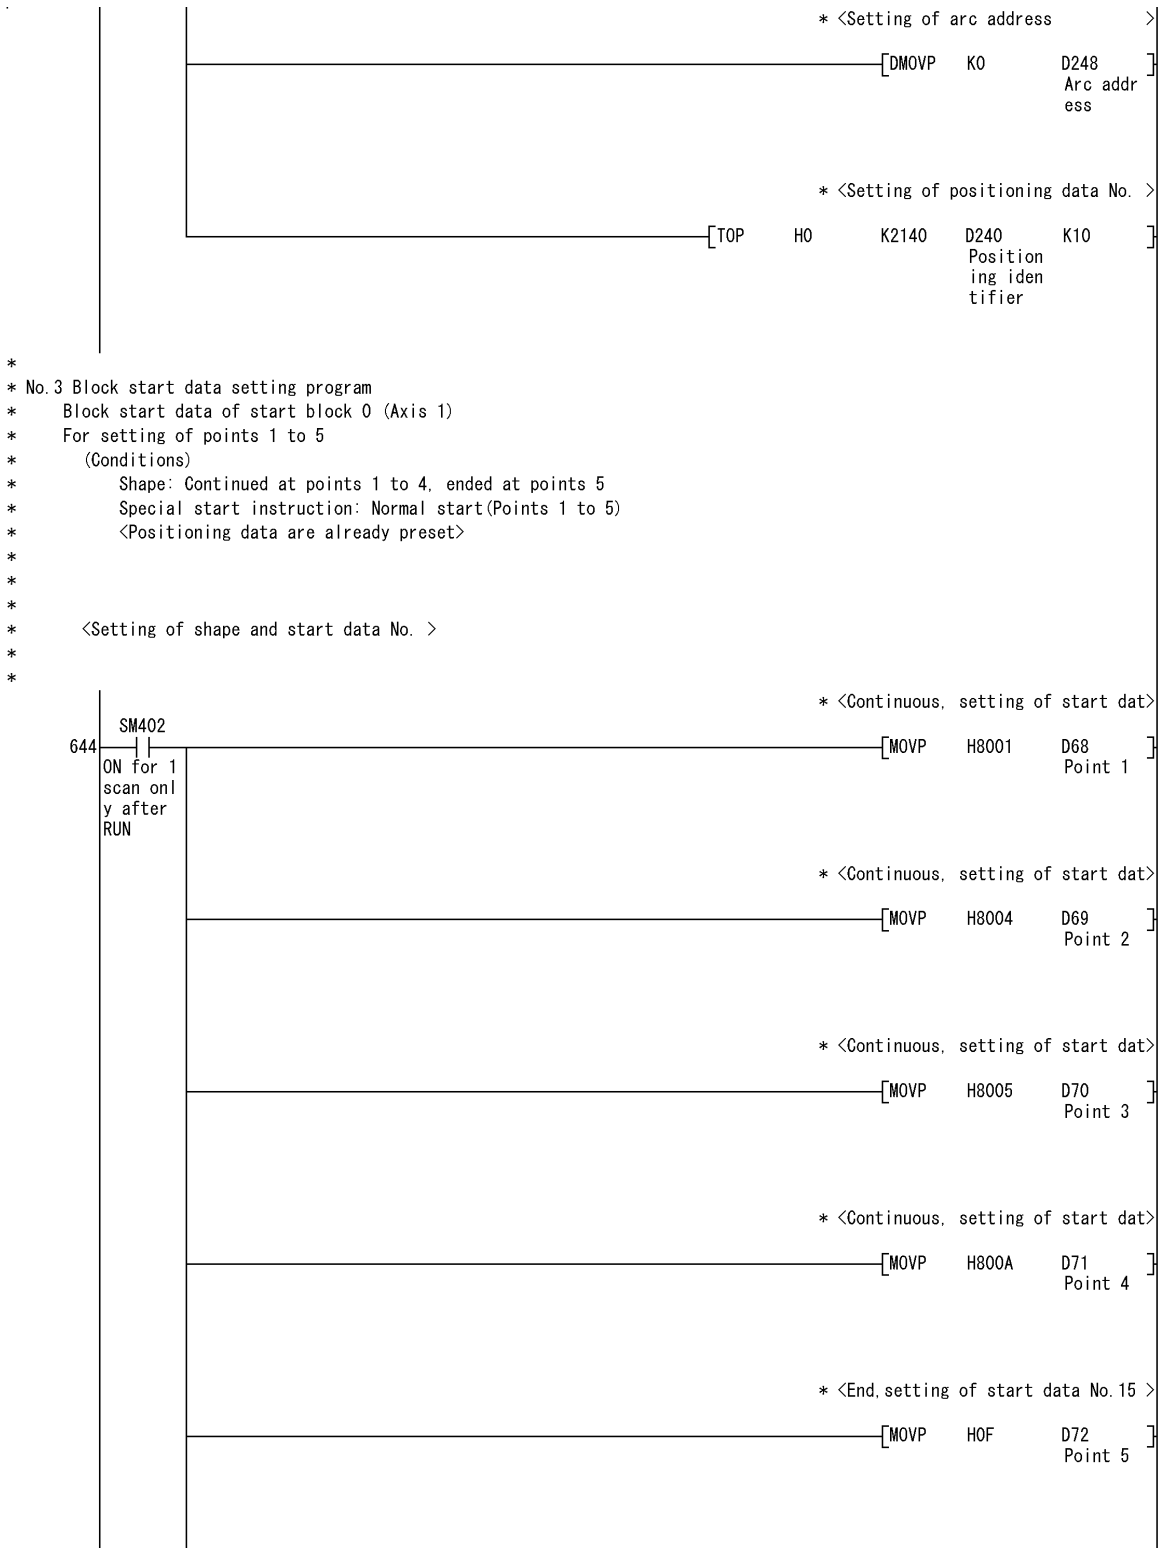


 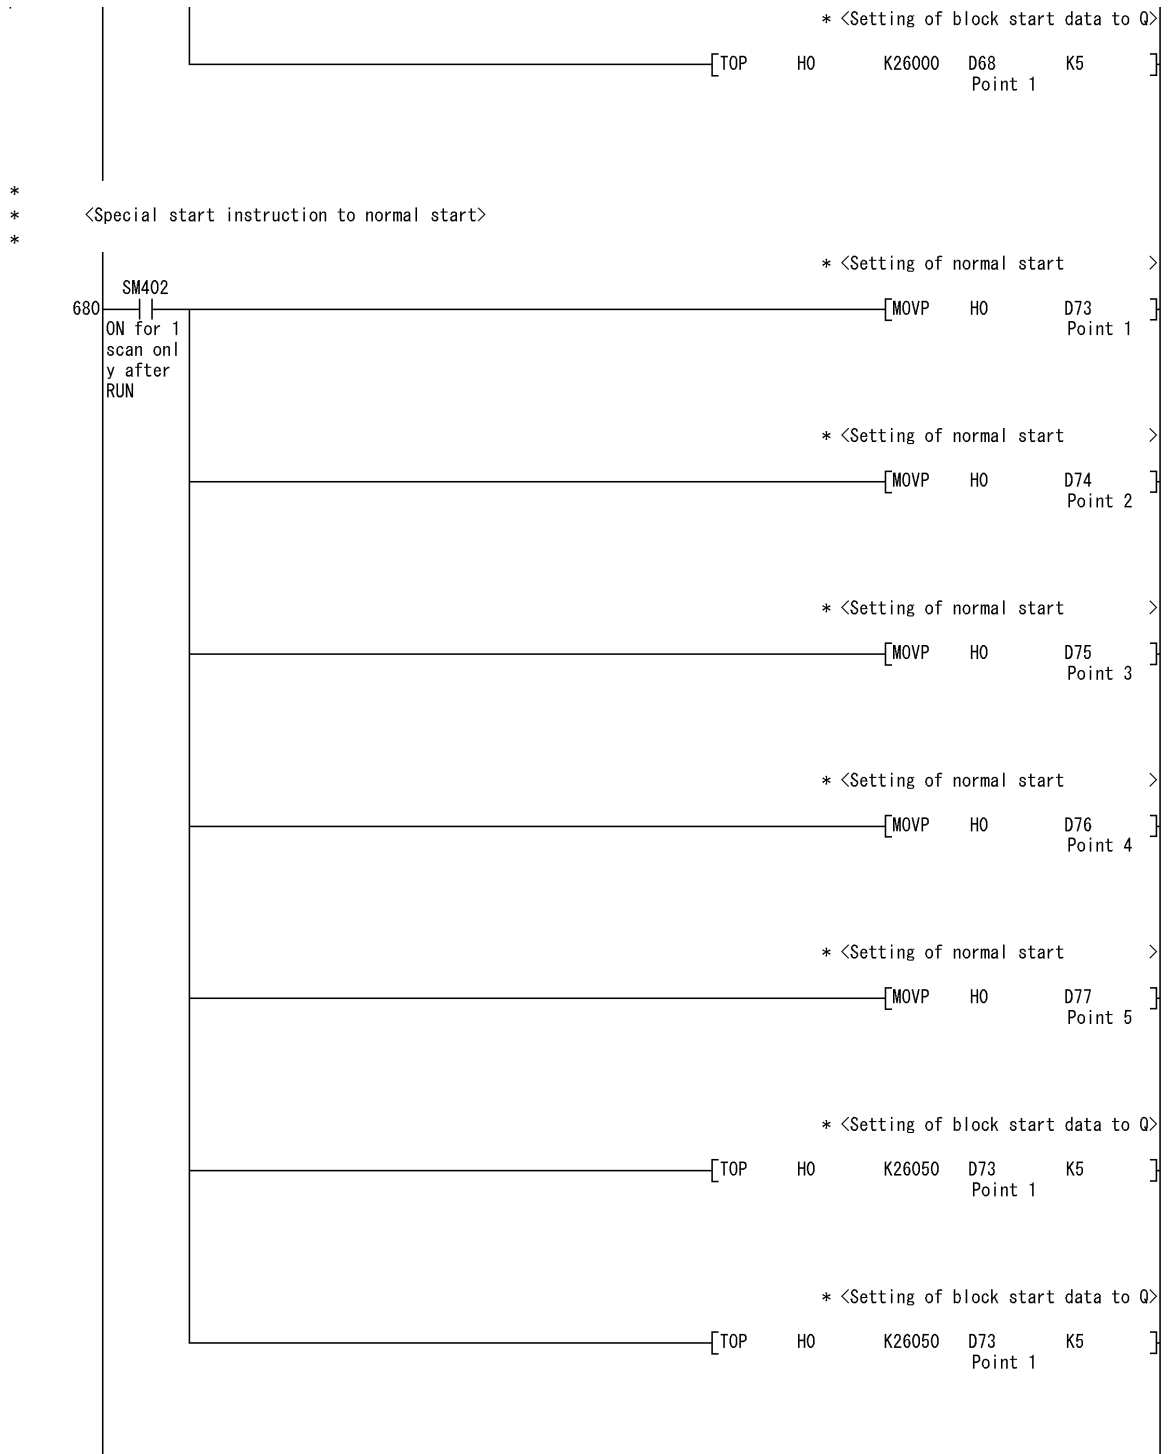




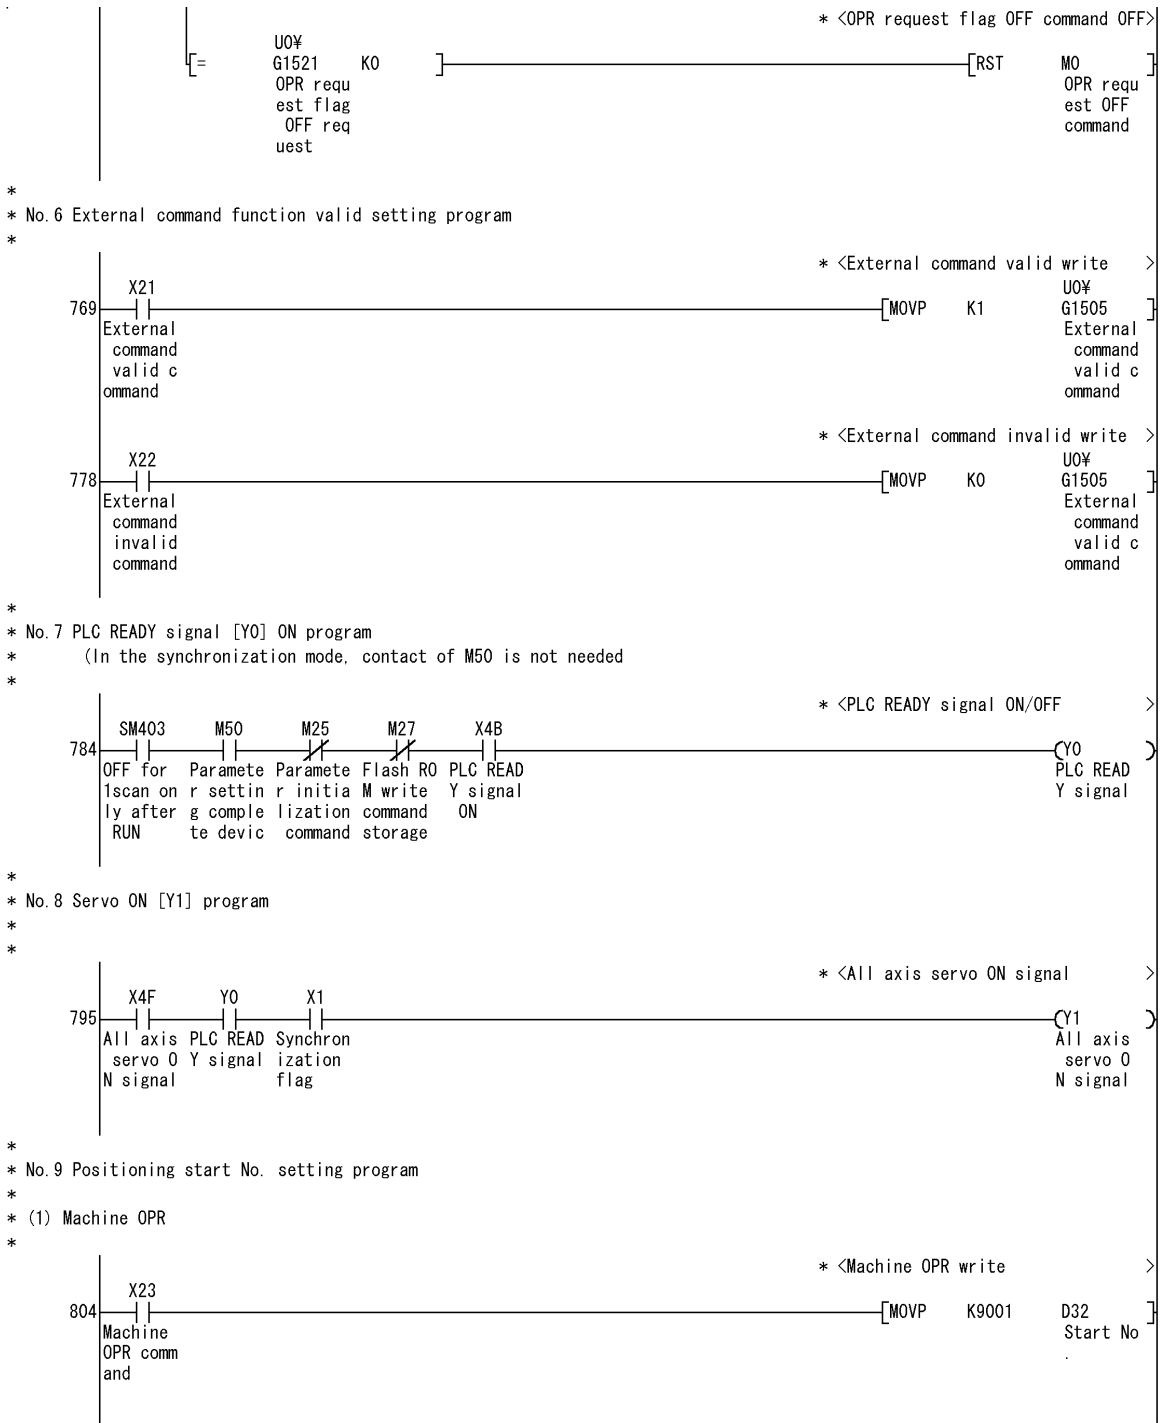


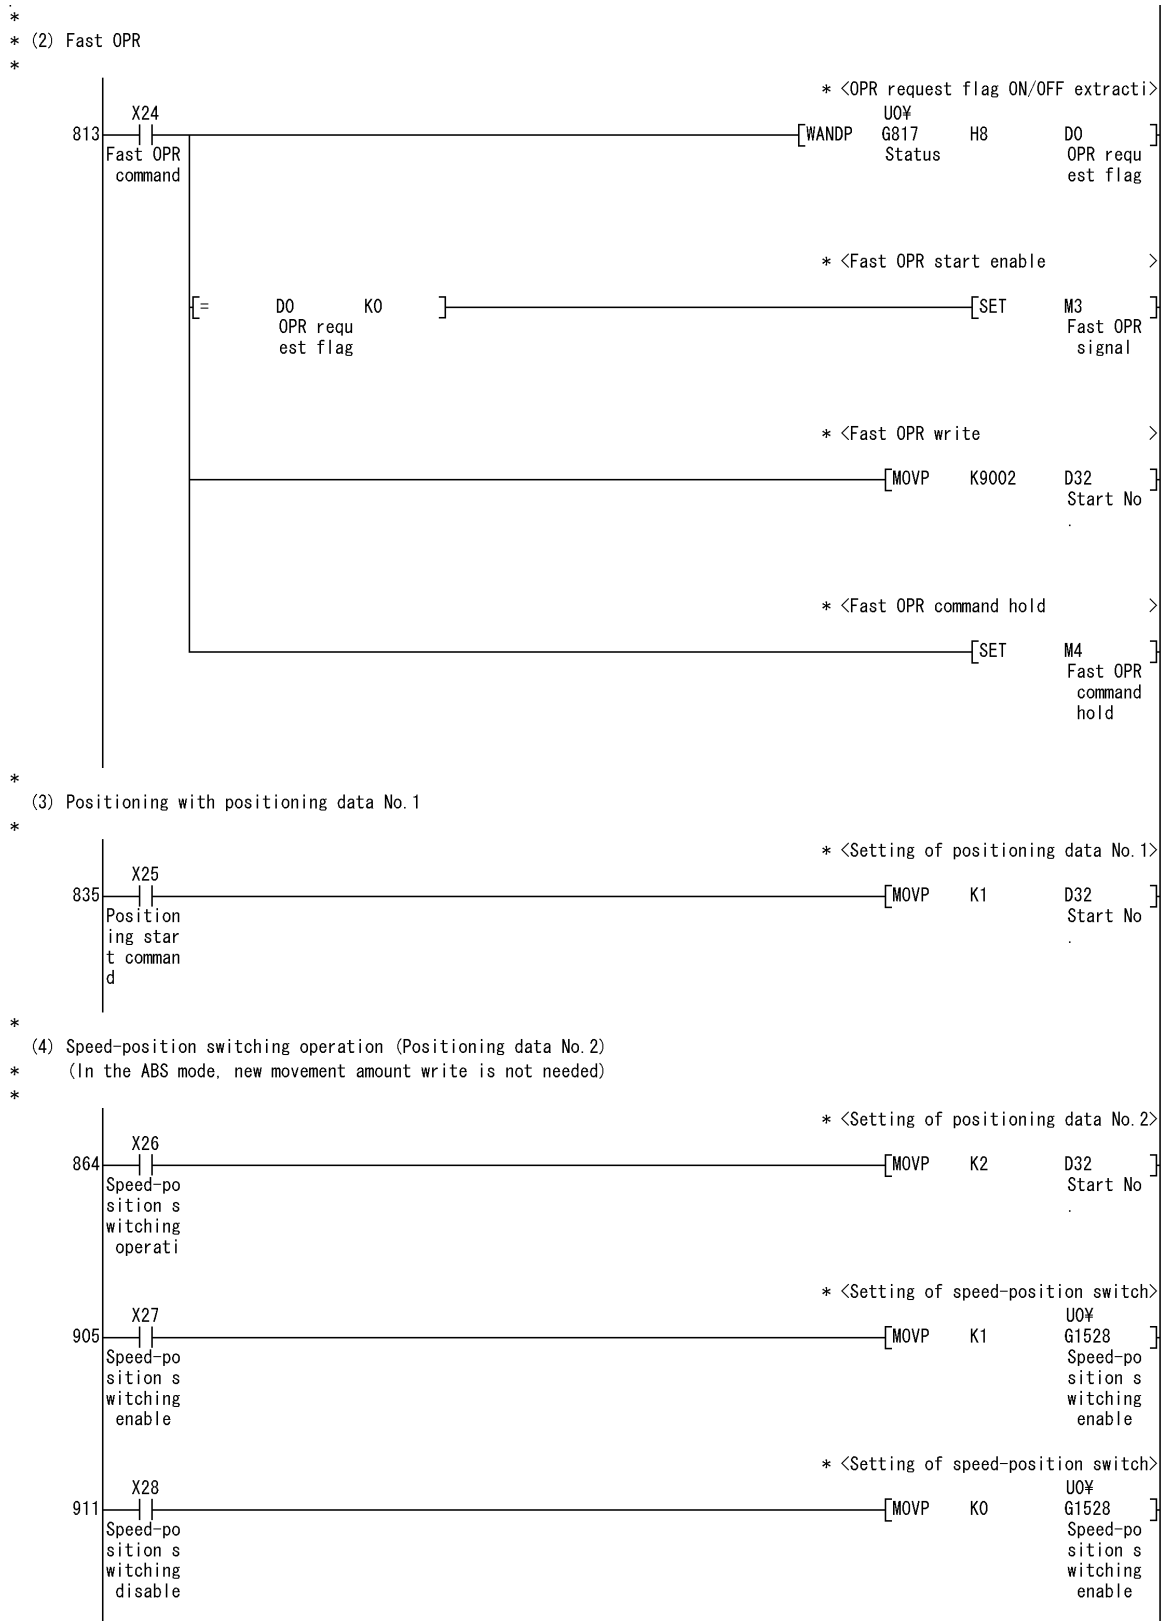

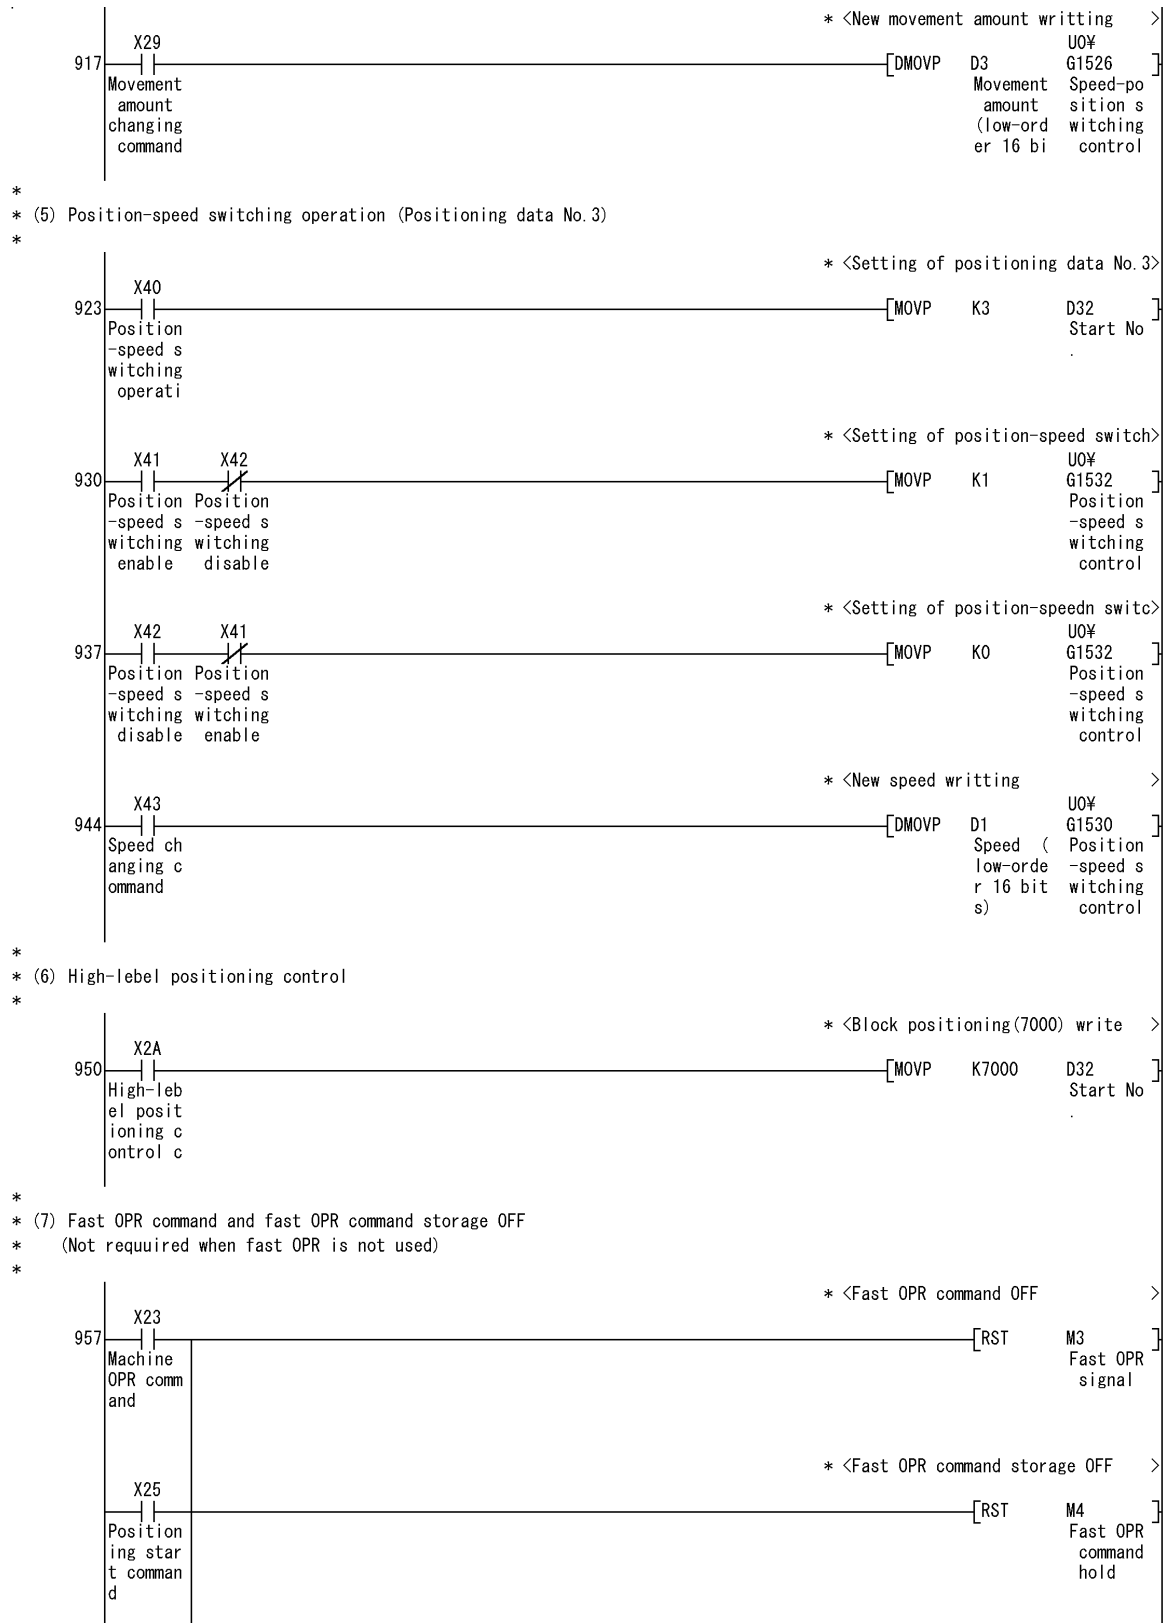






- \* No.10 Positioning start program
- \* (1) When dedicated instruction (PSTRT1) is used
- \* (When fast OPR is not made, contacts of M3 and M4 are not needed)
- \* (When M code is not used, contact of X04 is not needed)
- \* (When JOG operation/inching operation is not performed, contact of M7 is not needed)
- \* (When manual pulse generator operation is not performed, contacts of M9 is not needed)

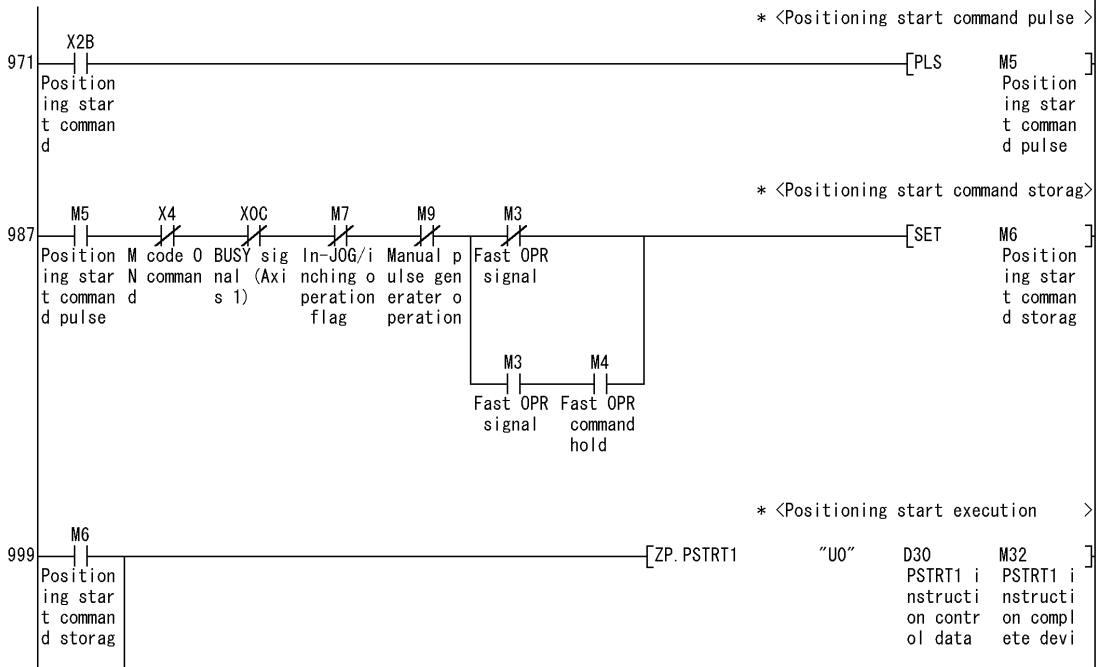





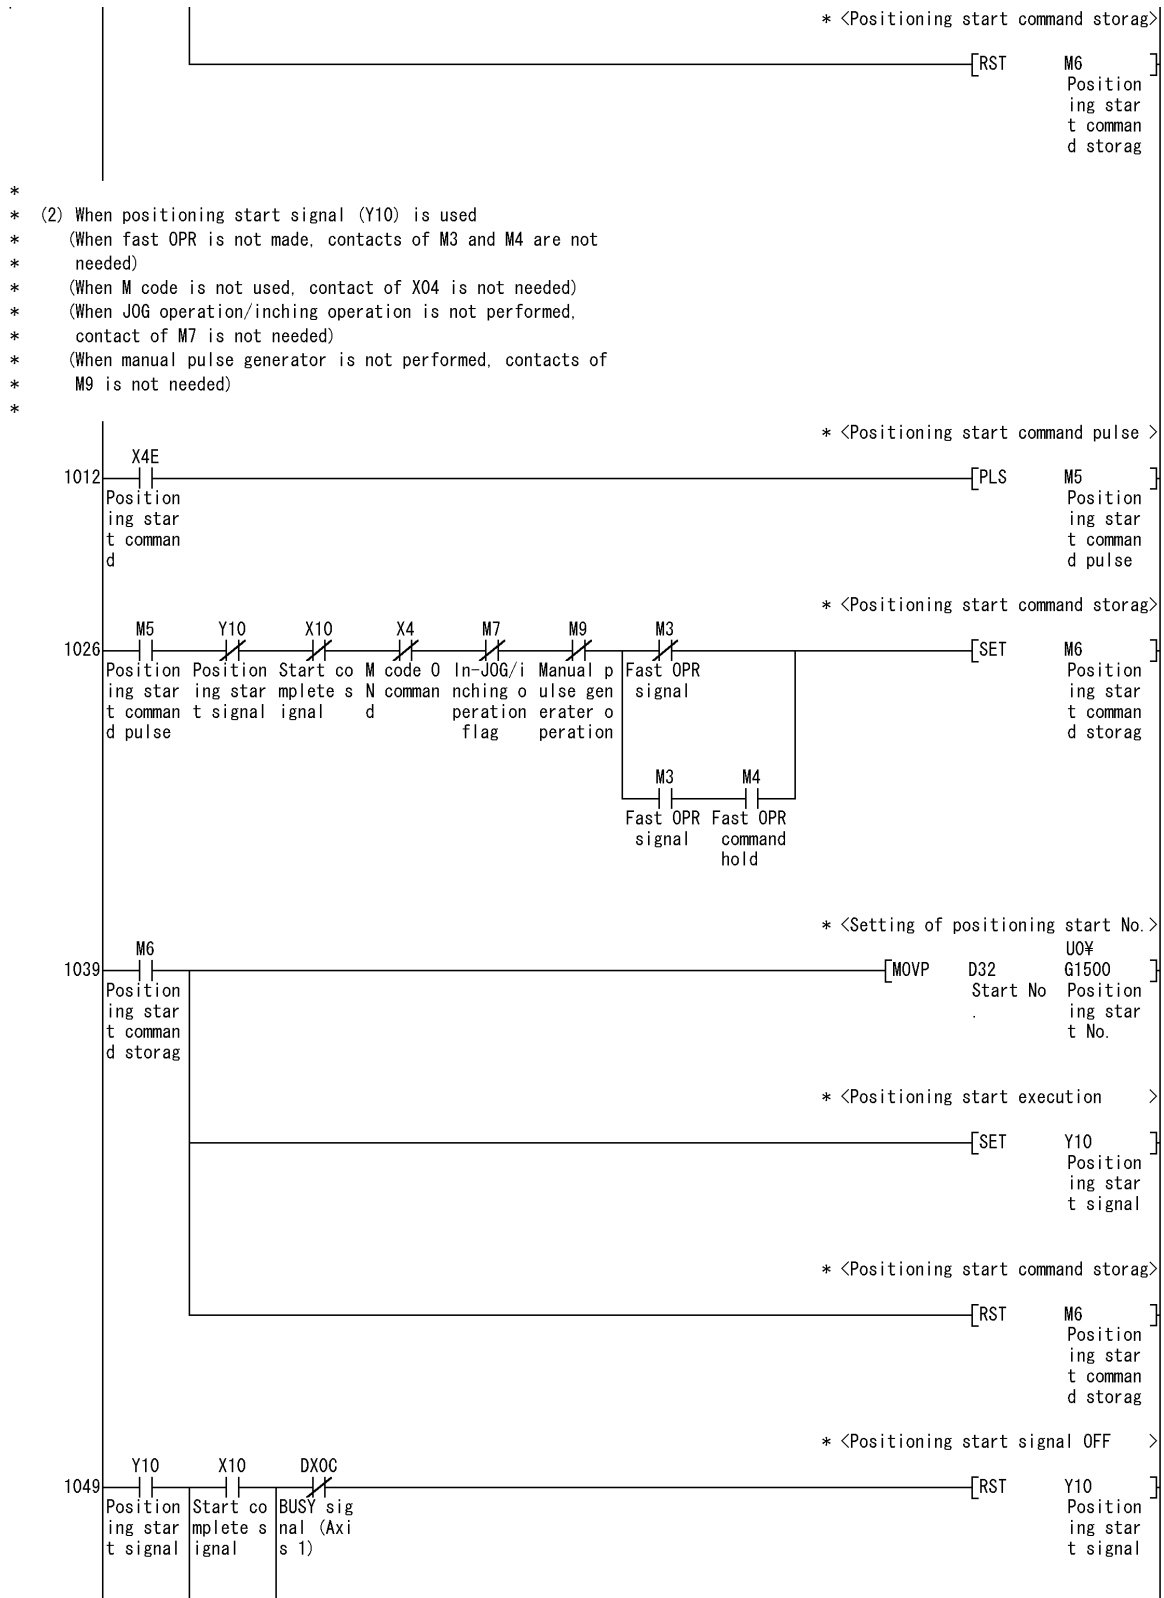

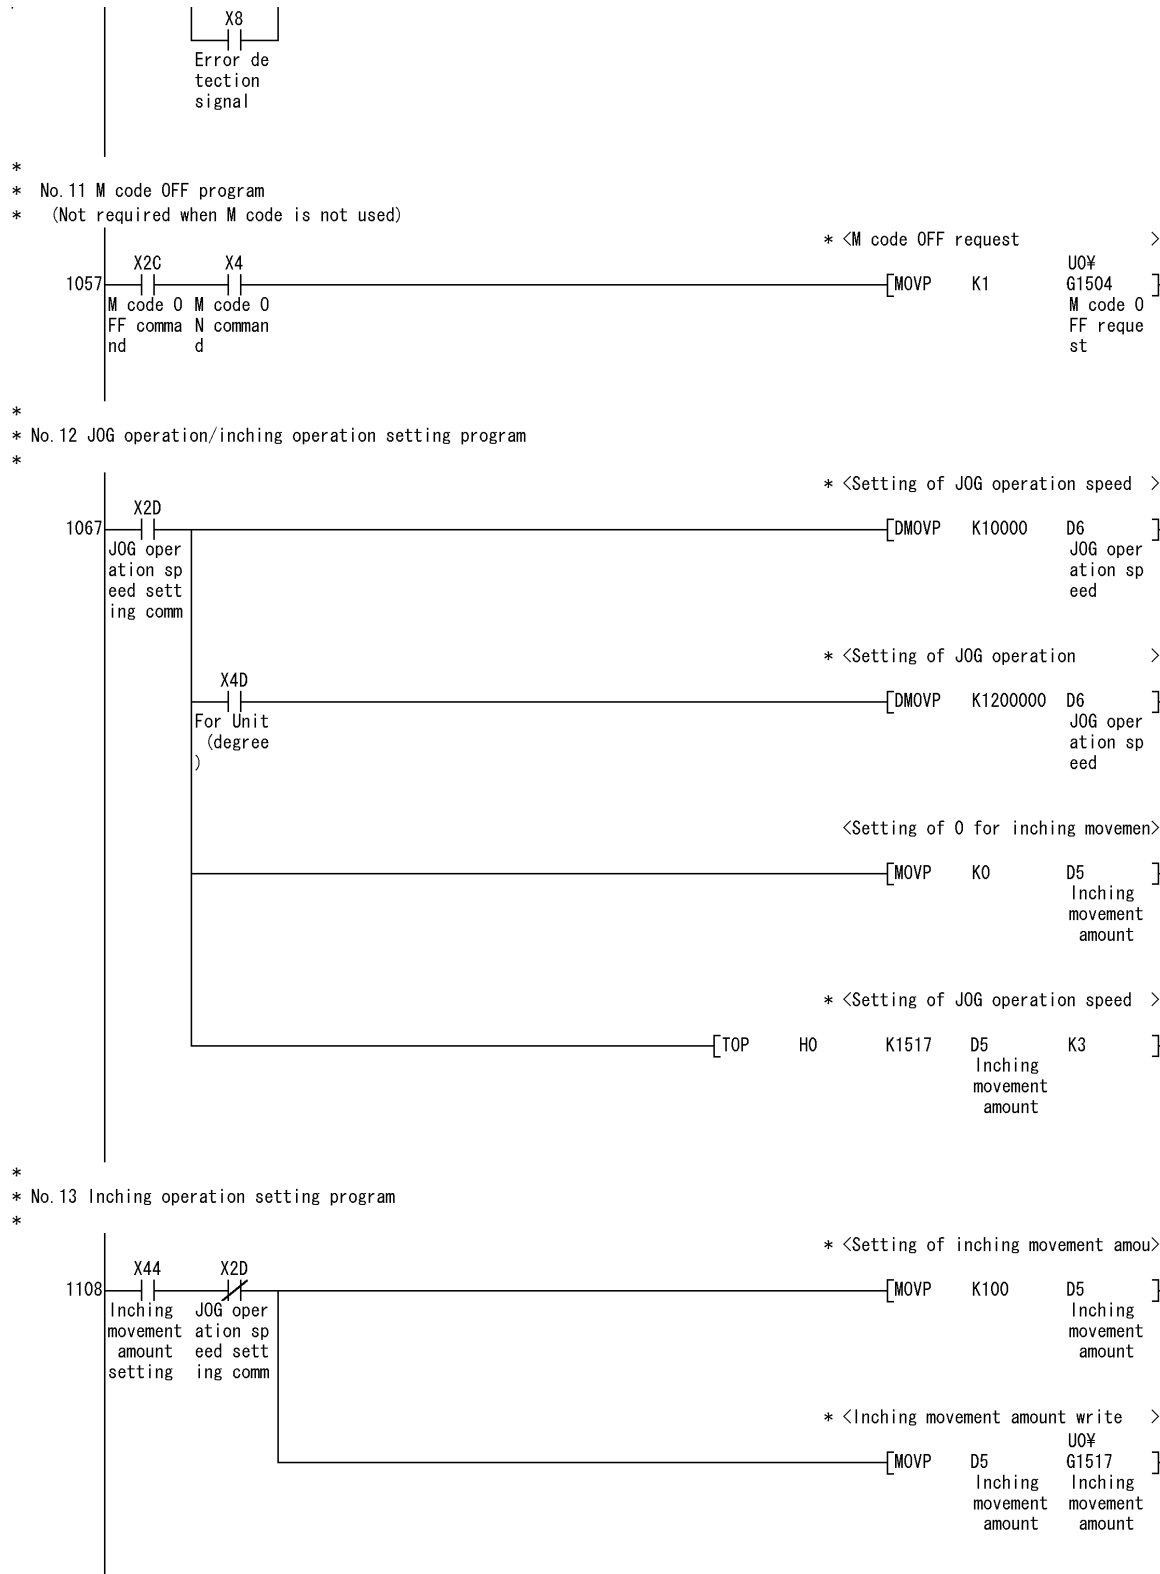


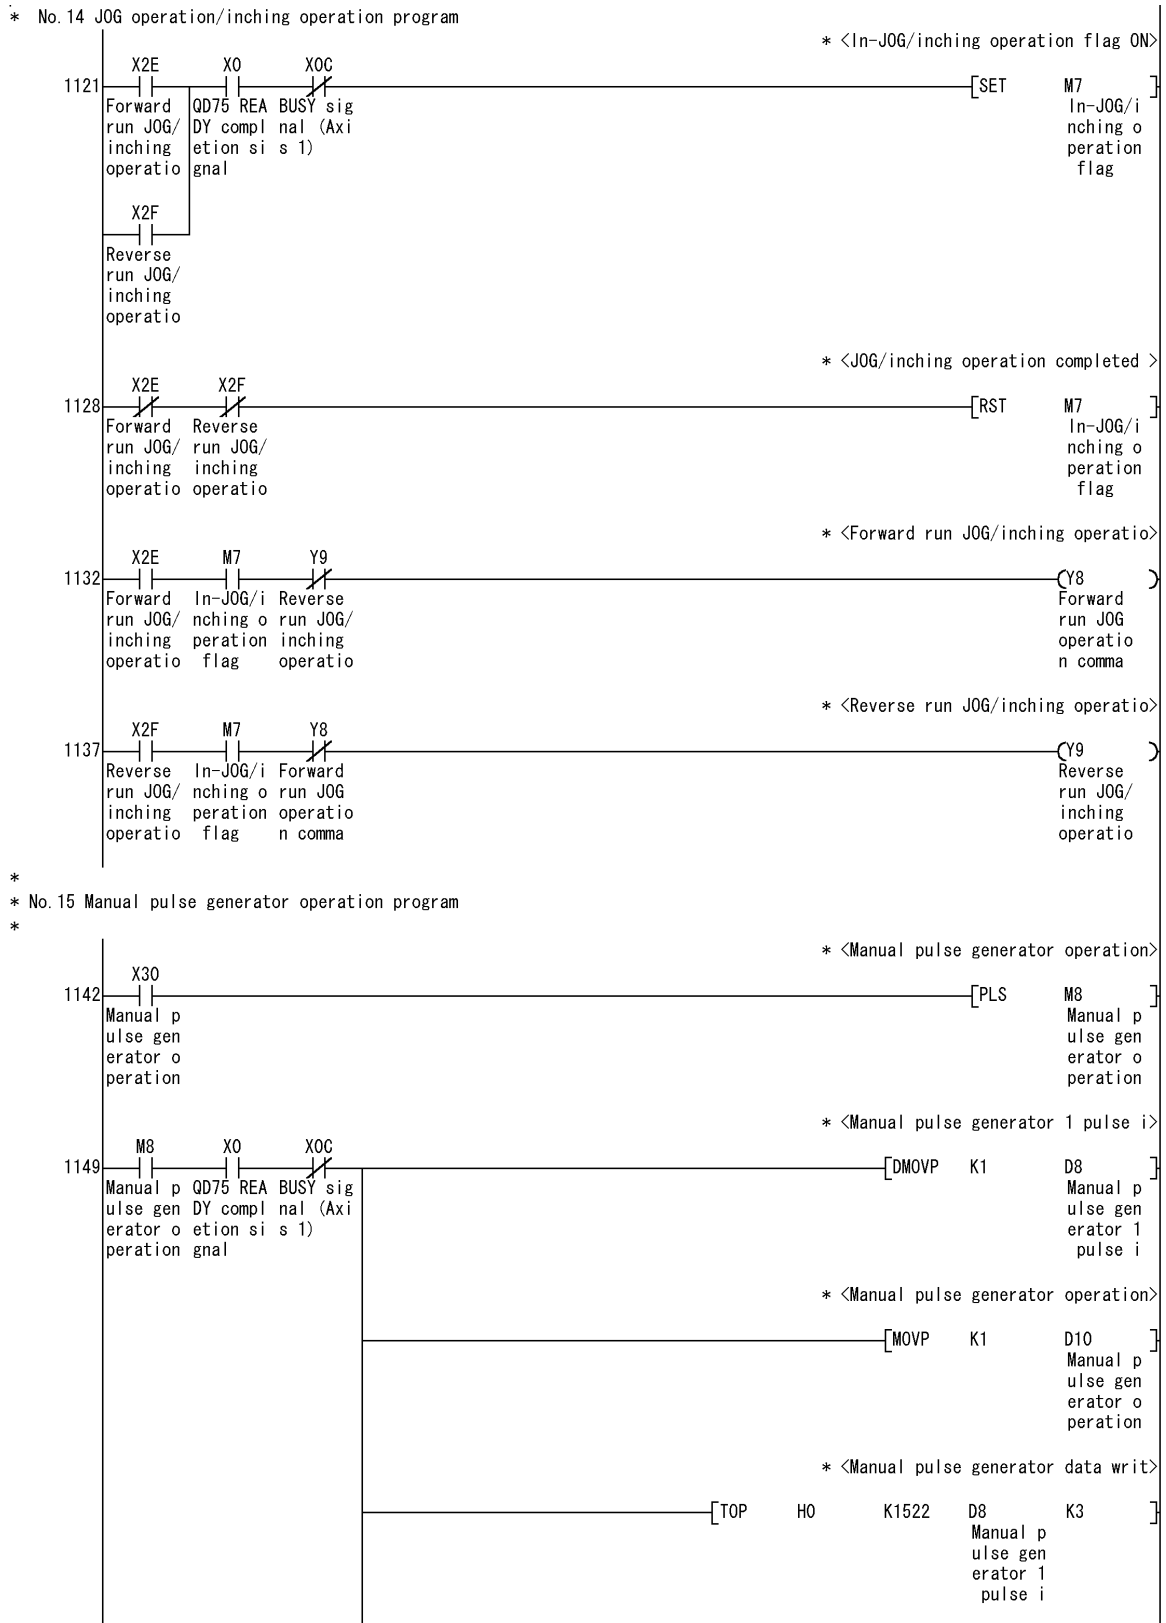


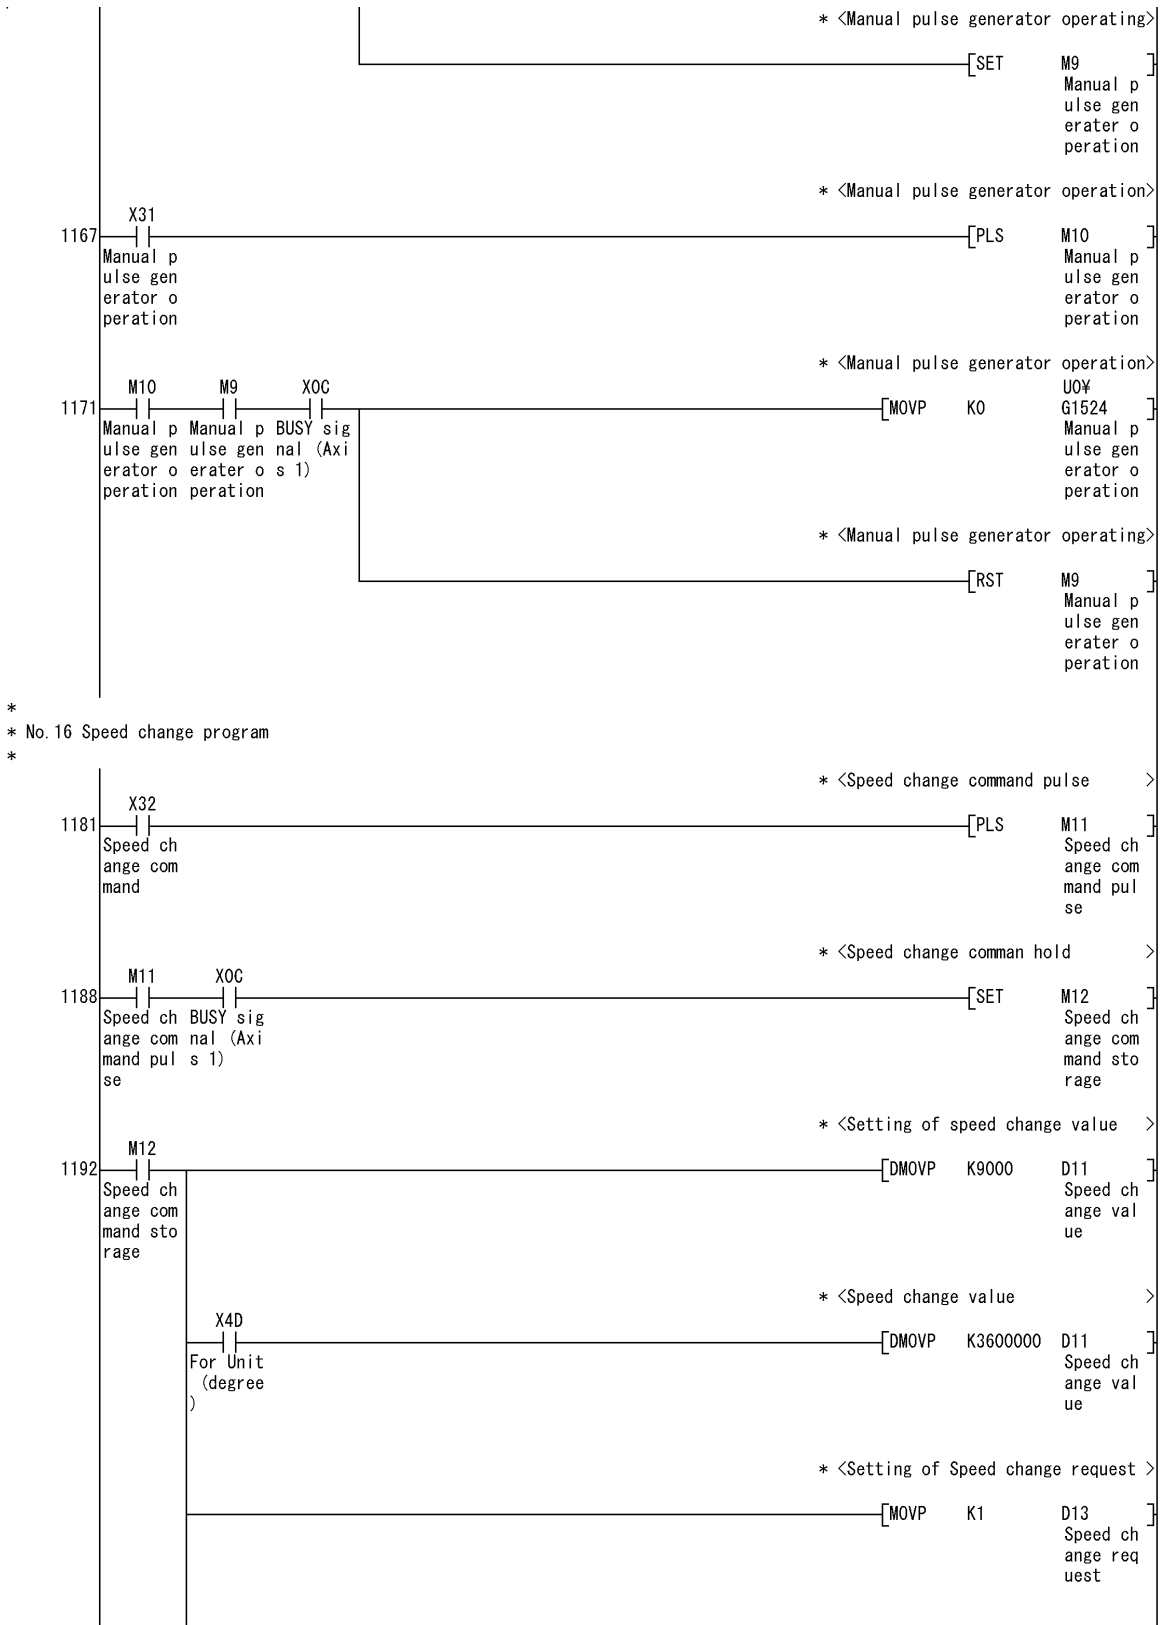

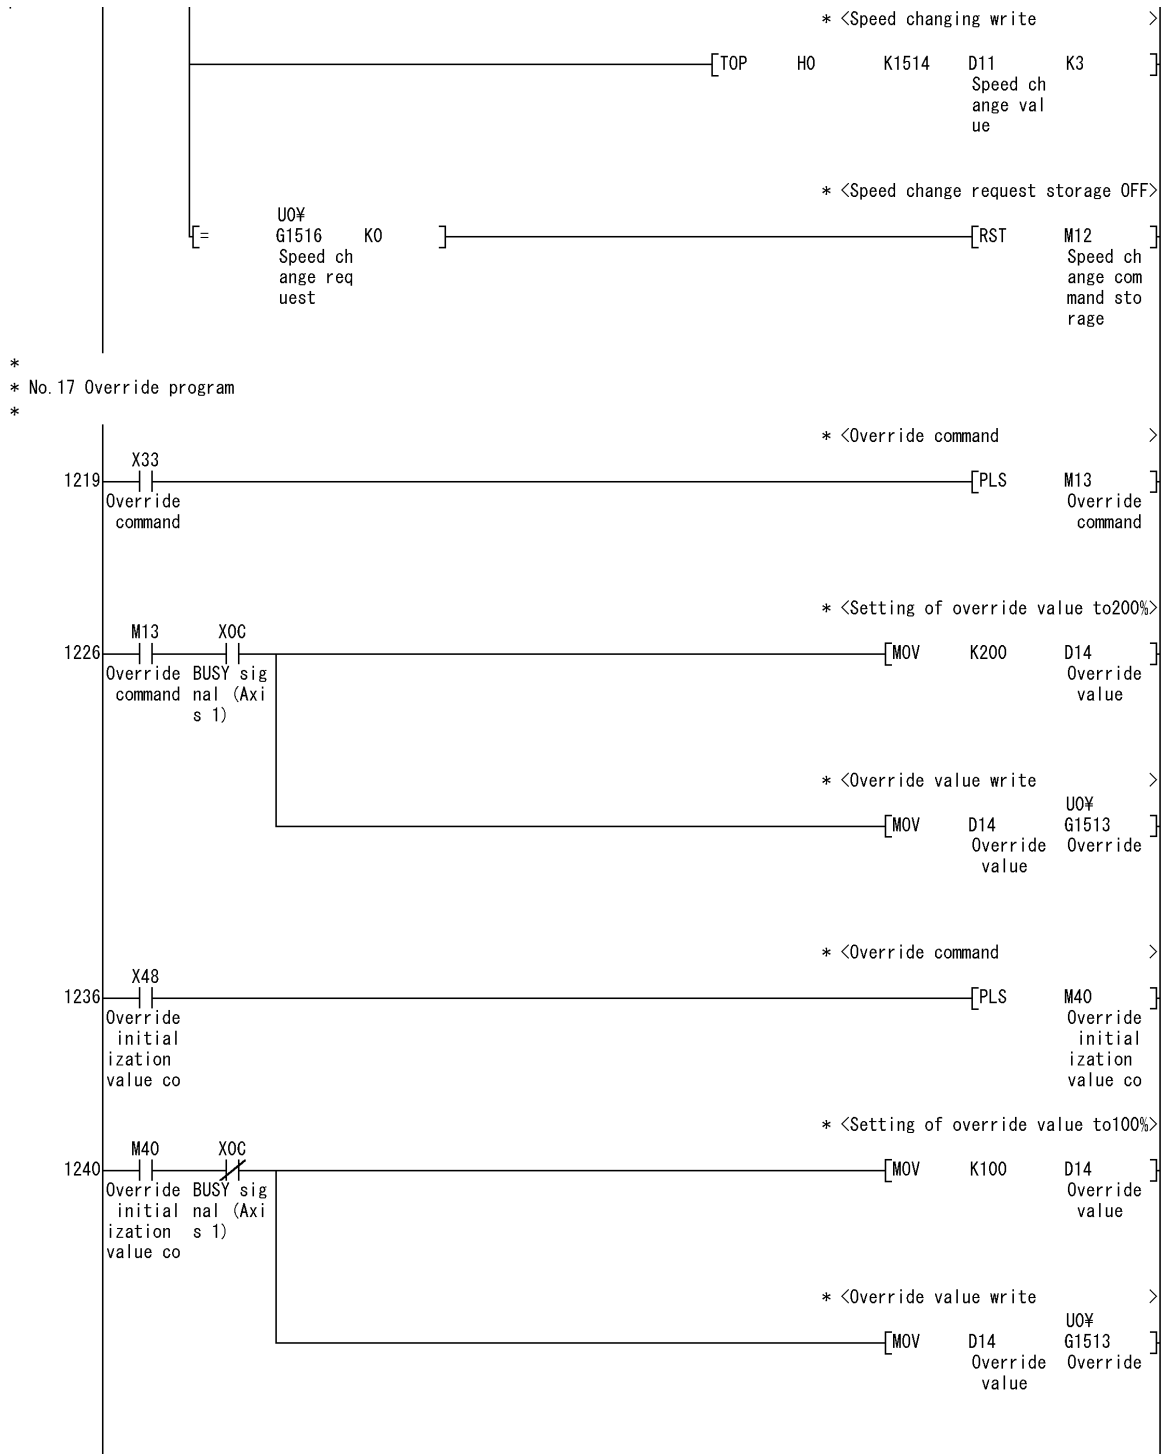





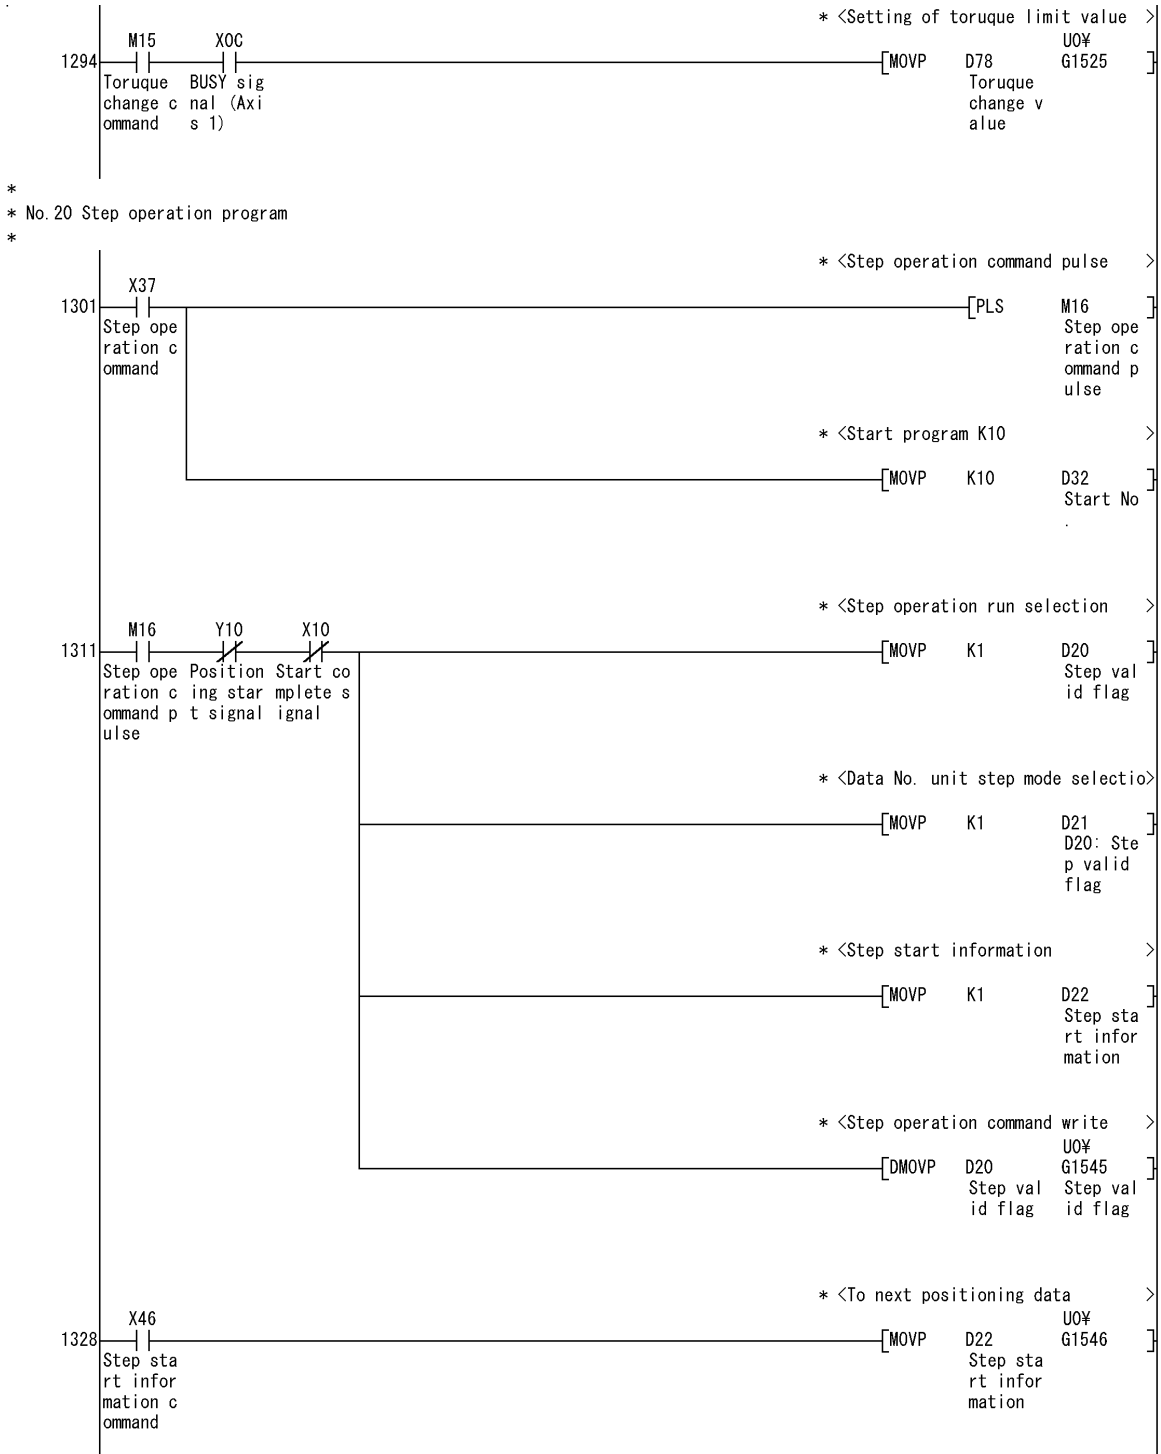


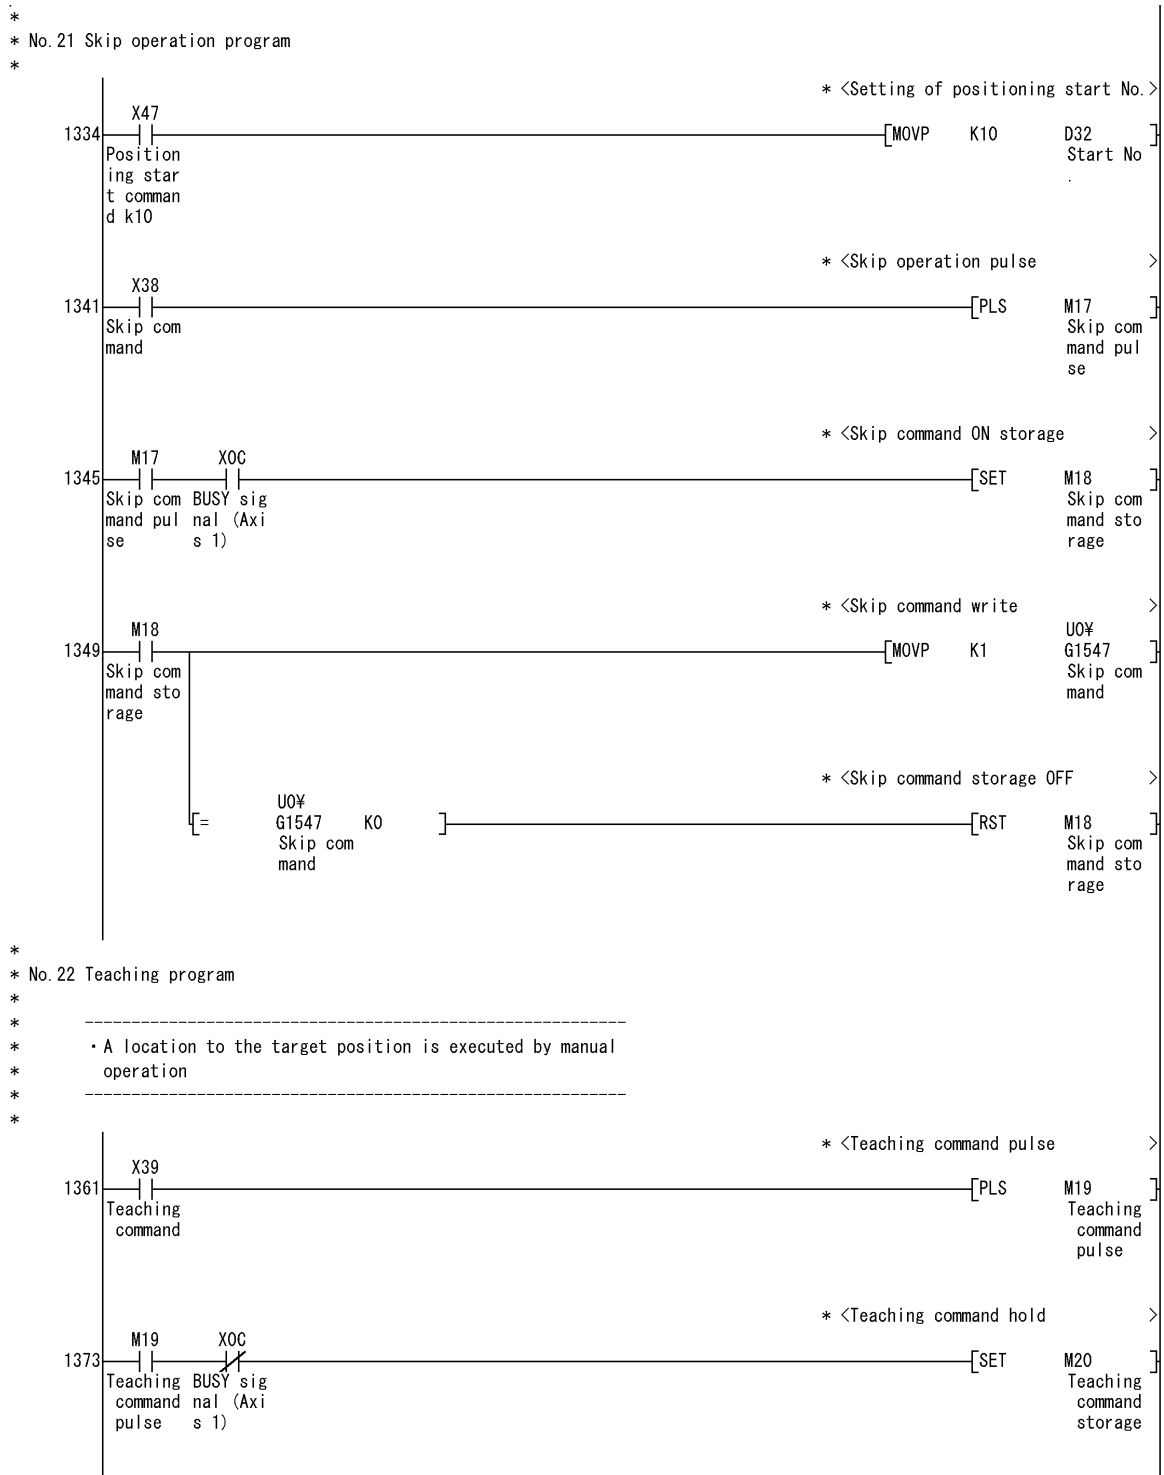




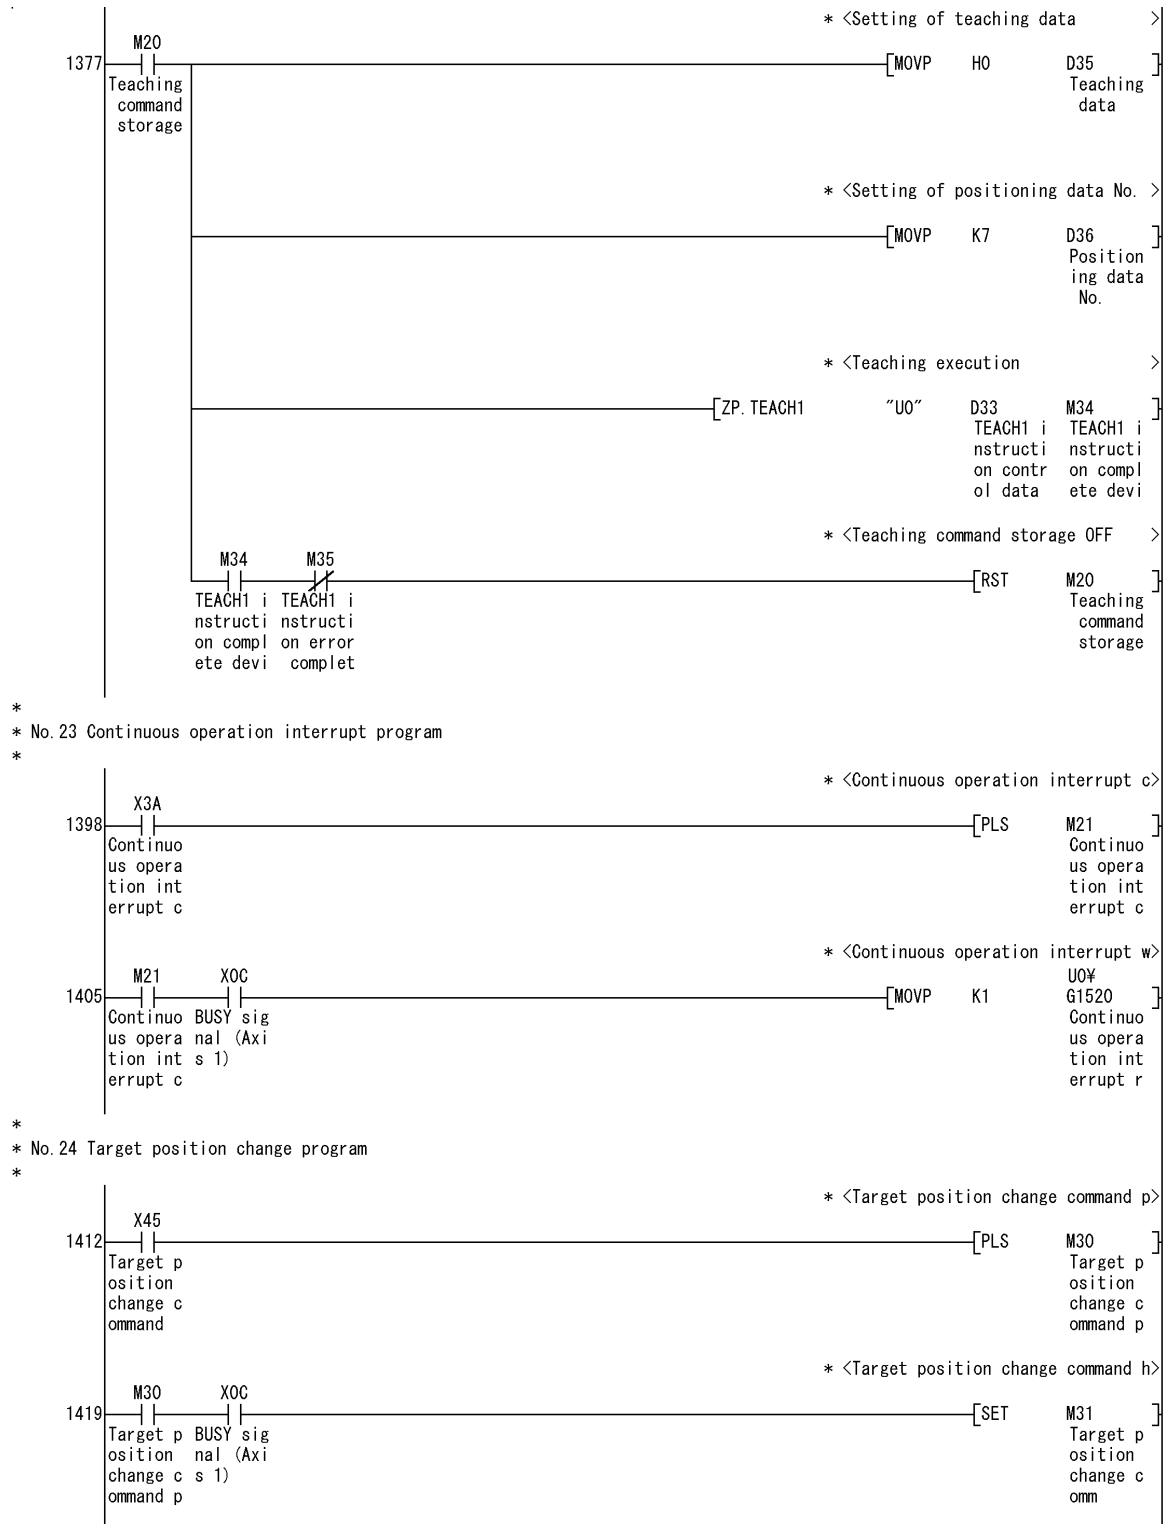

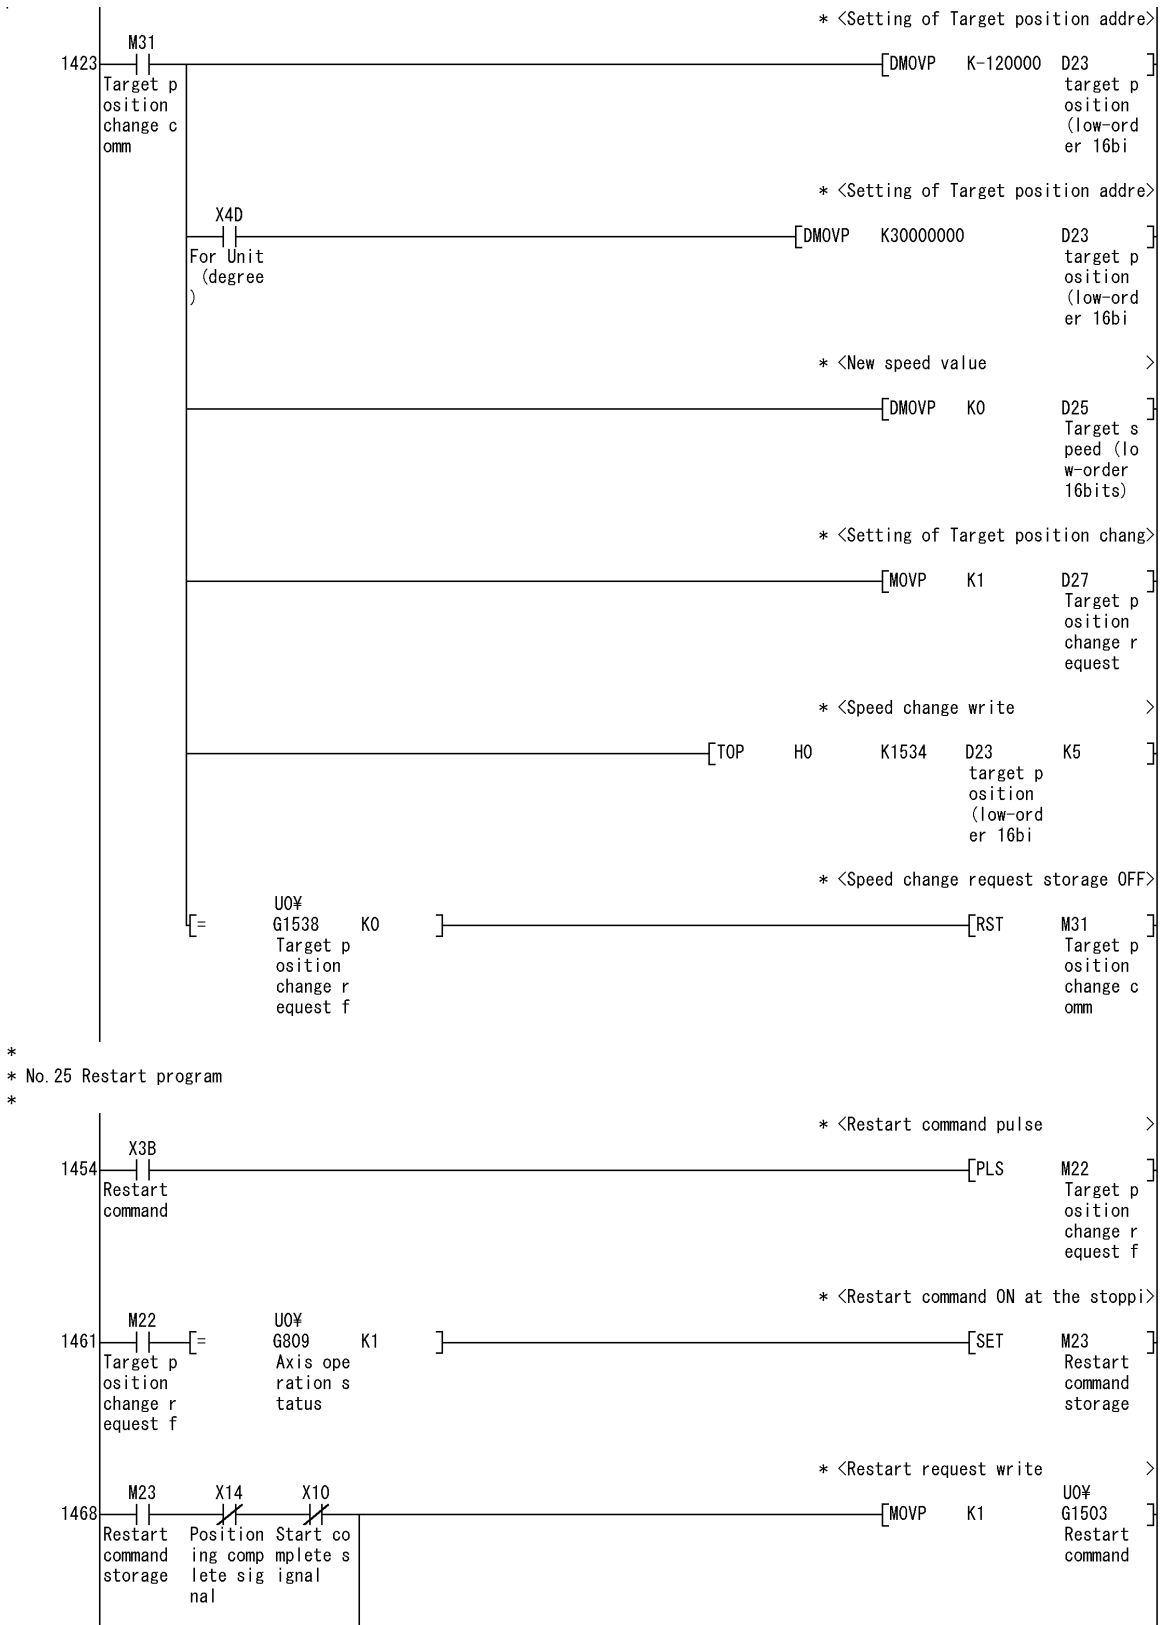

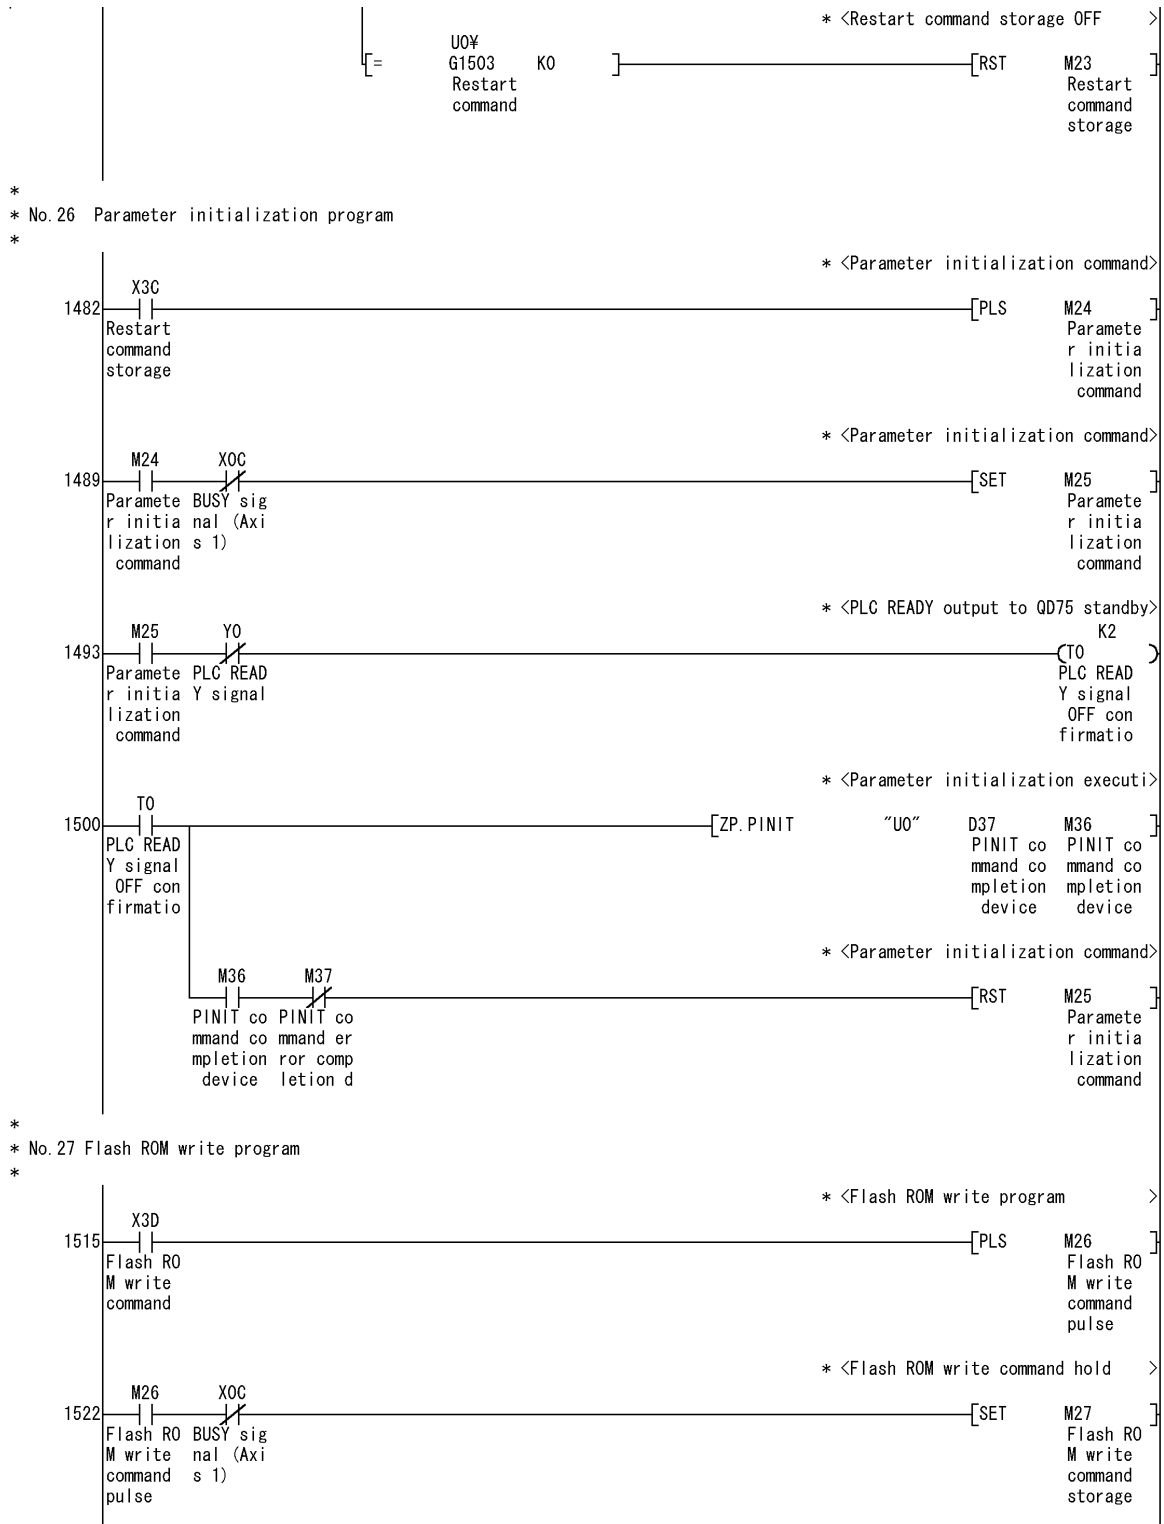

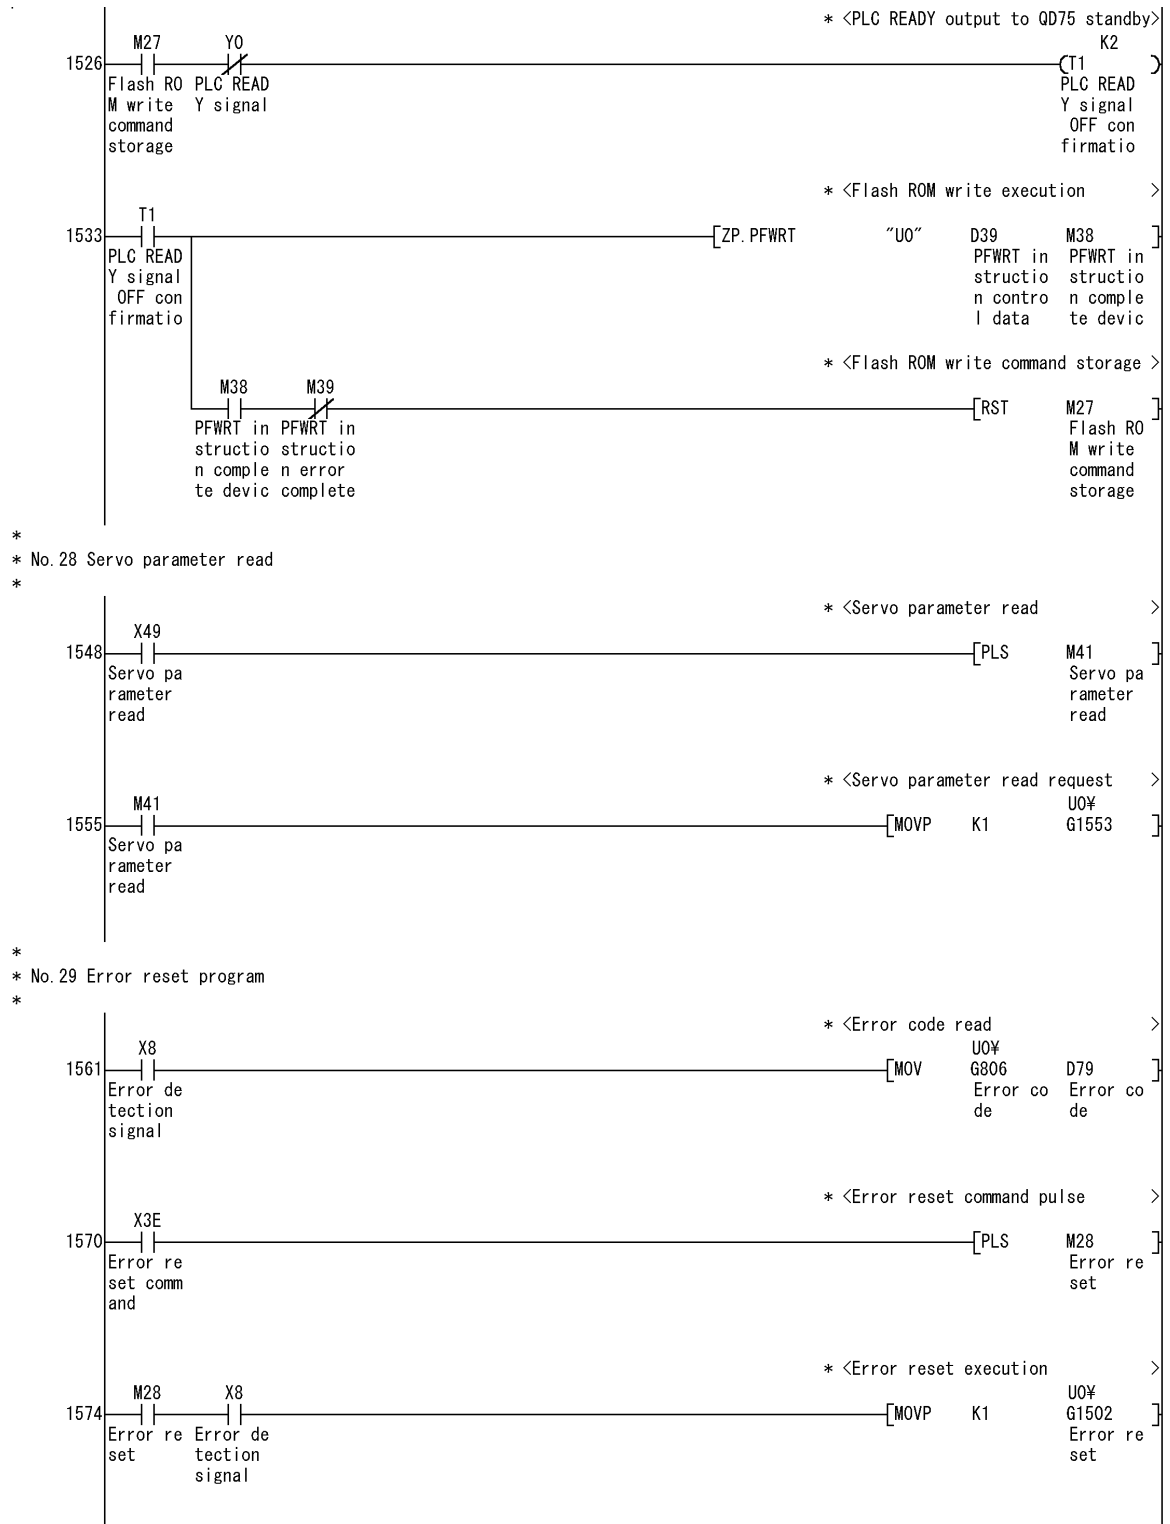



6.5 Program details

6.5.1 Initialization program

[1] OPR request OFF program

This program forcibly turns OFF the "OPR request flag" ( [Md.31] Status: b3) which is ON.

When using a system that does not require OPR, assemble the program to cancel the "OPR request" made by the QD75 when the power is turned ON, etc.

■ Data requiring setting

Set the following data to use the OPR request flag OFF request.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Cd.19] OPR request flag OFF request	1	Set to "1: Turn OPR request flag OFF".	1521	1621	1721	1821

\* Refer to Section 5.7 "List of control data" for details on the setting details.

■ Time chart for OPR OFF request

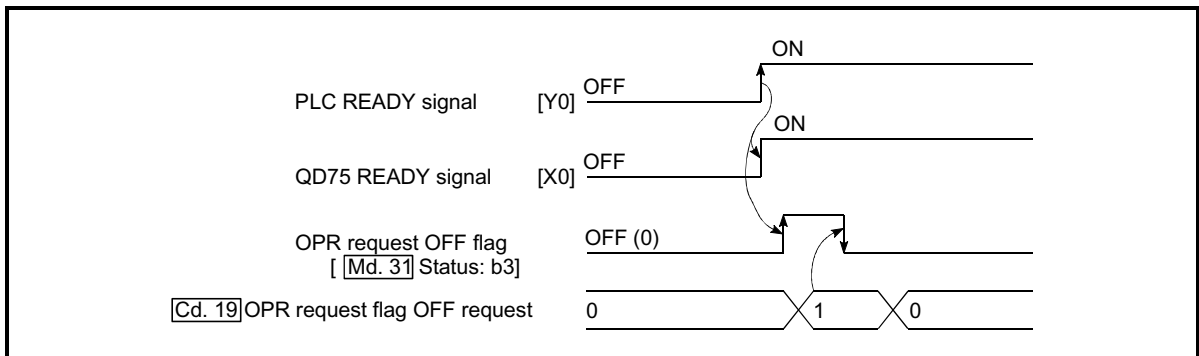


Fig. 6.1 Time chart for OPR OFF request

[2] External command function valid setting program

This program is used to validate the "external command signal" beforehand when using the external command functions (external start, speed change, speed-position switching, position-speed switching, skip). (Set which function to use beforehand in " [Pr.42] External command function selection".)

Set the following data to validate the "external command signal".

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Cd.8] External command valid	1	Set to "1: Validate external command".	1505	1605	1705	1805

\* Refer to Section 5.7 "List of control data" for details on the setting details.

## 6.5.2 Start details setting program

This program sets which control, out of "OPR", "major positioning control" or "high-level positioning control" to execute. For "high-level positioning control", "fast OPR", "speed-position switching control" and "position-speed switching control", add the respectively required PLC program.

(Refer to "Chapter 10" for details on starting the "high-level positioning control.")

### ■ Procedures for setting the starting details

- (1) Set the "positioning start No." corresponding to the control to be started in "Cd.3 Positioning start No."

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.3	→	1 to 600 : Positioning data No. 9001 : Machine OPR 9002 : Fast OPR 9003 : Current value changing 9004 : Simultaneous start 7000 to 7004 : Block No. (For "high-level positioning control")	1500	1600	1700	1800

\* Refer to Section 5.7 "List of control data" for details on the setting details.

- (2) For "high-level positioning control", set the "positioning start point No." of the block to be started in "Cd.4 Positioning start point No."

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.4	→	1 to 50 : Point No. of block start data	1501	1601	1701	1801

\* Refer to Section 5.7 "List of control data" for details on the setting details.

- (3) Set the following control data for "speed-position switching control (INC mode)".

(Set "Cd.23 Speed-position switching control movement amount change register as required". Setting is not required in the ABS mode.)

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.23	→	Set the new value when the position control's movement amount is to be changed during speed control.	1526 1527	1626 1627	1726 1727	1826 1827
Cd.24	1	When "1" is set, the speed-position switching signal will be validated.	1528	1628	1728	1828

\* Refer to Section 5.7 "List of control data" for details on the setting details.

- (4) For "position-speed switching control", set the control data shown below.  
 (As required, set the " Cd.25 Position-speed switching control speed change resistor".)

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
<span style="border: 1px solid black; padding: 0 2px;">Cd.25</span> Position-speed switching control speed change resistor	→	Used to set a new value when speed is changed during positioning control.	1530 1531	1630 1631	1730 1731	1830 1831
<span style="border: 1px solid black; padding: 0 2px;">Cd.26</span> Position-speed switching enable flag	1	To validate position-speed switching signal, this is set to 1.	1532	1632	1732	1832

\* Refer to Section 5.7 "List of control data" for details on the setting details.



6.5.3 Start program

This program is used to start the control with start commands.  
 The control can be started with the following two methods.

- [1] Starting by inputting positioning start signal [Y10, Y11, Y12, Y13]
- [2] Starting by inputting external command signal

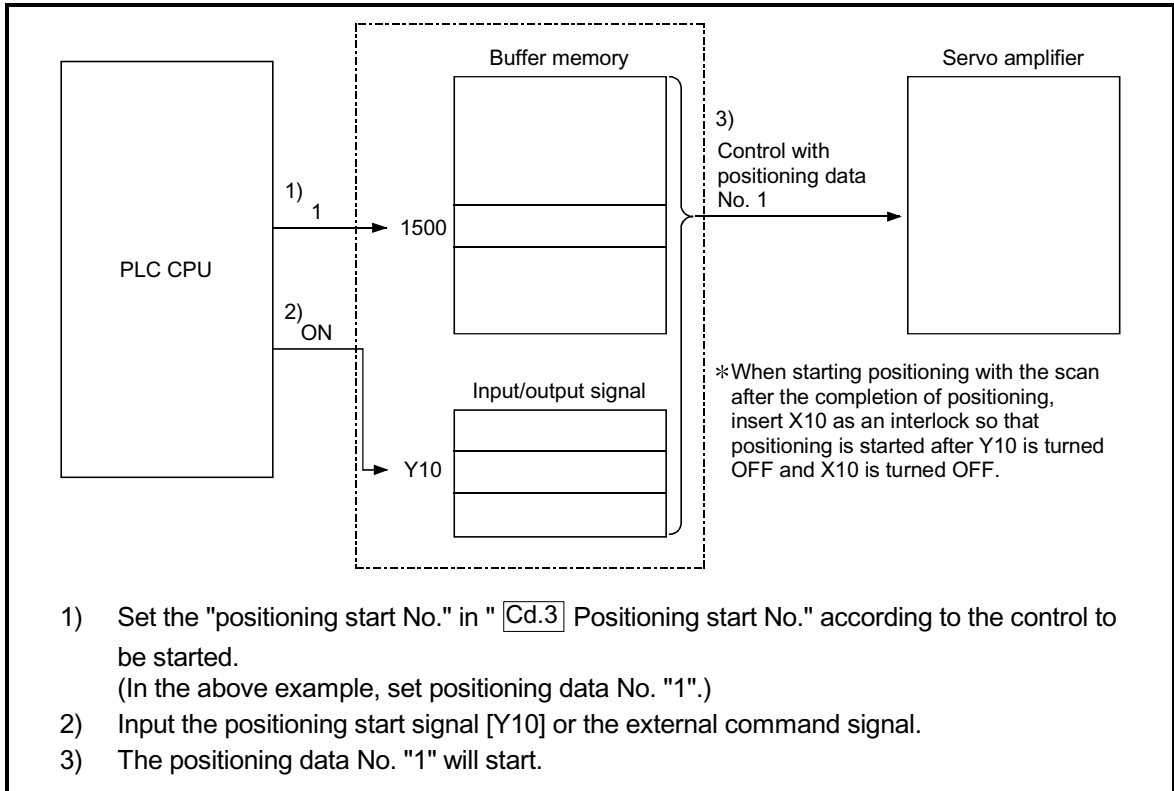


Fig. 6.2 Procedures for starting control (for axis 1)

■ Servo ON conditions

Setting of servo parameter



PLC READY signal Y0 ON



All axis servo ON Y1 ON

■ Starting conditions

To start the control, the following conditions must be satisfied.

The necessary start conditions must be incorporated in the PLC program so that the control is not started when the conditions are not satisfied.

Signal name		Signal state		Device			
				Axis 1	Axis 2	Axis 3	Axis 4
Interface signal	PLC READY signal	ON	PLC CPU preparation completed	Y0			
	QD75 READY signal	ON	QD75 preparation completed	X0			
	All axis servo ON	ON	All axis servo is ON	Y1			
	Synchronization flag *	ON	QD75 buffer memory Accessible	X1			
	Axis stop signal	OFF	Axis stop signal is OFF.	Y4	Y5	Y6	Y7
	M code ON signal	OFF	M code ON signal is OFF.	X4	X5	X6	X7
	Error detection signal	OFF	No error is present.	X8	X9	XA	XB
	BUSY signal	OFF	BUSY signal is OFF.	XC	XD	XE	XF
	Start complete signal	OFF	Start complete signal is OFF.	X10	X11	X12	X13
External signal	Stop signal	OFF	Stop signal is OFF.	-			
	Upper limit (FLS)	ON	Within limit range	-			
	Lower limit (RLS)	ON	Within limit range	-			

※: When the synchronous setting of the PLC CPU is made in the nonsynchronous mode, this must be provided as an interlock.  
 When it is made in the synchronous mode, no interlock must be provided in the program because the flag is turned ON when calculation is run on the PLC CPU.

[1] Starting by inputting positioning start signal

■ Operation when starting

- (1) When the positioning start signal turns ON, the start complete signal and BUSY signal turn ON, and the positioning operation starts.  
It can be seen that the axis is operating when the BUSY signal is ON.
- (2) When the positioning start signal turns OFF, the start complete signal also turns OFF.  
If the positioning start signal is ON even after positioning is completed, the start complete signal will remain ON.
- (3) If the positioning start signal turns ON again while the BUSY signal is ON, the warning "operating start (warning code: 100)" will occur.
- (4) The process taken when positioning is completed will differ according to case (a) and (b) below.
  - (a) When next positioning is not to be carried out
    - ⊖ If a dwell time is set, the system will wait for the set time to pass, and then positioning will be completed.
    - ⊖ When positioning is completed, the BUSY signal will turn OFF and the positioning complete signal will turn ON. However, when using speed control or when the positioning complete signal ON time is "0", the signal will not turn ON.
    - ⊖ When the positioning complete signal ON time is passed, the positioning complete signal will turn OFF.
  - (b) When next positioning is to be carried out
    - ⊖ If a dwell time is set, the system will wait for the set time to pass.
    - ⊖ When the set dwell time is passed, the next positioning will start.

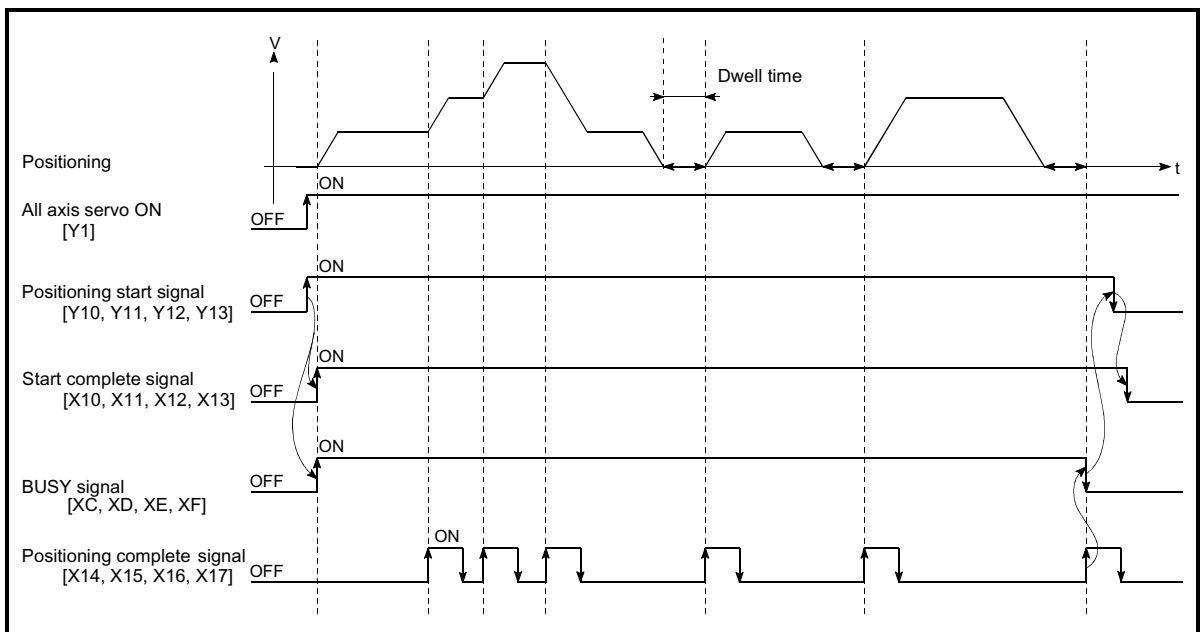


Fig. 6.3 ON/OFF timing of each signal at start of positioning

**POINT**  
 The BUSY signal [XC, XD, XE, XF] turns ON even when position control of movement amount 0 is executed. However, since the ON time is short, the ON status may not be detected in the PLC program.  
 (The ON status of the start complete signal [X10, X11, X12, X13], positioning complete signal [X14, X15, X16, X17] and M code ON signal [X4, X5, X6, X7] can be detected in the PLC program.)

■ Starting time chart

The time chart for starting each control is shown below.

(1) Time chart for starting "machine OPR"

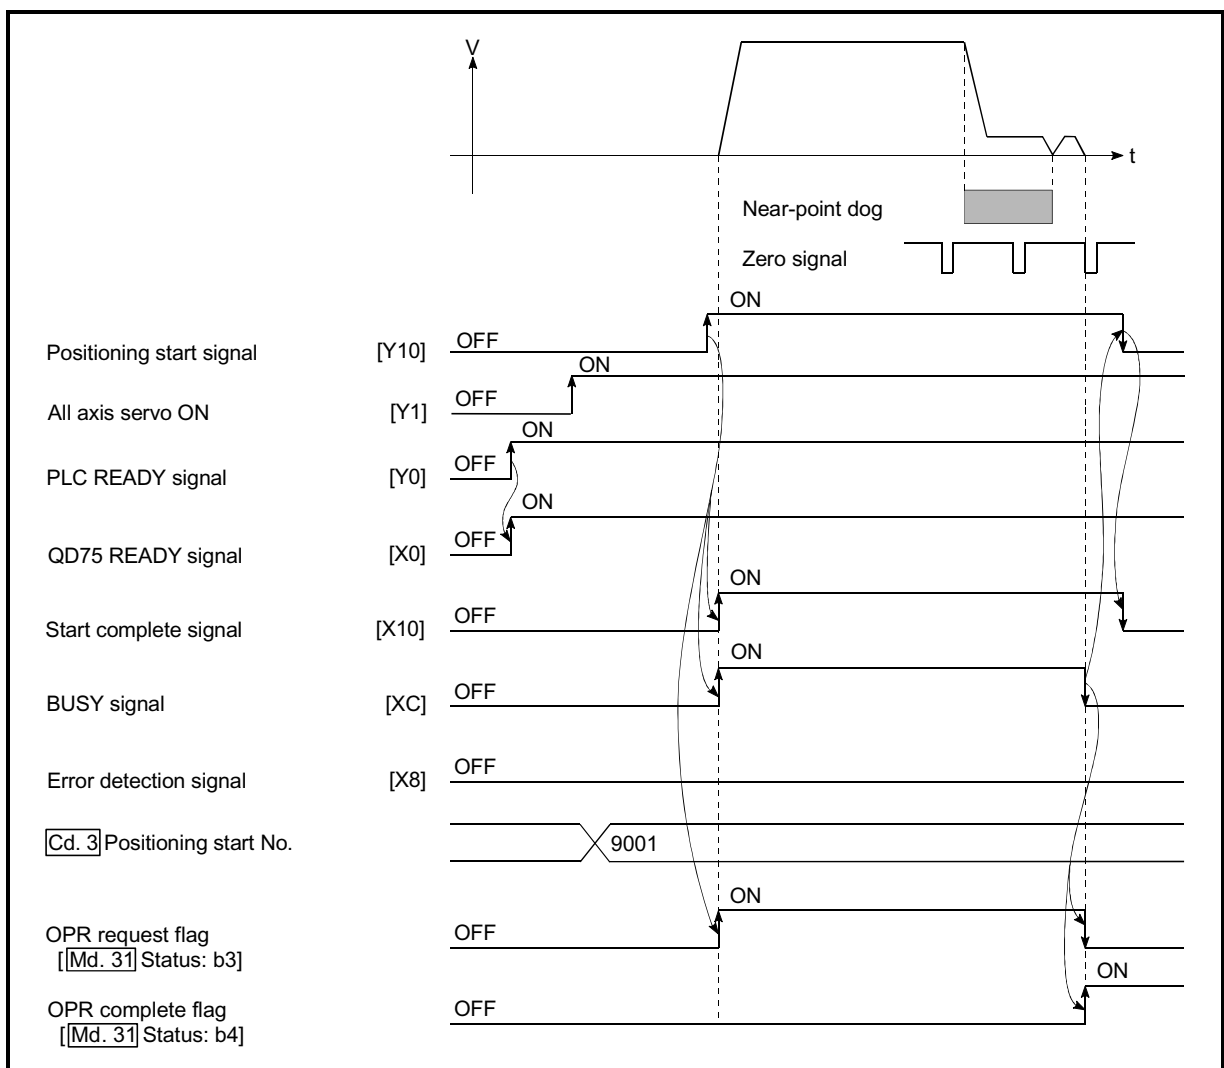


Fig. 6.4 Time chart for starting "machine OPR"

(2) Time chart for starting "fast OPR"

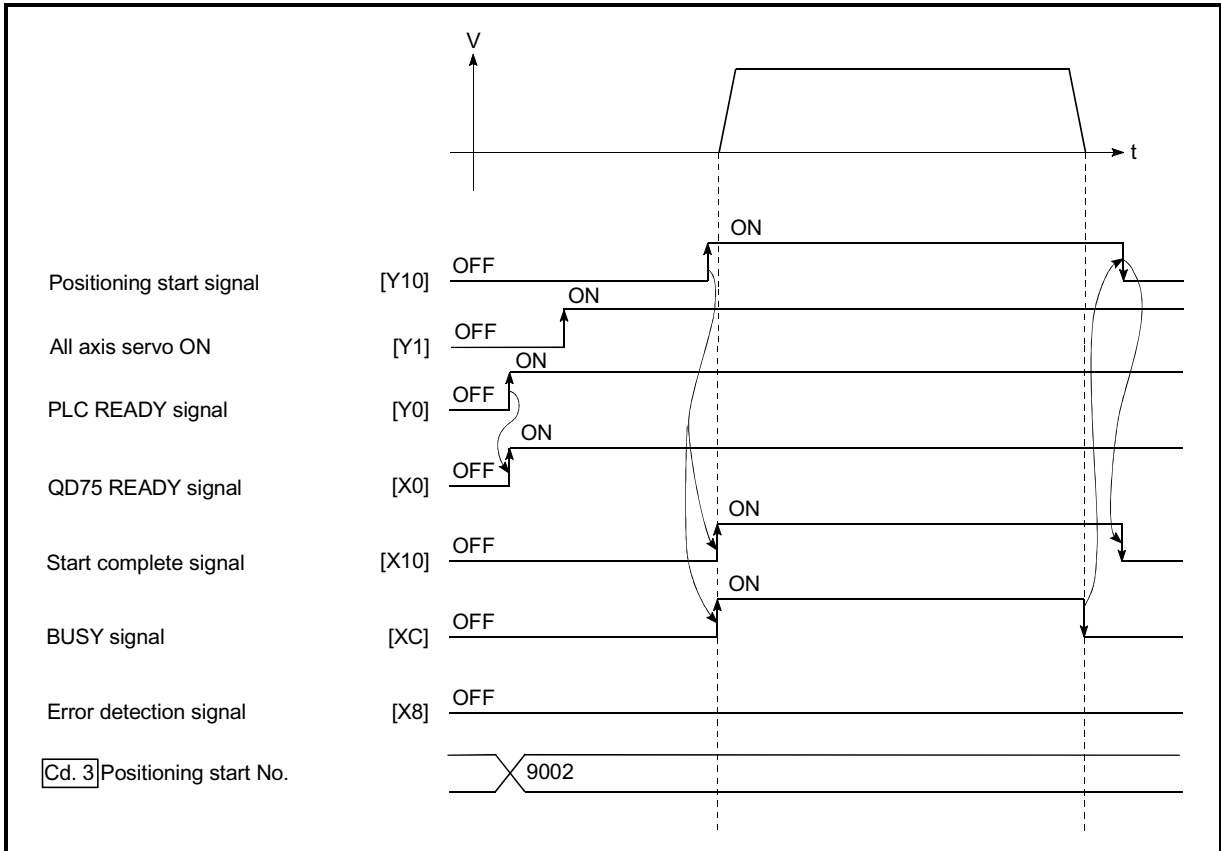


Fig. 6.5 Time chart for starting "fast OPR"

(3) Time chart for starting "major positioning control"

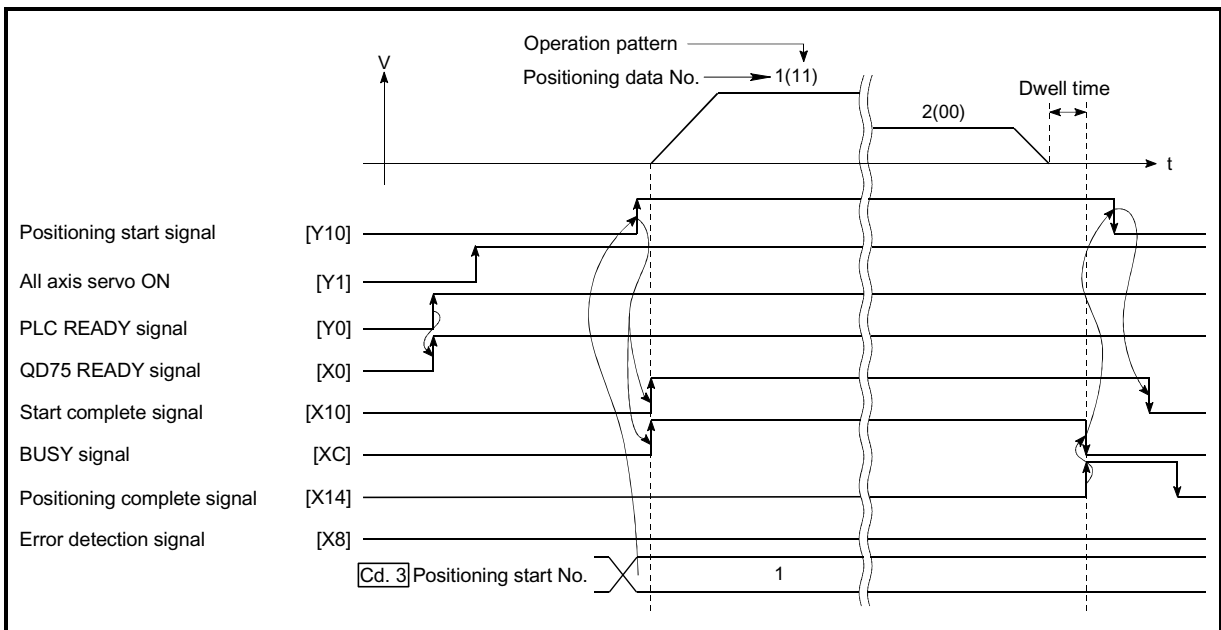


Fig. 6.6 Time chart for starting "major positioning control"

(4) Time chart for starting "speed-position switching control"

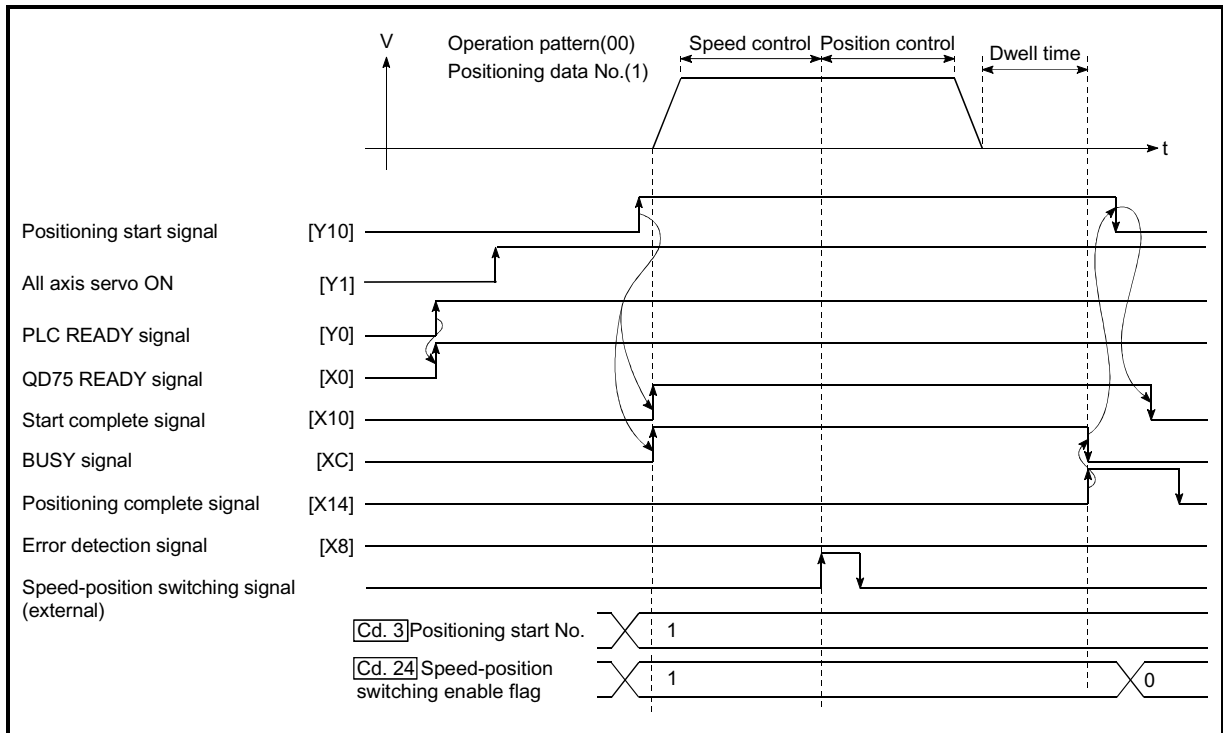


Fig. 6.7 Time chart for starting "speed-position switching control"

(5) Time chart for starting "position-speed switching control"

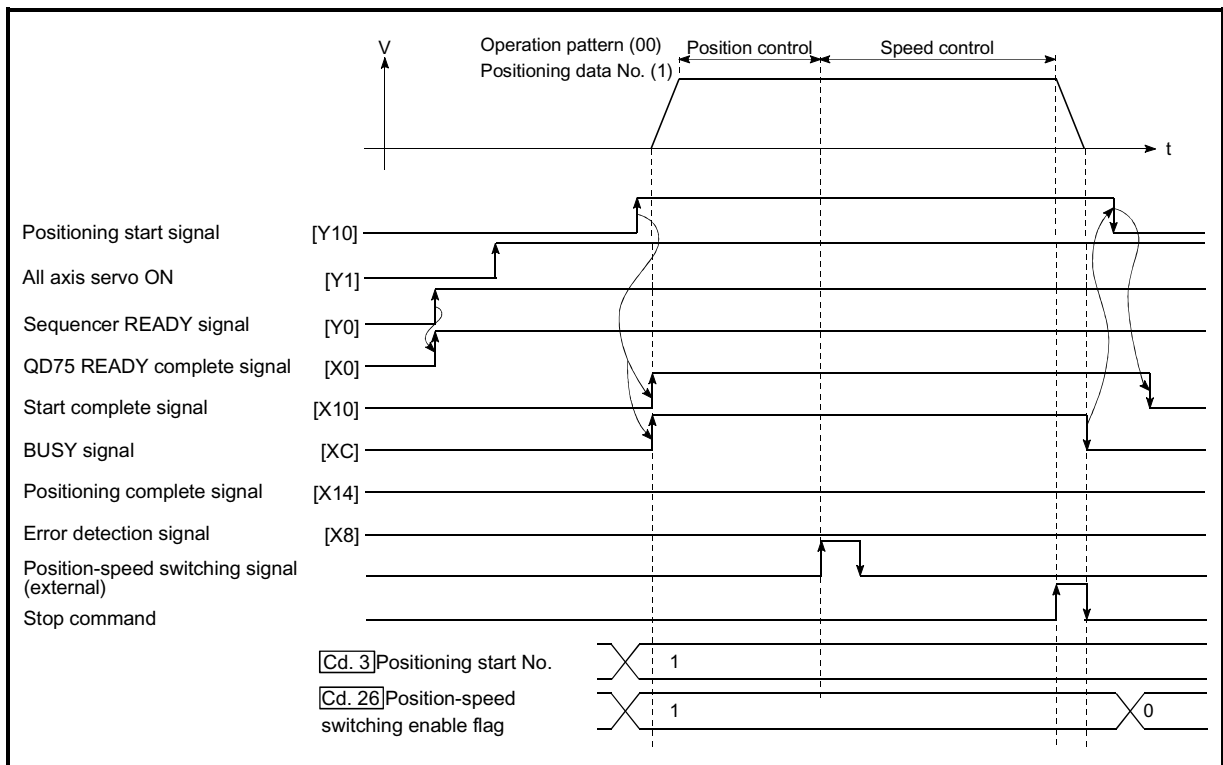


Fig. 6.8 Time chart for starting "position-speed switching control"

■ Machine OPR operation timing and process time

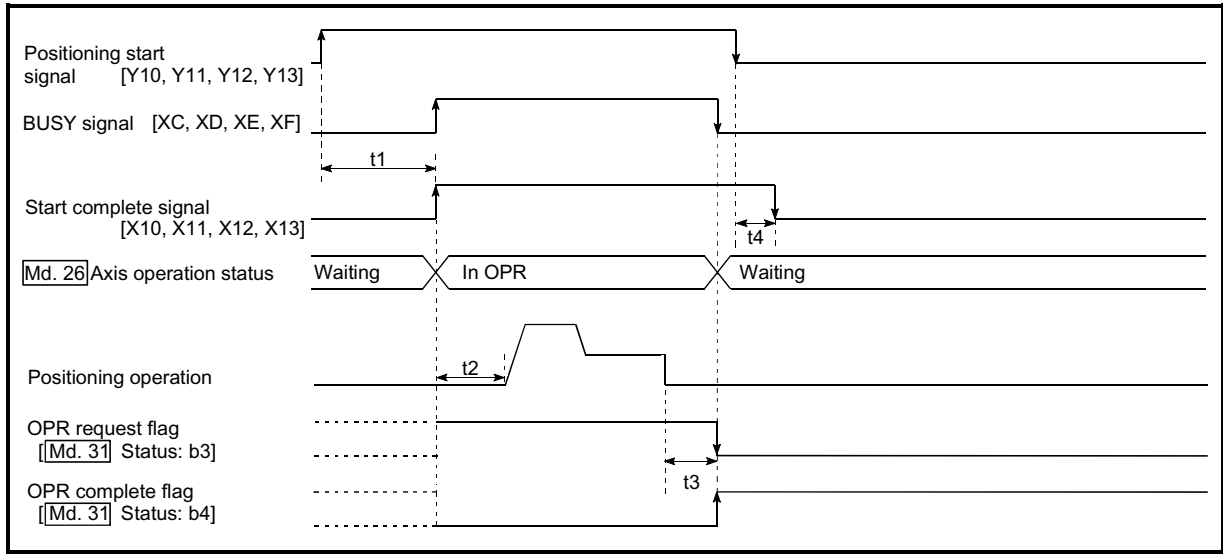


Fig. 6.9 Machine OPR operation timing and process time

Normal timing time

Unit: ms

t1	t2	t3	t4
1.0 to 1.4	5.5 to 7.9	0 to 3.5	0 to 3.5

⚠ The t1 timing time could be delayed depending on the operating conditions of the other axis.

■ Position control operation timing and process time

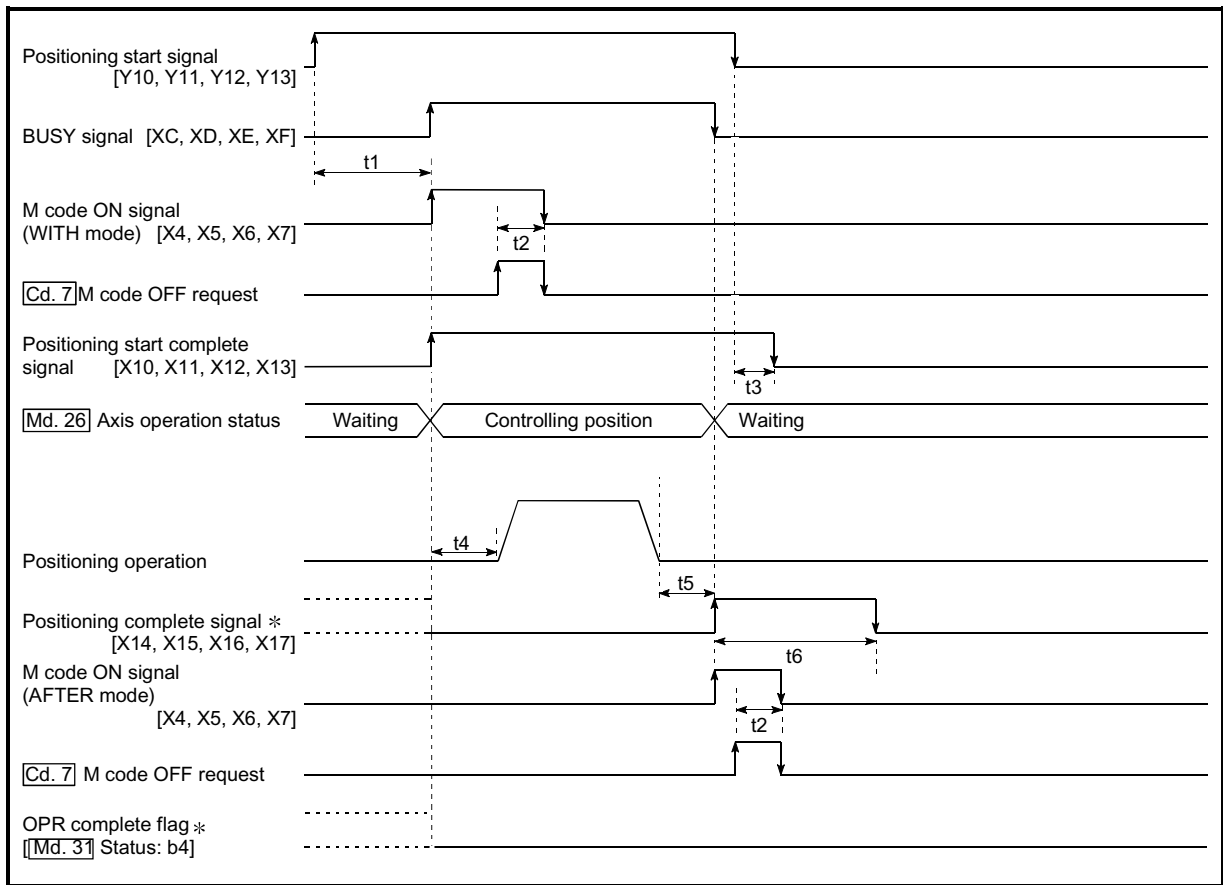


Fig. 6.10 Position control operation timing and process time

≠# When the positioning start signal turns ON, if all signals marked with an asterisk (\*) are already ON, the signals marked with an asterisk (\*) will turn OFF when the positioning start signal turns ON.

Normal timing time

Unit: ms

t1	t2	t3	t4	t5	t6
1.2 to 2.3	0 to 3.5	0 to 3.5	5.5 to 7.9	0 to 3.5	Follows parameters

≠ The t1 timing time could be delayed depending on the operating conditions of the other axis.



[2] Starting by inputting external command signal

When starting positioning control by inputting the external command signal, the start command can be directly input into the QD75. This allows the variation time equivalent to one scan time of the PLC CPU to be eliminated. This is an effective procedure when operation is to be started as quickly as possible with the start command or when the starting variation time is to be suppressed. To start positioning control by inputting the external command signal, set the "data required to be set" and then turn ON the external command signal.

■ Restrictions

When starting by inputting the external command signal, the start complete signal [X10, X11, X12, X13] will not turn ON.

■ Data required to be set

To execute positioning start with the external command signal, set parameter ( [Pr.42] ) beforehand, and validate the "external command signal" with the "external command signal validity setting program (program No. 5).

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Pr.42] External command function selection	0	Set to "0: External positioning start".	62	212	362	512
[Cd.8] External command valid	1	Set to "1: Validate external command".	1505	1605	1705	1805

\* Refer to Chapter 5 "Data Used for Positioning Control" for details on the setting details.

■ Starting time chart

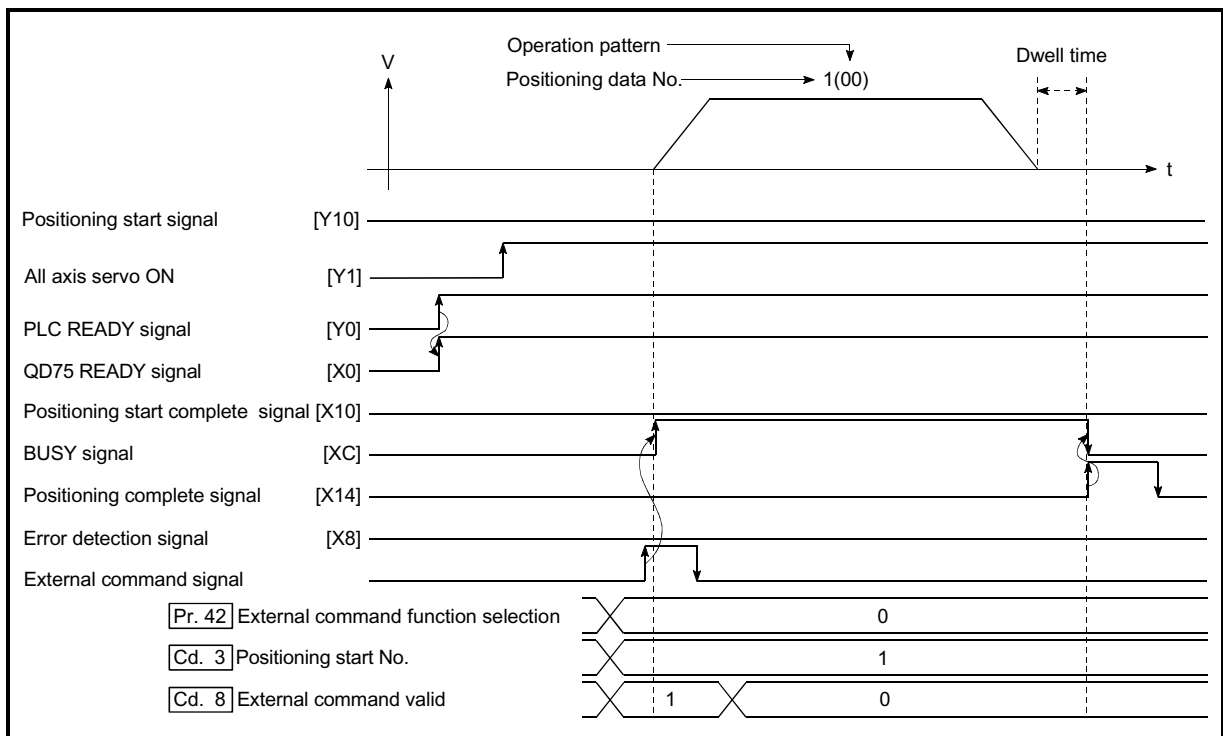


Fig. 6.11 Time chart for starting with external start signal

### 6.5.4 Continuous operation interrupt program

During positioning control, the control can be interrupted during continuous positioning control and continuous path control (continuous operation interrupt function). When "continuous operation interruption" is execution, the control will stop when the operation of the positioning data being executed ends. To execute continuous operation interruption, set "1: Continuous operation interrupt request" for " Cd.18 Interrupt request during continuous operation".

#### [1] Operation during continuous operation interruption

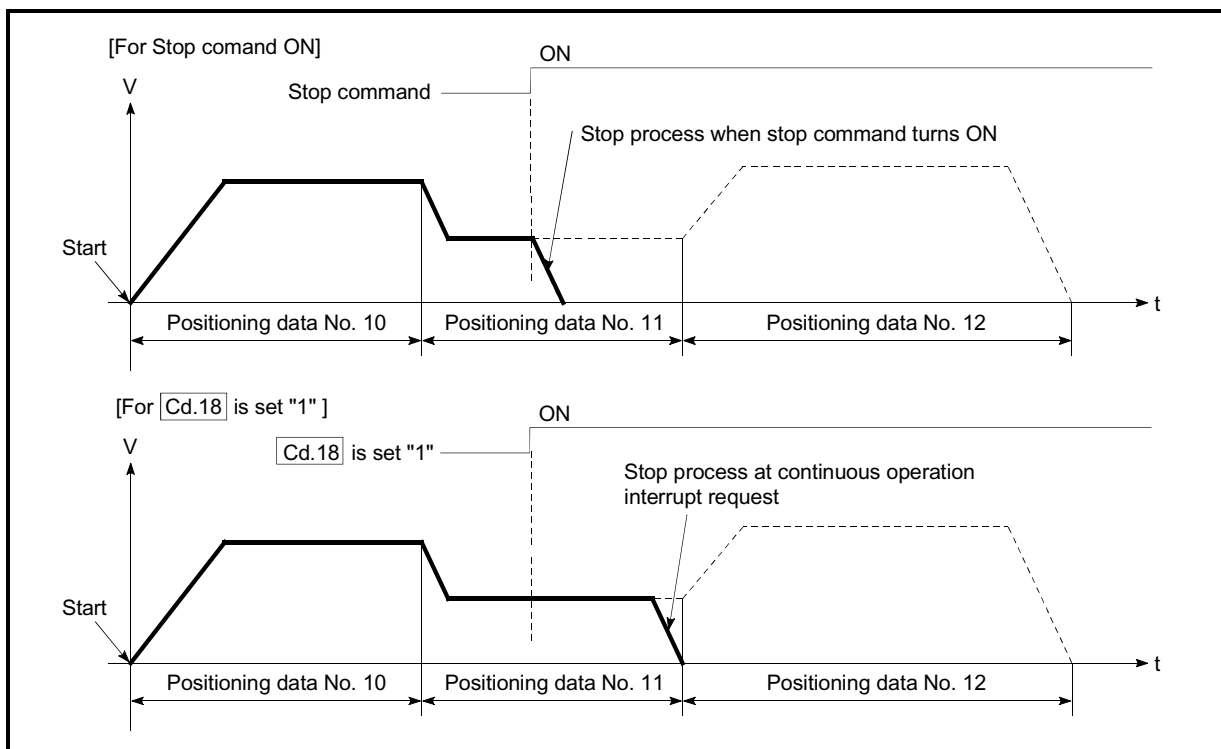


Fig. 6.12 Operation during continuous operation interruption


#### [2] Restrictions

- (1) When the "continuous operation interrupt request" is executed, the positioning will end.  
Thus, after stopping, the operation cannot be "restarted".  
When " Cd.6 Restart command" is issued, a warning "Restart not possible" (warning code: 104) will occur.
- (2) Even if the stop command is turned ON after executing the "continuous operation interrupt request", the "continuous operation interrupt request" cannot be canceled.  
Thus, if "restart" is executed after stopping by turning the stop command ON, the operation will stop when the positioning data No. where "continuous operation interrupt request" was executed is completed.

(3) If the operation cannot be decelerated to a stop because the remaining distance is insufficient when "continuous operation interrupt request" is executed with continuous path control, the interruption of the continuous operation will be postponed until the positioning data shown below.

- ≒ Positioning data No. have sufficient remaining distance
- ≒ Positioning data No. for positioning complete (pattern: 00)
- ≒ Positioning data No. for continuous positioning control (pattern: 01)

Even when the continuous operation interrupt is requested, the remaining distance is insufficient, and thus, the operation cannot stop at the positioning No. being executed.

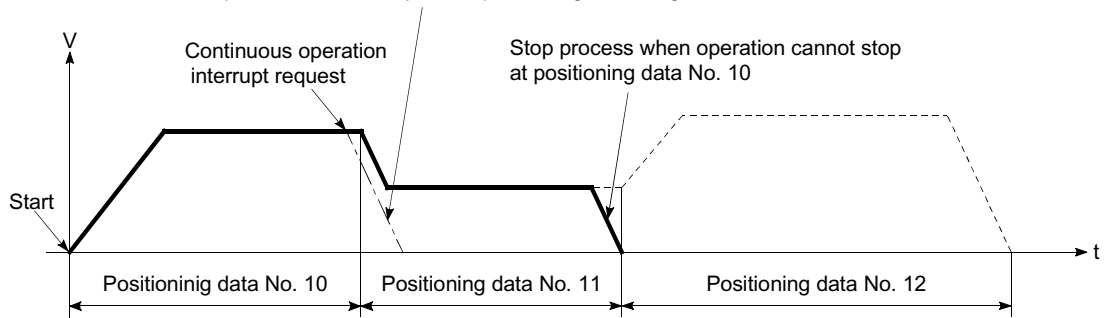

(4) When operation is not performed (BUSY signal [XC, XD, XE, XF] is OFF), the interrupt request during continuous operation is not accepted. It is cleared to 0 at a start or restart.

[3] Control data requiring settings

Set the following data to interrupt continuous operation.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.18 Interrupt request during continuous operation	1	Set "1: Interrupt request during continuous operation".	1520	1620	1720	1820

\* Refer to Section 5.7 "List of control data" for details on the setting details.

### 6.5.5 Restart program

When a stop factor occurs during position control and the operation stops, the positioning can be restarted from the stopped position to the position control end point by using the "restart command" ( [Cd.6](#) Restart command).

("Restarting" is not possible when "continuous operation is interrupted.")

#### [1] Restart operation

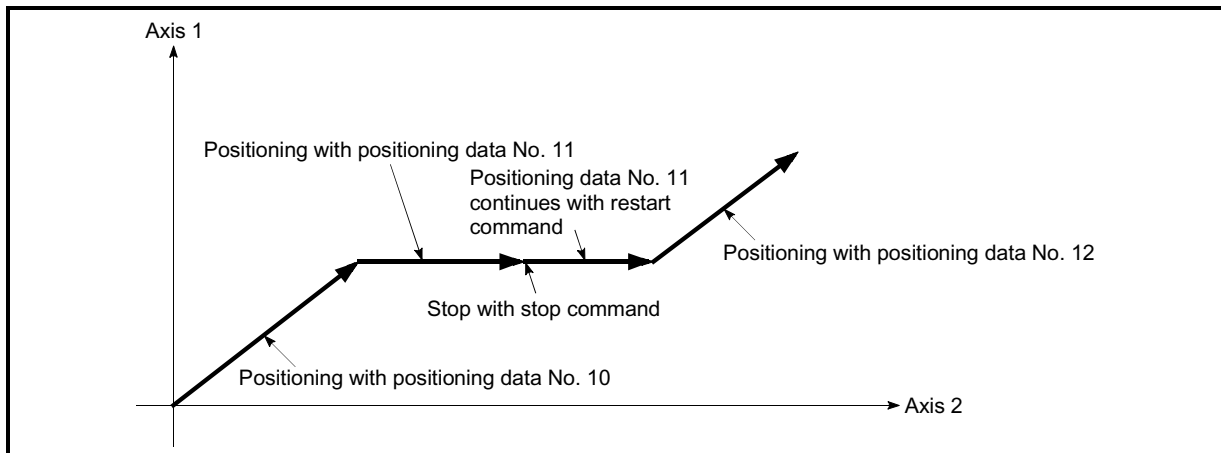


Fig. 6.13 Restart operation

#### [2] Restrictions

- (1) Restarting can be executed only when the " [Md.26](#) Axis operation status" is "stopped".  
If the axis operation is not "stopped", restarting is not possible.
- (2) Do not execute restart while the stop command is ON.  
If restart is executed while stopped, an error "Stop signal ON at start" (error code: 106) will occur, and the " [Md.26](#) Axis operation status" will change to "error occurring".  
Thus, even if the error is reset, the operation cannot be restarted.
- (3) Restarting can be executed even while the positioning start signal is ON.  
However, make sure that the positioning start signal does not change from OFF to ON while stopped.  
If the positioning start signal changes from OFF to ON, positioning will start from the positioning data No. of designated point's positioning data No. set in " [Cd.3](#) Positioning start No.".
- (4) If positioning is ended with the continuous operation interrupt request, the operation cannot be restarted.  
If restart is requested, a warning "Restart not possible" (warning code: 104) will occur.
- (5) When stopped with interpolation operation, write "1: Restarts" into " [Cd.6](#) Restart command" for the reference axis, and then restart.
- (6) If the " [Md.26](#) Axis operation status" is not "stopped" when restarting, a warning "Restart not possible" (warning code: 104) will occur, and the process at that time will be continued.

**REMARK**

Restarting after stopping is possible even for the following control.

- ≠ Incremental system position control    ≠ Continuous positioning control
- ≠ Continuous path control                    ≠ Block start

**[3] Control data requiring setting**

Set the following data to execute restart.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
<b>Cd.6</b> Restart command	1	Set "1: Restarts".	1503	1603	1703	1803

\* Refer to Section 5.7 "List of control data" for details on the setting details.

**[4] Restarting conditions**

The following conditions must be satisfied when restarting. (Assemble the required conditions into the PLC program as an interlock.)

**(1) Operation state**

\* " **Md.26** Axis operation status" is "1: Stopped"

**(2) Signal state**

Signal name	Signal state	Device							
		Axis 1	Axis 2	Axis 3	Axis 4				
Interface signal	PLC READY signal	ON	PLC CPU preparation completed			Y0			
	QD75 READY signal	ON	QD75 preparation completed			X0			
	All axis servo ON	ON	All axis servo ON			Y1			
	Synchronization flag *	ON	QD75 buffer memory Accessible			X1			
	Axis stop signal	OFF	Axis stop signal is OFF			Y4	Y5	Y6	Y7
	M code ON signal	OFF	M code ON signal is OFF			X4	X5	X6	X7
	Error detection signal	OFF	No error is present			X8	X9	XA	XB
	BUSY signal	OFF	BUSY signal is OFF			XC	XD	XE	XF
Start complete signal	OFF	Start complete signal is OFF			X10	X11	X12	X13	
External signal	Stop signal	OFF	Stop signal is OFF			-			
	Upper limit (FLS)	ON	Within limit range			-			
	Lower limit (RLS)	ON	Within limit range			-			

\*: When the synchronous setting of the PLC CPU is made in the nonsynchronous mode, this must be provided as an interlock.

When it is made in the synchronous mode, no interlock must be provided in the program because the flag is turned ON when calculation is run on the PLC CPU.

(5) Time chart for restarting

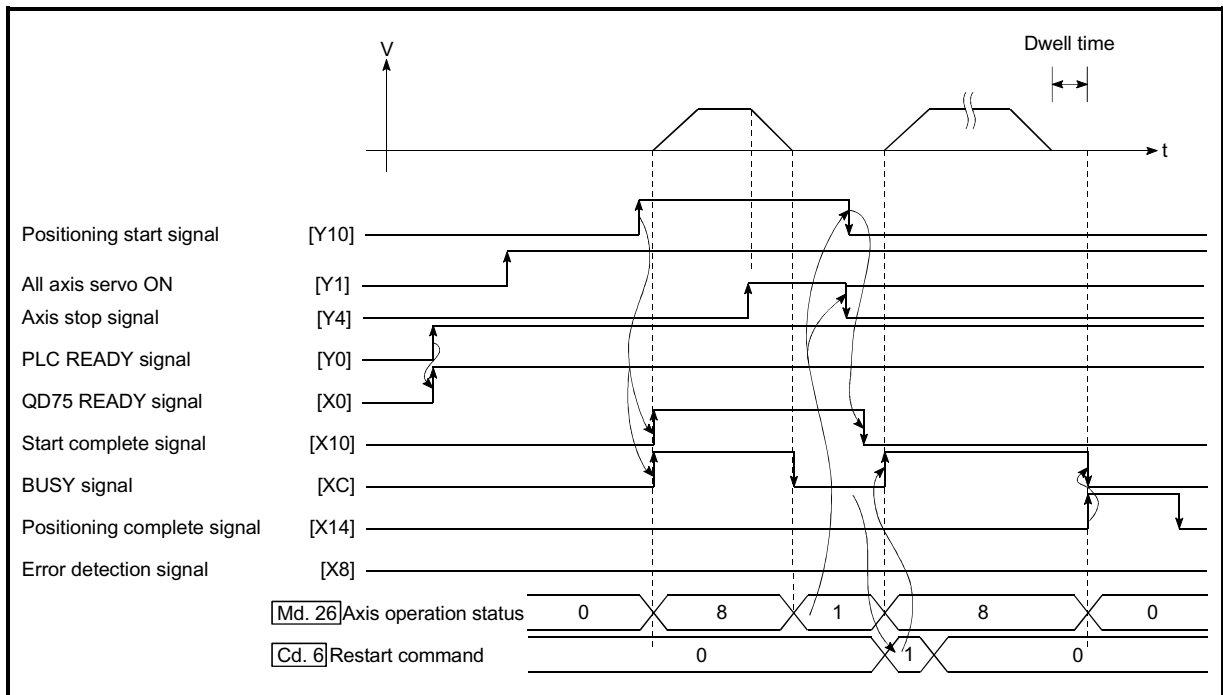


Fig. 6.14 Time chart for restarting

## 6.5.6 Stop program

The axis stop signal [Y4, Y5, Y6, Y7] or a stop signal from an external source is used to stop the control.

Create a program to turn ON the axis stop signal [Y4, Y5, Y6, Y7] as the stop program.

The process for stopping control is explained below.

Each control is stopped in the following cases.

- (1) When each control is completed normally.
- (2) When the Servo READY signal is turned OFF.
- (3) When a PLC CPU error occurs.
- (4) When the PLC READY signal is turned OFF.
- (5) When an error occurs in QD75.
- (6) When control is intentionally stopped  
(Stop signal from PLC CPU turned ON, stop signal from peripheral devices)

The stop process for the above cases is shown below.

(Excluding item (1) above "When each control is completed normally".)

## [1] Stop process

Stop cause		Stop axis	M code ON signal after stop	Axis operation status ( [Md.26] ) after stopping	Stop process					
					OPR control		Major positioning control	High-level positioning control	Manual control	
					Machine OPR control	Fast OPR control			JOG/ Inching operation	Manual pulse generator operation
Forced stop	Servo READY OFF • Servo amplifier power supply OFF • Servo alarm • Emergency stop of PLC CPU	Each axis	No change	During error	Servo OFF or free run					
Fatal stop (Stop group 1)	Hardware stroke limit upper/lower limit error occurrence	Each axis	No change	During error	Deceleration stop/sudden stop (Select with " [Pr.37] Sudden stop group 1 sudden stop selection".				Deceleration stop	
Emergency stop (Stop group 2)	Error occurs in PLC CPU	All axes	No change	During error	Delegation stop/sudden stop (Select with " [Pr.38] Sudden stop group 2 sudden stop selection".					
	PLC READY signal OFF		Turns OFF							
	Error in test mode		No change							
Relatively safe stop (Stop group 3)	Axis error detection (Error other than stop group 1 or 2) "Stop" input from peripheral device	Each axis	No change	During error	Deceleration stop/sudden stop (Select with " [Pr.39] Sudden stop group 3 sudden stop selection".					
Intentional stop (Stop group 3)	"Stop signal" ON from external source "Axis stop signal" ON from PLC CPU	Each axis	No change	During stop (during standing by)						

## [2] Types of stop processes

The operation can be stopped with deceleration stop, sudden stop or immediate stop.

## (1) Deceleration stop \*1

The operation stops with "deceleration time 0 to 3" ( Pr.10 , Pr.28 , Pr.29 , Pr.30 ).

Which time from "deceleration time 0 to 3" to use for control is set in positioning data ( Da.4 ).

## (2) Sudden stop

The operation stops with " Pr.36 Sudden stop deceleration time".

## (3) Servo OFF or free run (The operation stops with dynamic brake or electromagnetic brake.)

The operation does not decelerate.

The QD75 immediately stops the command, but the operation will coast for the droop pulses accumulated in the servo amplifier deviation counter.

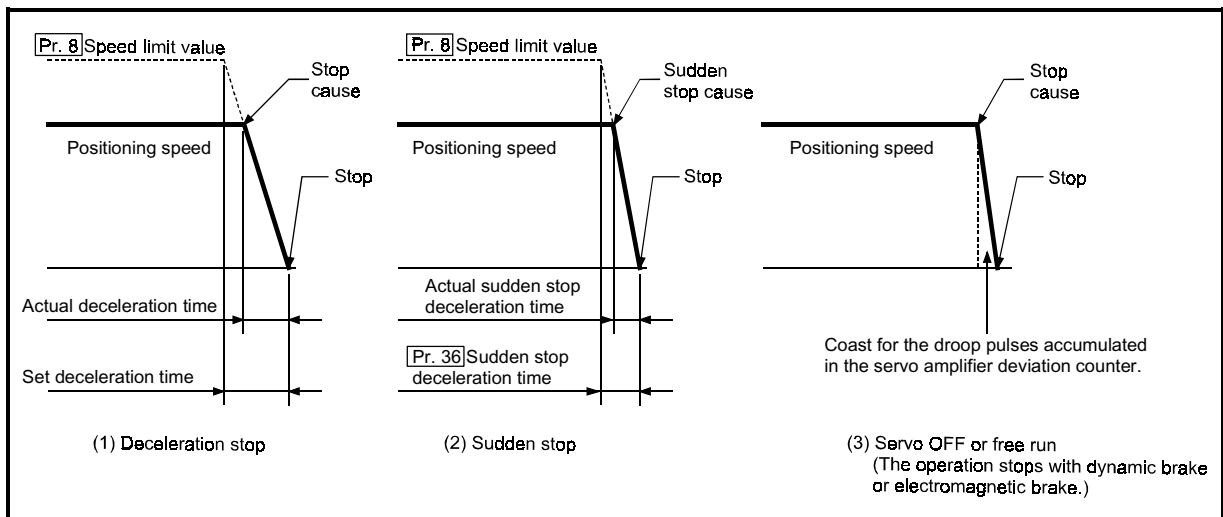


Fig. 6.15 Types of stop processes

**REMARK**

\*1 "Deceleration stop" and "sudden stop" are selected with the details parameter 2 "stop group 1 to 3 sudden stop selection". (The default setting is "deceleration stop".0)



### [3] Order of priority for stop process

The order of priority for the QD75 stop process is as follows.

Deceleration stop < Sudden stop < Servo OFF

- (1) If the deceleration stop command ON (stop signal ON) or deceleration stop cause occurs during deceleration to speed 0 (including automatic deceleration), operation changes depending on the setting of "Cd.42 Stop command processing for deceleration stop selection".
  - (a) Manual control
 


Independently of the Cd.42 setting, a deceleration curve is re-processed from the speed at stop cause occurrence.
  - (b) OPR control, positioning control
    - ⊖ When Cd.42 = 0 (deceleration curve re-processing):
 

A deceleration curve is re-processed from the speed at stop cause occurrence.
    - ⊖ When Cd.42 = 1 (deceleration curve continuation):
 

The current deceleration curve is continued after stop cause occurrence. (For details, refer to Section 12.7.10 "Stop command processing for deceleration stop function".)
- (2) If the stop signal designated for sudden stop turns ON or a stop cause occurs during deceleration, the sudden stop process will start from that point. However, if the sudden stop deceleration time is longer than the deceleration time, the deceleration stop process will be continued even if a sudden stop cause occurs during the deceleration stop process.

#### Example

The process when a sudden stop cause occurs during deceleration stop is shown below.

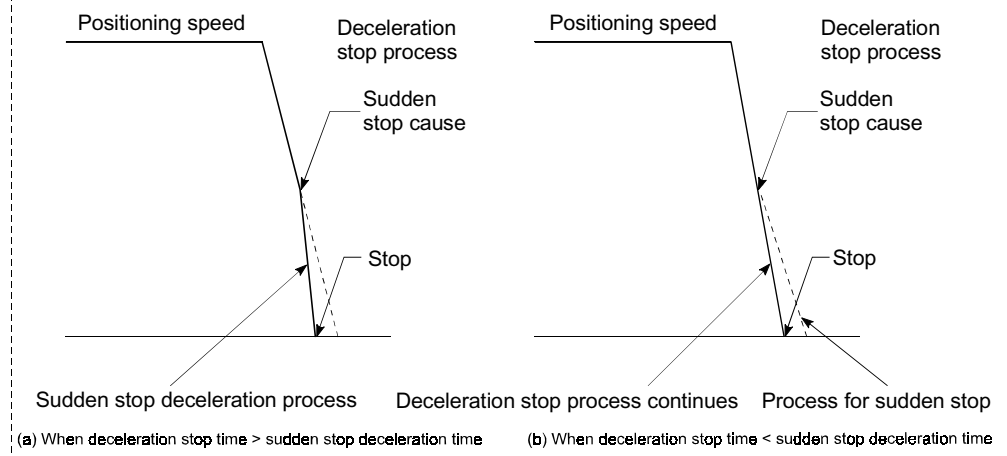

### [4] Inputting the stop signal during deceleration

- (1) Even if stop is input during deceleration (including automatic deceleration), the operation will stop at that deceleration speed.
- (2) If stop is input during deceleration for OPR, the operation will stop at that deceleration speed. If input at the creep speed, the operation will stop immediately.
- (3) If a stop cause, designated for sudden stop, occurs during deceleration, the sudden stop process will start from that point. The sudden stop process during deceleration is carried out only when the sudden stop time is shorter than the deceleration stop time.

# Chapter 7 Memory Configuration and Data Process

The QD75 memory configuration and data transmission are explained in this chapter.

The QD75 is configured of two memories. By understanding the configuration and roles of two memories, the QD75 internal data transmission process, such as "when the power is turned ON" or "when the PLC READY signal changes from OFF to ON" can be easily understood. This also allows the transmission process to be carried out correctly when saving or changing the data.

- 7.1 Configuration and roles of QD75 memory.....7- 2
  - 7.1.1 Configuration and roles of QD75 memory .....7- 2
  - 7.1.2 Buffer memory area configuration.....7- 5
- 7.2 Data transmission process.....7- 8

7.1 Configuration and roles of QD75 memory

7.1.1 Configuration and roles of QD75 memory

The QD75 is configured of the following two memories.

Memory configuration	Role	Area configuration							Backup	
		Parameter area	Monitor data area	Control data area	Positioning data area (No. 1 to 600)	Block start data area (No.7000 to 7004)	PLC CPU memo area	Servo parameter area		
€ Buffer memory	Area that can be directly accessed with PLC program from PLC CPU.	○	○	○	○	○	○	○	○	Not possible
€ Flash ROM	Area for backing up data required for positioning.	○	—	—	○	○	—	○	○	Possible

- : Setting and storage area provided, Not possible: Data is lost when power is turned OFF
- : Setting and storage area not provided, Possible: Data is held even when power is turned OFF

**■ Details of areas**

## ≠ Parameter area

Area where parameters, such as positioning parameters and OPR parameters, required for positioning control are set and stored.

(Set the items indicated with **Pr.1** to **Pr.57** , **Pr.200** to **Pr.201** for each axis.)

## ≠ Monitor data area

Area where positioning system or QD75 operation state is stored.

(Set the items indicated with **Md.1** to **Md.48** , **Md.100** to **Md.111** .)

## ≠ Control data area

Area where data for operating and controlling positioning system is set and stored. (Set the items indicated with **Cd.1** to **Cd.42** , **Cd.100** to **Cd.102** .)

## ≠ Positioning data area (No.1 to 600)

Area where positioning data No.1 to 600 is set and stored.

(Set the items indicated with **Da.1** to **Da.10** for each positioning data.)

## ≠ Block start data area (No.7000 to 7004)

Area where information required only when carrying out block No. 7000 to 7004 high-level positioning is set and stored. (Set the items indicated with **Da.11** to **Da.19** .)


## ≠ PLC CPU memo area

Area where condition judgment values required for special positioning, etc., are set and stored.

## ≠ Servo parameter area

Area where parameters, such as servo parameters, required for positioning control on servo amplifier are set and stored.

(Set the items indicated with **Pr.100** to **Pr.161** for each axis.)

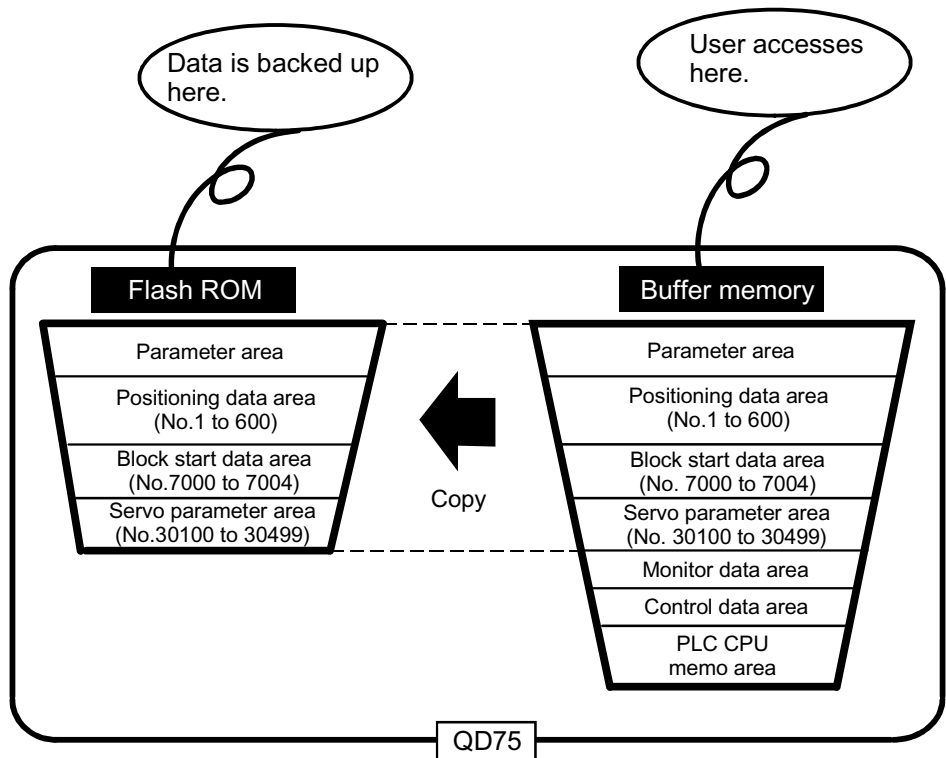

## 7.1.2 Buffer memory area configuration

The QD75 buffer memory is configured of the following types of areas.

Buffer memory area configuration		Buffer memory address				Writing possibility
		Axis 1	Axis 2	Axis 3	Axis 4	
Parameter area	Basic parameter area	0 to 15	150 to 165	300 to 315	450 to 465	Possible
	Detailed parameter area	17 to 69	167 to 219	317 to 369	467 to 519	
	OPR basic parameter area	70 to 78	220 to 228	370 to 378	520 to 528	
	OPR detailed parameter area	79 to 89	229 to 239	379 to 389	529 to 539	
Monitor data area	System monitor area	1200 to 1499				Not possible
	Axis monitor area	800 to 899	900 to 999	1000 to 1099	1100 to 1199	
Control data area	System control data area	1900 to 1999				Possible
	Axis control data area	1500 to 1599	1600 to 1699	1700 to 1799	1800 to 1899	
Positioning data area (No.1 to 600)	Positioning data area	2000 to 7999	8000 to 13999	14000 to 19999	20000 to 25999	Possible
Block start data area (No.7000)	Block start data area	26000 to 26049	27000 to 27049	28000 to 28049	29000 to 29049	
		26050 to 26099	27050 to 27099	28050 to 28099	29050 to 29099	
	Condition data area	26100 to 26199	27100 to 27199	28100 to 28199	29100 to 29199	
Block start data area (No.7001)	Block start data area	26200 to 26249	27200 to 27249	28200 to 28249	29200 to 29249	
		26250 to 26299	27250 to 27299	28250 to 28299	29250 to 29299	
	Condition data area	26300 to 26399	27300 to 27399	28300 to 28399	29300 to 29399	
Block start data area (No.7002)	Block start data area	26400 to 26449	27400 to 27449	28400 to 28449	29400 to 29449	
		26450 to 26499	27450 to 27499	28450 to 28499	29450 to 29499	
	Condition data area	26500 to 26599	27500 to 27599	28500 to 28599	29500 to 29599	
Block start data area (No.7003)	Block start data area	26600 to 26649	27600 to 27649	28600 to 28649	29600 to 29649	
		26650 to 26699	27650 to 27699	28650 to 28699	29650 to 29699	
	Condition data area	26700 to 26799	27700 to 27799	28700 to 28799	29700 to 29799	
Block start data area (No.7004)	Block start data area	26800 to 26849	27800 to 27849	28800 to 28849	29800 to 29849	
		26850 to 26899	27850 to 27899	28850 to 28899	29850 to 29899	
	Condition data area	26900 to 26999	27900 to 27999	28900 to 28999	29900 to 29999	
PLC CPU memo area	PLC CPU memo area	30000 to 30099				Possible

Buffer memory area configuration		Buffer memory address				Writing possibility
		Axis 1	Axis 2	Axis 3	Axis 4	
Servo parameter area	Servo basic parameter area	30100 to 30111	30200 to 30211	30300 to 30311	30400 to 30411	Possible
	Servo adjustment parameter area	30112 to 30126	30212 to 30226	30312 to 30326	30412 to 30426	
	Servo expansion parameter area	30127 to 30149	30227 to 30249	30327 to 30349	30427 to 30449	
	Servo expansion parameter area 2	30150 to 30199	30250 to 30299	30350 to 30399	30450 to 30499	

\* Use of address Nos. skipped above is prohibited. If used, the system may not operate correctly.







7.2 Data transmission process


The data is transmitted between the QD75 memories with steps (1) to (10) shown below.

\*The data transmission patterns numbered (1) to (10) on the right page correspond to the numbers (1) to (10) on the left page.

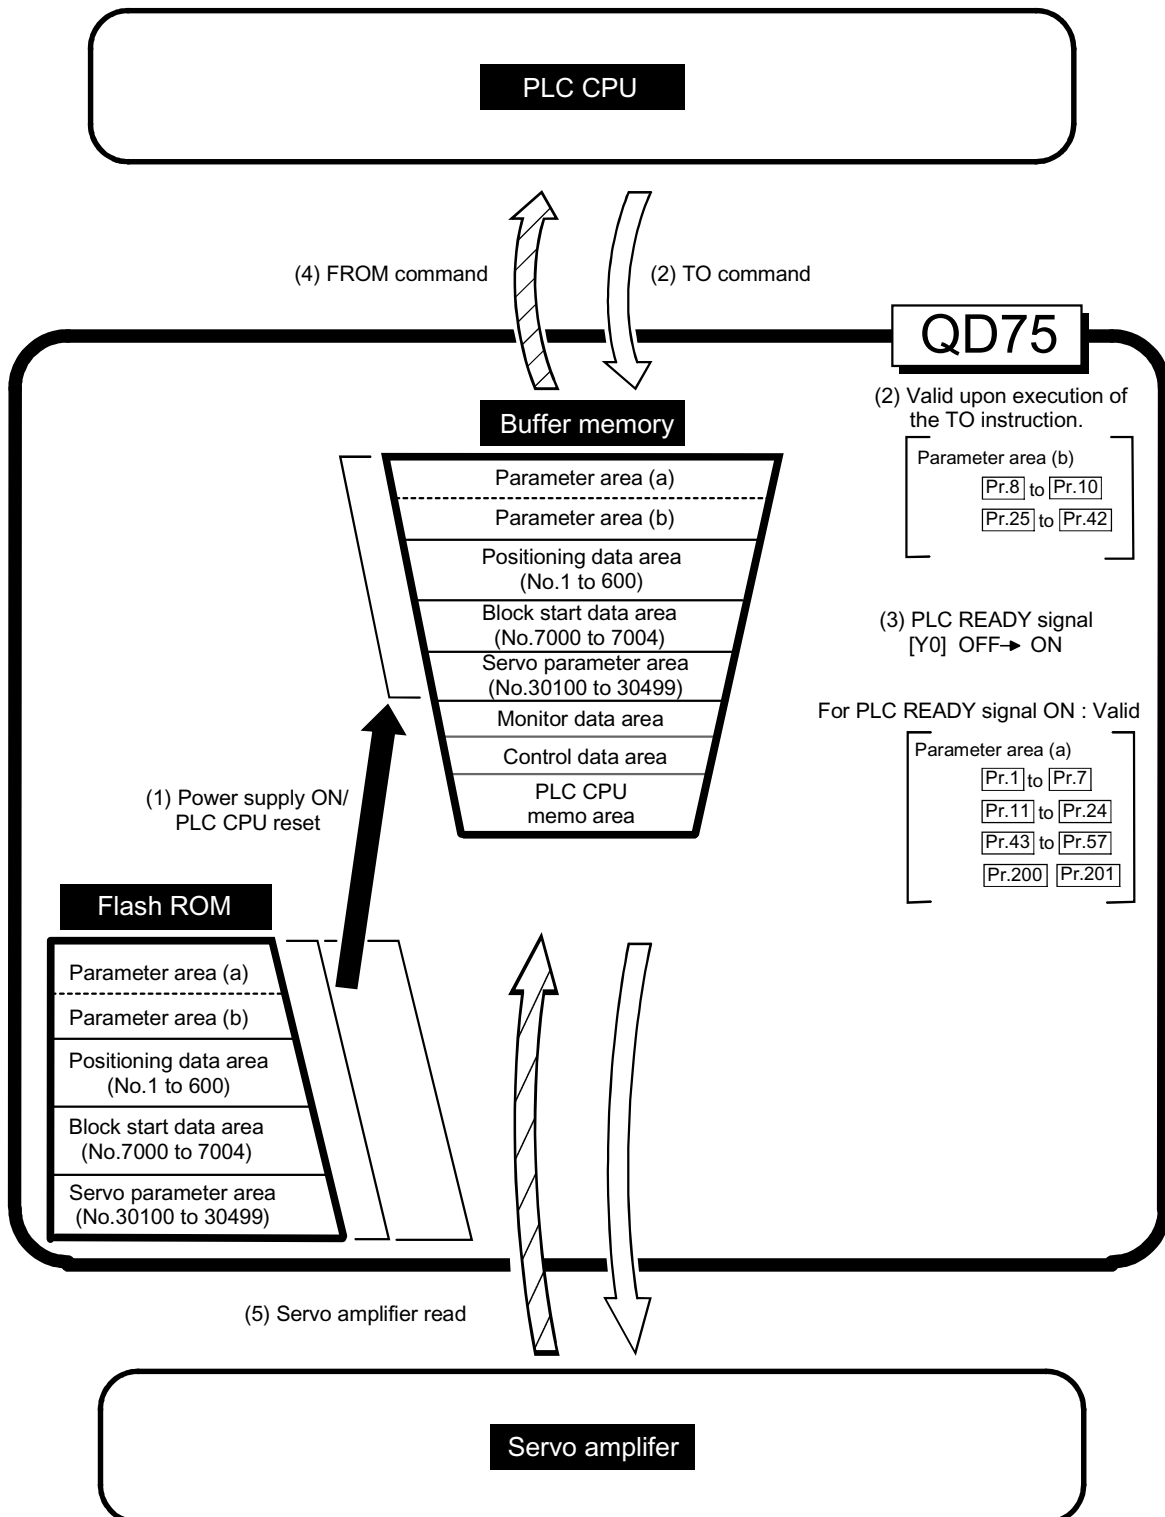

- (1) Transmitting data when power is turned ON or PLC CPU is reset  
(  )

When the power is turned ON or the PLC CPU is reset, the "parameters", "positioning data" and "block start data" stored (backed up) in the flash ROM is transmitted to the buffer memory.

- (2) Transmitting data with TO command from PLC CPU (  )

The parameters or data is written from the PLC CPU to the buffer memory using the TO command. At this time, when the "parameter area (b) \*1", "positioning data (No. 1 to 600)", "block start data (No. 7000 to 7004)", "control data" and "PLC CPU memo area" are written into the buffer memory with the TO command, it is simultaneously valid.

\*1 Parameter area (b) ..... Parameters validated simultaneously with the writing to the buffer memory with the TO command.

( Pr.8 to Pr.10 , Pr.25 to Pr.42 )

POINT
<p>When a value other than "0" has been set to the motor capacity of servo parameter <span style="border: 1px solid black; padding: 0 2px;">Pr.104</span> inside the flash ROM, the power is turned ON or PLC CPU is reset to transmit the servo parameter inside the flash ROM to the servo amplifier (servo amplifier LED indicates "bY").</p> <p>After that, the TO instruction writes the servo parameter from the PLC CPU to the buffer memory so that the servo parameter in the buffer memory is not transmitted to the servo amplifier even if the PLC READY signal [Y0] is turned OFF then ON.</p> <p>Change the servo parameter with the above method, after setting the motor capacity of servo parameter <span style="border: 1px solid black; padding: 0 2px;">Pr.104</span> inside the flash ROM, to "0".</p>

## (3) Validate parameters when PLC READY signal [Y0] changes from OFF to ON

When the PLC READY signal [Y0] changes from OFF to ON, the data stored in the buffer memory's "parameter area (a) \*2" is validated.

\*2: Parameter area (a) ..... Parameters validated when PLC READY signal [Y0] changes from OFF to ON.

( [Pr.1] to [Pr.7] , [Pr.11] to [Pr.24] , [Pr.43] to [Pr.57] , [Pr.200] , [Pr.201] )


When the motor capacity of servo parameter [Pr.104] inside the flash ROM is set to 0 and a value other than 0 is set to [Pr.104] in the above step (2), the servo parameter data is transmitted to the servo amplifier.

## POINT

The setting values of the parameters that correspond to parameter area (b) are valid when written into the buffer memory with the TO command. However, the setting values of the parameters that correspond to parameter area (a) are not validated until the PLC READY signal [Y0] changes from OFF to ON.


(4) Accessing with FROM command from PLC CPU (  )


The data is read from the buffer memory to the PLC CPU using the FROM command.

(5) Reading the servo parameter from the servo amplifier (  )

When 1 is written to [Cd.102], the servo parameter is read from the servo amplifier to the buffer memory.



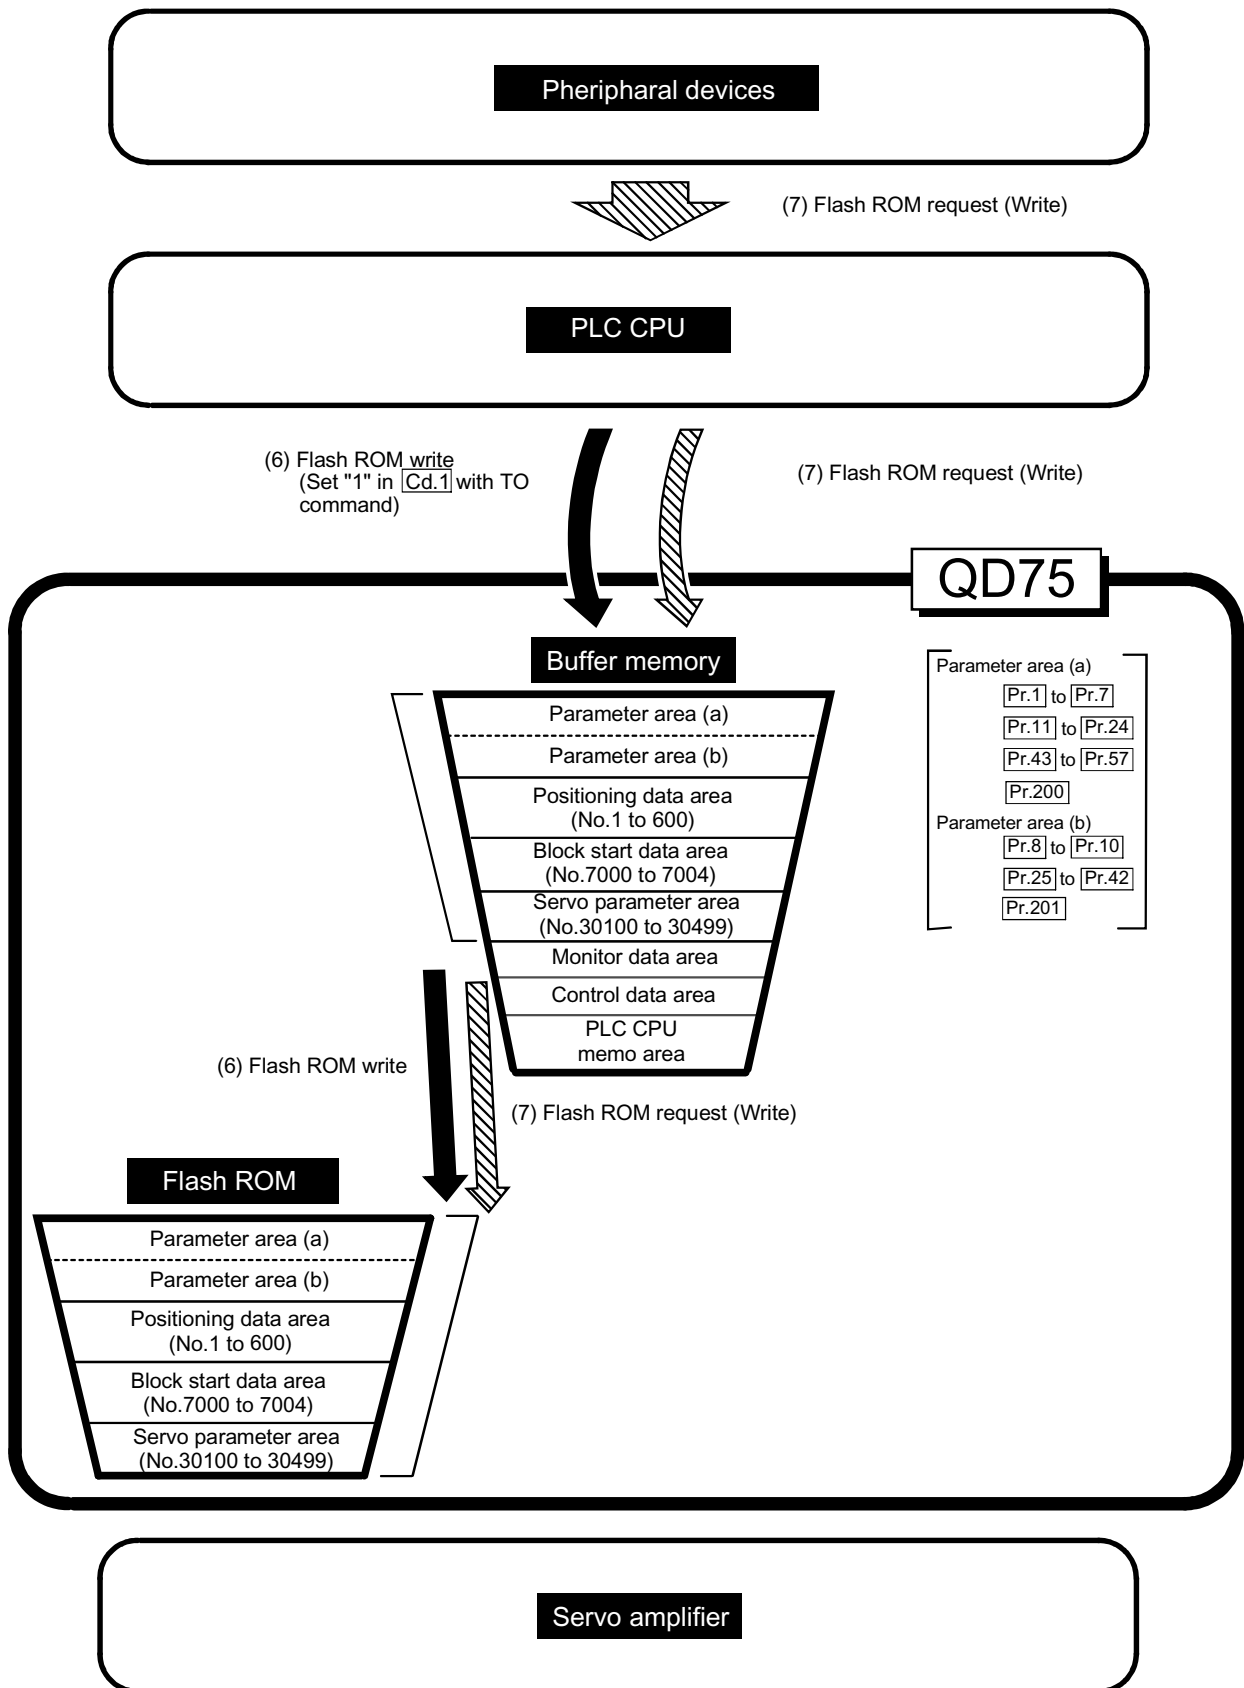

(6) Writing the flash ROM by a PLC CPU request (  )

The following transmission process is carried out by setting "1" in " Cd.1 Flash ROM write request" (buffer memory [1900]).

- 1) The "parameters", "positioning data (No. 1 to 600)", "block start data (No. 7000 to 7004)" and "servo parameter" in the buffer memory area are transmitted to the flash ROM.

The writing to the flash ROM may also be carried out using a dedicated instruction "PFWRT". (Refer to Chapter 14 "Dedicated instructions" for details.)

(7) Writing the flash ROM by a peripheral device request (  )


The following transmission processes are carried out with the [flash ROM request] (write) from the peripheral device.


- 1) The "parameters", "positioning data (No. 1 to 600)", "block start data (No. 7000 to 7004)" and "servo parameter" in the buffer memory area are transmitted to the flash ROM.

Note) This transmission process is the same as (7) above.

**IMPORTANT**

- (1) Do not turn the power OFF or reset the PLC CPU while writing to the flash ROM. If the power is turned OFF or the PLC CPU is reset to forcibly end the process, the data backed up in the flash ROM will be lost.
- (2) Do not write the data to the buffer memory before writing to the flash ROM is completed.
- (3) The number of writes to the flash ROM with the PLC program is 25 max. while the power is turned ON.  
Writing to the flash ROM beyond 25 times will cause an error (error code: 805). Refer to Section 15.2 "List of errors" for details.
- (4) Monitoring is the number of writes to the flash ROM by the " Md.19 No. of write accesses to flash ROM".

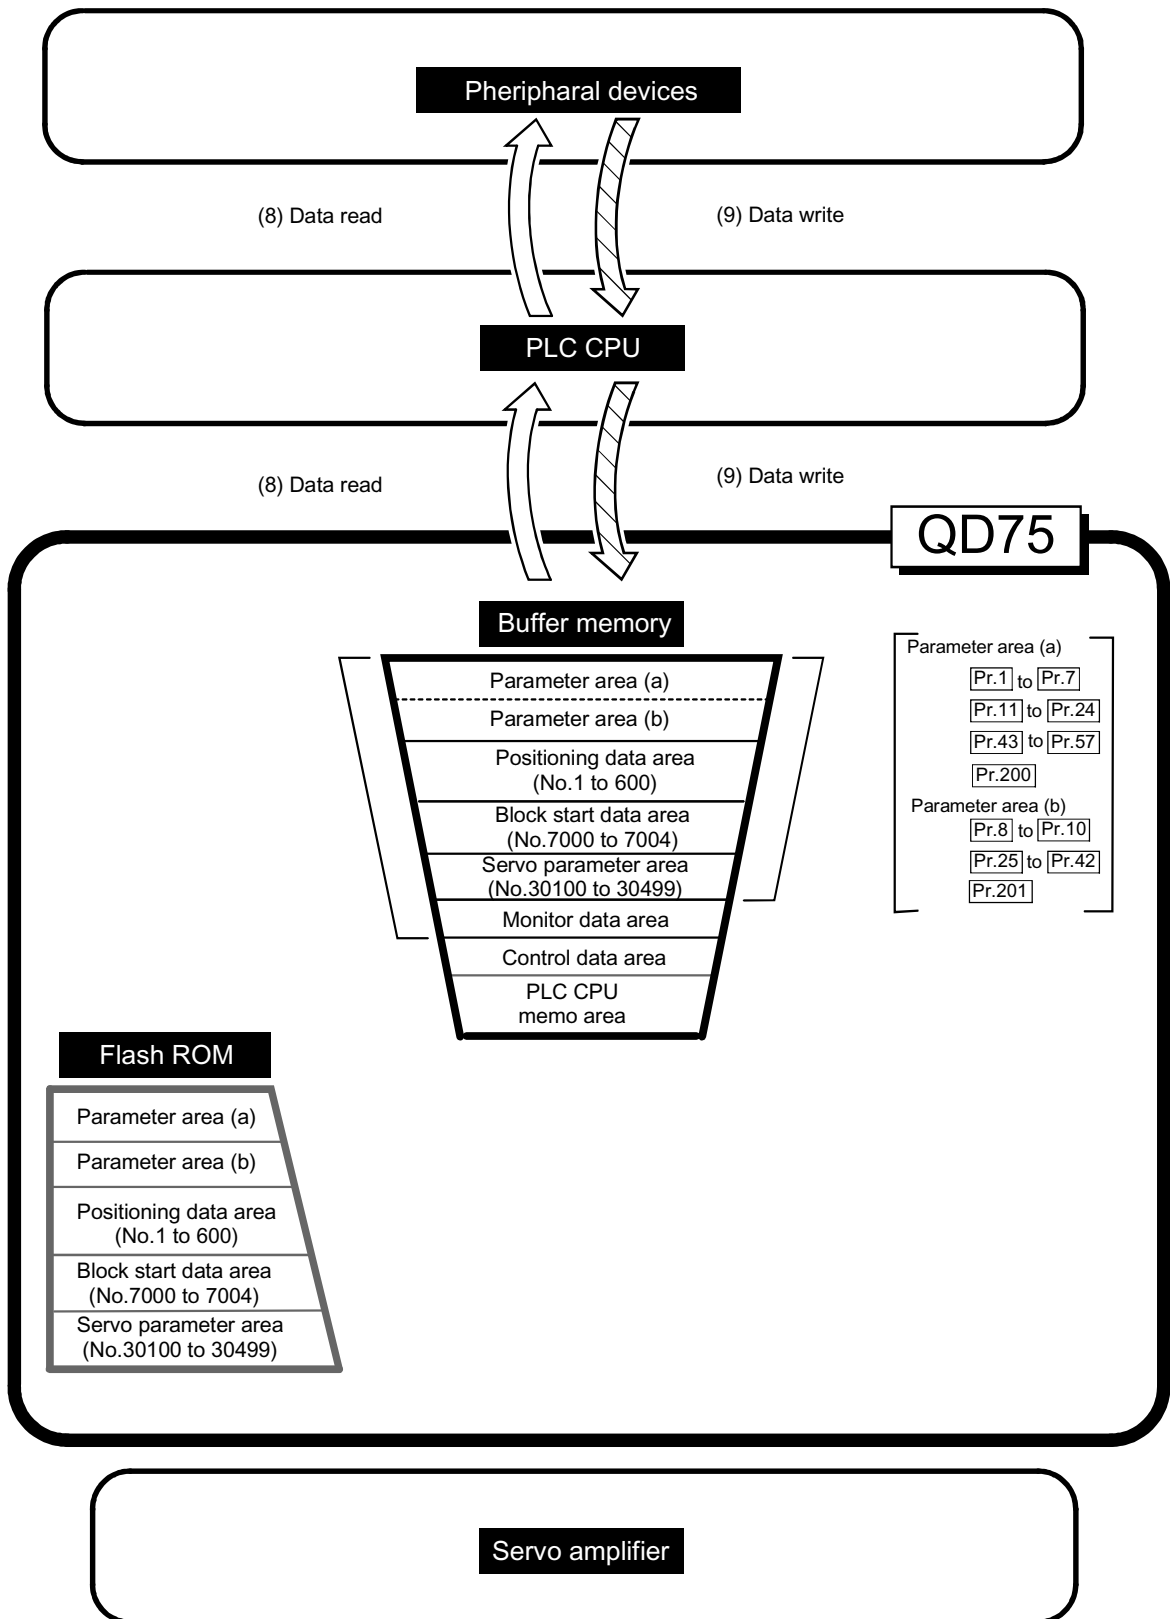


(8) Reading data from buffer memory to peripheral device (  )

The following transmission processes are carried out with the [Read from module] from the peripheral device.

- 1) The "parameters", "positioning data (No. 1 to 600)" and "block start data (No. 7000 to 7004)" in the buffer memory area are transmitted to the peripheral device via the PLC CPU.

The following transmission processes are carried out with the [monitor] from the peripheral device.

- 2) The "monitor data" in the buffer memory area is transmitted to the peripheral device via the PLC CPU.

(9) Writing data from peripheral device to buffer memory (  )


The following transmission processes are carried out with the [Write to module] from the peripheral device.

- 1) The "parameters", "positioning data (No. 1 to 600)" and "block start data (No. 7000 to 7004)" in the peripheral device area transmitted to the buffer memory via the PLC CPU.

At this time, when [Flash ROM automatic write] is set with the peripheral device, the transmission processes indicated with the following are carried out.

- (7) Flash ROM write



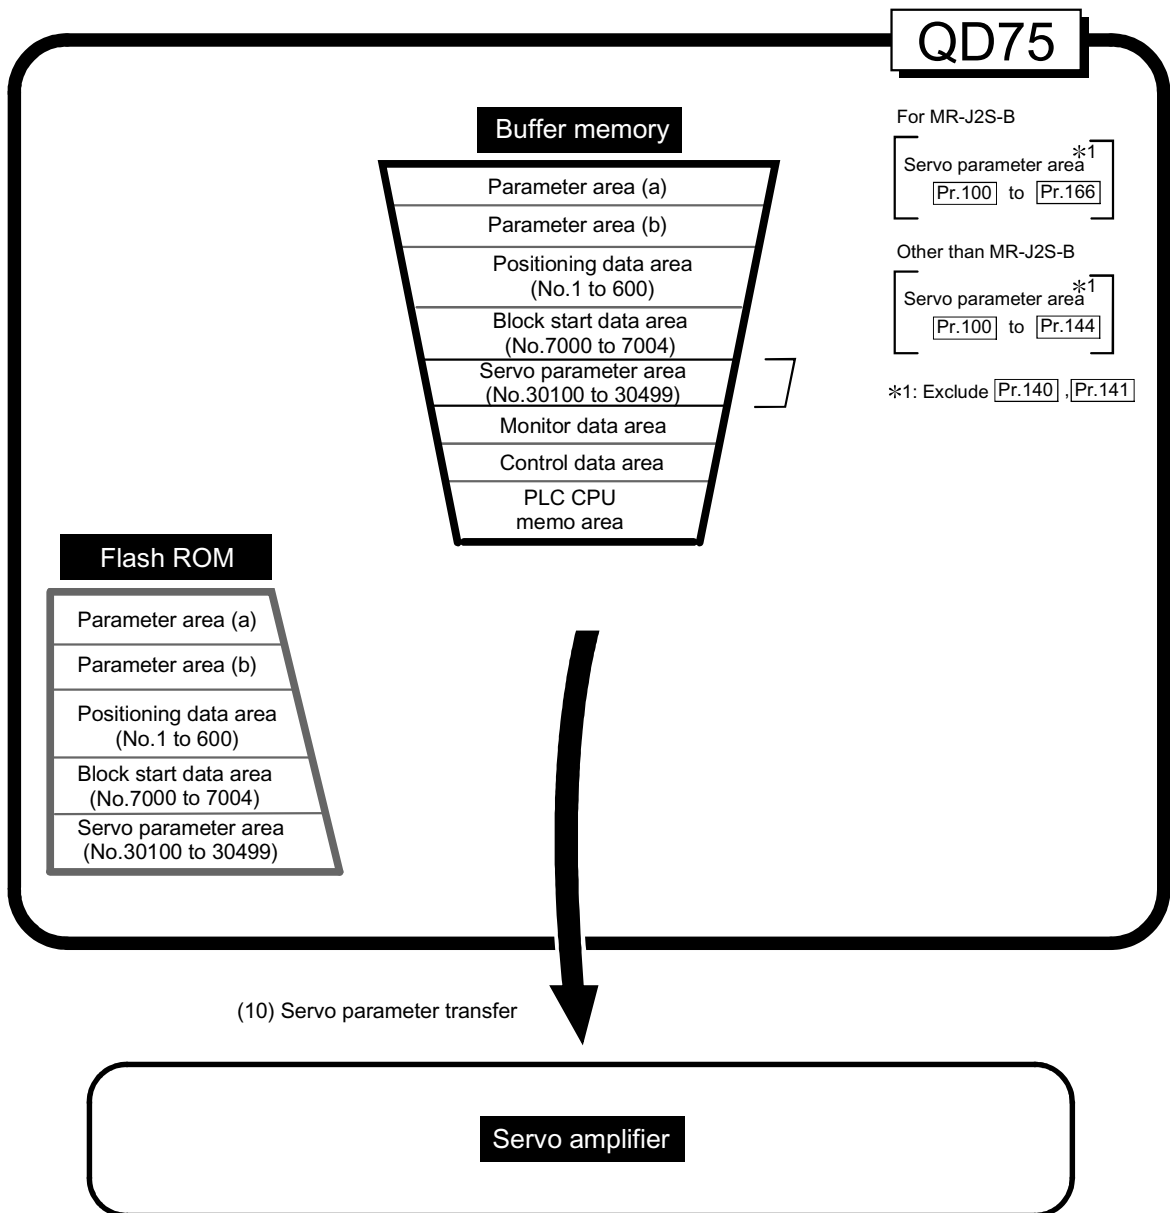

## (10) Transmitting servo parameter from the buffer memory area to servo amplifier (⇨)

The servo parameter in the buffer memory area is transmitted to the servo amplifier by the following timing.

- 1) The servo parameter transmitted to the servo amplifier when communications with servo amplifier start.  
The servo parameter in the buffer memory area is transmitted to the servo amplifier.
- 2) The following servo parameter in the buffer memory area carried out to the servo amplifier when the PLC READY signal [Y0] turns from OFF to ON.
  - [Pr.108](#) Auto tuning (Servo basic parameter)
  - [Pr.112](#) Load inertia ratio (Servo adjustment parameter)
  - [Pr.113](#) Position loop gain 1 (Servo adjustment parameter)
  - [Pr.115](#) Position loop gain 2 (Servo adjustment parameter)
  - [Pr.114](#) Speed loop gain 1 (Servo adjustment parameter)
  - [Pr.116](#) Speed loop gain 2 (Servo adjustment parameter)
  - [Pr.117](#) Speed integral compensation (Servo adjustment parameter)
  - [Pr.119](#) Feed forward gain (Servo adjustment parameter)

#### ■ About the communication start with servo amplifier

Communication with servo amplifier is valid when following condition is realized together.

- 1) The power of QD75 and servo amplifier is turned ON.
- 2) When the motor capacity of servo parameter [Pr.104](#) inside the buffer memory area is set to the value other than "0" in QD75.

When the power is turned ON or the PLC CPU is reset, the data stored in the flash ROM is transmitted to the buffer memory.

Therefore the motor capacity of servo parameter [Pr.104](#) inside the flash ROM is stored to the value other than "0", and communication with servo amplifier is started when the power is turn ON in order of the servo amplifier, QD75.

After the servo parameter stored in the flash ROM is transmitted to the servo amplifier.

#### ■ How to transfer the servo parameter setup from PLC program to the servo amplifier

The motor capacity of servo parameter [Pr.104](#) inside the flash ROM set to "0".  
(Initial value: "0")

The setting values of the parameters that correspond to the motor capacity of servo parameter [Pr.104](#) inside the flash ROM are not started when the power is turned ON or the PLC CPU is reset, after the communication with servo amplifier is not started.

■ How to transfer the servo parameter which wrote it in the flash ROM to servo amplifier

Flash ROM writing carried out after the servo parameter is set up in the buffer memory.

After that, when the power is turned ON or the PLC CPU is reset, the servo parameters stored in the flash ROM is transmitted to the buffer memory.

When the servo parameter is written in the flash ROM, it is unnecessary to use a setup from the PLC program.

■ Servo parameter of the buffer memory

The following shows details about the operation timing and details the servo parameter transfer of the buffer memory.

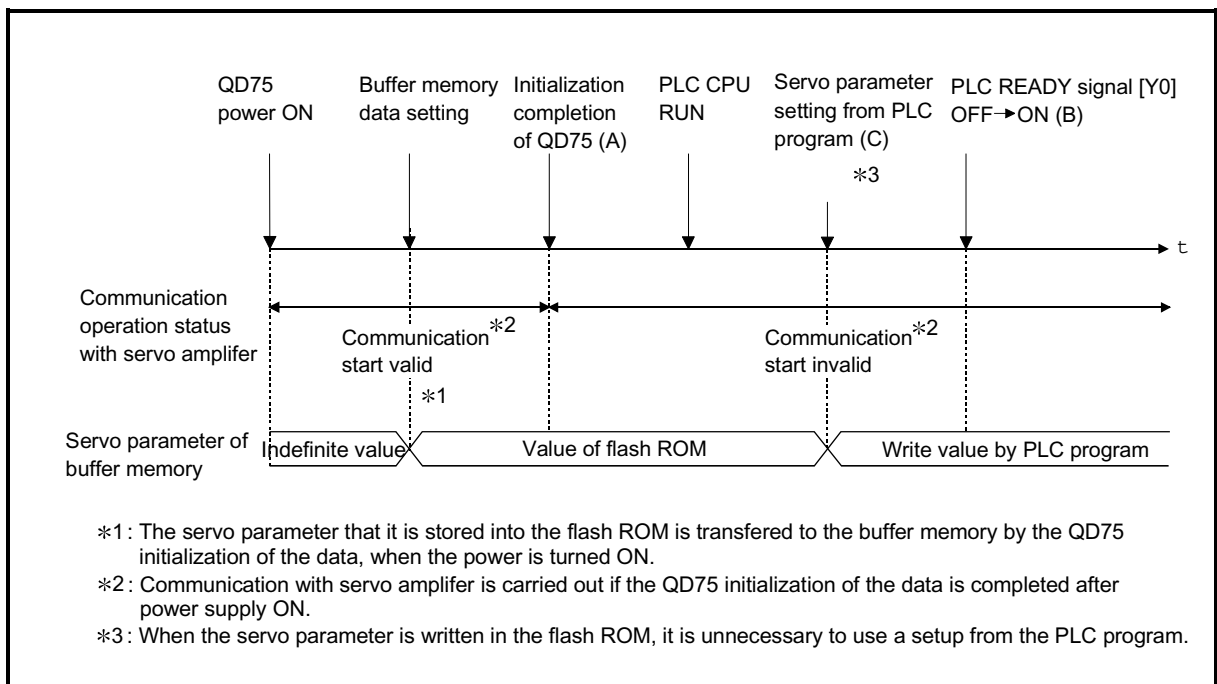


Fig. 7.1 Operation timing in the servo parameter transfer of the buffer memory

■ Operation details

(1) Servo parameter transfers when servo amplifier had started and the power supply of QD75 is turned ON.

(a) When the servo parameter "Pr.104 motor capacity" ≠ "0" is stored flash ROM.

Communication start timing to the servo amplifier: Initialization completion (Fig. 7.1 A)

Transfer the servo parameter : The data stored (backed up) in the flash ROM.

(b) When the servo parameter "Pr.104 motor capacity"="0" is stored flash ROM.

Communication start timing to the servo amplifier: The data written from PLC program before the PLC READY signal [Y0] ON (Fig. 7.1 B).

Transfer the servo parameter : The data written from PLC program before the PLC READY signal [Y0] ON (Fig. 7.1 C).

(2) Servo parameter transfers when servo amplifier had started after the PLC READY signal [Y0] is turned OFF to ON (Fig. 7.1 B)


Communication start timing to the servo amplifier: when servo amplifier had started

Transfer the servo parameter : The data written from PLC program before the PLC READY signal [Y0] ON (Fig. 7.1 C).

The data transmission is carried out as shown in the previous pages, but the main method of using this data process is shown below.

(Ex.) Setting the positioning data

The following methods can be used to set the positioning data.

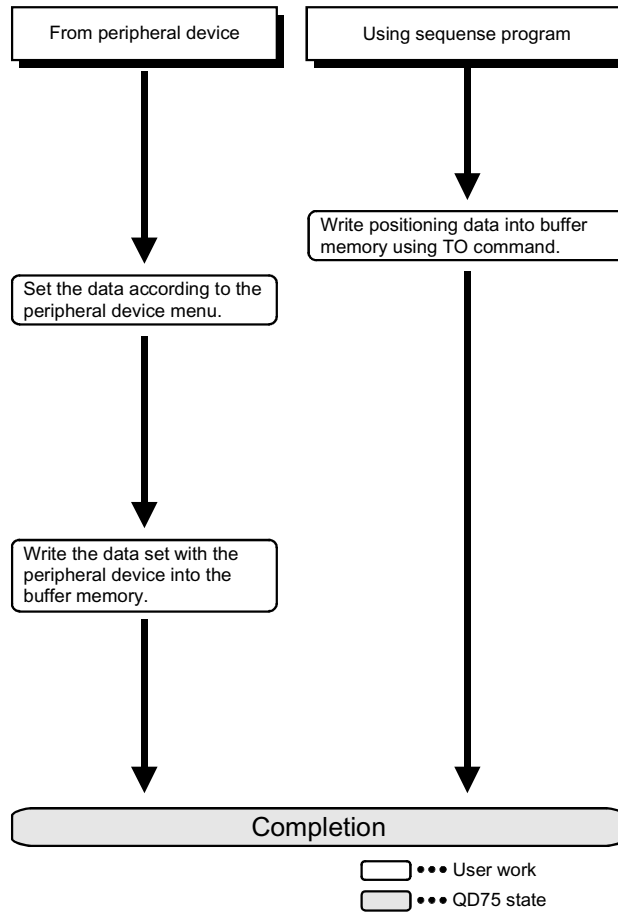

## Section 2 Control Details and Setting

Section 2 is configured for the following purposes shown in (1) to (3).

- (1) Understanding of the operation and restrictions of each control.
- (2) Carrying out the required settings in each control
- (3) Dealing with errors

The required settings in each control include parameter setting, positioning data setting, control data setting by a PLC program, etc.

Carry out these settings while referring to "Chapter 5 Data used for positioning". Also refer to "Chapter 6 PLC programs used in positioning control" when creating the PLC programs required in each control, and consider the entire control program configuration when creating each program.

Chapter 8	OPR Control .....	8- 1 to 8- 14
Chapter 9	Major Positioning Control.....	9- 1 to 9-116
Chapter 10	High-Level Positioning Control .....	10- 1 to 10- 26
Chapter 11	Manual Control.....	11- 1 to 11- 36
Chapter 12	Control Sub Functions .....	12- 1 to 12- 98
Chapter 13	Common Functions.....	13- 1 to 13- 8
Chapter 14	Dedicated instructions.....	14- 1 to 14- 18
Chapter 15	Troubleshooting .....	15- 1 to 15-106



# Chapter 8 OPR Control

The details and usage of "OPR control" are explained in this chapter.

OPR control includes "machine OPR" that establish a machine OP without using address data, and "fast OPR" that store the coordinates established by the machine OPR, and carry out positioning to that position.

OPR carried out by PLC programs from the PLC CPU are explained in this chapter. Refer to GX Configurator-QP Operating Manual for details on OPR using the peripheral device.

8.1	Outline of OPR control .....	8- 2
8.1.1	Two types of OPR control.....	8- 2
8.2	Machine OPR.....	8- 4
8.2.1	Outline of the machine OPR operation .....	8- 4
8.2.2	Machine OPR method .....	8- 5
8.2.3	OPR method (1): Near-point dog method.....	8- 6
8.2.4	OPR method (2): Count method 1).....	8- 8
8.2.5	OPR method (3): Count method 2).....	8-10
8.2.6	OPR method (4): Data set method .....	8-12
8.3	Fast OPR.....	8-13
8.3.1	Outline of the fast OPR operation .....	8-13



## 8.1 Outline of OPR control

### 8.1.1 Two types of OPR control

In "OPR control" a position is established as the starting point (or "OP") when carrying out positioning control, and positioning is carried out toward that starting point.

It is used to return a machine system at any position other than the OP to the OP when the QD75 issues a "OPR request"\* with the power turned ON or others, or after a positioning stop.

In the QD75, the two types of controls shown below are defined as "OPR control", following the flow of the OPR work.

These two types of OPR control can be executed by setting the "OPR parameters", setting "Positioning start No. 9001" and "positioning start No. 9002" prepared beforehand in the QD75 to "[Cd.3] Positioning start No.", and turning ON the positioning start signal.

The PSTRT  start numbers of the dedicated instruction can also be set to 9001 or 9002 to execute the OPR control. (For details, refer to Chapter 14 "Dedicated instructions".)

- (1) Establish a positioning control OP
  - "Machine OPR" (positioning start No. 9001)
- (2) Carry out positioning toward the OP
  - "Fast OPR" (positioning start No. 9002).

\* The "machine OPR" in (1) above must always be carried out before executing the "fast OPR" in (2).

### CAUTION

- In the case of the absolute position system, use the PLC program to check the OPR request before performing the positioning operation.  
Failure to observe this could lead to an accident such as a collision.

### REMARK

OPR request \*

The "OPR request flag" ( [Md.31] Status: b3) must be turned ON in the QD75, and a machine OPR must be executed in the following cases.

- ≠ When the power is turned ON (in the case of the absolute position system, however, the "OPR request flag" is not established.)
- ≠ When the absolute position system is not set
- ≠ When the OPR is not performed in the absolute position system
- ≠ When the OPR starts

The address information stored in the QD75 cannot be guaranteed while the "OPR request flag" is ON.

The "OPR request flag" turns OFF and the "OPR complete flag" ( [Md.31] Status: b4) turns ON if the machine OPR is executed and is completed normally.

### ■ OPR sub functions

Refer to Section 3.2.4 "Combination of QD75 main functions and sub functions" for details on "sub functions" that can be combined with OPR control. Also refer to Chapter 12 "Control sub functions" for details on each sub function.

#### [Remarks]

The following two sub functions are only related to machine OPR.

Sub function name	Machine OPR	Fast OPR	Reference
OPR retry function	△	×	Section 12.2.1
OP shift function	○	×	Section 12.2.2

○ : Combination possible, △: Restricted, ×: Combination not possible

### ■ When an OPR is not required

Control can be carried out ignoring the "OPR request flag" ( [Md.31](#) Status: b3) in systems that do not require an OPR.

In this case, the "OPR parameters ( [Pr.43](#) to [Pr.57](#) )" must all be set to their initial values or a value at which an error does not occur.

### ■ OPR from peripheral devices

"Machine OPR" and "fast OPR" can be executed from the test mode of the peripheral device.

Refer to GX Configurator-QP Operating Manual for details on OPR from the peripheral device.

## 8.2 Machine OPR

## 8.2.1 Outline of the machine OPR operation

**Important**

Use the OPR retry function when the OP position is not always in the same direction from the workpiece operation area (when the OP is not set near the upper or lower limit of the machine).

\* The machine OPR may not complete unless the OPR retry function is used.

**Machine OPR operation**

In a machine OPR, OP is established.

None of the address information stored in the QD75, PLC CPU, or servo is used at this time. The position mechanically established after the machine OPR is regarded as the "OP" to be the starting point for positioning control.

The method for establishing an "OP" by a machine OPR differs according to the method set in " [Pr.43] OPR method".

The following shows the operation when starting a machine OPR.

1)	The "machine OPR" is started.
2)	The operation starts according to the speed and direction set in the OPR parameters ( [Pr.43] to [Pr.57] ).
3)	The "OP" is established by the method set in " [Pr.43] OPR method", and the machine stops. (Refer to sections 8.2.2 to 8.2.8)
4)	If "a" is set as " [Pr.45] OP address", "a" will be stored as the current position in the " [Md.20] Current feed value" and " [Md.21] Machine feed value" which are monitoring the position.
5)	The machine OPR is completed.

\* The " [Pr.45] OP address" is a fixed value set by the user.

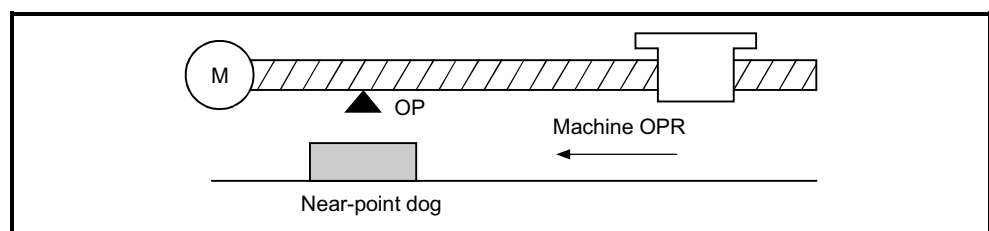


Fig. 8.1 Example of a machine OPR

## 8.2.2 Machine OPR method

The method by which the machine OP is established (method for judging the OP position and machine OPR completion) is designated in the machine OPR according to the configuration and application of the positioning method.

The following table shows the methods that can be used for this OPR method.

(The OPR method is one of the items set in the OPR parameters. It is set in " **Pr.43** OPR method" of the basic parameters for OPR.)

<b>Pr.43</b> OPR method	Operation details
Near-point dog method	Deceleration starts by the OFF → ON of the near-point dog. (Speed is reduced to " <b>Pr.47</b> Creep speed".) The operation stops once after the near-point dog turns ON and then OFF. Later the operation restarts and then stops at the first zero signal to complete the OPR.
Count method 1)	The deceleration starts by the OFF → ON of the near-point dog, and the machine moves at the " <b>Pr.47</b> Creep speed". The machine stops once after moving the distance set in the " <b>Pr.50</b> Setting for the movement amount after near-point dog ON" from the OFF → ON position. Later the operation restarts and then stops at the first zero signal to complete the machine OPR.
Count method 2)	The deceleration starts by the OFF → ON of the near-point dog, and the machine moves at the " <b>Pr.47</b> Creep speed". The machine moves the distance set in the " <b>Pr.50</b> Setting for the movement amount after near-point dog ON" from the near-point dog OFF → ON position, and stops at that position. The machine OPR is then regarded as completed.
Data set method	The position where the machine OPR has been performed becomes an OP. The current feed value and feed machine value are overwritten to the OP address.

**REMARK**

## Creep speed

The stopping accuracy is poor when the machine suddenly stops from fast speeds. To improve the machine's stopping accuracy, its must change over to a slow speed before stopping. This speed is set in the " **Pr.47** Creep speed".

8.2.3 OPR method (1): Near-point dog method

The following shows an operation outline of the "near-point dog method" OPR method.

■ Operation chart

1)	The machine OPR is started. (The machine begins the acceleration designated in " Pr.51 OPR acceleration time selection", in the direction designated in " Pr.44 OPR direction". It then moves at the " Pr.46 OPR speed" when the acceleration is completed.)
2)	The machine begins decelerating when the near-point dog ON is detected.
3)	The machine decelerates to the " Pr.47 Creep speed", and subsequently moves at that speed. (At this time, the near-point dog must be ON. The workpiece will continue decelerating and stop if the near-point dog is OFF.)
4)	After the near-point dog turns OFF, the machine stops. It then restarts and stops at the first zero point.
5)	After a "deviation counter clear signal" is output to the drive unit, the OPR complete flag ( Md.31 Status: b4) turns from OFF to ON and the OPR request flag ( Md.31 status: b3) turns from ON to OFF.

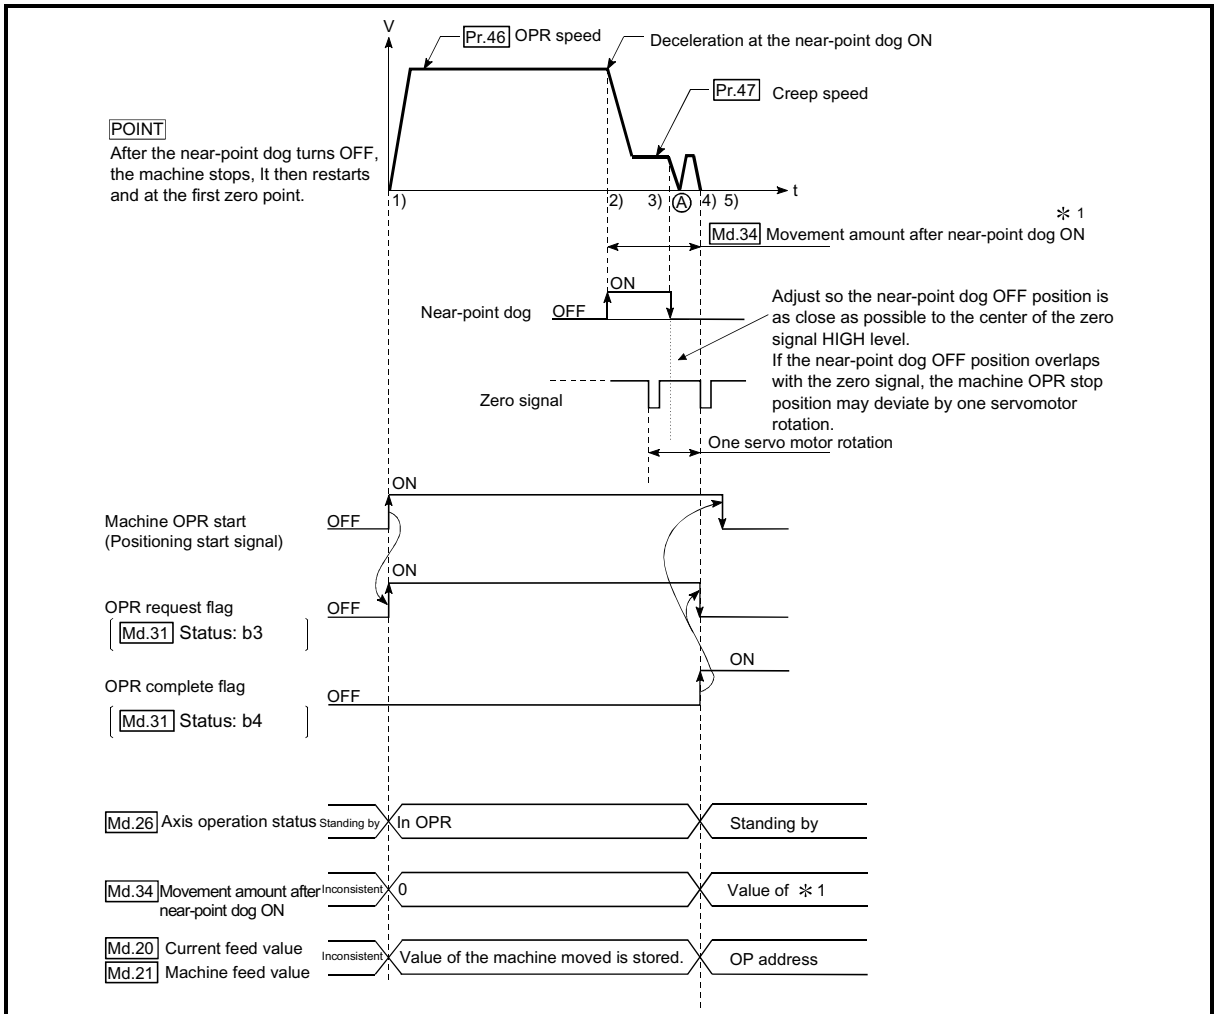


Fig. 8.2 Near-point dog method machine OPR

■ Precautions during operation

- (1) An error "Start at home position (OP) fault (error code: 201)" will occur if another machine OPR is attempted after a machine OPR completion when the OPR retry function is not set ("0" is set in "Pr.48 OPR retry").
  - (2) Machine OPR carried out from the near-point dog ON position will start at the "Pr.47 Creep speed".
  - (3) The near-point dog must be ON during deceleration from the OPR speed "Pr.47 Creep speed".
  - (4) When the stop signal stops the machine OPR, carry out the machine OPR again. When restart command is turned ON after the stop signal stops the OPR, the error "OPR restart impossible (error code: 209)" will occur.
- \* The workpiece will continue decelerating and stop if the near-point dog is turned OFF before it has decelerated to the creep speed, thus causing an error "Dog detection timing fault (error code: 203)".

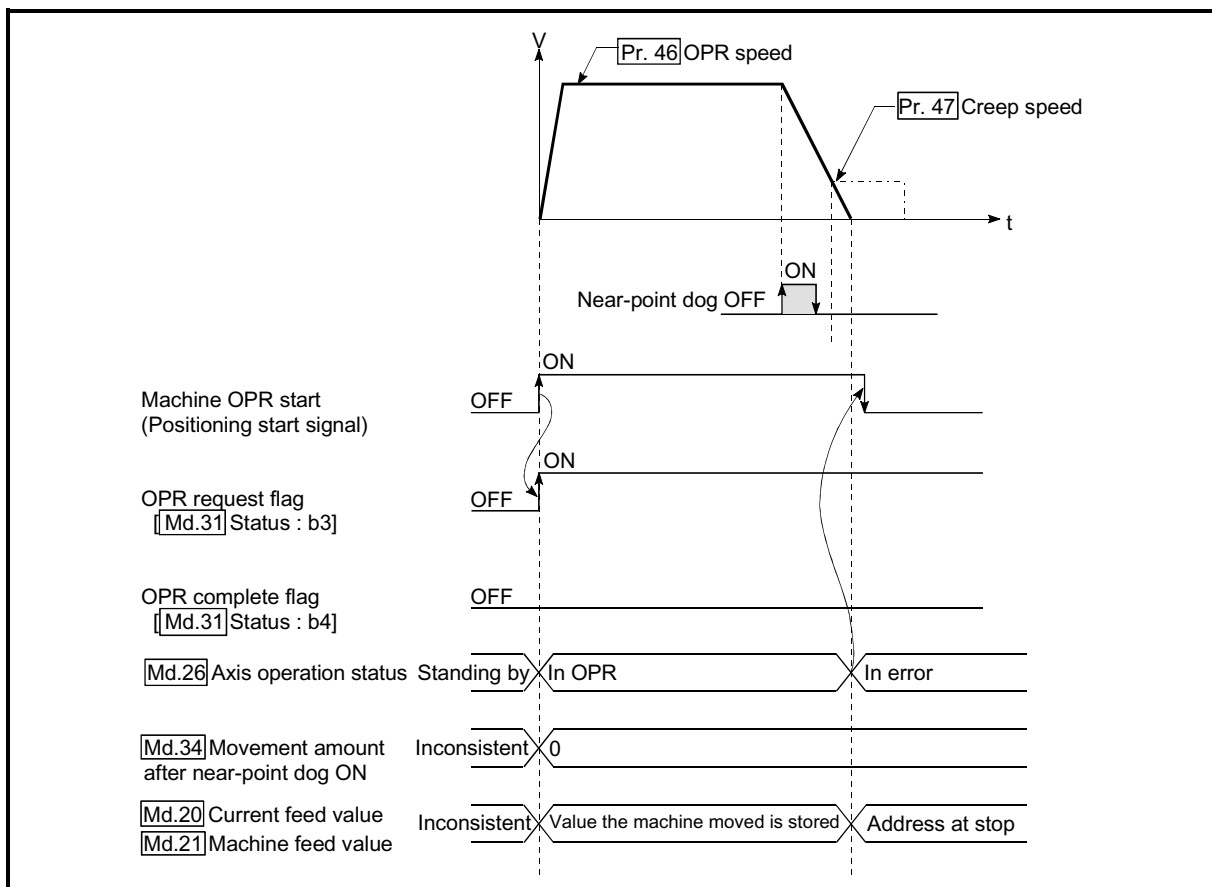


Fig. 8.3 Operation when the near-point dog is turned OFF before the creep speed is reached

8.2.4 OPR method (2): Count method 1)

The following shows an operation outline of the "count method 1)" OPR method. In the "count method 1)" OPR, the following can be performed:

- ≠ Machine OPR on near-point dog
- ≠ Second machine OPR after completion of first machine OPR

■ Operation chart

1)	The machine OPR is started. (The machine begins the acceleration designated in " [Pr.51] OPR acceleration time selection", in the direction designated in " [Pr.44] OPR direction". It then moves at the " [Pr.46] OPR speed" when the acceleration is completed.)
2)	The machine begins decelerating when the near-point dog ON is detected.
3)	The machine decelerates to the " [Pr.47] Creep speed", and subsequently moves at that speed.
4)	The machine stops after the workpiece has been moved the amount set in the " [Pr.50] Setting for the movement amount after near-point dog ON" after the near-point dog turned ON. It then restarts and stops at the first zero point.
5)	After a "deviation counter clear output" is output to the drive unit, the OPR complete flag [Md.31] Status: b4) turns from OFF to ON, and the OPR request flag ( [Md.31] Status: b3) turns from ON to OFF.

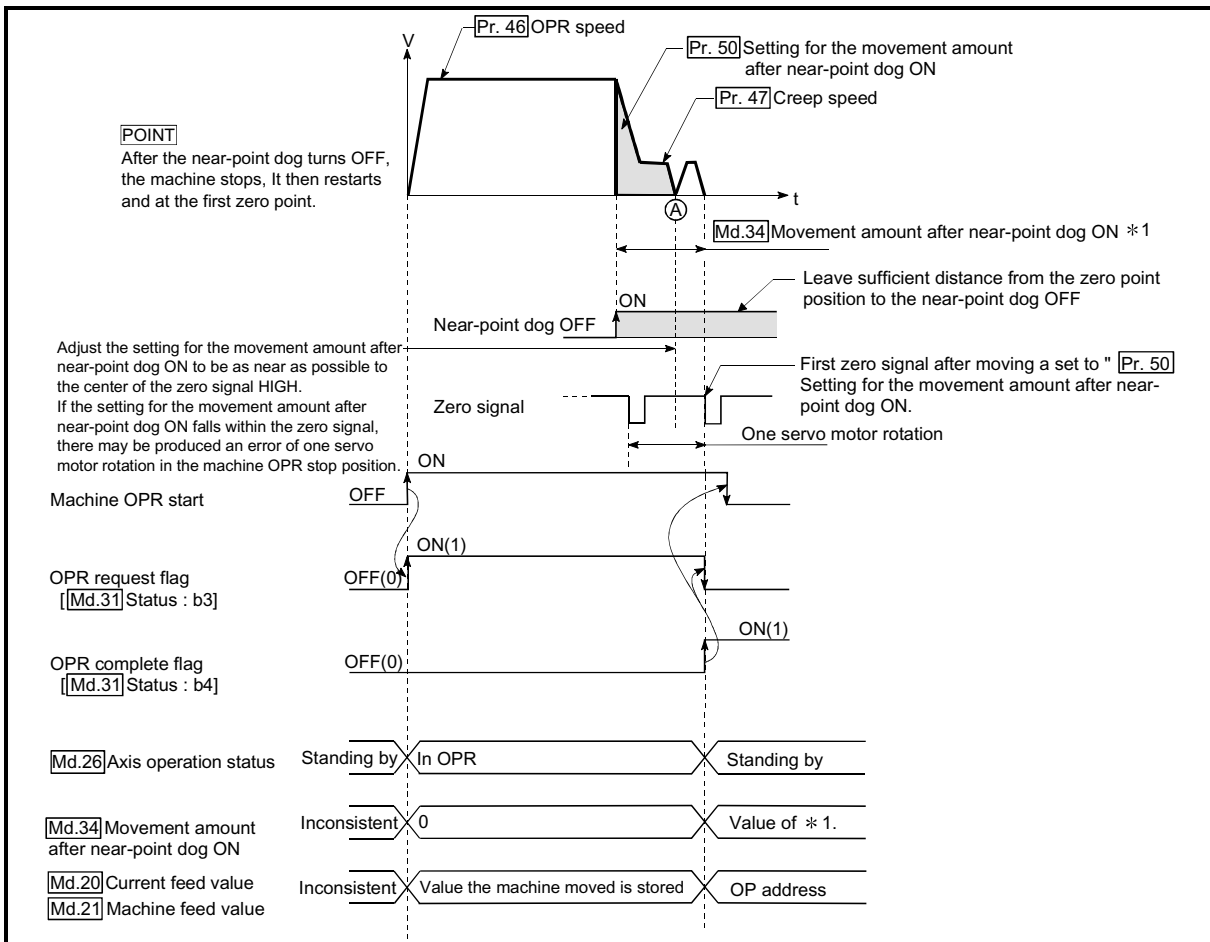


Fig. 8.12 Count method1) machine OPR

### ■ Precautions during operation

- (1) An error "Count method movement amount fault (error code: 206)" will occur and the operation will not start if the " [Pr.50](#) Setting for the movement amount after near-point dog ON" is smaller than the deceleration distance from the " [Pr.46](#) OPR speed" to " [Pr.47](#) Creep speed".

A deceleration stop will be carried out if the speed is changed during the operation and an error occurs.

- (2) The following shows the operation when a machine OPR is started while the near-point dog is ON.
- (3) When the stop signal stops the machine OPR, carry out the machine OPR again. When restart command is turned ON after the stop signal stops the OPR, the error "OPR restart impossible (error code: 209)" will occur.

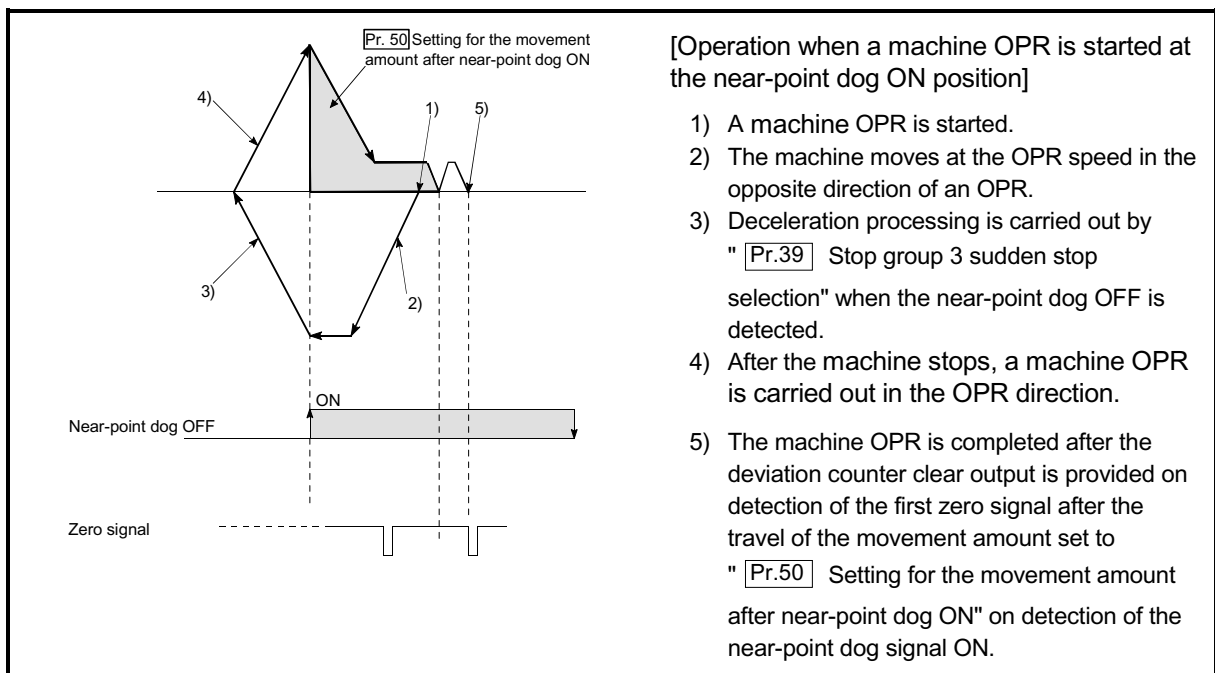


Fig. 8.13 Count method 1) machine OPR on the near-point dog ON position



8.2.5 OPR method (3): Count method 2)

The following shows an operation outline of the "method 2)" OPR method.  
 The "count method 2)" method is effective when a "zero signal" cannot be received.  
 (Note that compared to the "count method 1)" method, using this method will result in more deviation in the stop position during machine OPR.)

■ Operation chart

1)	The machine OPR is started. (The machine begins the acceleration designated in " Pr.51 OPR acceleration time selection", in the direction designated in " Pr.44 OPR direction". It then moves at the " Pr.46 OPR speed" when the acceleration is completed.)
2)	The machine begins decelerating when the near-point dog ON is detected.
3)	The machine decelerates to the " Pr.47 Creep speed", and subsequently moves at that speed.
4)	The command from the QD75 will stop and the machine OPR will be completed when the machine moves the movement amount set in " Pr.50 Setting for the movement amount after near-point dog ON " from the near-point dog ON position.

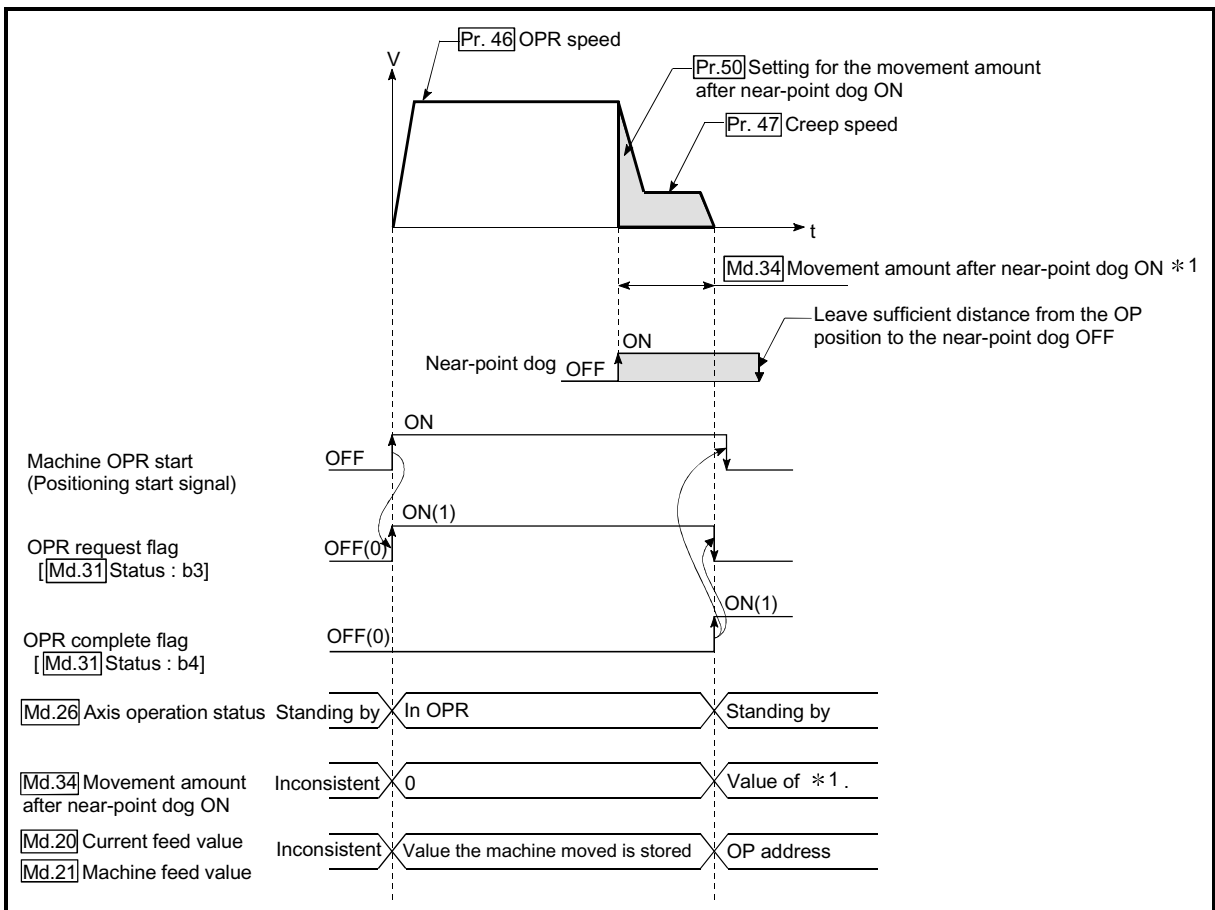


Fig. 8.14 Count method 2) machine OPR

### ■ Restrictions

When this method is used, a deviation will occur in the stop position (OP) compared to other OPR methods because an error of about 1 ms occurs in taking in the near-point dog ON.

### ■ Precautions during operation

- (1) An error "Count method movement amount fault (error code: 206)" will occur and the operation will not start if the " [Pr.50] Setting for the movement amount after near-point dog ON" is smaller than the deceleration distance from the " [Pr.46] OPR speed" to " [Pr.47] Creep speed".

A deceleration stop will be carried out if the speed is changed during the operation and an error occurs.

- (2) The following shows the operation when a machine OPR is started while the near-point dog is ON.
- (3) When the stop signal stops the machine OPR, carry out the machine OPR again. When restart command is turned ON after the stop signal stops the OPR, the error "OPR restart impossible (error code: 209)" will occur.

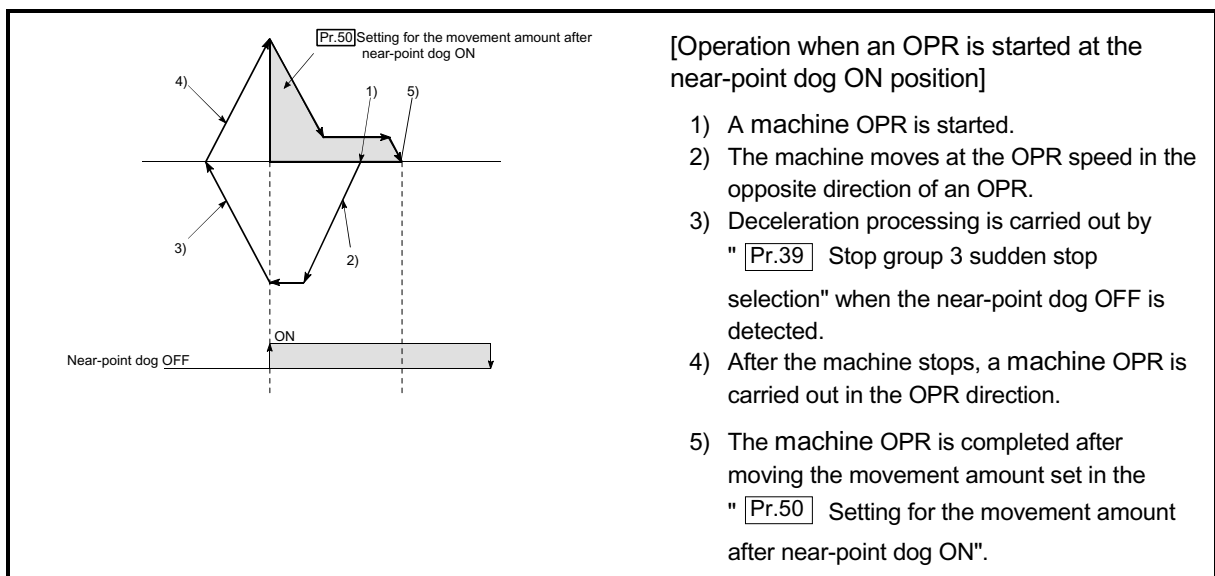


Fig. 8.15 Count method 2) machine OPR on the near-point dog ON position

### 8.2.6 OPR method (4): Data set method

The following shows an operation outline of the "Data set method" OPR method.

The "Data set method" method is effective when a "Near-point dog" does not used.

It can be used with absolute position system.

With the data set method OPR, the position where the machine OPR has been carried out, is registered into the QD75 as the OP, and the current feed value and feed machine value is overwritten to an OP address.

Use the JOG or manual pulse generator operation to move the OP.

#### ■ Operation chart

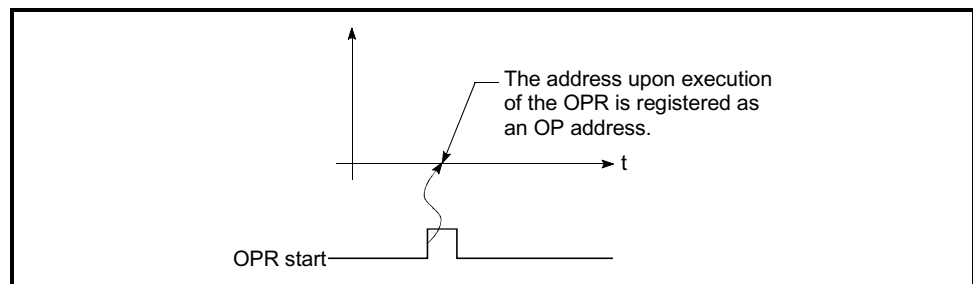


Fig. 8.16 Data set method OPR

#### ■ Precautions during operation

- (1) The zero point must have been passed before the OPR is carried out after the power supply is turned ON. If the OPR is carried out without passing the zero point even once, the "OPR restart zero point not passed error" will occur. When the "Home positioning return (OPR) restart zero point not passed error" occurs, perform the JOG or similar operation so that the servomotor makes more than one revolution after an error reset, before carrying out the machine OPR again.
- (2) When it is not the case of the absolute position system, starting the data set method OPR will be identical to the function of the current value change.
- (3) The OPR data used for the data set method is the "OPR method" and "OP address".  
The OPR data other than that for the OPR method and OP address is not used for the data set method OPR method, but if a value is set the outside the setting range, an error will occur when the PLC READY signal (Y0) is turned ON so that the preparation complete (X0) is not turned OFF.  
With the OPR data other than that for the OPR method and OP address, set an arbitrary value (default value can be allowed) within each data setting range so that an error will not occur upon receiving the PLC READY signal ON.

## 8.3 Fast OPR

## 8.3.1 Outline of the fast OPR operation

■ Fast OPR operation

In a fast OPR, positioning is carried out by a machine OPR to the "Md.21 Machine feed value" stored in the QD75.

The following shows the operation during a basic fast OPR start.

- 1) The fast OPR is started.
- 2) Positioning control begins to the "Md.21 Machine feed value", begins at speed set in the OPR parameters ( Pr.43 to Pr.57 ).
- 3) The fast OPR is completed.

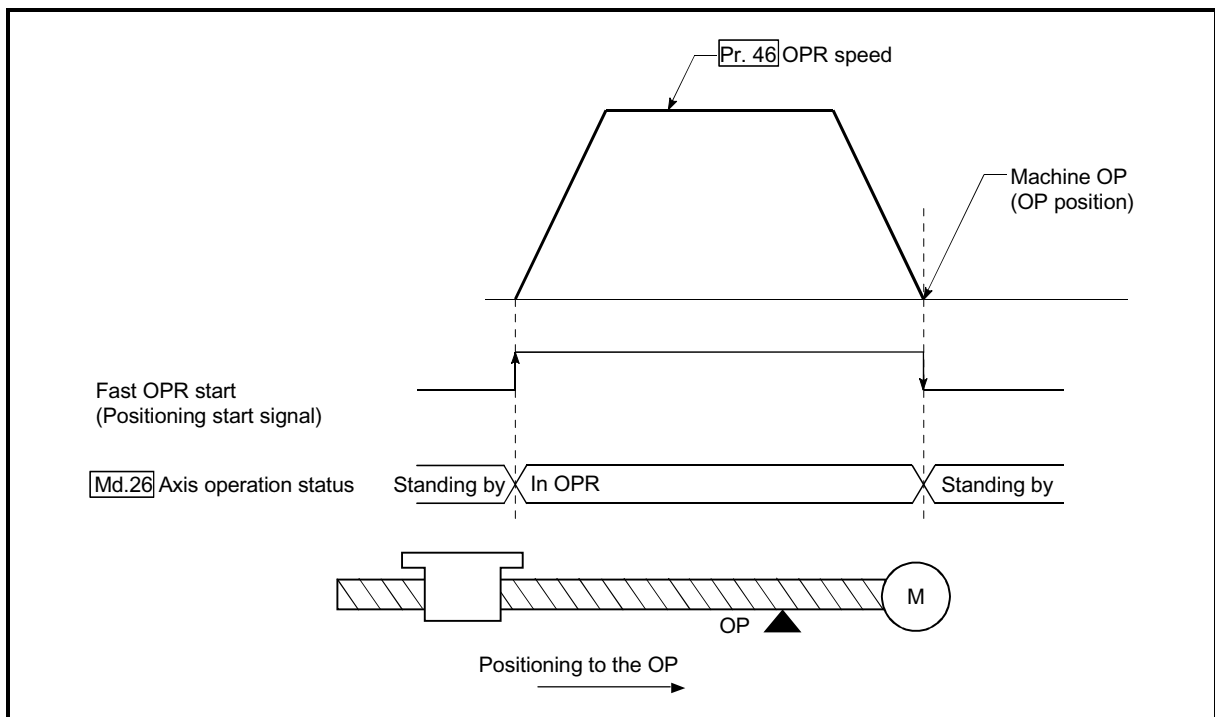


Fig. 8.17 Fast OPR

■ Operation timing and processing time of fast OPR

The following shows details about the operation timing and time during fast OPR.

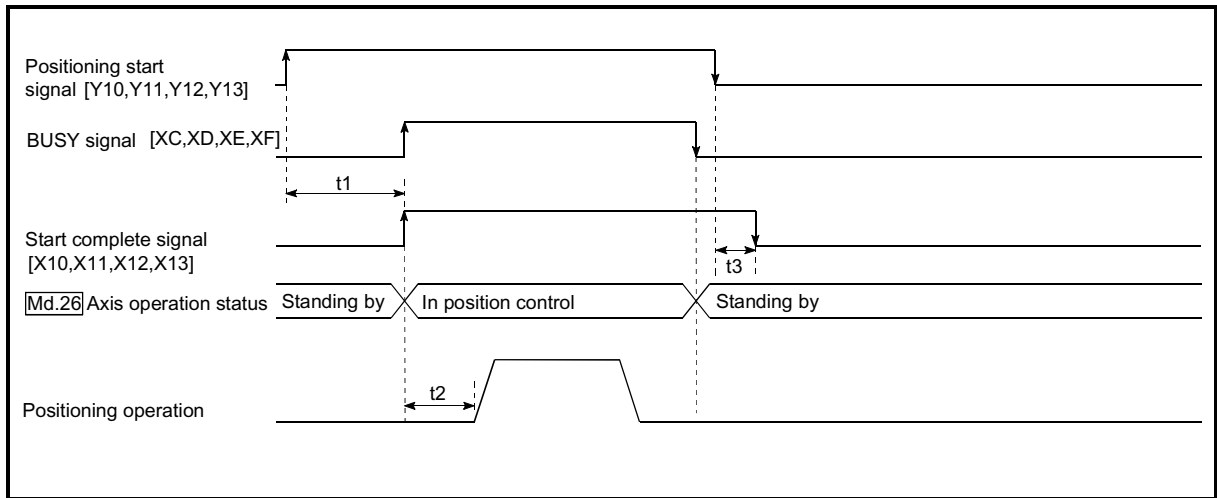


Fig. 8.18 Operation timing and processing time of fast OPR

Normal timing time

Unit: ms

t1	t2	t3
1.0 to 1.3	2.7 to 4.4	0 to 3.5

∅The t1 timing time could be delayed by the operation state of other axes.

■ Operating restrictions

When the OPR complete flag ([Md.31] Status: b3) is ON, executing a fast OPR start will result in an "Home positioning return (OPR) request flag ON" error (error code: 207)".

# Chapter 9 Major Positioning Control

The details and usage of the major positioning controls (control functions using the "positioning data") are explained in this chapter.

The major positioning controls include such controls as "positioning control" in which positioning is carried out to a designated position using the address information, "speed control" in which a rotating object is controlled at a constant speed, "speed-position switching control" in which the operation is shifted from "speed control" to "position control" and "position-speed switching control" in which the operation is shifted from "position control" to "speed control".

Carry out the required settings to match each control.

9.1	Outline of major positioning controls.....	9- 2
9.1.1	Data required for major positioning control.....	9- 4
9.1.2	Operation patterns of major positioning controls .....	9- 5
9.1.3	Designating the positioning address .....	9- 15
9.1.4	Confirming the current value .....	9- 16
9.1.5	Control unit "degree" handling.....	9- 18
9.1.6	Interpolation control .....	9- 21
9.2	Setting the positioning data .....	9- 25
9.2.1	Relation between each control and positioning data.....	9- 25
9.2.2	1-axis linear control.....	9- 27
9.2.3	2-axis linear interpolation control.....	9- 29
9.2.4	3-axis linear interpolation control.....	9- 33
9.2.5	4-axis linear interpolation control.....	9- 39
9.2.6	1-axis fixed-feed control.....	9- 44
9.2.7	2-axis fixed-feed control (interpolation).....	9- 46
9.2.8	3-axis fixed-feed control (interpolation).....	9- 48
9.2.9	4-axis fixed-feed control (interpolation) .....	9- 52
9.2.10	2-axis circular interpolation control with sub point designation .....	9- 54
9.2.11	2-axis circular interpolation control with center point designation.....	9- 60
9.2.12	1-axis speed control.....	9- 68
9.2.13	2-axis speed control.....	9- 71
9.2.14	3-axis speed control.....	9- 74
9.2.15	4-axis speed control.....	9- 78
9.2.16	Speed-position switching control (INC mode) .....	9- 83
9.2.17	Speed-position switching control (ABS mode) .....	9- 91
9.2.18	Position-speed switching control.....	9- 99
9.2.19	Current value changing .....	9-106
9.2.20	NOP instruction.....	9-111
9.2.21	JUMP instruction.....	9-112
9.2.22	LOOP .....	9-114
9.2.23	LEND.....	9-115

9.1 Outline of major positioning controls

"Major positioning controls" are carried out using the "positioning data" stored in the QD75.

The basic controls such as position control and speed control are executed by setting the required items in this "positioning data", and then starting that positioning data.

The control system for the "major positioning controls" is set in setting item "Da.2 Control system" of the positioning data.

Control defined as a "major positioning control" carries out the following types of control according to the "Da.2 Control system" setting.

Major positioning control		Da.2 Control system	Details	
Position control *	Linear control	1-axis linear control	ABS Linear 1 INC Linear 1	Positioning of a designated 1 axis is carried out from the start address (current stop position) to the designated position.
		2-axis linear interpolation control *	ABS Linear 2 INC Linear 2	Using a designated 2 axes, linear interpolation control is carried out from the start address (current stop position) to the designated position.
		3-axis linear interpolation control *	ABS Linear 3 INC Linear 3	Using a designated 3 axes, linear interpolation control is carried out from the start address (current stop position) to the designated position.
		4-axis linear interpolation control *	ABS Linear 4 INC Linear 4	Using a designated 4 axes, linear interpolation control is carried out from the start address (current stop position) to the designated position.
	Fixed-feed control	1-axis fixed-feed control	Fixed-feed 1	Positioning of a designated 1 axis is carried out from the start address (current stop position). (The "Md.20 Current feed value" is set to "0" at the start.)
		2-axis fixed-feed control *	Fixed-feed 2	Using a designated 2 axes, linear interpolation control is carried out from the start address (current stop position). (The "Md.20 Current feed value" is set to "0" at the start.)
		3-axis fixed-feed control *	Fixed-feed 3	Using a designated 3 axes, linear interpolation control is carried out from the start address (current stop position). (The "Md.20 Current feed value" is set to "0" at the start.)
		4-axis fixed-feed control *	Fixed-feed 4	Using a designated 4 axes, linear interpolation control is carried out from the start address (current stop position). (The "Md.20 Current feed value" is set to "0" at the start.)
	2-axis circular interpolation control *	Sub point designation	ABS Circular sub INC Circular sub	The axis in which the interpolation control system is set is regarded as the reference axis. Positioning is carried out in an arc path to a designated position, while controlling the other axis (interpolation axis) to match the positioning data set in the reference axis.
		Center point designation	ABS Circular right ABS Circular left INC Circular right INC Circular left	
	Speed control *	1-axis speed control	Forward run speed 1 Reverse run speed 1	The speed control of the designated 1 axis is carried out.
		2-axis speed control *	Forward run speed 2 Reverse run speed 2	The speed control of the designated 2 axes is carried out.
3-axis speed control *		Forward run speed 3 Reverse run speed 3	The speed control of the designated 3 axes is carried out.	
4-axis speed control *		Forward run speed 4 Reverse run speed 4	The speed control of the 4 axes is carried out.	

Major positioning control		Da.2 Control system	Details
Speed-position switching control		Forward run speed/position Reverse run speed/position	The control is continued as position control (positioning for the designated address or movement amount) by turning ON the "speed-position switching signal" after first carrying out speed control.
Position-speed switching control		Forward run position/speed Reverse run position/speed	The control is continued as speed control by turning ON the "position-speed switching signal" after first carrying out position control.
Other control	NOP instruction	NOP instruction	A nonexecutable control system. When this instruction is set, the operation is transferred to the next data operation, and the instruction is not executed.
	Current value changing	Current value changing	The current feed value ( Md.20 ) is changed to an address set in the positioning data. This can be carried out by either of the following 2 methods. (The machine feed value cannot be changed.) ≠ Current value changing using the control system ≠ Current value changing using the current value changing start No. (No. 9003).
	JUMP instruction	JUMP instruction	An unconditional or conditional JUMP is carried out to a designated positioning data No.
	LOOP	LOOP	A repeat control is carried out by repeat LOOP to LEND.
	LEND	LEND	Control is returned to the top of the repeat control by repeat LOOP to LEND. After the repeat operation is completed specified times, the next positioning data is run.

\* In "2-axis linear interpolation control", "3-axis linear interpolation control", "4-axis linear interpolation control", "2-axis fixed-feed control", "3-axis fixed-feed control", "4-axis fixed-feed control", "2-axis circular interpolation control", "2-axis speed control", "3-axis speed control" and "4-axis speed control", control is carried out so that linear and arc paths are drawn using a motor set in two or more axes directions. This kind of control is called "interpolation control". (Refer to Section 9.1.6 "Interpolation control" for details.)



## 9.1.1 Data required for major positioning control

The following table shows an outline of the "positioning data" configuration and setting details required to carry out the "major positioning controls".

Setting item		Setting details	
Positioning data No. 1	Da.1	Operation pattern	Set the method by which the continuous positioning data (Ex: positioning data No. 1, No. 2, No. 3) will be controlled. (Refer to Section "9.1.2".)
	Da.2	Control system	Set the control system defined as a "major positioning control". (Refer to Section "9.1".)
	Da.3	Acceleration time No.	Select and set the acceleration time at control start. (Select one of the four values set in Pr.9 , Pr.25 , Pr.26 , and Pr.27 for the acceleration time.)
	Da.4	Deceleration time No.	Select and set the deceleration time at control stop. (Select one of the four values set in Pr.10 , Pr.28 , Pr.29 , and Pr.30 for the deceleration time.)
	Da.5	Axis to be interpolated	Set an axis to be interpolated (partner axis) during the 2-axis interpolation operation (Refer to Section 9.1.6).
	Da.6	Positioning address/movement amount	Set the target value during position control. (Refer to Section "9.1.3".)
	Da.7	Arc address	Set the sub point or center point address during circular interpolation control.
	Da.8	Command speed	Set the speed during the control execution.
	Da.9	Dwell time	Set the time the machine waits from the completion of the executed positioning control and the stopping of the workpiece until the judgment of the QD75 positioning completion.
	Da.10	M code	Set this item when carrying out sub work (clamp and drill stops, tool replacement, etc.) corresponding to the code No. related to the positioning data execution.

\* The settings and setting requirement for the setting details of Da.1 to Da.10 differ according to the "Da.2 Control system". (Refer to Section 9.2 "Setting the positioning data".)

#### ■ Major positioning control sub functions

Refer to Section 3.2.4 "Combination of QD75 major functions and sub functions" for details on "sub functions" that can be combined with the major positioning control.

Also refer to Chapter 12 "Control sub Functions" for details on each sub function.

#### ■ Major positioning control from peripheral devices

"Major positioning control" can be executed from the peripheral device test mode. Refer to GX Configurator-QP Operating Manual for details on carrying out major positioning control from the peripheral device.

#### REMARK

≦ 600 positioning data (positioning data No. 1 to 600) items can be set per axis.


9.1.2 Operation patterns of major positioning controls

In "major positioning control" (high-level positioning control), "Da.1 Operation pattern" can be set to designate whether to continue executing positioning data after the started positioning data. The "operation pattern" includes the following 3 types.

- Positioning complete — (1) Independent positioning control (operation pattern: 00)
- Positioning continue — (2) Continuous positioning control (operation pattern: 01)
- (3) Continuous path control (operation pattern: 11)

The following shows examples of operation patterns when "1-axis linear control (ABS linear 1)" is set in positioning data No. 1 to No. 6 of axis 1. Details of each operation pattern are shown on the following pages.

< Operation example when "1-axis linear positioning" is set in the positioning data of axis 1 >

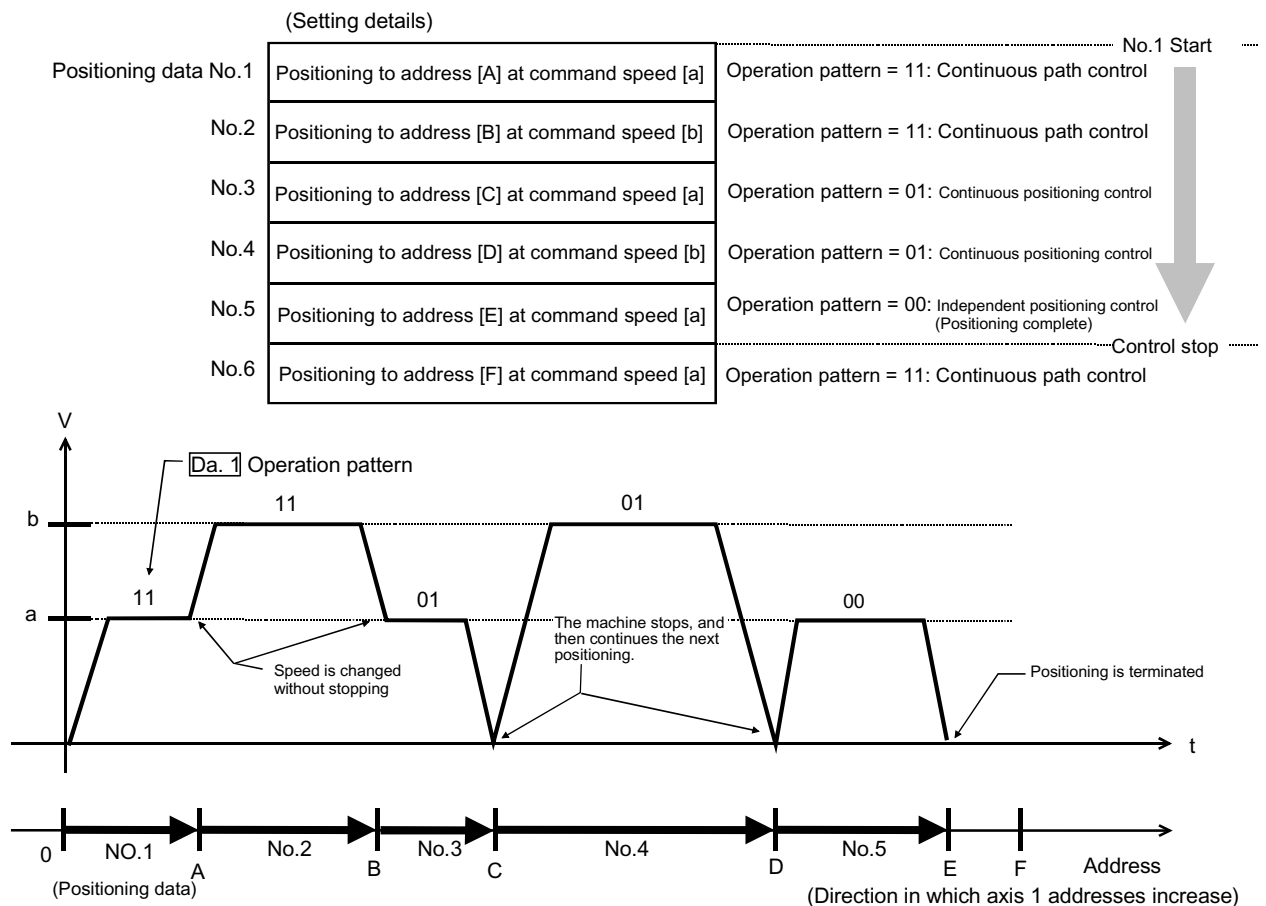

<b>POINT</b>	The BUSY signal [XC, XD, XE, XF] turns ON even when position control of movement amount 0 is executed. However, since the ON time is short, the ON status may not be detected in the PLC program.
--------------	---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

**[1] Independent positioning control (Positioning complete)**

This control is set when executing only one designated data item of positioning. If a dwell time is designated, the positioning will complete after the designated time elapses.

This data (operation pattern [00] data) becomes the end of block data when carrying out block positioning. (The positioning stops after this data is executed.)

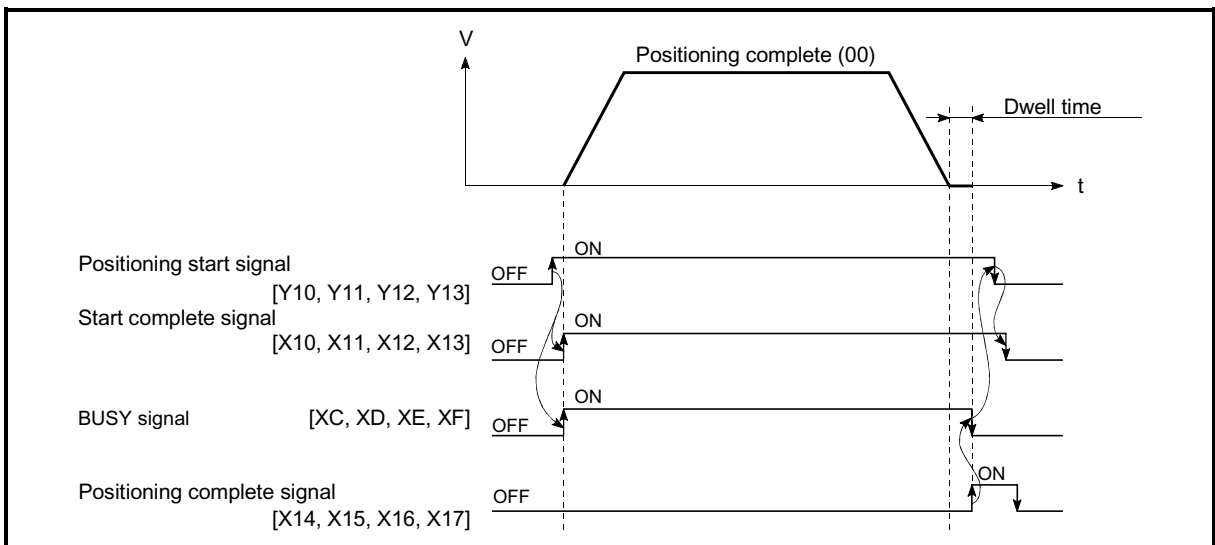


Fig. 9.1 Operation during independent positioning control

[2] Continuous positioning control

- (1) The machine always automatically decelerates each time the positioning is completed. Acceleration is then carried out after the QD75 command speed reaches 0 to carry out the next positioning data operation. If a dwell time is designated, the acceleration is carried out after the designated time elapses.
- (2) In operation by continuous positioning control (operation pattern "01"), the next positioning No. is automatically executed. Always set operation pattern "00" in the last positioning data to complete the positioning. If the operation pattern is set to positioning continue ("01" or "11"), the operation will continue until operation pattern "00" is found. If the operation pattern "00" cannot be found, the operation may be carried out until the positioning data No. 600. If the operation pattern of the positioning data No. 600 is not completed, the operation will be started again from the positioning data No. 1.

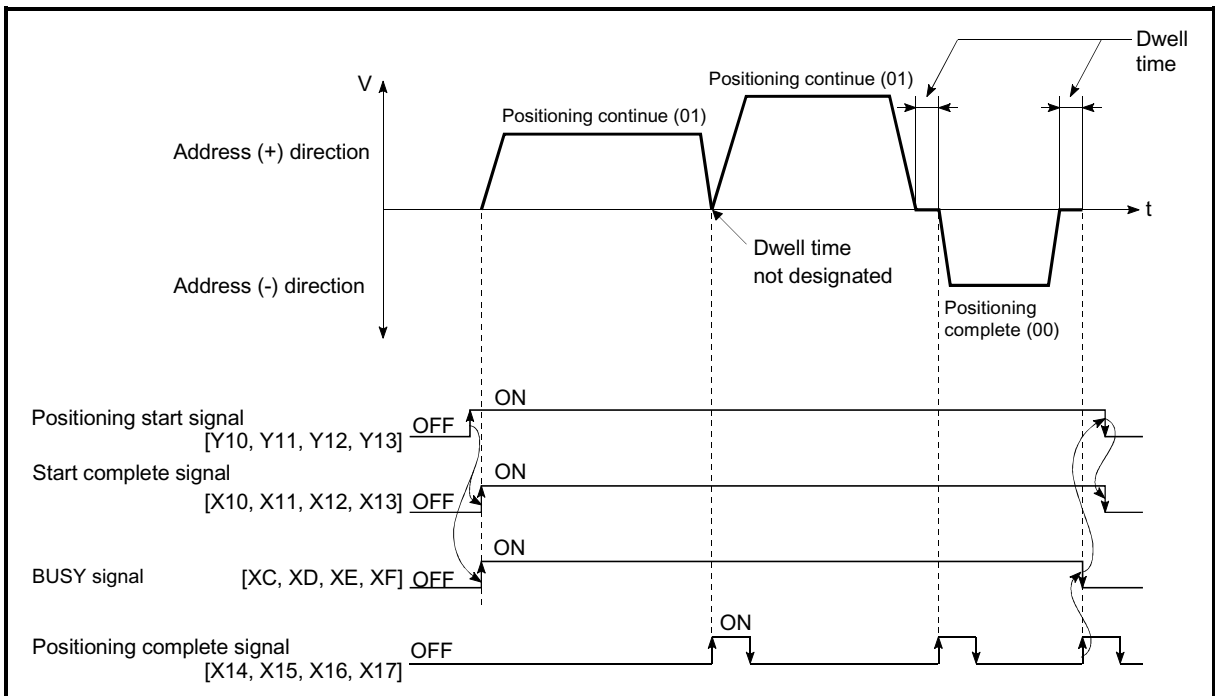


Fig. 9.2 Operation during continuous positioning control



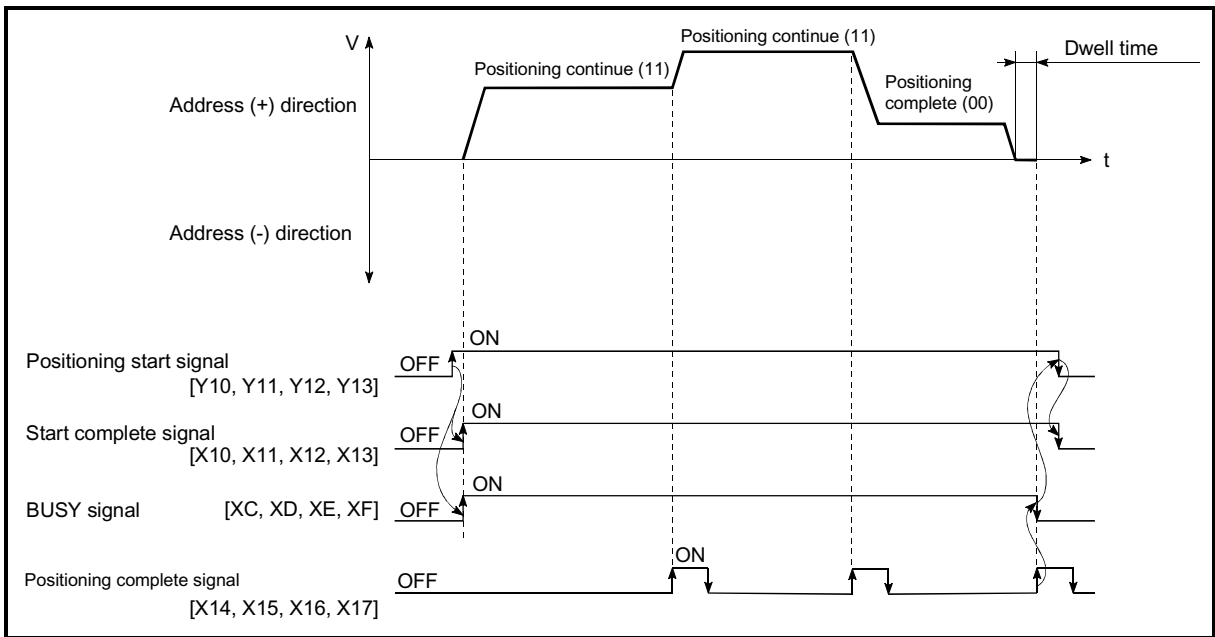



Fig. 9.3 Operation during continuous path control (Standard speed switching mode)

**POINT**

In the continuous path control, a speed variation will not occur using the near-pass function when the positioning data No. is switched (Refer to Section 12.3.3 "Near-pass function").

- (2) Deceleration stop conditions during continuous path control  
Deceleration stops are not carried out in continuous path control, but the machine will carry out a deceleration stop to speed "0" in the following cases (a) to (d).

- (a) When the operation pattern of the positioning data currently being executed is "continuous path control: 11", and the movement direction of the positioning data currently being executed differs from that of the next positioning data. (Only for 1-axis positioning control (Refer to the "Point" in the next page.))

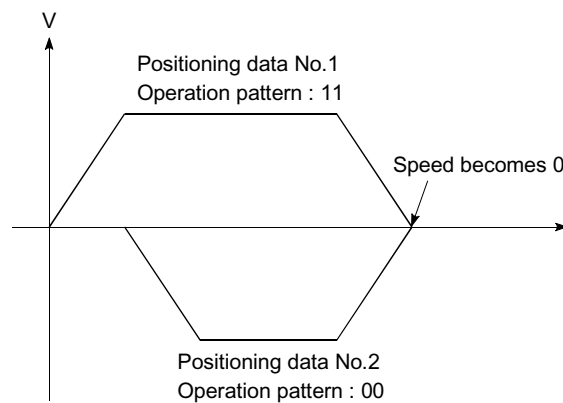


- (b) When the operation pattern of the positioning data currently being executed is "continuous path control: 11", and the movement amount of the next positioning data is "0".
- (c) During operation by step operation. (Refer to Section 12.7.1 "Step function".)
- (d) When there is an error in the positioning data to carry out the next operation.

POINTS
<p>(1) The movement direction is not checked during interpolation operations. Thus, automatic deceleration to a stop will not be carried out even if the movement direction is changed (See the figures below).                      Because of this, the interpolation axis may suddenly reverse direction.                      To avoid this sudden direction reversal in the interpolation axis, set the pass point to continuous positioning control "01" instead of setting it to continuous path control "11".</p> <div style="display: flex; justify-content: space-around; align-items: flex-start;"> <div style="text-align: center;"> <p>[Positioning by interpolation]</p> </div> <div style="text-align: center;"> <p>[Reference axis operation]</p> </div> <div style="text-align: center;"> <p>[Interpolation axis operation]</p> </div> </div> <p>(2) When a "0" is set in the " <span style="border: 1px solid black; padding: 0 2px;">Da.6</span> Positioning address/movement amount" of the continuous path control positioning data, the command speed of about 2 ms is reduced to 0.                      When a "0" is set in the " <span style="border: 1px solid black; padding: 0 2px;">Da.6</span> Positioning address/movement amount" to increase the number of speed change points in the future, change the " <span style="border: 1px solid black; padding: 0 2px;">Da.2</span> Control system" to the "NOP instruction" to make the control nonexecutable.                      (Refer to Section 9.2.20 "NOP instruction".)</p> <p>(3) In the continuous path control positioning data, assure a movement distance so that the execution time with that data is 100 ms or longer, or lower the command speed.</p>

(3) Speed handling

- (a) Continuous path control command speeds are set with each positioning data.  
The QD75 then carries out the positioning at the speed designated with each positioning data.
- (b) The command speed can be set to "-1" in continuous path control.  
The control will be carried out at the speed used in the previous positioning data No. if the command speed is set to "-1".  
(The "current speed" will be displayed in the command speed when the positioning data is set with a peripheral device. The current speed is the speed of the positioning control being executed currently.)
  - 1) The speed does not need to be set in each positioning data when carrying out uniform speed control if "-1" is set beforehand in the command speed.
  - 2) If the speed is changed in the previous positioning data when "-1" is set in the command speed, the operation can be continued at the new speed.
  - 3) An error "no command speed error (error code: 503)" occurs and positioning cannot be started if "-1" is set in the command speed of the first positioning data at start.

[Relation between the command speed and current speed]

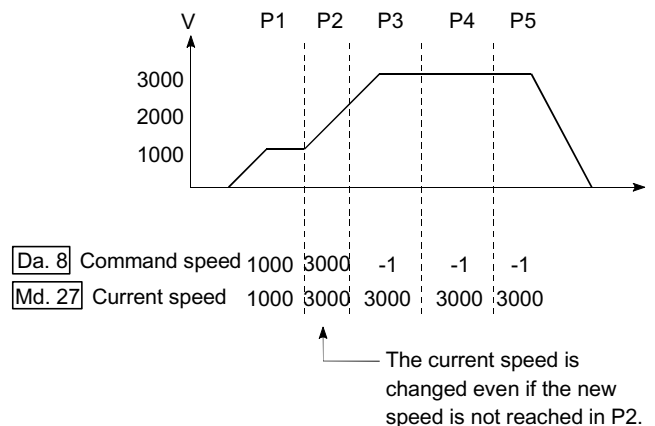

<b>POINTS</b>	<p>(1) In the continuous path control, a speed variation will not occur using the near-pass function when the positioning data is switched (Refer to Section 12.3.3 "Near-pass function").</p> <p>(2) The QD75 holds the command speed set with the positioning data, and the latest value of the speed set with the speed change request as the "Md.27" Current speed". It controls the operation at the "current speed" when "-1" is set in the command speed. (Depending on the relation between the movement amount and the changed speed, the feedrate may not reach the new speed value, but even then the current speed will be updated.)</p> <p>(3) When the address for speed change is identified beforehand, generate and execute the positioning data for speed change by the continuous path control to carry out the speed change without requesting the speed change with a PLC program.</p>
---------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------



(4) Speed switching

(Refer to " Pr.19 Speed switching mode".)

(a) Standard speed switching mode

- 1) If the respective command speeds differ in the "positioning data currently being executed" and the "positioning data to carry out the next operation", the machine will accelerate or decelerate after reaching the positioning point set in the "positioning data currently being executed" and the speed will change over to the speed set in the "positioning data to carry out the next operation".
- 2) The parameters used in acceleration/deceleration to the command speed set in the "positioning data to carry out the next operation" are those of the positioning data to carry out acceleration/deceleration.  
Speed switching will not be carried out if the command speeds are the same.


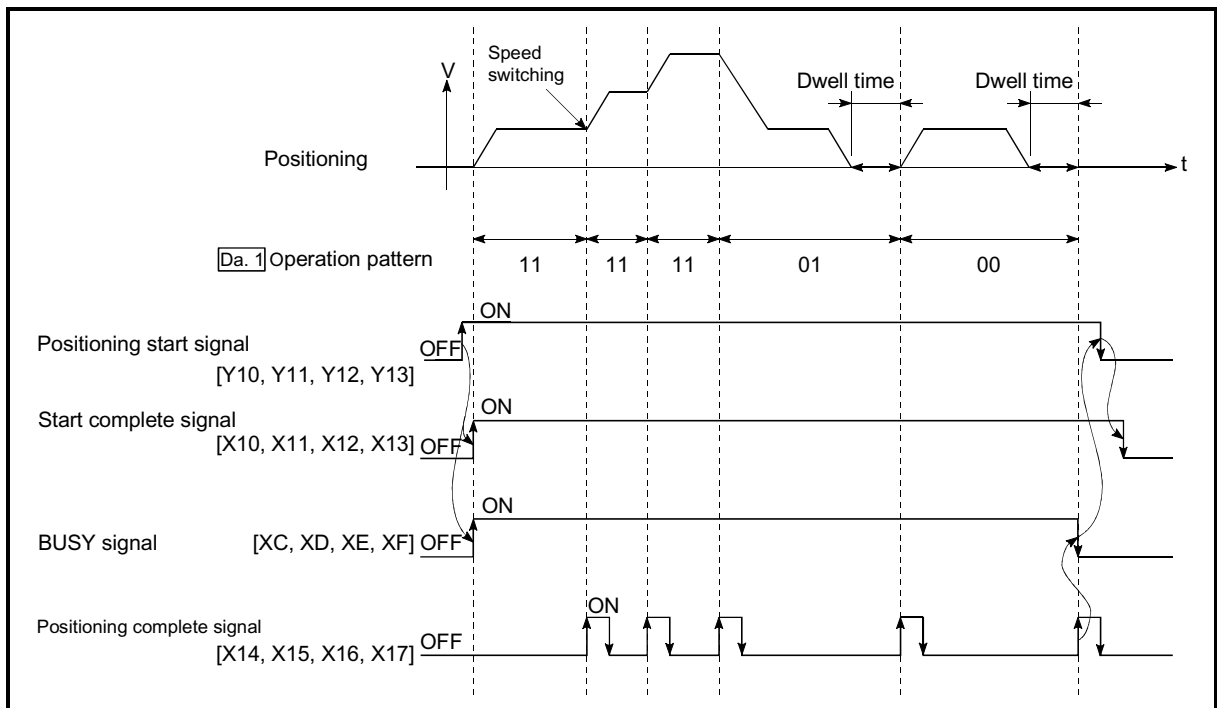


Fig. 9.4 Operation for the standard speed switching mode

3) Speed switching condition


If the movement amount is small in regard to the target speed, the current speed may not reach the target speed even if acceleration/deceleration is carried out. In this case, the machine is accelerated/decelerated so that it nears the target speed. If the movement amount will be exceeded when automatic deceleration is required (Ex. Operation patterns "00", "01", etc.), the machine will immediately stop at the designated positioning address, and a "insufficient movement distance warning (warning code: 513)" will occur.

[When the speed cannot change over in P2]  
 When the relation of the speeds is  $P1 = P4, P2 = P3, P1 < P2$ .

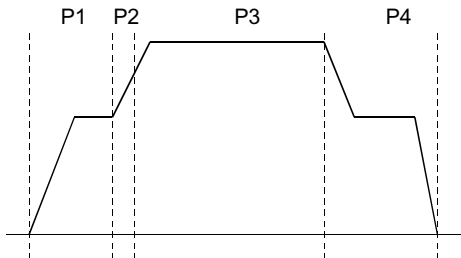

[When the movement amount is small during automatic deceleration]

The movement amount required to carry out the automatic deceleration cannot be secured, so the machine immediately stops in a speed 0 status.

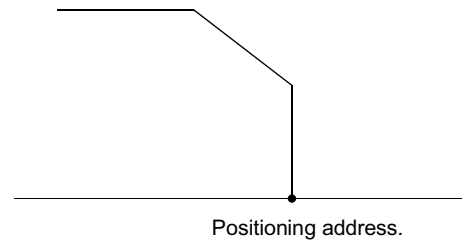

(b) Front-loading speed switching mode

- 1) If the respective command speeds differ in the "positioning data currently being executed" and the "positioning data to carry out the next operation", the speed will change over to the speed set in the "positioning data to carry out the next operation" at the end of the "positioning data currently being executed".
- 2) The parameters used in acceleration/deceleration to the command speed set in the "positioning data to carry out the next operation" are those of the positioning data to carry out acceleration/deceleration. Speed switching will not be carried out if the command speeds are the same.

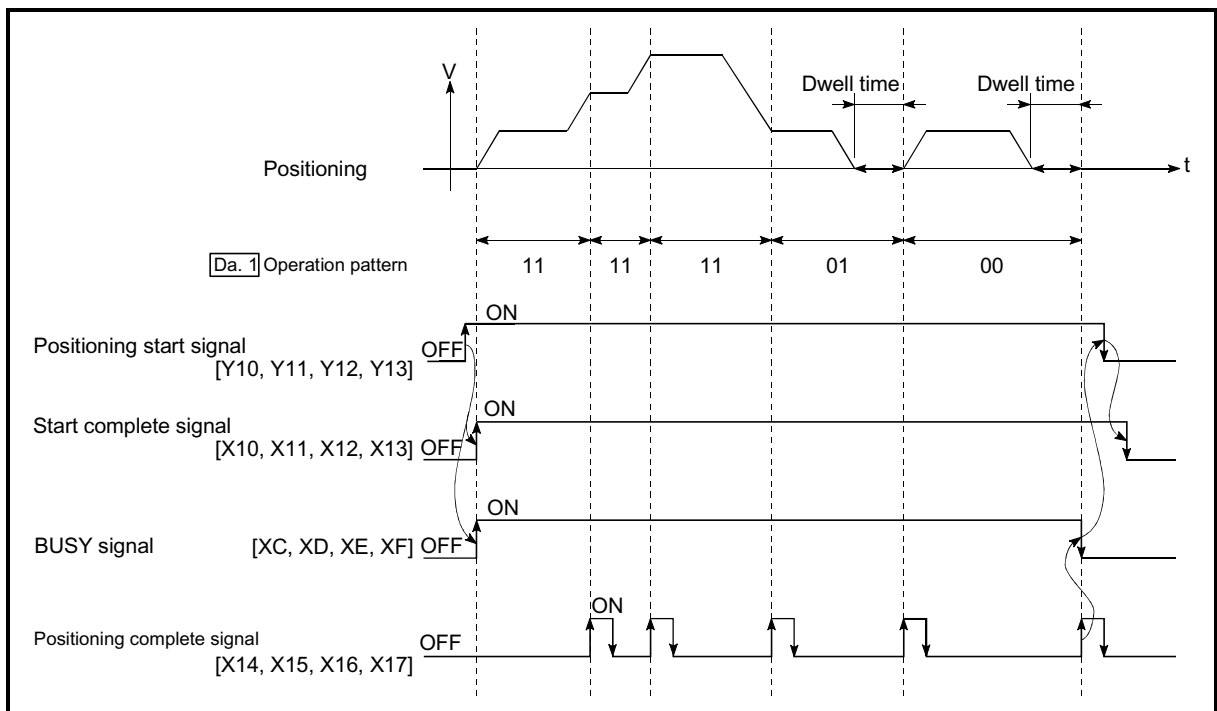



Fig. 9.5 Operation for the front-loading speed switching mode

3) Speed switching condition

If the movement amount is small in regard to the target speed, the current speed may not reach the target speed even if acceleration/deceleration is carried out. In this case, the machine is accelerated/decelerated so that it nears the target speed. If the movement amount will be exceeded when automatic deceleration is required (Ex. Operation patterns "00", "01", etc.), the machine will immediately stop at the designated positioning address, and a "insufficient movement distance warning (warning code: 513)" will occur.


[When the speed cannot change over to the P2 speed in P1]

When the relation of the speeds is  $P1 = P4, P2 = P3, P1 < P2$ .

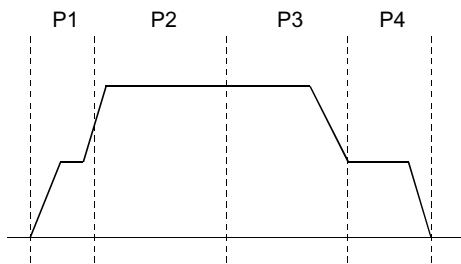

[When the movement amount is small during automatic deceleration]

The movement amount required to carry out the automatic deceleration cannot be secured, so the machine immediately stops in a speed 0 status.

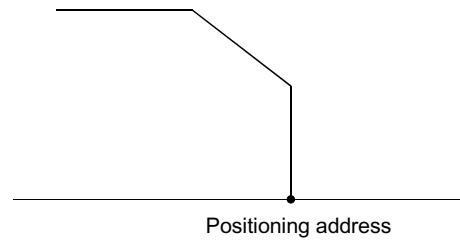

9.1.3 Designating the positioning address

The following shows the two methods for commanding the position in control using positioning data.

■ Absolute system

Positioning is carried out to a designated position (absolute address) having the OP as a reference. This address is regarded as the positioning address. (The start point can be anywhere.)

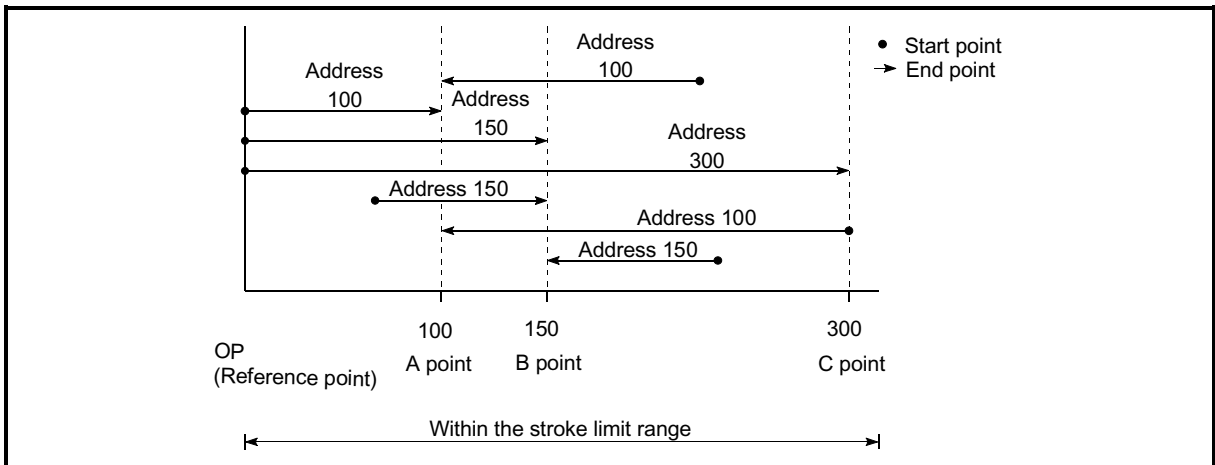


Fig. 9.6 Absolute system positioning

■ Incremental system

The position where the machine is currently stopped is regarded as the start point, and positioning is carried out for a designated movement amount in a designated movement direction.

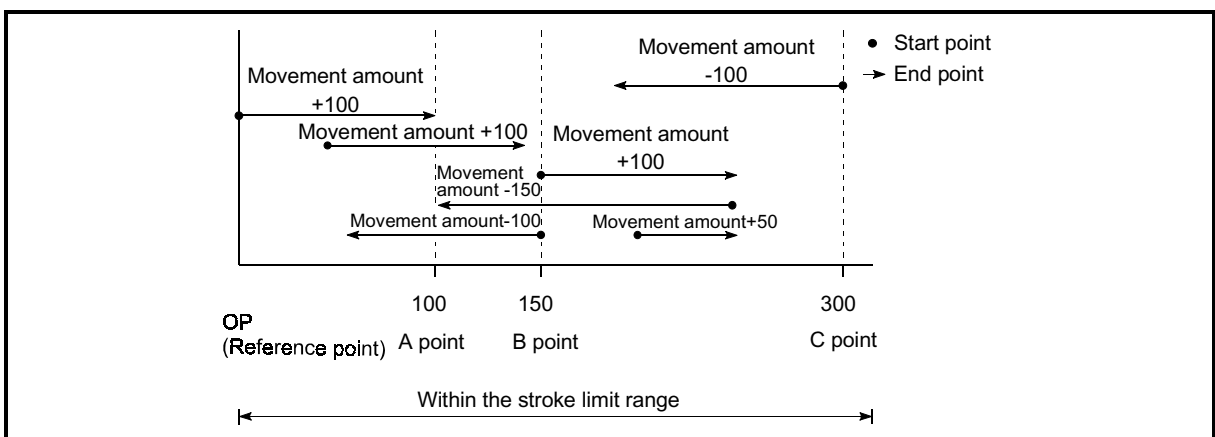


Fig. 9.7 Incremental system positioning

9.1.4 Confirming the current value

■ Values showing the current value

The following two types of addresses are used as values to show the position in the QD75.

These addresses ("current feed value" and "machine feed value") are stored in the monitor data area, and used in monitoring the current value display, etc.

Current feed value	<ul style="list-style-type: none"> <li>⊖ This is the value stored in "Md.20 Current feed value".</li> <li>⊖ This value has an address established with a "machine OPR" as a reference, but the address can be changed by changing the current value to a new value.</li> <li>⊖ This value is updated every 3.5ms.</li> </ul>
Machine feed value	<ul style="list-style-type: none"> <li>⊖ This is the value stored in "Md.21 Machine feed value".</li> <li>⊖ This value always has an address established with a "machine OPR" as a reference. The address cannot be changed, even if the current value is changed to a new value.</li> <li>⊖ This value is updated every 56.8ms.</li> </ul>

The "current feed value" and "machine feed value" are used in monitoring the current value display, etc.

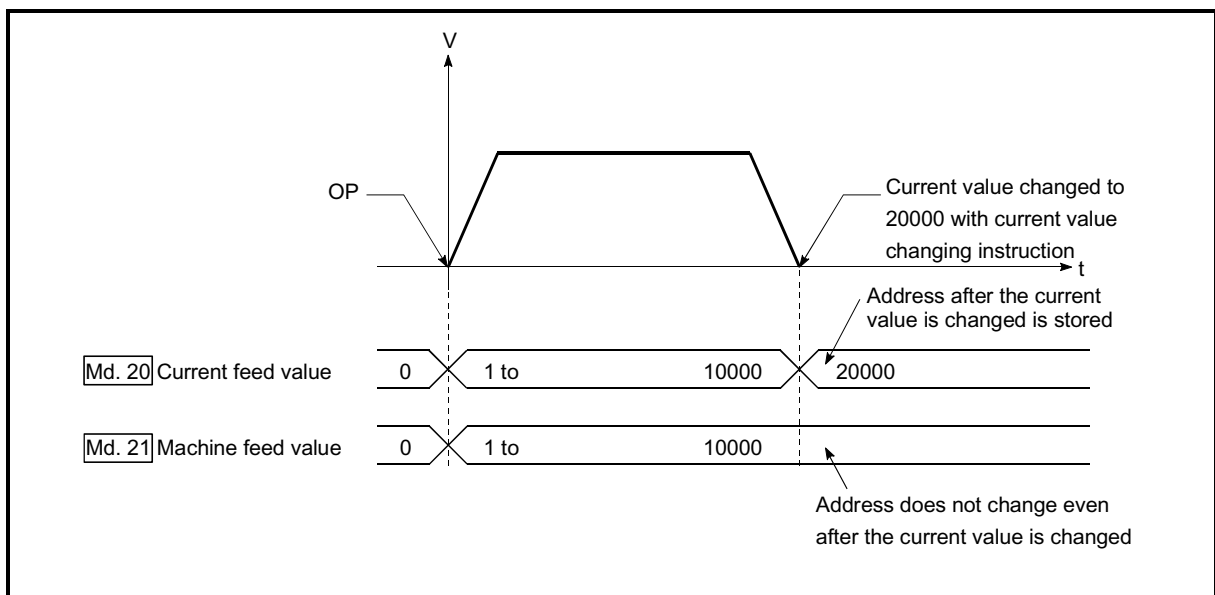


Fig. 9.8 Current feed value and machine feed value

■ Restrictions

- (1) A 3.5ms error will occur in the current value update timing when the stored "current feed value" is used in the control.  
A 56.8ms error will occur in the current value update timing when the stored "machine feed value" is used in the control.
- (2) The "current feed value" and "machine feed value" may differ from the values set in "Da.6 Positioning address/movement amount" of the positioning data if the movement amount per pulse is not set to "1".

■ Monitoring the current value

The "current feed value" and "machine feed value" are stored in the following buffer memory addresses, and can be read using a "DFRO (P) command" from the PLC CPU.

	Buffer memory addresses			
	Axis 1	Axis 2	Axis 3	Axis 4
<b>Md.20</b> Current feed value	800, 801	900, 900	1000, 1001	1100, 1101
<b>Md.21</b> Machine feed value	802, 803	902, 903	1002, 1003	1102, 1103

Example

\* Program in which the axis 1 current feed value is read to D104 and D105  
\*




9.1.5 Control unit "degree" handling

When the control unit is set to "degree", the following items differ from when other control units are set.

[1] Current feed value and machine feed value addresses

The address of "Md.20" Current feed value" becomes a ring address from 0 to 359.99999°.

But the address of "Md.21" Machine feed value" doesn't become a ring address.

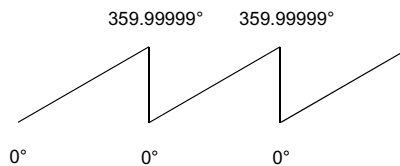


[2] Software stroke limit valid/invalid setting

With the control unit set to "degree", the software stroke limit upper and lower limit values are 0 to 359.99999.

(a) Setting to validate software stroke limit

To validate the software stroke limit, set the software stroke limit lower limit value and the upper limit value in a clockwise direction.

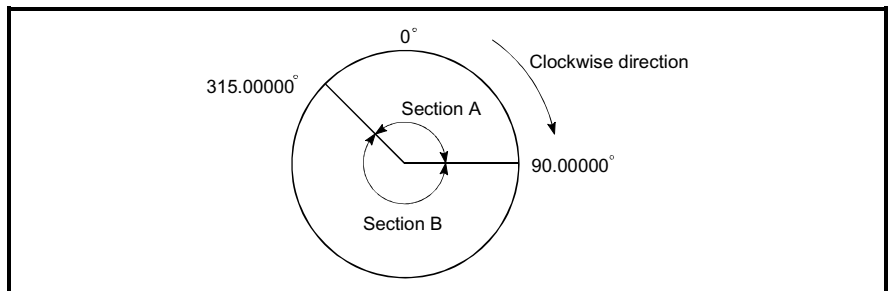

1) To set the movement range A, set as follows.

- Software stroke limit lower limit value.....315.00000°
- Software stroke limit upper limit value .....90.00000°

2) To set the movement range B, set as follows.

- Software stroke limit lower limit value.....90.00000°
- Software stroke limit upper limit value .....315.00000°

(b) Setting to invalidate software stroke limit

To invalidate the software stroke limit, set the software stroke limit lower limit value equal to the software stroke limit upper limit value.

The control can be carried out irrespective of the setting of the software stroke limit.


[3] Positioning control method when the control unit is set to "degree"

1) Absolute system

(a) When the software stroke limit is invalid

Positioning is carried out in the nearest direction to the designated address, using the current value as a reference.

(This is called "shortcut control".)

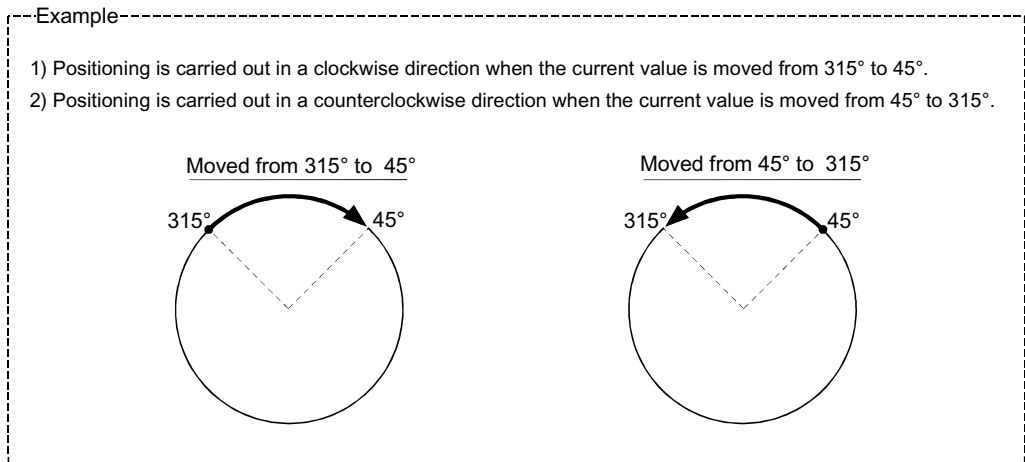

The shortcut control is invalidated and positioning in a designated direction is carried out by the "Cd.40 ABS direction in degrees".

This function can perform only when the software stroke limit is invalid. When the software stroke limit is valid, an error "ABS direction in degrees illegal" (error code: 546) occurs and positioning is not started.

To designate the movement direction in the ABS control, a "1" or "2" is written to the "Cd.40 ABS direction setting in the unit of degree" of the buffer memory (initial value: 0).

The value written to the "Cd.40 ABS direction in degrees" becomes valid only when the positioning control is started.

In the continuous positioning control and continuous path control, the operation is continued with the setting set at the time of start even if the setting is changed during the operation.

Name	Function	Buffer memory address				Initial value
		Axis 1	Axis 2	Axis 3	Axis 4	
Cd.40 ABS direction in degrees	The ABS movement direction in the unit of degree is designated. 0: Shortcut (direction setting invalid) 1: ABS clockwise 2: ABS counterclockwise	1550	1650	1750	1850	0




(b) When the software stroke limit is valid

The positioning is carried out in a clockwise/counterclockwise direction depending on the software stroke limit range setting method.

Because of this, positioning with "shortcut control" may not be possible.

Example

When the current value is moved from 0° to 315°, positioning is carried out in the clockwise direction if the software stroke limit lower limit value is 0° and the upper limit value is 345°.

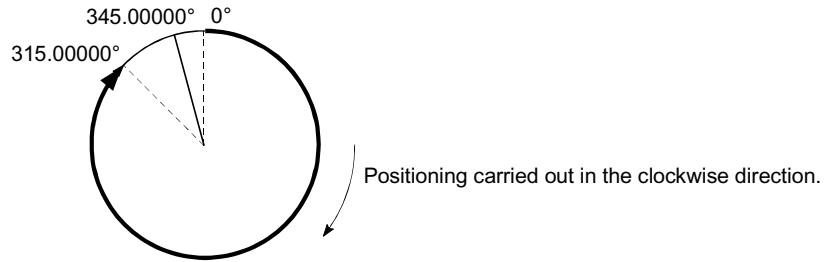

**POINT**

Positioning addresses are within a range of 0° to 359.99999°.  
Use the incremental system to carry out positioning of one rotation or more.

2) Incremental system

Positioning is carried out for a designated movement amount in a designated movement direction when in the incremental system of positioning.

The movement direction is determined by the sign (+, -) of the movement amount.

- € For a positive (+) movement direction .....Clockwise
- € For a negative (-) movement direction .....Counterclockwise

**POINT**

Positioning of 360° or more can be carried out with the incremental system.  
At this time, set as shown below to invalidate the software stroke limit.  
[Software stroke limit upper limit value = Software stroke limit lower limit value]

9.1.6 Interpolation control

■ Meaning of interpolation control

In "2-axis linear interpolation control", "3-axis linear interpolation control", "4-axis linear interpolation control", "2-axis fixed-feed control", "3-axis fixed-feed control", "4-axis fixed-feed control", "2-axis speed control", "3-axis speed control", "4-axis speed control", and "2-axis circular interpolation control", control is carried out so that linear and arc paths are drawn using a motor set in two to four axis directions. This kind of control is called "interpolation control".

In interpolation control, the axis in which the control system is set is defined as the "reference axis", and the other axis is defined as the "interpolation axis".

The QD75 controls the "reference axis" following the positioning data set in the "reference axis", and controls the "interpolation axis" corresponding to the reference axis control so that a linear or arc path is drawn.

The following table shows the reference axis and interpolation axis combinations.

Axis definition Axis set to interpolation control in "[Da.2] Control method"	Reference axis	Interpolation axis
2-axis linear interpolation control, 2-axis fixed-feed control, 2-axis circular interpolation control, 2-axis speed control	Any of axes 1, 2, 3, and 4	"Axes to be interpolated" set in reference axis
3-axis linear interpolation control, 3-axis fixed-feed control, 3-axis speed control	Axis 1	Axis 2, Axis 3
	Axis 2	Axis 3, Axis 4
	Axis 3	Axis 4, Axis 1
	Axis 4	Axis 1, Axis 2
4-axis linear interpolation control, 4-axis fixed-feed control, 4-axis speed control	Axis 1	Axis 2, Axis 3, Axis 4
	Axis 2	Axis 3, Axis 4, Axis 1
	Axis 3	Axis 4, Axis 1, Axis 2
	Axis 4	Axis 1, Axis 2, Axis 3

■ Setting the positioning data during interpolation control

When carrying out interpolation control, the same positioning data Nos. are set for the "reference axis" and the "interpolation axis".

The following table shows the "positioning data" setting items for the reference axis and interpolation axis.

Setting item		Axis	Reference axis setting item	Interpolation axis setting item
Same positioning data Nos	Da.1	Operation pattern	⊙	—
	Da.2	Control system	Linear 2, 3, 4, Fixed-feed 2, 3, 4, Circular sub, Circular right, Circular left Forward run speed 2, 3, 4 Reverse run speed 2, 3, 4	—
	Da.3	Acceleration time No.	⊙	—
	Da.4	Deceleration time No.	⊙	—
	Da.5	Axis to be interpolated.	○ *	—
	Da.6	Positioning address/movement amount	△	△
	Da.7	Arc address	△ (Only during circular sub, circular right, and circular left).	△ (Only during circular sub, circular right, and circular left).
	Da.8	Command speed	⊙	△ Only during forward run speed 2, 3, 4 and reverse run speed 2, 3, 4.
	Da.9	Dwell time	○	—
	Da.10	M code	○	—

⊙ : Setting always required

○ : Set according to requirements (Set to "—" when not used.)

△ : Setting restrictions exist

— : Setting not required (Unrelated setting item, so any setting value will be ignored. Use the initial value or a value within the setting range.)

\* : For 2-axis interpolation, the partner axis is set. If the self-axis is set, an error "Illegal interpolation description command (error code: 521)" will occur. For 3- and 4-axis interpolation, the axis setting is not required.

\* : Refer to Section 5.3 "List of positioning data" for information on the setting details.

### ■ Starting the interpolation control

The positioning data Nos. of the reference axis (axis in which interpolation control was set in "[Da.2] Control system") are started when starting the interpolation control. (Starting of the interpolation axis is not required.)

The following errors or warnings will occur and the positioning will not start if both reference axis and the interpolation axis are started.

- ≠ Reference axis : Interpolation while interpolation axis BUSY (error code: 519)
- ≠ Interpolation axis : Control system setting error (error code: 524), start during operation (warning code: 100).

### ■ Interpolation control continuous positioning

When carrying out interpolation control in which "continuous positioning control" and "continuous path control" are designated in the operation pattern, the positioning method for all positioning data from the started positioning data to the positioning data in which "positioning complete" is set must be set to interpolation control.

The QD75 may malfunction if a control system other than interpolation control is set.

### ■ Speed during interpolation control

Either the "composite speed" or "reference axis speed" can be designated as the speed during interpolation control.

( [Pr.20] Interpolation speed designation method.)

Only the "Reference axis speed" can be designated in the following interpolation control.

When a "composite speed" is set and positioning is started, the "Interpolation mode error (error code: 523)" occurs, and the system will not start.

- 4-axis linear interpolation
- 2-axis speed control
- 3-axis speed control
- 4-axis speed control

### ■ Cautions in interpolation control

(1) If either of the axes exceeds the "[Pr.8] Speed limit value" in the 2- to 4-axes speed control, the axis which exceeded the speed limit value is controlled by the speed limit value.

For the other axes which perform interpolation, the speed can be suppressed by the ratio of a command speed.

If the reference axis exceeds "[Pr.8] Speed limit value" during 2- to 4-axis linear interpolation control, 2- to 4-axis fixed-feed control or 2-axis circular interpolation control, the reference axis is controlled at the speed limit value. (The speed limit does not function on the interpolation axis side.)

(2) In 2-axis interpolation, you cannot change the combination of interpolated axes midway through operation.

<b>POINT</b>
<p>€ When the "reference axis speed" is set during interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " <b>Pr.8</b> Speed limit value".</p>

■ Limits to interpolation control

There are limits to the interpolation control that can be executed and speed ( **Pr.20** Interpolation speed designation method) that can be set, depending on the " **Pr.1** Unit setting" of the reference axis and interpolation axis. (For example, circular interpolation control cannot be executed if the reference axis and interpolation axis units differ.)

The following table shows the interpolation control and speed designation limits.

" <b>Da.2</b> Control system" interpolation control	" <b>Pr.20</b> Interpolation speed designation method	" <b>Pr.1</b> Unit setting *1	
		Reference axis and interpolation axis units are the same, or a combination of "mm" and "inch". *3	Reference axis and interpolation axis units differ *3
Linear 2 (ABS, INC) Fixed-feed 2	Composite speed	○	×
	Reference axis speed	○	○
Circular sub (ABS, INC) Circular right (ABS, INC) Circular left (ABS, INC)	Composite speed	○ *2	×
	Reference axis speed	×	×
Linear 3 (ABS, INC) Fixed-feed 3	Composite speed	○	×
	Reference axis speed	○	○
Linear 4 (ABS, INC) Fixed-feed 4	Composite speed	×	×
	Reference axis speed	○	○

○ : Setting possible, × : Setting not possible.

\*1 "mm" and "inch" unit mix possible.

\*2 "degree" setting not possible. A "Circular interpolation not possible (error code: 535)" will occur and the position cannot start if circular interpolation control is set when the unit is "degree". The machine will immediately stop if "degree" is set during positioning control.

\*3 The unit set in the reference axis will be used for the speed unit during control if the units differ or if "mm" and "inch" are combined.

■ Axis operation status during interpolation control

"In interpolation" will be stored in the " **Md.26** Axis operation status" during interpolation control. "Standing by" will be stored when the interpolation operation is terminated. Both the reference axis and interpolation axis will carry out a deceleration stop if an error occurs during control, and "error occurring" will be stored in the operation status.

9.2 Setting the positioning data

9.2.1 Relation between each control and positioning data

The setting requirements and details for the setting items of the positioning data to be set differ according to the "Da.2 Control system".

The following table shows the positioning data setting items corresponding to the different types of control. Details and settings for the operation of each control are shown in Section 9.2.2 and subsequent sections.

(In this section, it is assumed that the positioning data setting is carried out using GX Configurator-QP.)

Major positioning control			Position control			Speed control	Speed-position switching control	Position-speed switching control
			1-axis linear control 2-axis linear interpolation control 3-axis linear interpolation control 4-axis linear interpolation control	1-axis fixed-feed control 2-axis fixed-feed control 3-axis fixed-feed control 4-axis fixed-feed control	2-axis circular interpolation control	1-axis, 2-axis, 3-axis, 4-axis Speed control		
Positioning data setting items								
Da.1	Operation pattern	Independent positioning control (Positioning complete)	◎	◎	◎	◎	◎	◎
		Continuous positioning control	◎	◎	◎	×	◎	×
		Continuous path control	◎	×	◎	×	×	×
Da.2	Control system	Linear 1 Linear 2 Linear 3 Linear 4 *	Fixed-feed 1 Fixed-feed 2 Fixed-feed 3 Fixed-feed 4	Circular sub Circular right Circular left *	Forward run speed 1 Reverse run speed 1 Forward run speed 2 Reverse run speed 2 Forward run speed 3 Reverse run speed 3 Forward run speed 4 Reverse run speed 4	Forward run speed/position Reverse run speed/position *	Forward run position/speed  Reverse run position/speed	
Da.3	Acceleration time No.	◎	◎	◎	◎	◎	◎	
Da.4	Deceleration time No.	◎	◎	◎	◎	◎	◎	
Da.5	Axis to be interpolated	◎: 2-axis -: 1, 3, 4-axis				-	-	
Da.6	Positioning address/movement amount	◎	◎	◎	-	◎	◎	
Da.7	Arc address	-	-	◎	-	-	-	
Da.8	Command speed	◎	◎	◎	◎	◎	◎	
Da.9	Dwell time	○	○	○	○	○	○	
Da.10	M code	○	○	○	○	○	○	

◎ : Always set      ○ : Set as required ("-" when not set)

× : Setting not possible (If setting is made, an error (error code: 516) will occur at a start.)

- : Setting not required (Setting value is invalid. Use the initial values or setting values within a range where no error occurs.)

\* : The "ABS (absolute) system" or "INC (incremental) system" can be used for the control system.

**REMARK**

⚠ It is recommended that the "positioning data" be set whenever possible with GX Configurator-QP.  
 Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

Major positioning control  Positioning data setting items			Other control				
			NOP instruction	Current value changing	JUMP instruction	LOOP instruction	LEND instruction
Da.1	Operation pattern	Independent positioning control (Positioning complete)	-	⊙	-	-	-
		Continuous positioning control	-	⊙	-	-	-
		Continuous path control	-	×	-	-	-
Da.2	Control system		NOP instruction	Current value changing	JUMP instruction	LOOP instruction	LEND instruction
Da.3	Acceleration time No.		-	-	-	-	-
Da.4	Deceleration time No.		-	-	-	-	-
Da.5	Axis to be interpolated		-	-	-	-	-
Da.6	Positioning address/movement amount		-	Change destination address	-	-	-
Da.7	Arc address		-	-	-	-	-
Da.8	Command speed		-	-	-	-	-
Da.9	Dwell time		-	-	JUMP destination-positioning data No.	-	-
Da.10	M code		-	○	Condition data No. at JUMP	No. of repetition	-

- ⊙ : Always set      ○ : Set as required ("-" when not set)
- × : Setting not possible (If setting is made, an error (error code: 515) will occur.)
- : Setting not required (Setting value is invalid. Use the initial values or setting values within a range where no error occurs.)


9.2.2 1-axis linear control

In "1-axis linear control" (" Da.2 Control system" = ABS linear 1, INC linear 1), one motor is used to carry out position control in a set axis direction.

[1] 1-axis linear control (ABS linear 1)

■ Operation chart

In absolute system 1-axis linear control, addresses established by a machine OPR are used. Positioning is carried out from the current stop position (start point address) to the address (end point address) set in " Da.6 Positioning address/movement amount".

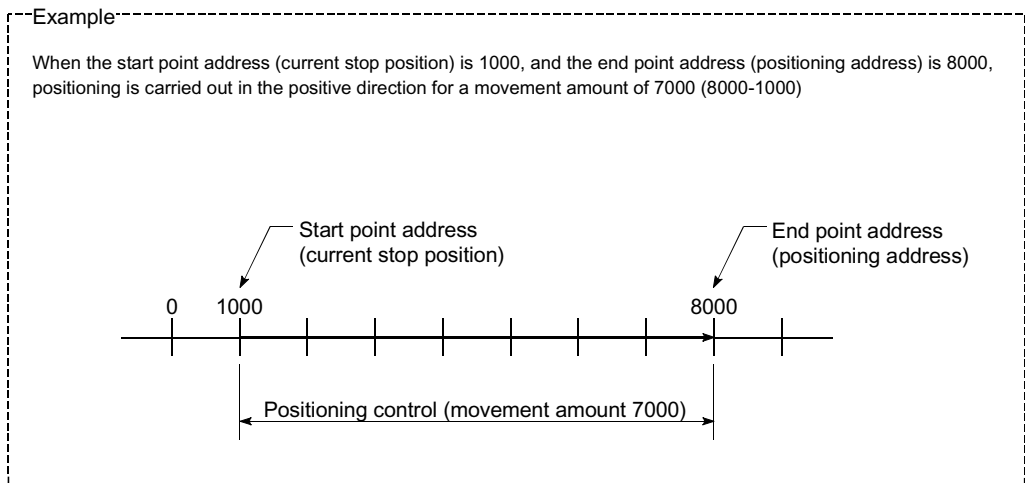

■ Positioning data setting example

The following table shows setting examples when "1-axis linear control (ABS linear 1)" is set in positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	ABS linear 1 Set absolute system 1-axis linear control.
	Da.3	Acceleration time No.	1 Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0 Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	- Setting not required (setting value will be ignored).
	Da.6	Positioning address/movement amount	8000.0σm Set the positioning address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	- Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00mm/min Set the speed during movement to the positioning address.
	Da.9	Dwell time	500ms Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10 Set this when other sub operation commands are issued in combination with the No. 1 positioning data.



\* Refer to Section 5.3 "List of positioning data" for information on the setting details.



[2] 1-axis linear control (INC linear 1)

■ Operation chart

In incremental system 1-axis linear control, addresses established by a machine OPR are used. Positioning is carried out from the current stop position (start point address) to a position at the end of the movement amount set in "Da.6" Positioning address/movement amount". The movement direction is determined by the sign of the movement amount.

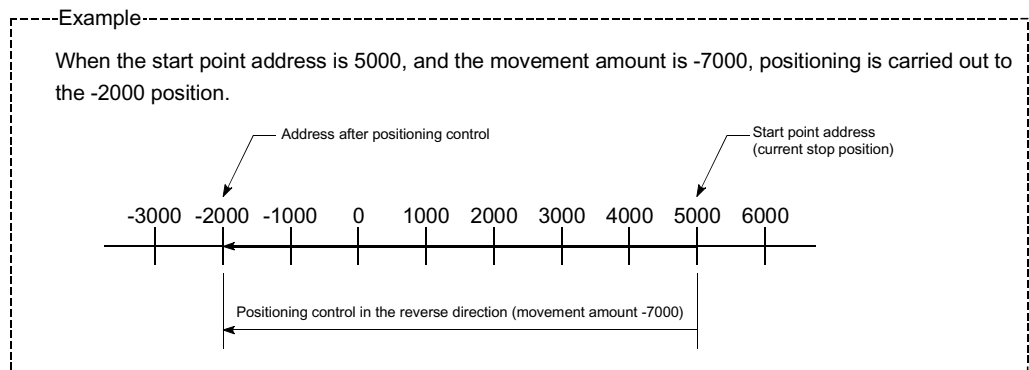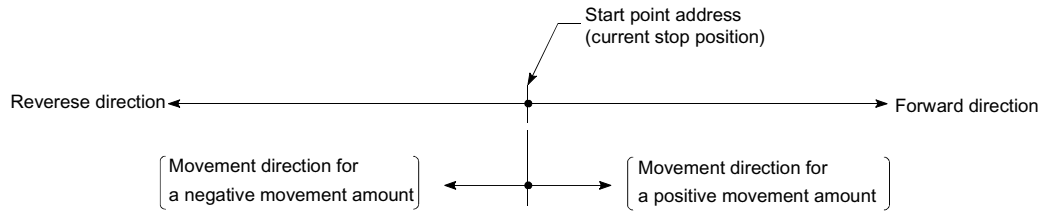

■ Positioning data setting example

The following table shows setting examples when "1-axis linear control (INC linear 1)" is set in positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	INC linear 1 Set incremental system 1-axis linear control.
	Da.3	Acceleration time No.	1 Designate the value set in "Pr.25" Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0 Designate the value set in "Pr.10" Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	- Setting not required (setting value will be ignored).
	Da.6	Positioning address/movement amount	-7000.0σm Set the movement amount. (Assuming "mm" is set in "Pr.1" Unit setting".)
	Da.7	Arc address	- Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00mm/min Set the speed during movement.
	Da.9	Dwell time	500ms Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10 Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.



9.2.3 2-axis linear interpolation control

In "2-axis linear interpolation control" ("Da.2 Control system" = ABS linear 2, INC linear 2), two motors are used to carry out position control in a linear path while carrying out interpolation for the axis directions set in each axis.  
 (Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

[1] 2-axis linear interpolation control (ABS linear 2)

■ Operation chart

In absolute system 2-axis linear control, addresses established by a machine OPR on a 2-axis coordinate plane are used. Linear interpolation positioning is carried out from the current stop position (start point address) to the address (end point address) set in "Da.6 Positioning address/movement amount".

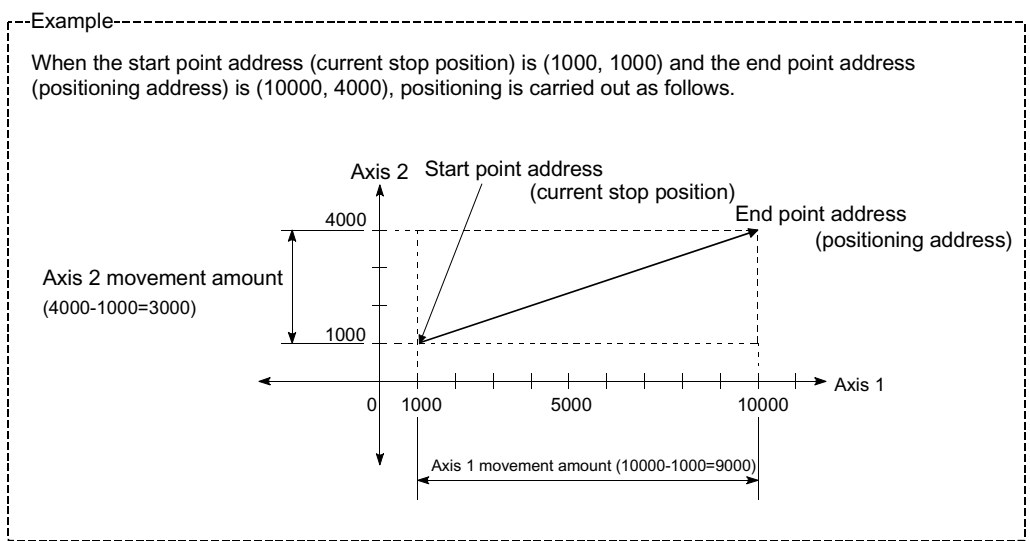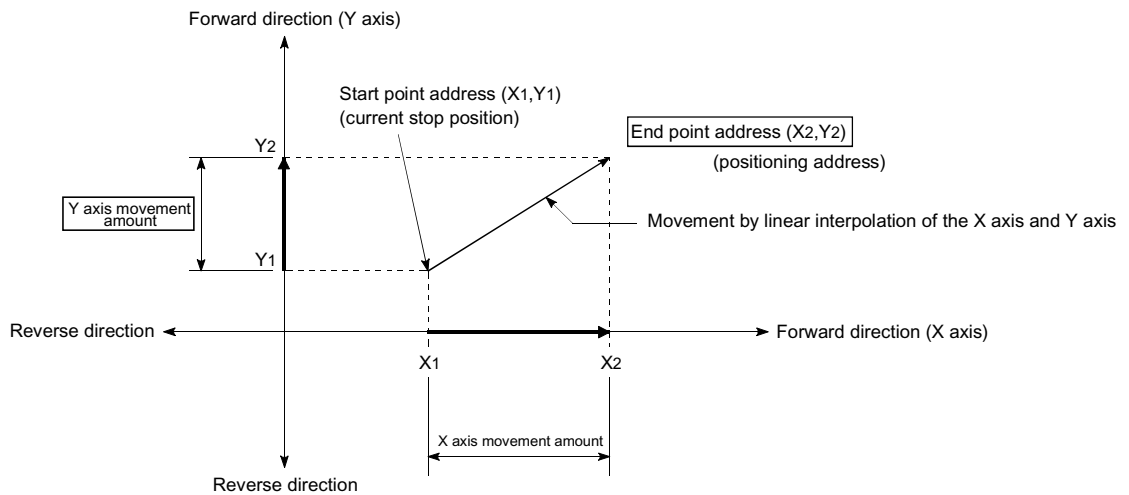

■ Restrictions

An error will occur and the positioning will not start in the following cases. The machine will immediately stop if the error is detected during a positioning control.

⚠ If the movement amount of each axis exceeds "1073741824 (=2<sup>30</sup>)" when "0: Composite speed" is set in " [Pr.20] Interpolation speed designation method" ... The "Outside linear movement amount range error (error code: 504)" occurs at a positioning start.

(The maximum movement amount that can be set in " [Da.6] Positioning address/movement amount" is "1073741824 (=2<sup>30</sup>).")

■ Positioning data setting example

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis linear interpolation control (ABS linear 2)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis		Setting details
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	
Axis 1 Positioning data No. 1	[Da.1] Operation pattern	Positioning complete	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	[Da.2] Control system	ABS linear 2	–	Set absolute system 2-axis linear interpolation control.
	[Da.3] Acceleration time No.	1	–	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	[Da.4] Deceleration time No.	0	–	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	[Da.5] Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	[Da.6] Positioning address/movement amount	10000.0 σm	4000.0 σm	Set the end point address. (Assuming "mm" is set in " [Pr.1] Unit setting".)
	[Da.7] Arc address	–	–	Setting not required (setting value will be ignored).
	[Da.8] Command speed	6000.00 mm/min	–	Set the speed during movement to the end point address.
	[Da.9] Dwell time	500ms	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	[Da.10] M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.


\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINT</b>
⚠ When the "reference axis speed" is set during 2-axis linear interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " [Pr.8] Speed limit value".

[2] 2-axis linear interpolation control (INC linear 2)


■ Operation chart

In incremental system 2-axis linear interpolation control, addresses established by a machine OPR on a 2-axis coordinate plane are used. Linear interpolation positioning is carried out from the current stop position (start point address) to a position at the end of the movement amount set in "Da.6 Positioning address/movement amount". The movement direction is determined by the sign of the movement amount.

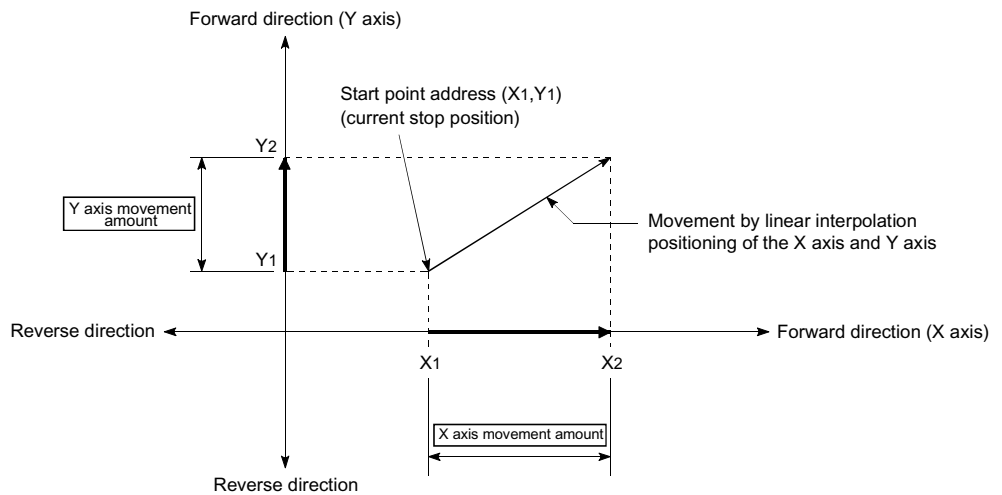

Example

When the axis 1 movement amount is 9000 and the axis 2 movement amount is -3000, positioning is carried out as follows.

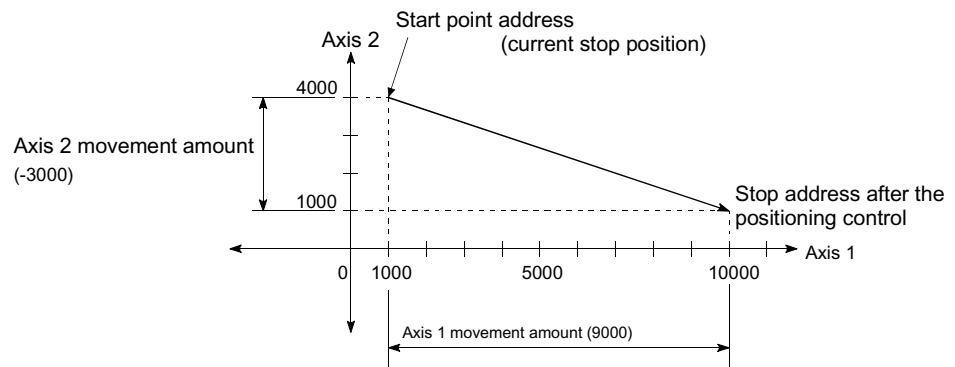

■ Restrictions

An error will occur and the positioning will not start in the following cases. The machine will immediately stop if the error is detected during a positioning operation.

⚠ If the movement amount of each axis exceeds "1073741824 (=2<sup>30</sup>)" when "0: Composite speed" is set in " [Pr.20] Interpolation speed designation method" ... The "Outside linear movement amount range error (error code: 504)" occurs at a positioning start.

(The maximum movement amount that can be set in " [Da.6] Positioning address/movement amount" is "1073741824 (=2<sup>30</sup>).")

■ Positioning data setting example

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis linear interpolation control (INC linear 2)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	[Da.1]	Operation pattern	Positioning complete	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	[Da.2]	Control system	INC linear 2	–	Set incremental system 2-axis linear interpolation control.
	[Da.3]	Acceleration time No.	1	–	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	[Da.4]	Deceleration time No.	0	–	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	[Da.5]	Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	[Da.6]	Positioning address/movement amount	9000.0 σm	-3000.0 σm	Set the movement amount. (Assuming "mm" is set in " [Pr.1] Unit setting".)
	[Da.7]	Arc address	–	–	Setting not required (setting value will be ignored).
	[Da.8]	Command speed	6000.00 mm/min	–	Set the speed during movement.
	[Da.9]	Dwell time	500ms	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	[Da.10]	M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINT</b>
⚠ When the "reference axis speed" is set during 2-axis linear interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " [Pr.8] Speed limit value".


9.2.4 3-axis linear interpolation control

In "3-axis linear interpolation control" (" Da.2 Control system" = ABS linear 3, INC linear 3), three motors are used to carry out position control in a linear path while carrying out interpolation for the axis directions set in each axis.  
 (Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

[1] 3-axis linear interpolation control (ABS linear 3)


■ Operation chart

In the absolute system 3-axis linear control, using an address established by a machine OPR in the 3-axis coordinate space, a linear interpolation positioning is carried out from the current stop position (start point address) to the address (end point address) set in the " Da.6 Positioning address/movement amount".

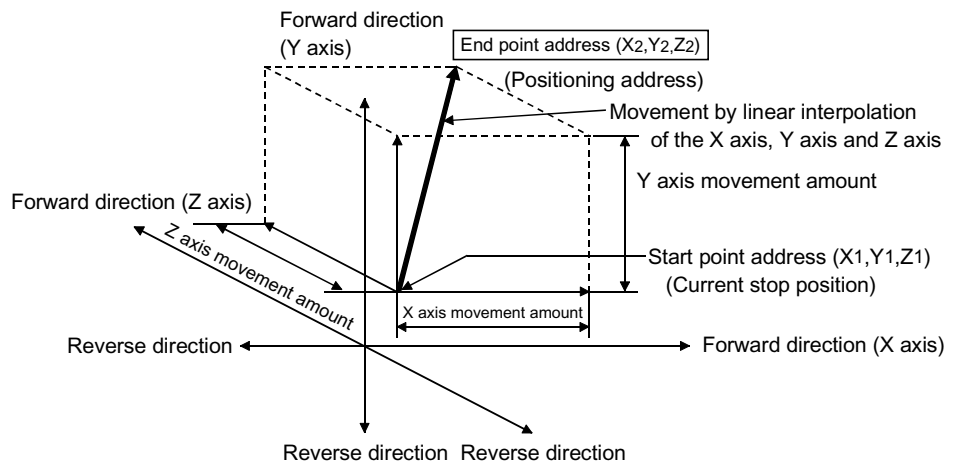

Example

When the start point address (current stop position) is (1000, 2000, 1000) and the end point address (positioning address) is (4000, 8000, 4000), positioning is carried out as follows.

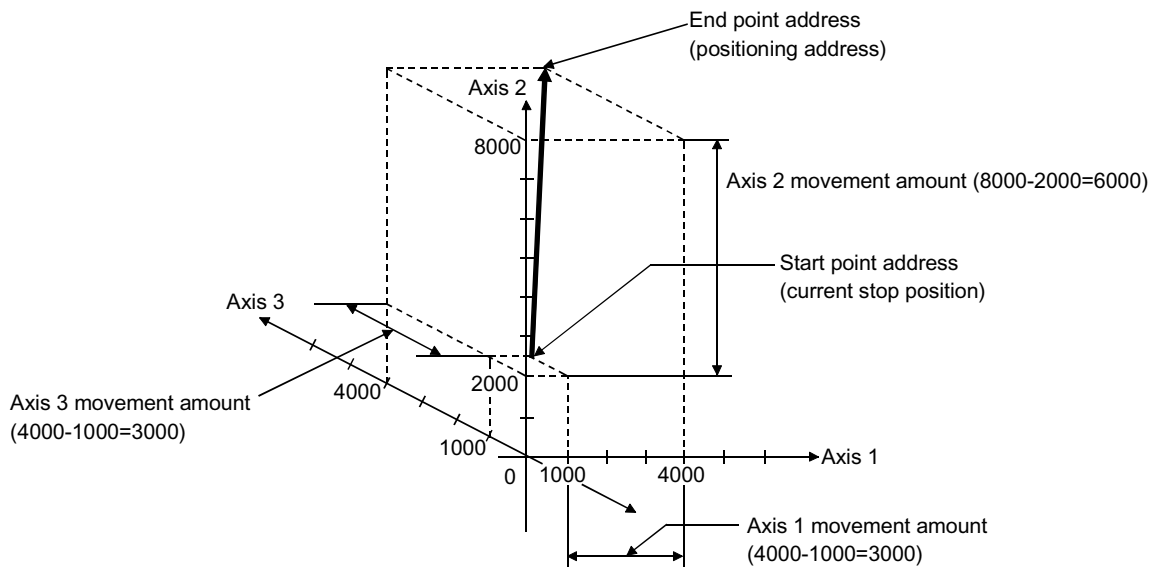

■ Restrictions

An error will occur and the positioning will not start in the following cases. The machine will immediately stop if the error is detected during a positioning control.

⚠ If the movement amount of each axis exceeds "1073741824 (=2<sup>30</sup>)" when "0: Composite speed" is set in " [Pr.20] Interpolation speed designation method" ... The "Outside linear movement amount range error (error code: 504)" occurs at a positioning start.

(The maximum movement amount that can be set in " [Da.6] Positioning address/movement amount" is "1073741824 (=2<sup>30</sup>)".)

■ Positioning data setting example

[Reference axis is designated as axis 1.]

The following table shows setting examples when "3-axis linear interpolation control (ABS linear 3)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2 and axis 3.)

Setting item		Axis			Setting details
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	
Axis 1 Positioning data No. 1	[Da.1] Operation pattern	Positioning complete	-	-	Set "Positioning complete" assuming the next positioning data will not be executed.
	[Da.2] Control system	ABS linear 3	-	-	Set absolute system 3-axis linear interpolation control.
	[Da.3] Acceleration time No.	1	-	-	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	[Da.4] Deceleration time No.	0	-	-	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	[Da.5] Axis to be interpolated	-	-	-	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2 and 3.
	[Da.6] Positioning address/movement amount	4000.0 σm	8000.0 σm	4000.0 σm	Set the end point address. (Assuming "mm" is set in " [Pr.1] Unit setting".)
	[Da.7] Arc address	-	-	-	Setting not required (setting value will be ignored).
	[Da.8] Command speed	6000.00 mm/min	-	-	Set the speed during movement to the end point address.
	[Da.9] Dwell time	500ms	-	-	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	[Da.10] M code	10	-	-	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

**POINTS**


- ⊖ When the "reference axis speed" is set during 3-axis linear interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the "Pr.8 Speed limit value".
- ⊖ Refer to Section 9.1.6 "Interpolation control" for the reference axis and interpolation axis combinations.



[2] 3-axis linear interpolation control (INC linear 3)


■ Operation chart

In the incremental system 3-axis linear interpolation control, using an address established by a machine OPR in the 3-axis coordinate space, a linear interpolation positioning is carried out from the current stop position (start point address) to a position at the end of the movement amount set in the "Da.6 Positioning address/movement amount". The movement direction depends on the sign (+ or -) of the movement amount.

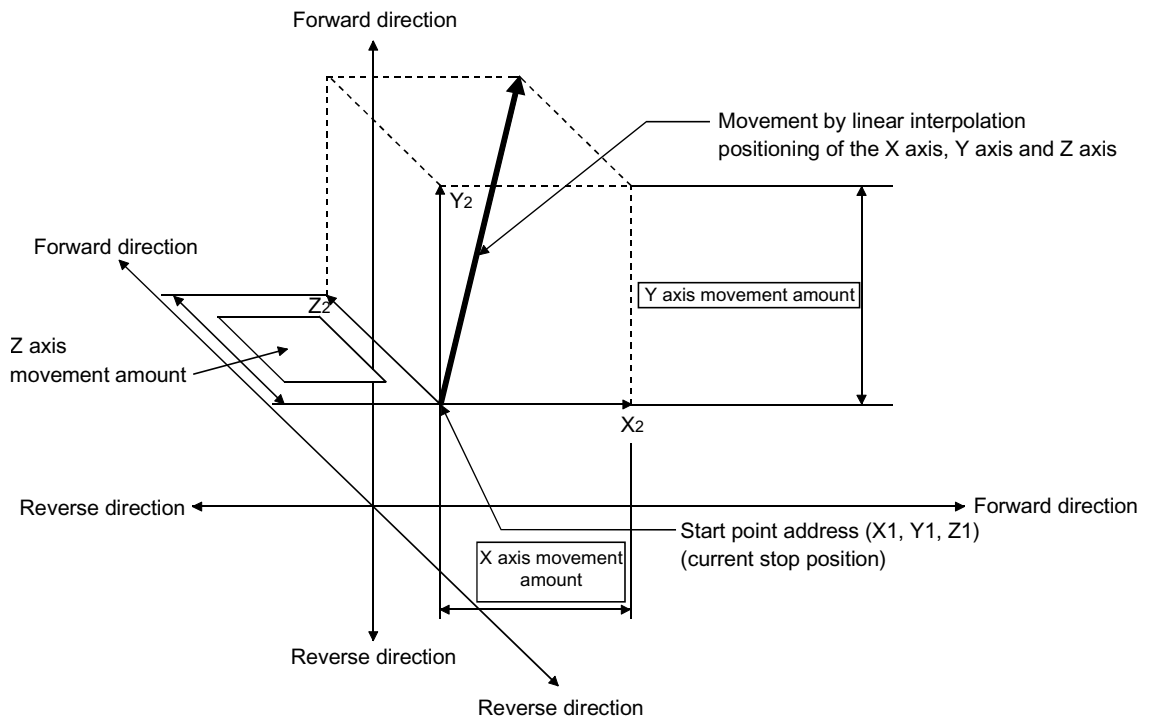

Example

When the axis 1 movement amount is 10000, the axis 2 movement amount is 5000 and the axis 3 movement amount is 6000, positioning is carried out as follows.

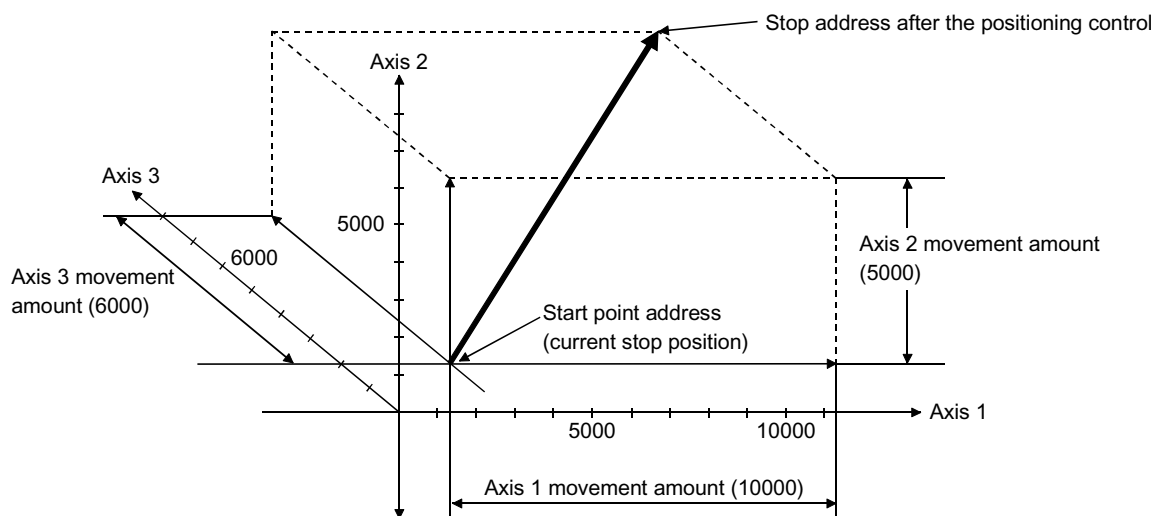

■ Restrictions

An error will occur and the positioning will not start in the following cases. The machine will immediately stop if the error is detected during a positioning operation.

⚠ If the movement amount of each axis exceeds "1073741824 (=2<sup>30</sup>)" when "0: Composite speed" is set in " [Pr.20] Interpolation speed designation method" ... The "Outside linear movement amount range error (error code: 504)" occurs at a positioning start.

(The maximum movement amount that can be set in " [Da.6] Positioning address/movement amount" is "1073741824 (=2<sup>30</sup>)".)

■ Positioning data setting example

[Reference axis is designated as axis 1.]

The following table shows setting examples when "3-axis linear interpolation control (INC linear 3)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2 and axis 3.)

Setting item		Axis			Setting details
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	
Axis 1 Positioning data No. 1	[Da.1] Operation pattern	Positioning complete	-	-	Set "Positioning complete" assuming the next positioning data will not be executed.
	[Da.2] Control system	INC linear 3	-	-	Set incremental system 3-axis linear interpolation control.
	[Da.3] Acceleration time No.	1	-	-	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	[Da.4] Deceleration time No.	0	-	-	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	[Da.5] Axis to be interpolated	-	-	-	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2 and 3.
	[Da.6] Positioning address/movement amount	10000.0 σm	5000.0 σm	6000.0 σm	Set the movement amount. (Assuming "mm" is set in " [Pr.1] Unit setting".)
	[Da.7] Arc address	-	-	-	Setting not required (setting value will be ignored).
	[Da.8] Command speed	6000.00 mm/min	-	-	Set the speed during movement.
	[Da.9] Dwell time	500ms	-	-	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	[Da.10] M code	10	-	-	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

**POINTS**

- € When the "reference axis speed" is set during 3-axis linear interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the "Pr.8 Speed limit value".
- € Refer to Section 9.1.6 "Interpolation control" for the reference axis and interpolation axis combinations.

### 9.2.5 4-axis linear interpolation control

In "4-axis linear interpolation control" ("Da.2 Control system" = ABS linear 4, INC linear 4), four motors are used to carry out position control in a linear path while carrying out interpolation for the axis directions set in each axis.  
(Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

#### [1] 4-axis linear interpolation control (ABS linear 4)

In the absolute system 4-axis linear control, using an address established by a machine OPR in the 4-axis coordinate space, a linear interpolation positioning is carried out from the current stop position (start point address) to the address (end point address) set in the "Da.6 Positioning address/movement amount".

#### ■ Restrictions

An error will occur and the positioning will not start in the following cases. The machine will immediately stop if the error is detected during a positioning control.

⚠ When the movement amount for each axis exceeds "1073741824 (=2<sup>30</sup>)"

An "outside linear movement amount range error (error code: 504)" will occur at the positioning start.

(The maximum movement amount that can be set in "Da.6 Positioning address/movement amount" is "1073741824 (=2<sup>30</sup>).")

■ Positioning data setting example

[Reference axis is designated as axis 1.]

The following table shows setting examples when "4-axis linear interpolation control (ABS linear 4)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2, axis 3 and axis 4.)

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	Axis 4 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	–	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	ABS linear 4	–	–	–	Set absolute system 4-axis linear interpolation control.
	Da.3	Acceleration time No.	1	–	–	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	–	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	–	–	–	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2, 3 and 4.
	Da.6	Positioning address/ movement amount	4000.0 σm	8000.0 σm	4000.0 σm	3000.0 σm	Set the end point address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	–	–	–	–	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	–	–	–	Set the speed during movement to the end point address.
	Da.9	Dwell time	500ms	–	–	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	–	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section "5.3 List of positioning data" for information on the setting details.

**POINTS**

- € When the "reference axis speed" is set during 4-axis linear interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " Pr.8 Speed limit value".
- € Refer to Section 9.1.6 "Interpolation control" for the reference axis and interpolation axis combinations.

## [2] 4-axis linear interpolation control (INC linear 4)

### ■ Operation chart

In the incremental system 4-axis linear interpolation control, using an address established by a machine OPR in the 4-axis coordinate plane, a linear interpolation positioning is carried out from the current stop position (start point address) to a position at the end of the movement amount set in the "Da.6 Positioning address/movement amount". The movement direction depends on the sign (+ or -) of the movement amount.

### ■ Restrictions

An error will occur and the positioning will not start in the following cases. The machine will immediately stop if the error is detected during a positioning operation.

€ When the movement amount for each axis exceeds "1073741824 (=2<sup>30</sup>)"  
An "outside linear movement amount range error (error code: 504)" will occur at the positioning start.

(The maximum movement amount that can be set in "Da.6 Positioning address/movement amount" is "1073741824 (=2<sup>30</sup>)".)

■ Positioning data setting example

[Reference axis is designated as axis 1.]

The following table shows setting examples when "4-axis linear interpolation control (INC linear 4)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2, axis 3 and axis 4.)

Setting item		Axis				Setting details	
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	Axis 4 (interpolation axis) setting example		
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	-	-	-	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	INC linear 4	-	-	-	Set incremental system 4-axis linear interpolation control.
	Da.3	Acceleration time No.	1	-	-	-	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	-	-	-	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	-	-	-	-	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2, 3 and 4.
	Da.6	Positioning address/movement amount	4000.0 σm	8000.0 σm	4000.0 σm	3000.0 σm	Set the movement amount. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	-	-	-	-	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	-	-	-	Set the speed during movement.
	Da.9	Dwell time	500ms	-	-	-	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	-	-	-	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINTS</b>
<p>⚠ When the "reference axis speed" is set during 4-axis linear interpolation control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " Pr.8 Speed limit value".</p> <p>⚠ Refer to Section 9.1.6 "Interpolation control" for the reference axis and interpolation axis combinations.</p>



## 9.2.6 1-axis fixed-feed control


In "1-axis fixed-feed control" ("Da.2 Control system" = fixed-feed 1), one motor is used to carry out fixed-feed control in a set axis direction.

In fixed-feed control, any remainder of the movement amount designated in the positioning data is rounded down if less than that required for control accuracy to output the same amount of pulses. (The remainder of the movement amount with an accuracy below the control accuracy does not affect the regular controls.)

### ■ Operation chart

In 1-axis fixed-feed control, the address (Md.20 Current feed value) of the current stop position (start point address) is set to "0". Positioning is then carried out to a position at the end of the movement amount set in "Da.6 Positioning address/movement amount".

The movement direction is determined by the movement amount sign.

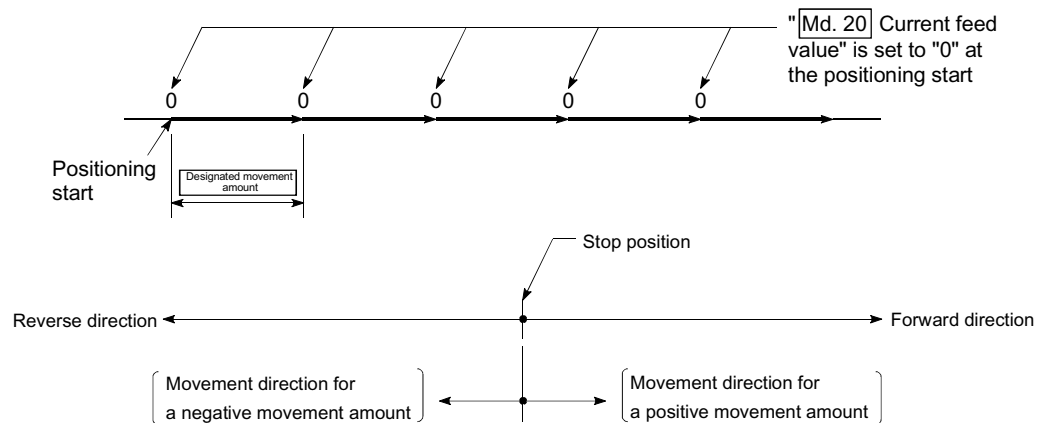

### ■ Restrictions

- (1) An axis error "Continuous path control invalid (error code: 516)" will occur and the operation cannot start if "continuous path control" is set in "Da.1 Operation pattern". ("Continuous path control" cannot be set in fixed-feed control.)
- (2) "Fixed-feed" cannot be set in "Da.2 Control system" in the positioning data when "continuous path control" has been set in "Da.1 Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", fixed-feed control cannot be set in positioning data No. 2.) An axis error "Continuous path control invalid (error code: 516)" will occur and the machine will carry out a deceleration stop if this type of setting is carried out.

■ Positioning data setting example

The following table shows setting examples when "1-axis fixed-feed control (fixed-feed 1)" is set in positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	Fixed-feed 1 Set 1-axis fixed-feed control.
	Da.3	Acceleration time No.	1 Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0 Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	– Setting not required (setting value will be ignored).
	Da.6	Positioning address/movement amount	8000.0σm Set the positioning address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	– Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00mm/min Set the speed during movement to the positioning address.
	Da.9	Dwell time	500ms Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10 Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

## 9.2.7 2-axis fixed-feed control (interpolation)


In "2-axis fixed-feed control" ("Da.2 Control system" = fixed-feed 2), two motors are used to carry out fixed-feed control in a linear path while carrying out interpolation for the axis directions set in each axis.

In fixed-feed control, any remainder of the movement amount designated in the positioning data is rounded down if less than that required for control accuracy to output the same amount of pulses. (The remainder of the movement amount with an accuracy below the control accuracy does not affect the regular controls.)

(Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

#### ■ Operation chart

In incremental system 2-axis fixed-feed control, the addresses ("Md.20 Current feed value") of the current stop position (start addresses) of both axes are set to "0". Linear interpolation positioning is then carried out from that position to a position at the end of the movement amount set in "Da.6 Positioning address/movement amount". The movement direction is determined by the sign of the movement amount.

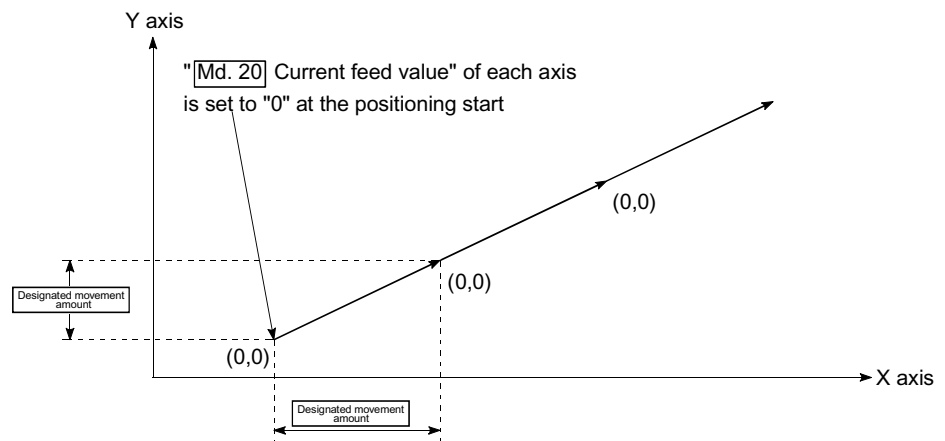

#### ■ Restrictions

- (1) An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous path control" is set in "Da.1 Operation pattern". ("Continuous path control" cannot be set in fixed-feed control.)
- (2) "Fixed-feed" cannot be set in "Da.2 Control system" in the positioning data when "continuous path control" has been set in "Da.1 Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", fixed-feed control cannot be set in positioning data No. 2.) An axis error "Continuous path control not possible (error code: 516)" will occur and the machine will carry out a deceleration stop if this type of setting is carried out.

■ Positioning data setting example

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis fixed-dimension feed control (fixed-feed 2)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis		Setting details	
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example		
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control method	Fixed-feed 2	–	Set 2-axis fixed-feed control.
	Da.3	Acceleration time No.	1	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	Da.6	Positioning address/movement amount	8000.0 σm	6000.0 σm	Set the positioning address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	–	–	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	–	Set the speed during movement. (Designate the composite speed of reference axis speed in " Pr.20 Interpolation speed designation method".)
	Da.9	Dwell time	500ms	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

POINTS
<p>⚠ When the "reference axis speed" is set during 2-axis fixed-feed control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " Pr.8 Speed limit value".</p>


### 9.2.8 3-axis fixed-feed control (interpolation)

In "3-axis fixed-feed control" ("Da.2 Control system" = fixed-feed 3), three motors are used to carry out fixed-feed control in a linear path while carrying out interpolation for the axis directions set in each axis.

In fixed-feed control, any remainder of the movement amount designated in the positioning data is rounded down if less than that required for control accuracy to output the same amount of pulses. (The remainder of the movement amount with an accuracy below the control accuracy does not affect the regular controls.) (Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

■ Operation chart

In incremental system 3-axis fixed-feed control, the addresses ( **[Md.20]** Current feed value) of the current stop position (start addresses) of every axes are set to "0". Linear interpolation positioning is then carried out from that position to a position at the end of the movement amount set in " **[Da.6]** Positioning address/movement amount". The movement direction is determined by the sign of the movement amount.

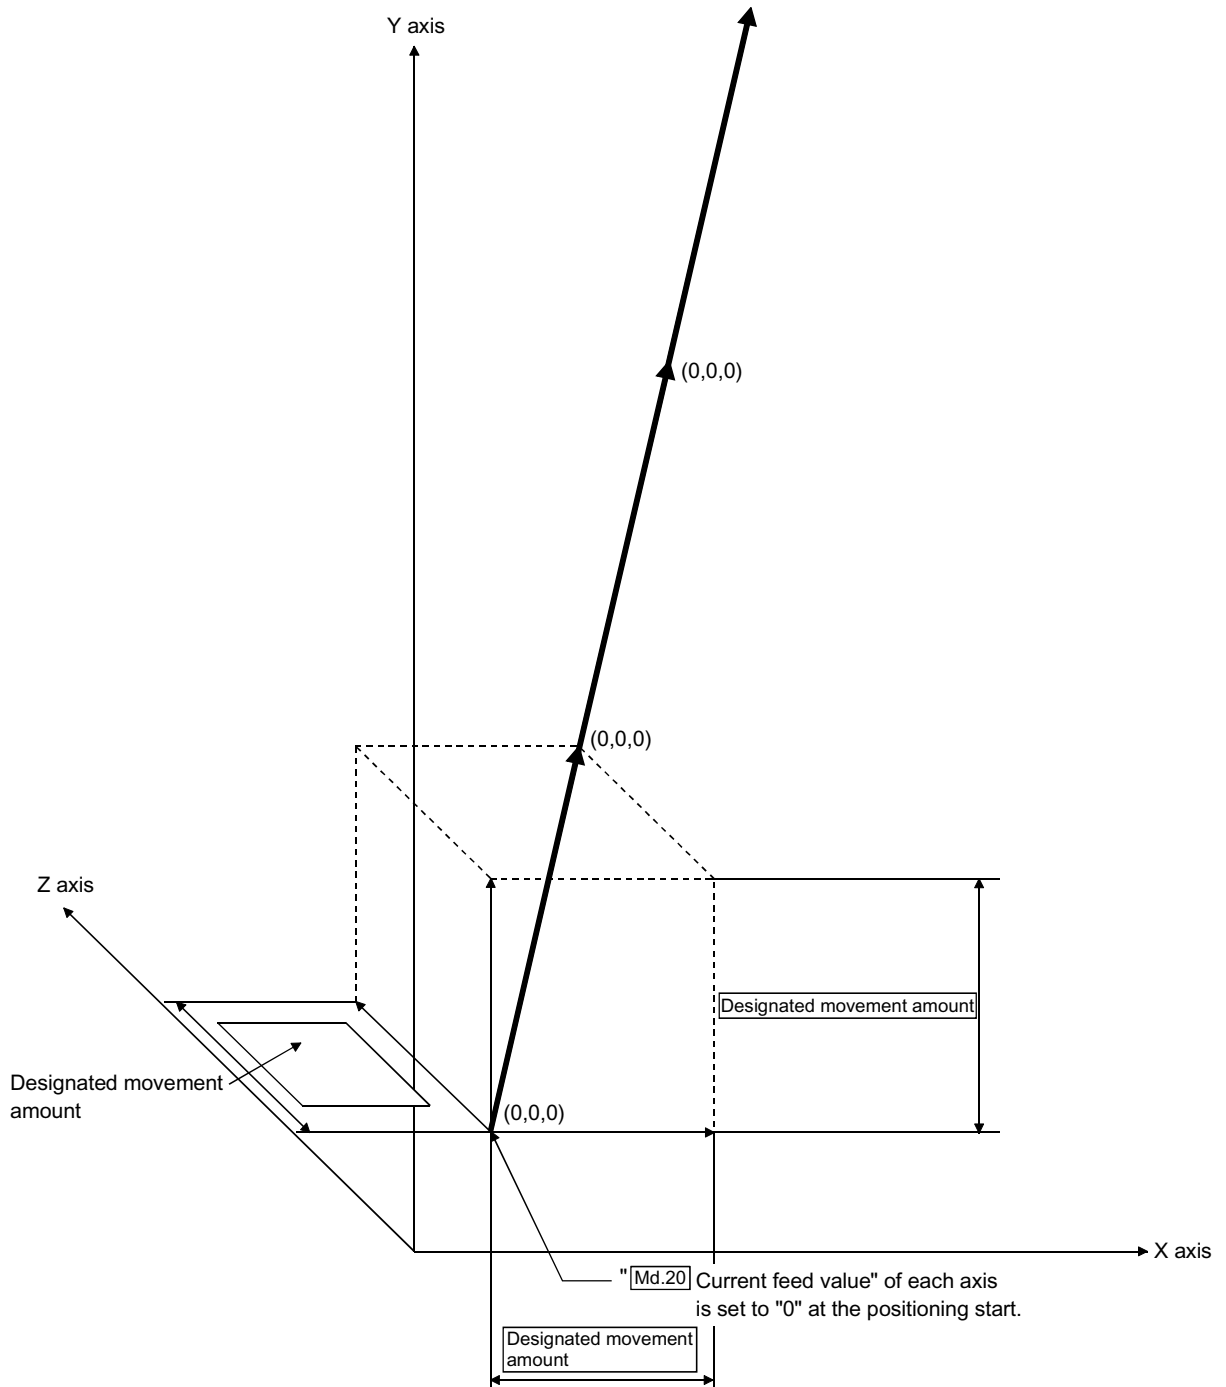

**■ Restrictions**

- (1) An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous path control" is set in " **Da.1** Operation pattern". ("Continuous path control" cannot be set in fixed-feed control.)
- (2) "Fixed-feed" cannot be set in " **Da.2** Control system" in the positioning data when "continuous path control" has been set in " **Da.1** Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", fixed-feed control cannot be set in positioning data No. 2.) An axis error "Continuous path control not possible (error code: 516)" will occur and the machine will carry out a deceleration stop if this type of setting is carried out.

**■ Positioning data setting example**

[Reference axis is designated as axis 1.]

The following table shows setting examples when "3-axis fixed-feed control (fixed-feed 3)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2 and axis 3.)

Setting item		Axis			Setting details	
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example		
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control method	Fixed-feed 3	–	–	Set 3-axis fixed-feed control.
	Da.3	Acceleration time No.	1	–	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	–	–	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2 and 3.
	Da.6	Positioning address/movement amount	10000.0 σm	5000.0 σm	6000.0 σm	Set the positioning address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	–	–	–	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	–	–	Set the speed during movement.
	Da.9	Dwell time	500ms	–	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

POINTS
<p>⊘ When the "reference axis speed" is set during 3-axis fixed-feed control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " Pr.8 Speed limit value".</p> <p>⊘ Refer to Section 9.1.6 "Interpolation control" for the reference axis and interpolation axis combinations.</p>



### 9.2.9 4-axis fixed-feed control (interpolation)

In "4-axis fixed-feed control" (" [Da.2](#) Control system" = fixed-feed 4), four motors are used to carry out fixed-feed control in a linear path while carrying out interpolation for the axis directions set in each axis.

In fixed-feed control, any remainder of the movement amount designated in the positioning data is rounded down if less than that required for control accuracy to output the same amount of pulses. (The remainder of the movement amount with an accuracy below the control accuracy does not affect the regular controls.) (Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

#### ■ Operation chart

In incremental system 4-axis fixed-feed control, the addresses ( [Md.20](#) Current feed value) of the current stop position (start addresses) of every axes are set to "0". Linear interpolation positioning is then carried out from that position to a position at the end of the movement amount set in " [Da.6](#) Positioning address/movement amount". The movement direction is determined by the sign of the movement amount.

#### ■ Restrictions

- (1) An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous path control" is set in " [Da.1](#) Operation pattern". ("Continuous path control" cannot be set in fixed-feed control.)
- (2) "Fixed-feed" cannot be set in " [Da.2](#) Control system" in the positioning data when "continuous path control" has been set in " [Da.1](#) Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", fixed-feed control cannot be set in positioning data No. 2.) An axis error "Continuous path control not possible (error code: 516)" will occur and the machine will carry out a deceleration stop if this type of setting is carried out.

■ Positioning data setting example

[Reference axis is designated as axis 1.]

The following table shows setting examples when "4-axis fixed-feed control (fixed-feed 4)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2, axis 3 and axis 4.)

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	Axis 4 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	–	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control method	Fixed-feed 4	–	–	–	Set 4-axis fixed-feed control.
	Da.3	Acceleration time No.	1	–	–	–	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	–	–	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	–	–	–	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2, 3 and 4.
	Da.6	Positioning address/movement amount	4000.0 $\sigma$ m	8000.0 $\sigma$ m	4000.0 $\sigma$ m	3000.0 $\sigma$ m	Set the positioning address. (Assuming "mm" is set in " [Pr.1] Unit setting".)
	Da.7	Arc address	–	–	–	–	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	–	–	–	Set the speed during movement.
	Da.9	Dwell time	500ms	–	–	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	–	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

POINTS
<p>⚠ When the "reference axis speed" is set during 4-axis fixed-feed control, set so the major axis side becomes the reference axis. If the minor axis side is set as the reference axis, the major axis side speed may exceed the " [Pr.8] Speed limit value".</p> <p>⚠ Refer to Section 9.1.6 "Interpolation control" for the reference axis and interpolation axis combinations.</p>

9.2.10 2-axis circular interpolation control with sub point designation

In "2-axis circular interpolation control" (" Da.2 Control system" = ABS circular sub, INC circular sub), two motors are used to carry out position control in an arc path passing through designated sub points, while carrying out interpolation for the axis directions set in each axis.


(Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

[1] 2-axis circular interpolation control with sub point designation (ABS circular sub)

■ Operation chart

In the absolute system, 2-axis circular interpolation control with sub point designation, addresses established by a machine OPR on a 2-axis coordinate plane are used. Positioning is carried out from the current stop position (start point address) to the address (end point address) set in " Da.6 Positioning address/movement amount", in an arc path that passes through the sub point address set in " Da.7 Arc address".

The resulting control path is an arc having as its center the intersection point of perpendicular bisectors of a straight line between the start point address (current stop position) and sub point address (arc address), and a straight line between the sub point address (arc address) and end point address (positioning address).

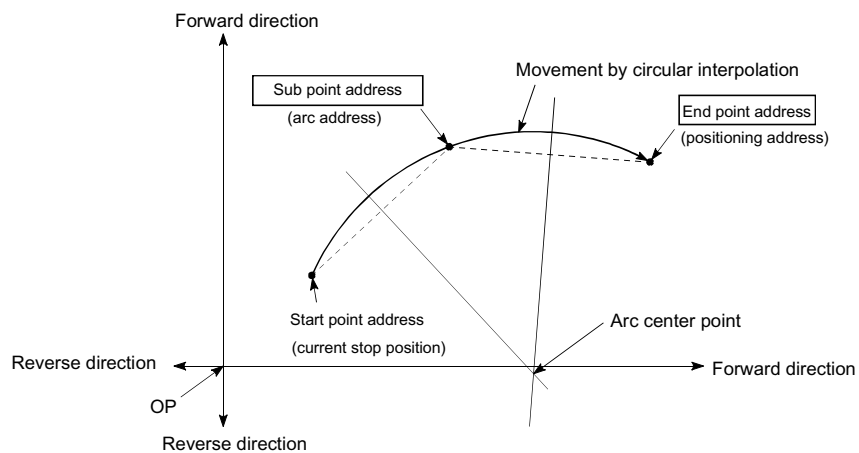

**■ Restrictions**

- (1) 2-axis circular interpolation control cannot be set in the following cases.
  - ⊖ When "degree" is set in " Pr.1 Unit setting"
  - ⊖ When the units set in " Pr.1 Unit setting" are different for the reference axis and interpolation axis. ("mm" and "inch" combinations are possible.)
  - ⊖ When "reference axis speed" is set in " Pr.20 Interpolation speed designation method"
- (2) An error will occur and the positioning start will not be possible in the following cases. The machine will immediately stop if the error is detected during positioning control.
  - ⊖ When the radius exceeds "536870912 ( $=2^{29}$ )". (The maximum radius for which circular interpolation control is possible is "536870912 ( $=2^{29}$ )"
    - ... An error "Outside radius range (error code: 544)" will occur at positioning start.
  - ⊖ When the center point address is outside the range of " $-2147483648 (-2^{31})$  to  $2147483647 (2^{31}-1)$ "
    - ... A "Sub point setting error" (error code: 525) will occur at positioning start.
  - ⊖ When the start point address is the same as the end point address
    - ... An "End point setting error" (error code: 526) will occur.
  - ⊖ When the start point address is the same as the sub point address
    - ... A "Sub point setting error" (error code: 525) will occur.
  - ⊖ When the end point address is the same as the sub point address
    - ... A "Sub point setting error" (error code: 525) will occur.
  - ⊖ When the start point address, sub point address, and end point address are in a straight line
    - ... A "Sub point setting error" (error code: 525) will occur.

■ Positioning data setting example

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis circular interpolation control with sub point designation (ABS circular sub)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	—	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	ABS circular sub	—	Set absolute system, 2-axis circular interpolation control with sub point designation.
	Da.3	Acceleration time No.	1	—	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	—	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	2	—	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	Da.6	Positioning address/movement amount	8000.0 σm	6000.0 σm	Set the positioning address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	4000.0 σm	3000.0 σm	Set the sub point address. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.8	Command speed	6000.00 mm/min	—	Set the speed when moving to the end point address. (Designate the composite speed in " Pr.20 Interpolation speed designation method".)
	Da.9	Dwell time	500ms	—	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	—	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINT</b>
Set a value in " Da.8 Command speed" so that the speed of each axis does not exceed the " Pr.8 Speed limit value". (The speed limit does not function for the speed calculated by the QD75 during interpolation control.)


[2] 2-axis circular interpolation control with sub point designation (INC circular sub)

■ Operation chart

In the incremental system, 2-axis circular interpolation control with sub point designation, positioning is carried out from the current stop position (start point address) to a position at the end of the movement amount set in "Da.6

Positioning address/movement amount" in an arc path that passes through the sub point address set in "Da.7 Arc address". The movement direction depends on the sign (+ or -) of the movement amount.

The resulting control path is an arc having as its center the intersection point of perpendicular bisectors of the straight line between the start point address (current stop position) and sub point address (arc address) calculated from the movement amount to the sub point, and a straight line between the sub point address (arc address) and end point address (positioning address) calculated from the movement amount to the end point.

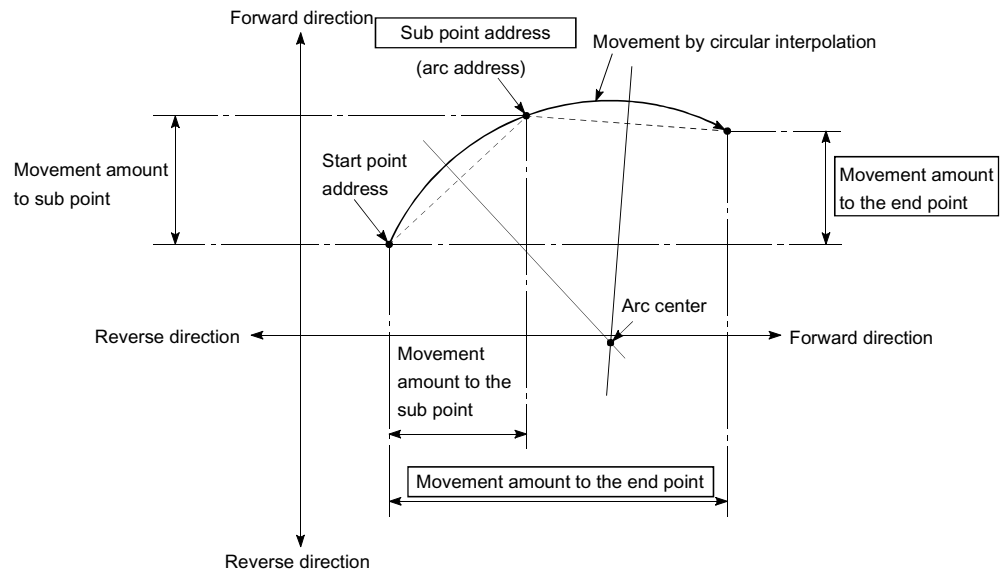

**■ Restrictions**

- (1) 2-axis circular interpolation control cannot be set in the following cases.
  - € When "degree" is set in " **Pr.1** Unit setting"
  - € When the units set in " **Pr.1** Unit setting" are different for the reference axis and interpolation axis. ("mm" and "inch" combinations are possible.)
  - € When "reference axis speed" is set in " **Pr.20** Interpolation speed designation method"
- (2) An error will occur and the positioning start will not be possible in the following cases. The machine will immediately stop if the error is detected during positioning control.
  - € When the radius exceeds "536870912 ( $=2^{29}$ )". (The maximum radius for which circular interpolation control is possible is "536870912 ( $=2^{29}$ )"
    - ... An error "Outside radius range (error code: 544)" will occur at positioning start.
  - € When the center point address is outside the range of " $-2147483648 (-2^{31})$  to  $2147483647 (2^{31}-1)$ "
    - ... A "Sub point setting error" (error code: 525) will occur at positioning start.
  - € When the start point address is the same as the end point address
    - ... An "End point setting error" (error code: 526) will occur.
  - € When the start point address is the same as the sub point address
    - ... A "Sub point setting error" (error code: 525) will occur.
  - € When the end point address is the same as the sub point address
    - ... A "Sub point setting error" (error code: 525) will occur.
  - € When the start point address, sub point address, and end point address are in a straight line
    - ... A "Sub point setting error" (error code: 525) will occur.

■ Positioning data setting example

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis circular interpolation control with sub point designation (INC circular sub)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	INC circular sub	–	Set incremental system, 2-axis circular interpolation control with sub point designation.
	Da.3	Acceleration time No.	1	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	Da.6	Positioning address/movement amount	8000.0 σm	6000.0 σm	Set the movement amount. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.7	Arc address	4000.0 σm	3000.0 σm	Set the sub point address. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.8	Command speed	6000.00 mm/min	–	Set the speed during movement. (Designate the composite speed in " Pr.20 Interpolation speed designation method".)
	Da.9	Dwell time	500ms	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINT</b>
Set a value in " Da.8 Command speed" so that the speed of each axis does not exceed the " Pr.8 Speed limit value". (The speed limit does not function for the speed calculated by the QD75 during interpolation control.)



9.2.11 2-axis circular interpolation control with center point designation

In "2-axis circular interpolation control" ("Da.2 Control system" = ABS circular right, INC circular right, ABS circular left, INC circular left), two motors are used to carry out position control in an arc path having a designated center point, while carrying out interpolation for the axis directions set in each axis.  
 (Refer to Section 9.1.6 "Interpolation control" for details on interpolation control.)

The following table shows the rotation directions, arc center angles that can be controlled, and positioning paths for the different control systems.

Control system	Rotation direction	Arc center angle that can be controlled	Positioning path
ABS circular right	Clockwise	$0^\circ < \chi \leq 360^\circ$	
INC circular right			
ABS circular left	Counterclockwise		
INC circular left			


### ■ Circular interpolation error compensation

In circular interpolation control with center point designation, the arc path calculated from the start point address and arc address may deviate from the position of the end point address set in "Da.6 Positioning address/movement amount".

(Refer to "Pr.41 Allowable circular interpolation error width".)

#### (1) Calculated error < "Pr.41 Allowable circular interpolation error width"

Circular interpolation control to the set end point address is carried out while the error compensation is carried out. (This is called "spiral interpolation".)

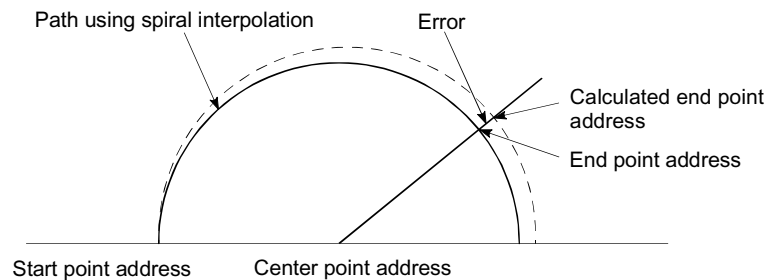

In circular interpolation control with center point designation, an angular velocity is calculated on the assumption that operation is carried out at a command speed on the arc using the radius calculated from the start point address and center point address, and the radius is compensated in proportion to the angular velocity deviated from that at the start point.

Thus, when there is a difference (error) between a radius calculated from the start point address and center point address (start point radius) and a radius calculated from the end point address and center point address (end point radius), the composite speed differs from the command speed as follows.

- \* Start point radius > End point radius: As compared with the speed without error, the speed becomes slower as end point address is reached.
- \* Start point radius < End point radius: As compared with the speed without error, the speed becomes faster as end point address is reached.


#### (2) Calculated error > "Pr.41 Allowable circular interpolation error width"

At the positioning start, an error "Outside circular interpolation error allowable limit" (error code: 506) will occur and the control will not start. The machine will immediately stop if the error is detected during positioning control.


[1] 2-axis circular interpolation control with center point designation  
(ABS circular right, ABS circular left)

■ Operation chart

In the absolute system, 2-axis circular interpolation control with center point designation, addresses established by a machine OPR on a 2-axis coordinate plane are used. Positioning is carried out from the current stop position (start point address) to the address (end point address) set in "Da.6 Positioning address/movement amount", in an arc path having as its center the address (arc address) of the center point set in "Da.7 Arc address".

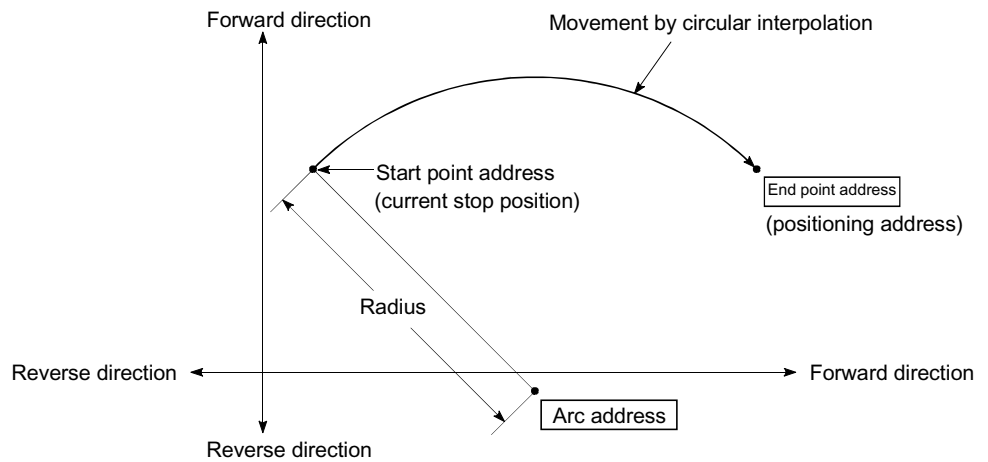

Positioning of a complete round with a radius from the start point address to the arc center point can be carried out by setting the end point address (positioning address) to the same address as the start point address.

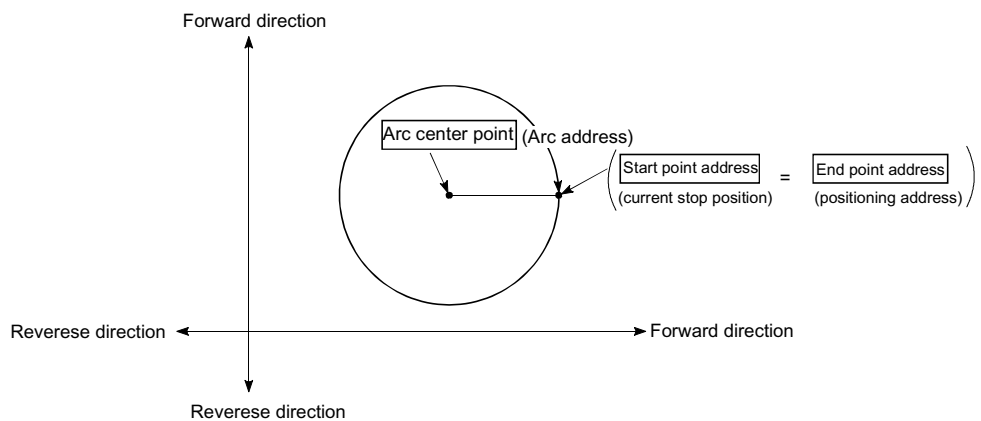

In circular interpolation control with center point designation, an angular velocity is calculated on the assumption that operation is carried out at a command speed on the arc using the radius calculated from the start point address and center point address, and the radius is compensated in proportion to the angular velocity deviated from that at the start point.

Thus, when there is a difference (error) between a radius calculated from the start point address and center point address (start point radius) and a radius calculated from the end point address and center point address (end point radius), the composite speed differs from the command speed as follows.

- \* Start point radius > End point radius: As compared with the speed without error, the speed becomes slower as end point address is reached.
- \* Start point radius < End point radius: As compared with the speed without error, the speed becomes faster as end point address is reached.

### ■ Restrictions

(1) 2-axis circular interpolation control cannot be set in the following cases.

- ∄ When "degree" is set in " Pr.1 Unit setting"
- ∄ When the units set in " Pr.1 Unit setting" are different for the reference axis and interpolation axis. ("mm" and "inch" combinations are possible.)
- ∄ When "reference axis speed" is set in " Pr.20 Interpolation speed designation method"

(2) An error will occur and the positioning start will not be possible in the following cases. The machine will immediately stop if the error is detected during positioning control.

- ∄ When the radius exceeds "536870912 (=2<sup>29</sup>)". (The maximum radius for which circular interpolation control is possible is "536870912 (=2<sup>29</sup>)"  
... An error "Outside radius range" (error code: 544)" will occur at positioning start.
- ∄ When the end point address is outside the range of -2<sup>31</sup> to 2<sup>31</sup>-1  
... An "End point setting error" (error code: 526)
- ∄ When the start point address is the same as the center point address  
... A "Center point setting error" (error code: 527) will occur.
- ∄ When the end point address is the same as the center point address  
... A "Center point setting error" (error code: 527) will occur.
- ∄ When the center point address is outside the range of -2<sup>31</sup> to 2<sup>31</sup>-1  
... A "Center point setting error" (error code: 527) will occur.

■ Positioning data setting examples

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis circular interpolation control with center point designation (ABS right arc, ABS left arc)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	ABS circular right ABS circular left	–	Set absolute system, 2-axis circular interpolation control with center point designation. (Select clockwise or counterclockwise according to the control.)
	Da.3	Acceleration time No.	1	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	Da.6	Positioning address/movement amount	8000.0 σm	6000.0 σm	Set the positioning address. (Assuming "mm" is set in " Pr.1 Unit setting".)
	Da.7	Arc address	4000.0 σm	3000.0 σm	Set the arc address. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.8	Command speed	6000.00 mm/min	–	Set the speed when moving to the end point address. (Designate the composite speed in " Pr.20 Interpolation speed designation method".)
	Da.9	Dwell time	500ms	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.


\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINT</b>
Set a value in " Da.8 Command speed" so that the speed of each axis does not exceed the " Pr.8 Speed limit value". (The speed limit does not function for the speed calculated by the QD75 during interpolation control.)


[2] 2-axis circular interpolation control with center point designation  
(INC circular right, INC circular left)

■ Operation chart

In the incremental system, 2-axis circular interpolation control with center point designation, addresses established by a machine OPR on a 2-axis coordinate plane are used. Positioning is carried out from the current stop position (start point address) to a position at the end of the movement amount set in "Da.6" Positioning address/movement amount", in an arc path having as its center the address (arc address) of the center point set in "Da.7" Arc address".

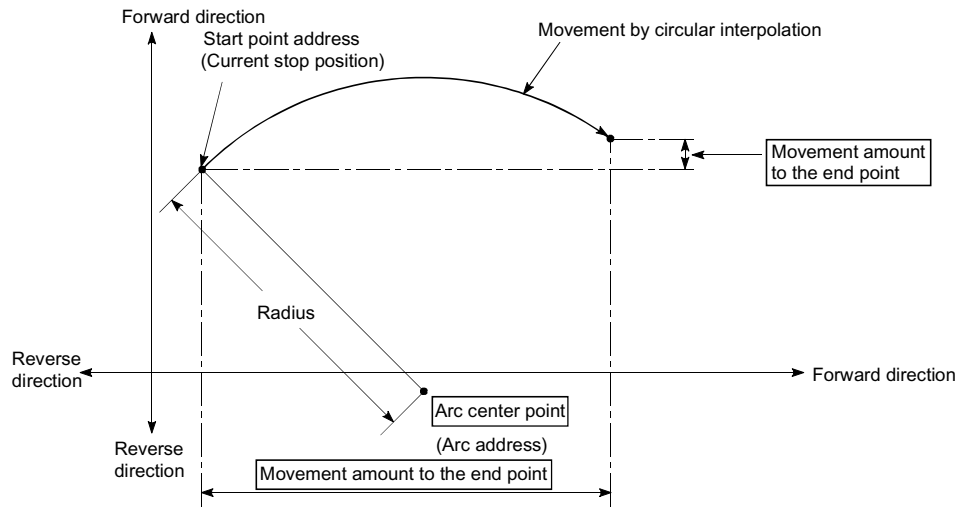

Positioning of a complete round with a radius of the distance from the start point address to the arc center point can be carried out by setting the movement amount to "0".

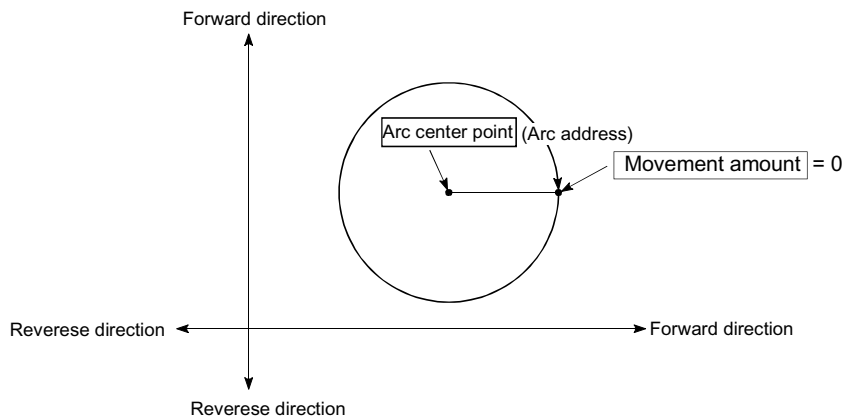

In circular interpolation control with center point designation, an angular velocity is calculated on the assumption that operation is carried out at a command speed on the arc using the radius calculated from the start point address and center point address, and the radius is compensated in proportion to the angular velocity deviated from that at the start point.

Thus, when there is a difference (error) between a radius calculated from the start point address and center point address (start point radius) and a radius calculated from the end point address and center point address (end point radius), the composite speed differs from the command speed as follows.

- \* Start point radius > End point radius: As compared with the speed without error, the speed becomes slower as end point address is reached.
- \* Start point radius < End point radius: As compared with the speed without error, the speed becomes faster as end point address is reached.

#### ■ Restrictions

- (1) 2-axis circular interpolation control cannot be set in the following cases.
  - ⊖ When "degree" is set in " Pr.1 Unit setting"
  - ⊖ When the units set in " Pr.1 Unit setting" are different for the reference axis and interpolation axis. ("mm" and "inch" combinations are possible.)
  - ⊖ When "reference axis speed" is set in " Pr.20 Interpolation speed designation method"
- (2) An error will occur and the positioning start will not be possible in the following cases. The machine will immediately stop if the error is detected during positioning control.
  - ⊖ When the radius exceeds "536870912 (=2<sup>29</sup>)". (The maximum radius for which circular interpolation control is possible is "536870912 (=2<sup>29</sup>)"  
... An "Outside radius range error (error code: 544)" will occur at positioning start.
  - ⊖ When the start point address is the same as the center point address  
... A "Center point setting error" (error code: 527) will occur.
  - ⊖ When the end point address is the same as the center point address  
... A "Center point setting error" (error code: 527) will occur.
  - ⊖ When the center point address is outside the range of -2<sup>31</sup> to 2<sup>31</sup>-1  
... A "Center point setting error" (error code: 527) will occur.

■ Positioning data setting examples

[Reference axis and interpolation axis are designated as axis 1 and axis 2, respectively.]

The following table shows setting examples when "2-axis circular interpolation control with center point designation (INC circular right, INC circular left)" is set in positioning data No. 1 of axis 1. (The required values are also set in positioning data No. 1 of axis 2.)

Setting item		Axis		Setting details	
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example		
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	Set "Positioning complete" assuming the next positioning data will not be executed.
	Da.2	Control system	INC circular right INC circular left	–	Set incremental system, 2-axis circular interpolation control with center point designation. (Select clockwise or counterclockwise according to the control.)
	Da.3	Acceleration time No.	1	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	Da.6	Positioning address/movement amount	8000.0 σm	6000.0 σm	Set the movement amount. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.7	Arc address	4000.0 σm	3000.0 σm	Set the center point address. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.8	Command speed	6000.00 mm/min	–	Set the speed when moving to the end point address. (Designate the composite speed in " Pr.20 Interpolation speed designation method".)
	Da.9	Dwell time	500ms	–	Set the time the machine dwells after the positioning stop (pulse output stop) to the output of the positioning complete signal.
	Da.10	M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

<b>POINT</b>
Set a value in " Da.8 Command speed" so that the speed of each axis does not exceed the " Pr.8 Speed limit value". (The speed limit does not function for the speed calculated by the QD75 during interpolation control.)



9.2.12 1-axis speed control

In "1-axis speed control" (" Da.2 Control system" = Forward run: speed 1, Reverse run: speed 1), control is carried out in the axis direction in which the positioning data has been set by continuously outputting pulses for the speed set in " Da.8 Command speed" until the input of a stop command.

The two types of 1-axis speed control are "Forward run: speed 1" in which the control starts in the forward run direction, and "Reverse run: speed 1" in which control starts in the reverse run direction.

■ Operation chart

The following chart shows the operation timing for 1-axis speed control with axis 1 as the reference axis.

The "in speed control" flag ( Md.31 Status: b0) is turned ON during speed control.

The "Positioning complete signal" is not turned ON.


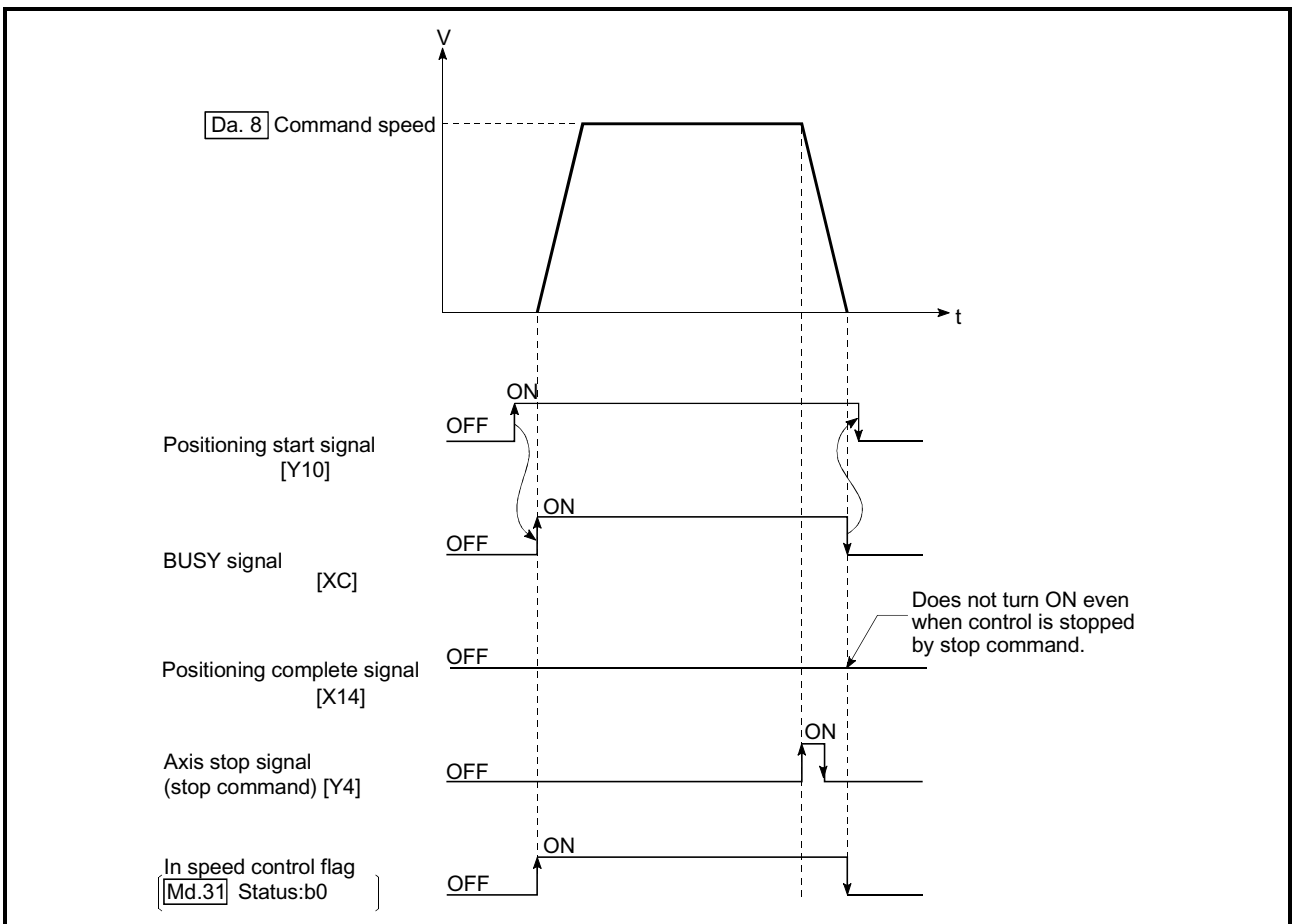


Fig.9.9 1-axis speed control operation timing

■ Current feed value during 1-axis speed control

The following table shows the "Md.20 Current feed value" during 1-axis speed control corresponding to the "Pr.21 Current feed value during speed control" settings.

Pr.21 Current feed value during speed control" setting	Md.20 Current feed value
0: Do not update current feed value	The current feed value at speed control start is maintained.
1: Update current feed value	The current feed value is updated.
2: Zero clear current feed value	The current feed value is fixed at 0.

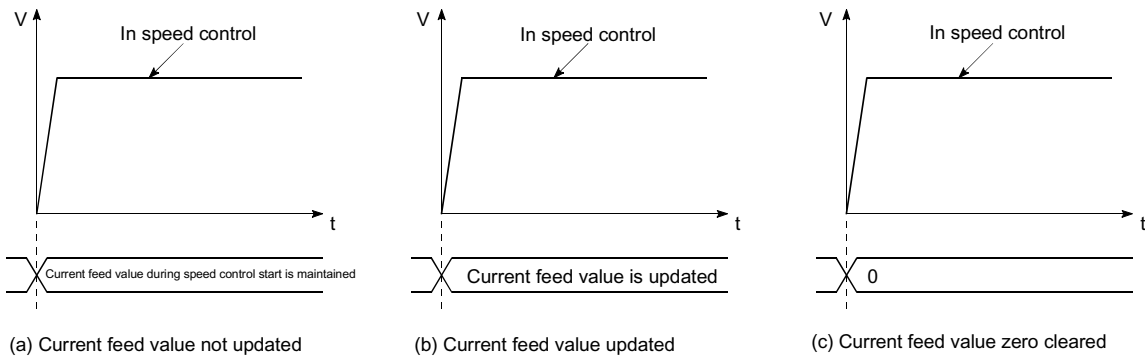

■ Restrictions

- (1) Set "Positioning complete" in "Da.1 Operation pattern". An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set in "Da.1 Operation pattern". ("Continuous positioning control" and "continuous path control" cannot be set in speed control.)
- (2) Set the WITH mode in "Pr.18 M code ON signal output timing" when using an M code. The M code will not be output, and the M code ON signal will not turn ON if the AFTER mode is set.
- (3) An error "No command speed (error code: 503)" will occur if the current speed (-1) is set in "Da.8 command speed".
- (4) The software stroke limit check will not be carried out if the control unit is set to "degree".

■ Positioning data setting examples

The following table shows the setting examples when "1-axis speed control (forward run: speed 1)" is set in the positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete Setting other than "Positioning complete" is not possible in speed control.
	Da.2	Control system	Forward run speed 1 Set 1-axis speed control.
	Da.3	Acceleration time No.	1 Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0 Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	– Setting not required (setting value will be ignored).
	Da.6	Positioning address/movement amount	– Setting not required (setting value will be ignored).
	Da.7	Arc address	– Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00mm/min Set the speed to be commanded.
	Da.9	Dwell time	– Setting not required (setting value will be ignored).
	Da.10	M code	10 Set this when other sub operation commands are issued in combination with the No. 1 positioning data. (" Pr.18 M code ON signal output timing" setting only possible in the WITH mode.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

9.2.13 2-axis speed control

In "2-axis speed control" ("Da.2 Control system" = Forward run: speed 2, Reverse run: speed 2), control is carried out in the 2-axis direction in which the positioning data has been set by continuously outputting pulses for the speed set in "Da.8 Command speed" until the input of a stop command.

The two types of 2-axis speed control are "Forward run: speed 2" in which the control starts in the forward run direction, and "Reverse run: speed 2" in which control starts in the reverse run direction.

(Refer to Section 9.1.6 "Interpolation control" for the combination of the reference axis with the interpolation axis.)

■ Operation chart

The following chart shows the operation timing for 2-axis (axes 1 and 2) speed control with axis 1 as the reference axis. The "in speed control" flag (Md.31 Status: b0) is turned ON during speed control.

The "positioning complete signal" is not turned ON.


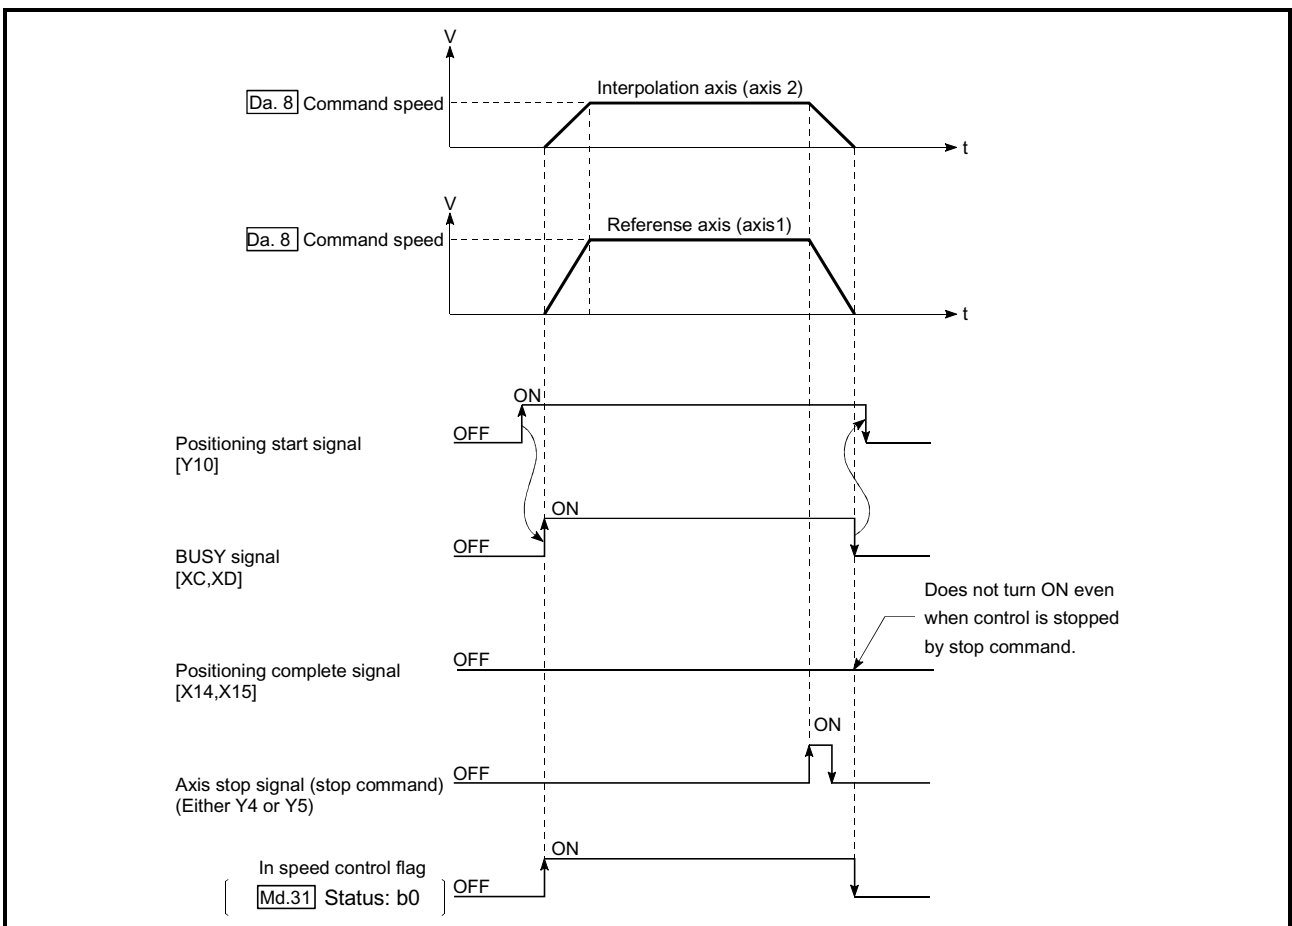


Fig. 9.10 2-axis speed control operation timing

■ Current feed value during 2-axis speed control

The following table shows the " [Md.20] Current feed value" during 2-axis speed control corresponding to the " [Pr.21] Current feed value during speed control" settings. (Note that the reference axis setting values are used for parameters.)

" [Pr.21] Current feed value during speed control" setting	[Md.20] Current feed value
0: Do not update current feed value	The current feed value at speed control start is maintained.
1: Update current feed value	The current feed value is updated.
2: Zero clear current feed value	The current feed value is fixed at 0.

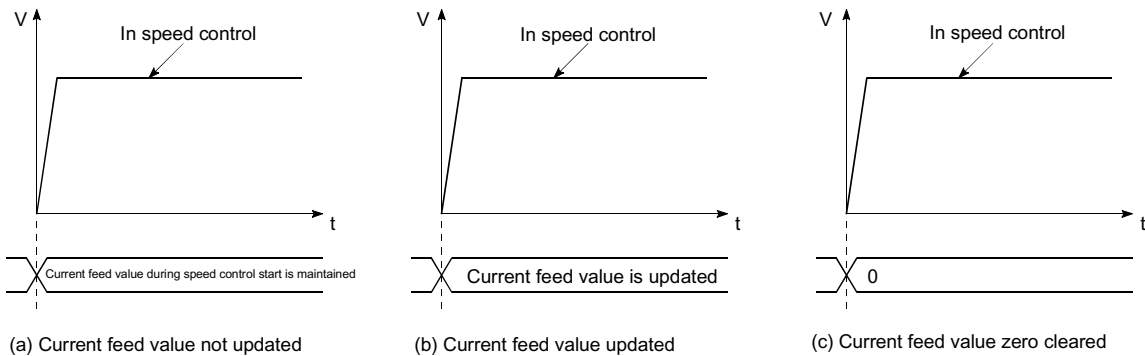

■ Restrictions

- Set "Positioning complete" in " [Da.1] Operation pattern". An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set. ("Continuous positioning control" and "continuous path control" cannot be set in speed control.)
- Set the WITH mode in " [Pr.18] M code ON signal output timing" when using an M code. The M code will not be output, and the M code ON signal will not turn ON if the AFTER mode is set.
- Set the "reference axis speed" in " [Pr.20] Interpolation speed designation method". An "Interpolation mode error (error code: 523)" will occur and the operation cannot start if a composite speed is set.
- When either of two axes exceeds the speed limit, that axis is controlled with the speed limit value. The speeds of the other axes are limited at the ratios of " [Da.8] Command speed".

(Examples)

Setting item		Axis	
		Axis 1 setting	Axis 2 setting
[Pr.8]	Speed limit value	4000.00mm/min	5000.00mm/min
[Da.8]	Command speed	8000.00mm/min	6000.00mm/min

With the settings shown above, the operation speed in speed control is as follows.

Axis 1: 4000.00 mm/min (Speed is limited by [Pr.8] ).

Axis 2: 3000.00 mm/min (Speed is limited at a ratio of an axis 1 command speed to an axis 2 command speed).

- (5) An error "No command speed (error code: 503)" occurs if a current speed (-1) is set in "Da.8] Command speed".
- (6) The software stroke limit check is not carried out when the control unit is set to "degree".

■ Positioning data setting examples

[Setting examples when the reference axis and interpolation axis are designated as axes 1 and 2, respectively.]

The following table shows the setting examples when "2-axis speed control (forward run: speed 2)" is set in the positioning data No. 1 of axis 1 (reference axis).

Setting item		Axis		Setting details
		Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	
Axis 1 Positioning data No. 1	Da.1] Operation pattern	Positioning complete	–	Setting other than "Positioning complete" is not possible in speed control.
	Da.2] Control system	Forward run speed 2	–	Set 2-axis speed control.
	Da.3] Acceleration time No.	1	–	Designate the value set in " Pr.25] Acceleration time 1" as the acceleration time at start.
	Da.4] Deceleration time No.	0	–	Designate the value set in " Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	Da.5] Axis to be interpolated	2	–	Set the axis to be interpolated (partner axis). If the self-axis is set, an error will occur.
	Da.6] Positioning address/ movement amount	–	–	Setting not required (setting value will be ignored).
	Da.7] Arc address	–	–	Setting not required (setting value will be ignored).
	Da.8] Command speed	6000.00 mm/min	3000.00 mm/min	Set the speed to be commanded.
	Da.9] Dwell time	–	–	Setting not required (setting value will be ignored).
	Da.10] M code	10	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data. (" Pr.18] M code ON signal output timing" setting only possible in the WITH mode.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

9.2.14 3-axis speed control

In "3-axis speed control" (" [Da.2] Control system" = Forward run: speed 3, Reverse run: speed 3), control is carried out in the 3-axis direction in which the positioning data has been set by continuously outputting pulses for the speed set in " [Da.8] Command speed" until the input of a stop command.

The two types of 3-axis speed control are "Forward run: speed 3" in which the control starts in the forward run direction, and "Reverse run: speed 3" in which control starts in the reverse run direction.

(Refer to Section 9.1.6 "Interpolation control" for the combination of the reference axis with the interpolation axes.)

■ Operation chart

The following chart shows the operation timing for 3-axis (axes 1, 2, and 3) speed control with axis 1 as the reference axis.

The "in speed control" flag ( [Md.31] Status: b0) is turned ON during speed control.

The "positioning complete signal" is not turned ON.


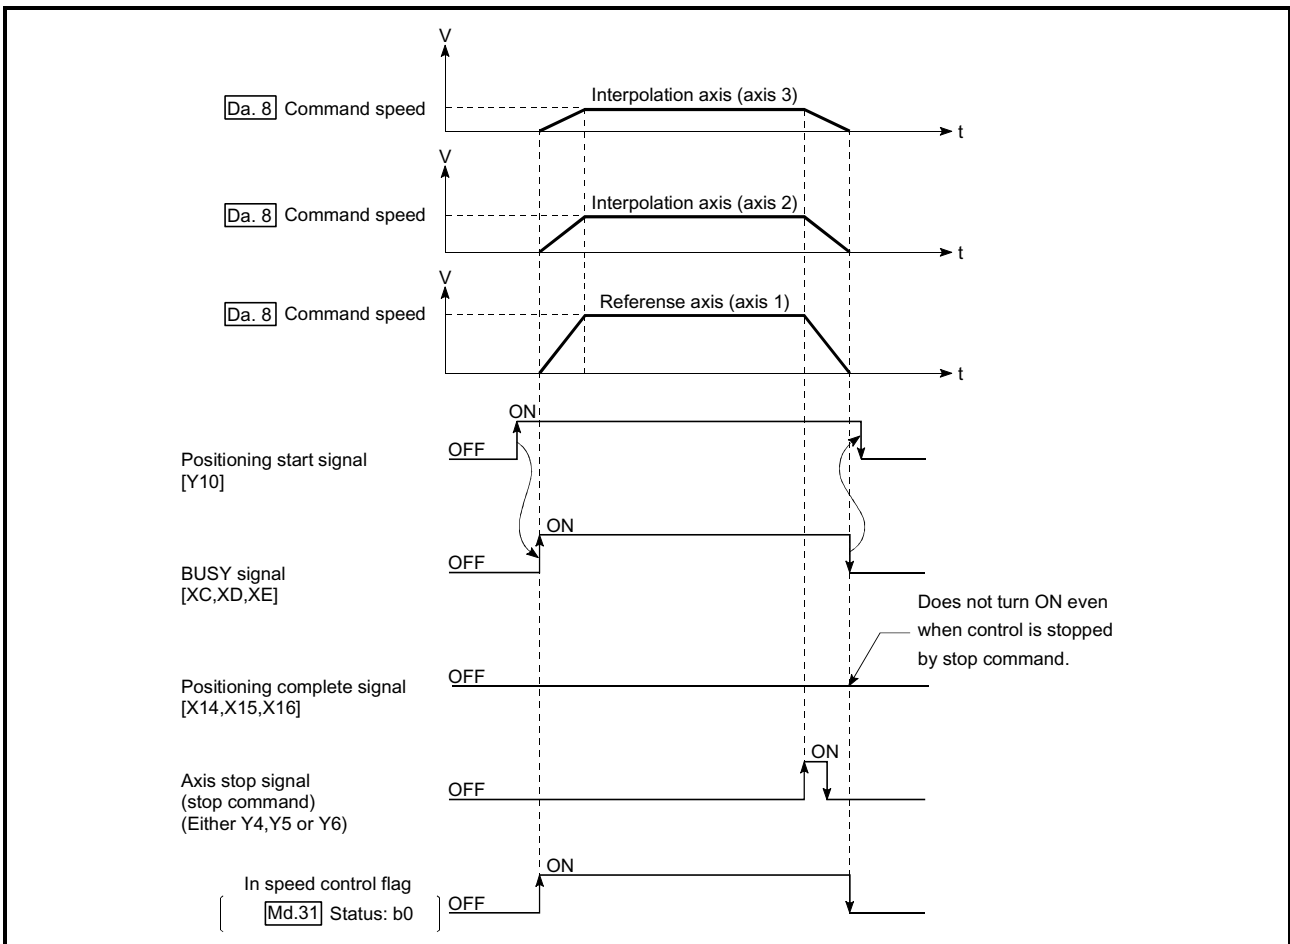


Fig. 9.11 3-axis speed control operation timing

■ Current feed value during 3-axis speed control

The following table shows the " [Md.20] Current feed value" during 3-axis speed control corresponding to the " [Pr.21] Current feed value during speed control" settings. (Note that the reference axis setting values are used for parameters.)

[Pr.21] Current feed value during speed control" setting	[Md.20] Current feed value
0: Do not update current feed value	The current feed value at speed control start is maintained.
1: Update current feed value	The current feed value is updated.
2: Zero clear current feed value	The current feed value is fixed at 0.

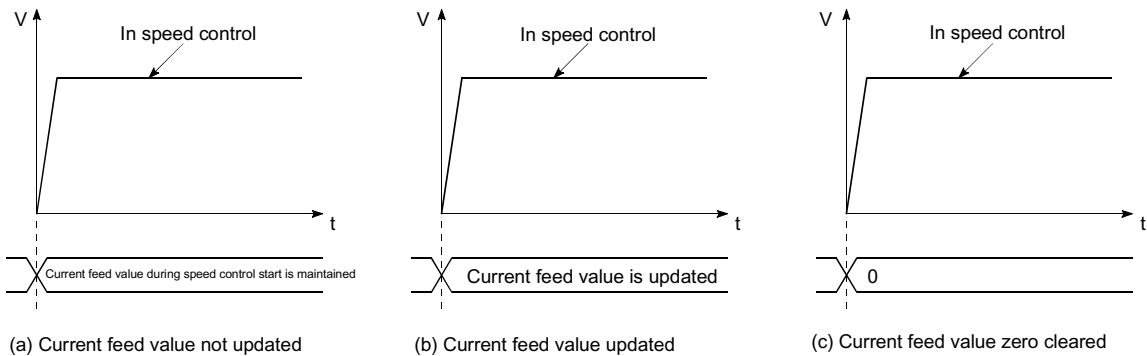

■ Restrictions

- (1) Set "Positioning complete" in " [Da.1] Operation pattern". An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set. ("Continuous positioning control" and "continuous path control" cannot be set in speed control.)
- (2) Set the WITH mode in " [Pr.18] M code ON signal output timing" when using an M code. The M code will not be output, and the M code ON signal will not turn ON if the AFTER mode is set.
- (3) Set the "reference axis speed" in " [Pr.20] Interpolation speed designation method". An "Interpolation mode error (error code: 523)" will occur and the operation cannot start if a composite speed is set.



- (4) When either of three axes exceeds the speed limit, that axis is controlled with the speed limit value. The speeds of the other axes are limited at the ratios of "Da.8 Command speed".

(Examples)

Setting item		Axis		
		Axis 1 setting	Axis 2 setting	Axis 3 setting
Pr.8	Speed limit value	4000.00mm/min	5000.00mm/min	6000.00mm/min
Da.8	Command speed	8000.00mm/min	6000.00mm/min	4000.00mm/min

With the settings shown above, the operation speed in speed control is as follows.

Axis 1: 4000.00 mm/min (Speed is limited by Pr.8 ).

Axis 2: 3000.00 mm/min (Speed is limited at ratios in axes 1, 2, and 3 command speeds).

Axis 3: 2000.00 mm/min (Speed is limited at ratios in axes 1, 2, and 3 command speeds).

- (5) An error "No command speed (error code: 503)" will occur if a current speed (-1) is set in "Da.8 Command speed".
- (6) The software stroke limit check is not carried out when the control unit is set to "degree".

■ Positioning data setting examples

The following table shows the setting examples when "3-axis speed control (forward run: speed 3)" is set in the positioning data No. 1 of axis 1 (reference axis).

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	–	Setting other than "Positioning complete" is not possible in speed control.
	Da.2	Control system	Forward run speed 3	–	–	Set 3-axis speed control.
	Da.3	Acceleration time No.	1	–	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	–	–	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2 and 3.
	Da.6	Positioning address/movement amount	–	–	–	Setting not required (setting value will be ignored).
	Da.7	Arc address	–	–	–	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	3000.00 mm/min	2000.00 mm/min	Set the speed to be commanded.
	Da.9	Dwell time	–	–	–	Setting not required (setting value will be ignored).
	Da.10	M code	10	–	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data. (" Pr.18 M code ON signal output timing" setting only possible in the WITH mode.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

### 9.2.15 4-axis speed control

In "4-axis speed control" ("Da.2 Control system" = Forward run: speed 4, Reverse run: speed 4), control is carried out in the 4-axis direction in which the positioning data has been set by continuously outputting pulses for the speed set in "Da.8 Command speed" until the input of a stop command.

The two types of 4-axis speed control are "Forward run: speed 4" in which the control starts in the forward run direction, and "Reverse run: speed 4" in which control starts in the reverse run direction.

(Refer to Section 9.1.6 "Interpolation control" for the combination of the reference axis with the interpolation axes.)

■ Operation chart

The following chart shows the operation timing for 4-axis speed control with axis 1 as the reference axis.

The "in speed control" flag (  $\overline{\text{Md.31}}$  Status: b0) is turned ON during speed control.

The "positioning complete signal" is not turned ON.


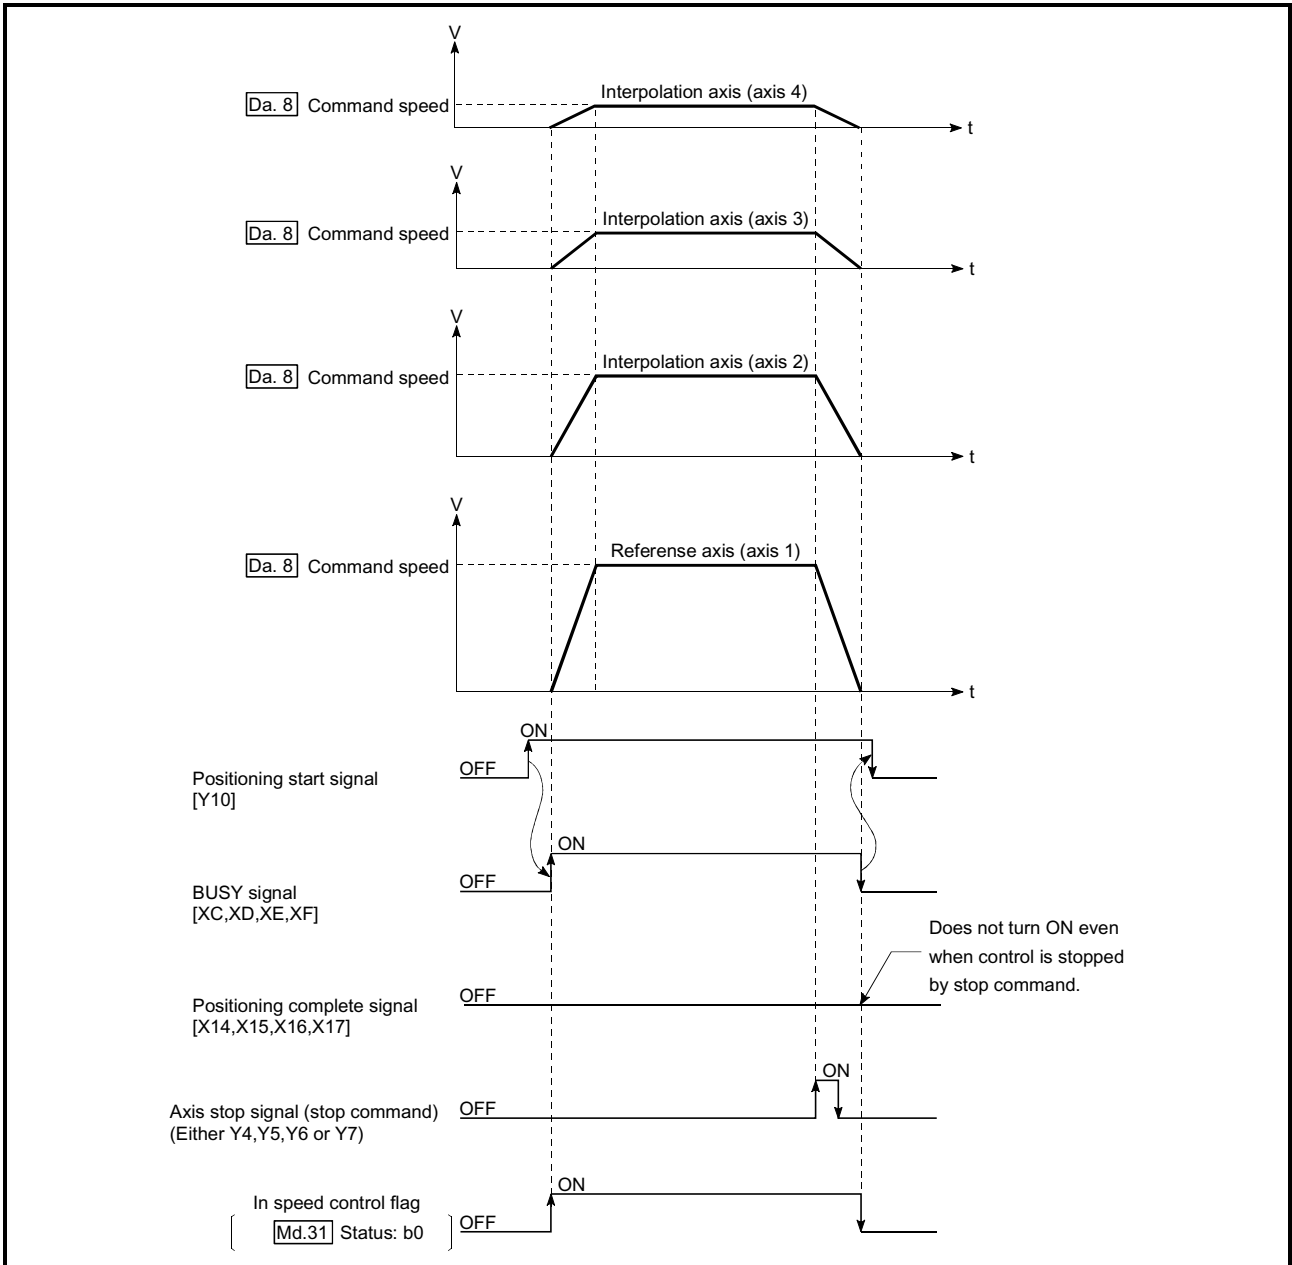


Fig. 9.12 4-axis speed control operation timing

■ Current feed value during 4-axis speed control

The following table shows the " [Md.20] Current feed value" during 4-axis speed control corresponding to the " [Pr.21] Current feed value during speed control" settings. (Note that the reference axis setting values are used for parameters.)

[Pr.21] Current feed value during speed control" setting	[Md.20] Current feed value
0: Do not update current feed value	The current feed value at speed control start is maintained.
1: Update current feed value	The current feed value is updated.
2: Zero clear current feed value	The current feed value is fixed at 0.

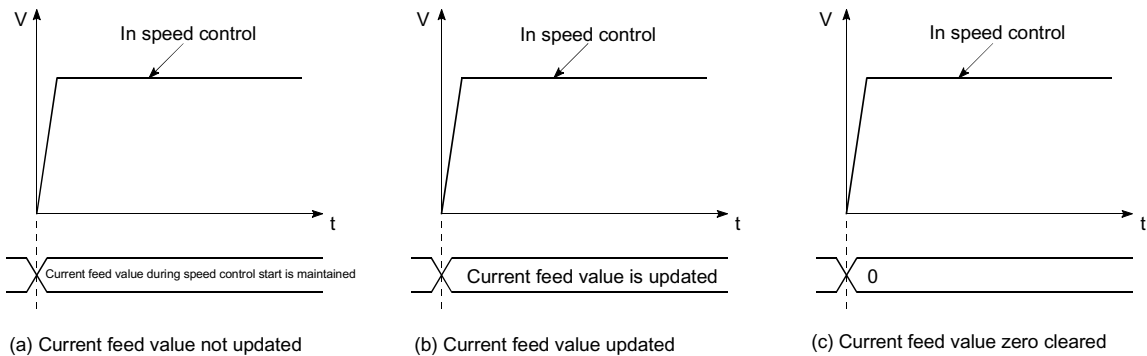

■ Restrictions

- (1) Set "Positioning complete" in " [Da.1] Operation pattern". An axis error "Continuous path control not possible (error code: 516)" will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set. ("Continuous positioning control" and "continuous path control" cannot be set in speed control.)
- (2) Set the WITH mode in " [Pr.18] M code ON signal output timing" when using an M code. The M code will not be output, and the M code ON signal will not turn ON if the AFTER mode is set.
- (3) Set the "reference axis speed" in " [Pr.20] Interpolation speed designation method". An "Interpolation mode error (error code: 523)" will occur and the operation cannot start if a composite speed is set.

- (4) When either of four axes exceeds the speed limit, that axis is controlled with the speed limit value. The speeds of the other axes are limited at the ratios of "Da.8 Command speed".

(Examples)

Setting item		Axis			
		Axis 1 setting	Axis 2 setting	Axis 3 setting	Axis 4 setting
Pr.8	Speed limit value	4000.00mm/min	5000.00mm/min	6000.00mm/min	8000.00mm/min
Da.8	Command speed	8000.00mm/min	6000.00mm/min	4000.00mm/min	1500.00mm/min

With the settings shown above, the operation speed in speed control is as follows.

Axis 1: 4000.00 mm/min (Speed is limited by Pr.8 ).

Axis 2: 3000.00 mm/min (Speed is limited at ratios in axes 1, 2, 3 and 4 command speeds).

Axis 3: 2000.00 mm/min (Speed is limited at ratios in axes 1, 2, 3 and 4 command speeds).

Axis 4: 750.00 mm/min (Speed is limited at ratios in axes 1, 2, 3 and 4 command speeds).

- (5) An error "No command speed (error code: 503)" will occur if a current speed (-1) is set in "Da.8 Command speed".
- (6) The software stroke limit check is not carried out when the control unit is set to "degree".

■ Positioning data setting examples

The following table shows the setting examples when "4-axis speed control (forward run: speed 4)" is set in the positioning data No. 1 of axis 1 (reference axis).

Setting item		Axis	Axis 1 (reference axis) setting example	Axis 2 (interpolation axis) setting example	Axis 3 (interpolation axis) setting example	Axis 4 (interpolation axis) setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	–	–	–	Setting other than "Positioning complete" is not possible in speed control.
	Da.2	Control system	Forward run speed 4	–	–	–	Set 4-axis speed control.
	Da.3	Acceleration time No.	1	–	–	–	Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	–	–	–	Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	–	–	–	Setting not required (setting value will be ignored). When axis 1 is used as a reference axis, the interpolation axes are axes 2, 3 and 4.
	Da.6	Positioning address/movement amount	–	–	–	–	Setting not required (setting value will be ignored).
	Da.7	Arc address	–	–	–	–	Setting not required (setting value will be ignored).
	Da.8	Command speed	6000.00 mm/min	3000.00 mm/min	2000.00 mm/min	1000.00 mm/min	Set the speed to be commanded.
	Da.9	Dwell time	–	–	–	–	Setting not required (setting value will be ignored).
	Da.10	M code	10	–	–	–	Set this when other sub operation commands are issued in combination with the No. 1 positioning data. (" Pr.18 M code ON signal output timing" setting only possible in the WITH mode.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

## 9.2.16 Speed-position switching control (INC mode)

In "speed-position switching control (INC mode)" ("Da.2" Control system = Forward run: speed/position, Reverse run: speed/position), the pulses of the speed set in "Da.8" Command speed" are kept output on the axial direction set to the positioning data. When the "speed-position switching signal" is input, position control of the movement amount set in "Da.6" Positioning address/movement amount" is exercised.

"Speed-position switching control (INC mode)" is available in two different types: "forward run: speed/position" which starts the axis in the forward run direction and "reverse run: speed/position" which starts the axis in the reverse run direction.

Use the detailed parameter 1 "Pr.200" Speed-position function selection" with regard to the choice for "speed-position switching control (INC mode)".

Setting item		Setting value	Setting details	Buffer memory address			
				Axis 1	Axis 2	Axis 3	Axis 4
Pr.200	Speed-position function selection	0	Speed-position switching control (INC mode)	34	184	334	484

\* If the set value is other than 0 and 2, it is regarded as 0 and operation is performed in the INC mode.

For details of the setting, refer to Sections 5.2 "List of parameters".

#### ■ Switching over from speed control to position control

- (1) The control is switched over from speed control to position control by the external signal "speed-position switching signal".
- (2) Besides setting the positioning data, the "Cd.24" Speed-position switching enable flag" must also be turned ON to switch over from speed control to position control. (If the "Cd.24" Speed-position switching enable flag" turns ON after the speed-position switching signal turns ON, the control will continue as speed control without switching over to position control. Only position control will be carried out when the "Cd.24" Speed-position switching enable flag" and speed-position switching signal are ON at the operation start.)



■ Operation chart

The following chart (Fig.9.13) shows the operation timing for speed-position switching control (INC mode). The "in speed control flag" ( Md.31 Status: b0) is turned ON during speed control of speed-position switching control (INC mode).


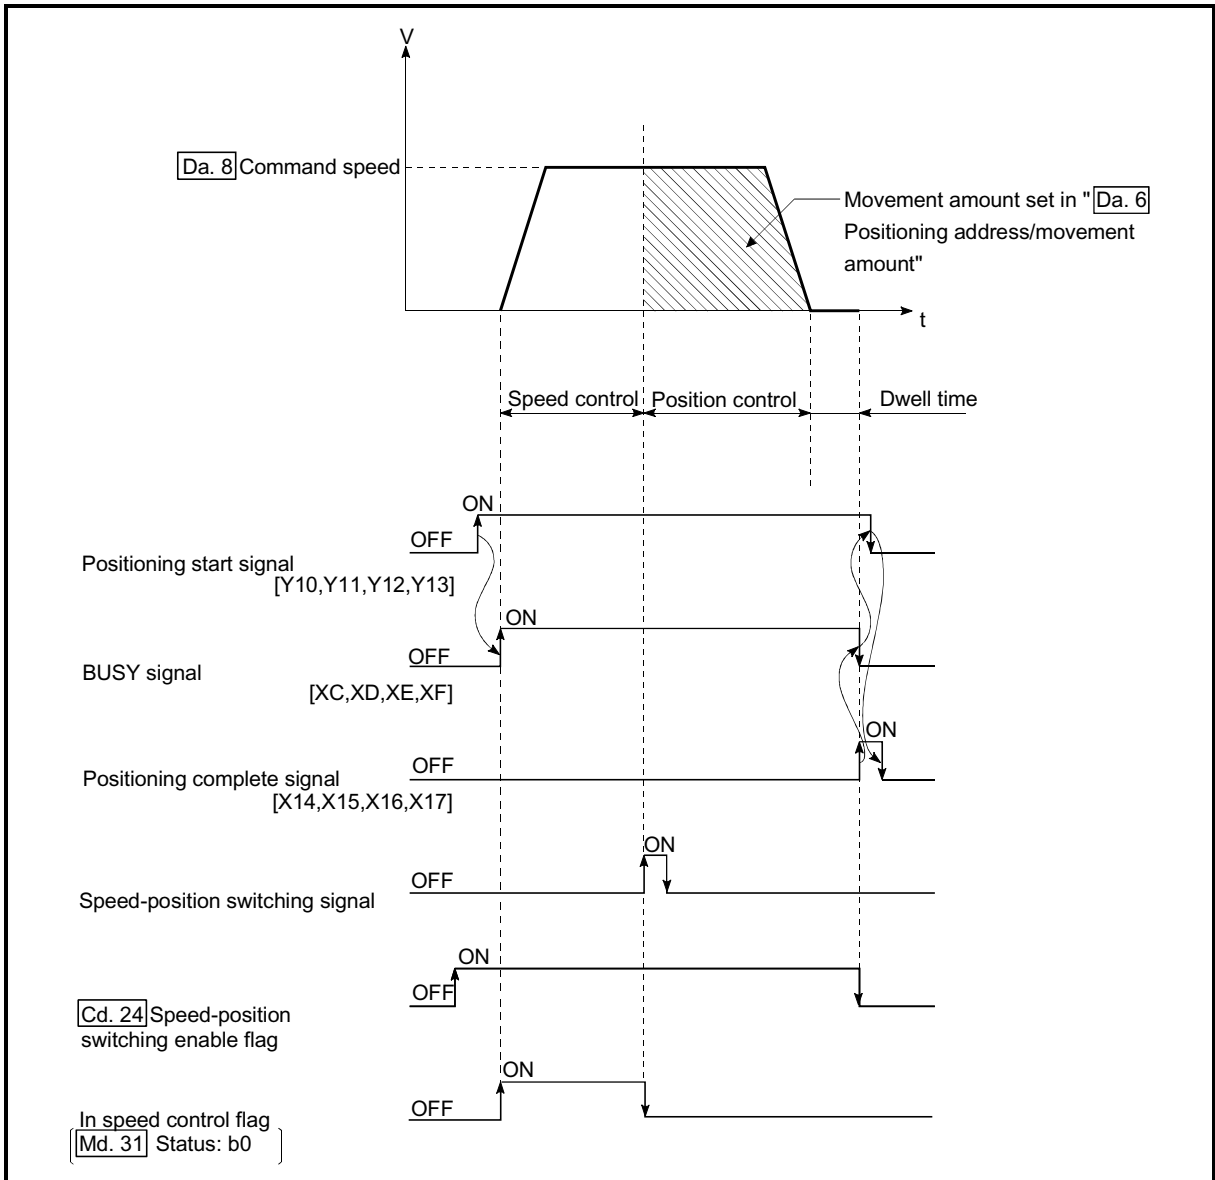


Fig. 9.13 Speed-position switching control (INC mode) operation timing

[Operation example]

The following operation assumes that the speed-position switching signal is input at the position of the current feed value of 90.00000 [degree] during execution of "Da.2 Control system" "Forward run: speed/position" at "Pr.1 Unit setting" of "2: degree" and "Pr.21 Current feed value during speed control" setting of "1: Update current feed value".  
 (The value set in "Da.6 Positioning address/movement amount" is 270.00000 [degree])

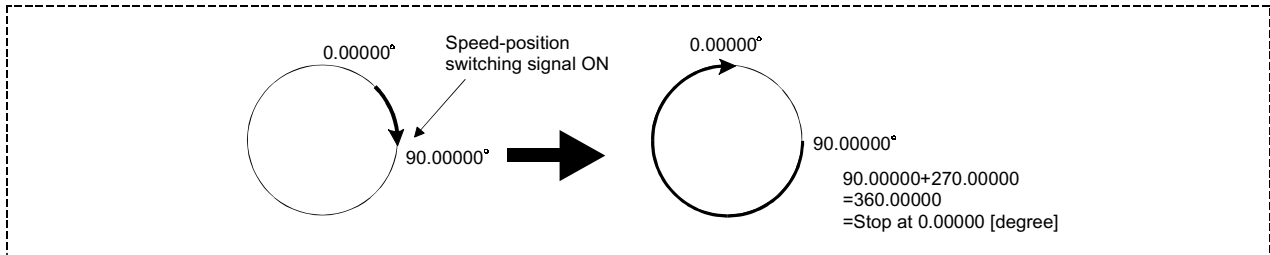

■ Operation timing and processing time during speed-position switching control (INC mode)

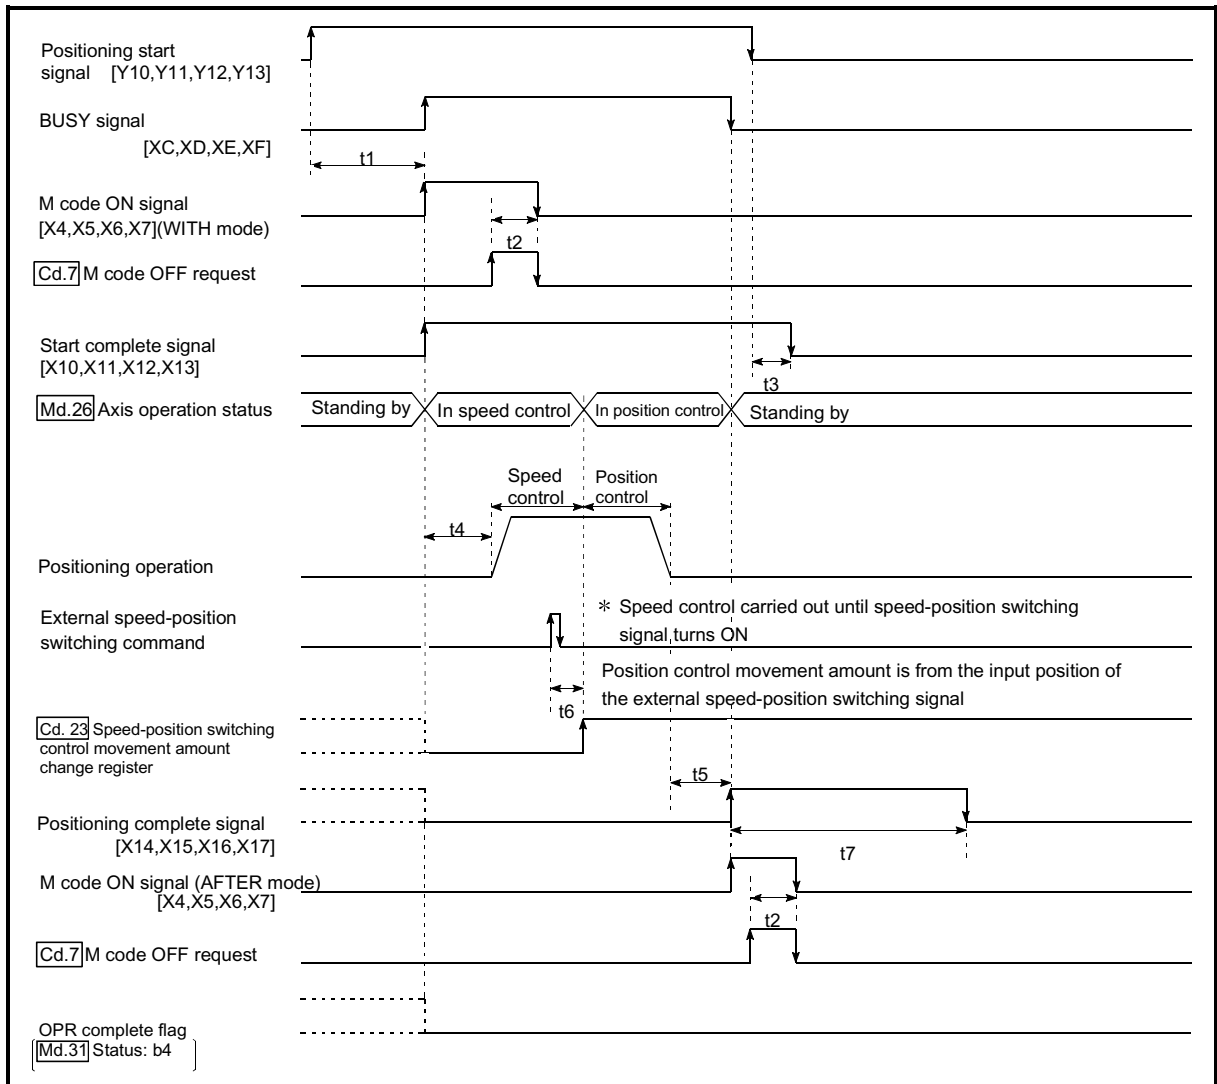


Fig. 9.14 Operation timing and processing time during speed-position switching control (INC mode)

Normal timing time

Unit: ms


t1	t2	t3	t4	t5	t6	t7
1.1	0 to 3.5	0 to 3.5	5.5 to 7.9	0 to 3.5	1.0	Follows parameters

∄ The t1 timing time could be delayed by the operation state of other axes.

■ Current feed value during speed-position switching control (INC mode)

The following table shows the "Md.20 Current feed value" during speed-position switching control (INC mode) corresponding to the "Pr.21 Current feed value during speed control" settings.

Pr.21 Current feed value during speed control" setting	Md.20 Current feed value
0: Do not update current feed value	The current feed value at control start is maintained during speed control, and updated from the switching to position control.
1: Update current feed value	The current feed value is updated during speed control and position control.
2: Zero clear current feed value	The current feed value is cleared (set to "0") at control start, and updated from the switching to position control.

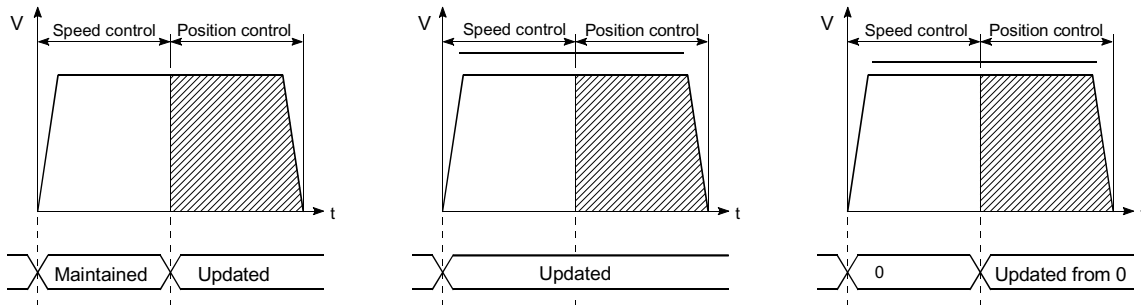


(a) Current feed value not updated

(b) Current feed value updated

(c) Current feed value zero cleared

■ Switching time from speed control to position control

There is 1ms from the time the speed-position switching signal is turned ON to the time the speed-position switching latch flag (Md.31 Status: b1) turns ON.

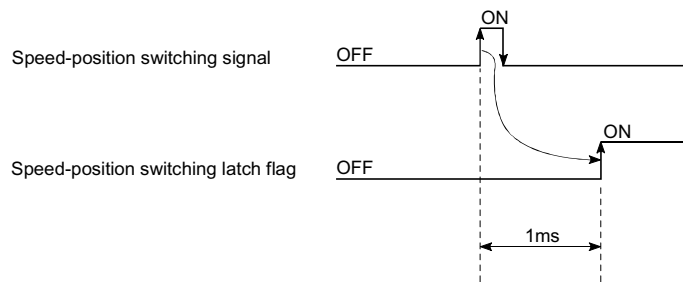

■ Speed-position switching signal setting

The following table shows the items that must be set to use the external command signals (CHG) as speed-position switching signals.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Pr.42] External command function selection	2	Set the "2: speed-position and position-speed switching requests".	62	212	362	512
[Cd.8] External command valid	1	Set "1: Validate external command".	1505	1605	1705	1805

\* Refer to Sections 5.2 "List of parameters" and Section 5.7 "List of control data" for information on the setting details.

■ Changing the position control movement amount

In "speed-position switching control (INC mode)", the position control movement amount can be changed during the speed control section.

- (1) The position control movement amount can be changed during the speed control section of speed-position switching control (INC mode).  
A movement amount change request will be ignored unless issued during the speed control section of the speed-position switching control (INC mode).
- (2) The "new movement amount" is stored in "[Cd.23] Speed-position switching control movement amount change register" by the PLC program during speed control.  
When the speed-position switching signal is turned ON, the movement amount for position control is stored in "[Cd.23] Speed-position switching control movement amount change register".
- (3) The movement amount is stored in the "[Md.29] Speed-position switching control positioning amount" of the axis monitor area from the point where the control changes to position control by the input of a speed-position switching signal from an external source.

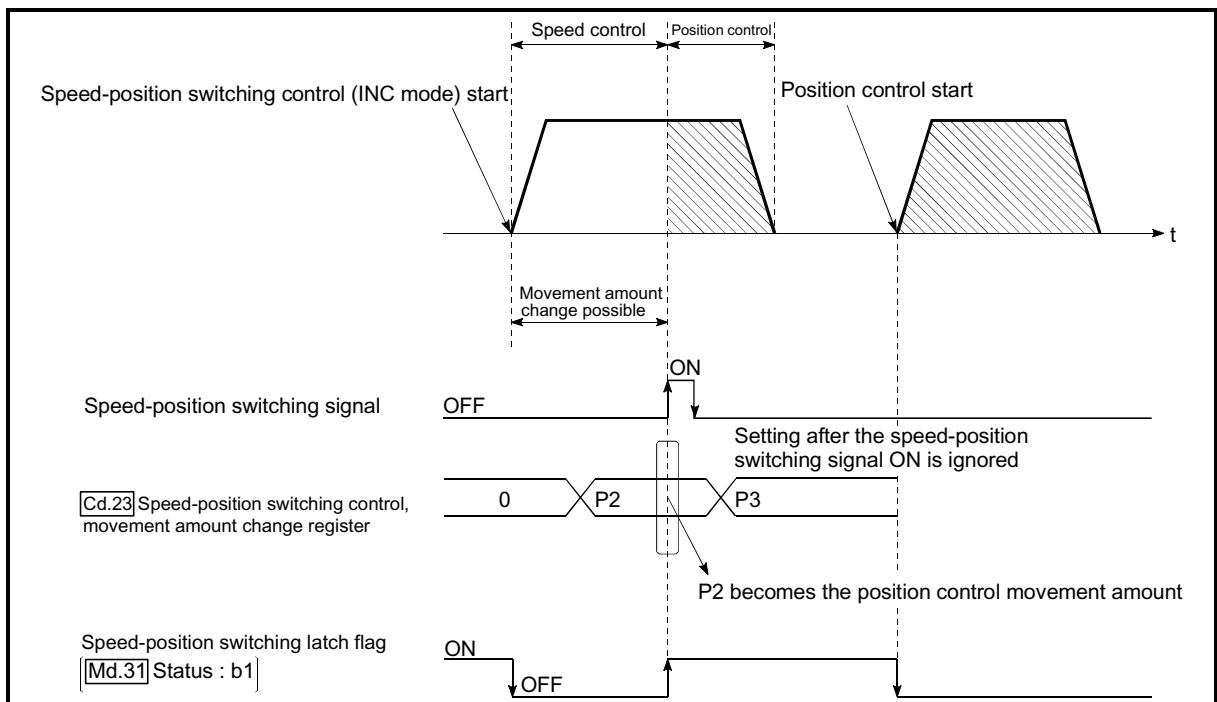


Fig. 9.15 Position control movement amount change timing

POINT
<p>⊘ The machine recognizes the presence of a movement amount change request when the data is written to " [Cd.23] Speed-position switching control movement amount change register" with the PLC program.</p> <p>⊘ The new movement amount is validated after execution of the speed-position switching control (INC mode), before the input of the speed-position switching signal.</p> <p>⊘ The movement amount change can be enable/disable with the interlock function in position control using the "speed-position switching latch flag" ( [Md.31] Status : b1) of the axis monitor area.</p>

#### ■ Restrictions

- (1) An axis error (error code: 516) will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set in " [Da.1] Operation pattern".
- (2) "Speed-position switching control" cannot be set in " [Da.2] Control system" of the positioning data when "continuous path control" has been set in " [Da.1] Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", "speed-position switching control" cannot be set in positioning data No. 2.) An axis error (error code: 516) will occur and the machine will carry out a deceleration stop if this type of setting is carried out.
- (3) An error (error code: 503) will occur if "current speed (-1)" is set in " [Da.8] command speed".
- (4) The software stroke limit range check during speed control is made only when the following (a) and (b) are satisfied:
  - (a) " [Pr.21] Current feed value during speed control" is "1: Update current feed value".  
If the movement amount exceeds the software stroke limit range during speed control in case of the setting of other than "1: Update current feed value", an error (error code: 507 or 508) will occur as soon as speed control is changed to position control and the axis will decelerate to a stop.
  - (b) When " [Pr.1] Unit setting" is other than "2: degree"  
If the unit is "degree", the software stroke limit range check is not performed.
- (5) If the value set in " [Da.6] Positioning address/movement amount" is negative, an error (error code: 530) will occur.
- (6) Deceleration processing is carried out from the point where the speed-position switching signal is input if the position control movement amount set in " [Da.6] Positioning address/movement amount" is smaller than the deceleration distance from the " [Da.8] Command speed".
- (7) Turn ON the speed-position switching signal in the speed stabilization region (constant speed status). A warning (warning code: 508) will occur because of large deviation in the droop pulse amount if the signal is turned ON during acceleration.  
During use of the servo motor, the actual movement amount after switching of speed control to position control is the "preset movement amount + droop pulse amount". If the signal is turned ON during acceleration/deceleration, the stop position will vary due to large variation of the droop pulse amount. Even though " [Md.29] Speed-position switching control positioning amount" is the same, the stop position will change due to a change in droop pulse amount when " [Da.8] Command speed" is different.

### ■ Positioning data setting examples

The following table shows setting examples when "speed-position switching control (INC mode) by forward run" is set in positioning data No. 1 of axis 1.

		Setting item	Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	Set "Positioning complete" assuming the next positioning data will not be executed. ("Continuous path control" cannot be set in "speed-position switching control (INC mode)".)
	Da.2	Control system	Forward run: speed/position	Set speed-position switching control by forward run.
	Da.3	Acceleration time No.	1	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	Setting not required. (Setting value is ignored.)
	Da.6	Positioning address/movement amount	10000.0σm	INC mode ( [Pr.200] = 0) Set the movement amount after the switching to position control. (Assuming that the " [Pr.1] Unit setting" is set to "mm".)
	Da.7	Arc address	–	Setting not required. (Setting value is ignored.)
	Da.8	Command speed	6000.00mm/min	Set the speed to be controlled.
	Da.9	Dwell time	500ms	Set a time from the positioning stop (pulse output stop) by position control until the positioning complete signal is output. When the system is stopped by speed control, ignore the setting value.
	Da.10	M code	10	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

9.2.17 Speed-position switching control (ABS mode)

In case of "speed-position switching control (ABS mode)" ("Da.2 Control system = Forward run: speed/position, Reverse run: speed/position), the pulses of the speed set in "Da.8 Command speed" are kept output in the axial direction set to the positioning data. When the "speed-position switching signal" is input, position control to the address set in "Da.6 Positioning address/movement amount" is exercised.

"Speed-position switching control (ABS mode)" is available in two different types: "forward run: speed/position" which starts the axis in the forward run direction and "reverse run: speed/position" which starts the axis in the reverse run direction.

"Speed-position switching control (ABS mode)" is valid only when "Pr.1 Unit setting" is "2: degree".

Speed-position function selection	Pr.1 Unit setting	mm	inch	degree	PLS
	INC mode	○	○	○	○
	ABS mode	×	×	○	×

○: Setting allowed,

×: Setting disallowed (If setting is made, an error (error code: 935) will occur when the PLC READY signal (Y0) turns ON.)

Use the detailed parameter 1 "Pr.200 Speed-position function selection" to choose "speed-position switching control (ABS mode)".

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Pr.200 Speed-position function selection	2	Speed-position switching control (ABS mode)	34	184	334	484

\* If the set value is other than 0 and 2, it is regarded as 0 and operation is performed in the INC mode.

For details of the setting, refer to Sections 5.2 "List of parameters".

■ Switching over from speed control to position control

- (1) The control is switched over from speed control to position control by the external signal "speed-position switching signal".
- (2) Besides setting the positioning data, the "Cd.24 Speed-position switching enable flag" must also be turned ON to switch over from speed control to position control. (If the "Cd.24 Speed-position switching enable flag" turns ON after the speed-position switching signal turns ON, the control will continue as speed control without switching over to position control. Only position control will be carried out when the "Cd.24 Speed-position switching enable flag" and speed-position switching signal are ON at the operation start.)



■ Operation chart

The following chart (Fig.9.16) shows the operation timing for speed-position switching control (ABS mode). The "in speed control flag" ( [Md.31] Status: b0) is turned ON during speed control of speed-position switching control (ABS mode).


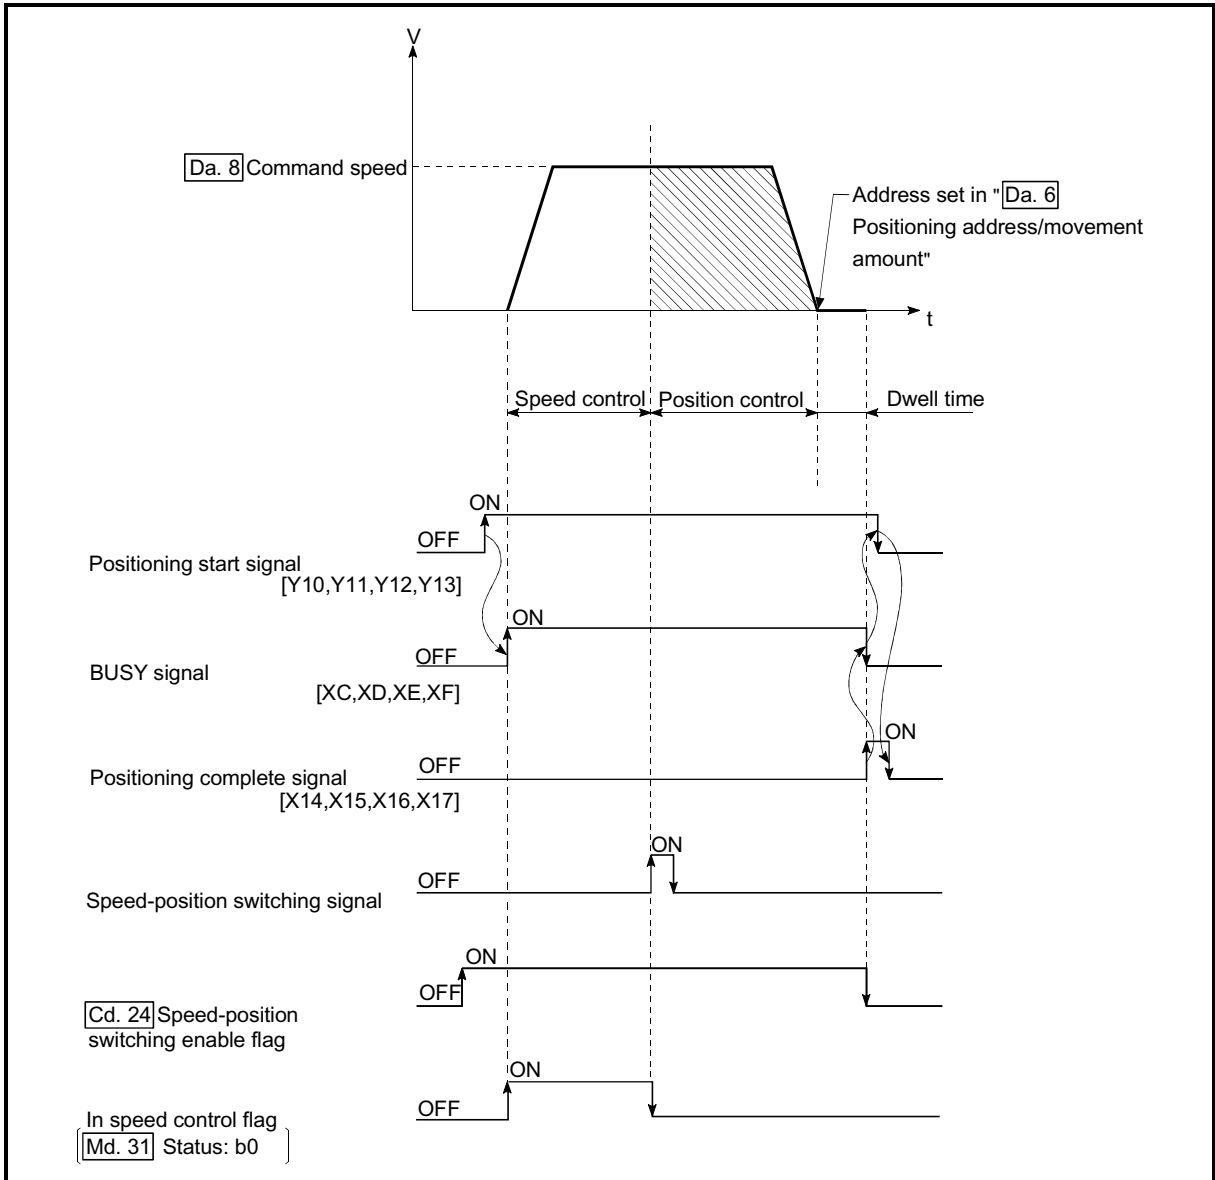


Fig. 9.16 Speed-position switching control (ABS mode) operation timing

[Operation example]

The following operation assumes that the speed-position switching signal is input at the position of the current feed value of 90.00000 [degree] during execution of "Da.2 Control system" "Forward run: speed/position" at "Pr.1 Unit setting" of "2: degree" and "Pr.21 Current feed value during speed control" setting of "1: Update current feed value".

(The value set in "Da.6 Positioning address/movement amount" is 270.00000 [degree])

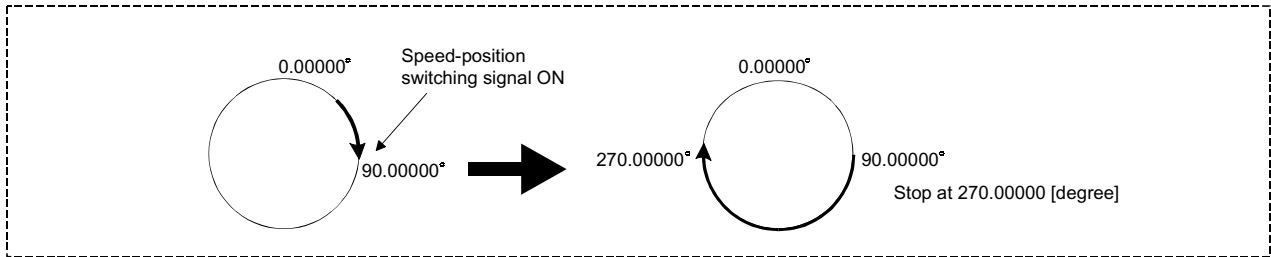

■ Operation timing and processing time during speed-position switching control (ABS mode)

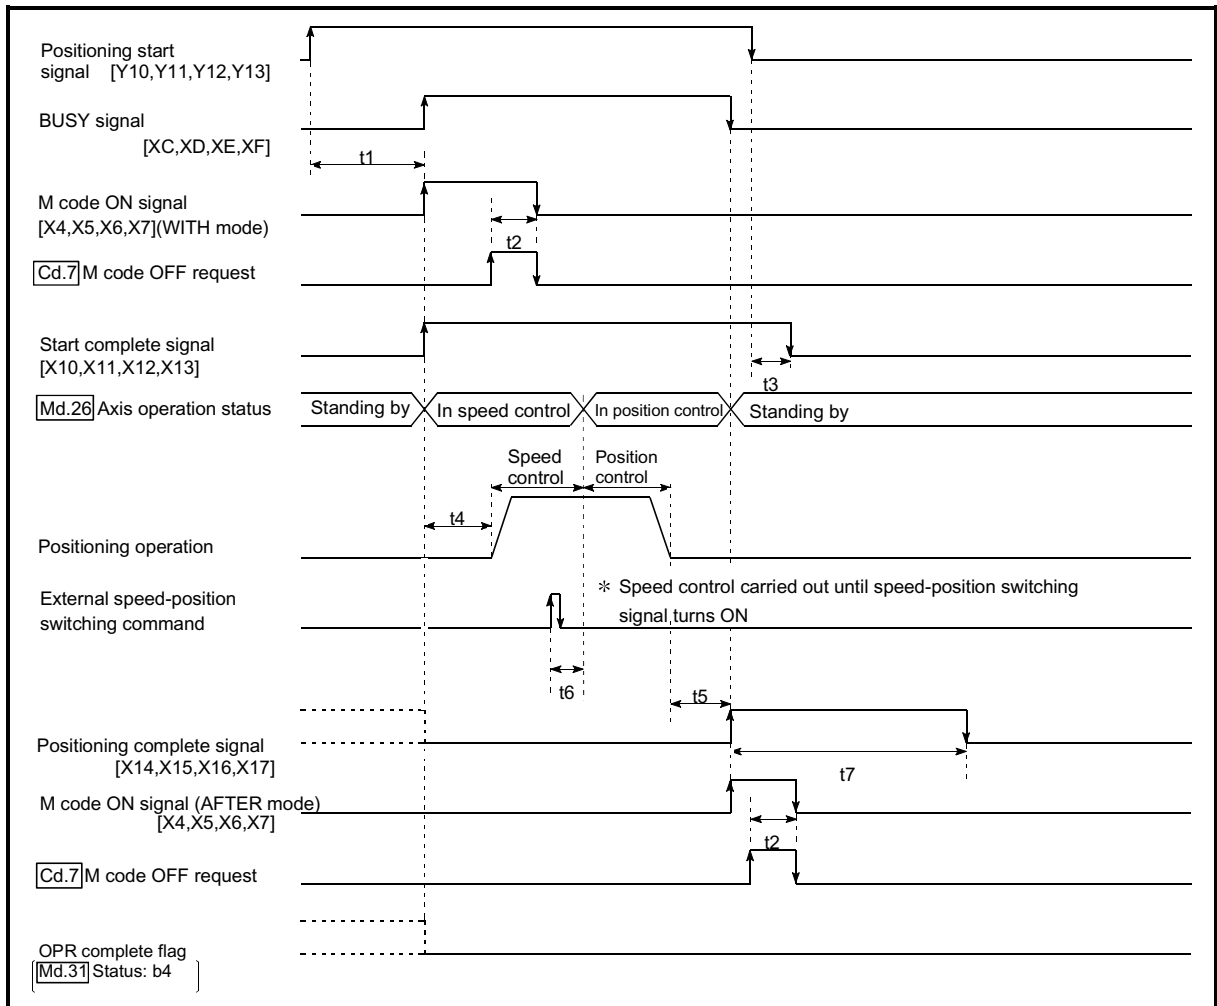


Fig. 9.17 Operation timing and processing time during speed-position switching control (ABS mode)

Normal timing time

Unit: ms

t1	t2	t3	t4	t5	t6	t7
1.1	0 to 3.5	0 to 3.5	5.5 to 7.9	0 to 3.5	1.0	Follows parameters


⚠ The t1 timing time could be delayed by the operation state of other axes.

■ Current feed value during speed-position switching control (ABS mode)

The following table shows the "Md.20 Current feed value" during speed-position switching control (ABS mode) corresponding to the "Pr.21 Current feed value during speed control" settings.

"Pr.21 Current feed value during speed control" setting	Md.20 Current feed value
1: Update current feed value	The current feed value is updated during speed control and position control.


Only "1: Update current value" is valid for the setting of "Pr.21 Current feed value during speed control" in speed-position switching control (ABS mode).  
 An error (error code: 935) will occur if the "Pr.21 Current feed value during speed control" setting is other than 1.

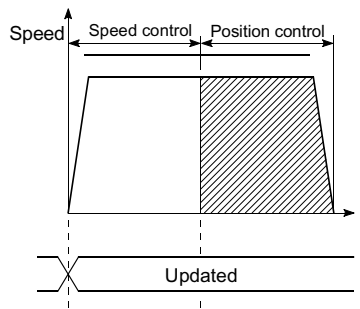

Current feed value updated

■ Switching time from speed control to position control

There is 1ms from the time the speed-position switching signal is turned ON to the time the speed-position switching latch flag (Md.31 Status: b1) turns ON.

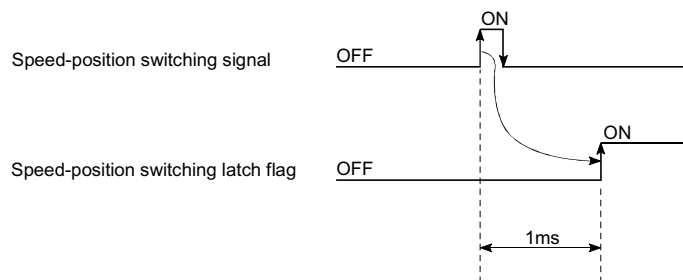

### ■ Speed-position switching signal setting


The following table shows the items that must be set to use the external command signals (CHG) as speed-position switching signals.

Setting item		Setting value	Setting details	Buffer memory address			
				Axis 1	Axis 2	Axis 3	Axis 4
Pr.42	External command function selection	2	Set the "2: speed-position and position-speed switching requests".	62	212	362	512
Cd.8	External command valid	1	Set "1: Validate external command".	1505	1605	1705	1805

\* Refer to Sections 5.2 "List of parameters" and Section 5.7 "List of control data" for information on the setting details.

### ■ Restrictions

- (1) An axis error (error code: 516) will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set in "Da.1" Operation pattern".
- (2) "Speed-position switching control" cannot be set in "Da.2" Control system" of the positioning data when "continuous path control" has been set in "Da.1" Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", "speed-position switching control" cannot be set in positioning data No. 2.) An axis error (error code: 516) will occur and the machine will carry out a deceleration stop if this type of setting is carried out.
- (3) An error (error code: 503) will occur if "current speed (-1)" is set in "Da.8" command speed".
- (4) If the value set in "Da.6" Positioning address/movement amount" is negative, an error (error code: 530) will occur.
- (5) Even though the axis control data "Cd.23" Speed-position switching control movement amount change register" was set in speed-position switching control (ABS mode), it would not function. The set value is ignored.
- (6) To exercise speed-position switching control (ABS mode), the following conditions must be satisfied:
  - (a) "Pr.1" Unit setting" is "2: degree"
  - (b) The software stroke limit function is invalid (upper limit value = lower limit value)
  - (c) "Pr.21" Current feed value during speed control" is "1: Update current feed value"
  - (d) The "Da.6" Positioning address/movement amount" setting range is 0 to 359.99999 (degree)  
If the value is outside of the range 0 to 359.99999 (degree), an error (error code: 530) will occur at a start.
  - (e) The "Pr.200" Speed-position function selection" setting is "2: Speed-position switching control (ABS mode)".
- (7) If any of the conditions in (6)(a) to (6)(c) is not satisfied in the case of (6)(e), an error (error code: 935) will occur when the PLC READY signal [Y0] turns from OFF to ON.
- (8) If the axis reaches the positioning address midway through deceleration after automatic deceleration started at the input of the speed-position switching signal, the axis will not stop immediately at the positioning address. The axis will stop at the positioning address after N revolutions so that automatic deceleration can always be made. (N: Natural number)  
In this case, make the movement amount after speed-position switching signal input within 21474.83647 (degree). If the movement amount exceeds 21474.83647 (degree), make the movement amount smaller by reducing the command speed or shortening the deceleration time, for example.  
In the following example, since making deceleration in the path of dotted line will cause the axis to exceed the positioning addresses twice, the axis will decelerate to a stop at the third positioning address.

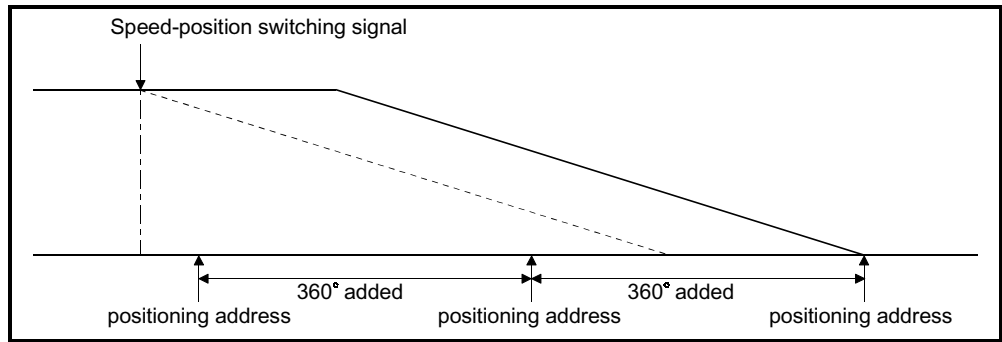

■ Positioning data setting examples

The following table shows setting examples when "speed-position switching control (ABS mode) by forward run" is set in positioning data No. 1 of axis 1.

	Setting item	Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete Set "Positioning complete" assuming the next positioning data will not be executed. ("Continuous path control" cannot be set in "speed-position switching control (ABS mode)".)
	Da.2	Control system	Forward run: speed/position Set speed-position switching control by forward run.
	Da.3	Acceleration time No.	1 Designate the value set in " Pr.25 Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0 Designate the value set in " Pr.10 Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	- Setting not required. (Setting value is ignored.)
	Da.6	Positioning address/movement amount	270.00000 degree ABS mode ( Pr.200 = 2) Set the address after the switching to position control. (Assuming that the " Pr.1 Unit setting" is set to "mm".)
	Da.7	Arc address	- Setting not required. (Setting value is ignored.)
	Da.8	Command speed	6000.00mm/min Set the speed to be controlled.
	Da.9	Dwell time	500ms Set a time from the positioning stop (pulse output stop) by position control until the positioning complete signal is output. When the system is stopped by speed control, ignore the setting value.
	Da.10	M code	10 Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

### 9.2.18 Position-speed switching control

In "position-speed switching control" (" [Da.2] Control system" = Forward run: position/speed, Reverse run: position/speed), before the position-speed switching signal is input, position control is carried out for the movement amount set in " [Da.6] Positioning address/movement amount" in the axis direction in which the positioning data has been set. When the position-speed switching signal is input, the position control is carried out by continuously outputting the pulses for the speed set in " [Da.8] command speed" until the input of a stop command.

The two types of position-speed switching control are "Forward run: position/speed" in which the control starts in the forward run direction, and "Reverse run: position/speed" in which control starts in the reverse run direction.

#### ■ Switching over from position control to speed control

- (1) The control is switched over from position control to speed control by the external signal "position-speed switching signal".
- (2) Besides setting the positioning data, the " [Cd.26] Position-speed switching enable flag" must also be turned ON to switch over from position control to speed control. (If the " [Cd.26] Position-speed switching enable flag" turns ON after the position-speed switching signal turns ON, the control will continue as position control without switching over to speed control. Only speed control will be carried out when the " [Cd.26] Position-speed switching enable flag" and position-speed switching signal are ON at the operation start.)



■ Operation chart

The following chart shows the operation timing for position-speed switching control.

The "in speed control" flag ( **Md.31** Status: b0) is turned ON during speed control of position-speed switching control.

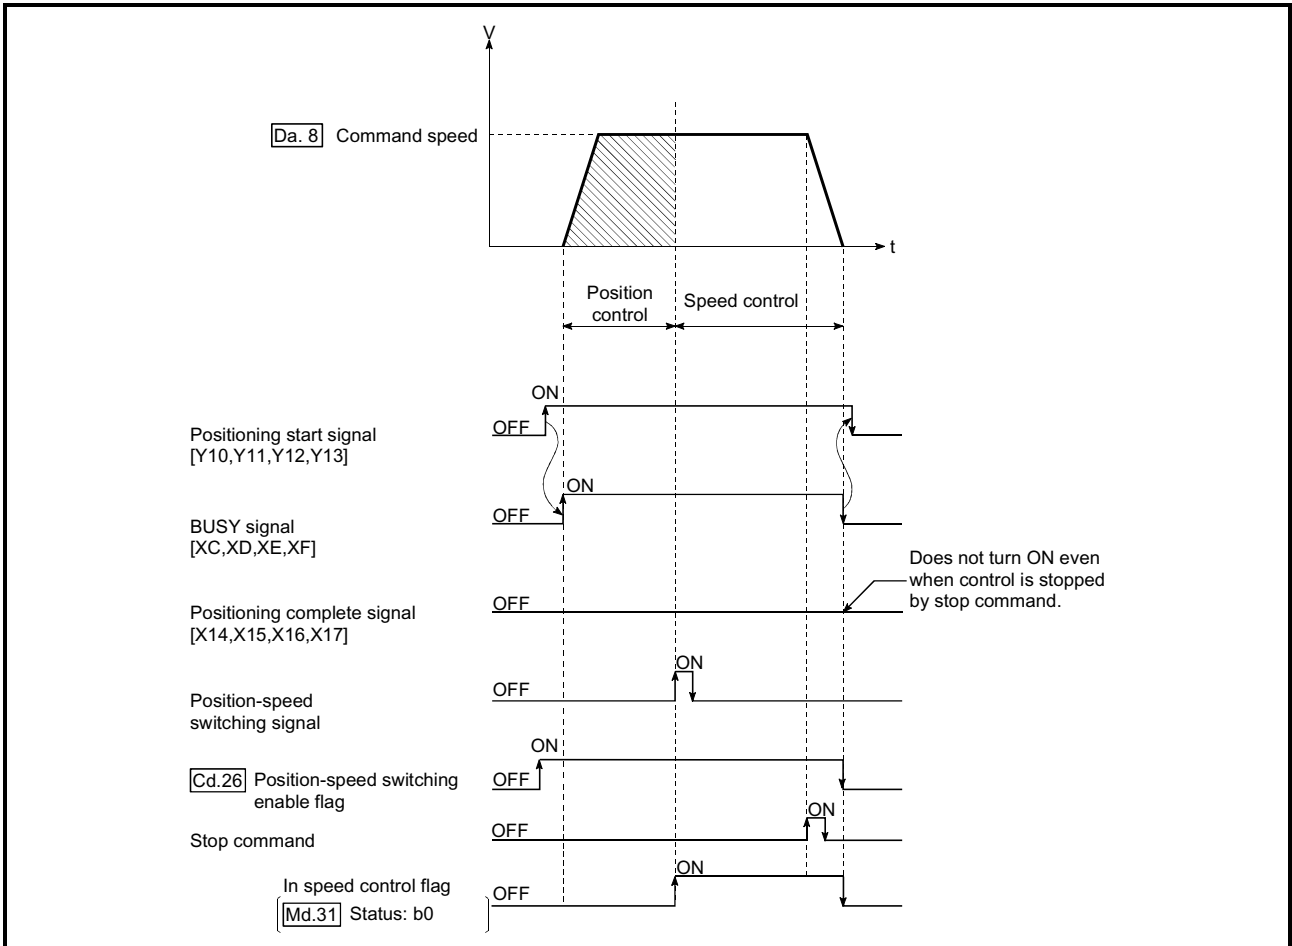


Fig. 9.18 Position-speed switching control operation timing

■ Operation timing and processing time during position-speed switching control

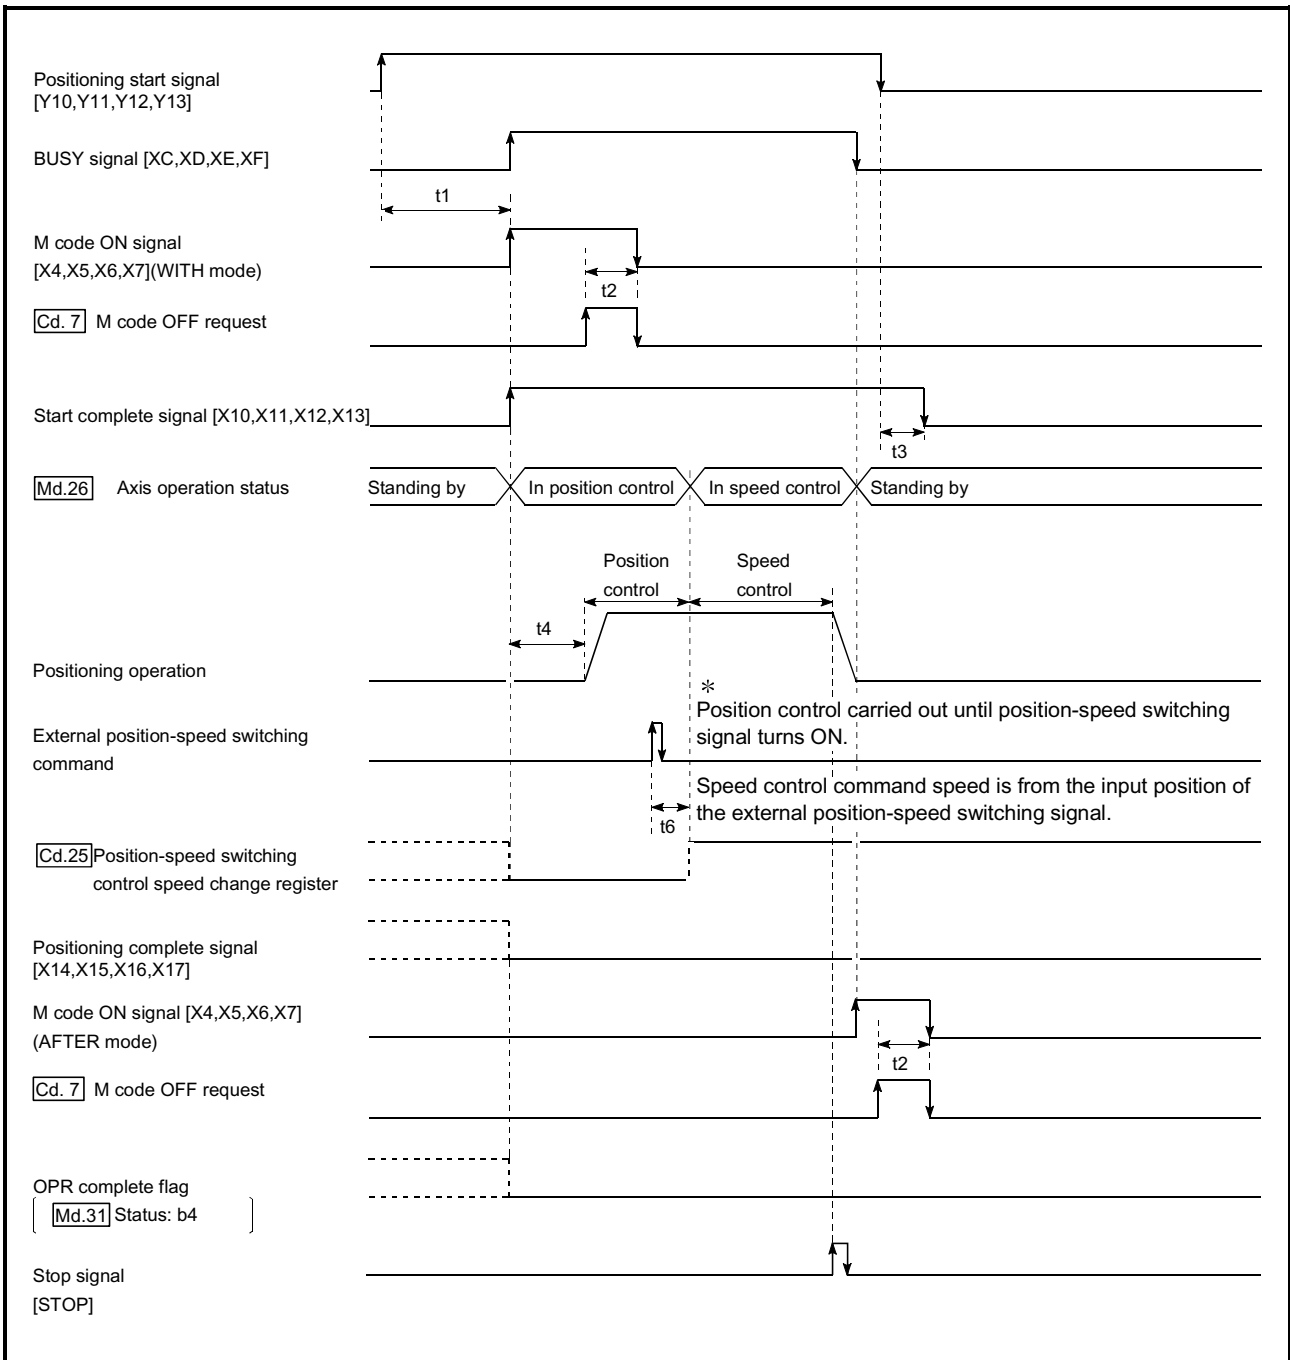


Fig. 9.19 Operation timing and processing time during position-speed switching control

Normal timing time

Unit: ms


t1	t2	t3	t4	t5	t6
1.0 to 1.4	0 to 3.5	0 to 3.5	5.5 to 7.9	-	1.0

⚠ The t1 timing time could be delayed by the operation state of other axes.

■ Current feed value during position-speed switching control

The following table shows the "Md.20 Current feed value" during position-speed switching control corresponding to the "Pr.21 Current feed value during speed control" settings.

"Pr.21 Current feed value during speed control" setting	Md.20 Current feed value
0: Do not update current feed value	The current feed value is updated during position control, and the current feed value at the time of switching is maintained as soon as position control is switched to speed control.
1: Update current feed value	The current feed value is updated during position control and speed control.
2: Zero clear current feed value	The current feed value is updated from 0 at a control start, and the current feed value is cleared (to "0") as soon as position control is switched to speed control.

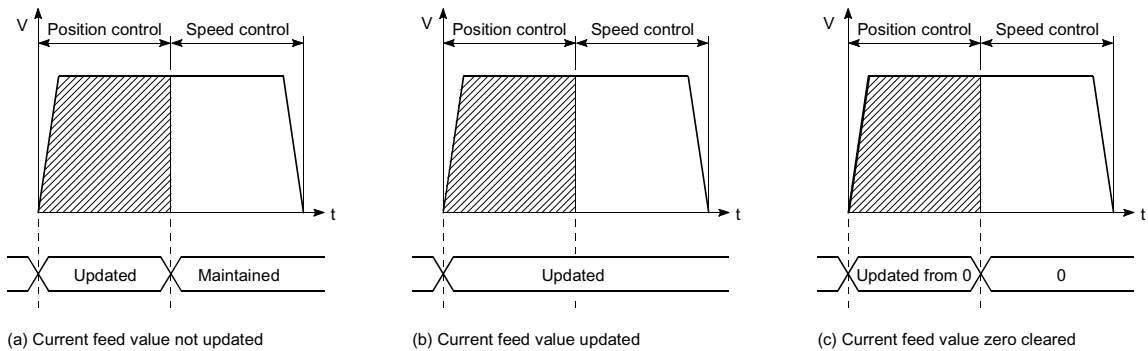

■ Switching time from position control to speed control

There is 1ms from the time the position-speed switching signal is turned ON to the time the position-speed switching latch flag (Md.31 Status: b5) turns ON.



■ Position-speed switching signal setting

The following table shows the items that must be set to use the external command signals (CHG) as position-speed switching signals.

Setting item		Setting value	Setting details	Buffer memory address			
				Axis 1	Axis 2	Axis 3	Axis 4
Pr.42	External command function selection	2	Set the "2: speed-position and position-speed switching requests".	62	212	362	512
Cd.8	External command valid	1	Set "1: Validate external command".	1505	1605	1705	1805

\* Refer to Sections 5.2 "List of parameters" and Section 5.7 "List of control data" for information on the setting details.

■ Changing the speed control command speed

In "position-speed switching control", the speed control command speed can be changed during the position control.

- (1) The speed control command speed can be changed during the position control of position-speed switching control.  
A command speed change request will be ignored unless issued during the position control of the position-speed switching control.
- (2) The "new command speed" is stored in "Cd.25 Position-speed switching control speed change register" by the PLC program during position control. This value then becomes the speed control command speed when the position-speed switching signal turns ON.

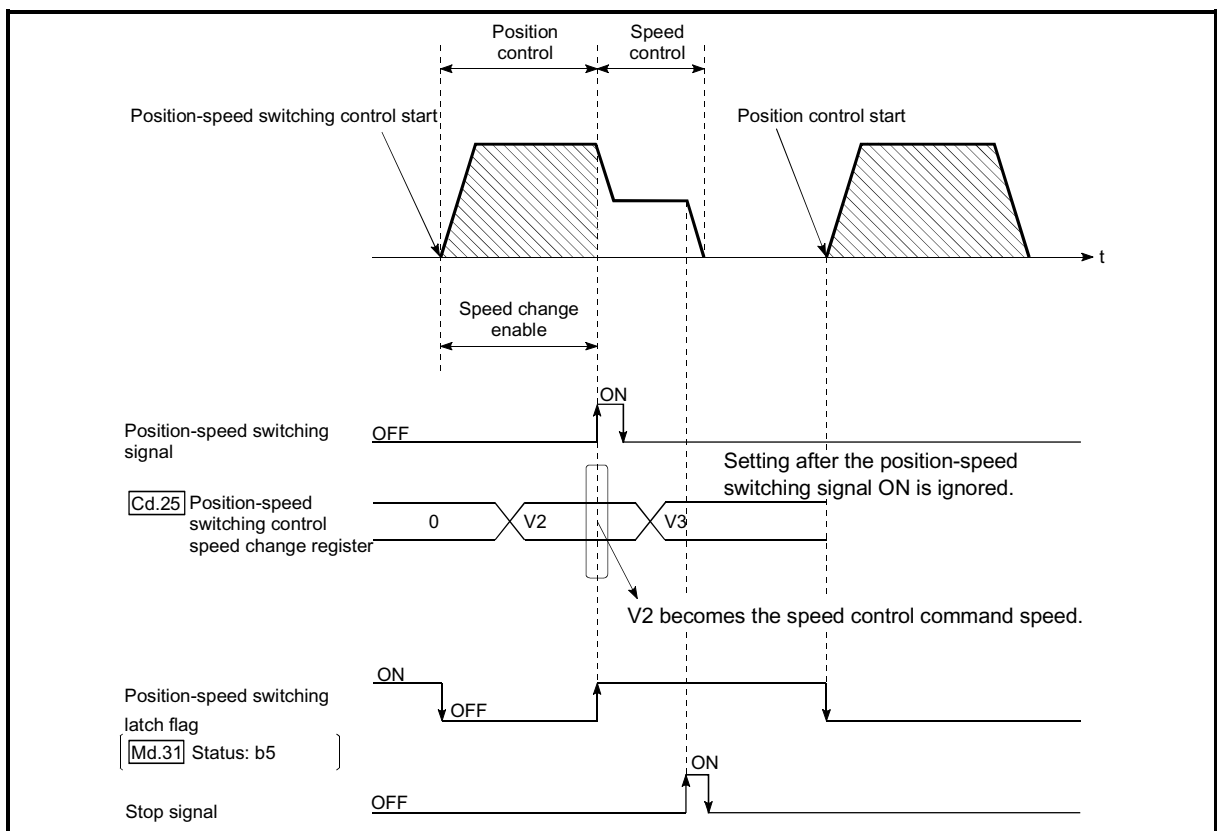


Fig. 9.20 Speed control speed change timing

## POINTS

- ⊘ The machine recognizes the presence of a command speed change request when the data is written to " [Cd.25] Position-speed switching control speed change register" with the PLC program.
- ⊘ The new command speed is validated after execution of the position-speed switching control before the input of the position-speed switching signal.
- ⊘ The command speed change can be enabled/disabled with the interlock function in speed control using the "position-speed switching latch flag" ( [Md.31] Status: b5) of the axis monitor area.

### ■ Restrictions

- (1) An axis error (error code: 516) will occur and the operation cannot start if "continuous positioning control" or "continuous path control" is set in " [Da.1] Operation pattern".
- (2) "Position-speed switching control" cannot be set in " [Da.2] Control system" of the positioning data when "continuous path control" has been set in " [Da.1] Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", "position-speed switching control" cannot be set in positioning data No. 2.) An axis error (error code: 516) will occur and the machine will carry out a deceleration stop if this type of setting is carried out.
- (3) The software stroke limit range is only checked during speed control if the "1: Update current feed value" is set in " [Pr.21] Current feed value during speed control".  
The software stroke limit range is not checked when the control unit is set to "degree".
- (4) An error (error code: 507 or 508) will occur and the operation cannot start if the start point address or end point address for position control exceeds the software stroke limit range.
- (5) Deceleration stop will be carried out if the position-speed switching signal is not input before the machine is moved by a specified movement amount.  
When the position-speed switching signal is input during automatic deceleration by positioning control, acceleration is carried out again to the command speed to continue speed control.  
When the position-speed switching signal is input during deceleration to a stop with the stop signal, the control is switched to the speed control to stop the machine.  
Restart is carried out by speed control using the restart command.
- (6) A warning (warning code: 501) will occur and control is continued by " [Pr.8] Speed limit value" if a new speed exceeds " [Pr.8] Speed limit value" at the time of change of the command speed.
- (7) If the value set in " [Da.6] Positioning address/movement amount" is negative, an error (error code: 530) will occur.

### ■ Positioning data setting examples

The following table shows setting examples when "position-speed switching control (forward run: position/speed)" is set in positioning data No. 1 of axis 1.

		Setting item	Setting example	Setting details
Axis 1 Positioning data No. 1	Da.1	Operation pattern	Positioning complete	Set "Positioning complete" assuming the next positioning data will not be executed. ("Continuous positioning control" and "Continuous path control" cannot be set in "position/speed changeover control".)
	Da.2	Control system	Forward run: position/speed	Set position-speed switching control.
	Da.3	Acceleration time No.	1	Designate the value set in " [Pr.25] Acceleration time 1" as the acceleration time at start.
	Da.4	Deceleration time No.	0	Designate the value set in " [Pr.10] Deceleration time 0" as the deceleration time at deceleration.
	Da.5	Axis to be interpolated	–	Setting not required. (Setting value is ignored.)
	Da.6	Positioning address/movement amount	10000.0σm	Set the movement amount at the time of position control before the switching to speed control. (Assuming that the " [Pr.1] Unit setting" is set to "mm".)
	Da.7	Arc address	–	Setting not required. (Setting value is ignored.)
	Da.8	Command speed	6000.00mm/min	Set the speed to be controlled.
	Da.9	Dwell time	500ms	Set the time the machine dwells after the positioning stop (pulse output stop) by position control to the output of the positioning complete signal. If the machine is stopped by speed control, the setting value will be ignored.
	Da.10	M code	10	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

## 9.2.19 Current value changing

When the current value is changed to a new value, control is carried out in which the "Md.20 Current feed value" of the stopped axis is changed to a random address set by the user. (The "Md.21 Machine feed value" is not changed when the current value is changed.)

The two methods for changing the current value are shown below.


- [1] Changing to a new current value using the positioning data
- [2] Changing to a new current value using the start No. (No. 9003) for a current value changing

The current value changing using method [1] is used during continuous positioning of multiple blocks, etc.

## [1] Changing to a new current value using the positioning data

## ■ Operation chart

The following chart shows the operation timing for a current value changing. The "Md.20 Current feed value" is changed to the value set in "Da.6 Positioning address/movement amount" when the positioning start signal turns ON.

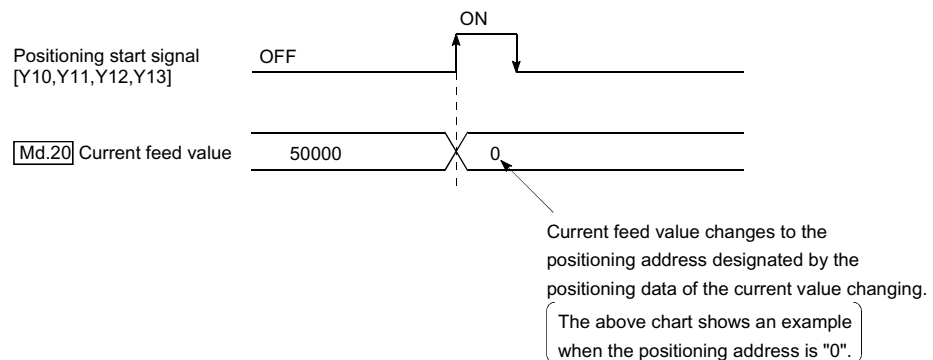

## ■ Restrictions

- (1) An axis error "New current value not possible (error code: 515)" will occur and the operation cannot start if "continuous path control" is set in "Da.1 Operation pattern". ("Continuous path control" cannot be set in current value changing.)
- (2) "Current value changing" cannot be set in "Da.2 Control system" of the positioning data when "continuous path control" has been set in "Da.1 Operation pattern" of the immediately prior positioning data. (For example, if the operation pattern of positioning data No. 1 is "continuous path control", "current value changing" cannot be set in positioning data No. 2.) An axis error "New current value invalid (error code: 515)" will occur and the machine will carry out a deceleration stop if this type of setting is carried out.
- (3) An axis error "Outside new current value range (error code: 514)" will occur and the operation cannot start if "degree" is set in "Pr.1 Unit setting" and the value set in "Da.6 Positioning address/movement amount (0 to 359.99999 [degree])" is outside the setting range.

- (4) If the value set in " [Da.6] Positioning address/movement amount" is outside the software stroke limit ( [Pr.12] , [Pr.13] ) setting range, an error "Software stroke limit +, - (error code: 507 or 508)" will occur at the positioning start, and the operation will not start.
- (5) An error (error code: 507 or 508) will occur if the new current value is outside the software stroke limit range.

■ Positioning data setting examples

The following table shows the setting examples when " current value changing" is set in the positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details	
Axis 1 positioning data No. 1	[Da.1]	Operation pattern	Positioning complete	Set "Positioning complete" assuming that the next positioning data will be executed. ("Continuous path control" cannot be set by current value change.)
	[Da.2]	Control system	Current value changing	Set the current value changing.
	[Da.3]	Acceleration time No.	-	Setting not required (Setting value is ignored.)
	[Da.4]	Deceleration time No.	-	Setting not required (Setting value is ignored.)
	[Da.5]	Axis to be interpolated	-	Setting not required (Setting value is ignored.)
	[Da.6]	Positioning address/movement amount	10000.0 μm	Set the address to which address change is desired. (Assuming that the " [Pr.1] Unit setting" is set to "mm".)
	[Da.7]	Arc address	-	Setting not required (Setting value is ignored.)
	[Da.8]	Command speed	-	Setting not required (Setting value is ignored.)
	[Da.9]	Dwell time	-	Setting not required (Setting value is ignored.)
	[Da.10]	M code	10	Set this when other sub operation commands are issued in combination with the No. 1 positioning data.


\* Refer to Section 5.3 "List of positioning data" for information on the setting details.



[2] Changing to a new current value using the start No. (No. 9003) for a current value changing

■ Operation chart

The current value is changed by setting the new current value in the current value changing buffer memory "Cd.9 Current value changing", setting "9003" in the "Cd.3 Positioning start No.", and turning ON the positioning start signal.

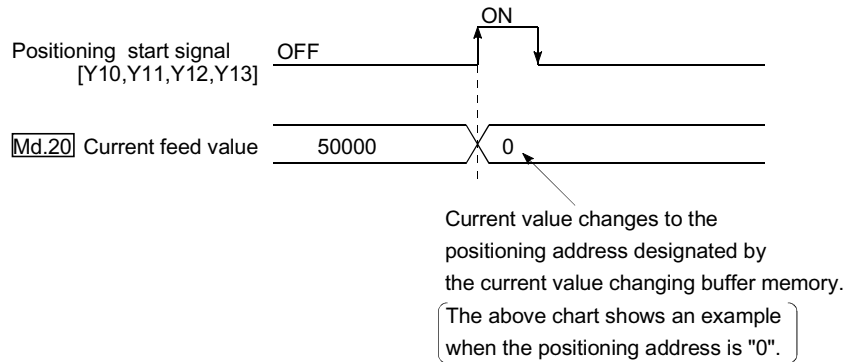


■ Restrictions

- (1) An axis error "Outside new current value range (error code: 514)" will occur if the designated value is outside the setting range when "degree" is set in "Unit setting".
- (2) An error "Software stroke limit +, - (error code: 507 or 508)" will occur if the designated value is outside the software stroke limit range.
- (3) The current value cannot be changed during stop commands and while the M code ON signal is ON.
- (4) The M code output function is made invalid.

■ Current value changing procedure

The following shows the procedure for changing the current value to a new value.

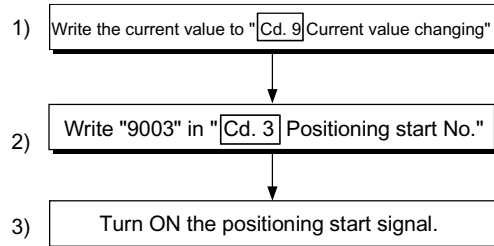

■ Setting method for the current value changing function

The following shows an example of a PLC program and data setting to change the current value to a new value with the positioning start signal. (The "Md.20" Current feed value is changed to "5000.0σm" in the example shown.)

- (1) Set the following data.  
(Set with the PLC program shown in (3), while referring to the start time chart shown in (2).)

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.3	Positioning start No.	9003	Set the start No. "9003" for the new current value.			
Cd.9	Current value changing	50000	Set the new "Md.20" Current feed value".			
			1500	1600	1700	1800
			1506	1606	1706	1806
			1507	1607	1707	1807

\* Refer to Section 5.7 "List of control data" for details on the setting details.

- (2) The following shows a start time chart.


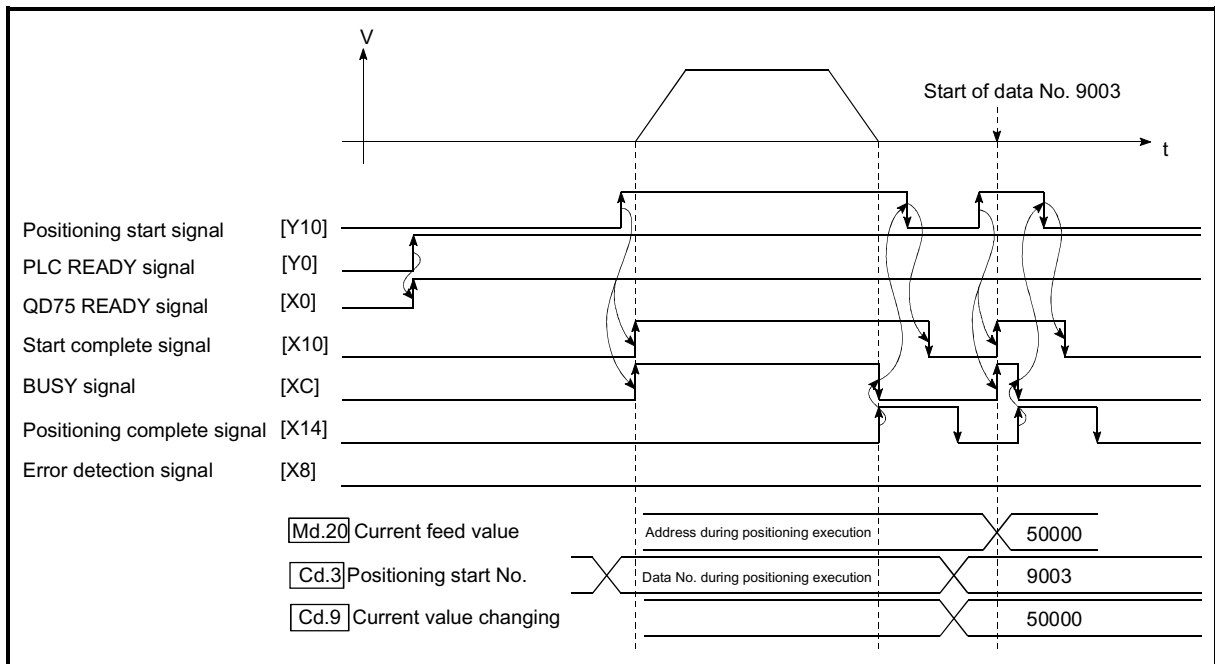


Fig. 9.21 Changing to a new current value using the start No. (No. 9003) for a current value changing

(3) Add the following PLC program to the control program, and write it to the PLC CPU.

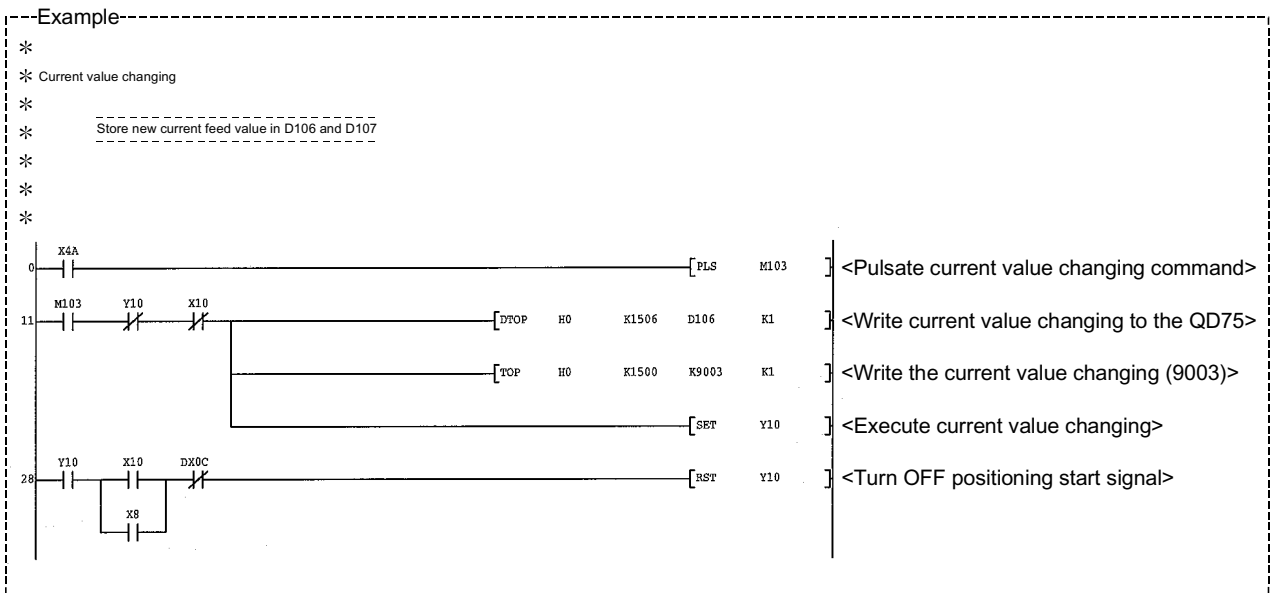

9.2.20 NOP instruction

The NOP instruction is used for the nonexecutable control system.

■ Operation

The positioning data No. to which the NOP instruction is set transfers, without any processing, to the operation for the next positioning data No.

■ Positioning data setting examples

The following table shows the setting examples when "NOP instruction" is set in positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details	
Axis 1 positioning data No. 1	Da.1	Operation pattern	-	Setting not required (Setting value is ignored.)
	Da.2	Control system	NOP instruction	Set the NOP instruction
	Da.3	Acceleration time No.	-	Setting not required (Setting value is ignored.)
	Da.4	Deceleration time No.	-	Setting not required (Setting value is ignored.)
	Da.5	Axis to be interpolated	-	Setting not required (Setting value is ignored.)
	Da.6	Positioning address/movement amount	-	Setting not required (Setting value is ignored.)
	Da.7	Arc address	-	Setting not required (Setting value is ignored.)
	Da.8	Command speed	-	Setting not required (Setting value is ignored.)
	Da.9	Dwell time	-	Setting not required (Setting value is ignored.)
	Da.10	M code	-	Setting not required (Setting value is ignored.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

■ Restrictions

An error "Control system setting error (error code: 524)" will occur if the "NOP instruction" is set for the control system of the positioning data No. 600.

<b>POINT</b>
<p>&lt;Use example of NOP instruction&gt;</p> <p>If there is a possibility of speed switching or temporary stop (automatic deceleration) at a point between two points during positioning, that data can be reserved with the NOP instruction to change the data merely by the replacement of the identifier.</p>

### 9.2.21 JUMP instruction

The JUMP instruction is used to control the operation so it jumps to a positioning data No. set in the positioning data during "continuous positioning control" or "continuous path control".

JUMP instruction include the following two types of JUMP.

- (1) Unconditional JUMP  
When no execution conditions are set for the JUMP instruction  
(When "0" is set as the condition data No.)
- (2) Conditional JUMP  
When execution conditions are set for the JUMP instruction  
(The conditions are set in the "condition data" used with "high-level positioning control".)

Using the JUMP instruction enables repeating of the same positioning control, or selection of positioning data by the execution conditions during "continuous positioning control" or "continuous path control".

#### ■ Operation

- (1) Unconditional JUMP  
The JUMP instruction is unconditionally executed. The operation jumps to the positioning data No. set in "Da.9 Dwell time".
- (2) Conditional JUMP  
The block start condition data is used as the JUMP instruction execution conditions.
  - € When block positioning data No. 7000 to 7004 is started:  
Each block condition data is used.
  - € When positioning data No. 1 to 600 is started:  
Start block 0 condition data is used.
  - € When the execution conditions set in "Da.10 M code" of the JUMP instruction have been established:  
the JUMP instruction is executed to jump the operation to the positioning data No. set in "Da.9 Dwell time".
  - € When the execution conditions set in "Da.10 M code" of the JUMP instruction have not been established:  
the JUMP instruction is ignored, and the next positioning data No. is executed.

#### ■ Restrictions

- (1) When using a conditional JUMP instruction, establish the JUMP instruction execution conditions by the 4th positioning data No. before the JUMP instruction positioning data No..  
If the JUMP instruction execution conditions are not established by the time the 4th positioning control is carried out before the JUMP instruction positioning data No., the operation will be processed as an operation without established JUMP instruction execution conditions.  
(During execution of continuous path control/continuous positioning control, the QD75 calculates the positioning data of the positioning data No. four items ahead of the current positioning data.)

- (2) The operation pattern, if set, is ignored in the JUMP instruction.
- (3) Use unconditional JUMP instructions when setting JUMP instructions at the end of continuous path control/continuous positioning control.  
When conditional JUMP instructions are set at the end of continuous path control/continuous positioning control, the positioning data of the next positioning data No. will be executed if the execution conditions have not been established.
- (4) Positioning control such as loops cannot be executed by conditional JUMP instructions alone until the conditions have been established.

■ Positioning data setting example

The following table shows setting examples when "JUMP instruction" is set in positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details	
Axis 1 Positioning data No. 1	Da.1	Operation pattern	–	Setting not required. (Setting value is ignored.)
	Da.2	Control system	JUMP instruction	Set the JUMP instruction.
	Da.3	Acceleration time No.	–	Setting not required. (Setting value is ignored.)
	Da.4	Deceleration time No.	–	Setting not required. (Setting value is ignored.)
	Da.5	Axis to be interpolated	–	Setting not required. (Setting value is ignored.)
	Da.6	Positioning address/movement amount	–	Setting not required. (Setting value is ignored.)
	Da.7	Arc address	–	Setting not required. (Setting value is ignored.)
	Da.8	Command speed	–	Setting not required. (Setting value is ignored.)
	Da.9	Dwell time	500	Set the positioning data No. 1 to 600 for the JUMP destination. (The positioning data No. of the JUMP instruction cannot be set. Setting its own positioning data No. will result in an error "Illegal data No." (error code: 502).)
	Da.10	M code	1	Set the JUMP instruction execution conditions with the condition data No. 0 : Unconditional JUMP 1 to 10 : Condition data No. ("Simultaneous start" condition data cannot be set.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

9.2.22 LOOP

The LOOP is used for loop control by the repetition of LOOP to LEND.

■ Operation

The LOOP to LEND loop is repeated by set repeat cycles.

■ Positioning data setting examples

The following table shows the setting examples when "LOOP" is set in positioning data No. 1 of axis 1.

Setting item		Setting example	Setting details	
Axis 1 Positioning data No. 1	Da.1	Operation pattern	–	Setting not required. (Setting value is ignored.)
	Da.2	Control system	LOOP	Set the LOOP.
	Da.3	Acceleration time No.	–	Setting not required. (Setting value is ignored.)
	Da.4	Deceleration time No.	–	Setting not required. (Setting value is ignored.)
	Da.5	Axis to be interpolated	–	Setting not required. (Setting value is ignored.)
	Da.6	Positioning address/ movement amount	–	Setting not required. (Setting value is ignored.)
	Da.7	Arc address	–	Setting not required. (Setting value is ignored.)
	Da.8	Command speed	–	Setting not required. (Setting value is ignored.)
	Da.9	Dwell time	–	Setting not required. (Setting value is ignored.)
	Da.10	M code	5	Set the LOOP to LEND repeat cycles.

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

■ Restrictions

- (1) An error "Control system LOOP setting error (error code: 545)" will occur if a "0" is set for the repeat cycles.
- (2) Even if LEND is absent after LOOP, no error will occur, but repeat processing will not be carried out.
- (3) Nesting is not allowed between LOOP-LEND's. If such setting is made, only the inner LOOP-LEND is processed repeatedly.

<b>POINT</b>
<p>The setting by this control system is easier than that by the special start "FOR loop" of "High-level Positioning Control" (refer to Chapter 10).</p> <p>&lt;Setting data&gt;</p> <ul style="list-style-type: none"> <li>• For special start: Positioning start data, special start data, condition data, and positioning data</li> <li>• For control system : Positioning data</li> </ul> <p>For the special start FOR to NEXT, the positioning data is required for each of FOR and NEXT points. For the control system, loop can be executed even only by one data.</p> <p>Also, nesting is enabled by using the control system LOOP to LEND in combination with the special start FOR to NEXT.</p> <p>However LOOP to LEND cannot be set across block. Always set LOOP to LEND so that the processing ends within one block.</p> <p>(For details of the "block", refer to Section 10.1 "Outline of high-level positioning control".)</p>

9.2.23 LEND

The LEND is used to return the operation to the top of the repeat (LOOP to LEND) loop.

■ Operation

When the repeat cycle designated by the LOOP becomes 0, the loop is terminated, and the next positioning data No. processing is started. (The operation pattern, if set to "Positioning complete", will be ignored.)

When the operation is stopped after the repeat operation is executed by designated cycles, the dummy positioning data (for example, incremental positioning without movement amount) is set next to LEND.

Positioning data No.	Operation pattern	Control system	Conditions	Operation
1	Continuous control	ABS2		Executed in the order of the positioning data No. 1 → 2 → 3 → 4 → 5 → 2 → 3 → 4 → 5 → 6. (The operation patterns of the positioning data Nos. 2 and 5 are ignored.)
2	Positioning complete	LOOP	Number of loop cycles: 2	
3	Continuous path control	ABS2		
4	Continuous control	ABS2		
5	Positioning complete	LEND		
6	Positioning complete	ABS2		

■ Positioning data setting examples

The following table shows the setting examples when "LEND" is set in positioning data No. 8 of axis 1.

Setting item		Setting example	Setting details	
Axis 1 Positioning data No. 8	Da.1	Operation pattern	–	Setting not required. (Setting value is ignored.)
	Da.2	Control system	LEND	Set the LEND.
	Da.3	Acceleration time No.	–	Setting not required. (Setting value is ignored.)
	Da.4	Deceleration time No.	–	Setting not required. (Setting value is ignored.)
	Da.5	Axis to be interpolated	–	Setting not required. (Setting value is ignored.)
	Da.6	Positioning address/movement amount	–	Setting not required. (Setting value is ignored.)
	Da.7	Arc address	–	Setting not required. (Setting value is ignored.)
	Da.8	Command speed	–	Setting not required. (Setting value is ignored.)
	Da.9	Dwell time	–	Setting not required. (Setting value is ignored.)
	Da.10	M code	–	Setting not required. (Setting value is ignored.)

\* Refer to Section 5.3 "List of positioning data" for information on the setting details.

■ Restrictions

- (1) Ignore the "LEND" before the "LOOP" is executed.





# Chapter 10 High-Level Positioning Control

The details and usage of high-level positioning control (control functions using the "block start data") are explained in this chapter.

High-level positioning control is used to carry out applied control using the "positioning data". Examples of applied control are using conditional judgment to control "positioning data" set with the major positioning control, or simultaneously starting "positioning data" for several different axes.

Read the execution procedures and settings for each control, and set as required.

10.1	Outline of high-level positioning control .....	10- 2
10.1.1	Data required for high-level positioning control.....	10- 3
10.1.2	"Block start data" and "condition data" configuration .....	10- 4
10.2	High-level positioning control execution procedure .....	10- 6
10.3	Setting the block start data .....	10- 7
10.3.1	Relation between various controls and block start data .....	10- 7
10.3.2	Block start (normal start) .....	10- 8
10.3.3	Condition start .....	10- 10
10.3.4	Wait start .....	10- 11
10.3.5	Simultaneous start .....	10- 12
10.3.6	Repeated start (FOR loop) .....	10- 13
10.3.7	Repeated start (FOR condition) .....	10- 14
10.3.8	Restrictions when using the NEXT start.....	10- 15
10.4	Setting the condition data .....	10- 16
10.4.1	Relation between various controls and the condition data .....	10- 16
10.4.2	Condition data setting examples .....	10- 19
10.5	Multiple axes simultaneous start control.....	10- 20
10.6	Start program for high-level positioning control .....	10- 23
10.6.1	Starting high-level positioning control.....	10- 23
10.6.2	Example of a start program for high-level positioning control .....	10- 24

### 10.1 Outline of high-level positioning control

In "high-level positioning control" the execution order and execution conditions of the "positioning data" are set to carry out more applied positioning. (The execution order and execution conditions are set in the "block start data" and "condition data".)  
The following applied positioning controls can be carried out with "high-level positioning control".

High-level positioning control	Details
Block *1 start (Normal start)	With one start, executes the positioning data in a random block with the set order.
Condition start	Carries out condition judgment set in the "condition data" for the designated positioning data, and then executes the "block start data". <ul style="list-style-type: none"> <li>• When the condition is established, the " block start data" is executed.</li> <li>• When not established, that " block start data" is ignored, and the next point's " block start data" is executed.</li> </ul>
Wait start	Carries out condition judgment set in the "condition data" for the designated positioning data, and then executes the " block start data". <ul style="list-style-type: none"> <li>• When the condition is established, the " block start data" is executed.</li> <li>• When not established, stops the control until the condition is established. (Waits.)</li> </ul>
Simultaneous start *2	Simultaneously executes the positioning data having the No. for the axis designated with the "condition data". (Outputs pulses at the same timing.)
Repeated start (FOR loop)	Repeats the program from the " block start data" set with the "FOR loop" to the " block start data" set in "NEXT" for the designated No. of times.
Repeated start (FOR condition)	Repeats the program from the " block start data" set with the "FOR condition" to the " block start data" set in "NEXT" until the conditions set in the "condition data" are established.

#### ■ High-level positioning control sub functions

"High-level positioning control" uses the "positioning data" set with the "major positioning control". Refer to Section 3.2.4 "Combination of QD75 main functions and sub functions" for details on sub functions that can be combined with the major positioning control.

Note that the sub function Section 12.7.8 "Pre-reading start function" cannot be used together with "high-level positioning control".

#### ■ High-level positioning control from peripheral devices

"High-level positioning control" (start of the "block start data") can be executed from GX Configurator-QP test mode.

Refer to GX Configurator-QP Operating Manual for details on starting of the "block start data" from GX Configurator-QP.

#### REMARK

Block \*1:

"1 block" is defined as all the data continuing from the positioning data in which "continuous positioning control" or "continuous path control" is set in the operation pattern ( Da.1 ) to the positioning data in which "independent positioning control (Positioning complete)" is set.

Simultaneous start \*2:

Besides the simultaneous start of "block start data" system, the "simultaneous starts" include the "multiple axes simultaneous start control" of control system. Refer to Section 10.5 "Multiple axis simultaneous start control" for details.

10.1.1 Data required for high-level positioning control

"High-level positioning control" is executed by setting the required items in the "block start data" and "condition data", then starting that "block start data". Judgment about whether execution is possible, etc., is carried out at execution using the "condition data" designated in the "block start data".

"Block start data" can be set for each No. from 7000 to 7004 (called "block Nos."), and up to 50 points can be set for each axis. (This data is controlled with Nos. called "points" to distinguish it from the positioning data. For example, the 1st block start data item is called the "1st point block start data" or "point No. 1 block start data".)

"Condition data" can be set for each No. from 7000 to 7004 (called "block Nos."), and up to 10 data items can be set for each axis.

The "block start data" and "condition data" are set as 1 set for each block No.


The following table shows an outline of the "block start data" and "condition data" stored in the QD75.

Setting item		Setting details	
Block start data	Da.11	Shape	Set whether to end the control after executing only the "block start data" of the shape itself, or continue executing the "block start data" set in the next point.
	Da.12	Start data No.	Set the "positioning data No." to be executed.
	Da.13	Special start instruction	Set the method by which the positioning data set in Da.12 will be started.
	Da.14	Parameter	Set the conditions by which the start will be executed according to the commands set in Da.13. (Designate the "condition data No." and "No. of repetitions".)


Setting item		Setting details	
Condition data	Da.15	Condition target	Designate the "device", "buffer memory storage details", and "positioning data No." elements for which the conditions are set.
	Da.16	Condition operator	Set the judgment method carried out for the target set in Da.15.
	Da.17	Address	Set the buffer memory address in which condition judgment is carried out (only when the details set in Da.15 are "buffer memory storage details").
	Da.18	Parameter 1	Set the required conditions according to the details set in Da.15 and Da.16.
	Da.19	Parameter 2	Set the required conditions according to the details set in Da.15 and Da.16.

10.1.2 "Block start data" and "condition data" configuration

The "block start data" and "condition data" corresponding to "block No. 7000" can be stored in the buffer memory. (The following drawing shows an example for axis 1.)

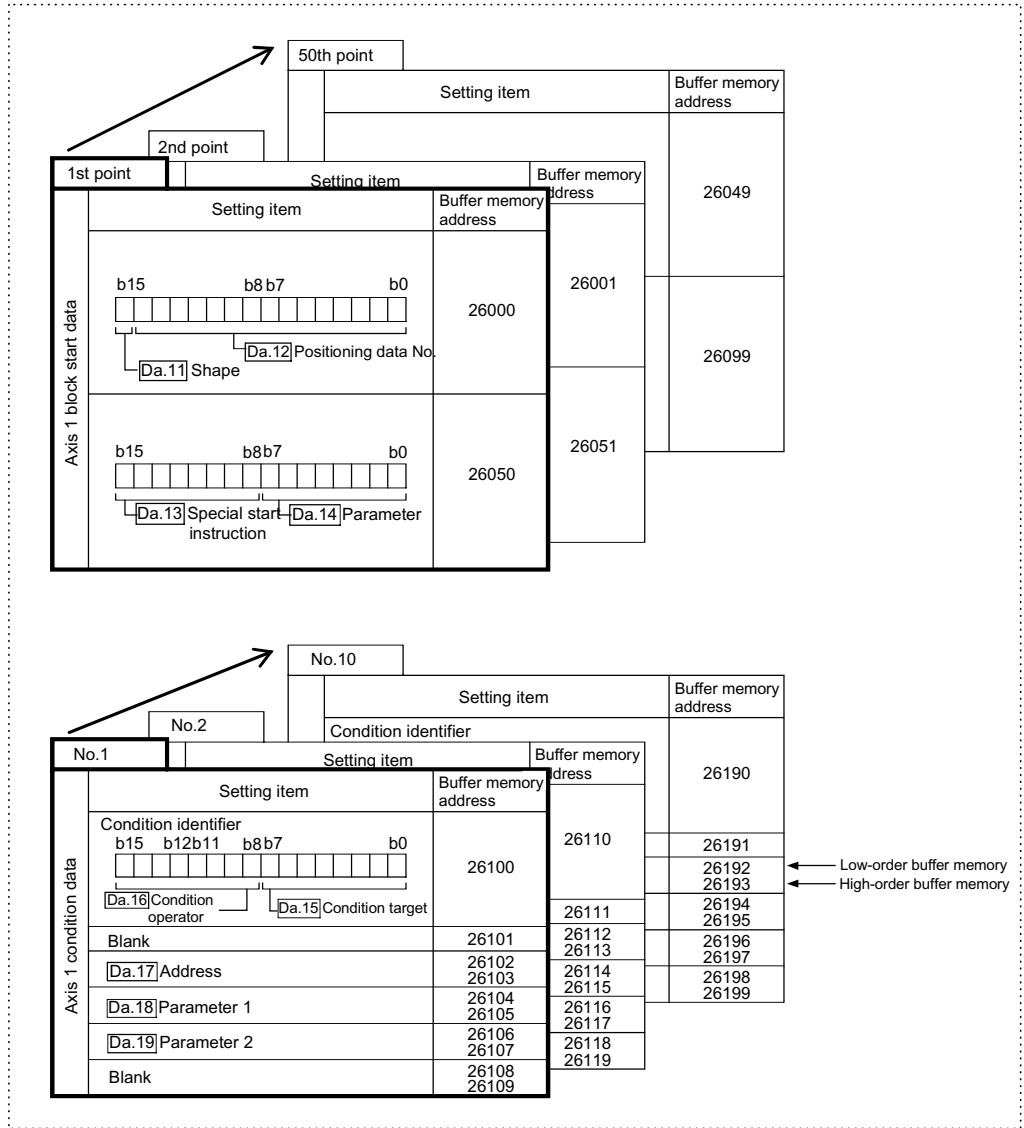


(Same for axis 2, axis 3 and axis 4.)

 


\* Set in the QD75 with a PLC program or GX Configurator-QP.

Set in QD75 the "block start data" and "condition data" corresponding to the following "block Nos. 7001 to 7004" using GX Configurator-QP or the PLC program. (The following drawing shows an example for axis 1.)

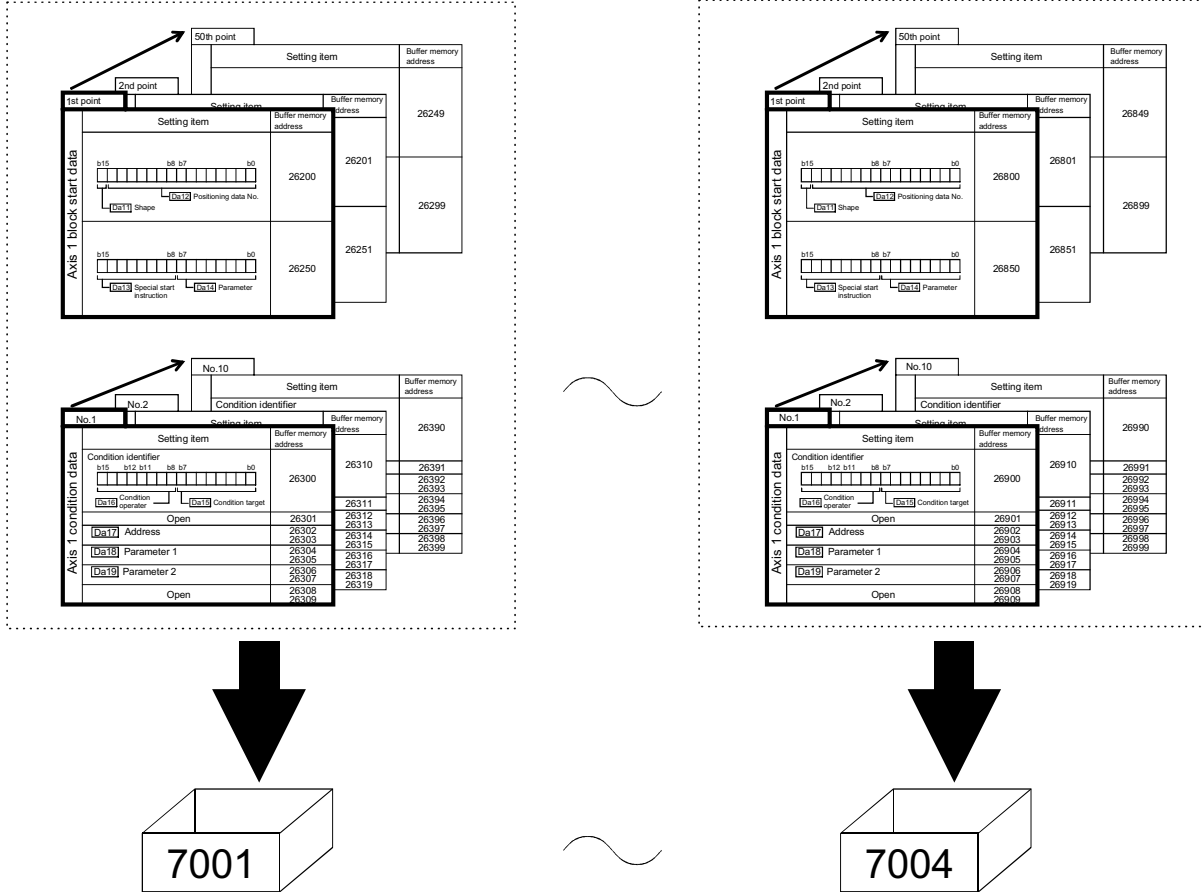

10.2 High-level positioning control execution procedure

High-level positioning control is carried out using the following procedure.

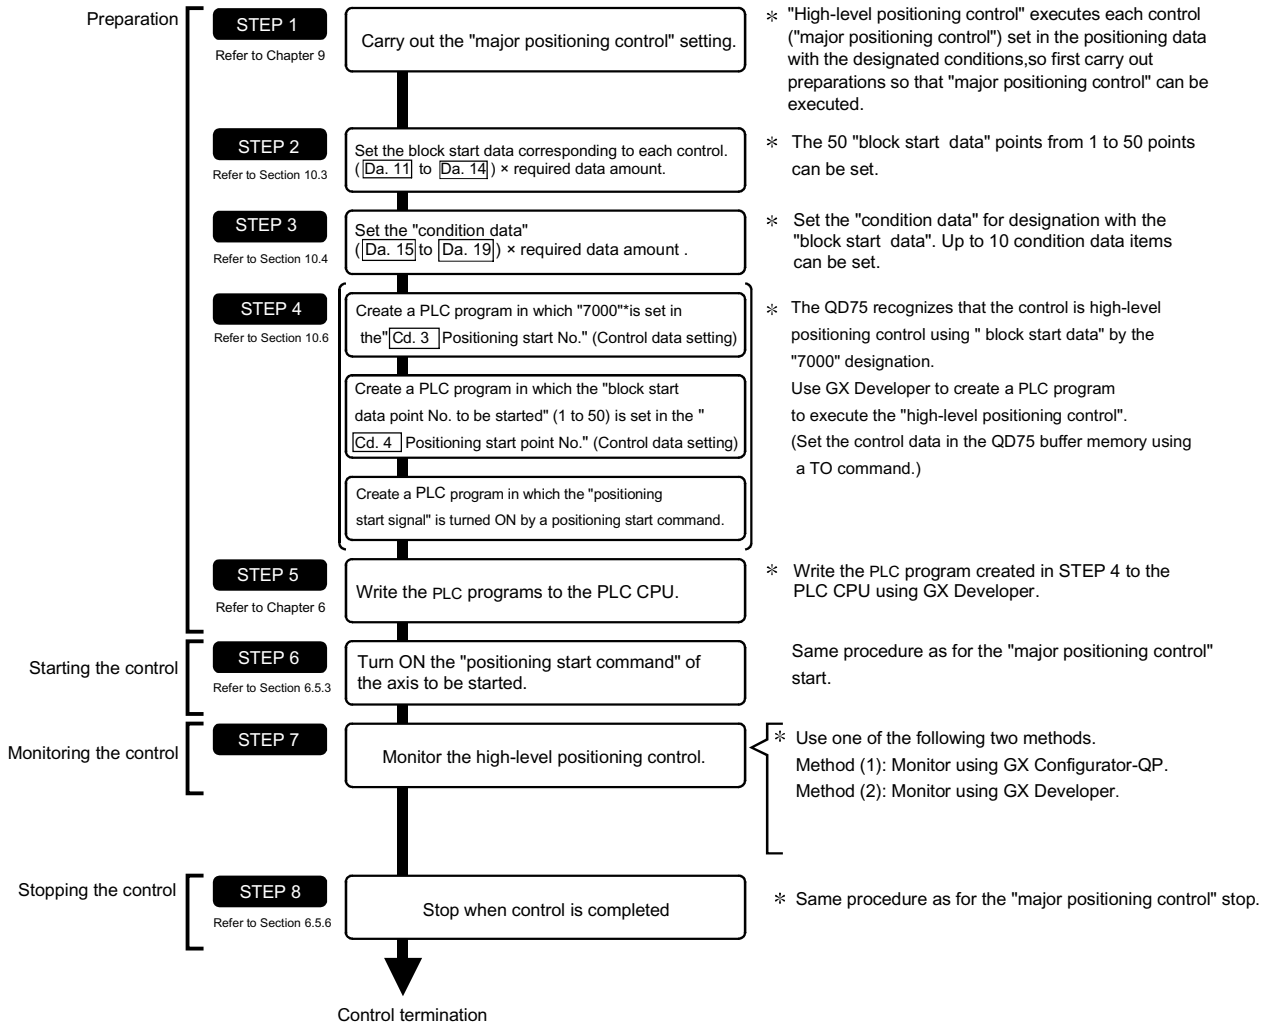

**REMARK**

- \* (1) Five sets of "block start data (50 points)" and "condition data (10 items)" corresponding to "7000" to "7004" are set with a PLC program.
- (2) Five sets of data from "7000" to "7004" can be set when GX Configurator-QP is used. If GX Configurator-QP is used to set the "block start data" and "condition data" corresponding to "7001" to "7004" and write the data to the QD75, "7001" to "7004" can be set in "Cd.3 Positioning start No." in STEP 4.

10.3 Setting the block start data

10.3.1 Relation between various controls and block start data

The "block start data" must be set to carry out "high-level positioning control". The setting requirements and details of each "block start data" item to be set differ according to the "Da.13 Special start instruction" setting.

The following shows the "block start data" setting items corresponding to various control systems. The operation details of each control type are explained starting in section 10.3.2. Also refer to section "10.4 Setting the condition data" for details on "condition data" with which control execution is judged.

(The "block start data" settings in this chapter are assumed to be carried out using GX Configurator-QP.)

High-level positioning control		Block start (Normal start)	Condition start	Wait start	Simultaneous start	Repeated start (FOR loop)	Repeated start (FOR condition)	NEXT start *
Da.11	Shape	0 : End	◎	◎	◎	×	×	◎
		1 : Continue	◎	◎	◎	◎	◎	◎
Da.12	Start data No.	1 to 600						
Da.13	Special start instruction	0	1	2	3	4	5	6
Da.14	Parameter	–	Condition data No.			No. of repetitions	Condition data No.	–

- ◎ : One of the two setting items must be set.
- : Set when required (Set to "–" when not used.)
- × : Setting not possible
- : Setting not required (Setting value will be ignored. Use the initial value or a value within the setting range.)

\* The "NEXT start" instruction is used in combination with "repeated start (FOR loop)" and "repeated start (FOR condition)". Control using only the "NEXT start" will not be carried out.

**REMARK**

It is recommended that the "block start data" be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.



10.3.2 Block start (normal start)

In a "block start (normal start)", the positioning data groups of a block are continuously executed in a set PLC starting from the positioning data set in "[Da.12] Start data No." by one start.

Section [2] shows a control example where the " block start data" and "positioning data" are set as shown in section [1].

[1] Setting examples

(1) Block start data setting example

Axis 1 block start data	[Da.11] Shape	[Da.12] Start data No.	[Da.13] Special start instruction	[Da.14] Parameter
1st point	1: Continue	1	0: Block start	—
2nd point	1: Continue	2	0: Block start	—
3rd point	1: Continue	5	0: Block start	—
4th point	1: Continue	10	0: Block start	—
5th point	0: End	15	0: Block start	—
∅				
∅				

(2) Positioning data setting example

Axis 1 positioning data No.	[Da.1] Operation pattern	
1	00: Positioning complete	} 1 block *
2	11: Continuous path control	
3	01: Continuous positioning control	
4	00: Positioning complete	
5	11: Continuous path control	} 1 block
6	00: Positioning complete	
∅		
10	00: Positioning complete	
∅		
15	00: Positioning complete	
∅		

**REMARK**

Block \* :

"1 block" is defined as all the data continuing from the positioning data in which "continuous positioning control" or "continuous path control" is set in the operation pattern ([Da.1]) to the positioning data in which "independent positioning control (Positioning complete)" is set.

[2] Control examples

The following shows the control executed when the "block start data" of the 1st point of axis 1 is set as shown in section [1] and started.

<1> The positioning data is executed in the following order before stopping.  
 Axis 1 positioning data No. 1 → 2 → 3 → 4 → 5 → 6 → 10 → 15.

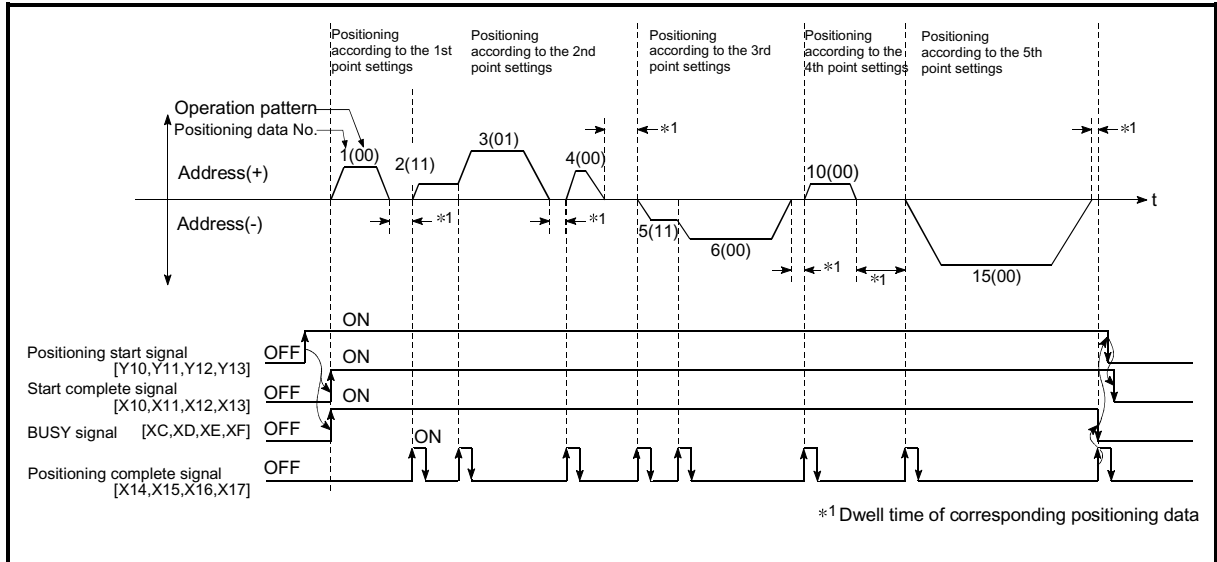


Fig. 10.1 Block start control example

10.3.3 Condition start

In a "condition start", the "condition data" conditional judgment designated in "Da.14 Parameter" is carried out for the positioning data set in "Da.12 Start data No.". If the conditions have been established, the "block start data" set in "1: condition start" is executed. If the conditions have not been established, that "block start data" will be ignored, and the "block start data" of the next point will be executed.

Section [2] shows a control example where the "block start data" and "positioning data" are set as shown in section [1].

[1] Setting examples

(1) Block start data setting example

Axis 1 block start data	Da.11 Shape	Da.12 Start data No.	Da.13 Special start instruction	Da.14 Parameter
1st point	1: Continue	1	1: Condition start	1
2nd point	1: Continue	10	1: Condition start	2
3rd point	0: End	50	0: Block start	-
€				
€				

\* The "condition data Nos." have been set in "Da.14 Parameter".

(2) Positioning data setting example

Axis 1 positioning data No.	Da.1 Operation pattern
1	01: Continuous positioning control
2	01: Continuous positioning control
3	00: Positioning complete
€	
10	11: Continuous path control
11	11: Continuous path control
12	00: Positioning complete
€	
50	00: Positioning complete
€	

[2] Control examples

The following shows the control executed when the "block start data" of the 1st point of axis 1 is set as shown in section [1] and started.

- <1> The conditional judgment set in "condition data No. 1" is carried out before execution of the axis 1 "positioning data No. 1".
  - Conditions established → Execute positioning data No. 1, 2, and 3 → Go to <2>.
  - Conditions not established → Go to <2>.
- <2> The conditional judgment set in "condition data No. 2" is carried out before execution of the axis 1 "positioning data No. 10".
  - Conditions established → Execute positioning data No. 10, 11, and 12 → Go to <3>.
  - Conditions not established → Go to <3>.
- <3> Execute axis 1 "positioning data No. 50" and stop the control.

## 10.3.4 Wait start

In a "wait start", the "condition data" conditional judgment designated in "[Da.14] Parameter" is carried out for the positioning data set in "[Da.12] Start data No.". If the conditions have been established, the "block start data" is executed. If the conditions have not been established, the control stops (waits) until the conditions are established.

Section [2] shows a control example where the "block start data" and "positioning data" are set as shown in section [1].

## [1] Setting examples

## (1) Block start data setting example

Axis 1 block start data	[Da.11] Shape	[Da.12] Start data No.	[Da.13] Special start instruction	[Da.14] Parameter
1st point	1: Continue	1	2: Wait start	3
2nd point	1: Continue	10	0: Block start	–
3rd point	0: End	50	0: Block start	–
∅				
∅				

\* The "condition data Nos." have been set in "[Da.14] Parameter".

## (2) Positioning data setting example

Axis 1 positioning data No.	[Da.1] Operation pattern
1	01: Continuous positioning control
2	01: Continuous positioning control
3	00: Positioning complete
∅	
10	11: Continuous path control
11	11: Continuous path control
12	00: Positioning complete
∅	
50	00: Positioning complete
∅	

## [2] Control examples

The following shows the control executed when the "block start data" of the 1st point of axis 1 is set as shown in section [1] and started.

<1> The conditional judgment set in "condition data No. 3" is carried out before execution of the axis 1 "positioning data No. 1".

→ Conditions established → Execute positioning data No. 1, 2, and 3 → Go to <2>.

→ Conditions not established → Control stops (waits) until conditions are established → Go to <1>.

<2> Execute the axis 1 "positioning data No. 10, 11, 12, and 50" and stop the control.

10.3.5 Simultaneous start

In a "simultaneous start", the positioning data set in the "[Da.12] Start data No." and positioning data of other axes set in the "condition data" are simultaneously executed (pulses are output with the same timing).

(The "condition data" is designated with "[Da.14] Parameter".)

Section [2] shows a control example where the "block start data" and "positioning data" are set as shown in section [1].

[1] Setting examples

(1) Block start data setting example

Axis 1 block start data	[Da.11] Shape	[Da.12] Start data No.	[Da.13] Special start instruction	[Da.14] Parameter
1st point	1: Continue	1	3: Simultaneous start	4
2nd point	1: Continue	10	3: Simultaneous start	5
3rd point	0: End	50	3: Simultaneous start	6
∅				
∅				

\* It is assumed that the "axis 2 positioning data" for simultaneous starting is set in the "condition data" designated with "[Da.14] Parameter".

(2) Positioning data setting example

Axis 1 position- ing data No.	[Da.1] Operation pattern
1	01: Continuous positioning control
2	01: Continuous positioning control
3	00: Positioning complete
∅	
10	11: Continuous path control
11	11: Continuous path control
12	00: Positioning complete
∅	
50	00: Positioning complete
∅	

[2] Control examples

The following shows the control executed when the "block start data" of the 1st point of axis 1 is set as shown in section [1] and started.

- <1> Simultaneously start the axis 1 "positioning data No. 1" and axis 2 positioning data set in "condition data No. 4". After the execution of axis 1 "positioning data No. 1, 2, and 3" is completed, go to <2>.
- <2> Simultaneously start the axis 1 "positioning data No. 10" and axis 2 positioning data set in "condition data No. 5".
  - Standing by after completion of axis 2 positioning data simultaneously started in <1>. → Go to <3>.
  - Executing axis 2 positioning data simultaneously started in <1>. → "Error".
- <3> Simultaneously start the axis 1 "positioning data No. 50" and the axis 2 positioning data set in "condition data No. 6" after the completion of the execution of axis 1 "positioning data No. 10, 11, and 12".
  - Standing by after completion of axis 2 positioning data simultaneously started in <2>. → Go to <4>.
  - Executing axis 2 positioning data simultaneously started in <2>. → "Error".
- <4> After the execution of the axis 1 "positioning data No. 50" is completed, stop the control.

10.3.6 Repeated start (FOR loop)

In a "repeated start (FOR loop)", the data between the " block start data" in which "4: FOR loop" is set in " Da.13 Special start instruction" and the "block start data" in which "6: NEXT start" is set in " Da.13 Special start instruction " is repeatedly executed for the No. of times set in " Da.14 Parameter". An endless loop will result if the No. of repetitions is set to "0".

(The No. of repetitions is set in " Da.14 Parameter" of the " block start data" in which "4: FOR loop" is set in " Da.13 Special start instruction".)

Section [2] shows a control example where the " block start data" and "positioning data" are set as shown in section [1].

[1] Setting examples

(1) Block start data setting example

Axis 1 block start data	Da.11 Shape	Da.12 Start data No.	Da.13 Special start instruction	Da.14 Parameter
1st point	1: Continue	1	4: FOR loop	2
2nd point	1: Continue	10	0: Block start	–
3rd point	0: End	50	6: NEXT start	–
€				
€				

\* The "condition data Nos." have been set in " Da.14 Parameter".

(2) Positioning data setting example

Axis 1 position- ing data No.	Da.1 Operation pattern
1	01: Continuous positioning control
2	01: Continuous positioning control
3	00: Positioning complete
€	
10	11: Continuous path control
11	00: Positioning complete
€	
50	01: Continuous positioning control
51	00: Positioning complete
€	

[2] Control examples

The following shows the control executed when the " block start data" of the 1st point of axis 1 is set as shown in section [1] and started.

<1> Execute the axis 1 "positioning data No. 1, 2, 3, 10, 11, 50, and 51".

<2> Return to the axis 1 "1st point block start data". Again execute the axis 1 "positioning data No. 1, 2, 3, 10, 11, 50 and 51", and then stop the control.

(Repeat for the No. of times (2 times) set in Da.14 .)

10.3.7 Repeated start (FOR condition)

In a "repeated start (FOR condition)", the data between the " block start data" in which "5: FOR condition" is set in "[Da.13] Special start instruction" and the " block start data" in which "6: NEXT start" is set in "[Da.13] Special start instruction" is repeatedly executed until the establishment of the conditions set in the "condition data". (The "condition data" designation is set in "[Da.14] Parameter" of the " block start data" in which "5: FOR condition" is set in "[Da.13] Special start instruction".)

Section [2] shows a control example where the " block start data" and "positioning data" are set as shown in section [1].

[1] Setting examples

(1) Block start data setting example

Axis 1 block start data	[Da.11] Shape	[Da.12] Start data No.	[Da.13] Special start instruction	[Da.14] Parameter
1st point	1: Continue	1	5: FOR condition	5
2nd point	1: Continue	10	0: Block start	—
3rd point	0: End	50	6: NEXT start	—
€				
€				

\* The "condition data Nos." have been set in "[Da.14] Parameter".

(2) Positioning data setting example

Axis 1 position- ing data No.	[Da.1] Operation pattern
1	01: Continuous positioning control
2	01: Continuous positioning control
3	00: Positioning complete
€	
10	11: Continuous path control
11	00: Positioning complete
€	
50	01: Continuous positioning control
51	00: Positioning complete
€	

[2] Control examples

The following shows the control executed when the " block start data" of the 1st point of axis 1 is set as shown in section [1] and started.

- <1> Carry out the conditional judgment set in "condition data No. 5" for the axis 1 "positioning data No. 1".
  - Conditions not established → Go to <2>.
  - Conditions established → Go to <3>.
- <2> Execute axis 1 "positioning data No. 1, 2, 3, 10, 11, 50, and 51", then go to <1>.
- <3> Execute axis 1 "positioning data No. 1, 2, 3, 10, 11, 50, and 51", then stop the control.

10.3.8 Restrictions when using the NEXT start

The "NEXT start" is a instruction indicating the end of the repetitions when executing Section 10.3.6 "Repeated start (FOR loop)" and Section 10.3.7 "Repeated start (FOR condition)".

The following shows the restrictions when setting "6: NEXT start" in the " block start data".

- (1) The processing when "6: NEXT start" is set before execution of "4: FOR loop" or "5: FOR condition" is the same as that for a "0: block start".
- (2) Repeated processing will not be carried out if there is no "6: NEXT start" instruction after the "4: FOR loop" or "5: FOR condition" instruction. (Note that an "error" will not occur.)
- (3) Nesting is not possible between "4: FOR loop" and "6: NEXT start", or between "5: FOR condition" and "6: NEXT start". A warning "FOR to NEXT nest construction (warning code: 506)" will occur if nesting is attempted.

Block start data	Da.13 Special start instruction
1st point	Block start
2nd point	FOR
3rd point	Block start
4th point	FOR
5th point	Block start
6th point	Block start
7th point	NEXT
8th point	Block start
9th point	NEXT
∅	
∅	

The JUMP destination of the NEXT designated with points 7 and 9 is the FOR of point 4. A warning will occur if the NEXT designated with point 9 is executed.



10.4 Setting the condition data

10.4.1 Relation between various controls and the condition data

"Condition data" is set in the following cases.

- (1) When setting conditions during execution of Section 9.2.21 "JUMP instruction" (major positioning control)
- (2) When setting conditions during execution of "high-level positioning control"

The "condition data" to be set includes the 5 setting items from [Da.15] to [Da.19], but the setting requirements and details differ according to the control system and setting conditions.

The following shows the "condition data [Da.15] Condition target" corresponding to the different types of control.

(The "condition data" settings in this chapter are assumed to be carried out using GX Configurator-QP.)

Control type Setting item	High-level positioning control				Major positioning control
	Block start	Wait start	Simultaneous start	Repeated start (For condition)	JUMP instruction
01: Device X	⊙	⊙	×	⊙	⊙
02: Device Y	⊙	⊙	×	⊙	⊙
03: Buffer memory (1 word)	⊙	⊙	×	⊙	⊙
04: Buffer memory (2 words)	⊙	⊙	×	⊙	⊙
05: Positioning data No.	×	×	⊙	×	×

⊙ : One of the setting items must be set.

× : Setting not possible

**REMARK**

It is recommended that the "condition data" be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

The setting requirements and details of the following "condition data" "Da.16" to "Da.19" setting items differ according to the "Da.15 Condition target" setting.

The following shows the "Da.16" to "Da.19" setting items corresponding to the "Da.15 Condition target".

Other setting item Da.15 Setting item	Da.16 Condition operator	Da.17 Address	Da.18 Parameter 1		Da.19 Parameter 2	
01H: Device X	07H: DEV=ON	-	0 to 1FH (bit No.)		-	
02H: Device Y	08H: DEV=OFF		0 to 1FH (bit No.)			
03H: Buffer memory (1 word)	01H: **=P1 02H: **IP1	Buffer memory address	P1 (numeric value)		P2 (numeric value) (Set only when "Da.16" is [05H] or [06H].)	
04H: Buffer memory (2 words)	03H: **OP1 04H: **OP1 05H: P1C.**OP2 06H: **OP1, P2C.**					
05H: Positioning data No.	10H: Axis 1 designation	-	Low-order 16 bits	Axis 1 positioning data No.	Low-order 16 bits	Axis 3 positioning data No.
	20H: Axis 2 designation					
	30H: Axis 1 and axis 2 designation					
	40H: Axis 3 designation					
	50H: Axis 1 and axis 3 designation					
	60H: Axis 2 and axis 3 designation		High-order 16 bits	Axis 2 positioning data No.	High-order 16 bits	Axis 4 positioning data No.
	70H: Axis 1, axis 2 and axis 3 designation					
	80H: Axis 4 designation					
	90H: Axis 1 and axis 4 designation					
	A0H: Axis 2 and axis 4 designation					
B0H: Axis 1, axis 2 and axis 4 designation						
C0H: Axis 3 and axis 4 designation						
D0H: Axis 1, axis 3 and axis 4 designation						
E0H: Axis 2, axis 3 and axis 4 designation						

- : Setting not required (Setting value will be ignored. Use the initial value or a value within the setting range.)


\*\* : Value stored in buffer memory designated in Da.17.

\* : Refer to Section 5.5 "List of condition data" for the setting contents.

Judgment whether the condition operator is "=" or "≠" at the start of wait.  
Judgment on data is carried out for each control cycle of the QD75. Thus, in the judgment on the data such as current feed value which varies continuously, the operator "=" may not be detected. If this occurs, use a range operator.

**REMARK**

The "PLC CPU memo area" can be designated as the buffer memory address to be designated in Da.17 . (Refer to Section 7.1.1 "Configuration and roles of QD75 memory".)

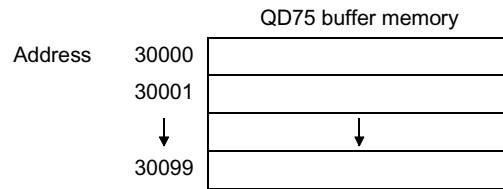

10.4.2 Condition data setting examples

The following shows setting examples for "condition data".

(1) Setting the device ON/OFF as a condition

[Condition] Device "X0" (=QD75 READY) is OFF

Da.15 Condition target	Da.16 Condition operator	Da.17 Address	Da.18 Parameter 1	Da.19 Parameter 2
01H: Device X	08H: DEV=OFF	-	0	-

(2) Setting the numeric value stored in the "buffer memory" as a condition

[Condition]

The value stored in buffer memory addresses "800, 801" (= "Md.20 Current feed value") is "1000" or larger.

Da.15 Condition target	Da.16 Condition operator	Da.17 Address	Da.18 Parameter 1	Da.19 Parameter 2
04H: Buffer memory (2 words)	04H: * * ØP1	800	1000	-

(3) Designating the axis and positioning data No. to be simultaneously started in "simultaneous start"

[Condition]

Simultaneously starting "axis 2 positioning data No.3".

Da.15 Condition target	Da.16 Condition operator	Da.17 Address	Da.18 Parameter 1	Da.19 Parameter 2
05H: Positioning data No.	20H: Axis 2 designation	-	High-order 16 bits "0003H"	-

## 10.5 Multiple axes simultaneous start control

The "multiple axes simultaneous start control" starts and controls the multiple axes simultaneously by outputting pulses to the axis to be started at the same timing as the start axis.

The maximum of four axes can be started simultaneously.

### [1] Control details


The multiple axes simultaneous start control is carried out by setting the simultaneous start an object axis start data No. (positioning data No. to start simultaneously for each axis) to the multiple axes simultaneous start control buffer memory "[Cd.30] to [Cd.33] Simultaneously starting axis start data No. (1 to 4 axis start data No.)" of the axis control data, and the "9004" to "[Cd.3] positioning start No." of the start axis, and then turning ON the positioning start signal.

### [2] Restrictions

- (1) An error will occur and all simultaneously started axes will not start (error code: 501) if the simultaneously started axis start data No. is not set to the axis control data on the start axis or set outside the setting range.
- (2) An error will occur and all simultaneously started axes will not start (error code: 501) if either of the simultaneously started axes is BUSY.
- (3) An error will occur and all simultaneously started axes will not start (error code: 501) if an error occurs during the analysis of the positioning data on the simultaneously started axes.
- (4) No error or warning will occur if only the start axis is the simultaneously started axis.
- (5) This function cannot be used with the sub function Section 12.7.8 "Pre-reading start function".

### [3] Multiple axes simultaneous start control procedure

The procedure for multiple axes simultaneous start control is as follows.

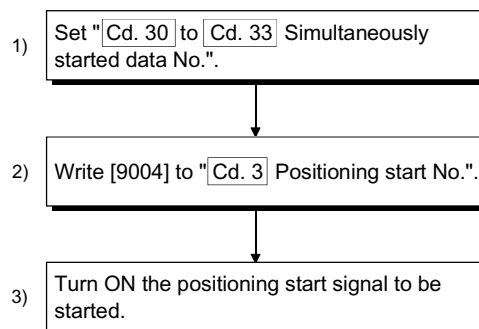

[4] Multiple axes simultaneous start control function setting method

The following shows the setting of the data used to execute the multiple axes simultaneous start control with positioning start signals (The axis control data on the start axis is set).

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.3	9004	Set the multiple axes simultaneous start control start No. "9004".	1500	1600	1700	1800
Cd.30		Set the simultaneously started axis start data No. Set a "0" for the axis other than the simultaneously started axes.	1540	1640	1740	1840
Cd.31			1541	1641	1741	1841
Cd.32			1542	1642	1742	1842
Cd.33			1543	1643	1743	1843

\* Refer to Section 5.7 "List of control data" for information on setting details.

[5] Setting examples

The following shows the setting examples in which the axis 1 is used as the start axis and the simultaneously started axes are used as the axes 2 and 4.

Setting item	Setting value	Setting details	Buffer memory address (Axis 1)
Cd.3	9004	Set the multiple axes simultaneous start control start No. "9004".	1500
Cd.30	100	The axis 1 starts the positioning data No. 100.	1540
Cd.31	200	Immediately after the start of the axis 1, the axis 2 starts the axis 2 positioning data No. 200.	1541
Cd.32	0	Will not start simultaneously.	1542
Cd.33	300	Immediately after the start of the axis 1, the axis 4 starts the axis 4 positioning data No. 300.	1543

**POINTS**

- (1) The "multiple axes simultaneous start control" carries out an operation equivalent to the "simultaneous start" using the "block start data".
- (2) The setting of the "multiple axes simultaneous start control" is easier than that of the "simultaneous start" using the "block start data".
  - Setting items for "simultaneous start" using "block start data"  
Positioning start data, block start data, condition data, and positioning data
  - Setting items for "multiple axes simultaneous start control"  
Positioning data and axis control data

10.6 Start program for high-level positioning control

10.6.1 Starting high-level positioning control

To execute high-level positioning control, a PLC program must be created to start the control in the same method as for major positioning control.

The following shows the procedure for starting the "1st point block start data" (regarded as block No. 7000) set in axis 1.

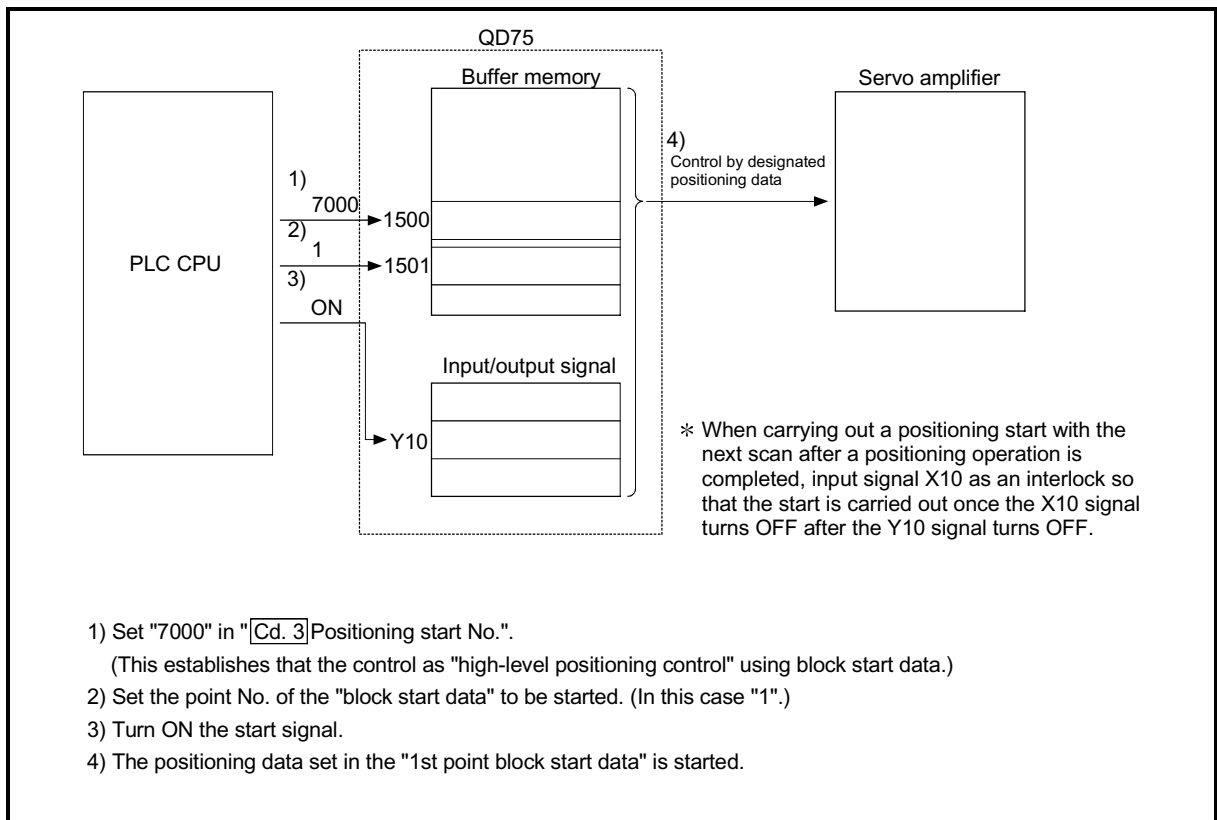


Fig. 10.2 High-level positioning control start procedure



10.6.2 Example of a start program for high-level positioning control

The following shows an example of a start program for high-level positioning control in which the 1st point " block start data" of axis 1 is started. (The block No. is regarded as "7000".)

■ Control data that require setting

The following control data must be set to execute high-level positioning control. The setting is carried out using a PLC program.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.3	Positioning start No.	7000	Set "7000" to indicate control using " block start data".			
Cd.4	Positioning starting point No.	1	Set the point No. of the " block start data" to be started.			

\* Refer to Section 5.7 "List of control data" for details on the setting details.

■ Start conditions

The following conditions must be fulfilled when starting the control. The required conditions must also be integrated into the PLC program, and configured so the control does not start unless the conditions are fulfilled.

Signal name	Signal state	Device							
		Axis 1	Axis 2	Axis 3	Axis 4				
Interface signal	PLC READY signal	ON	PLC CPU preparation completed			Y0			
	QD75 READY signal	ON	QD75 preparation completed			X0			
	All axis servo ON	ON	All axis servo ON			Y1			
	Synchronization flag	ON	QD75 buffer memory The access is possible.			X1			
	Axis stop signal	OFF	Axis stop signal is OFF			Y4	Y5	Y6	Y7
	Start complete signal	OFF	Start complete signal is OFF			X10	X11	X12	X13
	BUSY signal	OFF	BUSY signal is OFF			XC	XD	XE	XF
	Error detection signal	OFF	There is no error			X8	X9	XA	XB
External signal	M code ON signal	OFF	M code ON signal is OFF			X4	X5	X6	X7
	Stop signal	OFF	Stop signal is OFF			-			
	Upper limit (FLS)	ON	Within limit range			-			
	Lower limit (RLS)	ON	Within limit range			-			

■ Start time chart

The following chart shows a time chart in which the positioning data No. 1, 2, 10, 11, and 12 of axis 1 are continuously executed as an example.

(1) Block start data setting example

Axis 1 block start data	Da.11 Shape	Da.12 Start data No.	Da.13 Special start instruction	Da.14 Parameter
1st point	1: Continue	1	0: Block start	—
2nd point	0: End	10	0: Block start	—
€				
€				

(2) Positioning data setting example

Axis 1 position- ing data No.	Da.1 Operation pattern
1	11: Continuous path control
2	00: Positioning complete
€	
10	11: Continuous path control
11	11: Continuous path control
12	00: Positioning complete
€	

(3) Start time chart


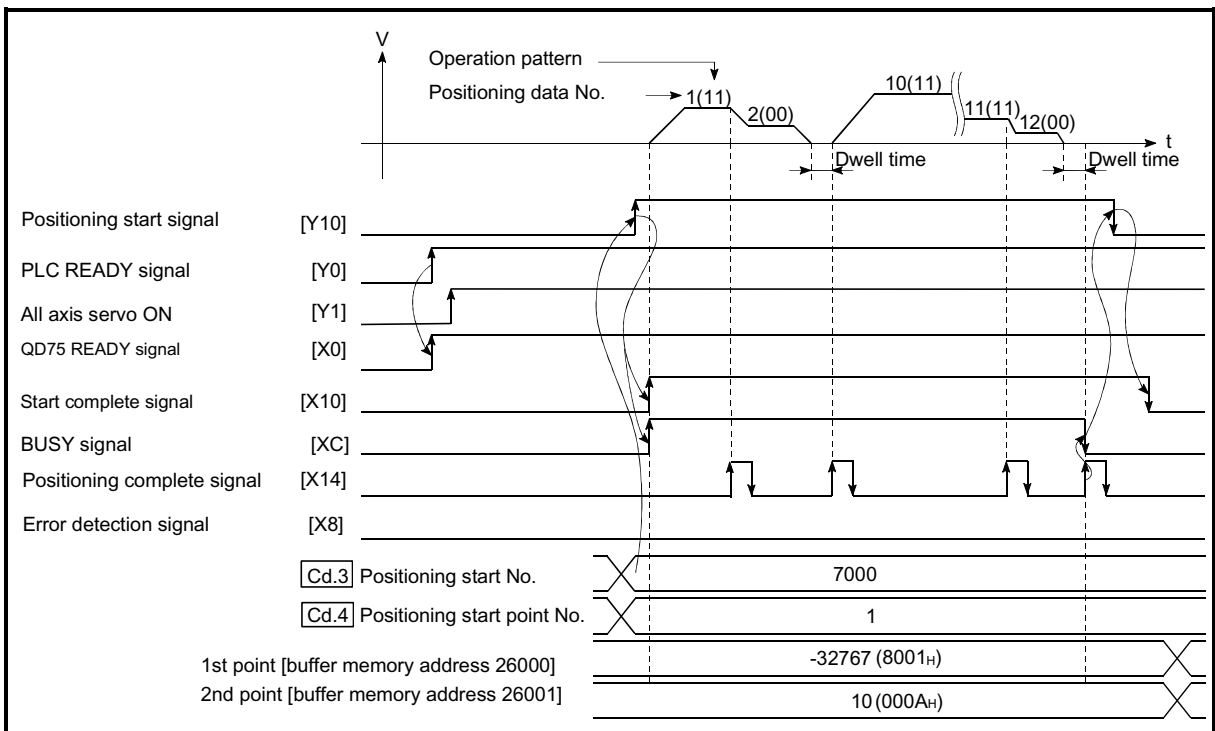


Fig. 10.3 Start time chart for high-level positioning control (block start)

■ Creating the program

Example

Set the block start data beforehand.

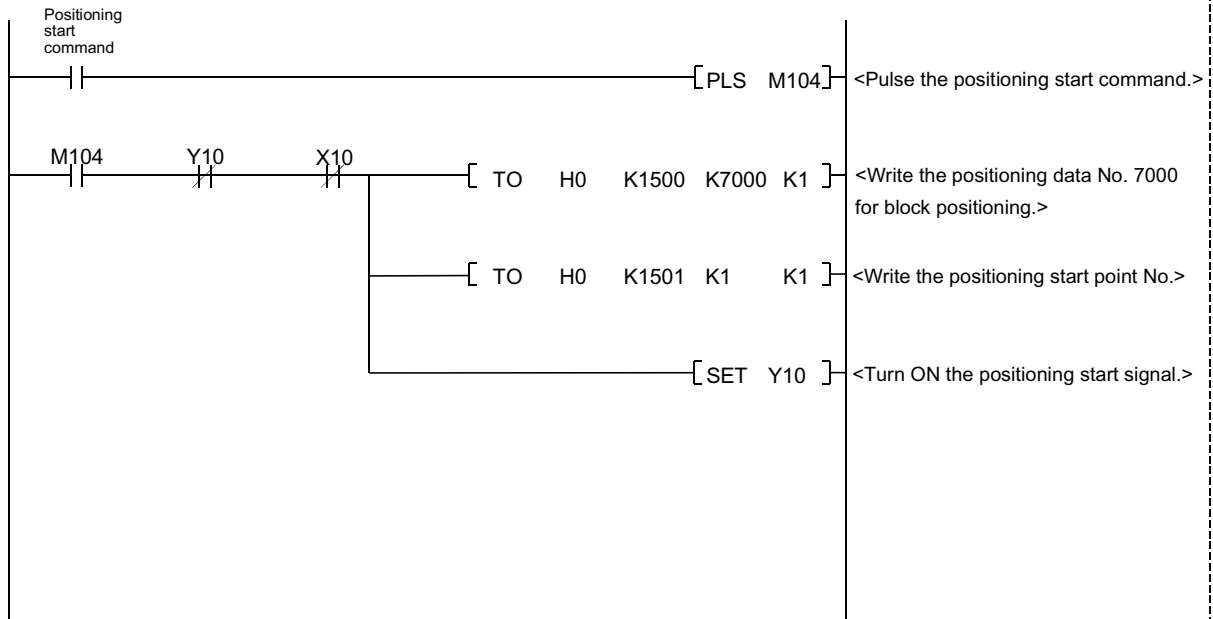

Y10: Positioning start signal  
 X10: Start complete signal  
 M104: Positioning start command pulse

# Chapter 11 Manual Control

The details and usage of manual control are explained in this chapter. In manual control, pulse output commands are issued during a JOG operation and an inching operation executed by the turning ON of the JOG START signal, or from a manual pulse generator connected to the QD75. Manual control using a PLC program from the PLC CPU is explained in this chapter. Refer to GX Configurator-QP Operating Manual for an explanation of manual control (JOG operation, inching operation and manual pulse generator operation) using the peripheral devices.

11.1	Outline of manual control .....	11- 2
11.1.1	Three manual control methods.....	11- 2
11.2	JOG operation.....	11- 4
11.2.1	Outline of JOG operation .....	11- 4
11.2.2	JOG operation execution procedure .....	11- 7
11.2.3	Setting the required parameters for JOG operation .....	11- 8
11.2.4	Creating start programs for JOG operation.....	11- 10
11.2.5	JOG operation example .....	11- 13
11.3	Inching operation .....	11- 17
11.3.1	Outline of inching operation .....	11- 17
11.3.2	Inching operation execution procedure .....	11- 20
11.3.3	Setting the required parameters for inching operation .....	11- 21
11.3.4	Creating a program to enable/disable the inching operation.....	11- 22
11.3.5	Inching operation example.....	11- 25
11.4	Manual pulse generator operation .....	11- 27
11.4.1	Outline of manual pulse generator operation.....	11- 27
11.4.2	Manual pulse generator operation execution procedure .....	11- 31
11.4.3	Setting the required parameters for manual pulse generator operation .	11- 32
11.4.4	Creating a program to enable/disable the manual pulse generator operation .....	11- 33

11.1 Outline of manual control

11.1.1 Three manual control methods

"Manual control" refers to control in which positioning data is not used, and a positioning operation is carried out in response to signal input from an external source. The three types of this "manual control" are explained below.

[1] JOG operation

"JOG operation" is a control method in which the machine is moved by only a movement amount (pulses are continuously transmitted while the JOG START signal is ON). This operation is used to move the workpiece in the direction in which the limit signal is ON, when the operation is stopped by turning the limit signal OFF to confirm the positioning system connection and obtain the positioning data address (refer to Section 12.7.4 "Teaching function").

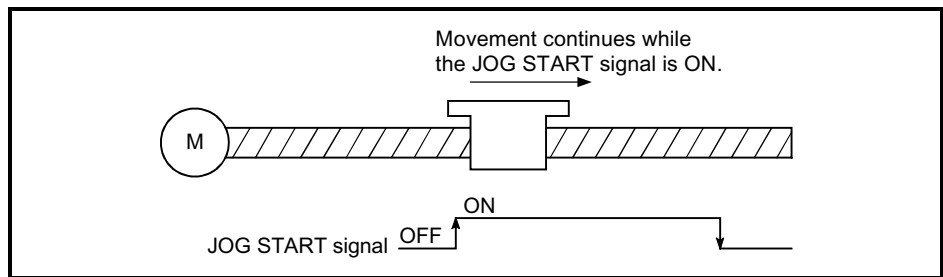


Fig. 11.1 JOG operation

[2] Inching operation

"Inching operation" is a control method in which a minute movement amount of pulses is output manually in one control cycle. When the "inching movement amount" of the axis control data is set by JOG operation, the workpiece is moved by a set movement amount. (When the "inching movement amount" is set to "0", the machine functions as JOG operation.)

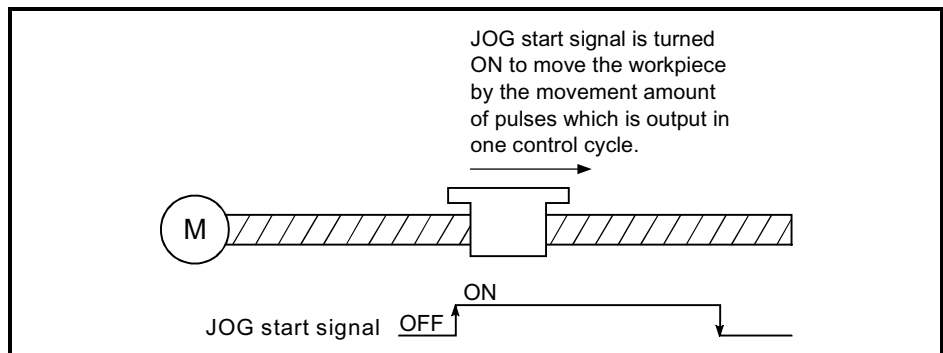


Fig. 11.2 Inching operation

### [3] Manual pulse generator operation

"Manual pulse generator operation" is a control method in which positioning is carried out in response to the No. of pulses input from a manual pulse generator (the No. of input pulses is output). This operation is used for manual fine adjustment, etc., when carrying out accurate positioning to obtain the positioning address.

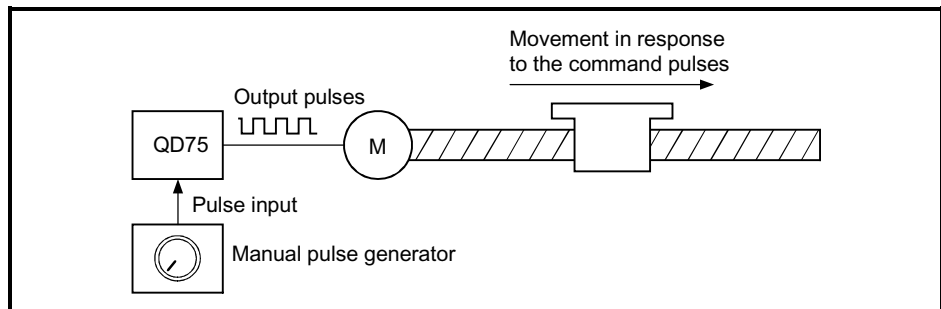


Fig. 11.3 Manual pulse generator control

#### ■ Manual control sub functions

Refer to Section 3.2.4 "Combination of QD75 major functions and sub functions" for details on "sub functions" that can be combined with manual control. Also refer to Chapter 12 "Control sub functions" for details on each sub function.

#### ■ Carrying out manual control from peripheral devices

"JOG operation", "Inching operation" and enabling/disabling of the "manual pulse generator operation" can be executed from GX Configurator-QP test mode. Refer to GX Configurator-QP Operating Manual for details on manual control from GX Configurator-QP.

#### ■ Monitoring manual control

Refer to Section 5.6 "List of monitor data" when directly monitoring the buffer memory using GX Developer. Also refer to GX Configurator-QP Operating Manual when monitoring with the monitor functions of GX Configurator-QP.

11.2 JOG operation

11.2.1 Outline of JOG operation

**Important**

Use the hardware stroke limit function when carrying out JOG operation near the upper or lower limits. (Refer to Section "12.4.4").

\* If the hardware stroke limit function is not used, the workpiece may exceed the moving range, causing an accident.

■ JOG operation

In JOG operation, the FORWARD run JOG start signal (Y8, YA, YC, YE) or REVERSE run JOG start signal (Y9, YB, YD, YF) turns ON, causing pulses to be output to the servo amplifier from the QD75 while the signal is ON. The workpiece is then moved in the designated direction.

The following shows examples of JOG operation.

1)	When the START signal turns ON, acceleration begins in the direction designated by the START signal, and continues for the acceleration time designated in " [Pr.32] JOG operation acceleration time selection". At this time, the BUSY signal changes from OFF to ON.
2)	When the workpiece being accelerated reaches the speed set in " [Cd.17] JOG speed", the movement continues at this speed. The constant speed movement takes place at 2) and 3).
3)	When the START signal is turned OFF, deceleration begins from the speed set in " [Cd.17] JOG speed", and continues for the deceleration time designated in " [Pr.33] JOG operation deceleration time selection".
4)	The operation stops when the speed becomes "0". At this time, the BUSY signal changes from ON to OFF.

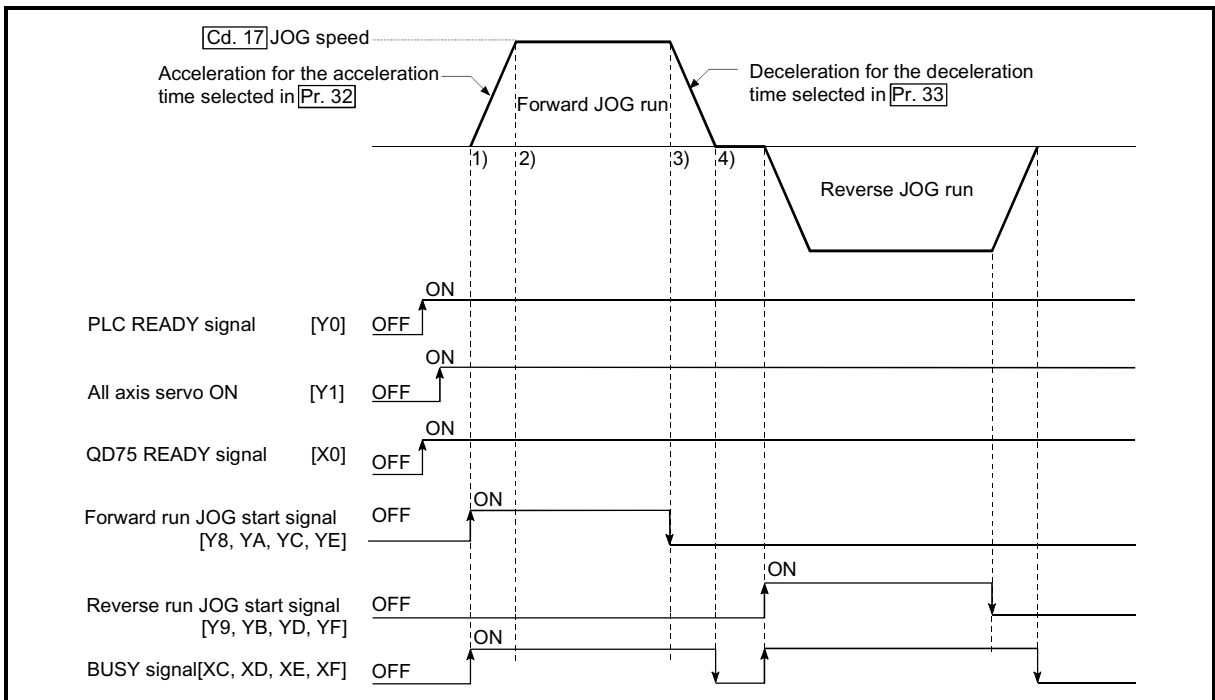


Fig. 11.4 JOG operation


### ■ Precautions during operation

The following details must be understood before carrying out JOG operation.

- (1) For safety, first set "Cd.17 JOG speed" to a smaller value and check the movement. Then gradually increase the value.
- (2) An axis error will occur and the operation will not start (error code: 300) if the "JOG speed" is outside the setting range at the JOG start.
- (3) An axis error will occur and the operation will not start (error code: 956) if "Pr.31 JOG speed limit value" is set to a value larger than "Pr.8 speed limit value".
- (4) If "Cd.17 JOG speed" exceeds the speed set in "Pr.31 JOG speed limit value", the workpiece will move at the "Pr.31 JOG speed limit value" and an "Axis warning" will occur in the QD75 (warning code: 301).
- (5) The JOG operation can be continued even if an "Axis warning" has occurred.
- (6) A JOG start signal OFF → ON immediately after the stop signal ON → OFF (within 100ms) will be ignored. (The operation will not start.)
- (7) Set a "0" in "Cd.16 inching movement amount". If a value other than "0" is set, the operation will become an inching operation (Refer to section 11.3 "Inching operation").

### ■ Errors during operation

If the operation is stopped by the stroke limit (limit signal OFF), JOG operation can be performed out in the direction in which the limit signal turns ON after an error reset. (An error will occur again if the JOG start signals in the direction in which the limit signal turns OFF is turned ON.)

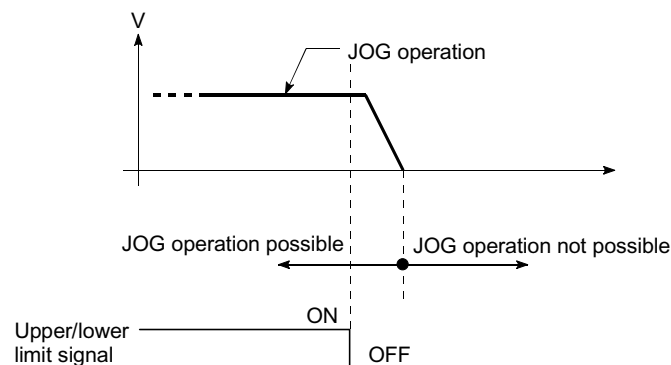



■ JOG operation timing and processing time

The following drawing shows details of the JOG operation timing and processing time.

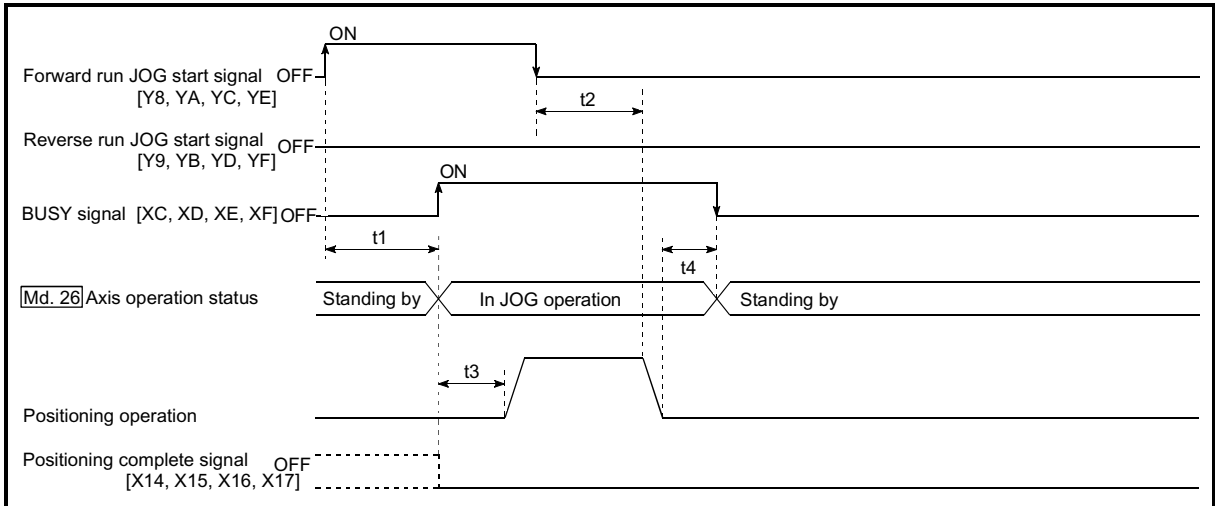


Fig. 11.5 JOG operation timing and processing times

Normal timing times


Unit: ms

t1	t2	t3	t4
1.0 to 4.0	0 to 3.5	5.5 to 7.9	0 to 3.5

⚠ Delays may occur in the t1 timing time due to the operation status of other axes.

11.2.2 JOG operation execution procedure

The JOG operation is carried out by the following procedure.

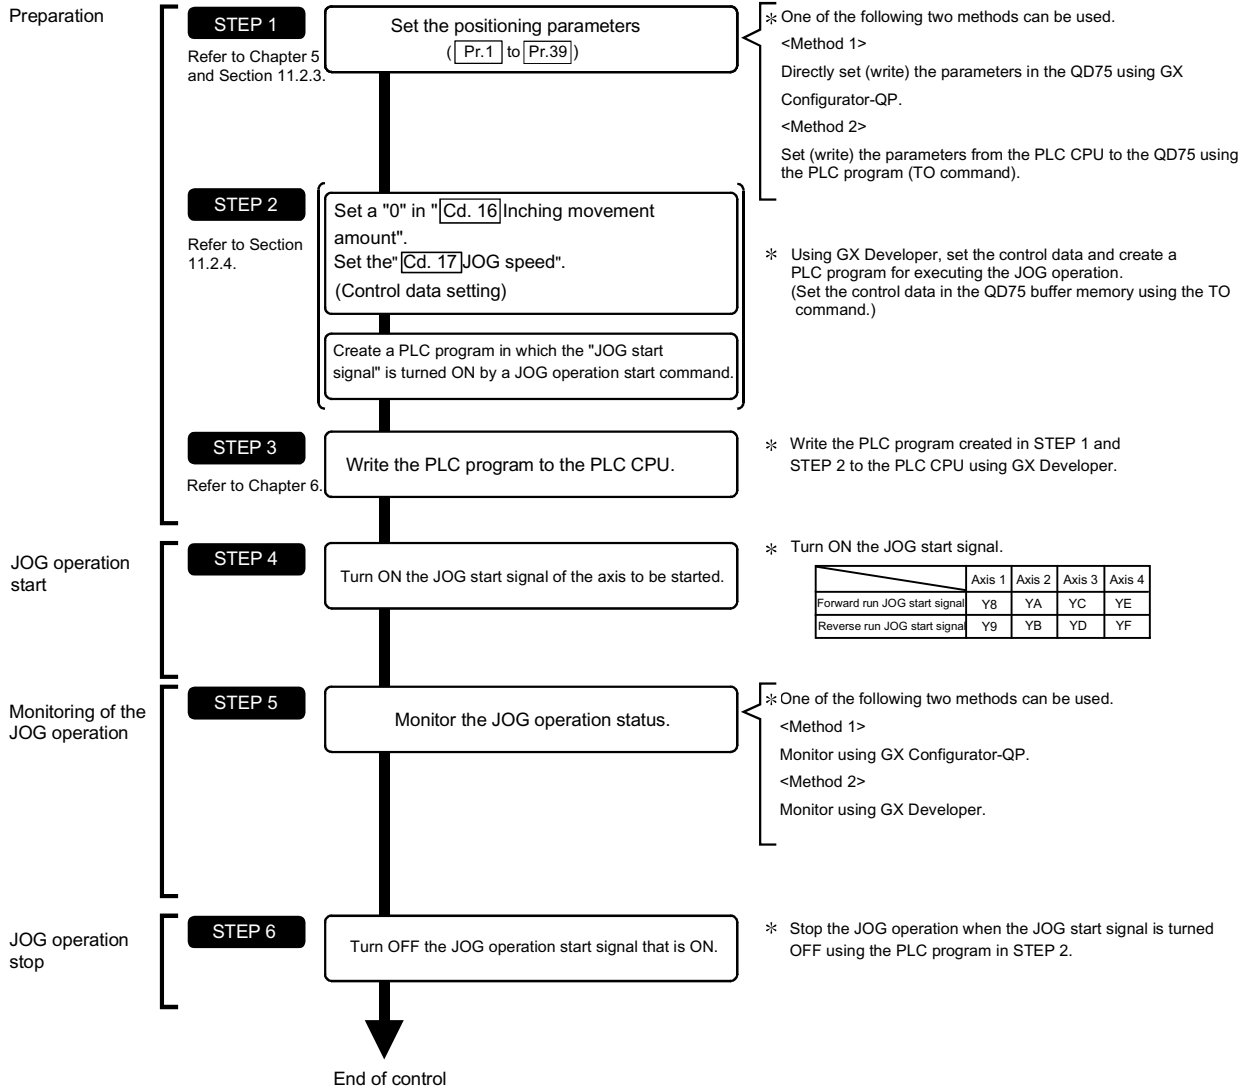

**REMARK**

- ≠ Mechanical elements such as limit switches are considered as already installed.
- ≠ Positioning parameter settings work in common for all control using the QD75.

## 11.2.3 Setting the required parameters for JOG operation

The "Positioning parameters" must be set to carry out JOG operation.

The following table shows the setting items of the required parameters for carrying out JOG operation. When only JOG operation will be carried out, no parameters other than those shown below need to be set. (Use the initial values or setting values within a range where no error occurs for trouble-free operation.)

Setting item		Setting requirement	Factory-set initial value (setting details)	
Positioning parameters	Pr.1	Unit setting	◎	3 (PLS)
	Pr.2	No. of pulses per rotation (Ap) (Unit: PLS)	◎	20000
	Pr.3	Movement amount per rotation (Al) (Unit: PLS)	◎	20000
	Pr.4	Unit magnification (Am)	◎	1 (1 times)
	Pr.7	Bias speed at start (Unit: PLS/s)	○	0
	Pr.8	Speed limit value (Unit: PLS/s)	◎	20000
	Pr.9	Acceleration time 0 (Unit: PLS/s)	◎	1000
	Pr.10	Deceleration time 0 (Unit: PLS/s)	◎	1000
	Pr.11	Backlash compensation amount (Unit: PLS)	○	0
	Pr.12	Software stroke limit upper limit value (Unit: PLS)	○	2147483647
	Pr.13	Software stroke limit lower limit value (Unit: PLS)	○	-2147483648
	Pr.14	Software stroke limit selection	○	0 (current feed value)
	Pr.15	Software stroke limit valid/invalid setting	○	0 (valid)
	Pr.17	Torque limit setting value (Unit: %)	○	300

◎ : Setting always required.

○ : Set according to requirements (Leave set to the initial value when not used.)

**REMARK**

- ≠ Positioning parameter settings work in common for all control using the QD75.  
When carrying out other control ("major positioning control", "high-level positioning control", "OPR positioning control"), the respective setting items must also be matched and set.
- ≠ Parameters are set for each axis.
- ≠ Refer to Chapter 5 "Data Used for Positioning Control" for setting details.

Setting item		Setting requirement	Factory-set initial value (setting details)	
Positioning parameters	Pr.25	Acceleration time 1 (Unit: ms)	○	1000
	Pr.26	Acceleration time 2 (Unit: ms)	○	1000
	Pr.27	Acceleration time 3 (Unit: ms)	○	1000
	Pr.28	Deceleration time 1 (Unit: ms)	○	1000
	Pr.29	Deceleration time 2 (Unit: ms)	○	1000
	Pr.30	Deceleration time 3 (Unit: ms)	○	1000
	Pr.31	JOG speed limit value (Unit: PLS/s)	◎	20000
	Pr.32	JOG operation acceleration time selection	◎	0 (acceleration time 0)
	Pr.33	JOG operation deceleration time selection	◎	0 (deceleration time 0)
	Pr.34	Acceleration/deceleration process selection	○	0 (trapezoidal acceleration/ deceleration processing)
	Pr.35	S-pattern proportion (Unit: %)	○	100
	Pr.36	Sudden stop deceleration time (Unit: ms)	○	1000
	Pr.37	Stop group 1 sudden stop selection	○	0 (deceleration stop)
	Pr.38	Stop group 2 sudden stop selection	○	0 (deceleration stop)
	Pr.39	Stop group 3 sudden stop selection	○	0 (deceleration stop)

◎ : Setting always required.

○ : Set according to requirements (Leave set to the initial value when not used.)

11.2.4 Creating start programs for JOG operation

A PLC program must be created to execute a JOG operation. Consider the "required control data setting", "start conditions" and "start time chart" when creating the program.

The following shows an example when a JOG operation is started for axis 1. ("Cd.17 JOG speed" is set to "100.00mm/min" in the example shown.)

■ Required control data setting

The control data shown below must be set to execute a JOG operation. The setting is carried out with the PLC program.

Setting item	Setting value	Setting details	Buffer memory address				
			Axis 1	Axis 2	Axis 3	Axis 4	
Cd.16	Inching movement amount	0	Set "0".	1517	1617	1717	1817
Cd.17	JOG speed	10000	Set a value equal to or below the "Pr.31 JOG speed limit value".	1518 1519	1618 1619	1718 1719	1818 1819

\* Refer to Section 5.7 "List of control data" for details on the setting details.

■ Start conditions

The following conditions must be fulfilled when starting. The required conditions must also be assembled in the PLC program, and the PLC program must be configured so the operation will not start if the conditions are not fulfilled.

Signal name	Signal state	Device								
		Axis 1	Axis 2	Axis 3	Axis 4					
Interface signal	PLC READY signal	ON	PLC CPU preparation completed				Y0			
	QD75 READY signal	ON	QD75 preparation completed				X0			
	All axis servo ON	ON	All axis servo ON				Y1			
	Synchronization flag *	ON	QD75 buffer memory The access is possible.				X1			
	Axis stop signal	OFF	Axis stop signal is OFF				Y4	Y5	Y6	Y7
	Start complete signal	OFF	Start complete signal is OFF				X10	X11	X12	X13
	BUSY signal	OFF	QD75 is not operating				XC	XD	XE	XF
	Error detection signal	OFF	There is no error				X8	X9	XA	XB
External signal	M code ON signal	OFF	M code ON signal is OFF				X4	X5	X6	X7
	Stop signal	OFF	Stop signal is OFF				-			
	Upper limit (FLS)	ON	Within limit range				-			
Lower limit (RLS)	ON	Within limit range				-				

\* If the PLC CPU is set to the asynchronous mode in the synchronization setting, this must be inserted in the program for interlocking. If it is set to the synchronous mode, it must not be inserted in the program for interlocking because it is turned ON when the PLC CPU executes calculation.

■ Start time chart


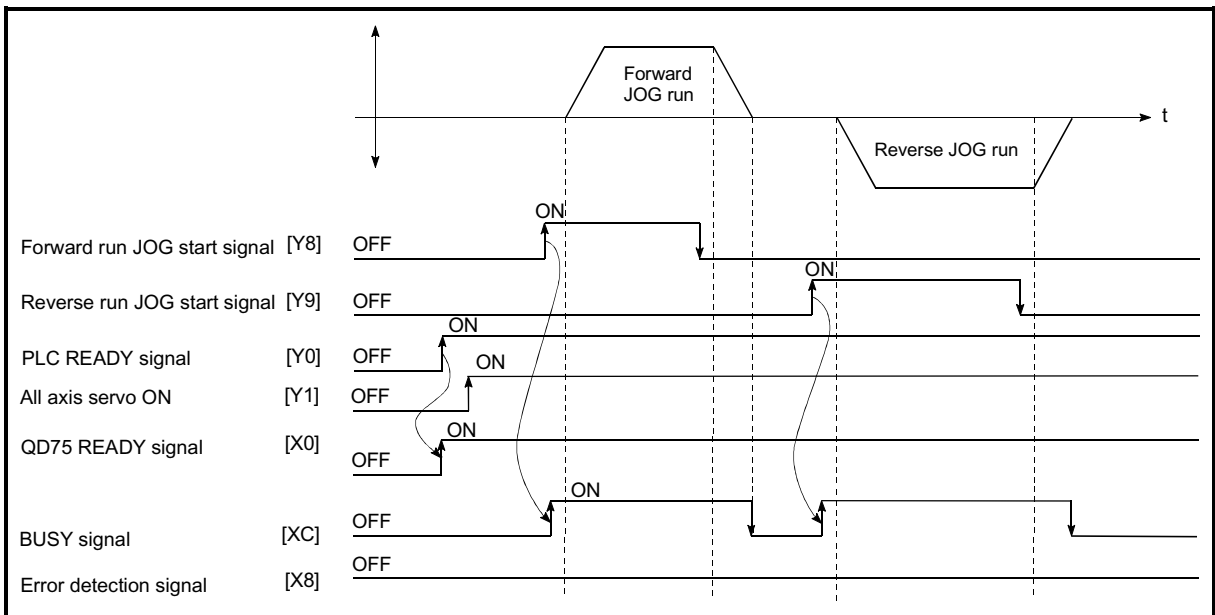


Fig. 11.6 JOG operation start time chart

■ Creating the program

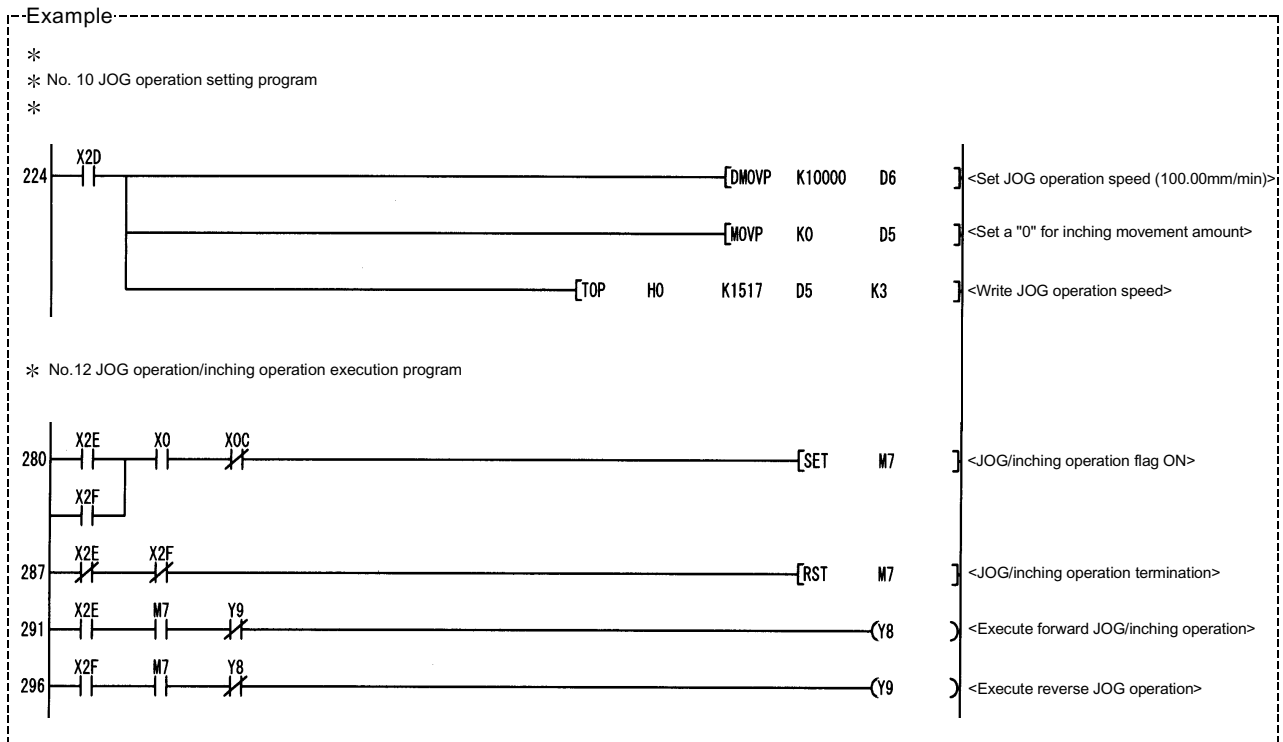

11.2.5 JOG operation example

■ When the "stop signal" is turned ON during JOG operation

When the "stop signal" is turned ON during JOG operation, the JOG operation will stop by the "deceleration stop" method.  
 JOG start signals will be ignored while the stop signal is ON.  
 The operation can be started by turning the stop signal OFF, and turning the JOG start signal from OFF to ON again.

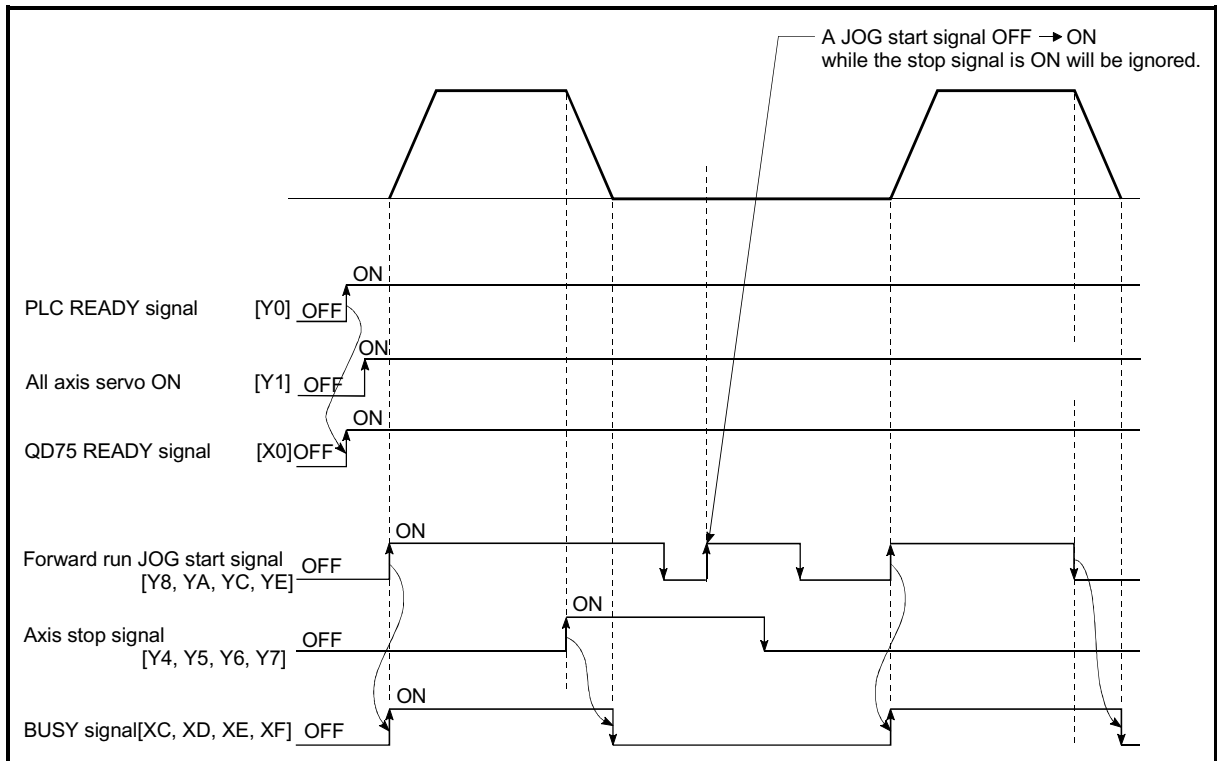


Fig. 11.7 Operation when the stop signal is turned ON during JOG operation

<b>POINT</b>
The QD75 will not receive a "JOG start signal" while the "stop signal" is ON.



■ When both the "forward run JOG start signal" and "reverse run JOG start signal" are turned ON simultaneously for one axis

When both the "forward run JOG start signal" and "reverse run JOG start signal" are turned ON simultaneously for one axis, the "forward run JOG start signal" is given priority. In this case, the "reverse run JOG start signal" is validated when the QD75 BUSY signal is turned OFF.

If the forward run JOG operation is stopped due to stop or axis error by a stop signal, the reverse run JOG operation will not be executed even if the "reverse run JOG start signal" turns ON.

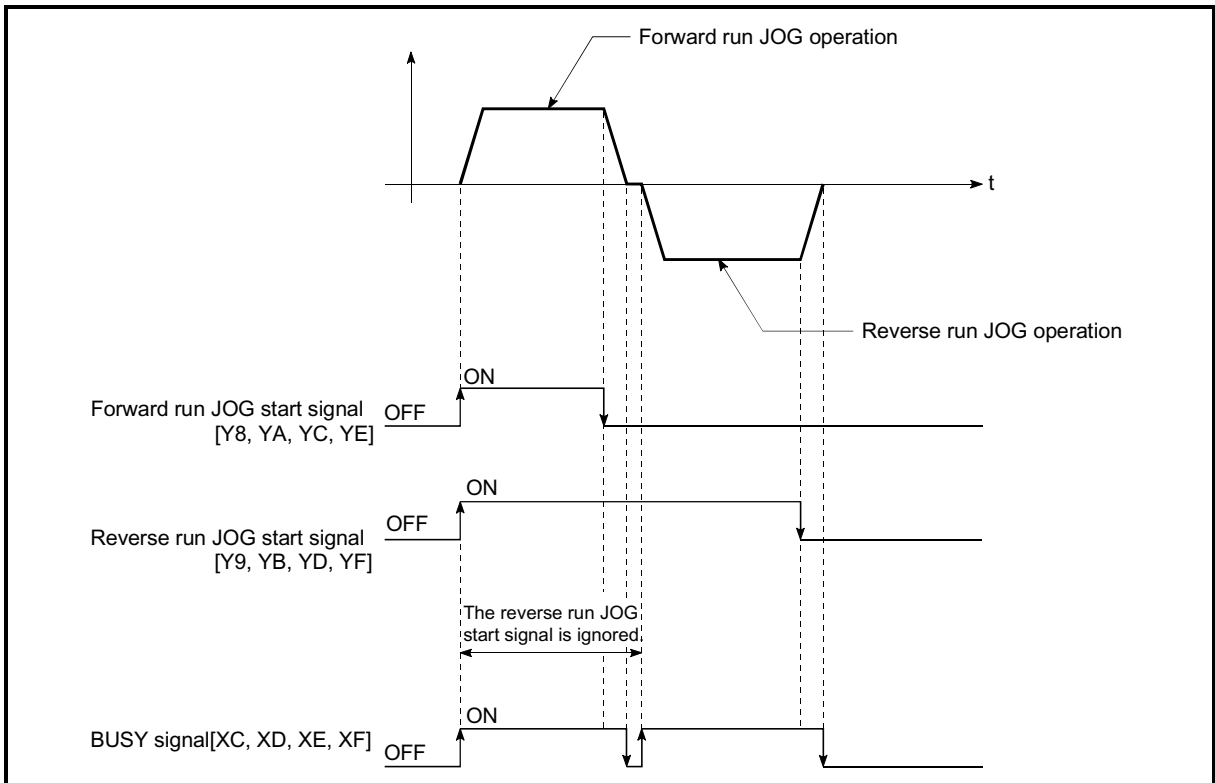


Fig. 11.8 Operation when both the forward run JOG start signal and reverse run JOG start signal are turned ON simultaneously

- When the "JOG start signal" is turned ON again during deceleration caused by the ON → OFF of the "JOG start signal"

When the "JOG start signal" is turned ON again during deceleration caused by the ON → OFF of the "JOG start signal", the JOG operation will be carried out from the time the "JOG start signal" is turned ON.

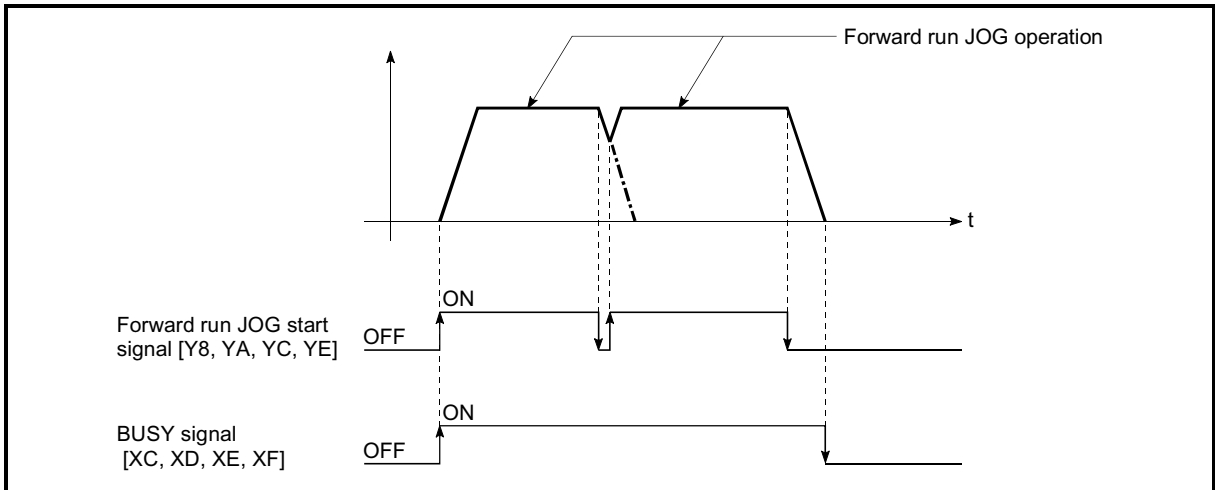


Fig. 11.9 Operation when the JOG start signal is turned ON during deceleration

- When the "JOG start signal" is turned ON during a peripheral device test mode

When the "JOG start signal" is turned ON during a peripheral device test mode, it will be ignored and the JOG operation will not be carried out.

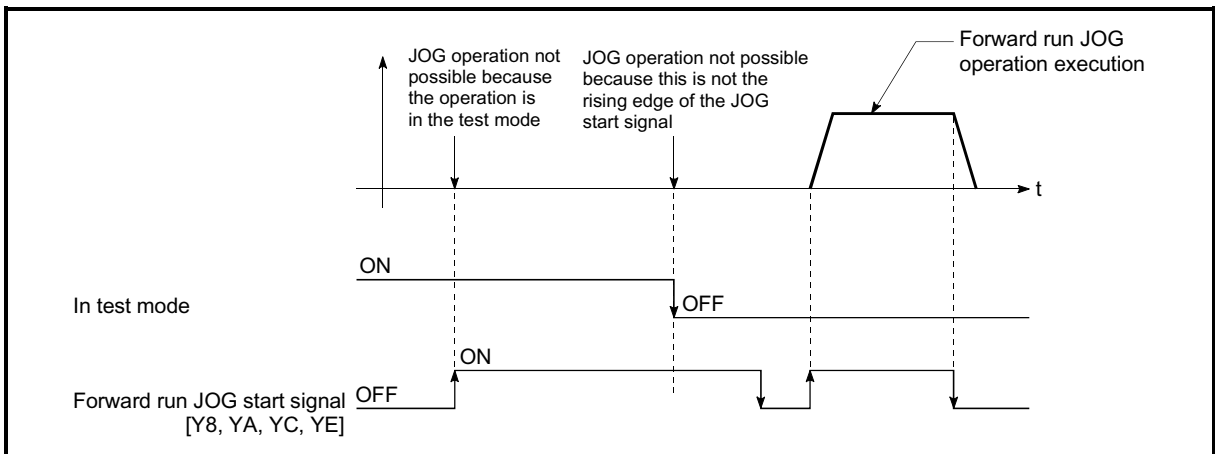


Fig. 11.10 Operation when the JOG start signal is turned ON during a test mode

- When the "JOG start signal" is turned ON immediately after the stop signal OFF (within 100ms)

When the "JOG start signal" is turned ON immediately after the stop signal OFF (within 100ms), it will be ignored and the JOG operation will not be carried out.

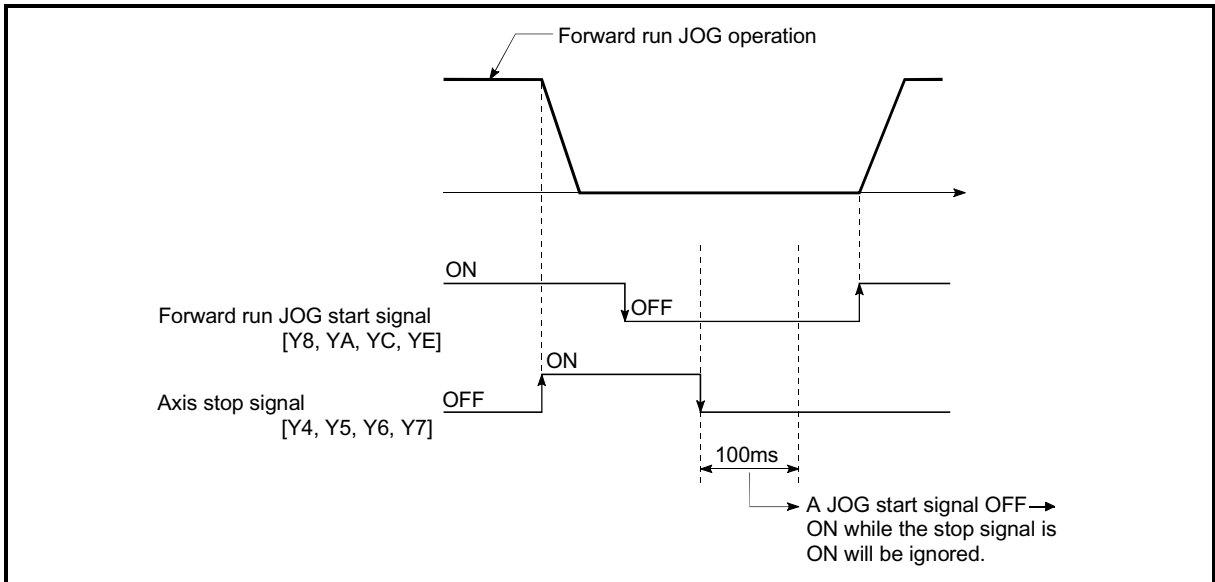


Fig. 11.11 Operation when the JOG start signal is turned ON immediately after the stop signal OFF

11.3 Inching operation

11.3.1 Outline of inching operation

**Important**

When the inching operation is carried out near the upper or lower limit, use the hardware stroke limit function (Refer to Section 12.4.4).

\* If the hardware stroke limit function is not used, the workpiece may exceed the movement range, and an accident may result.

■ Inching operation

In inching operation, pulses are input to the servo amplifier at the first control cycle (3.5 ms) to move the workpiece by a designated movement amount after the forward run JOG start signal [Y8, YA, YC, YE] or reverse JOG start signal [Y9, YB, YD, YF] is turned ON.

The following shows the example of inching operation.

- |    |                                                                                                                                                                           |
|----|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1) | When the start signal is turned ON, inching operation is carried out in the direction designated by the start signal. In this case, BUSY signal is turned from OFF to ON. |
| 2) | The workpiece is moved by a movement amount set in " Cd.16 Inching movement amount".                                                                                      |
| 3) | The workpiece movement stops when the speed becomes "0". In this case, BUSY signal is turned from ON to OFF. The positioning complete signal is turned from OFF to ON.    |
| 4) | The positioning complete signal is turned from ON to OFF after a time set in " Pr.40 Positioning complete signal output time" has elapsed.                                |

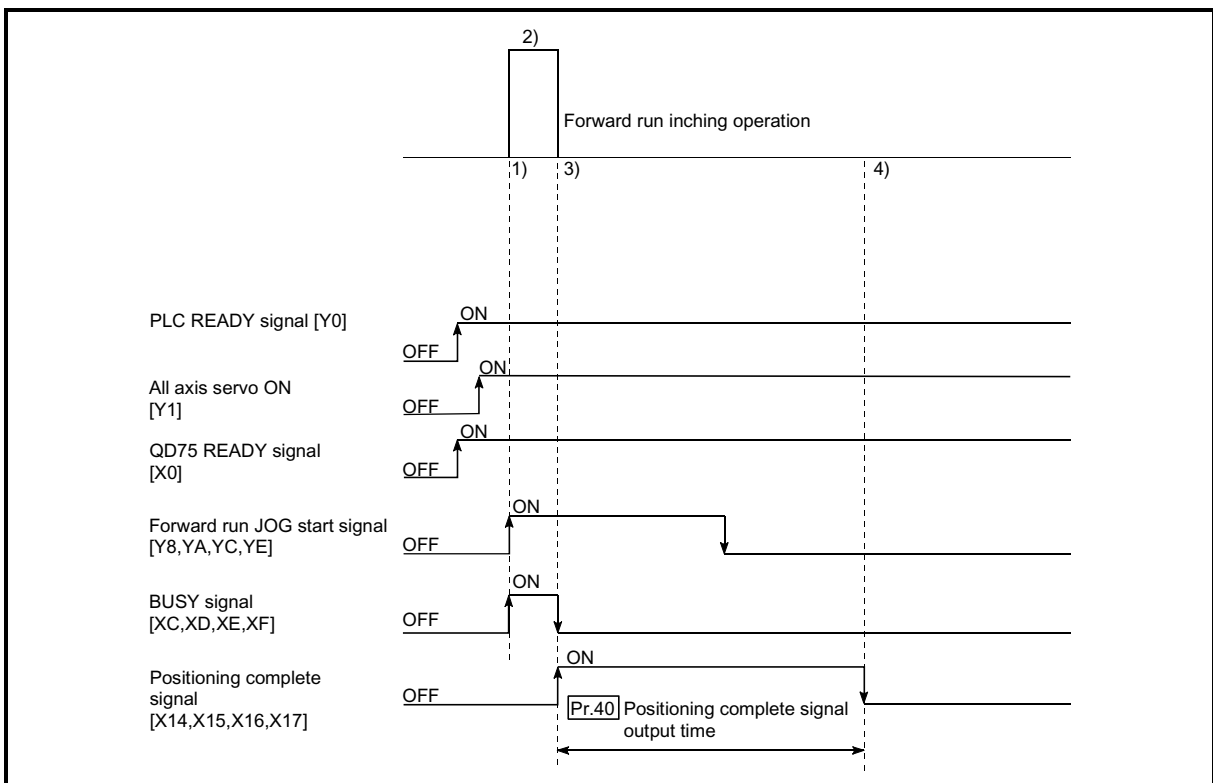


Fig. 11.12 Inching operation

■ Precautions during operation

The following details must be understood before inching operation is carried out.

(1) Acceleration/deceleration processing is not carried out during inching operation.

(Pulses corresponding to the designated inching movement amount are output at the first control cycle of the QD75 (3.5 ms). The movement direction of inching operation is reversed and, when a backlash compensation is carried out, first pulses corresponding to the backlash amount are output in the first control cycle of the QD75 and then pulses corresponding to the designated inching movement amount are output in the subsequent control cycles.)

The "Cd.17 JOG speed" is ignored even if it is set. An error will occur in the following cases (error code: 301).

$$(\text{Cd.16 Inching movement amount}) \times (A) > (\text{Pr.31 JOG speed limit value})$$

Where (A) is as follows.

- When the unit is PLS: 562.5
- When the unit is other than PLS: 337.5

(2) JOG start signal OFF → ON immediately after stop signal ON → OFF (within 100 ms) is ignored.

(Operation will not start.)


(3) Set a value other than a "0" in "Cd.16 Inching movement amount".

If a "0" is set, the operation will become JOG operation (Refer to Section 11.2 "JOG operation").

■ Errors during operation

When the operation is stopped by the stroke limit (limit signal OFF), inching operation can be performed out in the direction in which the limit signal turns ON after an error reset.

(JOG start signals in the direction in which the limit signal turns OFF will be ignored.)

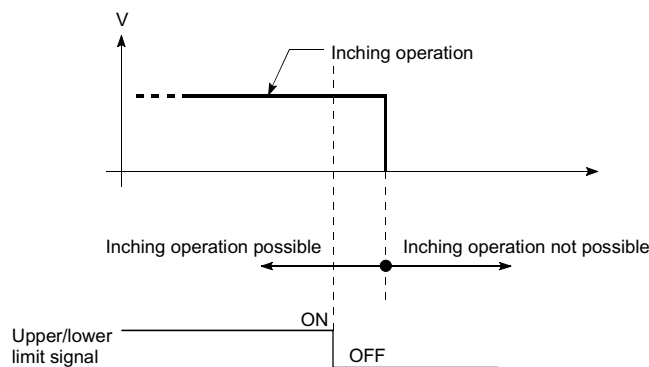

■ Inching operation timing and processing times

The following drawing shows the details of the inching operation timing and processing time.

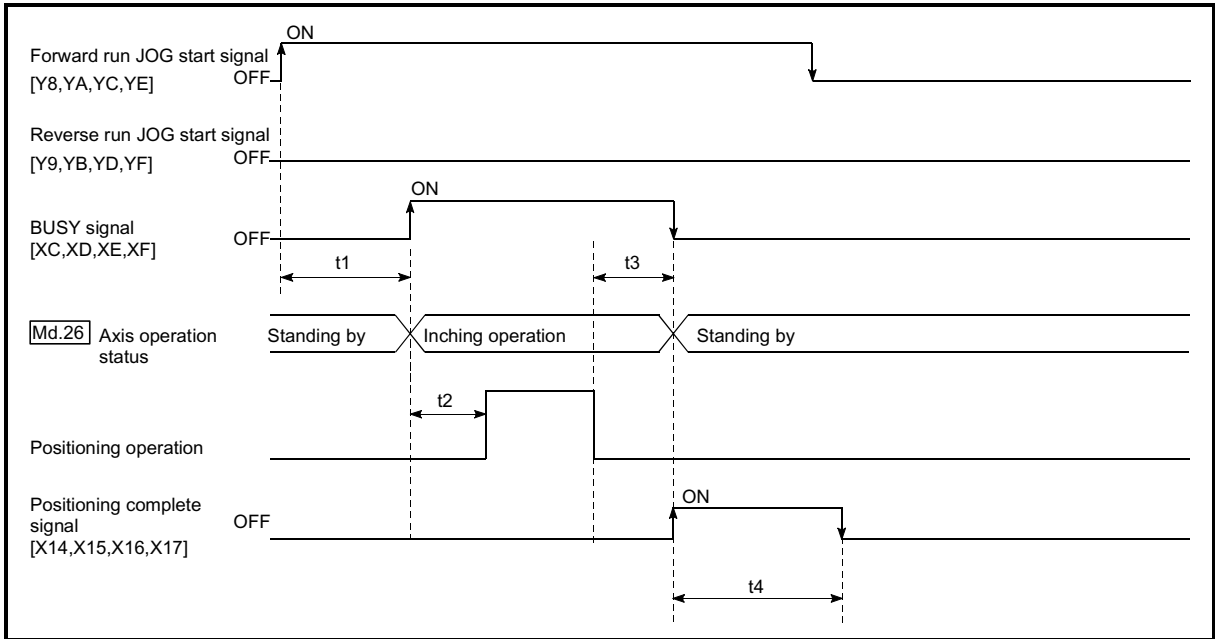


Fig. 11.13 Inching operation timing and processing times

Normal timing times


Unit : ms

t1	t2	t3	t4
1.0 to 4.0	5.5 to 7.9	0 to 3.5	Depending on parameters

⚠ Depending on the operating statuses of the other axes, delay may occur in the  $t_1$  timing time.

11.3.2 Inching operation execution procedure

The inching operation is carried out by the following procedure.

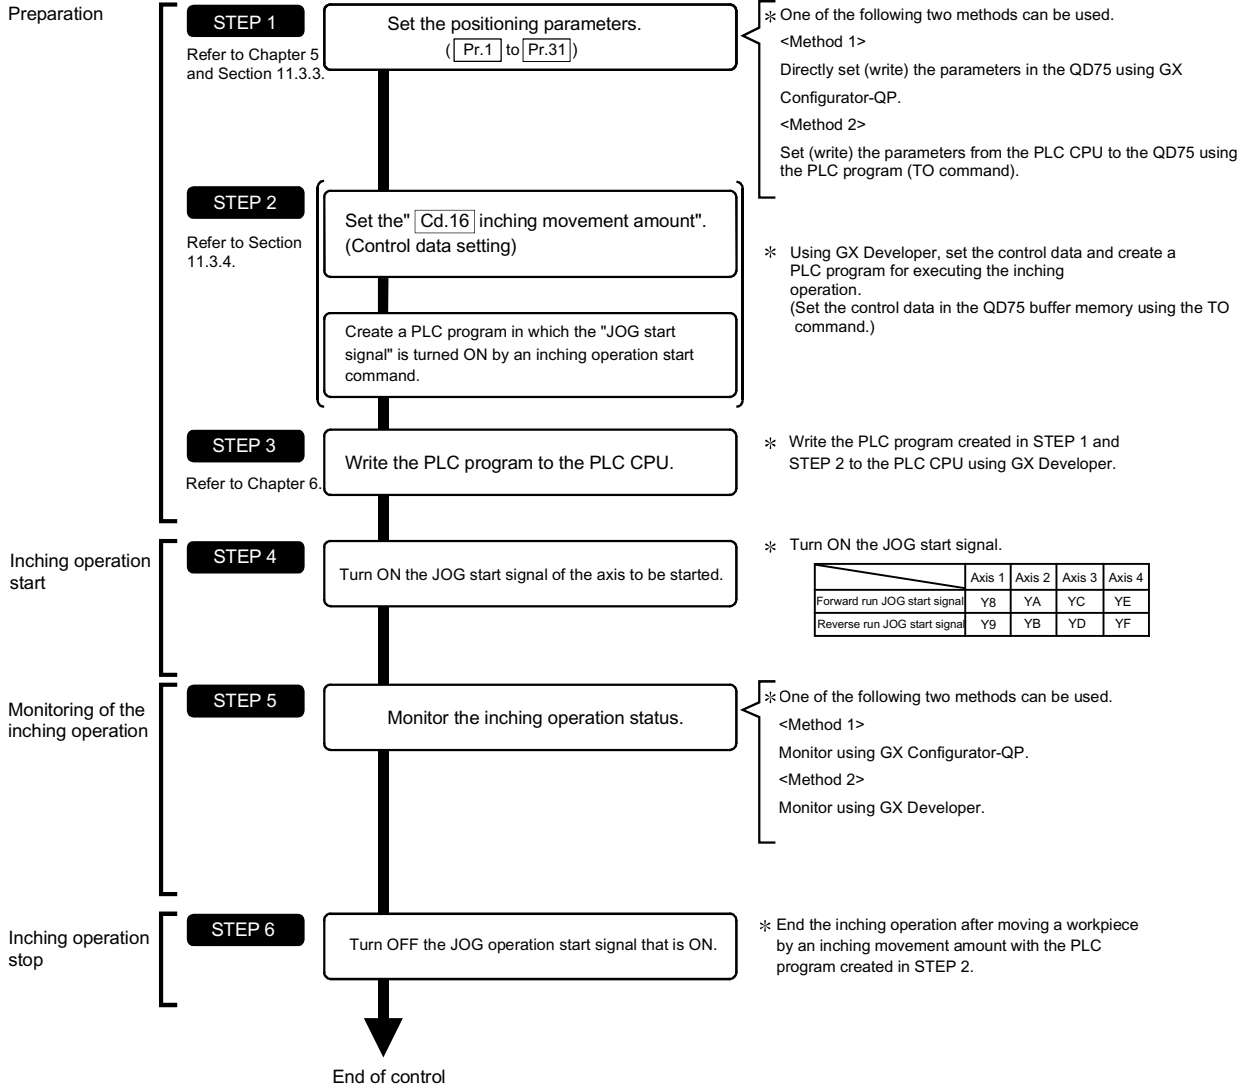

**REMARK**

- ≠ Mechanical elements such as limit switches are considered as already installed.
- ≠ Positioning parameter settings work in common for all control using the QD75.

## 11.3.3 Setting the required parameters for inching operation

The "Positioning parameters" must be set to carry out inching operation.

The following table shows the setting items of the required parameters for carrying out inching operation. When only inching operation will be carried out, no parameters other than those shown below need to be set. (Use the initial values or setting values within a range where no error occurs for trouble-free operation.)

Setting item		Setting requirement	Factory-set initial value (setting details)	
Positioning parameters	Pr.1	Unit setting	☉	3 (PLS)
	Pr.2	No. of pulses per rotation (AP) (Unit: PLS)	☉	20000
	Pr.3	Movement amount per rotation (AL) (Unit: PLS)	☉	20000
	Pr.4	Unit magnification (AM)	☉	1 (1 times)
	Pr.11	Backlash compensation amount (Unit: PLS)	○	0
	Pr.12	Software stroke limit upper limit value (Unit: PLS)	○	2147483647
	Pr.13	Software stroke limit lower limit value (Unit: PLS)	○	-2147483648
	Pr.14	Software stroke limit selection	○	0 (current feed value)
	Pr.15	Software stroke limit valid/invalid setting	○	0 (valid)
	Pr.17	Torque limit setting value (Unit: %)	○	300
	Pr.31	JOG speed limit value (Unit: PLS/s)	☉	20000

☉ : Setting always required.

○ : Set according to requirements (Leave set to the initial value when not used.)

<b>REMARK</b>
---------------

≠ Positioning parameter settings work in common for all control using the QD75. When carrying out other controls ("major positioning control", "high-level positioning control", and "OPR positioning control"), the respective setting items must also be set.

≠ Parameters are set for each axis.

≠ Refer to Chapter 5 "Data Used for Positioning Control" for setting details.



11.3.4 Creating a program to enable/disable the inching operation

A PLC program must be created to execute an inching operation. Consider the "required control data setting", "start conditions", and "start time chart" when creating the program.

The following shows an example when an inching operation is started for axis 1. (The example shows the inching operation when a "10.0 μm" is set in "[Cd.16] Inching movement amount".)

■ Required control data setting

The control data shown below must be set to execute an inching operation. The setting is carried out with the PLC program.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Cd.16] Inching movement amount	100	Set the setting value so that the JOG speed limit value is not increased larger than the maximum output pulse	1517	1617	1717	1817

\* Refer to Section 5.7 "List of control data" for information on setting details.

■ Start conditions

The following conditions must be fulfilled when starting. The required conditions must also be assembled in the PLC program, and the PLC program must be configured so the operation will not start if the conditions are not fulfilled.

Signal name	Signal state	Device								
		Axis 1	Axis 2	Axis 3	Axis 4					
Interface signal	PLC READY signal	ON	PLC CPU preparation completed				Y0			
	QD75 READY signal	ON	QD75 preparation completed				X0			
	All axis servo ON	ON	All axis servo ON				Y1			
	Synchronization flag *	ON	Accessible to QD75 buffer memory				X1			
	Axis stop signal	OFF	Axis stop signal is OFF				Y4	Y5	Y6	Y7
	Start complete signal	OFF	Start complete signal is OFF				X10	X11	X12	X13
	BUSY signal	OFF	QD75 is not operating				XC	XD	XE	XF
	Positioning complete signal	OFF	Positioning complete signal is OFF				X14	X15	X16	X17
	Error detection signal	OFF	There is no error				X8	X9	XA	XB
External signal	M code ON signal	OFF	M code ON signal is OFF				X4	X5	X6	X7
	Stop signal	OFF	Stop signal is OFF				-			
	Upper limit (FLS)	ON	Within limit range				-			
	Lower limit (RLS)	ON	Within limit range				-			

\* If the PLC CPU is set to the asynchronous mode in the synchronization setting, this must be inserted in the program for interlocking. If it is set to the synchronous mode, it must not be inserted in the program for interlocking because it is turned ON when the PLC CPU executes calculation.

■ Start time chart


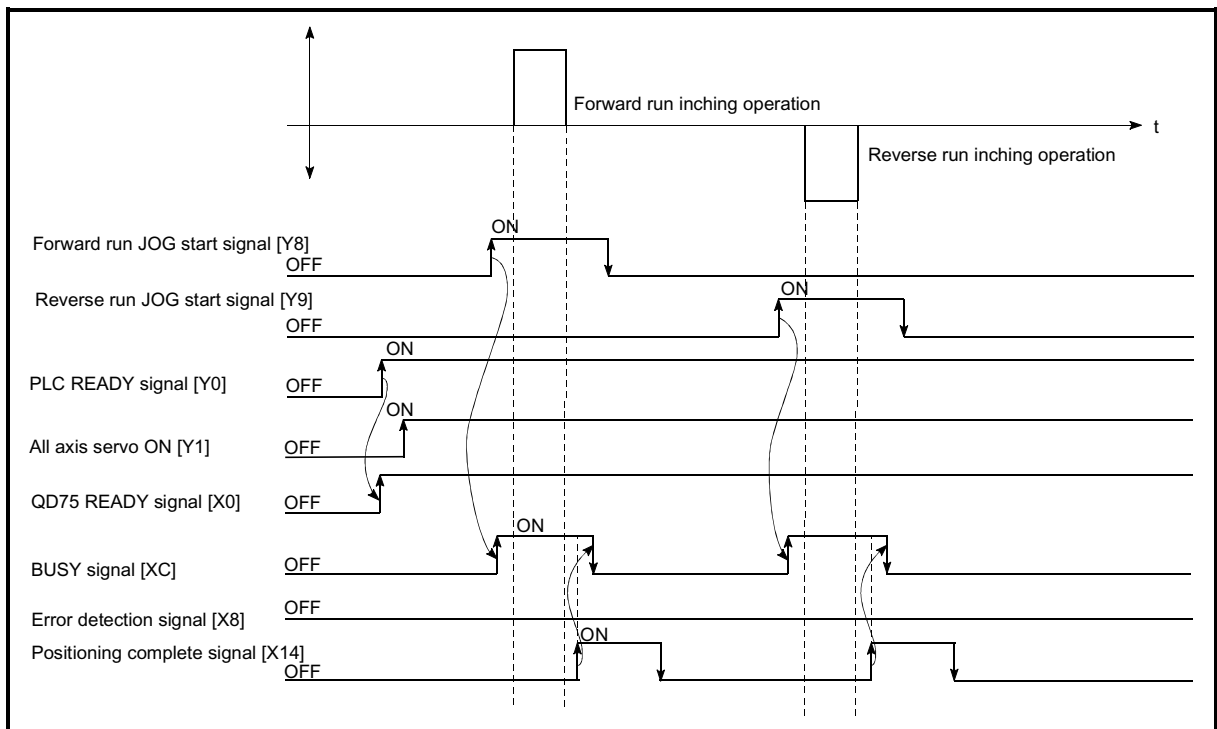


Fig. 11.14 Inching operation start time chart

■ Creating the program

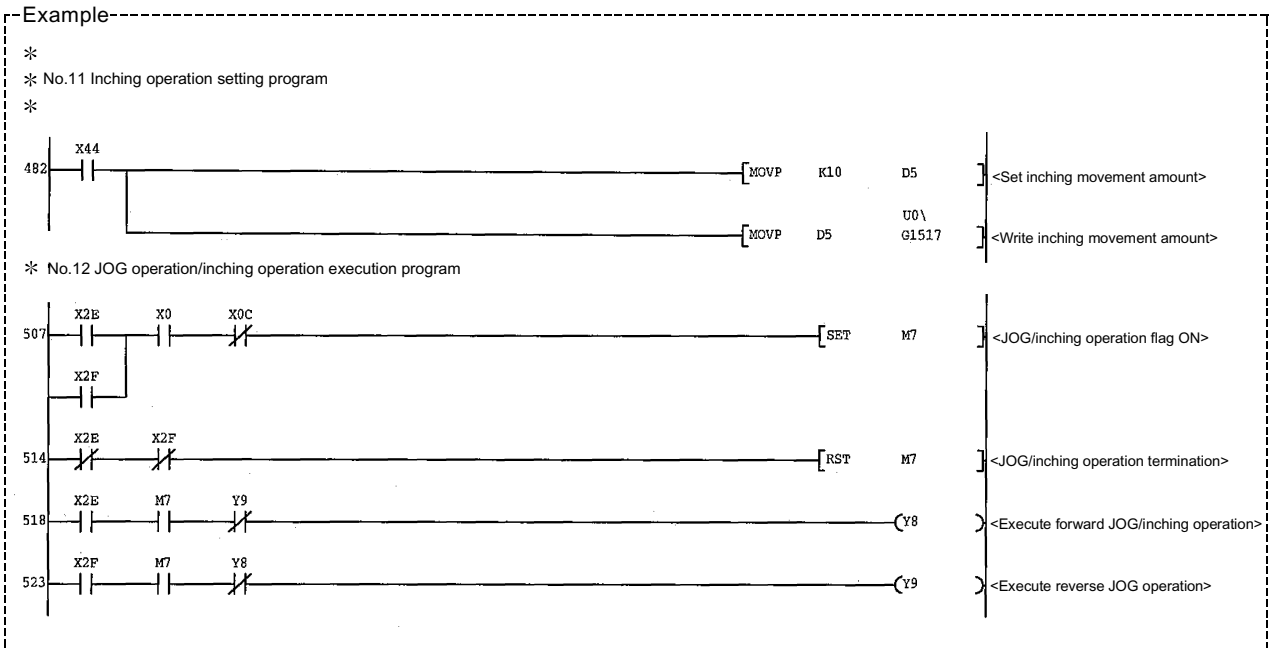

11.3.5 Inching operation example

■ When "stop signal" is turned ON during inching operation:

If "stop signal" is turned ON during inching operation, the inching operation will be stopped.  
 While the stop signal is turned ON, the JOG start signal is ignored.  
 The inching operation can be re-started when the stop signal is turned OFF and then re-turned ON.

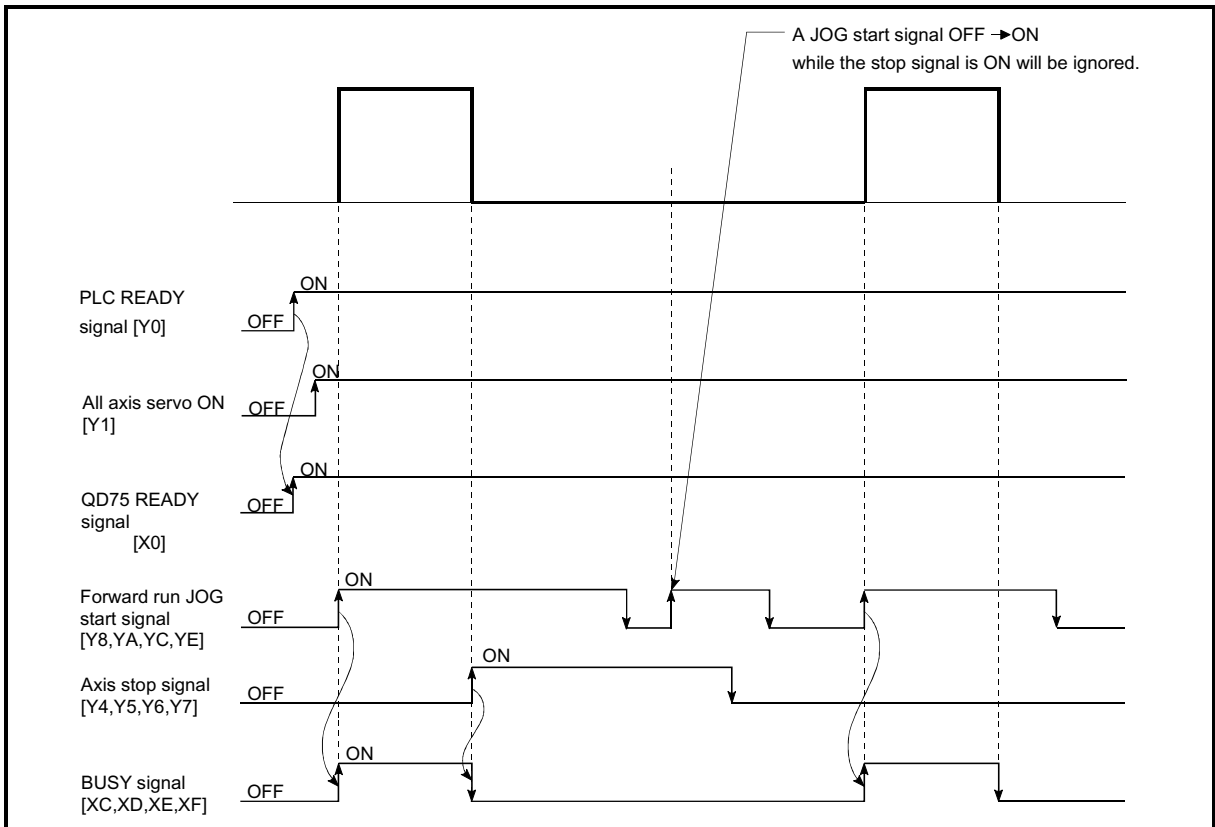


Fig. 11.15 Operation when stop signal is turned ON during inching operation

**POINT**  
 The QD75 will not accept "JOG start signal" while "stop signal" is turned ON.

■ When "JOG start signal" is turned ON when peripheral devices are in the test mode:

If "JOG start signal" is turned ON when peripheral devices are in the test mode, the "JOG start signal" will be ignored and inching operation will not be carried out.

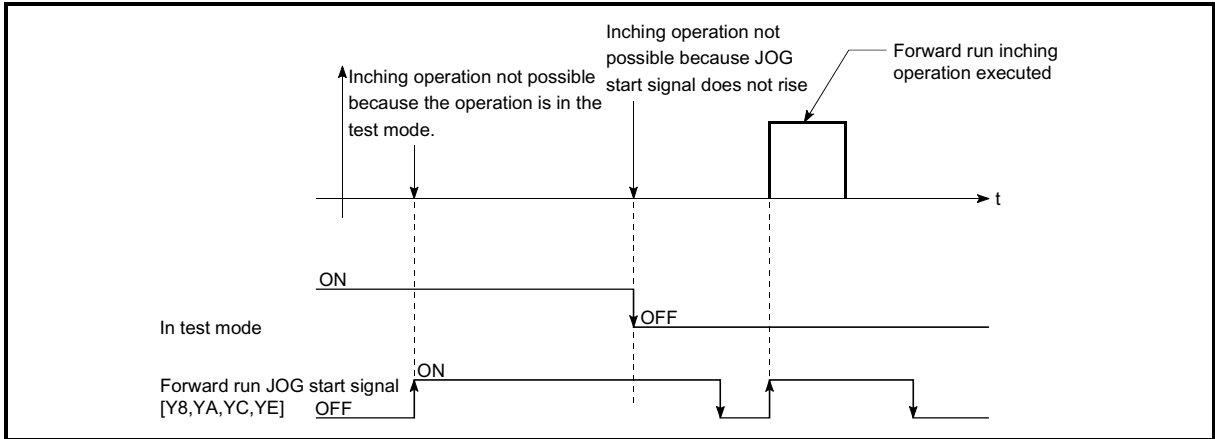


Fig. 11.16 Operation when JOG start signal is turned ON in test mode

■ When "JOG start signal" is turned ON immediately after stop signal OFF (within 100 ms):

If "JOG start signal" is turned ON immediately after the stop signal is turned OFF (within 100 ms), the "JOG start signal" will be ignored and inching operation will not be carried out.

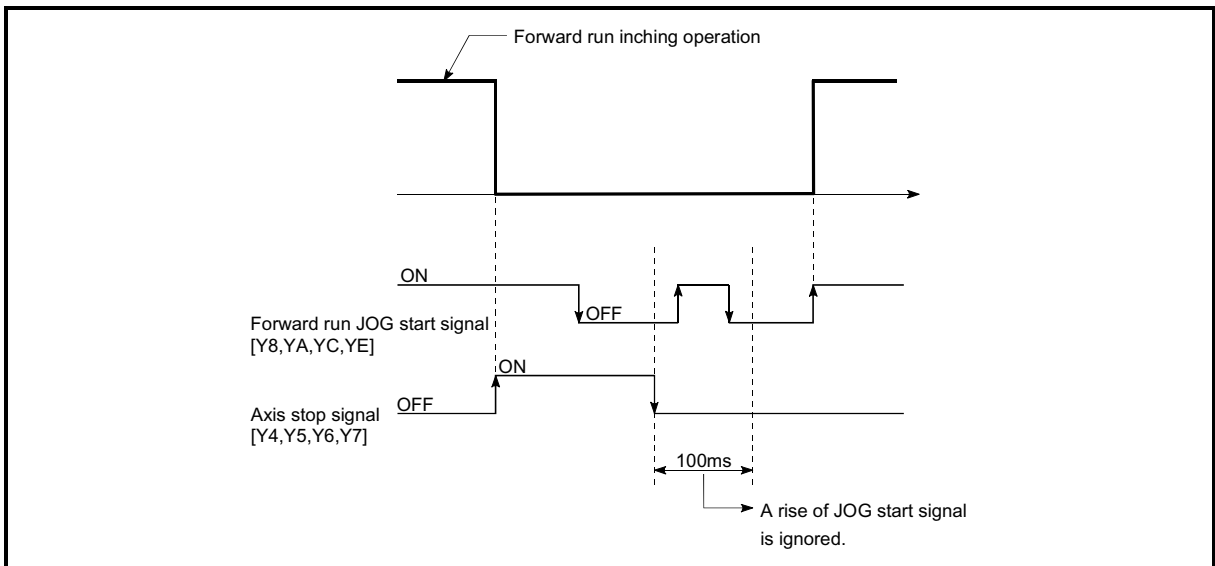


Fig. 11.17 Operation when JOG start signal is turned ON immediately after stop signal is turned OFF

11.4 Manual pulse generator operation

11.4.1 Outline of manual pulse generator operation

**Important**

Create the PLC program so that "Cd.21 Manual pulse generator enable flag" is always set to "0" (disabled) when a manual pulse generator operation is not carried out.

\* Mistakenly touching the manual pulse generator when the manual pulse generator enable flag is set to "1" (enable) can cause accidents or incorrect positioning.

■ Manual pulse generator operation

In manual pulse generator operations, pulses are input to the QD75 from the manual pulse generator. This causes the same No. of input pulses to be output from the QD75 to the servo amplifier, and the workpiece is moved in the designated direction.

The following shows an example of manual pulse generator operation.

1)	When the "Cd.21 Manual pulse generator enable flag" is set to "1", the BUSY signal turns ON and the manual pulse generator operation is enabled.
2)	The workpiece is moved corresponding to the No. of pulses input from the manual pulse generator.
3)	The workpiece movement stops when no more pulses are input from the manual pulse generator.
4)	When the "Cd.21 Manual pulse generator enable flag" is set to "0", the BUSY signal turns OFF and the manual pulse generator operation is disabled.

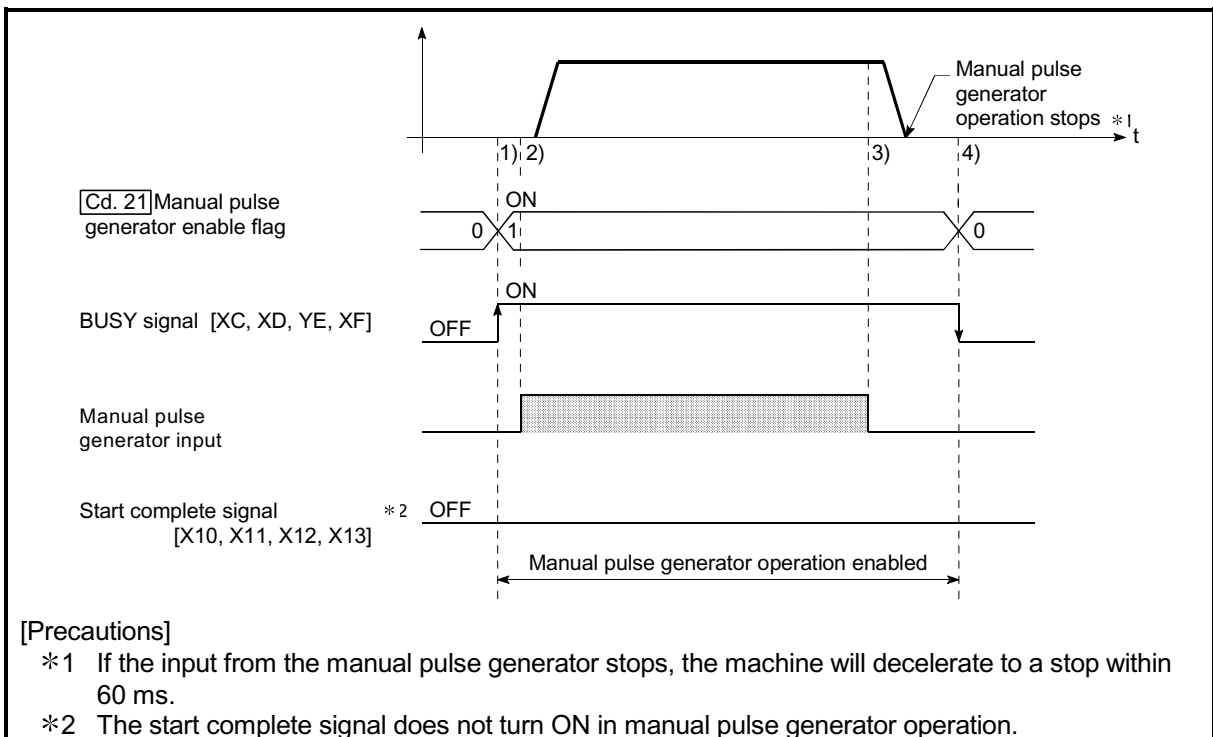


Fig. 11.18 Manual pulse generator operation

### ■ Restricted items

A manual pulse generator is required to carry out manual pulse generator operation.

### ■ Precautions during operation

The following details must be understood before carrying out manual pulse generator operation.

- (1) The speed during manual pulse generator operation is not limited by the " [Pr.8] Speed limit value".
- (2) If the " [Cd.21] Manual pulse generator enable flag" is turned ON while the QD75 is BUSY (BUSY signal ON), a warning will occur (warning code 100: start during operation).
- (3) If a stop factor occurs during manual pulse generator operation, the operation will stop, and the BUSY signal will turn OFF.  
At this time, the " [Cd.21] Manual pulse generator enable flag" will be left ON, but manual pulse generator operation will not be possible. To carry out manual pulse generator operation again, measures must be carried out to eliminate the stop factor. Once eliminated, the operation can be carried out again by turning the " [Cd.21] Manual pulse generator enable flag" ON → OFF → ON.
- (4) Pulses will not be output if an error occurs when the manual pulse generator operation starts.

### Important

When the speed command beyond the following calculated value is input into the positioning module using the manual pulse generator, the servo error "2035: data error" (detection of the alarm "35: command frequency error at the servo amplifier) may occur.

The following calculation formula is used to judge whether or not an error will occur.

Output pulse of manual pulse generator × Magnification × Electronic gear  
(number of pulses per revolution/movement amount per revolution) × Number of  
revolutions of manual pulse generator for one second = Speed command pps

When the speed command is larger than 2500000pps (2.5Mpps), an error may occur.

[Calculation example for setting]

$$100\text{pls} \times 50 \times 131072 / 500 \times 2 = 2621440\text{pps}$$

(Speed of two revolutions for one second) = 2.6Mpps

Occurrence of data error

With detection of an alarm at the servo amplifier, "2035: data error" will be given when the command from the positioning module is larger than 2.5Mpps.

Because the command is issued according to the pulse input irrelevant of the speed limit setting when the manual pulse generator is used for entry, "2035: data error" will occur if a speed command, which the servo amplifier cannot follow up, is input.


In the case of a high setting magnification, there is a high possibility of error occurrence. Therefore, perform the setting so that the setting magnification of the manual pulse generator decreases to the level where "2035: data error" will not occur.

**REMARK**

- ≠ One QD75 module can be connected to one manual pulse generator.
- ≠ The QD75 module can simultaneously command to the axis 1 to axis 4 servo amplifier by one manual pulse generator.  
(axis 1 to axis 4 simultaneous operation is possible.)

**Errors during operation**

When the operation is stopped by the stroke limit (limit signal OFF), manual pulse generator operation can be performed in the direction in which the limit signal turns ON after an error reset. (An error will occur again if pulse input is provided in the direction in which the limit signal turns OFF is turned ON.)

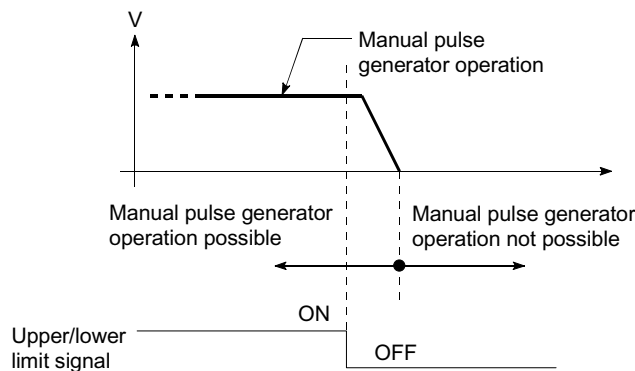

**Manual pulse generator operation timing and processing time**

The following drawing shows details of the manual pulse generator operation timing and processing time.

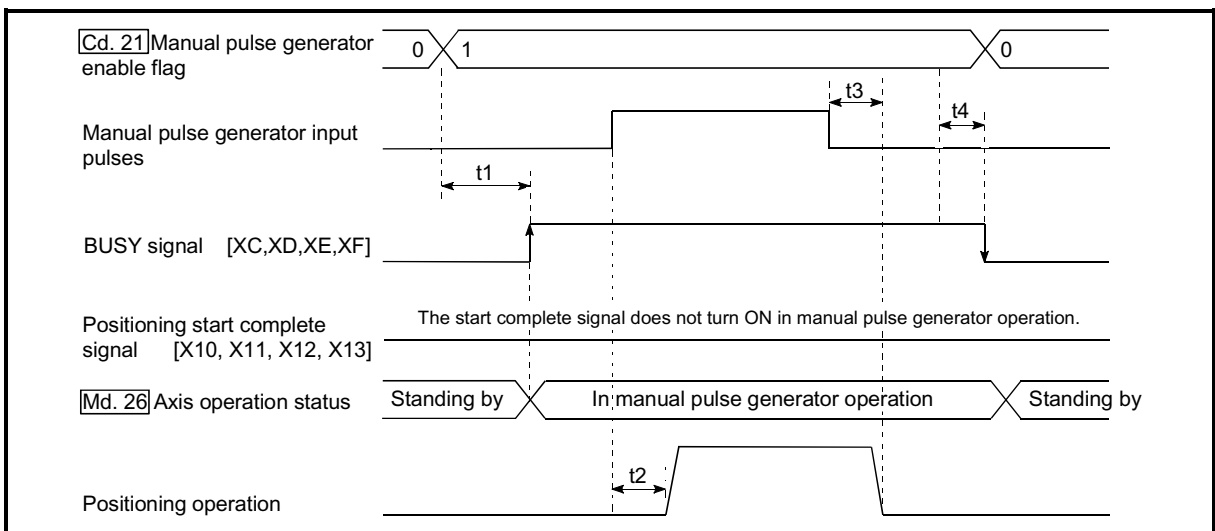


Fig. 11.19 Manual pulse generator operation timing and processing times

Normal timing times

Unit : ms

t1	t2	t3	t4
113.6	4.34	4.34	113.6

≠ Delays may occur in the t1 timing time due to the operation status of other axes.



■ Position control by manual pulse generator operation

In manual pulse generator operation, the position is moved by a "manual pulse generator 1 pulse movement amount" per pulse.

The current feed value in the positioning control by manual pulse generator operation can be calculated using the expression shown below.

$$\text{Current feed value} = \text{Number of input pulses} \times \text{Cd.20 Manual pulse generator 1 pulse input magnification} \times \text{Manual pulse generator 1 pulse movement amount}$$

Pr.1 Unit setting	mm	inch	degree	PLS
Manual pulse generator 1 pulse movement amount	0.1μm	0.00001inch	0.00001degree	1PLS

For example, when "Pr.1 Unit setting" is mm and "Cd.20 Manual pulse generator 1 pulse input magnification" is 2, and 100 pulses are input from the manual pulse generator, the current feed value is as follows.

$$100 \times 2 \times 0.1 = 20 [\mu\text{m}]$$


■ Speed control by manual pulse generation operation

The speed during positioning control by manual pulse generator operation is a speed corresponding to the No. of input pulses per unit time, and can be obtained using the following equation.

$$\text{Output command frequency} = \text{Input frequency} \Delta \text{Cd.20 Manual pulse generator 1 pulse input magnification}$$

11.4.2 Manual pulse generator operation execution procedure

The manual pulse generator operation is carried out by the following procedure.

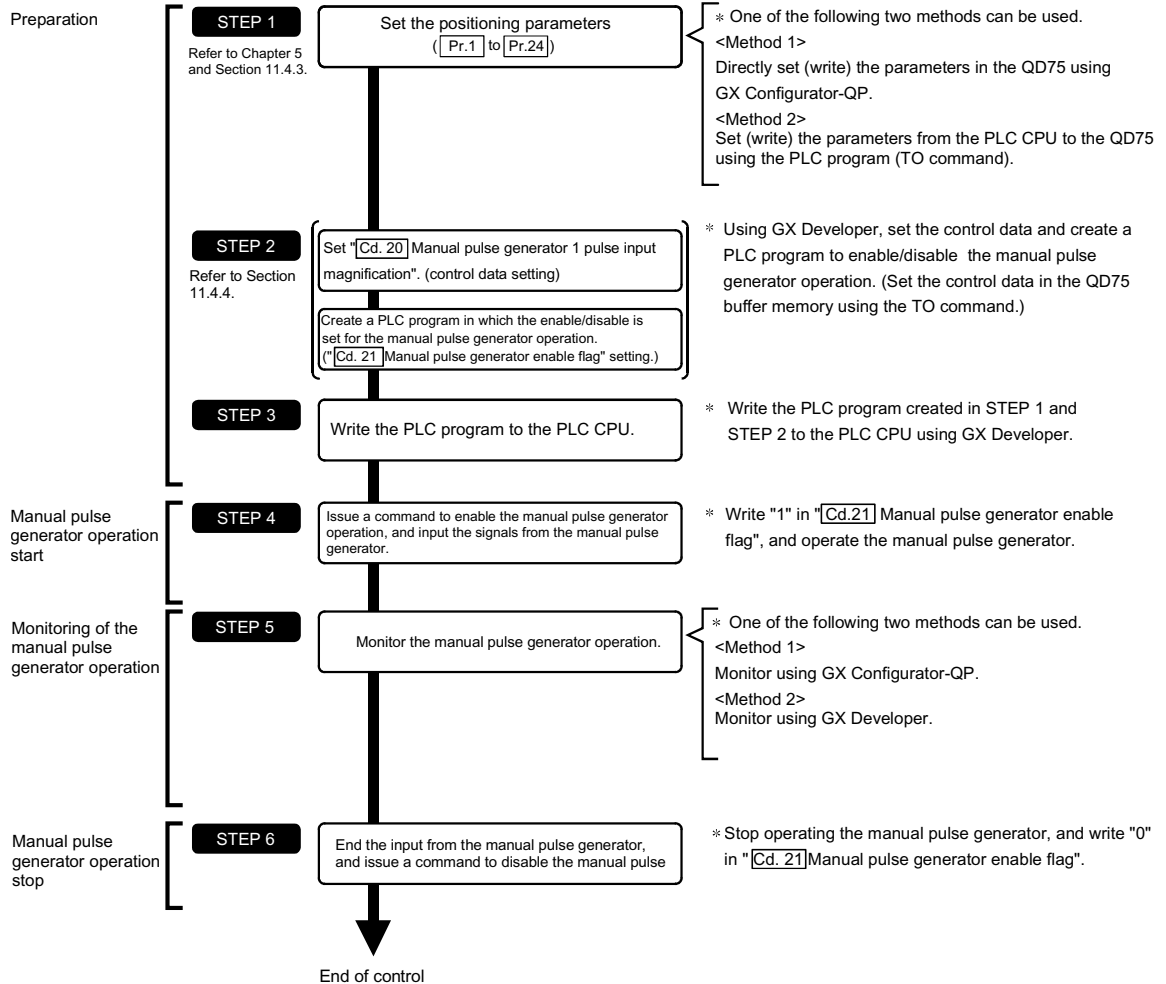

**REMARK**

- ∄ Mechanical elements such as limit switches are considered as already installed.
- ∄ Positioning parameter settings work in common for all control using the QD75.

## 11.4.3 Setting the required parameters for manual pulse generator operation

The "Positioning parameters" must be set to carry out manual pulse generator operation.

The following table shows the setting items of the required parameters for carrying out manual pulse generator operation. When only manual pulse generator operation will be carried out, no parameters other than those shown below need to be set. (Use the initial values or setting values within a range where no error occurs for trouble-free operation.)

Setting item		Setting requirement	Factory-set initial value (setting details)	
Positioning parameters	Pr.1	Unit setting	☉	3 (PLS)
	Pr.2	No. of pulses per rotation (AP) (Unit: PLS)	☉	20000
	Pr.3	Movement amount per rotation (AL) (Unit: PLS)	☉	20000
	Pr.4	Unit magnification (AM)	☉	1 (1 times)
	Pr.8	Speed limit value (Unit: PLS/s)	☉	20000
	Pr.11	Backlash compensation amount (Unit: PLS)	○	0
	Pr.12	Software stroke limit upper limit value (Unit: PLS)	○	2147483647
	Pr.13	Software stroke limit lower limit value (Unit: PLS)	○	-2147483648
	Pr.14	Software stroke limit selection	○	0 (current feed value)
	Pr.15	Software stroke limit valid/invalid setting	○	0 (valid)
	Pr.17	Torque limit setting value (Unit: %)	○	300
	Pr.22	Input signal logic selection	○	0 (Manual pulse generator input is negative logic.)
	Pr.24	Manual pulse generator input selection	○	0 (4 times multiplication of A phase/B phase)

☉ : Setting always required.

○ : Set according to requirements (Leave set to the initial value when not used.)

### REMARK

≠ Positioning parameter settings work in common for all control using the QD75.

When carrying out other control ("major positioning control", "high-level positioning control", "OPR positioning control"), the respective setting items must also be matched and set.

≠ Parameters are set for each axis. But Pr.22 Manual pulse generator input logic (b8), Pr.24 is set only for axis 1. (The setting for axes 2,3, and 4 is ignored.)

≠ Refer to Chapter 5 "Data Used for Positioning Control" for setting details.

11.4.4 Creating a program to enable/disable the manual pulse generator operation

A PLC program must be created to execute a manual pulse generator operation. Consider the "required control data setting", "start conditions" and "start time chart" when creating the program.

The following shows an example when a manual pulse generator operation is started for axis 1.

■ Required control data setting

The control data shown below must be set to execute a manual pulse generator operation. The setting is carried out with the PLC program.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.20 Manual pulse generator 1 pulse input magnification	1	Set the manual pulse generator 1 pulse input magnification.	1522 1523	1622 1623	1722 1723	1822 1823
Cd.21 Manual pulse generator enable flag	1 (0)	Set "1: Enable manual pulse generator operation". (Set "0: Disable manual pulse generator operation" when finished with the manual pulse generator operation.)	1524	1624	1724	1824

\* Refer to Section 5.7 "List of control data" for details on the setting details.

■ Start conditions

The following conditions must be fulfilled when starting. The required conditions must also be assembled in the PLC program, and the PLC program must be configured so the operation will not start if the conditions are not fulfilled.

Signal name	Signal state	Device								
		Axis 1	Axis 2	Axis 3	Axis 4					
Interface signal	PLC READY signal	ON	PLC CPU preparation completed				Y0			
	QD75 READY signal	ON	QD75 preparation completed				X0			
	All axis servo ON	ON	All axis servo ON				Y1			
	Synchronization flag *	ON	QD75 buffer memory The access is possible.				X1			
	Axis stop signal	OFF	Axis stop signal is OFF				Y4	Y5	Y6	Y7
	Start complete signal	OFF	Start complete signal is OFF				X10	X11	X12	X13
	BUSY signal	OFF	QD75 is not operating				XC	XD	XE	XF
	Error detection signal	OFF	There is no error				X8	X9	XA	XB
M code ON signal	OFF	M code ON signal is OFF				X4	X5	X6	X7	
External signal	Stop signal	OFF	Stop signal is OFF				-			
	Upper limit (FLS)	ON	Within limit range				-			
	Lower limit (RLS)	ON	Within limit range				-			

\* If the PLC CPU is set to the asynchronous mode in the synchronization setting, this must be inserted in the program for interlocking. If it is set to the synchronous mode, it must not be inserted in the program for interlocking because it is turned ON when the PLC CPU executes calculation.

■ Start time chart


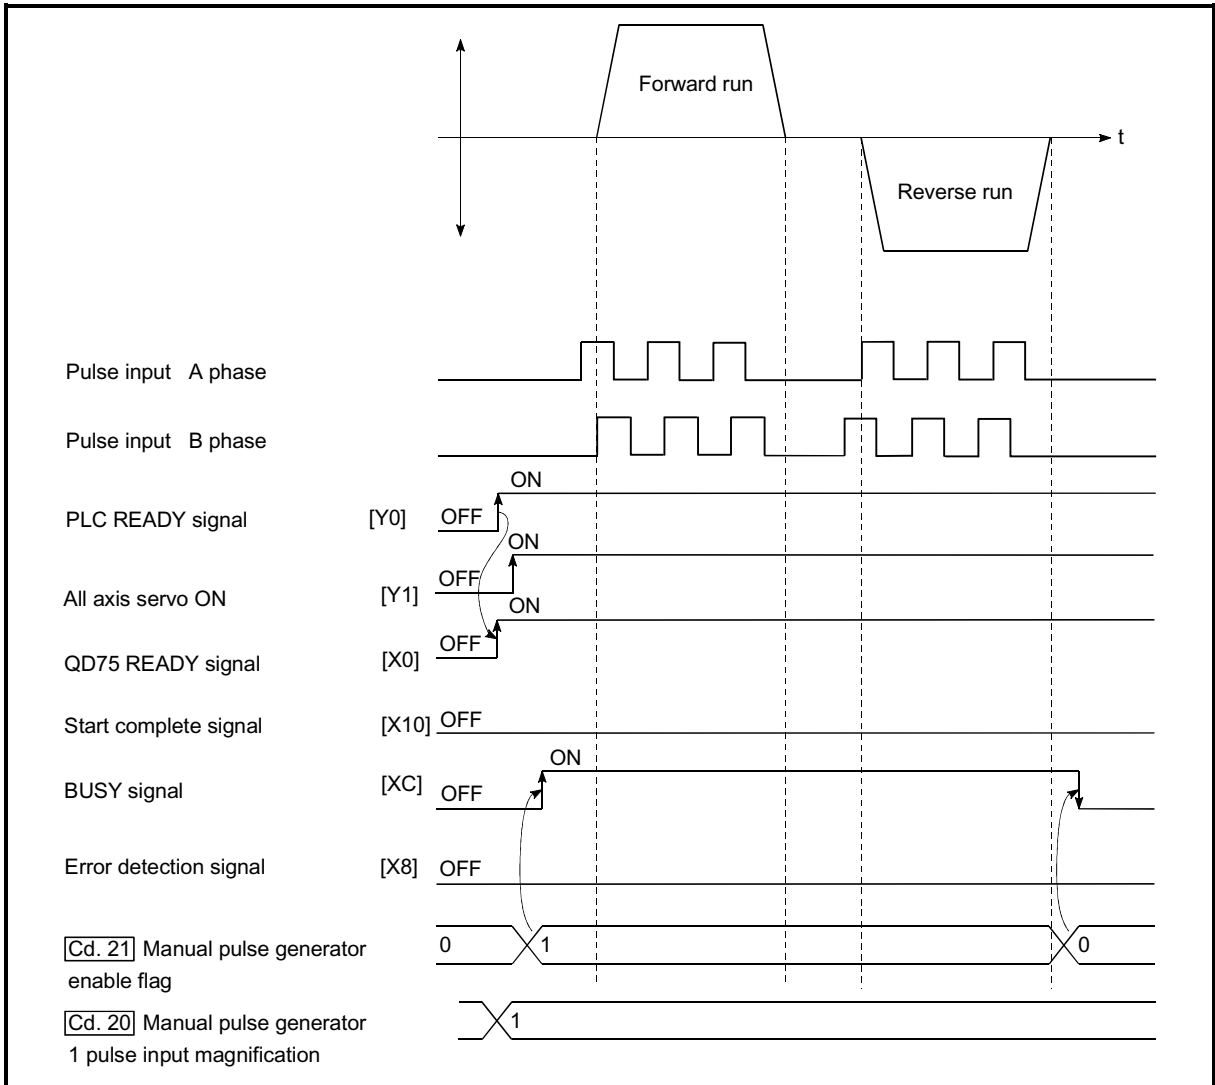


Fig. 11.20 Manual pulse generator operation start time chart

■ Creating the program



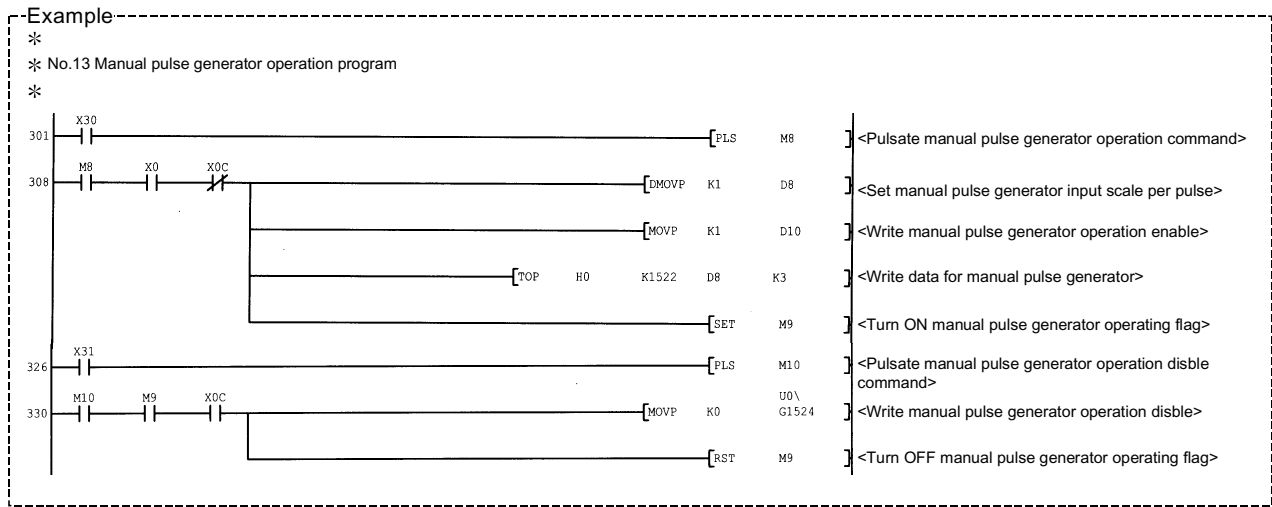

# Chapter 12 Control Sub Functions

The details and usage of the "sub functions" added and used in combination with the main functions are explained in this chapter.

A variety of sub functions are available, including functions specifically for machine OPR and generally related functions such as control compensation, etc. More appropriate, finer control can be carried out by using these sub functions. Each sub function is used together with a main function by creating matching parameter settings and PLC programs. Read the execution procedures and settings for each sub function, and set as required.

12.1	Outline of sub functions .....	12- 2
12.1.1	Outline of sub functions .....	12- 2
12.2	Sub functions specifically for machine OPR .....	12- 4
12.2.1	OPR retry function .....	12- 4
12.2.2	OP shift function .....	12- 8
12.3	Functions for compensating the control .....	12- 11
12.3.1	Backlash compensation function .....	12- 11
12.3.2	Electronic gear function .....	12- 13
12.3.3	Near pass function .....	12- 20
12.4	Functions to limit the control .....	12- 23
12.4.1	Speed limit function .....	12- 23
12.4.2	Torque limit function .....	12- 25
12.4.3	Software stroke limit function .....	12- 29
12.4.4	Hardware stroke limit function .....	12- 35
12.5	Functions to change the control details .....	12- 37
12.5.1	Speed change function .....	12- 37
12.5.2	Override function .....	12- 44
12.5.3	Acceleration/deceleration time change function .....	12- 47
12.5.4	Torque change function .....	12- 51
12.6	Absolute position system .....	12- 54
12.7	Other functions .....	12- 56
12.7.1	Step function .....	12- 56
12.7.2	Skip function .....	12- 61
12.7.3	M code output function .....	12- 64
12.7.4	Teaching function .....	12- 68
12.7.5	Target position change function .....	12- 74
12.7.6	Command in-position function .....	12- 78
12.7.7	Acceleration/deceleration processing function .....	12- 81
12.7.8	Pre-reading start function .....	12- 84
12.7.9	Deceleration start flag function .....	12- 89
12.7.10	Stop command processing for deceleration stop function .....	12- 93
12.8	Other functions .....	12- 96
12.8.1	Servo ON/OFF .....	12- 96
12.8.2	Follow up function .....	12- 97
12.9	Precautions for MR-J2M-B connection .....	12- 98



12.1 Outline of sub functions

"Sub functions" are functions that compensate, limit, add functions, etc., to the control when the main functions are executed. These sub functions are executed by parameter settings, commands from GX Configurator-QP, sub function PLC programs, etc.

12.1.1 Outline of sub functions

The following table shows the types of sub functions available.

Sub function		Details
Functions characteristic to machine OPR	OPR retry function	This function retries the OPR with the upper/lower limit switches during machine OPR. This allows machine OPR to be carried out even if the axis is not returned to before the near-point dog with JOG operation, etc.
	OP shift function	After returning to the machine OP, this function offsets the position by the designated distance from the machine OP position and sets that position as the OP address.
Functions that compensate control	Backlash compensation function	This function compensates the mechanical backlash. Feed pulses equivalent to the set backlash amount are output each time the movement direction changes.
	Electronic gear function	By setting the movement amount per pulse, this function can freely change the machine movement amount per commanded pulse. When the movement amount per pulse is set, a flexible positioning system that matches the machine system can be structured.
	Near pass function *1	This function suppresses the machine vibration when the speed changes during continuous path control in the interpolation control.
Functions that limit control	Speed limit function	If the command speed exceeds " [Pr.8] Speed limit value" during control, this function limits the commanded speed to within the " [Pr.8] Speed limit value" setting range.
	Torque limit function	If the torque generated by the servomotor exceeds " [Pr.17] Torque limit setting value" during control, this function limits the generated torque to within the " [Pr.17] Torque limit setting value" setting range.
	Software stroke limit function	If a command outside of the upper/lower limit stroke limit setting range, set in the parameters, is issued, this function will not execute positioning for that command.
	Hardware stroke limit function	This function carries out deceleration stop with the limit switch connected to the QD75 external device connector.
Functions that change control details	Speed change function	This function changes the speed during positioning. Set the changed speed in the speed change buffer memory ( [Cd.14] New speed value), and change the speed with the speed change request ( [Cd.15] Speed change request).
	Override function	This function changes the speed within a percentage of 1 to 300% during positioning. This is executed using " [Cd.13] Positioning operation speed override".
	Acceleration/deceleration time change function	This function changes the acceleration/deceleration time during speed change.
	Torque change function	This function changes the "torque limit value" during control.

\*1 The near pass function is validated only when the machine of the standard specification carries out the position control with the continuous path control mode.  
It cannot be invalidated with parameters.

Sub function	Details	
Absolute position system function	<p>This function holds the current value.</p> <p>This function sets the absolute position coordinate in relation to the OP in the machine movement range, and prevent the OP from being lost even if the power supply is turned OFF to ON.</p>	
Other functions	Step function	<p>This function temporarily stops the operation to confirm the positioning operation during debugging, etc.</p> <p>The operation can be stopped at each "automatic deceleration" or "positioning data".</p>
	Skip function	<p>This function stops the positioning being executed (decelerates to a stop) when the skip signal is input, and carries out the next positioning.</p>
	M code output function	<p>This function issues a sub work (clamp or drill stop, tool change, etc.) according to the code No. (0 to 65535) set for each positioning data.</p>
	Teaching function	<p>This function stores the address positioned with manual control into the positioning address ( [Da.6] Positioning address/movement amount) having the designated positioning data No.</p>
	Target position change function	<p>This function changes the target position during the execution of positioning. At the same time, this also can change the speed.</p>
	Command in-position function	<p>At each automatic deceleration, this function calculates the remaining distance for the QD75 to reach the positioning stop position, and when the value is less than the set value, sets the "command in-position flag".</p> <p>When using another sub work before ending the control, use this function as a trigger for the sub work.</p>
	Acceleration/deceleration process function	<p>This function adjusts the control acceleration/deceleration.</p>
	Pre-reading start function	<p>This function shortens the virtual start time.</p>
Deceleration start flag function	<p>Function that turns ON the flag when the constant speed status or acceleration status switches to the deceleration status during position control, whose operation pattern is "Positioning complete", to make the stop timing known.</p>	
Stop command processing for deceleration stop function	<p>Function that selects a deceleration curve when a stop cause occurs during deceleration stop processing to speed 0.</p>	

12.2 Sub functions specifically for machine OPR

The sub functions specifically for machine OPR include the "OPR retry function" and "OP shift function". Each function is executed by parameter setting.

12.2.1 OPR retry function

When the workpiece goes past the OP without stopping during positioning control, it may not move back in the direction of the OP although a machine OPR is commanded, depending on the workpiece position. This normally means the workpiece has to be moved to a position before the near-point dog by a JOG operation, etc., to start the machine OPR again. However, by using the OPR retry function, a machine OPR can be carried out regardless of the workpiece position.

The details shown below explain about the "OPR retry function".

- [1] Control details
- [2] Precautions during control
- [3] Setting the OPR retry function

[1] Control details

The following drawing shows the operation of the OPR retry function.

- (1) OPR retry point return retry operation when the workpiece is within the range between the upper and lower limits.

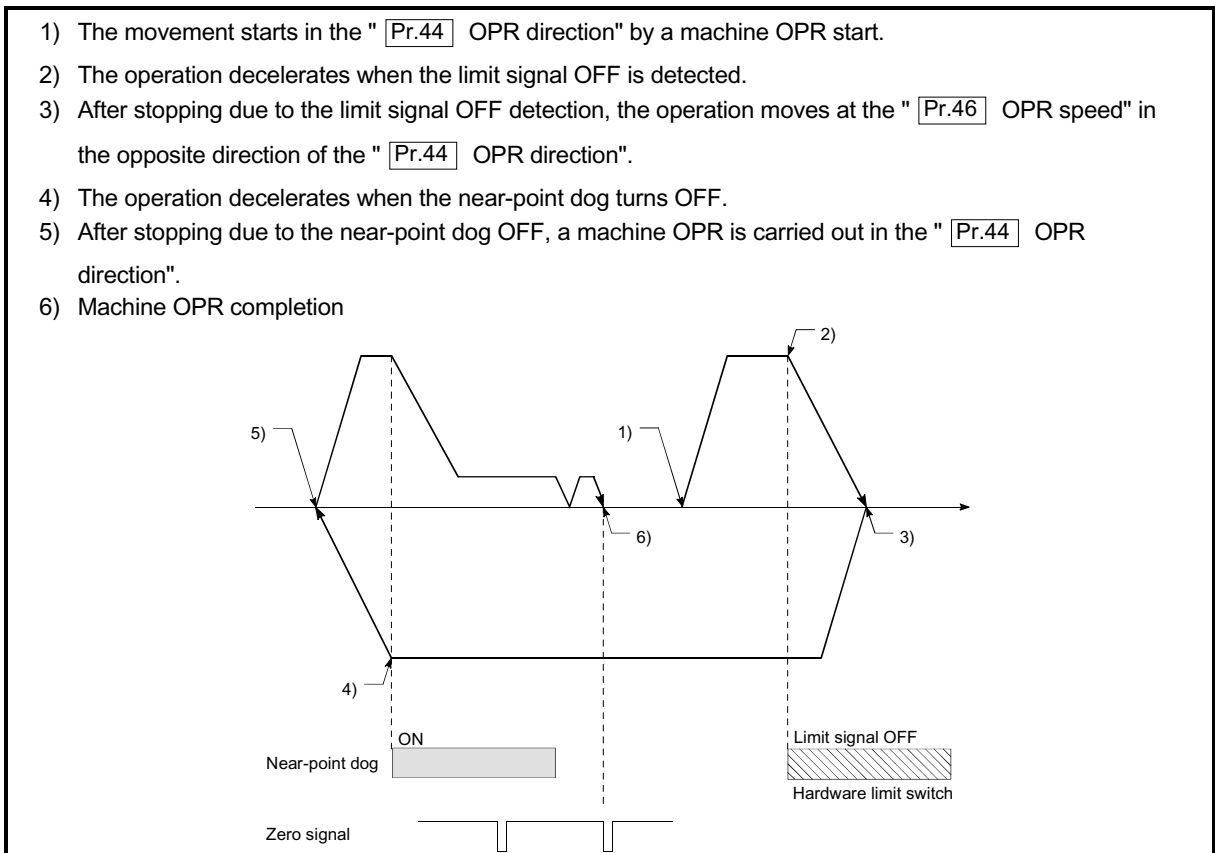


Fig. 12.1 OPR retry operation by limit signal detection

(2) OPR retry operation when the workpiece is outside the range between the upper and lower limits.

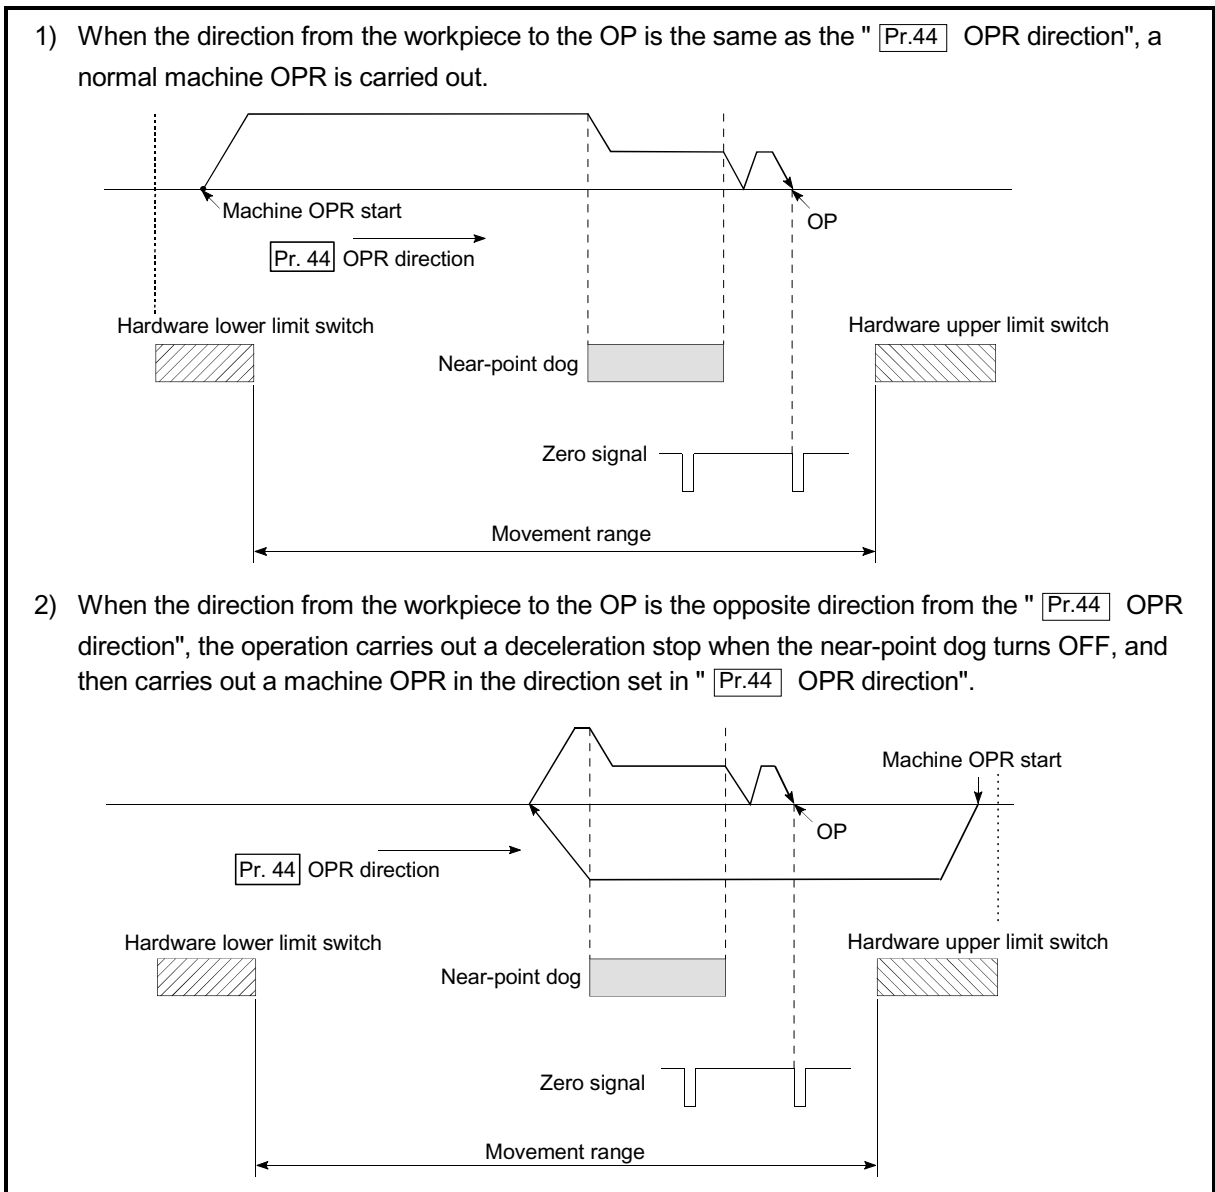


Fig. 12.2 OPR retry operation from on limit (limit signal OFF)

(3) Setting the dwell time during an OPR retry

The OPR retry function can perform such function as the dwell time using " Pr.57 Dwell time at OPR retry" when the reverse run operation is carried out due to detection by the limit signal for upper and lower limits and when the machine OPR is executed after the near point dog is turned OFF to stop the operation.

" Pr.57 Dwell time during OPR " is validated when the operation stops at the "A" and "B" positions in the following drawing. (The dwell time is the same value at both positions "A" and "B".)

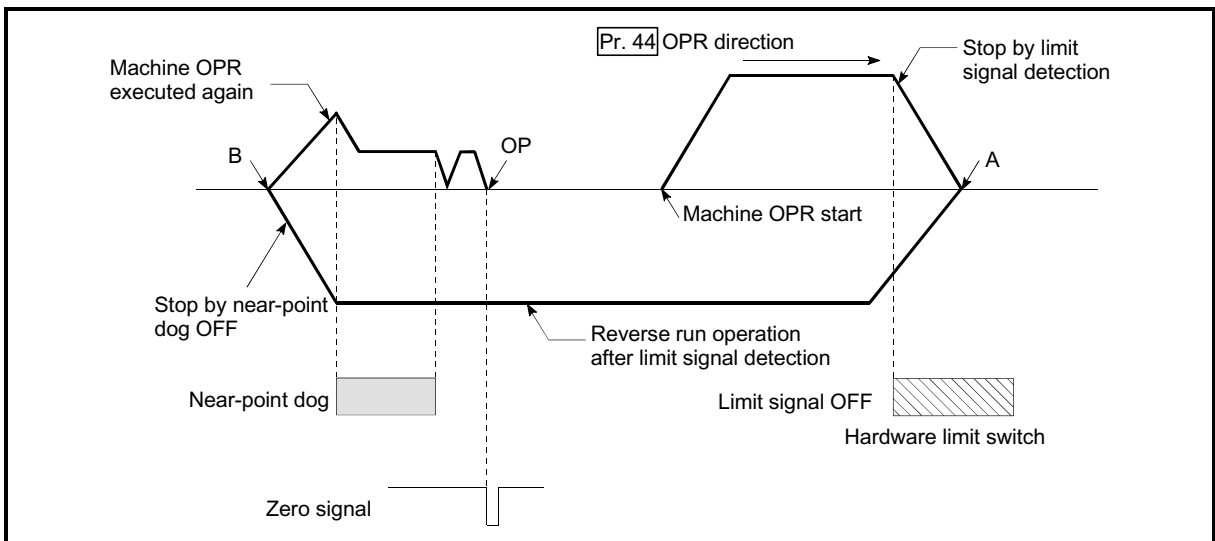


Fig. 12.3 Setting the dwell time during an OPR retry

## [2] Precaution during control

- (1) The following table shows whether the OPR retry function may be executed by the " [Pr.43] OPR method".

[Pr.43] OPR method	Execution status of OPR retry function
Near-point dog method	○ : Execution possible
Count method 1)	○ : Execution possible
Count method 2)	○ : Execution possible
Data set method	— :

- (2) Always establish upper/lower limit switches at the upper/lower limit positions of the machine, and connect an QD75 module. If the OPR retry function is used without hardware stroke limit switches, the motor will continue rotation until a hardware stroke limit signal is detected.
- (3) Always wire QD75 upper/lower limit switches even when the OPR function is invalidated. Control cannot be carried out with the QD75 unless the wiring is carried out.
- (4) Do not carry out settings so that the servo amplifier power turns OFF by the upper/lower limit switches connected to the QD75. If the servo amplifier power is turned OFF, the OPR retry cannot be carried out.
- (5) The operation decelerates upon detection of the hardware limit signal, and the movement starts in the opposite direction. In this case, however, an error (104, 105) is not produced.

## [3] Setting the OPR retry function

To use the "OPR retry function", set the required details in the parameters shown in the following table, and write them to the QD75.

When the parameters are set, the OPR retry function will be added to the machine OPR control. The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0). Set " [Pr.57] Dwell time during OPR retry" according to the user's requirements.

Setting item	Setting value	Setting details	Factory-set initial value
[Pr.48] OPR retry	1	Set "1: Carry out OPR retry by limit switch".	0
[Pr.57] Dwell time during OPR retry	→	Set the deceleration stop time during OPR retry. (Random value between 0 and 65535 (ms))	0

\* Refer to Section 5.2 "List of parameters" for setting details.

**REMARK**

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

12.2.2 OP shift function

When a machine OPR is carried out, the OP is normally established using the near-point dog, stopper, and zero signal. However, by using the OP shift function, the machine can be moved a designated movement amount from the position where the zero signal was detected. A mechanically established OP can then be interpreted at that point.

The OP shift function can be used without relation to " [Pr.43] OPR method".

The details shown below explain about the "OP shift function".

- [1] Control details
- [2] Setting range for the OP shift amount
- [3] Movement speed during OP shift
- [4] Precautions during control
- [5] Setting the OP shift function

[1] Control details

The following drawing shows the operation of the OP shift function.

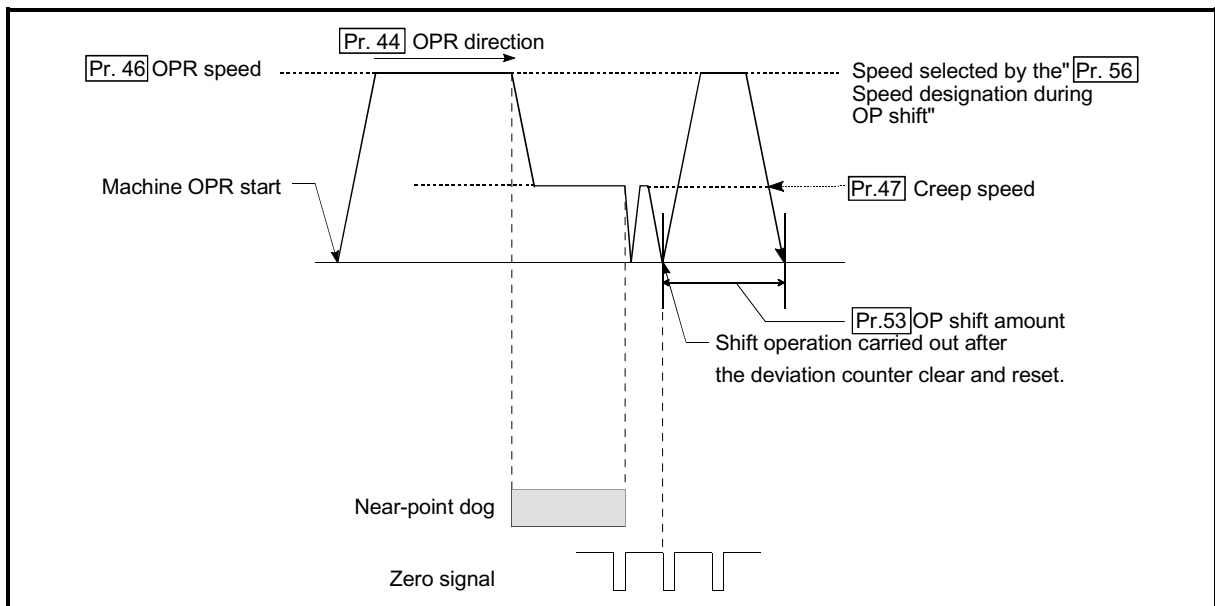


Fig. 12.4 OP shift operation

[2] Setting range for the OP shift amount

Set the OP shift amount within the range from the detected zero signal to the upper/lower limit switches.

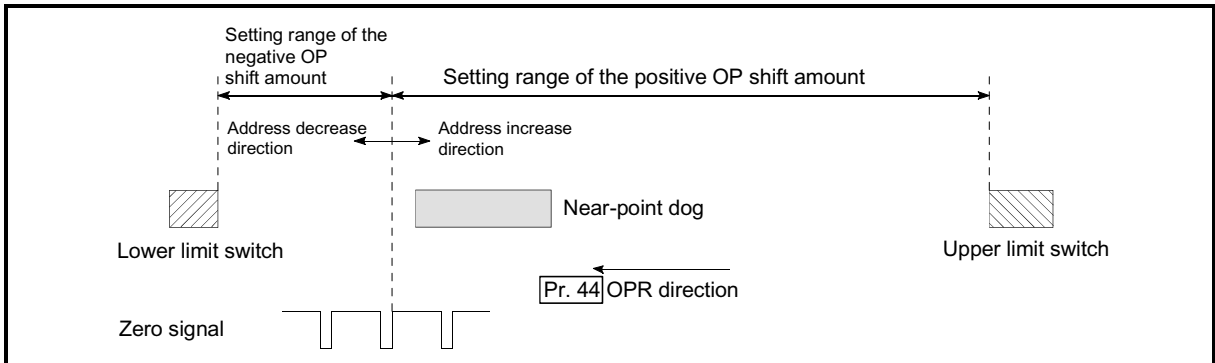


Fig. 12.5 Setting range for the OP shift amount

[3] Movement speed during OP shift

When using the OP shift function, the movement speed during the OP shift is set in "Pr.56 Speed designation during OP shift". The movement speed during the OP shift is selected from either the "Pr.46 OPR speed" or the "Pr.47 Creep speed".

The following drawings show the movement speed during the OP shift when a mechanical OPR is carried out by the near-point dog method.

(1) OP shift operation at the "Pr.46 OPR speed"

(When "Pr.56 speed designation during OP shift" is 0)

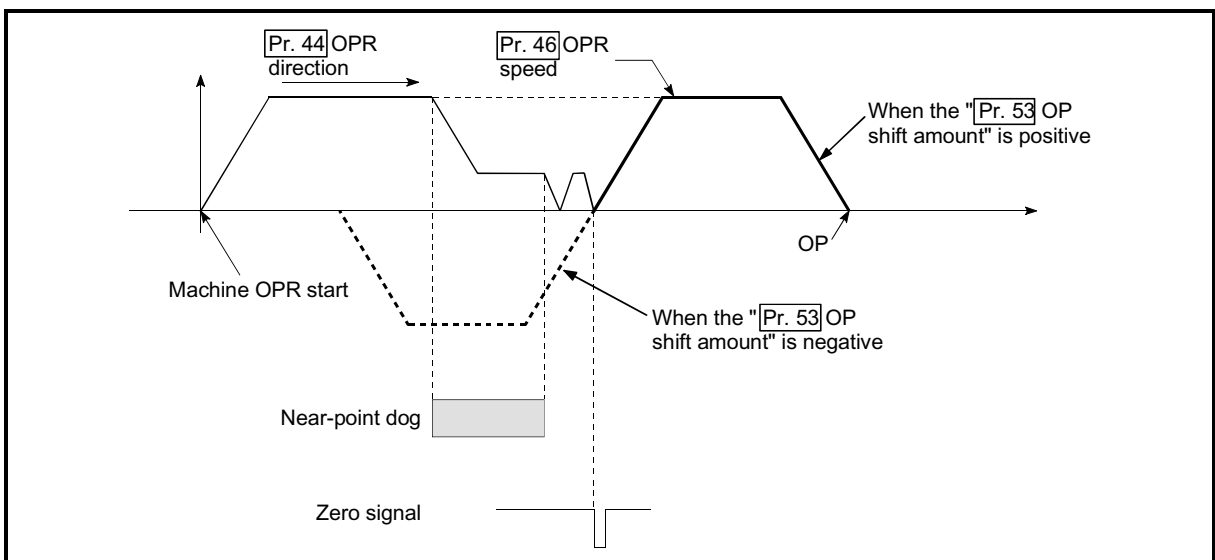


Fig. 12.6 OP shift operation at the OPR speed



- (2) OP shift operation at the " Pr.47 Creep speed"  
 (When " Pr.56 Speed designation during OP shift" is 1)

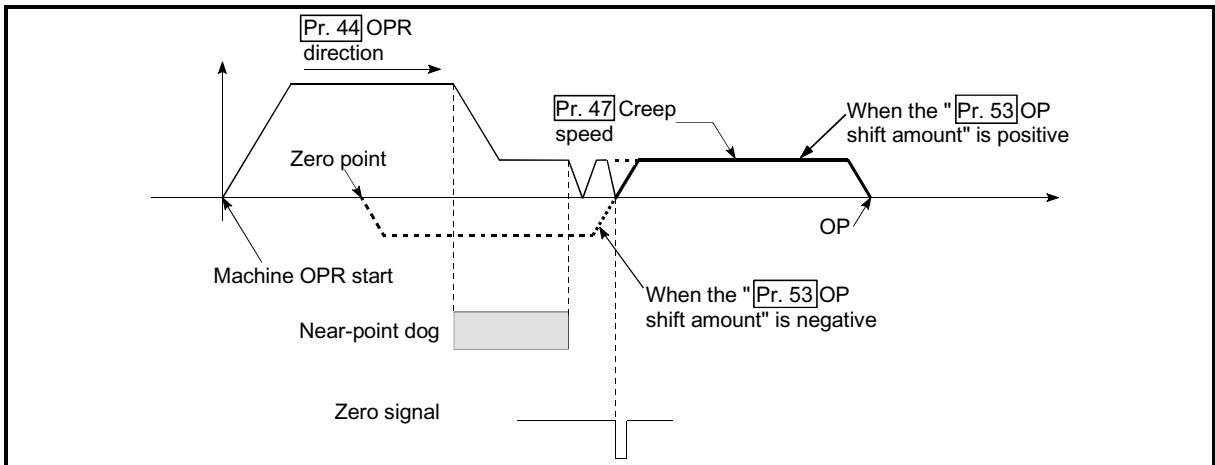


Fig. 12.7 OP shift operation at the creep speed

[4] Precautions during control

The following data are set after the OP shift amount is complete.

- ≠ OPR complete flag ( Md.31 Status: b4)
- ≠ Md.20 Current feed value
- ≠ Md.21 Machine feed value
- ≠ Md.26 Axis operation status
- ≠ Md.34 Movement amount after near-point dog ON (" Pr.53 OP shift amount" is not added.)
- ≠ OPR request flag ( Md.31 Status: b3) is reset after completion of the OP shift.

[5] Setting the OP shift function

To use the "OP shift function", set the required details in the parameters shown in the following table, and write them to the QD75.

When the parameters are set, the OP shift function will be added to the machine OPR control. The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

Setting item	Setting value	Setting details	Factory-set initial value
Pr.53 OP shift amount	→	Set the shift amount during the OP shift.	0
Pr.56 Speed designation during OP shift	→	Select the speed during the OP shift 0: Pr.46 OPR speed 1: Pr.47 Creep speed	0

\* Refer to Section 5.2 "List of parameters" for setting details.

**REMARK**

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

### 12.3 Functions for compensating the control

The sub functions for compensating the control include the "backlash compensation function", "electronic gear function", and "near pass function". Each function is executed by parameter setting or PLC program creation and writing.

#### 12.3.1 Backlash compensation function

The "backlash compensation function" compensates the backlash amount in the mechanical system. When the backlash compensation amount is set, an extra amount of command equivalent to the set backlash amount is output every time the movement direction changes.

The details shown below explain about the "backlash compensation function".

- [1] Control details
- [2] Precautions during control
- [3] Setting the backlash compensation function

##### [1] Control details

The following drawing shows the operation of the backlash compensation function.

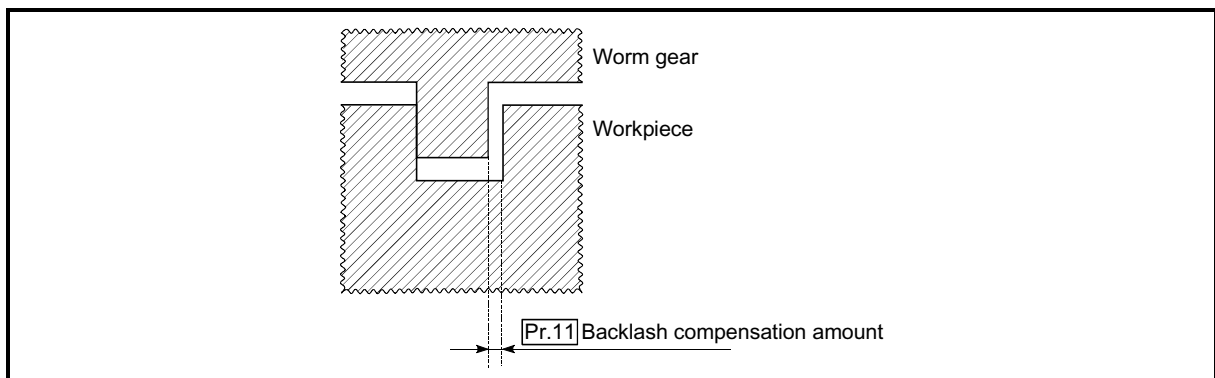


Fig. 12.8 Backlash compensation amount

[2] Precautions during control

- (1) The feed command of the backlash compensation amount are not added to the " [Md.20] Current feed value" or " [Md.21] Machine feed value".
- (2) Always carry out a machine OPR before starting the control when using the backlash compensation function (when " [Pr.11] Backlash compensation amount" is set). The backlash in the mechanical system cannot be correctly compensated if a machine OPR is not carried out.
- (3) Backlash compensation, which includes the movement amount and " [Pr.11] Backlash compensation amount", is output the moment at the moving direction changes.

[3] Setting the backlash compensation function

To use the "backlash compensation function", set the "backlash compensation amount" in the parameter shown in the following table, and write it to the QD75. The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

Setting item		Setting value	Setting details	Factory-set initial value
[Pr.11]	Backlash compensation amount	→	Set the backlash compensation amount.	0

\* Refer to Section 5.2 "List of parameters" for setting details.

**REMARK**

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

### 12.3.2 Electronic gear function

The "electronic gear function" adjusts the pulses calculated and output according to the parameters set in the QD75 with the actual machine movement amount.

The "electronic gear function" has the following three functions ( [A] to [C] ).

- [A] During machine movement, the function increments in the QD75 values less than one pulse that could not be pulse output, and outputs the incremented amount of pulses when the total incremented value reached one pulse or more.
- [B] When machine OPR is completed, current value changing is completed, speed control is started (except when current feed value change is present), or fixed-feed control is started, the function clears to "0" the cumulative values of less than one pulse which could not be output. (If the cumulative value is cleared, an error will occur by a cleared amount in the feed machine value. Control can be constantly carried out at the same machine movement amount, even when the fixed-feed control is continued.)
- [C] The function compensates the mechanical system error of the command movement amount and actual movement amount by adjusting the "electronic gear".  
(The "movement amount per pulse" value is defined by " Pr.2 No. of pulses per rotation (AP)", " Pr.3 Movement amount per rotation (AL)" and " Pr.4 Unit magnification (AM)".)


The QD75 automatically carries out the processing for [A] and [B].

The details shown below explain about the "electronic gear function", including the method for compensating the error in [C] above, etc.

- [1] Basic concept of the electronic gear
- [2] The method for compensating the error

[1] Basic concept of the electronic gear

The electronic gear is an item which determines how many rotations (rotations by how many pulses) the motor must make in order to move the machine according to the programmed movement amount.

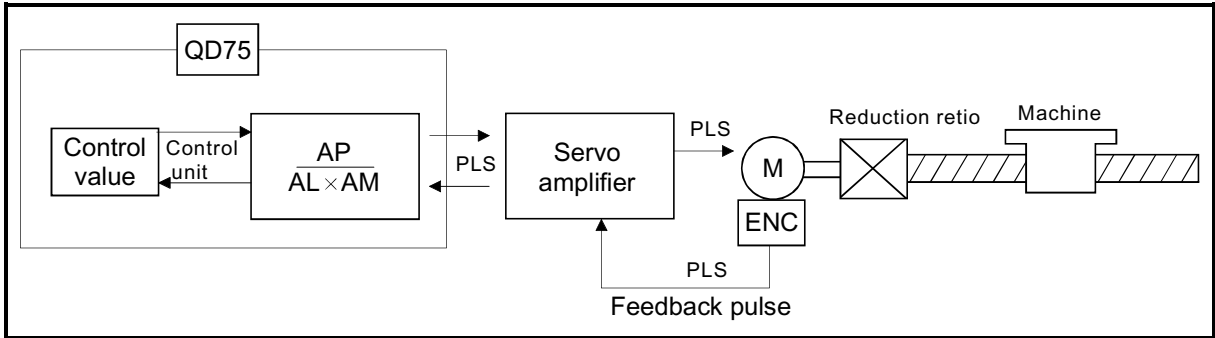

The basic concept of the electronic gear is represented by the following expression.


- € Pr.2 (No. of pulses per rotation) = AP
- € Pr.3 (Movement amount per rotation) = AL
- € Pr.4 (Unit magnification) = AM
- € Movement amount per pulse = ΔS

$$\text{Electronic gear} = \frac{AP}{\Delta S} = \frac{AP}{AL \Delta AM} \dots(1)$$

Set values for AP, AL and AM so that this related equation is established. However, because values to be set for AP, AL and AM have the settable range, values calculated (reduced) from the above related equation must be contained in the setting range for AP, AL and AM.

(1) For "Ball screw" + "Reduction gear"

When the ball screw pitch is 10mm, the motor is the HC-MF (8192 PLS/rev) and the reduction ratio of the reduction gear is 9/44.

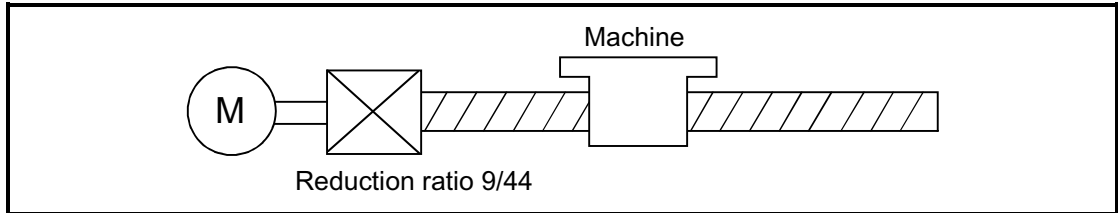

First, find how many millimeters the load (machine) will travel ( $\Delta S$ ) when the motor turns one revolution (AP).

$$\begin{aligned} \epsilon \text{ AP (No. of pulses per rotation)} &= 8192 \\ \epsilon \Delta S \text{ (Machine travel value per motor revolution)} &= \text{Ball screw pitch} \Delta \text{ Reduction ratio} \\ &= 10 \text{ [mm]} \Delta 9/44 \\ &= 10000.0 \text{ [\sigma m]} \Delta 9/44 \end{aligned}$$

Substitute this for the above expression (1).

At this time, make calculation with the reduction ratio 9/44 remaining as a fraction.

$$\begin{aligned} \frac{\text{AP}}{\Delta S} &= \frac{8192}{10000.0 \text{ [\sigma m]} \Delta 9/44} \\ &= \frac{8192 \Delta 44}{10000.0 \Delta 9} \\ &= \frac{360448}{90000.0} \\ &= \frac{45056}{11250.0} = \frac{45056 \text{ (AP)}}{11250.0 \text{ (AL)} \Delta 1 \text{ (AM)}} \\ &= \frac{45056 \text{ (AP)}}{1125.0 \text{ (AL)} \Delta 10 \text{ (AM)}} \end{aligned}$$

Thus, AP, AL and AM to be set are as follows.

$$\begin{aligned} \text{AP} &= 45056 \text{ ..... } \boxed{\text{Pr.2}} & \text{AP} &= 45056 \text{ .... } \boxed{\text{Pr.2}} \\ \text{AL} &= 11250.0 \text{ ... } \boxed{\text{Pr.3}} & \text{or} & \text{AL} &= 1125.0 \text{ ... } \boxed{\text{Pr.3}} \\ \text{AM} &= 1 \text{ ..... } \boxed{\text{Pr.4}} & \text{AM} &= 10 \text{ ..... } \boxed{\text{Pr.4}} \end{aligned}$$

Note): These two examples of settings are only examples. There are settings other than these examples.)

(2) When "PLS (pulse)" is set as the control unit

When using PLS (pulse) as the control unit, set the electronic gear as follows.


- AP = "No. of pulses per rotation"
- AL = "Movement amount per rotation"
- AM = 1

Example) When the motor is the HC-MF (8192PLS/rev)

- AP = 8192 ..... Pr.2
- AL = 8192 ..... Pr.3
- AM = 1 ..... Pr.4

(3) When "degree" is set as the control unit for a rotary axis

When the rotary axis is used, the motor is HC-SF (16384PLS/rev) and the reduction ratio of the reduction gear is 3/11

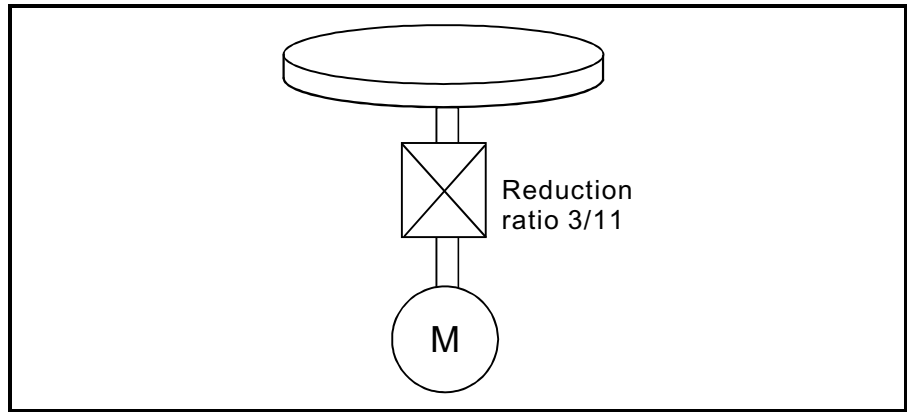

First, find how many degrees the load (machine) will travel ( $\Delta S$ ) when the motor turns one revolution (AP).

$$\begin{aligned} \epsilon \text{ AP (No. of pulses per rotation)} &= 16384 \\ \epsilon \Delta S \text{ (Machine travel value per motor revolution)} &= 360.00000 \text{ [degree]} \Delta \text{ Reduction ratio} \\ &= 360.00000 \Delta 3/11 \end{aligned}$$

Substitute this for the above expression (1).

$$\begin{aligned} \frac{AP}{\Delta S} &= \frac{16384 \text{ [PLS]}}{360.00000 \text{ [degree]} \Delta 3/11} \\ &= \frac{16384 \text{ [PLS]} \Delta 11}{10000.0 \Delta 3} \\ &= \frac{180224}{1080.00000} \\ &= \frac{11264}{67.50000} = \frac{11264 \text{ (AP)}}{67.50000 \text{ (AL)} \Delta 1 \text{ (AM)}} \\ &= \frac{11264 \text{ (AP)}}{0.06750 \text{ (AL)} \Delta 1000 \text{ (AM)}} \end{aligned}$$


Thus, AP, AL and AM to be set are as follows.

$$\begin{array}{ll}
 AP = 11264 \dots\dots \boxed{\text{Pr.2}} & AP = 11264 \dots\dots \boxed{\text{Pr.2}} \\
 AL = 67.50000 \dots \boxed{\text{Pr.3}} & \text{or } AL = 0.06750 \dots \boxed{\text{Pr.3}} \\
 AM = 1 \dots\dots\dots \boxed{\text{Pr.4}} & AM = 1000 \dots\dots \boxed{\text{Pr.4}}
 \end{array}$$

Note): These two examples of settings are only examples. There are settings other than these examples.)

(4) When "mm" is set as the control unit for conveyor drive (calculation including  $\pi$  )

When the belt conveyor drive is used, the conveyor diameter is 135mm, the pulley ratio is 1/3, the motor is HC-SF (16384PLS/rev) and the reduction ratio of the reduction gear is 7/53.

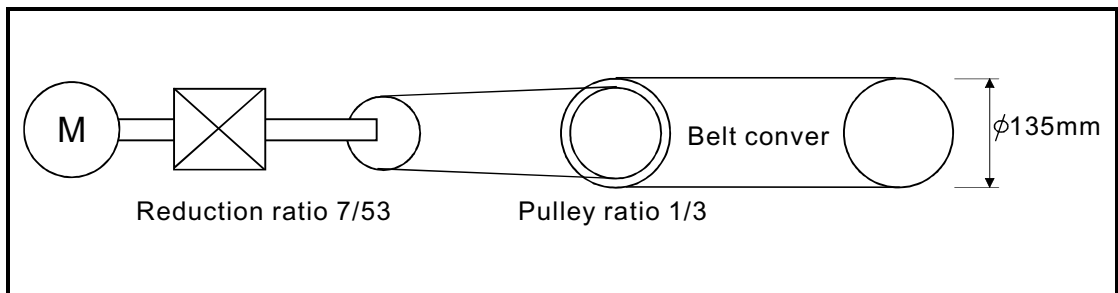

As the travel value of the conveyor is used to exercise control, set "mm" as the control unit.

First, find how many millimeters the load (machine) will travel ( $\Delta S$ ) when the motor turns one revolution (AP).

$$\begin{aligned}
 \epsilon AP(\text{No. of pulses per rotation}) &= 16384 \\
 \epsilon \Delta S (\text{Machine travel value per motor revolution}) &= 135000.0 [\sigma\text{m}] \Delta \pi \Delta \text{Reduction ratio} \\
 &= 135000.0 [\sigma\text{m}] \Delta \pi \Delta 7/53 \Delta 1/3
 \end{aligned}$$

Substitute this for the above expression (1).

At this time, make calculation with the reduction ratio 7/53  $\Delta$  1/3 remaining as a fraction.

$$\begin{aligned}
 \frac{AP}{\Delta S} &= \frac{AP}{AL \Delta AM} = \frac{16384 [\text{PLS}]}{135000.0 [\sigma\text{m}] \Delta \pi \Delta 7/53 \Delta 1/3} \\
 &= \frac{16384 \Delta 53 \Delta 3}{135000.0 \Delta \pi \Delta 7}
 \end{aligned}$$

Here, make calculation on the assumption that  $\pi$ 's equal to 3.141592654.

$$\frac{AP}{\Delta S} = \frac{AP}{AL \Delta AM} = \frac{2605056}{2968805.058}$$



AL has a significant number to first decimal place, round down numbers to two decimal places.

Reduce a fraction in the above result.

$$\frac{AP}{\Delta S} = \frac{AP}{AL \Delta AM} = \frac{2605056}{2968805.0} = \frac{2605056 (AP)}{2968805.0 (AL) \Delta 1(AM)}$$

Thus, AP, AL and AM to be set are as follows.

$$AP = 2605056 \dots\dots \boxed{\text{Pr.2}}$$

$$AL = 2968805.0 \dots\dots \boxed{\text{Pr.3}}$$

$$AM = 1 \dots\dots\dots \boxed{\text{Pr.4}}$$

This setting will produce an error for the true machine value, but it cannot be helped. This error is as follows.

$$\left( \frac{29688050/2605056}{9450000 \pi \Delta 2605056} - 1 \right) \Delta 100 = -1.94 \Delta 10^{-6} [\%]$$

It is equivalent to an about 19.4[σm] error in continuous 1km feed.


[2] The method for compensating the error

When the position control is carried out using the "Electronic gear" set in a parameter, this may produce an error between the command movement amount (L) and the actual movement amount (L'). With QD75, this error is compensated by adjusting the electronic gear. The "Error compensation amount", which is used for error compensation, is defined as follows:


$$\text{Error compensation amount} = \frac{\text{Command movement amount (L)}}{\text{Actual movement amount (L')}} \dots(2)$$

The electronic gear including an error compensation amount is shown below.

$$\frac{AP}{AL \Delta AM} \Delta \frac{L}{L'} = \frac{AP'}{AL' \Delta AM'}$$

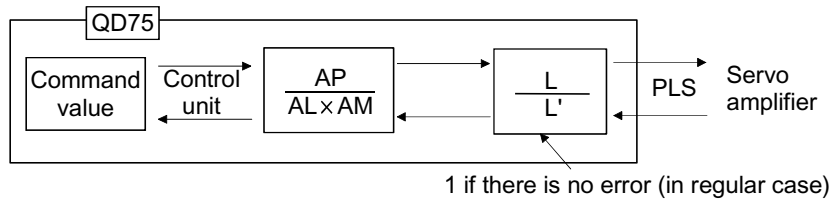

Electronic gear taking an error into consideration

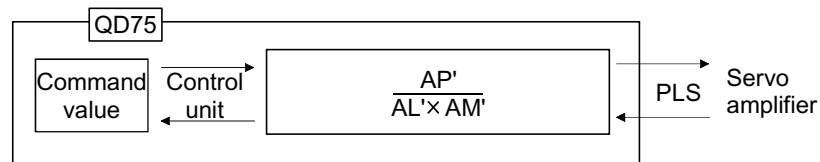

--- Calculation example ---

(Conditions)

- Movement amount per pulse : 131072 [PLS]
- No. of pulses per rotation : 5000.0 [σm]
- Unit magnification : 1

(Positioning results)

- Command movement amount (L) : 100 [mm]
- Actual movement amount (L') : 101 [mm]

(Compensation)

$$\frac{AP}{AL \Delta AM} \Delta \frac{L}{L'} = \frac{131072}{5000.0 \Delta 1} \Delta \frac{100}{101} = \frac{131072 (AP')}{5050 (AL') \Delta 1 (AM')}$$

- Movement amount per pulse : 131072 ... [Pr.2]
- No. of pulses per rotation : 5050.0 .... [Pr.3]
- Unit magnification : 1 ..... [Pr.4]

Set the post-compensation " [Pr.2] No. of pulses per rotation (AP')", " [Pr.3] Movement amount per rotation (AL')", and " [Pr.4] Unit magnification (AM')" in the parameters, and write them to the QD75. The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

12.3.3 Near pass function

When continuous pass control is carried out using interpolation control, the near pass function is carried out.

The "near pass function" is a function to suppress the mechanical vibration occurring at the time of switching the positioning data when continuous pass control is carried out using interpolation control.

[Near pass function]

The extra movement amount occurring at the end of each positioning data unit being continuously executed is carried over to the next positioning data unit. Alignment is not carried out, and thus the output speed drops are eliminated, and the mechanical vibration occurring during speed changes can be suppressed. Because alignment is not carried out, the operation is controlled on a path that passes near the position set in "Da.6 Positioning address".

The details shown below explain about the "near pass function".

- [1] Control details
- [2] Precautions during control

[1] Control details

The following drawing shows the path of the continuous path control.

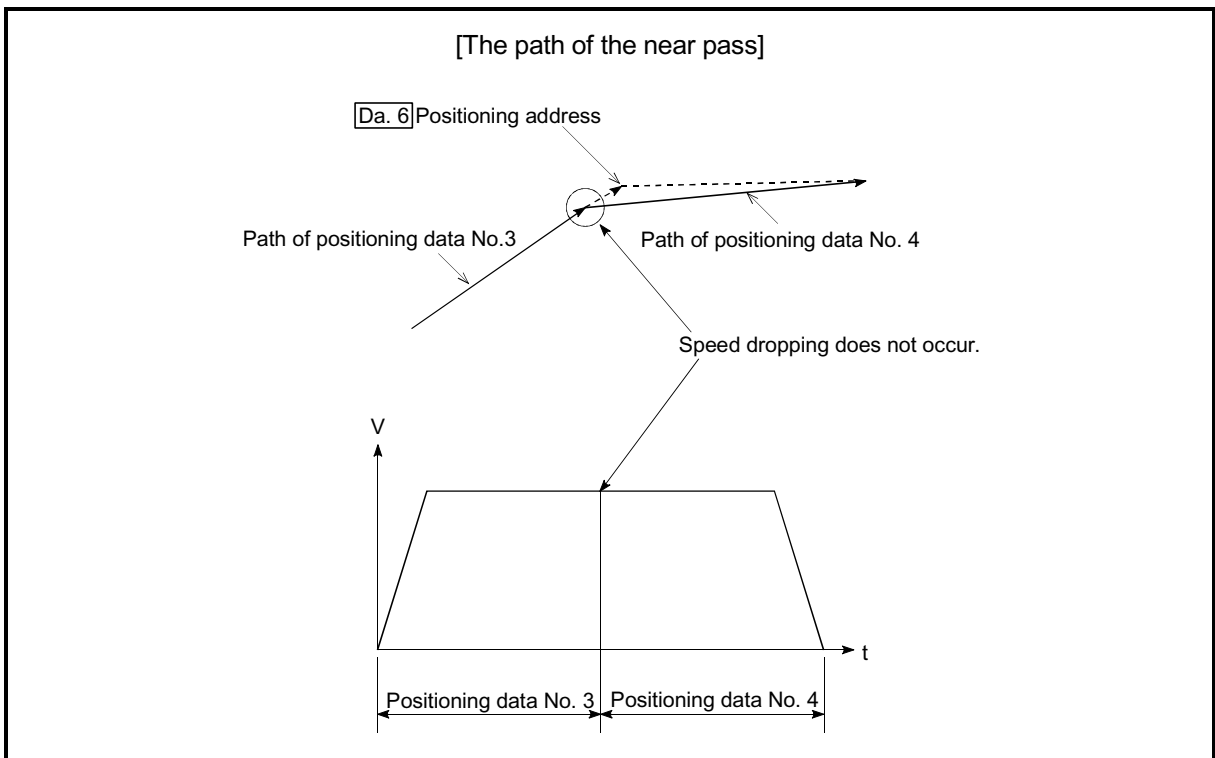


Fig. 12.9 The path of the continuous path control

[2] Precautions during control

- (1) If the movement amount designated by the positioning data is small when the continuous path control is executed, the output speed may not reach the designated speed.
- (2) If continuous path control is carried out, the output will suddenly reverse when the reference axis movement direction changes from the positioning data No. currently being executed to the next positioning data No. If the sudden output reversal affects the mechanical system, carry out control with continuous positioning control.

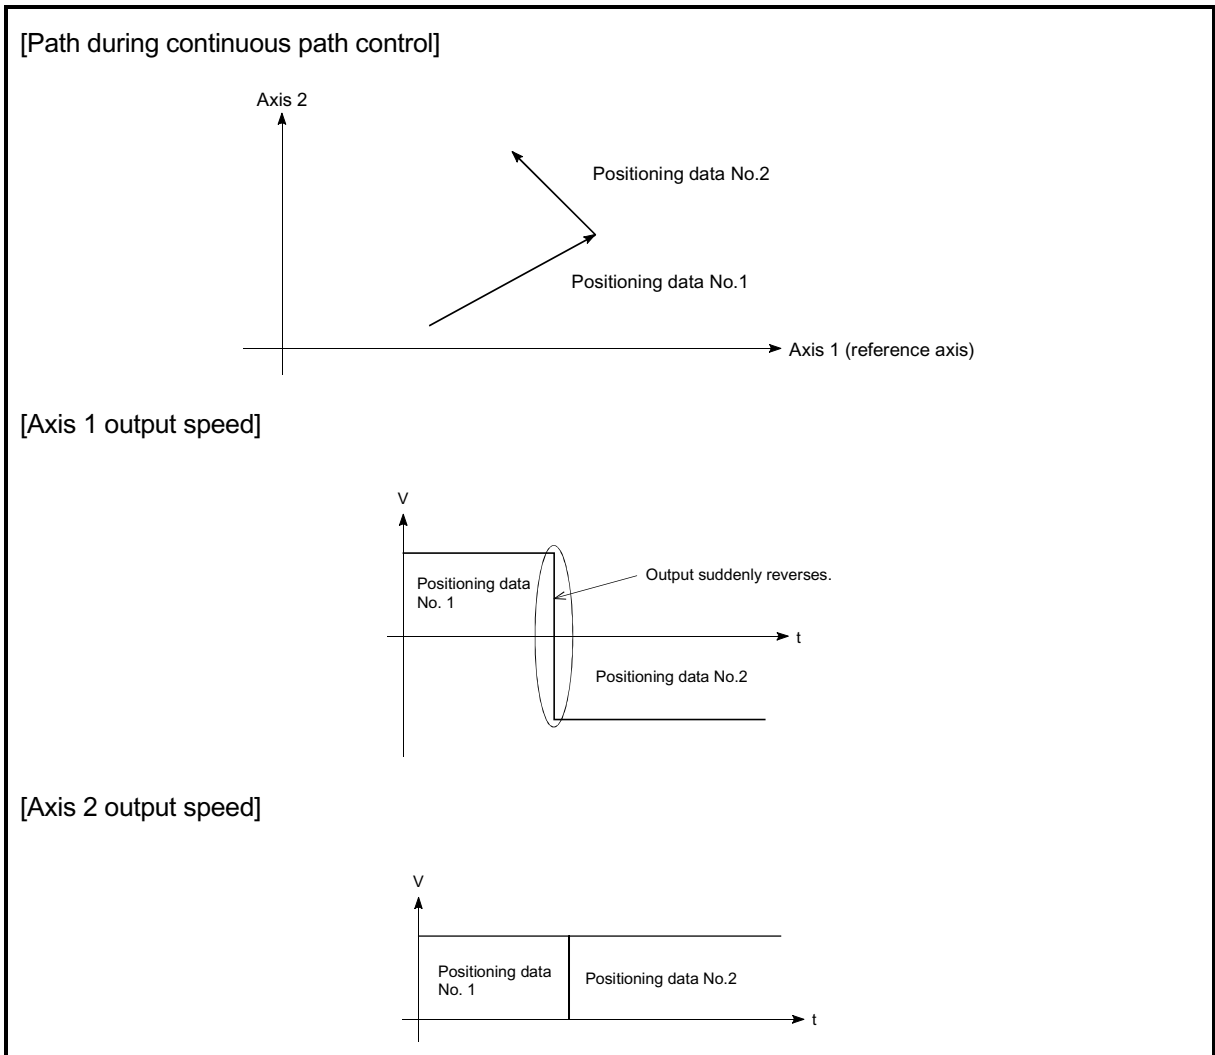


Fig. 12.10 Path and output speed of various axes when movement direction varies during continuous path control

- (3) When continuous path control of a circular interpolation is being carried out in the near pass, an address in which the extra movement amount is subtracted from the positioning address of the positioning data currently being executed is replaced by the starting point address of the next positioning data No. Because the starting point address will be replaced, a large arc error deviation (error code: 506) may occur.

In this case, adjust the " Pr.41 Allowable circular interpolation error width".


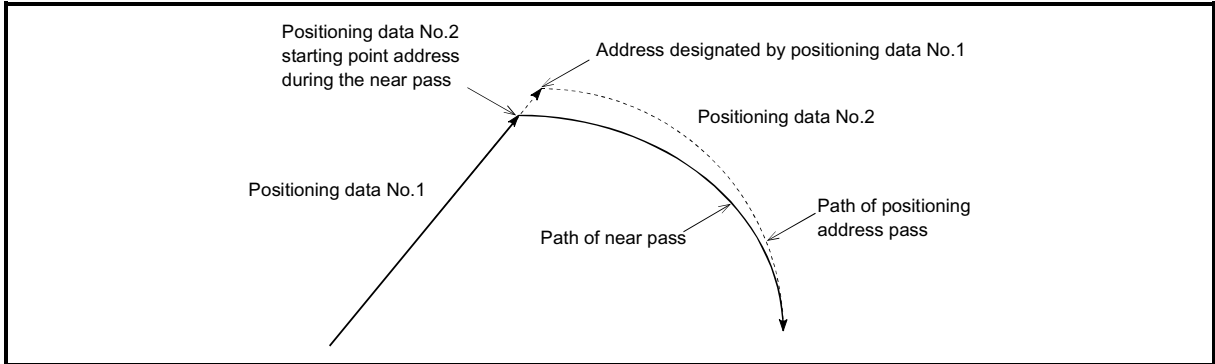


Fig. 12.11 Arc error during the near pass

- (4) When a circle center is designated to continuously designate the circular interpolation control by a continuous path designation in the near pass, and the positioning address and starting point address of that arc are the same address, the path will make one circle using the two data items. This is because the 2nd data starting point address is shifted by the extra amount of the movement amount occurring from the 1st data.

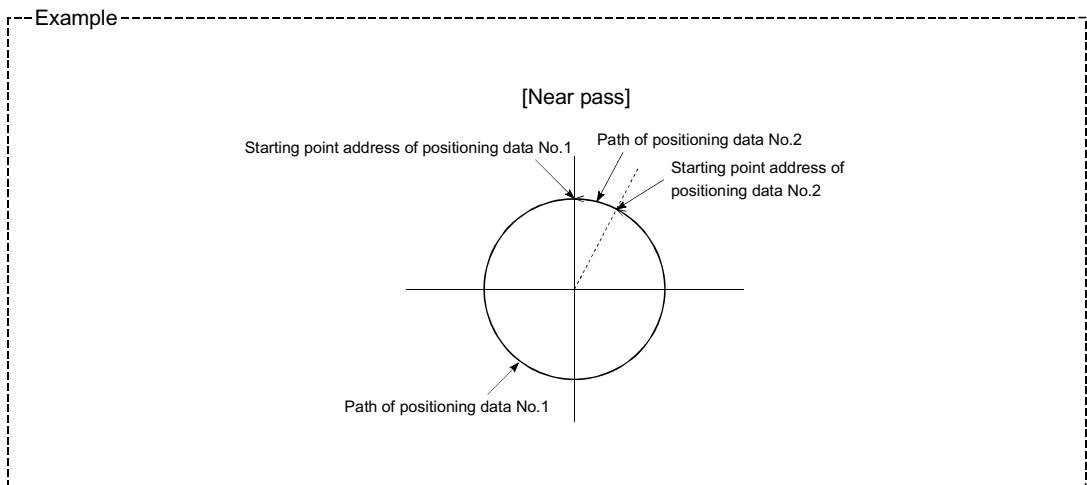

12.4 Functions to limit the control

Functions to limit the control include the "speed limit function", "torque limit function", "software stroke limit", and "hardware stroke limit". Each function is executed by parameter setting or PLC program creation and writing.

12.4.1 Speed limit function

The speed limit function limits the command speed to a value within the "speed limit value" setting range when the command speed during control exceeds the "speed limit value".

The details shown below explain about the "speed limit function".

- [1] Relation between the speed limit function and various controls
- [2] Precautions during control
- [3] Setting the speed limit function

[1] Relation between the speed limit function and various controls

The following table shows the relation of the "speed limit function" and various controls.

Control type		Speed limit function	Speed limit value	
OPR control	Machine OPR control	◎	Pr.8 Speed limit value	
	Fast OPR control	◎		
Major positioning control	Position control	1-axis linear control		◎
		2 to 4-axes linear interpolation control		◎
		1-axis fixed-feed control		◎
		2 to 4-axes fixed-feed control (interpolation)		◎
		2-axis circular interpolation control		◎
	1 to 4-axes Speed control	◎		
	Speed-position switching control, Position-speed switching control	◎		
Other control	Current value changing	—		Setting value invalid
	JUMP instruction, NOP instruction, LOOP to LEND	—		
Manual control	JOG operation, Inching operation	◎	Pr.31 JOG speed limit value	
	Manual pulse generator operation	—	Setting is invalid	

◎ : Always set

— : Setting not required (Setting value is invalid. Use the initial values or setting values within a range where no error occurs.)

[2] Precautions during control

If any axis exceeds " [Pr.8] Speed limit value" during 2- to 4-axis speed control, the axis in excess of the speed limit value is controlled at the speed limit value. The speeds of the other axes interpolated are suppressed depending on their command speed ratios.

If the reference axis exceeds " [Pr.8] Speed limit value" during 2- to 4-axis linear interpolation control, 2- to 4-axis fixed-feed control or 2-axis circular interpolation control, the reference axis is controlled at the speed limit value (The speed limit does not function on the interpolation axis side.)

[3] Setting the speed limit function

To use the "speed limit function", set the "speed limit value" in the parameters shown in the following table, and write them to the QD75.

The set details are validated after they are written to the QD75.

Setting item	Setting value	Setting details	Factory-set initial value
[Pr.8] Speed limit value	→	Set the speed limit value (max. speed during control).	200000
[Pr.31] JOG speed limit value	→	Set the speed limit value during JOG operation (max. speed during control). (Note that [Pr.31] JOG speed limit value shall be less than or equal to [Pr.8] Speed limit value.)	20000

\* Refer to Section 5.2 "List of parameters" for setting details.

**REMARK**

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

12.4.2 Torque limit function

The "torque limit function" limits the generated torque to a value within the "torque limit value" setting range when the torque generated in the servomotor exceeds the "torque limit value".

The "torque limit function" protects the deceleration function, limits the power of the operation pressing against the stopper, etc. It controls the operation so that unnecessary force is not applied to the load and machine.

The details shown below explain about the "torque limit function".

- [1] Relation between the torque limit function and various controls
- [2] Control details
- [3] Precautions during control
- [4] Setting the torque limit function

[1] Relation between the torque limit function and various controls

The following table shows the relation of the "torque limit function" and various controls.

Control type		Torque limit function	Torque limit value *
OPR control	Machine OPR control	○	" [Pr.17] Torque limit setting value" or " [Cd.101] Torque output setting value". * After the " [Pr.47] Creep speed" is reached, this value becomes the " [Pr.54] OPR torque limit value".
	Fast OPR control	○	
Major positioning control	Position control	1-axis linear control	○
		2 to 4-axes linear interpolation control	○
		1-axis fixed-feed control	○
		2 to 4-axes fixed-feed control (interpolation)	○
		2-axis circular interpolation control	○
	1 to 4-axes Speed control	○	
	Speed-position switching control	○	
	Position-speed switching control	○	
Other control	Current value changing	-	Setting value is invalid.
	JUMP instruction, NOP instruction, LOOP to LEND	-	
Manual control	JOG operation, Inching operation	○	" [Pr.17] Torque limit setting value" or " [Cd.101] Torque output setting value".
	Manual pulse generator operation	○	

○ : Set when required (Set to " - " when not used.)

- : Setting not required (Setting value is invalid. Use the initial values or setting values within a range where no error occurs.)

\* : Shows the torque limit value when " [Cd.22] New torque value" is set to "0".



[2] Control details

The following drawing shows the operation of the torque limit function.

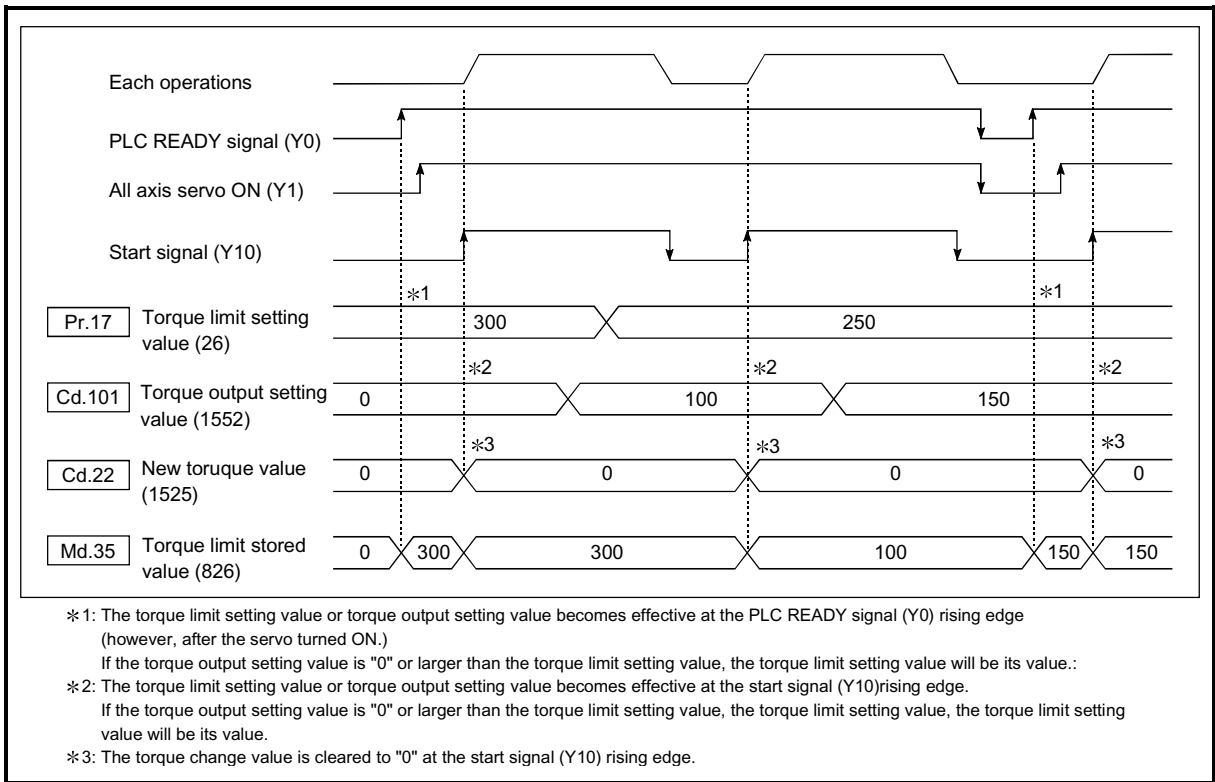


Fig. 12.12 Torque limit function operation

[3] Precautions during control

- (1) When limiting the torque at the " [Pr.17] Torque limit setting value", confirm that " [Cd.22] New torque value" is set to "0". If this parameter is set to a value besides "0", the " [Cd.22] New torque value" will be validated, and the torque will be limited at that value. (Refer to Section 12.5.4 "Torque change function" for details about the "new torque value".)
- (2) When the " [Pr.54] OPR torque limit value "exceeds the " [Pr.17] Torque limit setting value", an error occurs. (Error code: 995)
- (3) When the operation is stopped by torque limiting, the droop pulse will remain in the deviation counter. If the load torque is eliminated, operation for the amount of droop pulses will be carried out.

[4] Setting the torque limit function

(1) To use the "torque limit function", set the "torque limit value" in the parameters shown in the following table, and write them to the QD75.

a) The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

Setting item	Setting value	Setting details	Factory-set initial value
Pr.17 Torque limit setting value	→	Set the torque limit value as a percentage.	300
Pr.54 OPR torque limit value	→	Set the torque limit value after the " Pr.47 Creep speed" is reached. Set as a percentage.	300

b) The set details are validated at the rising edge (OFF → ON) of the positioning start signal (Y10).

Setting item	Setting value	Setting details	Factory-set initial value
Cd.101 Torque output setting value	→	Set the torque output setting value as a percentage.	0

- \* Refer to Section 5.2 "List of parameters" for setting details.
- \* Torque limit value: Will be an upper limit value of the torque change value. Even if a larger value has been mistakenly input for the torque change value, it is restricted within the torque limit setting values to prevent an erroneous entry. (Even if a value larger than the torque limit setting value has been input to the torque change value, the torque value is not changed.)
- \* Torque output setting value: to be taken at the start of positioning, and used as a torque limit value. If the value is "0" or larger than the torque limit setting value, the parameter "torque limit setting value" is taken at the start.

(2) The "torque limit value" set in the QD75 is set in the " Md.35 Torque limit stored value".

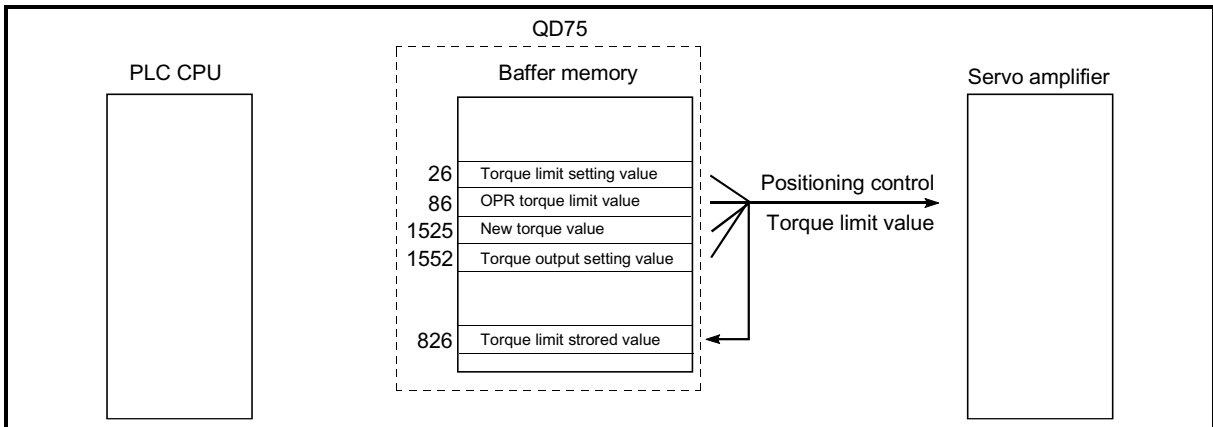


Fig. 12.13 Limiting the torque to the servo amplifier (Axis 1)

The following table shows the "Md.35 Torque limit stored value" of the buffer memory address.

Monitor item	Monitor value	Storage details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Md.35	Torque limit stored value	→	The "torque limit value" valid at that time is stored. ( Pr.17 , Pr.54 , Cd.22 , or Cd.101 )			
			826	926	1026	1126

\* Refer to Section 5.6 "List of monitor data" for information on the setting details.

### REMARK

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

### 12.4.3 Software stroke limit function

In the "software stroke limit function" the address established by a machine OPR is used to set the upper and lower limits of the moveable range of the workpiece. Movement commands issued to addresses outside that setting range will not be executed.

In the QD75, the "current feed value" and "machine feed value" are used as the addresses indicating the current position. However, in the "software stroke limit function", the address used to carry out the limit check is designated in the " Pr.14

Software stroke limit selection". (Refer to Section 9.1.4 "Confirming the current value" or details on the "current feed value" and "machine feed value".)

The upper and lower limits of the moveable range of the workpiece are set in " Pr.12

Software stroke limit upper limit value"/ " Pr.13 Software stroke limit lower limit value".

The details shown below explain about the "software stroke limit function".

- [1] Differences in the moveable range when "current feed value" and "machine feed value" are selected.
- [2] Software stroke limit check details
- [3] Relation between the software stroke limit function and various controls
- [4] Precautions during software stroke limit check
- [5] Setting the software stroke limit function
- [6] Invalidating the software stroke limit
- [7] Setting when the control unit is "degree"

#### [1] Differences in the moveable range when "current feed value" and "machine feed value" are selected.

The following drawing shows the moveable range of the workpiece when the software stroke limit function is used.

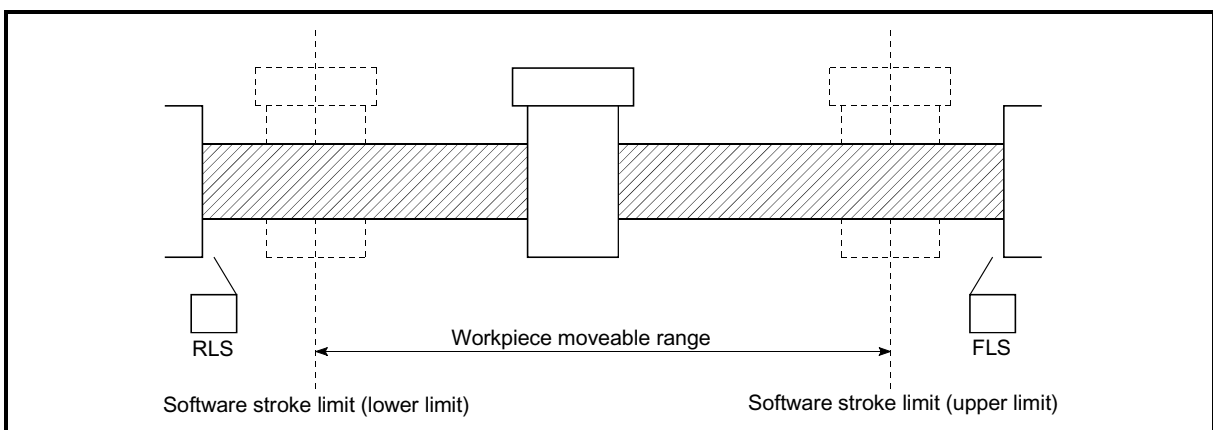


Fig. 12.14 Workpiece moveable range

The following drawing shows the differences in the operation when "Md.20 Current feed value" and "Md.21 Machine feed value" are used in the moveable range limit check.

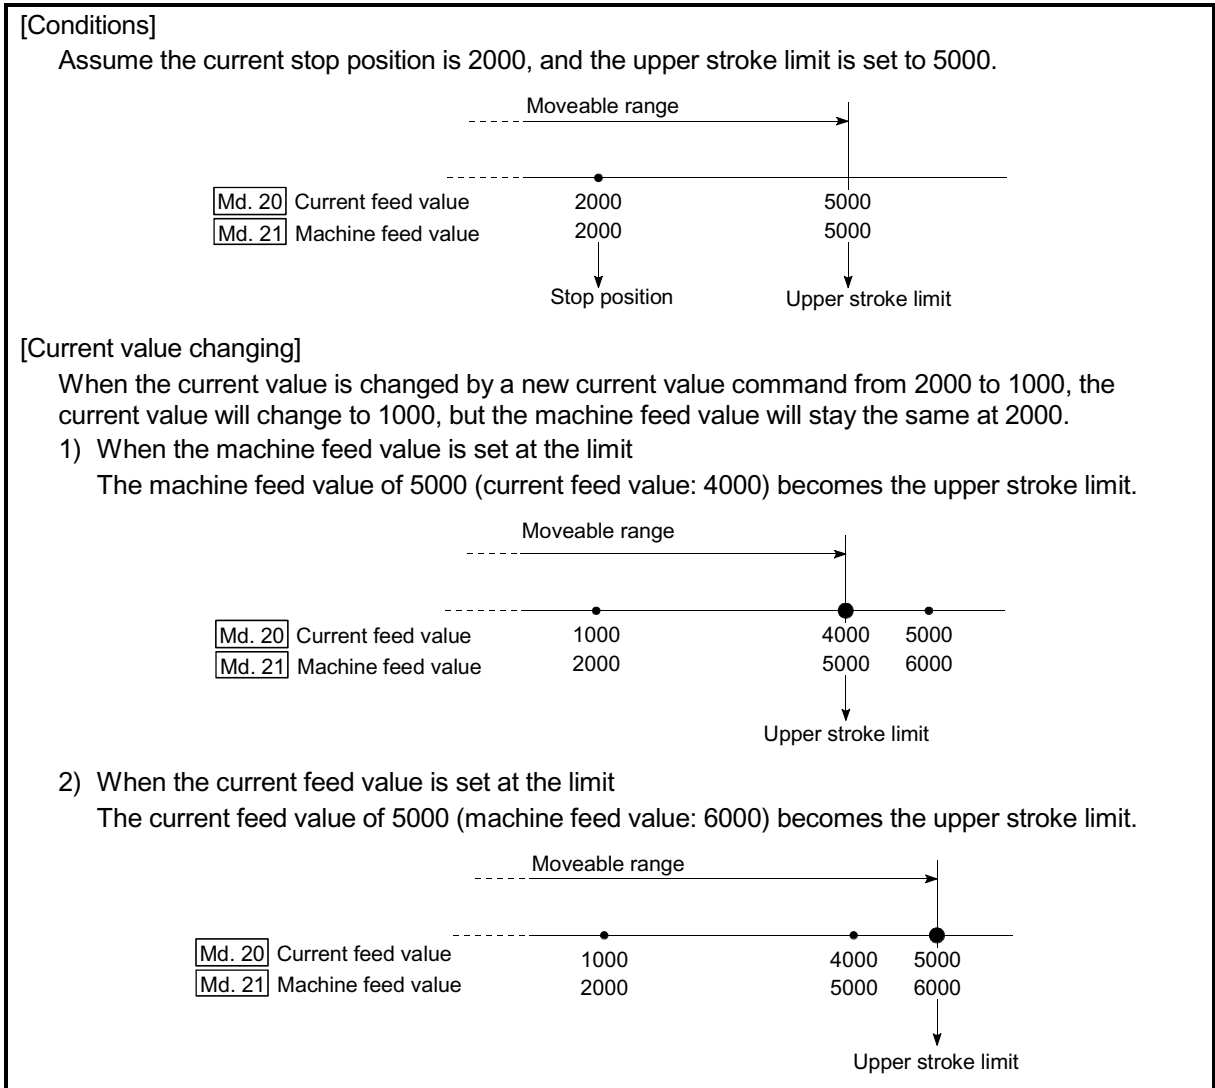


Fig. 12.15 Software stroke limits of the current feed value and machine feed value

**POINT**  
When "machine feed value" is set in "Pr.14 Software stroke limit selection", the moveable range becomes an absolute range referenced on the OP. When "current feed value" is set, the moveable range is the relative range from the "current feed value".

[2] Software stroke limit check details

Check details		Processing when an error occurs
1)	An error shall occur if the current value *1 is outside the software stroke limit range *2. (Check " [Md.20] Current feed value" or " [Md.21] Machine feed value".)	An "axis error" will occur (error code: 507, 508)
2)	An error shall occur if the command address is outside the software stroke limit range. (Check " [Da.6] Positioning address/movement amount".)	

\*1: Check whether the " [Md.20] Current feed value" or " [Md.21] Machine feed value" is set in " [Pr.14] Software stroke limit selection".

\*2: Moveable range from the " [Pr.12] Software stroke limit upper limit value" to the " [Pr.13] Software stroke limit lower limit value".

[3] Relation between the software stroke limit function and various controls

Control type		Limit check	Processing at check	
OPR control	Machine OPR control	Data set method	⊙	Check not carried out.
		Other than "Data set method"	—	
	Fast OPR control	—		
Major positioning control	Position control	1-axis linear control	⊙	Checks 1) and 2) in the previous section [2] are carried out. For speed control: The axis decelerates to a stop when it exceeds the software stroke limit range. For position control: The axis comes to an immediate stop when it exceeds the software stroke limit range.
		2 to 4-axes axis linear interpolation control	⊙	
		1-axis fixed-feed control	⊙	
		2 to 4-axes fixed-feed control (interpolation)	⊙	
		2-axis circular interpolation control	⊙	
	1 to 4-axes speed control	○ *3, 4		
	Speed-position switching control	○		
	Position-speed switching control	*3, 4		
Other control	Current value changing	⊙	The current value will not be changed if the new current value is outside the software stroke limit range.	
	JUMP instruction, NOP instruction, LOOP to LEND	—	Check not carried out.	
Manual control	JOG operation, Inching operation	△ *5	Check 1) in the previous section [2] is carried out. The machine will carry out a deceleration stop when the software stroke limit range is exceeded. If the address is outside the software stroke limit range, the operation can only be started toward the moveable range.	
	Manual pulse generator operation	△ *5		

⊙ : Check valid

○ : Check is not made when the current feed value is not updated (Refer to [Pr.21] ) at the setting of " current feed value" in " [Pr.14] Software stroke limit selection" during speed control.

— : Check not carried out (check invalid).

△ : Valid only when "1:valid" is set in the " [Pr.15] Software stroke limit valid/invalid setting".

\*3: The value in " [Md.20] Current feed value" will differ according to the " [Pr.21] Current feed value during speed control" setting.


\*4: When the unit is "degree", check is not made during speed control.

\*5: When the unit is "degree", check is not carried out.


[4] Precautions during software stroke limit check

- (1) A machine OPR must be executed beforehand for the "software stroke limit function" to function properly.
- (2) During interpolation control, a stroke limit check is carried out for the every current value of both the reference axis and the interpolation axis. Every axis will not start if an error occurs, even if it only occurs in one axis.
- (3) During circular interpolation control, the " [Pr.12] Software stroke limit upper limit value"/" [Pr.13] Software stroke limit lower limit value" may be exceeded.

In this case, a deceleration stop will not be carried out even if the stroke limit is exceeded. Always install an external limit switch if there is a possibility the stroke limit will be exceeded.

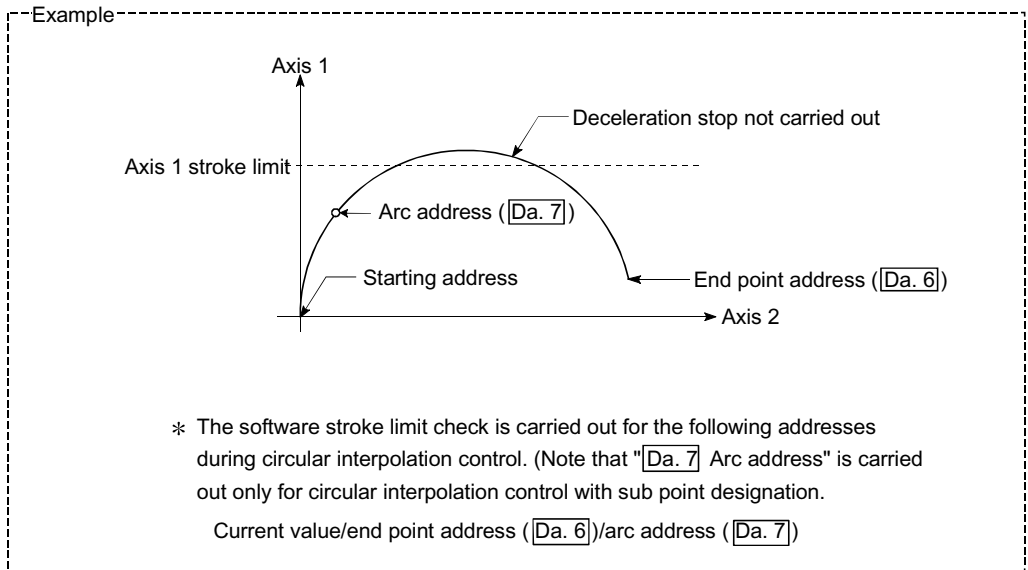

- (4) If an error is detected during continuous path control, the axis stops immediately on completion of execution of the positioning data located right before the positioning data in error.

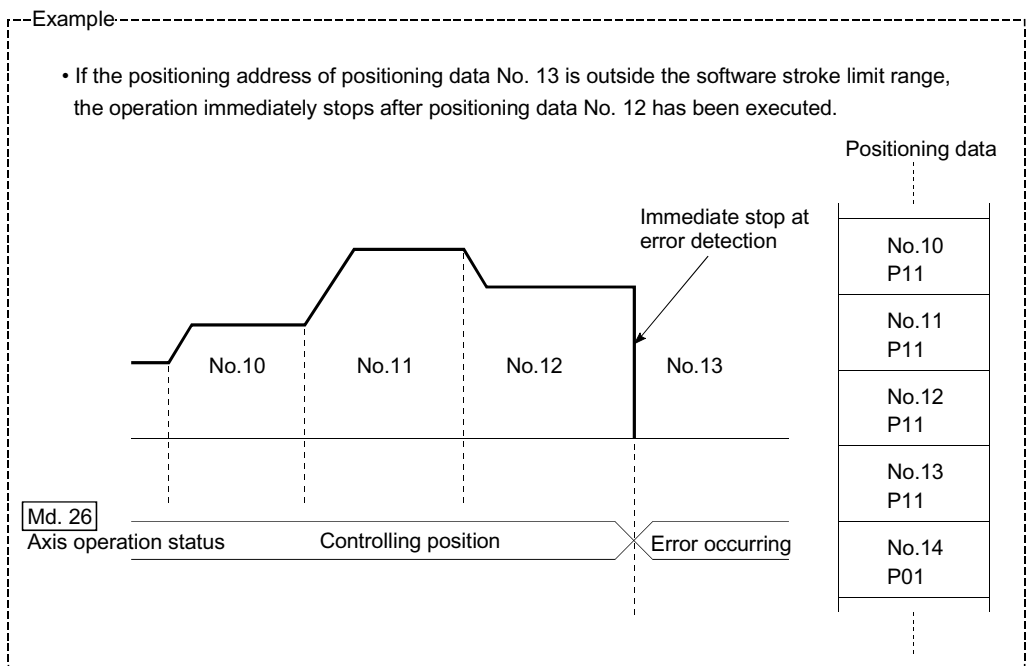

- (5) During simultaneous start, a stroke limit check is carried out for the current values of every axis to be started. Every axis will not start if an error occurs, even if it only occurs in one axis.

**[5] Setting the software stroke limit function**

To use the "software stroke limit function", set the required values in the parameters shown in the following table, and write them to the QD75.

The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

Setting item	Setting value	Setting details	Factory-set initial value
Pr.12 Software stroke limit upper limit value	→	Set the upper limit value of the moveable range.	2147483647
Pr.13 Software stroke limit lower limit value	→	Set the lower limit value of the moveable range.	-2147483648
Pr.14 Software stroke limit selection	→	Set whether to use the "Md.20 Current feed value" or "Md.21 Machine feed value" as the "current value".	0: Current feed value
Pr.15 Software stroke limit valid/invalid setting	0: Valid	Set whether the software stroke limit is validated or invalidated during manual control (JOG operation, Inching operation, manual pulse generator operation).	0: valid

\* Refer to Section 5.2 "List of parameters" for setting details.

**[6] Invalidating the software stroke limit**

To invalidate the software stroke limit, set the following parameters as shown, and write them to the QD75.

Pr.12	Software stroke limit upper limit value	=	Pr.13	Software stroke limit lower limit value
-------	-----------------------------------------	---	-------	-----------------------------------------

(For manual operation, set "0: software stroke limit invalid" in the "Pr.15 Software stroke limit valid/invalid setting".)

The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

When the unit is "degree", the software stroke limit check is not performed during speed control (including speed control in speed-position switching control or position-speed switching control) or during manual control, independently of the values set in Pr.12, Pr.13 and Pr.15.

**REMARK**

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.



[7] Setting when the control unit is "degree"

■ Current value address

The "Md.20" Current feed value" address is a ring address between 0 and 359.99999° .

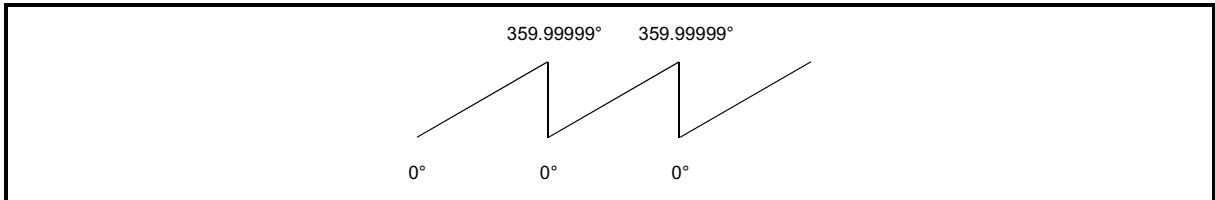


Fig. 12.16 Current value address when the control unit is "degree".

■ Setting the software stroke limit

The upper limit value/lower limit value of the software stroke limit is a value between 0 and 359.99999° .

(1) Setting when the software stroke limit is to be validated.

When the software stroke limit is to be validated, set the upper limit value in a clockwise direction from the lower limit value.

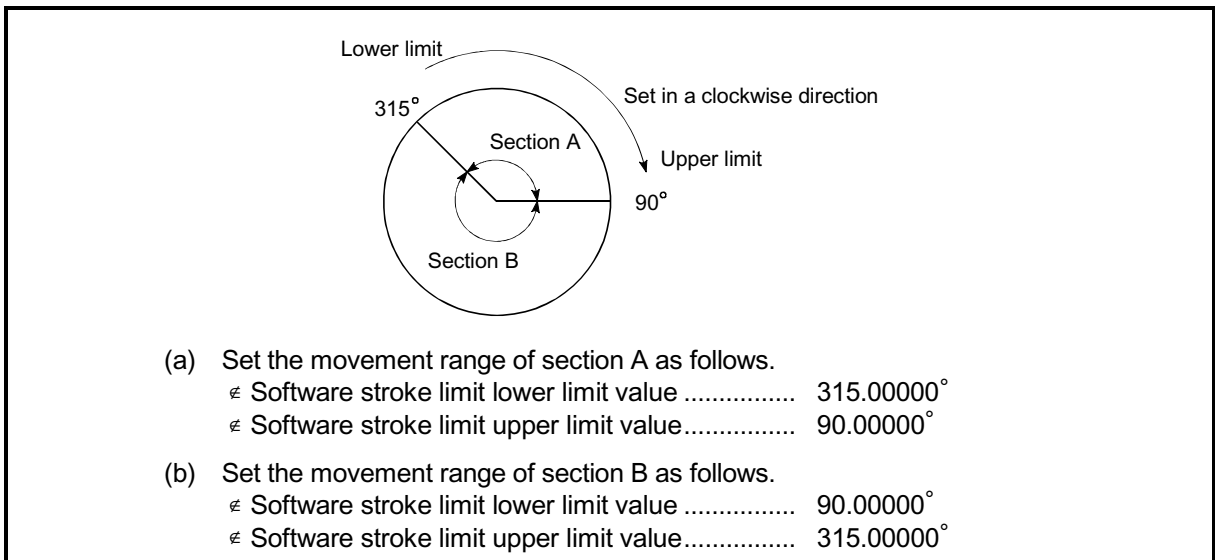


Fig. 12.17 Software stroke limit when the control unit is "degree"

12.4.4 Hardware stroke limit function

**⚠ DANGER**

When the hardware stroke limit is required to be wired, ensure to wire it in the negative logic using b-contact. If it is set in positive logic using a-contact, a serious accident may occur.

In the "hardware stroke limit function", limit switches are set at the upper/lower limit of the physical moveable range, and the control is stopped (by deceleration stop) by the input of a signal from the limit switch. Damage to the machine can be prevented by stopping the control before the upper/lower limit of the physical moveable range is reached.

The details shown below explain about the "hardware stroke limit function".

- [1] Control details
- [2] Wiring the hardware stroke limit
- [3] Precautions during control
- [4] When the hardware stroke limit is not used

[1] Control details

The following drawing shows the operation of the hardware stroke limit function.

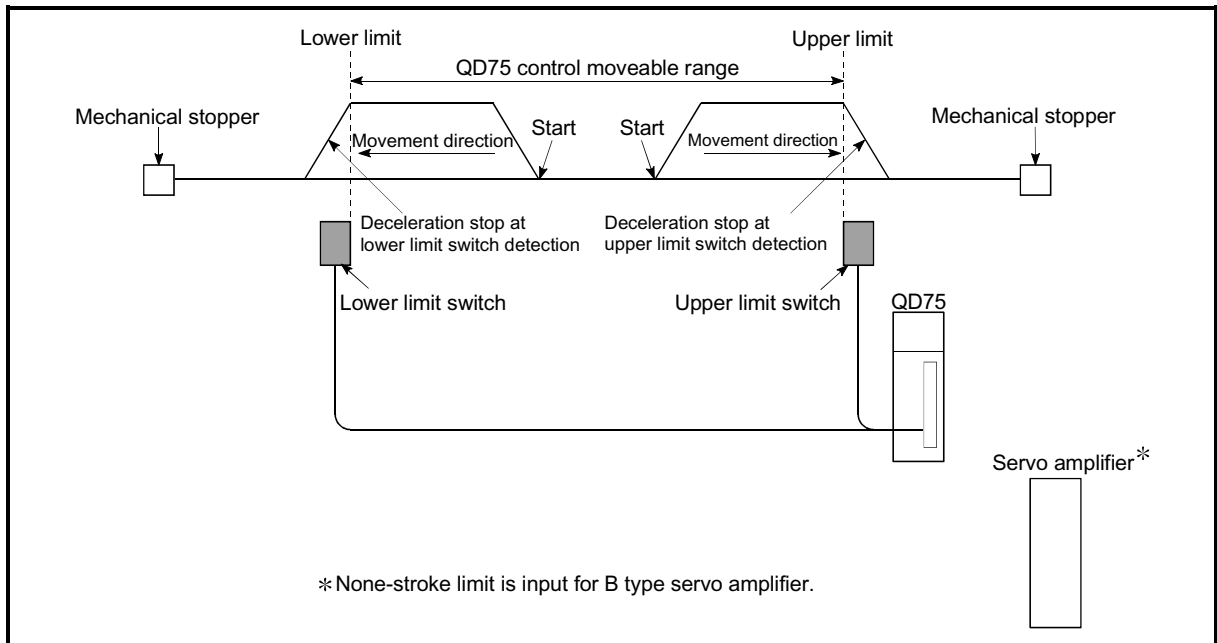


Fig. 12.18 Hardware stroke limit function operation

[2] Wiring the hardware stroke limit

When using the hardware stroke limit function, wire the terminals of the QD75 upper/lower limit stroke limit as shown in the following drawing.

(When " Pr.22 Input signal logic selection" is set to the initial value)

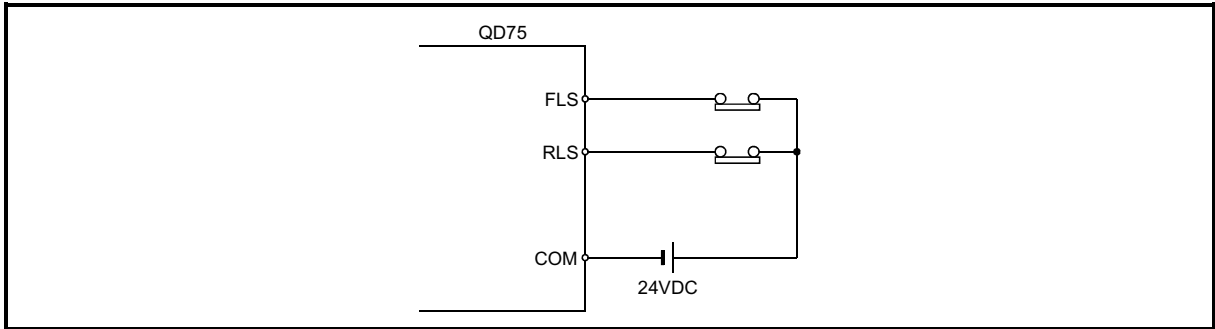


Fig. 12.19 Wiring when using the hardware stroke limit

[3] Precautions during control

- (1) If the machine is stopped outside the QD75 control range (outside the upper/lower limit switches), or if stopped by hardware stroke limit detection, the "OPR control", "major positioning control", and "high-level positioning control" cannot start. To carry out these types of control again, return the workpiece to the QD75 control range by a "JOG operation", "inching operation" or "manual pulse generator operation".
- (2) When " Pr.22 Input signal logic selection" is set to the initial value, the QD75 cannot carry out the positioning control if FLS (limit switch for upper limit) is separated from COM or RLS (limit switch for lower limit) is separated from COM (including when wiring is not carried out).

[4] When the hardware stroke limit function is not used

When not using the hardware stroke limit function, wire the terminals of the QD75 upper/lower limit stroke limit as shown in the following drawing.

When the logic of FLS and RLS is set to "positive logic" using " Pr.22 Input signal logic selection", positioning control can be carried out even if FLS and RLS are not wired. (For details, refer to Section 13.4 "External I/O signal logic switching function".)

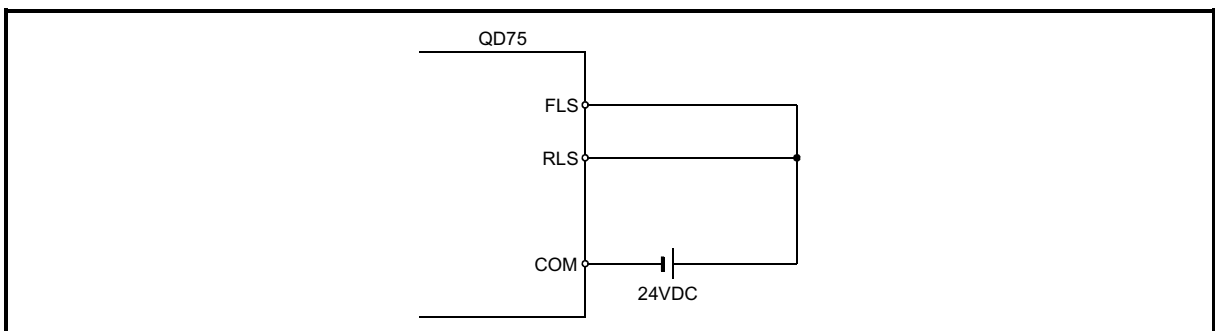


Fig. 12.20 Wiring when not using the hardware stroke limit function  
(When " Pr.20 Input signal logic selection" is the initial value)

## 12.5 Functions to change the control details

Functions to change the control details include the "speed change function", "override function", "acceleration/deceleration time change function" and "torque change function". Each function is executed by parameter setting or PLC program creation and writing.

Both the "speed change function" or "override function" change the speed, but the differences between the functions are shown below. Use the function that corresponds to the application.

"Speed change function"

- ≠ The speed is changed at any time, only in the control being executed.
- ≠ The new speed is directly set.

<b>POINT</b>	The speed change function is available even during JOG operation.
--------------	-------------------------------------------------------------------

"Override function"

- ≠ The speed is changed for all control to be executed. (Note that this excludes manual pulse generator operation.)
- ≠ The new speed is set as a percent (%) of the command speed.

<b>POINT</b>	The override function is available even during JOG operation.
--------------	---------------------------------------------------------------

### 12.5.1 Speed change function

The speed control function is used to change the speed during control to a newly designated speed at any time.

The new speed is directly set in the buffer memory, and the speed is changed by a speed change command ( [Cd.15](#) Speed change request) or external command signal.

During the machine OPR, a speed change to the creep speed cannot be carried out after deceleration start because the near point dog ON is detected.

The details shown below explain about the "speed change function".

- [1] Control details
- [2] Precautions during control
- [3] Setting the speed change function from the PLC CPU
- [4] Setting the speed change function using an external command signal

[1] Control details

The following drawing shows the operation during a speed change.

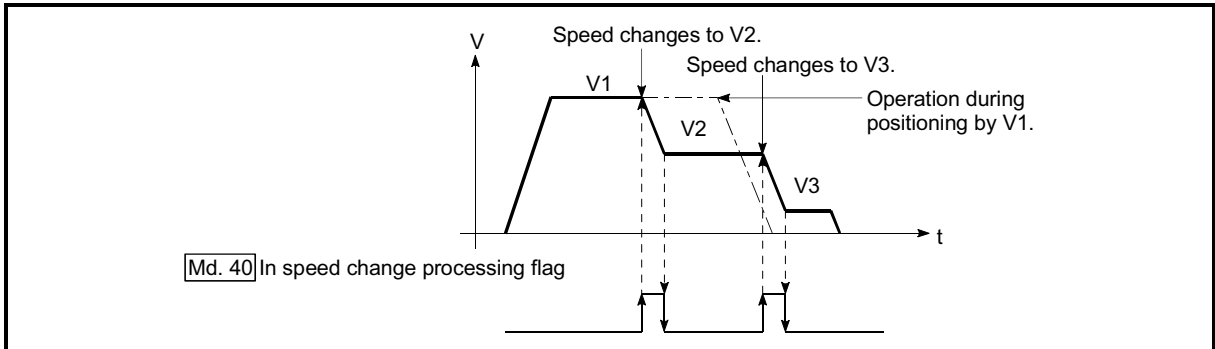


Fig. 12.21 Speed change operation

[2] Precautions during control

- (1) Control is carried out as follows at the speed change during continuous path control.
  - a) When no speed designation (current speed) is provided in the next positioning data:
    - The next positioning data is controlled at the "Cd.14 New speed value".
  - b) When a speed designation is provided in the next positioning data:
    - The next positioning data is controlled at its command speed (Da.8).

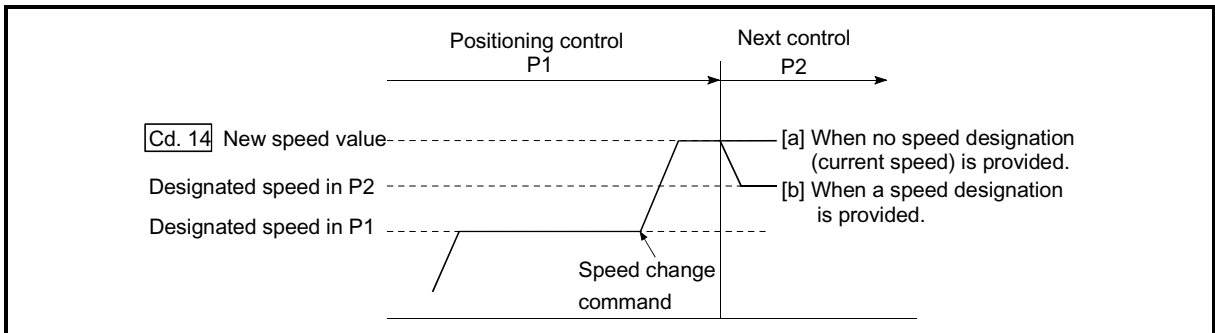


Fig. 12.22 Speed change during continuous path control

- (2) When changing the speed during continuous path control, the speed change will be ignored if there is not enough distance remaining to carry out the change.

- (3) When the stop command was given to make a stop after a speed change that had been made during position control, the restarting speed depends on the "Cd.14 New speed value".

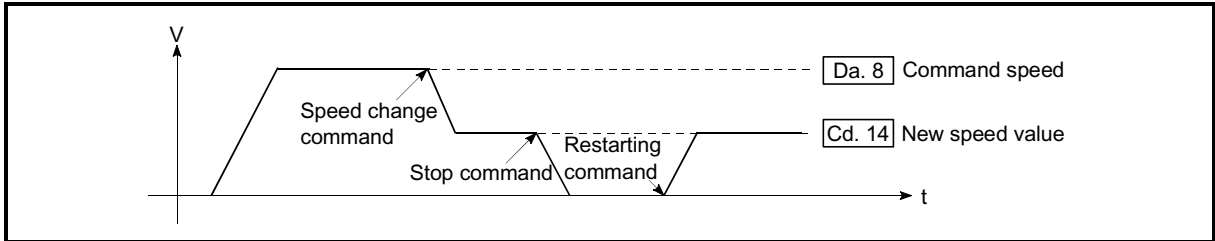


Fig. 12.23 Restarting speed after speed change made during position control

- (4) When the speed is changed by setting "Cd.14 New speed value" to "0", the operation is carried out as follows.
  - ≠ A deceleration stop is carried out, and the speed change 0 flag (Md.31 Status: b10) turns ON. (During interpolation control, the speed change 0 flag on the reference axis side turns ON.)
  - ≠ The axis stops, but "Md.26 Axis operation status" does not change, and the BUSY signal remains ON. (If a stop signal is input, the BUSY signal will turn OFF, and "Md.26 Axis operation status" will change to "stopped".)
  - \*In this case, setting the "Cd.14 New speed value" to a value besides "0" will turn OFF the speed change 0 flag (Md.31 Status: b10), and enable continued operation.

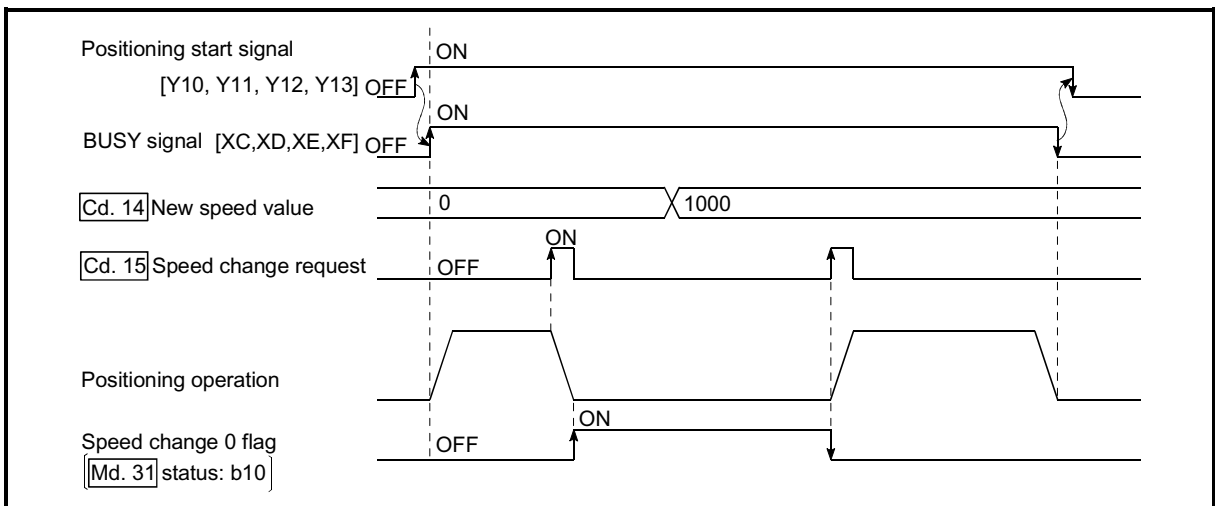


Fig. 12.24 Speed change at new speed value "0"

- (5) A warning "Deceleration/stop speed change (warning code: 500)" occurs and the speed cannot be changed in the following cases.
  - ≠ During deceleration by a stop command
  - ≠ During automatic deceleration during positioning control
- (6) A warning "Speed limit value over (warning code: 501)" occurs and the speed is controlled at the " [Pr.8] Speed limit value" when the value set in " [Cd.14] New speed value" is equal to or larger than the " [Pr.8] Speed limit value".
- (7) When the speed is changed during interpolation control, the required speed is set in the reference axis.
- (8) When carrying out consecutive speed changes, be sure there is an interval between the speed changes of 100ms or more.  
(If the interval between speed changes is short, the QD75 will not be able to track, and it may become impossible to carry out commands correctly.)
- (9) When a speed change is requested simultaneously for multiple axes, change the speed in the ascending axis number order.
- (10) Speed change cannot be carried out during the machine OPR. A request for speed change is ignored.
- (11) When deceleration is started by the speed change function, the deceleration start flag does not turn ON.

[3] Setting the speed change function from the PLC CPU

The following shows the data settings and PLC program example for changing the control speed of axis 1 from the PLC CPU. (In this example, the control speed is changed to "20.00mm/min".)

- (1) Set the following data.  
(Use the start time chart shown in section (2) below as a reference, and set using the PLC program shown in section (3).)

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Cd.14] New speed value	2000	Set the new speed.	1514 1515	1614 1615	1714 1715	1814 1815
[Cd.15] Speed change request	1	Set "1: Change the speed".	1516	1616	1716	1816

\* Refer to Section 5.7 "List of control data" for details on the setting details.

(2) The following shows the speed change time chart.


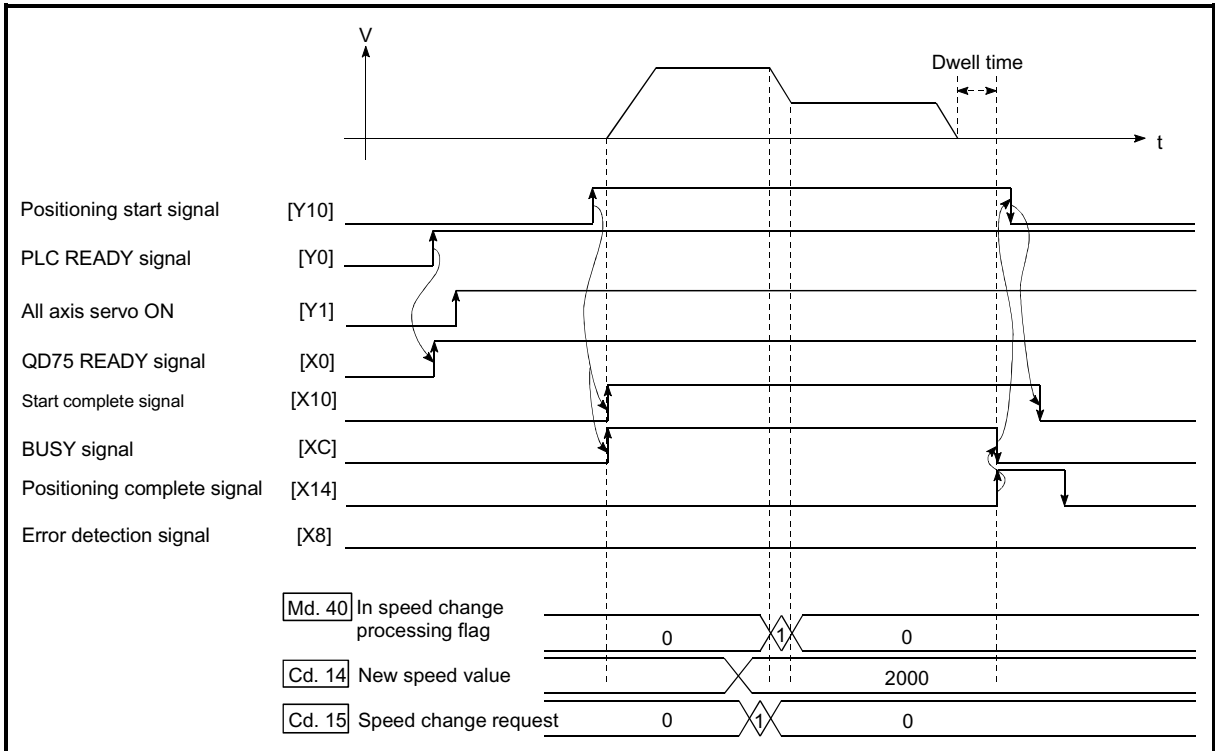


Fig. 12.25 Time chart for changing the speed from the PLC CPU

(3) Add the following PLC program to the control program, and write it to the PLC CPU.



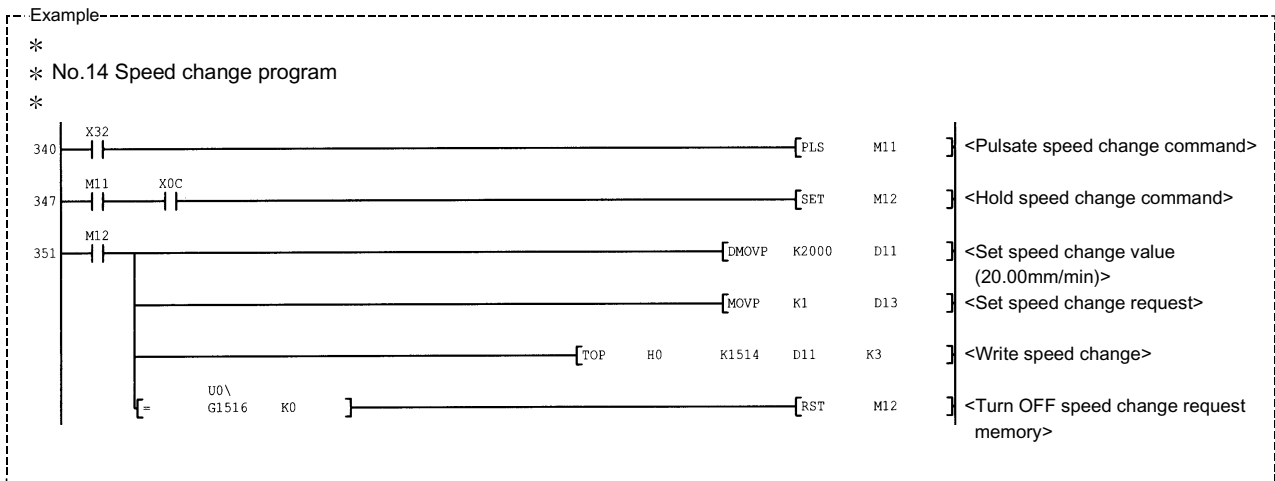

[4] Setting the speed change function using an external command signal

The speed can also be changed using an "external command signal".

The following shows the data settings and PLC program example for changing the control speed of axis 1 using an "external command signal". (In this example, the control speed is changed to "10000.00mm/min".)

- (1) Set the following data to change the speed using an external command signal.

(Use the start time chart shown in section (2) below as a reference, and set using the PLC program shown in section (3).)

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Pr.42 External command function selection	1	Set "1: External speed change request".	62	212	362	512
Cd.8 External command valid	1	Set "1: Validate the external command".	1505	1605	1705	1805
Cd.14 New speed value	1000000	Set the new speed.	1514	1614	1714	1814
			1515	1615	1715	1815

\* Refer to section "5.7 List of control data" for details on the setting details.

- (2) The following shows the speed change time chart.


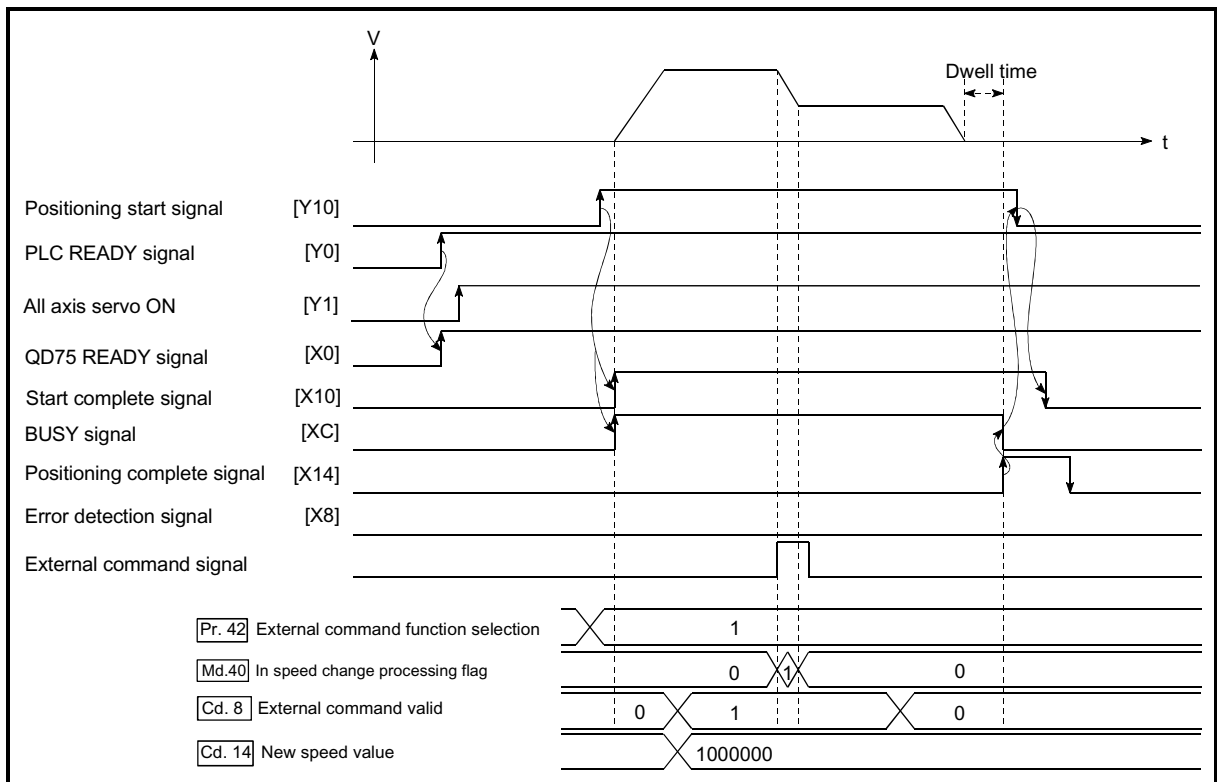


Fig. 12.26 Time chart for changing the speed using an external command signal

(3) Add the following PLC program to the control program, and write it to the PLC CPU.

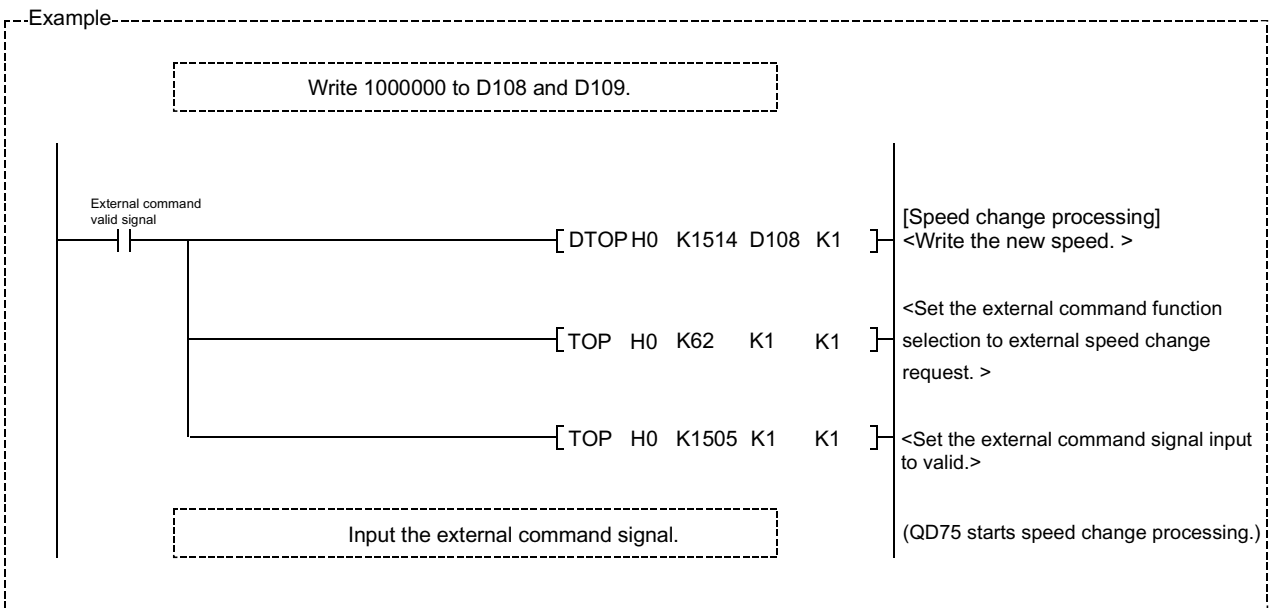

12.5.2 Override function

The override function changes the command speed by a designated percentage (1 to 300%) for all control to be executed.

The speed can be changed by setting the percentage (%) by which the speed is changed in "Cd.13 Positioning operation speed override".

However, when a machine OPR is performed, an override cannot be made after a deceleration start to the creep speed following the detection of near-point dog ON.

- [1] Control details
- [2] Precautions during control
- [3] Setting the override function

[1] Control details

The following shows that operation of the override function.

- 1) A value changed by the override function is monitored by "Md.22 Feedrate".
- 2) If "Cd.13 Positioning operation speed override" is set to 100%, the speed will not change.
- 3) If "Cd.13 Positioning operation speed override" is set a value less than 100%, control will be carried out at speed unit "1" at the time "Md.22 Feedrate" becomes a value of "1" or less. (When Md.22 becomes "0", the warning "Less than minimum speed (warning code: 110)" is generated and the axis is controlled in the then speed unit of "1".)
- 4) If there is not enough remaining distance to change the speed when the speed is changed during the position control of speed-position switching control or position-speed switching control, the operation will be carried out at the speed that could be changed.
- 5) If the speed changed by the "override function" is greater than the "Pr.8 Speed limit value", a warning "Speed limit value over (warning code: 501)" will occur and the speed will be controlled at the "Pr.8 Speed limit value". The "Md.39 Speed limit flag" will turn ON.

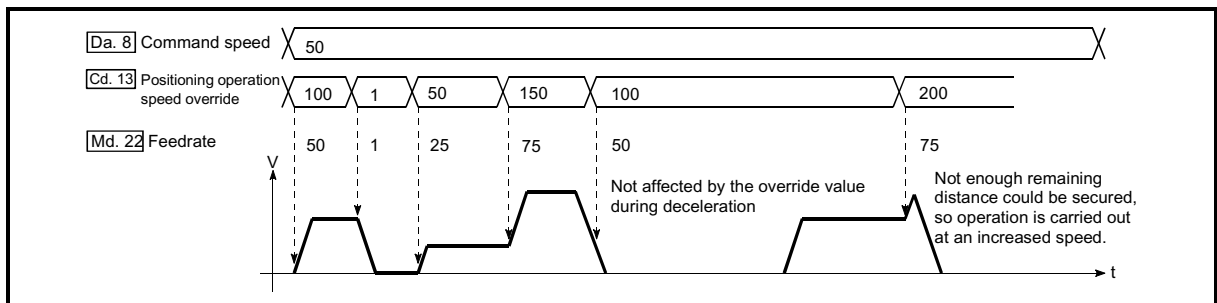


Fig. 12.27 Override function operation

[2] Precaution during control

- (1) When changing the speed during continuous path control, the speed change will be ignored if there is not enough distance remaining to carry out the change.
- (2) A warning "Deceleration/stop speed change (warning code: 500)" occurs and the speed cannot be changed in the following cases.  
 (The value set in " [Cd.13] Positioning operation speed override" is validated after a deceleration stop.)  
 ≠ During deceleration by a stop command  
 ≠ During automatic deceleration during positioning control
- (3) When the speed is changed during interpolation control, the required speed is set in the reference axis.
- (4) When deceleration is started by the override function, the deceleration start flag does not turn ON.
- (5) When carrying out continuously override, be sure there is an interval between the override execution of 100ms or more.  
 (If the interval between override is short, the QD75 will not be able to track, and it may become impossible to carry out commands correctly.)

[3] Setting the override function

The following shows the data settings and PLC program example for setting the override value of axis 1 to "200%".

- (1) Set the following data. (Use the start time chart shown in section (2) below as a reference, and set using the PLC program shown in section (3).)

Setting item		Setting value	Setting details	Buffer memory address			
				Axis 1	Axis 2	Axis 3	Axis 4
[Cd.13]	Positioning operation speed override	200	Set the new speed as a percentage (%).	1513	1613	1713	1813

\* Refer to Section 5.7 "List of control data" for details on the setting details.

(2) The following shows a time chart for changing the speed using the override function.


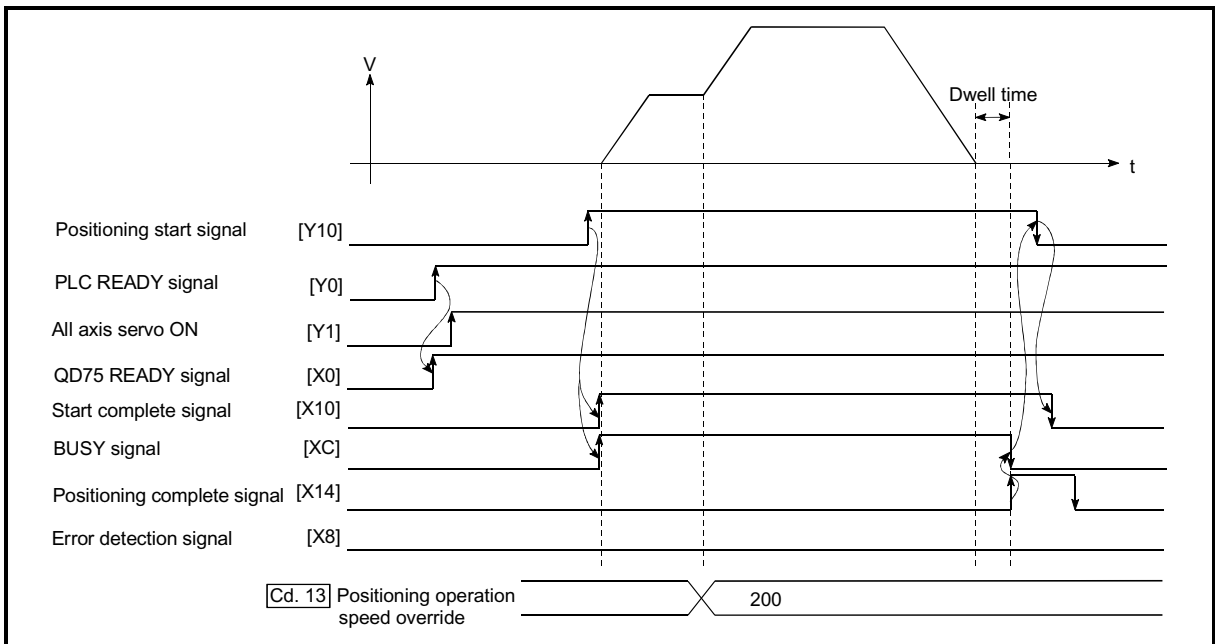


Fig. 12.28 Time chart for changing the speed using the override function

(3) Add the following PLC program to the control program, and write it to the PLC CPU.

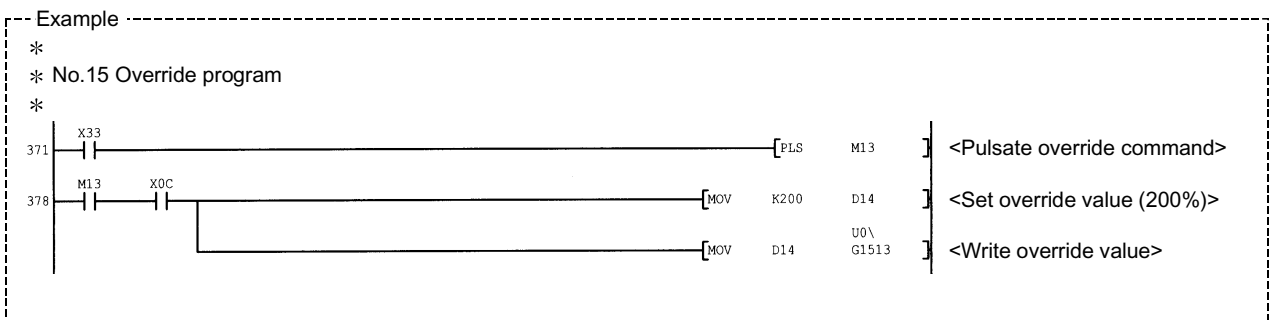

12.5.3 Acceleration/deceleration time change function

The "acceleration/deceleration time change function" is used to change the acceleration/deceleration time during a speed change to a random value when carrying out the speed change indicated in Section 12.5.1 "Speed change function". In a normal speed change (when the acceleration/deceleration time is not changed), the acceleration/deceleration time previously set in the parameters ( [Pr.9] , [Pr.10] , and [Pr.25] to [Pr.30] values) is set in the positioning parameter data items [Da.3] and [Da.4], and control is carried out with that acceleration/deceleration time. However, by setting the new acceleration/deceleration time ( [Cd.10] , [Cd.11] ) in the control data, and issuing an acceleration/deceleration time change enable command ( [Cd.12] Acceleration/deceleration time change during speed change, enable/disable selection) to change the speed when the acceleration/deceleration time change is enabled, the speed will be changed with the new acceleration/deceleration time ( [Cd.10] , [Cd.11] ).

The details shown below explain about the "acceleration/deceleration time change function".

- [1] Control details
- [2] Precautions during control
- [3] Setting the acceleration/deceleration time change function

[1] Control details

The following drawing shows the operation during an acceleration/deceleration time change.


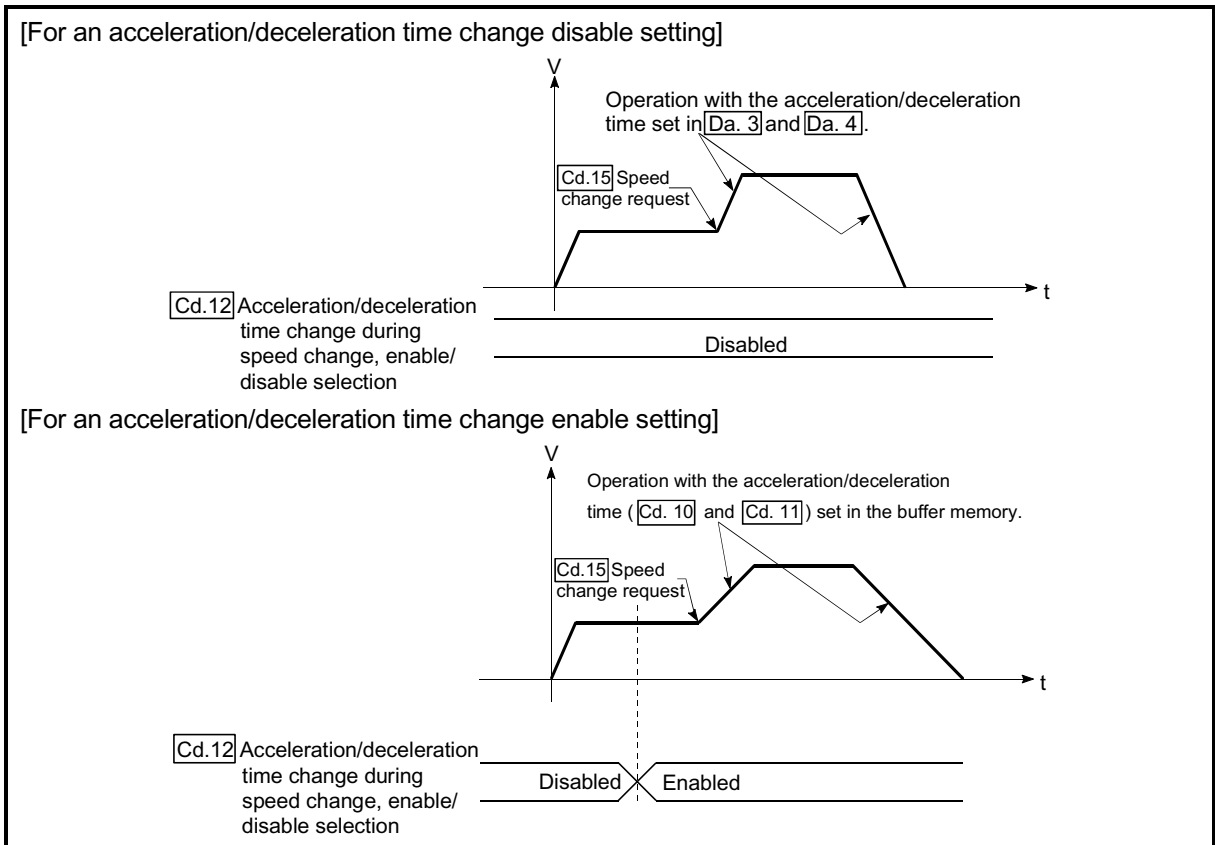



Fig. 12.29 Operation during an acceleration/deceleration time change

[2] Precautions during control

- (1) When "0" is set in " [Cd.10] New acceleration time value" and " [Cd.11] New deceleration time value", the acceleration/deceleration time will not be changed even if the speed is changed. In this case, the operation will be controlled at the acceleration/deceleration time previously set in the parameters.
- (2) The "new acceleration/deceleration time" is valid during execution of the positioning data for which the speed was changed. In continuous positioning control and continuous path control, the speed is changed and control is carried out with the previously set acceleration/deceleration time at the changeover to the next positioning data, even if the acceleration/deceleration time is changed to the "new acceleration/deceleration time ( [Cd.10] , [Cd.11] )".
- (3) Even if the acceleration/deceleration time change is set to disable after the "new acceleration/deceleration time" is validated, the positioning data for which the "new acceleration/deceleration time" was validated will continue to be controlled with that value. (The next positioning data will be controlled with the previously set acceleration/deceleration time.)

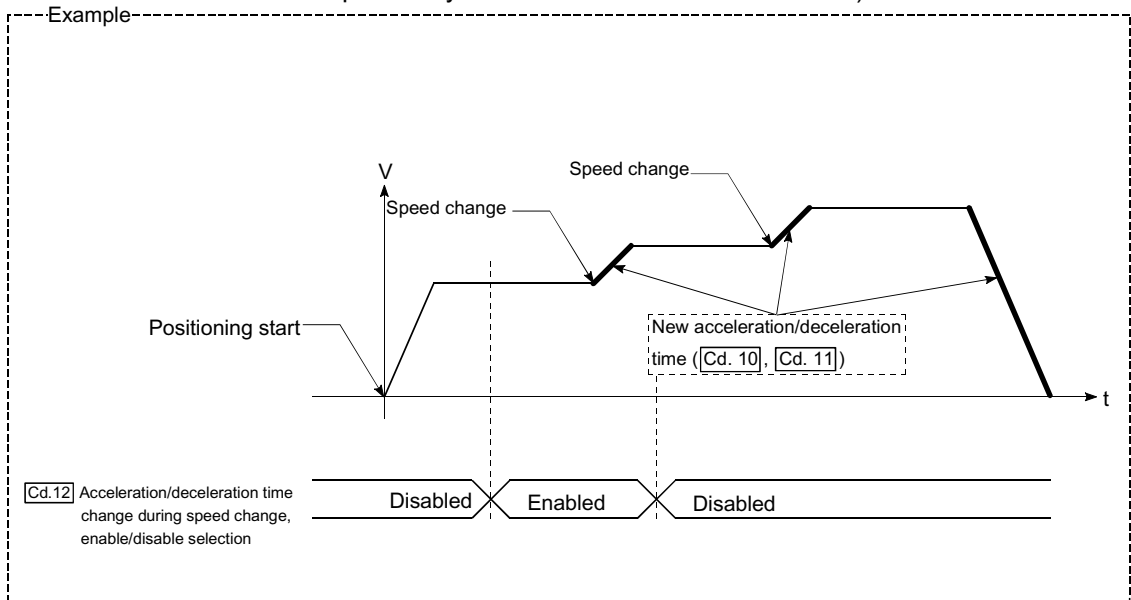

- (4) If the "new acceleration/deceleration time" is set to "0" and the speed is changed after the "new acceleration/deceleration time" is validated, the operation will be controlled with the previous "new acceleration/deceleration time".

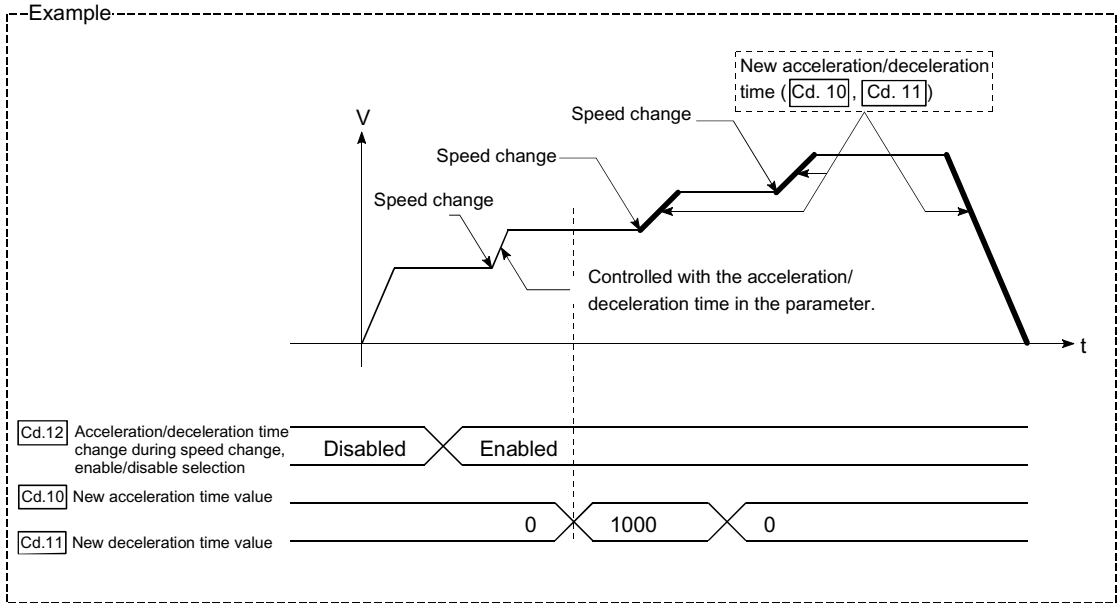

- (5) The acceleration/deceleration time change function is disabled for JOG operation and inching operation.

**POINT**

If the speed is changed when an acceleration/deceleration change is enabled, the "new acceleration/deceleration time" will become the acceleration/deceleration time of the positioning data being executed. The "new acceleration/deceleration time" remains valid until the changeover to the next positioning data. (The automatic deceleration processing at the completion of the positioning will also be controlled by the "new acceleration/deceleration time".)

**[3] Setting the acceleration/deceleration time change function**

To use the "acceleration/deceleration time change function", write the data shown in the following table to the QD75 using the PLC program.

The set details are validated when a speed change is executed after the details are written to the QD75.


Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.10	New acceleration time value	→ Set the new acceleration time.	1508 1509	1608 1609	1708 1709	1808 1809
Cd.11	New deceleration time value	→ Set the new deceleration time.	1510 1511	1610 1611	1710 1711	1810 1811
Cd.12	Acceleration/deceleration time change during speed change, enable/disable selection	1 Set "1: Acceleration/deceleration time change enable".	1512	1612	1712	1812

\* Refer to Section 5.7 "List of control data" for details on the setting details.



Example

\*  
 \* No.16 Acceleration/deceleration time change program  
 \*

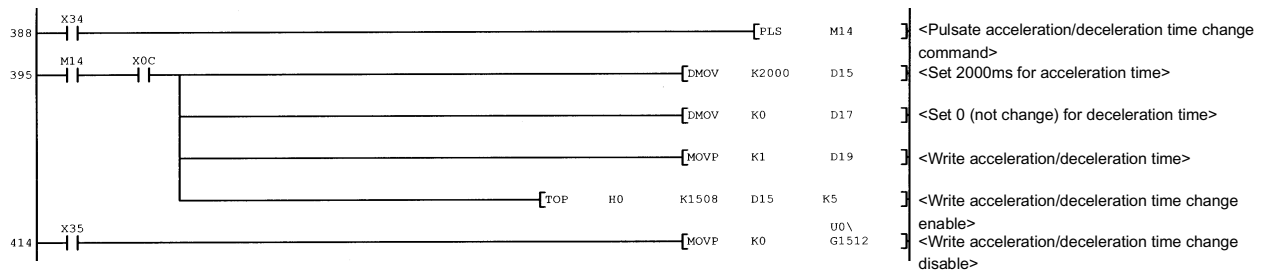

### 12.5.4 Torque change function

The "torque change function" is used to change the torque limit value during torque limiting.

The torque limit value during torque limiting is normally the value set in the " [Pr.17](#) Torque limit setting value" or " [Cd.101](#) Torque output setting value" that was previously set in the parameters. However, by setting the new torque limit value in the axis control data " [Cd.22](#) New torque value", and writing it to the QD75, the torque generated by the servomotor during control can be limited with the new torque value. (The " [Cd.22](#) New torque value" is validated when written to the QD75.)

The details shown below explain about the "torque change function".

- [1] Control details
- [2] Precautions during control
- [3] Setting the torque change function start signal

[1] Control details

The torque value of the axis control data can be changed at all times. The torque can be limited with a new torque value from the time the new torque value has been written to the QD75. (a torque change is made only during operation.) (Note that the delay time until a torque control is executed is max. 7.1ms after torque change value was written.)

The torque limiting is not carried out from the time the power supply is turned ON to the time the PLC READY signal (Y0) is turned ON.

The torque setting range is from 0 to "Pr.17 Torque limit setting value".

When the new torque value is 0, a torque change is considered not to be carried out.

The torque change range is 1 to "Pr.17 Torque limit setting value".

The following drawing shows the torque change operation.

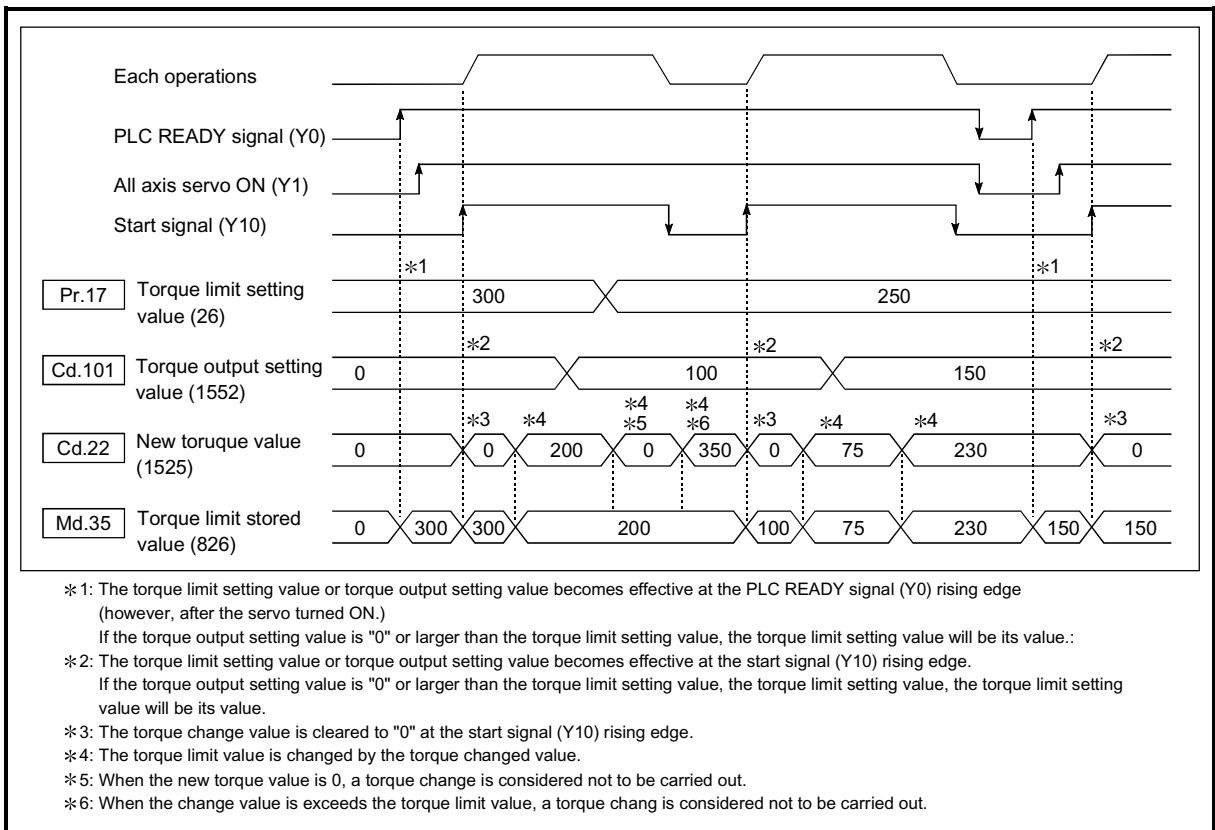


Fig. 12.30 Torque change operation

[2] Precautions during control

- (1) If a value besides "0" is set in the "Cd.22 New torque value", the torque generated by the servomotor will be limited by that value. To limit the torque with the value set in "Pr.17 Torque limit setting value" or "Cd.101 Torque output setting value", set the "Cd.22 New torque value" to "0".
- (2) The "Cd.22 New torque value" is validated when written to the QD75.  
(Note that it is not validated from the time the power supply is turned ON to the time the PLC READY signal (Y0) is turned ON.)
- (3) If the setting value is outside the setting range, an axis warning "Outside new torque value range" (warning code: 113) will occur and the torque will not be changed.
- (4) If the time to hold the new torque value is not more than 100ms, a torque change may not be executed.

[3] Setting the torque change function start signal

To use the "torque change function", write the data shown in the following table to the QD75 using the PLC program.

The set details are validated when written to the QD75.

Setting item		Setting value	Setting details	Buffer memory address			
				Axis 1	Axis 2	Axis 3	Axis 4
Cd.22	New torque value	→	Set the new torque limit value.	1525	1625	1725	1825

\* Refer to Section 5.7 "List of control data" for details on the setting details.

12.6 Absolute position system

The QD75 can construct an absolute position system by installing the absolute position system and connecting it through SSCNET.

The following describes precautions when constructing the absolute position system.

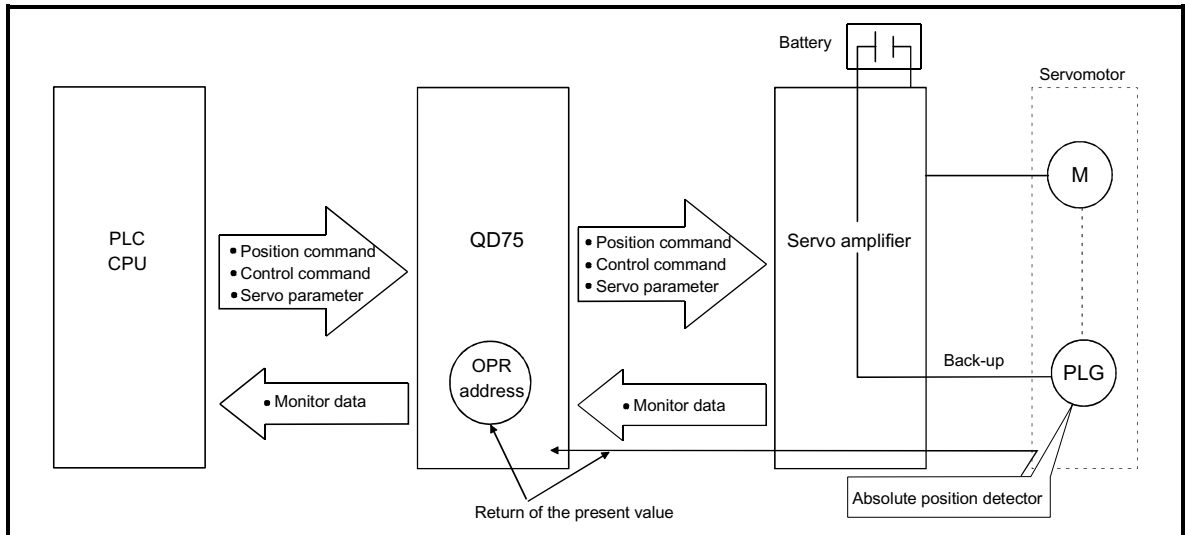


Fig. 12.31 Configuration of absolute position system

[1] Setting for absolute positions

When constructing an absolute position system, use a servomotor with absolute position detector.

It is also necessary to install a battery for retaining the location of the OPR in the servo amplifier. When an absolute position detector is installed, select "absolute value detector available" in the amplifier setting for the servo basic parameters.

Axis No.	Axis 1	Axis 2	Axis 3	Axis 4
Buffer memory	30101	30201	30301	30401

[2] OPR

The absolute position system can establish the location of the OPR, using "Data set method", "Near-point dog" and "Count method" OPR method.

In the "Data set method" OPR method, the location to which the location of the OPR position is moved by manual operation (JOG operation/manual pulse generator operation) is treated as the OPR position.

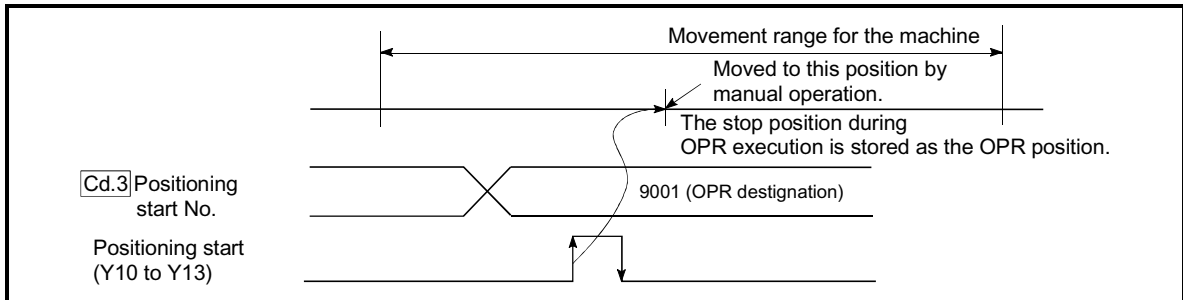


Fig. 12.32 Operation of the OPR execution

**POINT**

The OPR must be made after the servomotor has been rotated more than one revolution using JOG or positioning operation. If OPR is not rotated more than one revolution, error [210] (Home position return (OPR) restart zero point not passed) occurs.

When "Pr.133 OPR set condition selection" of the MR-J2S-B or MR-J2M-B is set "1", OPR can be carried out even if the servomotor are not routed more than one revolution. (The "OP address" is the current value at the power supply is turned ON.)

12.7 Other functions

Other functions include the "step function", "skip function", "M code output function", "teaching function", "target position change function", "command in-position function", "acceleration/deceleration processing function", "pre-reading start function", "deceleration start flag function" and "stop command processing for deceleration stop function" and "follow up processing function". Each function is executed by parameter setting or PLC program creation and writing.

12.7.1 Step function

The "step function" is used to confirm each operation of the positioning control one by one.

It is used in debugging work for major positioning control, etc.

A positioning operation in which a "step function" is used is called a "step operation". In step operations, the timing for stopping the control can be set. (This is called the "step mode".) Control stopped by a step operation can be continued by setting "step continue" (to continue the control)" or restarted by setting "restart" in the "step start information".

The details shown below explain about the "step function".

- [1] Relation between the step function and various controls
- [2] Step mode
- [3] Step start information
- [4] Using the step operation
- [5] Control details
- [6] Precautions during control
- [7] Step function settings

[1] Relation between the step function and various controls

The following table shows the relation between the "step function" and various controls.

Control type		Step function	Step applicability	
OPR control	Machine OPR control	×	Step operation not possible	
	Fast OPR control	×		
Major positioning control	Position control	1-axis linear control	○	
		2 to 4-axes linear interpolation control	○	
		1-axis fixed-feed control	○	
		2 to 4- axes fixed-feed control (interpolation)	○	
	2-axis circular interpolation control	○	Step operation possible	
	1 to 4- axes Speed control	×		Step operation not possible
	Speed-position switching control Position-speed switching control	○		Step operation possible
Other control	Current value changing	○	Step operation not possible	
JUMP instruction, NOP instruction, LOOP to LEND	×			
Manual control	JOG operation, Inching operation	×	Step operation not possible	
	Manual pulse generator operation	×		

○ : Set when required. × : Setting not possible

[2] Step mode

In step operations, the timing for stopping the control can be set. This is called the "step mode". (The "step mode" is set in the control data " [Cd.34] Step mode".)

The following shows the two types of "step mode" functions.

(1) Deceleration unit step

The operation stops at positioning data requiring automatic deceleration. (A normal operation will be carried out until the positioning data requiring automatic deceleration is found. Once found, that positioning data will be executed, and the operation will then automatically decelerate and stop.)

(2) Data No. unit step

The operation automatically decelerates and stops for each positioning data. (Even in continuous path control, an automatic deceleration and stop will be forcibly carried out.)

[3] Step start information

Control stopped by a step operation can be continued by setting "step continue" (to continue the control) in the "step start information". (The "step start information" is set in the control data " [Cd.36] Step start information".)

The following table shows the results of starts using the "step start information" during step operation.

Stop status in the step operation	[Md.26] Axis operation status	[Cd.36] Step start information	Step start results
1 step of positioning stopped normally	Step standing by	1: Step continue	The next positioning data is executed.

The warnings "Step not possible (warning code: 511)" will occur if the " [Md.26]

Axis operation status" is as shown below or the step valid flag is OFF when step start information is set.

[Md.26] Axis operation status	Step start results
Standing by	Step not continued by warning
Stopped	
In interpolation	
In JOG operation	
In manual pulse generator operation	
Analyzing	
Waiting for special start	
In OPR	
In position control	
In speed control	
In speed control of speed-position switching control	
In position control of speed-position switching control	
In speed control of position-speed switching control	
In position control of position-speed switching control	



**[4] Using the step operation**

The following shows the procedure for checking positioning data using the step operation.

- (1) Turn ON the step valid flag before starting the positioning data.  
(Write "1" (carry out step operation) in " [Cd.35](#) Step valid flag".)
- (2) Set the step mode before starting the positioning data.  
(Set in " [Cd.34](#) Step mode".)
- (3) Turn ON the positioning start signal, and check that the positioning control starts normally.
- (4) The control will stop for the following reasons.
  - a) One step of positioning stopped normally. → Go to step (6).
  - b) Control stopped by a stop signal. → Take appropriate measures, go to step (5).
  - c) An error occurred and the control stopped. → Take appropriate measures, go to step (3).
- (5) Write "1" (restart) to " [Cd.6](#) Restart command", and check that the positioning data where the control stopped operates normally. → Go to step (4).
- (6) Write "1" (step continue) to " [Cd.36](#) Step start information", and check that the next positioning data operates normally.
  - a) One step of positioning stopped normally. → Go to step (6).
  - b) Control stopped by a stop signal. → Take appropriate measures, go to step (5).
  - c) An error occurred and the control stopped. → Take appropriate measures, go to step (3).
  - d) All positioning data operated normally. → Go to step (7).
- (7) Turn OFF the step valid flag, and quit the "step function".  
(Write "0" (do not carry out step operation) in " [Cd.35](#) Step valid flag".)

[5] Control details

(1) The following drawing shows a step operation during a "deceleration unit step".

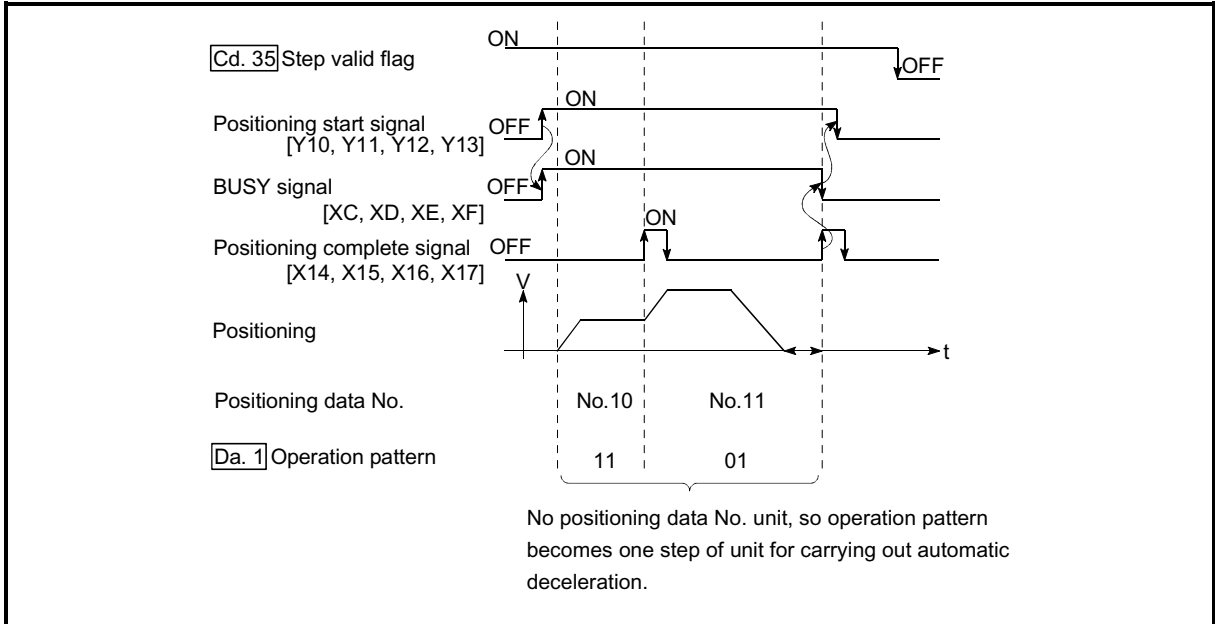


Fig. 12.33 Operation during step execution by deceleration unit step

(2) The following drawing shows a step operation during a "data No. unit step".

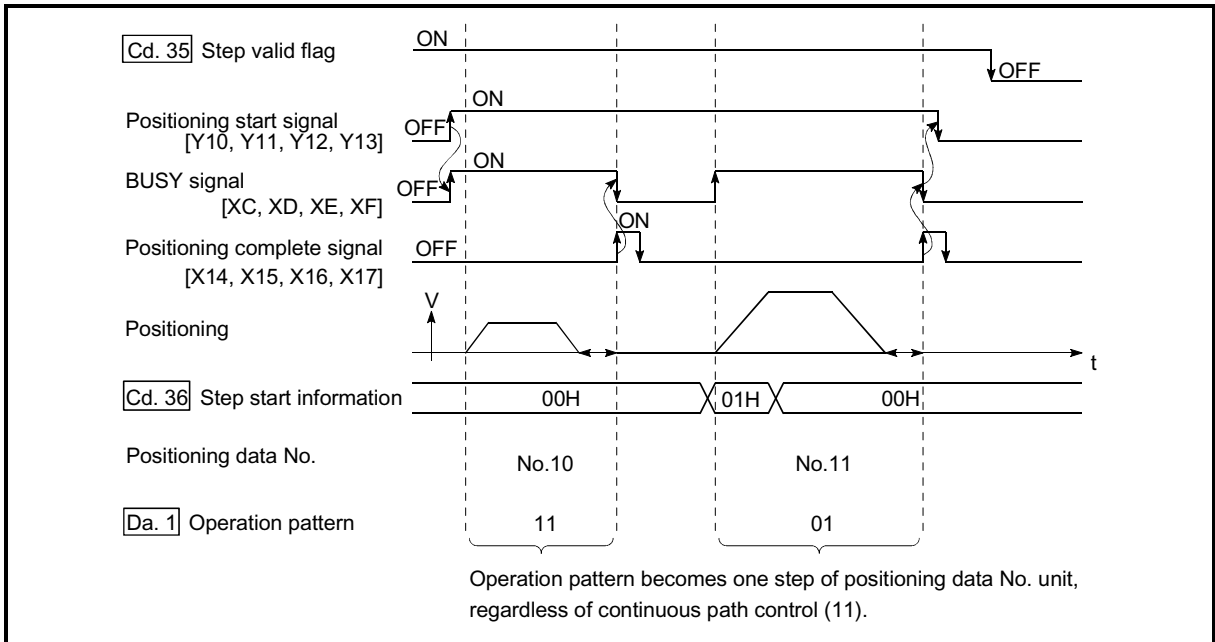


Fig. 12.34 Operation during step execution positioning data No. unit step

**[6] Precautions during control**

- (1) When step operation is carried out using interpolation control positioning data, the step function settings are carried out for the reference axis.
- (2) When the step valid flag is ON, the step operation will start from the beginning if the positioning start signal is turned ON while "Md.26 Axis operation status" is "step standing by". (The step operation will be carried out from the positioning data set in "Cd.3 Positioning start No".)

**[7] Step function settings**

To use the "step function", write the data shown in the following table to the QD75 using the PLC program. Refer to section [4] "Using the step operation" for the timing of the settings.

The set details are validated when written to the QD75.

Setting item		Setting value	Setting details	Buffer memory address			
				Axis 1	Axis 2	Axis 3	Axis 4
Cd.34	Step mode	→	Set "0: Deceleration unit step" or "1: Data No. unit step".	1544	1644	1744	1844
Cd.35	Step valid flag	1	Set "1: Carry out step operation".	1545	1645	1745	1845
Cd.36	Step start information	→	Set "1: Step continue", depending on the stop status.	1546	1646	1746	1846

\* Refer to Section 5.7 "List of control data" for details on the setting details.

## 12.7.2 Skip function

The "skip function" is used to stop (deceleration stop) the control of the positioning data being executed at the time of the skip signal input, and execute the next positioning data.

A skip is executed by a skip command ( [Cd.37](#) Skip command) or external command signal.

The "skip function" can be used during control in which positioning data is used.

The details shown below explain about the "skip function".

[1] Control details

[2] Precautions during control

[3] Setting the skip function from the PLC CPU

[4] Setting the skip function using an external command signal

## [1] Control details

The following drawing shows the skip function operation.

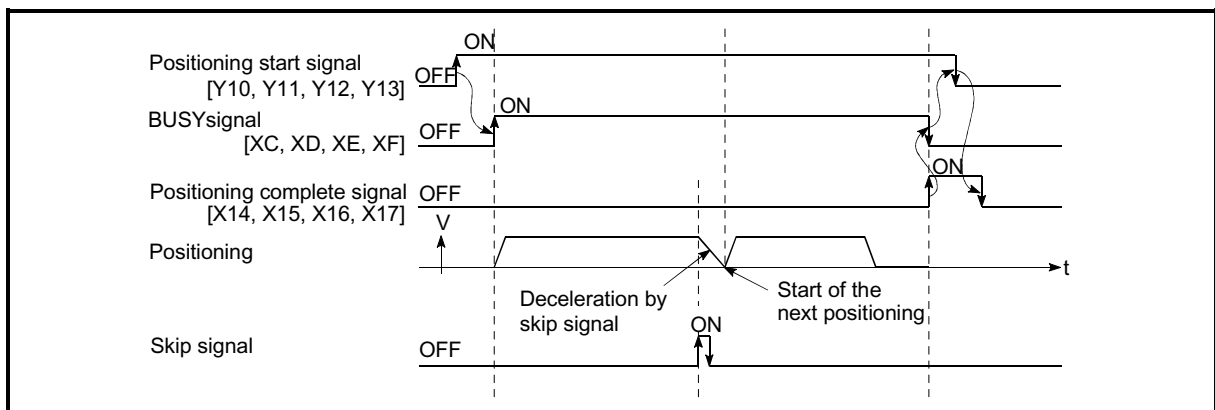


Fig. 12.35 Operation when a skip signal is input during positioning control

## [2] Precautions during control

- (1) If the skip signal is turned ON at the last of an operation, a deceleration stop will occur and the operation will be terminated.
- (2) When a control is skipped (when the skip signal is turned ON during a control), the positioning complete signals (X14, X15, X16, X17) will not turn ON.
- (3) When the skip signal is turned ON during the dwell time, the remaining dwell time will be ignored, and the next positioning data will be executed.
- (4) When a control is skipped during interpolation control, the reference axis skip signal is turned ON. When the reference axis skip signal is turned ON, a deceleration stop will be carried out for every axis, and the next reference axis positioning data will be executed.
- (5) The M code ON signals (X4, X5, X6, X7) will not turn ON when the M code output is set to the AFTER mode (when "1: AFTER mode" is set in [Pr.18](#) M code ON signal output timing").  
(In this case, the M code will not be stored in [Md.25](#) Valid M code.)
- (6) The skip cannot be carried out by the speed-position and position-speed switching control. It is processed in the same manner as in the speed control.

[3] Setting the skip function from the PLC CPU

The following shows the settings and PLC program example for skipping the control being executed in axis 1 with a command from the PLC CPU.

- (1) Set the following data.  
(The setting is carried out using the PLC program shown below in section (2)).

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
<span style="border: 1px solid black; padding: 2px;">Cd.37</span> Skip command	1	Set "1: Skip request".	1547	1647	1747	1847


\* Refer to Section "5.7 List of control data" for details on the setting details.

- (2) Add the following PLC program to the control program, and write it to the PLC CPU.

- 1) When the "skip command" is input, the value "1" (skip request) set in "Cd.37 Skip command" is written to the QD75 buffer memory (1547).

Example

\*  
\* No.19 Skip program  
\*

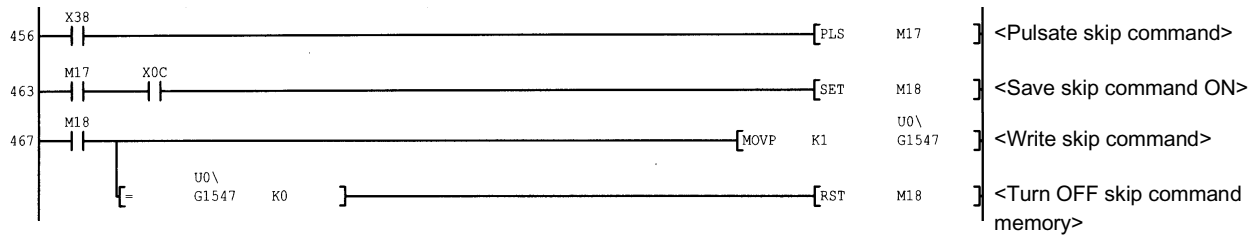

[4] Setting the skip function using an external command signal


The skip function can also be executed using an "external command signal". The following shows the settings and PLC program example for skipping the control being executed in axis 1 using an "external command signal".

- (1) Set the following data to execute the skip function using an external command signal.  
(The setting is carried out using the PLC program shown below in section (2)).

Setting item	Setting value	Setting details	Buffer memory address				
			Axis 1	Axis 2	Axis 3	Axis 4	
Pr.42	External command function selection	3	Set "3: Skip request".	62	212	362	512
Cd.8	External command valid	1	Set "1: Validate external command".	1505	1605	1705	1805

\* Refer to Section 5.7 "List of control data" for details on the setting details.

- (2) Add the following PLC program to the control program, and write it to the PLC CPU.

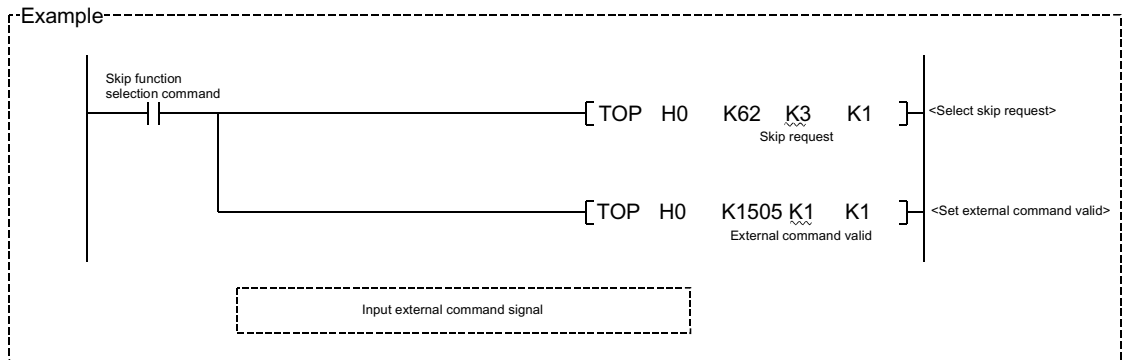

12.7.3 M code output function

The "M code output function" is used to command sub work (clamping, drill rotation, tool replacement, etc.) related to the positioning data being executed. When the M code ON signal (X4, X5, X6, X7) is turned ON during positioning execution, a No. called the M code is stored in "Md.25 Valid M code".

These "Md.25 Valid M code" are read from the PLC CPU, and used to command auxiliary work. M codes can be set for each positioning data. (Set in setting item "Da.10 M code" of the positioning data.)

The timing for outputting (storing) the M codes can also be set in the "M code output function".

The details shown below explain about the "M code output function".

- [1] M code ON signal output timing
- [2] M code OFF request
- [3] Precautions during control
- [4] Setting the M code output function
- [5] Reading M codes

[1] M code ON signal output timing

The timing for outputting (storing) the M codes can be set in the "M code output function". (The M code is stored in "Md.25 Valid M code" when the M code ON signal is turned ON.)

The following shows the two types of timing for outputting M codes: the "WITH mode" and the "AFTER mode".

(1) WITH mode

The M code ON signal (X4, X5, X6, X7) is turned ON at the positioning start, and the M code is stored in "Md.25 Valid M code".

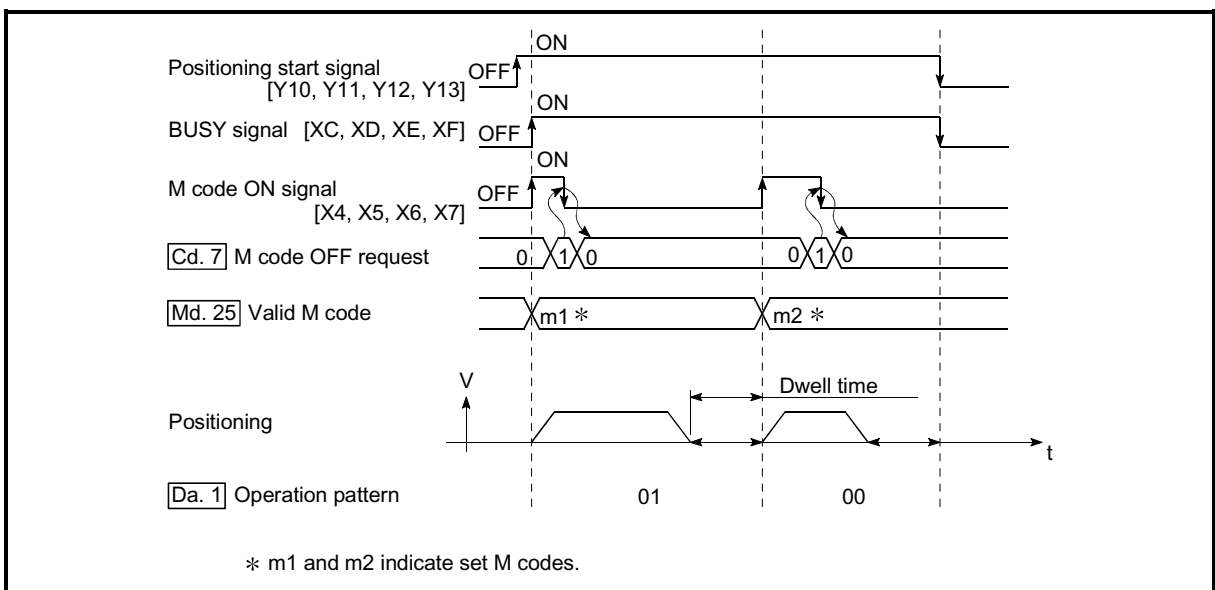


Fig. 12.36 M code ON/OFF timing (WITH mode)

(2) AFTER mode

The M code ON signal (X4, X5, X6, X7) is turned ON at the positioning completion, and the M code is stored in "Md.25 Valid M code".

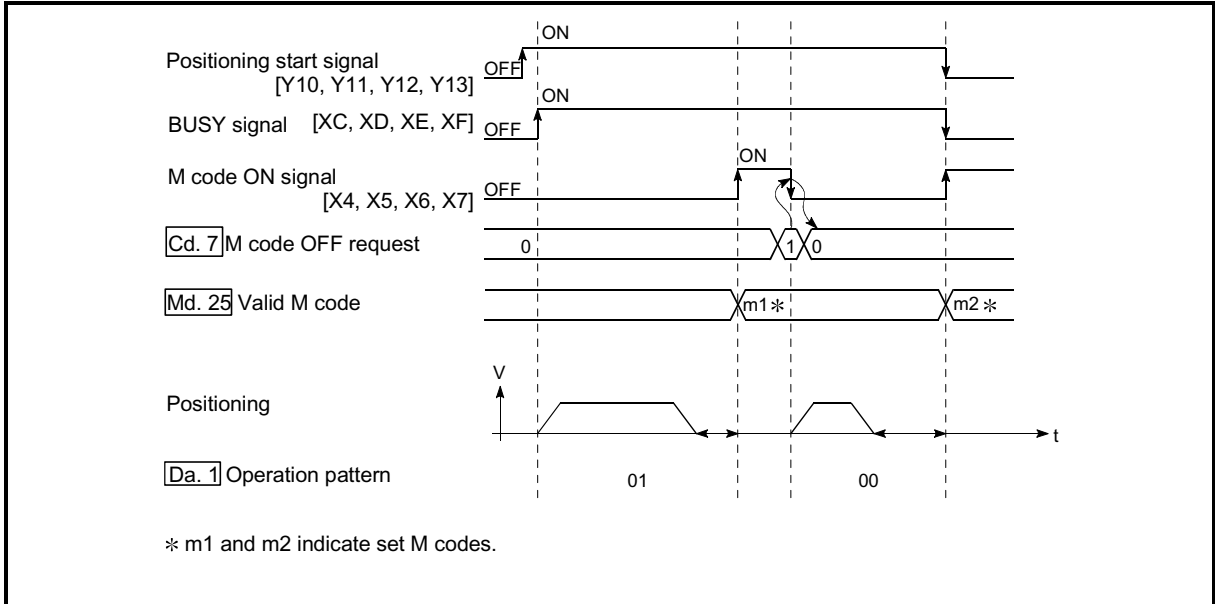


Fig. 12.37 M code ON/OFF timing (AFTER mode)

[2] M code OFF request

When the M code ON signal (X4, X5, X6, X7) is ON, it must be turned OFF by the PLC program.

To turn OFF the M code ON signal, set "1" (turn OFF the M code signal) in "Cd.7 M code OFF request".

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.7 M code OFF request	1	Set "1: Turn OFF the M code ON signal".	1504	1604	1704	1804

\* Refer to Section 5.7 "List of control data" for details on the setting details.

The next positioning data will be processed as follows if the M code ON signal is not turned OFF. (The processing differs according to the Da.1 Operation pattern.)

Da.1 Operation pattern		Processing
00	Independent positioning control (Positioning control)	The next positioning data will not be executed until the M code ON signal is turned OFF.
01	Continuous positioning control	
11	Continuous path control	The next positioning data will be executed, but a warning "M code ON signal ON start" (warning code: 503) will occur.



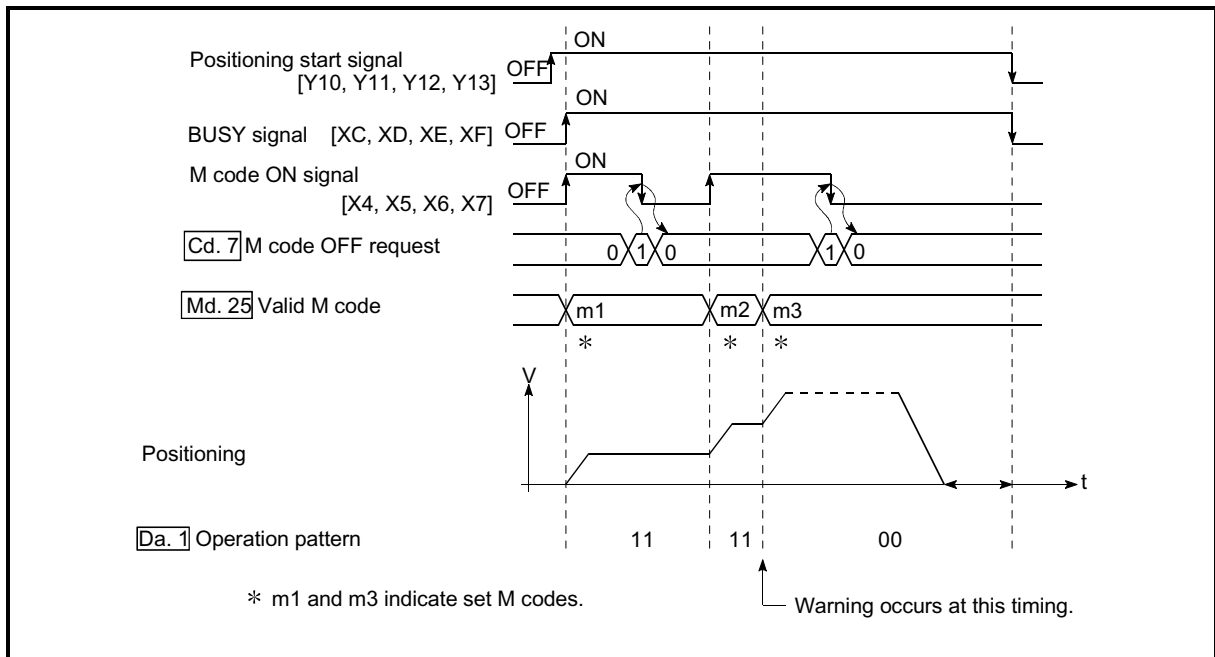


Fig. 12.38 Warning due to an M code ON signal during continuous path control

**POINT**

If the M code output function is not required, set a "0" in setting item " **Da.10** M code" of the positioning data.

**[3] Precautions during control**

- (1) During interpolation control, the reference axis M code ON signal is turned ON.
- (2) The M code ON signal will not turn ON if "0" is set in " **Da.10** M code". (The M code will not be output, and the previously output value will be held in " **Md.25** Valid M code".)
- (3) If the M code ON signal is ON at the positioning start, an error "M code signal ON at positioning start (error code: 536)" will occur, and the positioning will not start.
- (4) If the PLC READY signal (Y0) is turned OFF, the M code ON signal will turn OFF and "0" will be stored in " **Md.25** Valid M code".
- (5) If the positioning operation time is short during continuous path control, there will not be enough time to turn OFF the M code ON signal, and a warning "M code signal ON (error code: 503)" may occur. In this case, set a "0" in the " **Da.10** M code" of that section's positioning data.
- (6) In the AFTER mode during speed control, the M code is not output and the M code ON signal does not turn ON.
- (7) If current value changing where "9003" has been set to " **Cd.3** Positioning start No." is performed, the M code output function is made invalid.

[4] Setting the M code output function

The following shows the settings to use the "M code output function".

- (1) Set the M code No. in the positioning data " [Da.10] M code".
- (2) Set the timing to output the M code ON signal (X4, X5, X6, X7).

Set the required value in the following parameter, and write it to the QD75.

The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Pr.18] M code ON signal output timing	→	Set the timing to output the M code ON signal. 0: WITH mode 1: AFTER mode	27	177	327	477

\* Refer to Section 5.2 "List of parameters" for setting details.

[5] Reading M codes


"M codes" are stored in the following buffer memory when the M code ON signal turns ON.

Monitor item	Monitor value	Storage details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Md.25] Valid M code	→	The M code No. ( [Da.10] M code) set in the positioning data is stored.	808	908	1008	1108

\* Refer to Section 5.6 "List of monitor data" for information on the storage details.

The following shows a PLC program example for reading the " [Md.25] Valid M code" to the PLC CPU data register (D110). (The read value is used to command the sub work.)

Read M codes not as "rising edge commands", but as "ON execution commands".

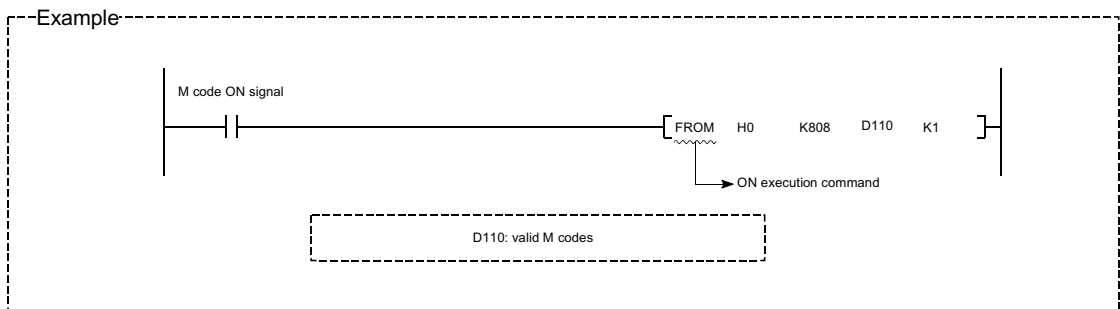

### 12.7.4 Teaching function

The "teaching function" is used to set addresses aligned using the manual control (JOG operation, inching operation manual pulse generator operation) in the positioning data addresses ("Da.6 Positioning address/movement amount", "Da.7 Arc address").

The details shown below explain about the "teaching function".

- [1] Control details
- [2] Precautions during control
- [3] Data used in teaching
- [4] Teaching procedure
- [5] Teaching program example


#### [1] Control details

##### (1) Teaching timing

Teaching is executed using the PLC program when the BUSY signal (XC, XD, XE, XF) is OFF. (During manual control, teaching can be carried out as long as the axis is not BUSY, even when an error or warning has occurred.)

##### (2) Addresses for which teaching is possible

The addresses for which teaching is possible are "current feed values" (Md.20 Current feed value) having the OP as a reference. The settings of the "movement amount" used in incremental system positioning cannot be used. In the teaching function, these "current feed values" are set in the "Da.6 Positioning address/movement amount" or "Da.7 Arc address".

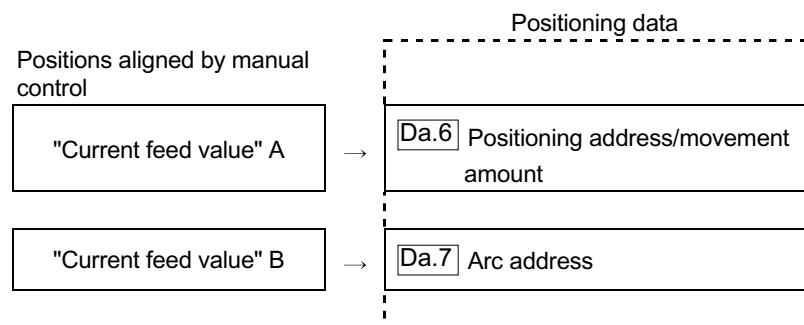

##### (3) Dedicated instructions "TEACH 1, TEACH 2, TEACH 3, TEACH 4, PFWRT"

When the dedicated instructions "TEACH 1, TEACH 2, TEACH 3, TEACH 4, PFWRT" are used to execute the teaching function, the programming becomes easier. Refer to Chapter 14 "Dedicated instructions" for details.

[2] Precautions during control

- (1) Before teaching, a "machine OPR" must be carried out to establish the OP. (When a current value changing, etc., is carried out, " [Md.20] Current feed value" may not show absolute addresses having the OP as a reference.)
- (2) Teaching cannot be carried out for positions to which movement cannot be executed by manual control (positions to which the workpiece cannot physically move). (During center point designation circular interpolation control, etc., teaching of " [Da.7] Arc address" cannot be carried out if the center point of the arc is not within the moveable range of the workpiece.)
- (3) Writing to the flash ROM can be executed up to 100,000 times. If writing to the flash ROM exceeds 100,000 times, the writing may become impossible (assured value is up to 100,000 times). If an error (error code: 805) occurs when writing to the flash ROM has been completed, check whether or not the program is created so as to write continuously to the flash ROM.

[3] Data used in teaching

The following control data is used in teaching.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
[Cd.1] Flash ROM write request	1	Write the set details to the flash ROM (backup the changed data).	1900			
[Cd.38] Teaching data selection	→	Sets to which "current feed value" is written. 0: Written to " [Da.6] Positioning address/ movement amount". 1: Written to " [Da.7] Arc address".	1548	1648	1748	1848
[Cd.39] Teaching positioning data No.	→	Designates the data to be taught. (Teaching is carried out when the setting value is 1 to 600.) When teaching has been completed, the QD75 is zero cleared in the initial stage.	1549	1649	1749	1849


\* Refer to Section 5.7 "List of control data" for details on the setting details.

[4] Teaching procedure


The following shows the procedure for a teaching operation.

(Interpolation operation with axis 1 as a reference)

(1) When teaching to the "Da.6 Positioning address/movement amount"

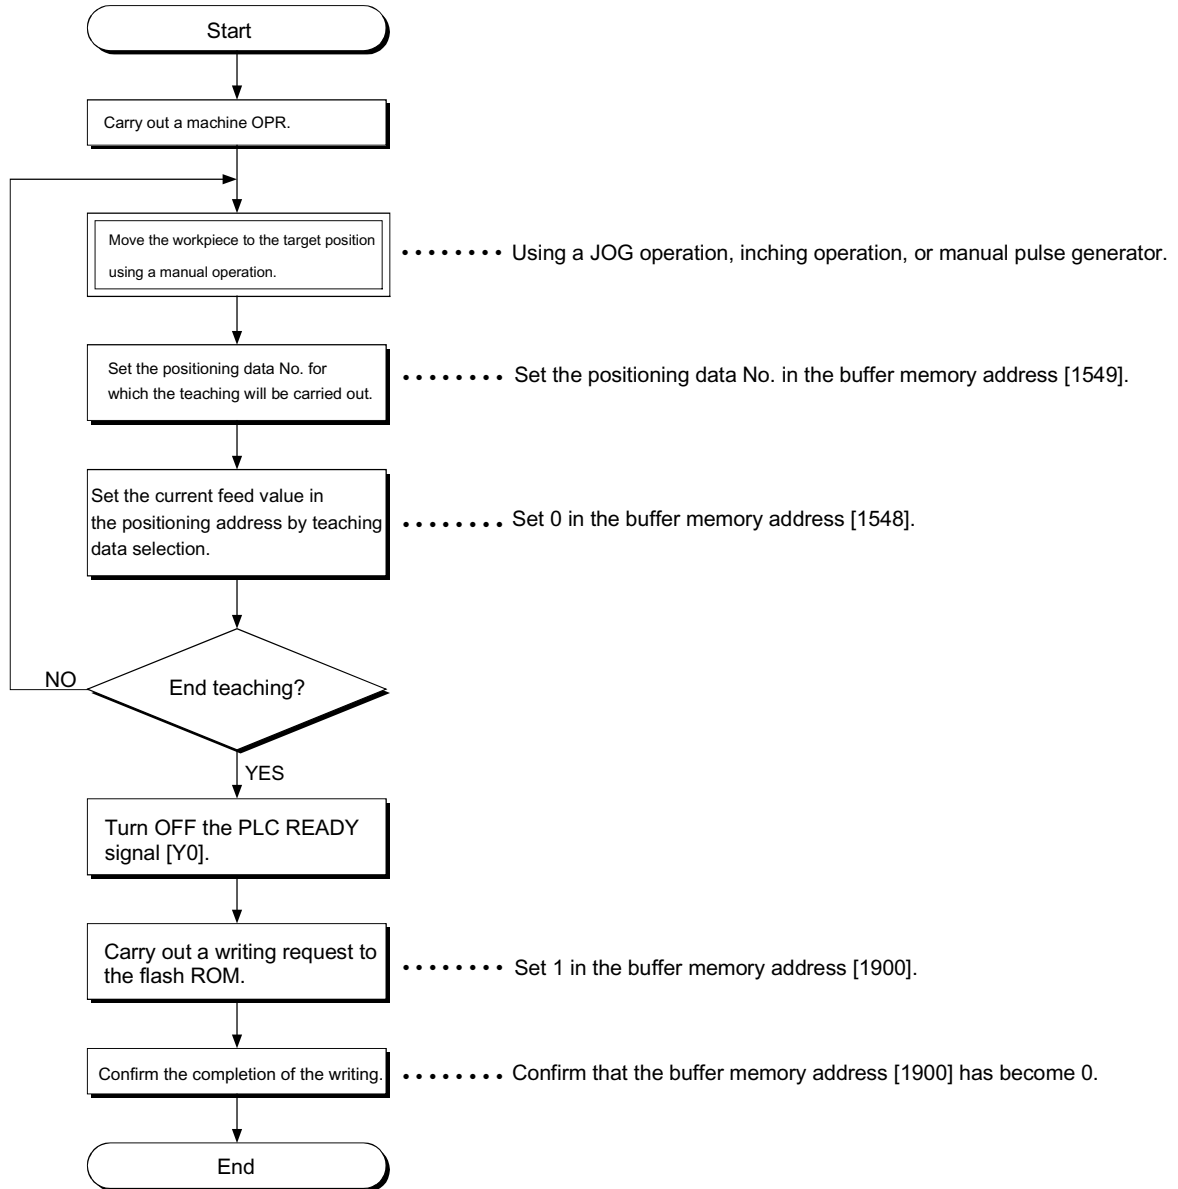

(2) When teaching to the " [Da.7] Arc address", then teaching to the " [Da.6] Positioning address/movement amount"

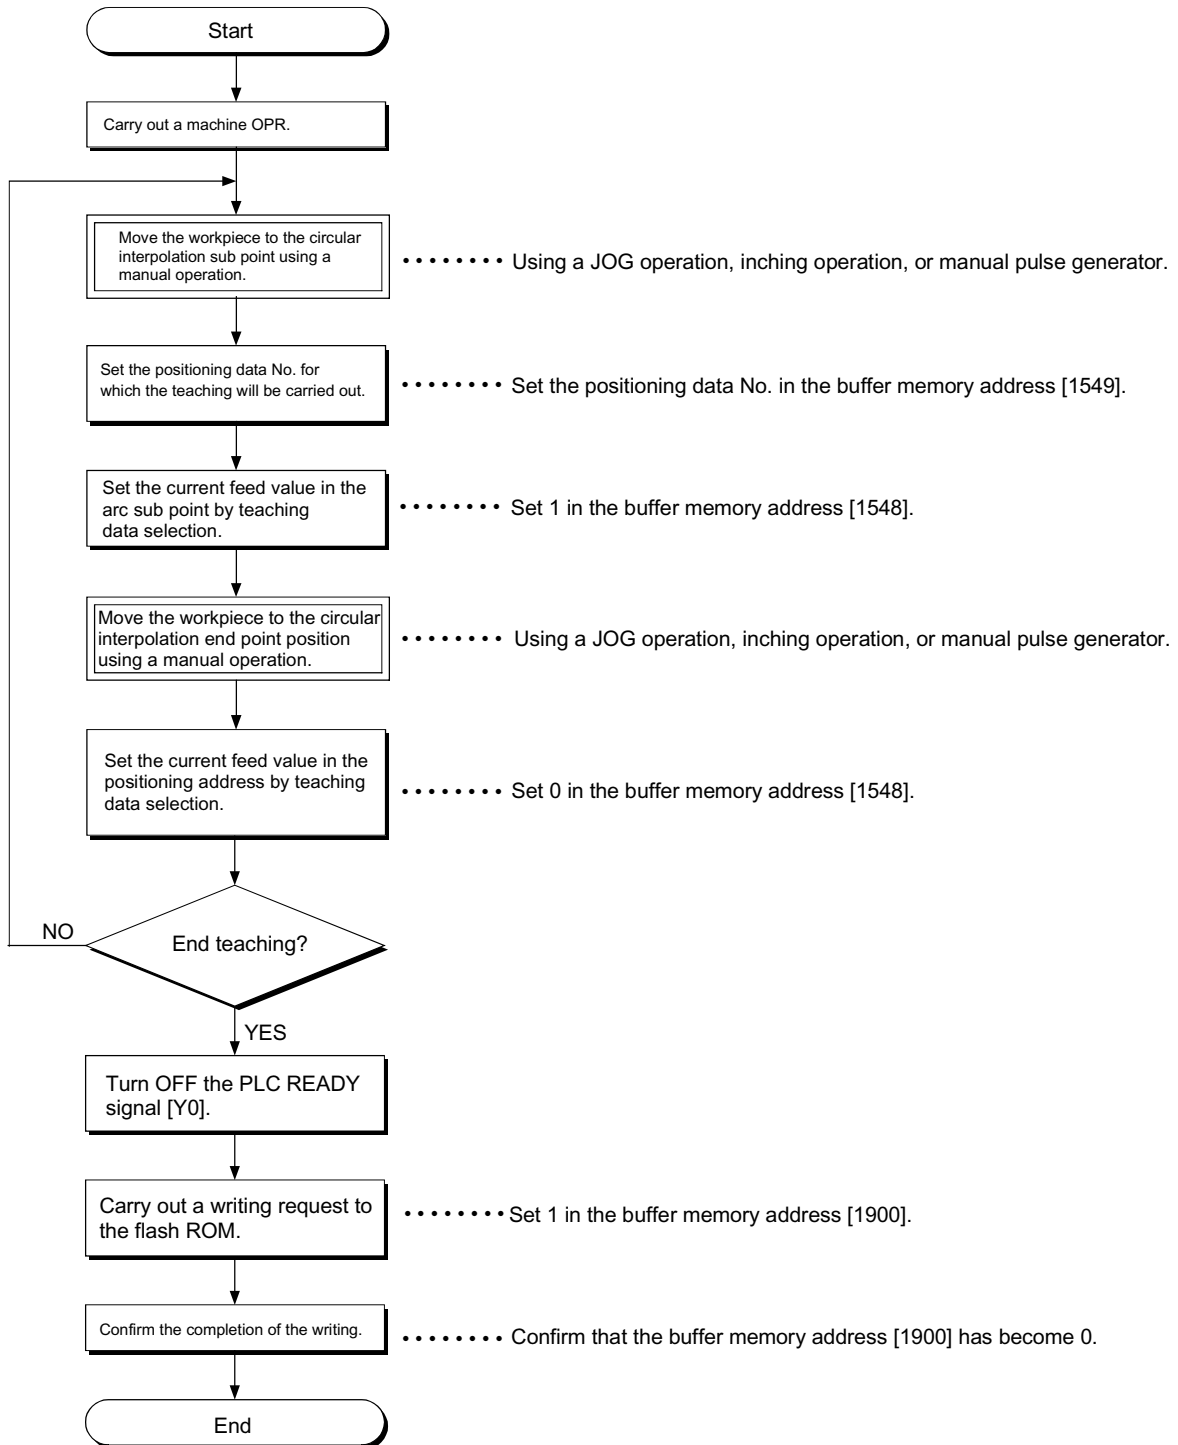

[5] Teaching program example

The following shows a PLC program example for setting (writing) the positioning data obtained with the teaching function to the QD75.


(1) Setting conditions

€ When setting the current feed value as the positioning address, write it when the BUSY signal is OFF.

(2) Program example

€ The following example shows a program to carry out the teaching of axis 1 by the dedicated instruction "TEACH 1".


- 1) Move the workpiece to the target position using a JOG operation (or an inching operation, a manual pulse generator operation).

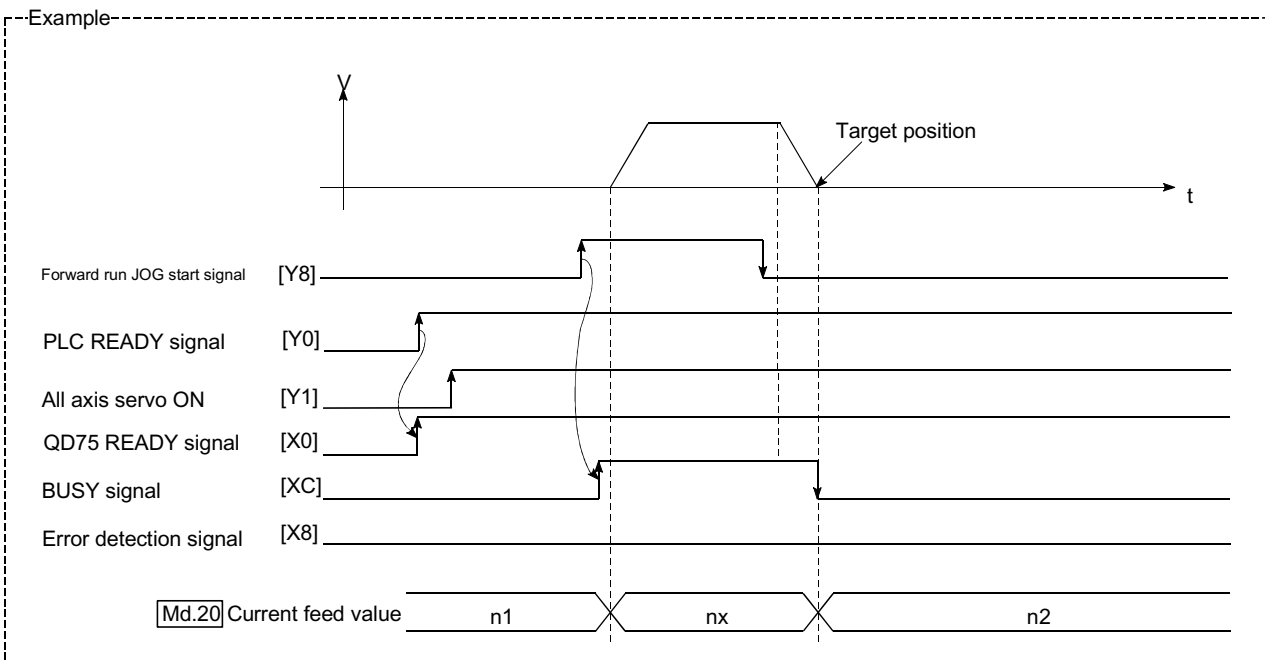

2) Carry out the teaching operation with the following program.

Example

```
*
* No.20 Teaching program
*
* -----
* •Position to the target position with manual operation.
* -----
*
*
*
```

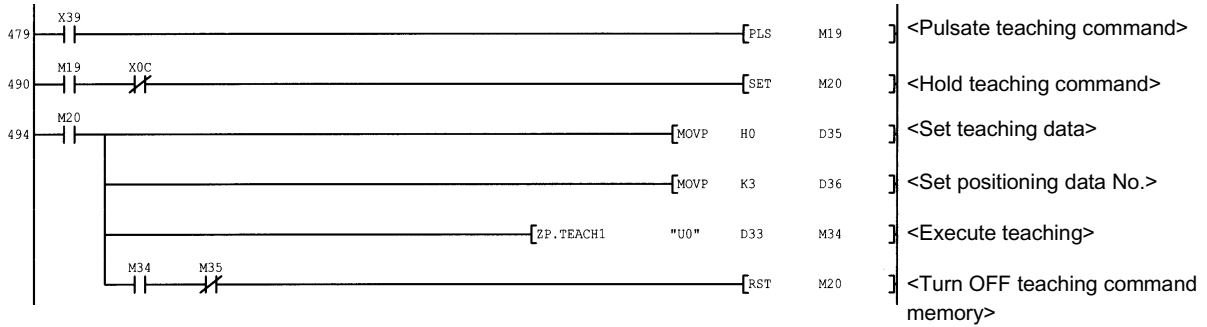

POINT

- (1) Confirm the teaching function and teaching procedure before setting the positioning data.
- (2) The positioning addresses that are written are absolute address (ABS) values.
- (3) If the positioning operation is correctly completed with the written positioning data, it is recommended that the positioning data be registered in the QD75 flash ROM.



12.7.5 Target position change function

The "target position change function" is a function to change a target position to a newly designated target position at any timing during the position control (1-axis linear control). A command speed can also be changed simultaneously. The target position and command speed changed are set directly in the buffer memory, and the target position change is executed by "Cd.29 Target position change request flag".

The following shows the details of the "target position change function".

[1] Details of control

[2] Precaution during operation

[3] Method of setting target position change function from PLC CPU

[1] Details of control

The following charts show the details of control of the target position change function.

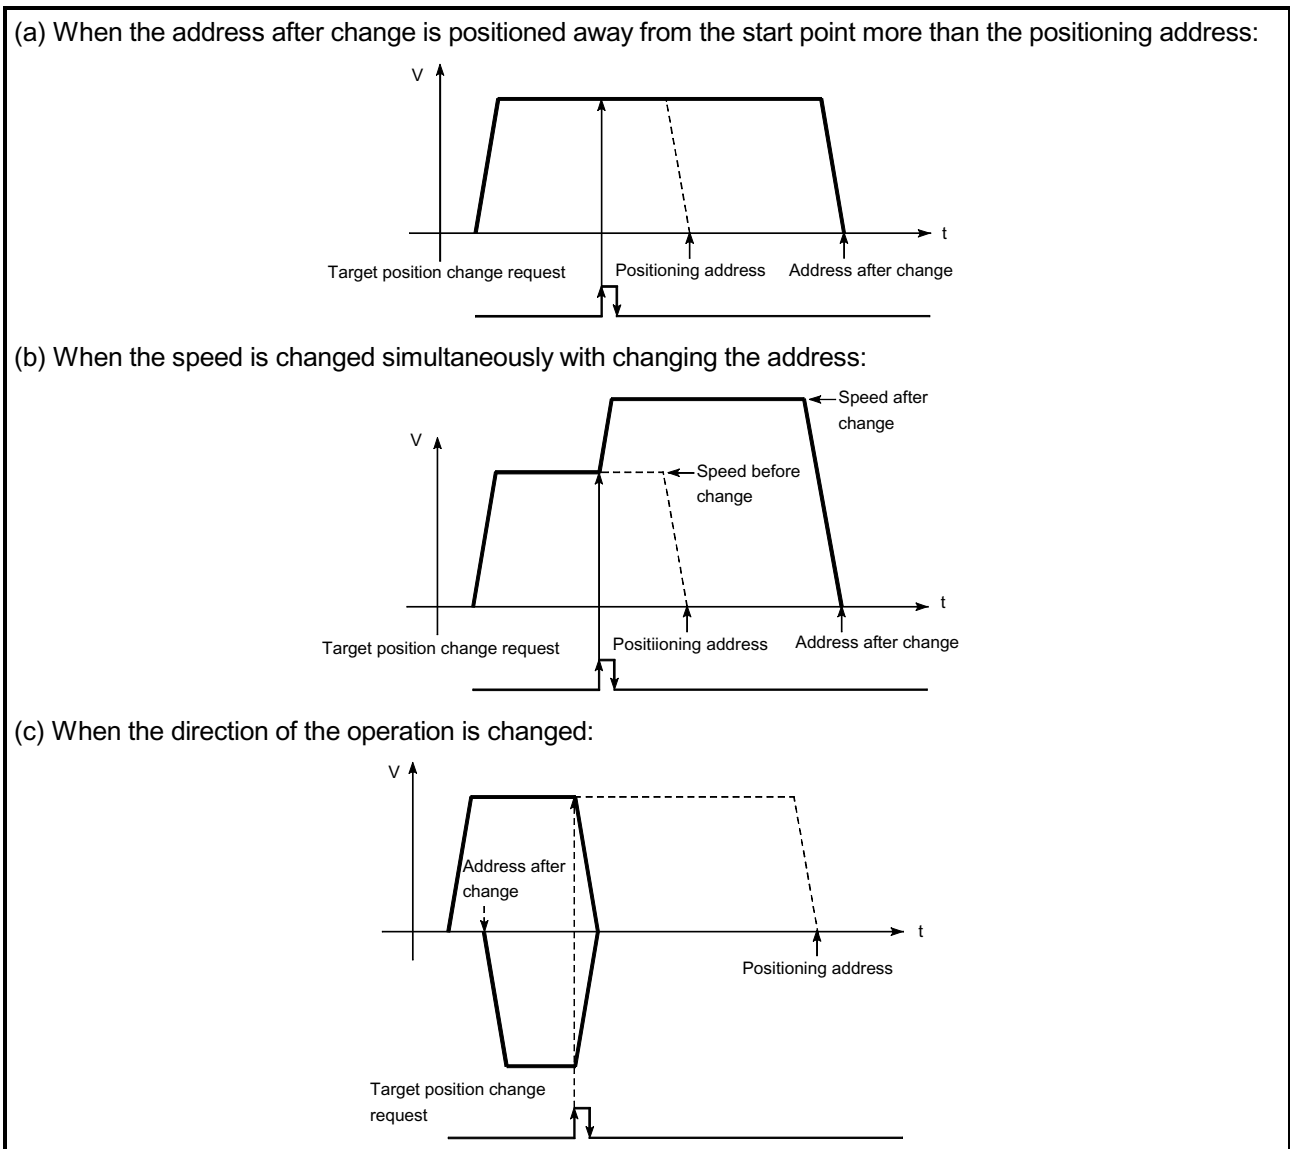


Fig. 12.39 Target position change operation

## [2] Precautions during operation

- (1) If the positioning movement direction from the stop position to a new target position is reversed, stop the operation once and then position to the new target position. (Refer to Fig. 12.39 (c).)
- (2) If a command speed exceeding the speed limit value is set to change the command speed, a warning will be given, and the new command speed will be the speed limit value (warning code: 501).  
Also, if the command speed change disables the remaining distance to the target value from being assured, a warning will be given (warning code: 509).
- (3) During interpolation control, a target position change request given is ignored and a warning (warning code: 518) occurs if a new target position value (address) is outside the software stroke limit range, if the axis is decelerating to a stop, or if the operation pattern is continuous path control.
- (4) When a command speed is changed, the current speed is also changed. When the next positioning speed uses the current speed in the continuous positioning, the next positioning operation is carried out at the new speed value. When the speed is set with the next positioning data, that speed becomes the current speed and the operation is carried out at the current speed.
- (5) When a target position change request is given during automatic deceleration in position control, positioning control to a new position is exercised after the axis has stopped once if the moving direction is reversed. If the moving direction is not reversed, the axis is accelerated to the command speed again and positioned to the new position.
- (6) If the constant speed status is regained or the output is reversed by a target position change made while "Md.48 Deceleration start flag" is ON, the deceleration start flag remains ON. (For details, refer to Section 12.7.9.)

<b>POINT</b>
--------------

When carrying out the target position change continuously, take an interval of 100 ms or longer between the times of the target position changes. Also, take an interval of 100 ms or longer when the speed change is carried out after changing the target position or the target position change is carried out after the speed change.
-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

[3] Method of setting target position change function from PLC CPU

The following table and chart show the example of a data setting and PLC program used to change the target position of the axis 1 by the command from the PLC CPU, respectively. (example in which the target position value and command speed are changed to a new target position of "300.0 μm" and a new command speed of "10000.00 mm/min".)

(1) The following data is set.

(Referring to the starting time chart shown in item (2) below, carry out the setting with the PLC program shown in item (3).)

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.27 Target position Value (new address)	3000	Set the new address.	1534 1535	1634 1635	1734 1735	1834 1835
Cd.28 Target position value (new speed)	1000000	Set the new speed.	1536 1537	1636 1637	1736 1737	1836 1837
Cd.29 Target position change request flag	1	Set "1: Carry out speed change".	1538	1638	1738	1838

\* Refer to Section 5.7 "List of control data" for details on the setting details.

(2) The following shows the time chart for target position change.


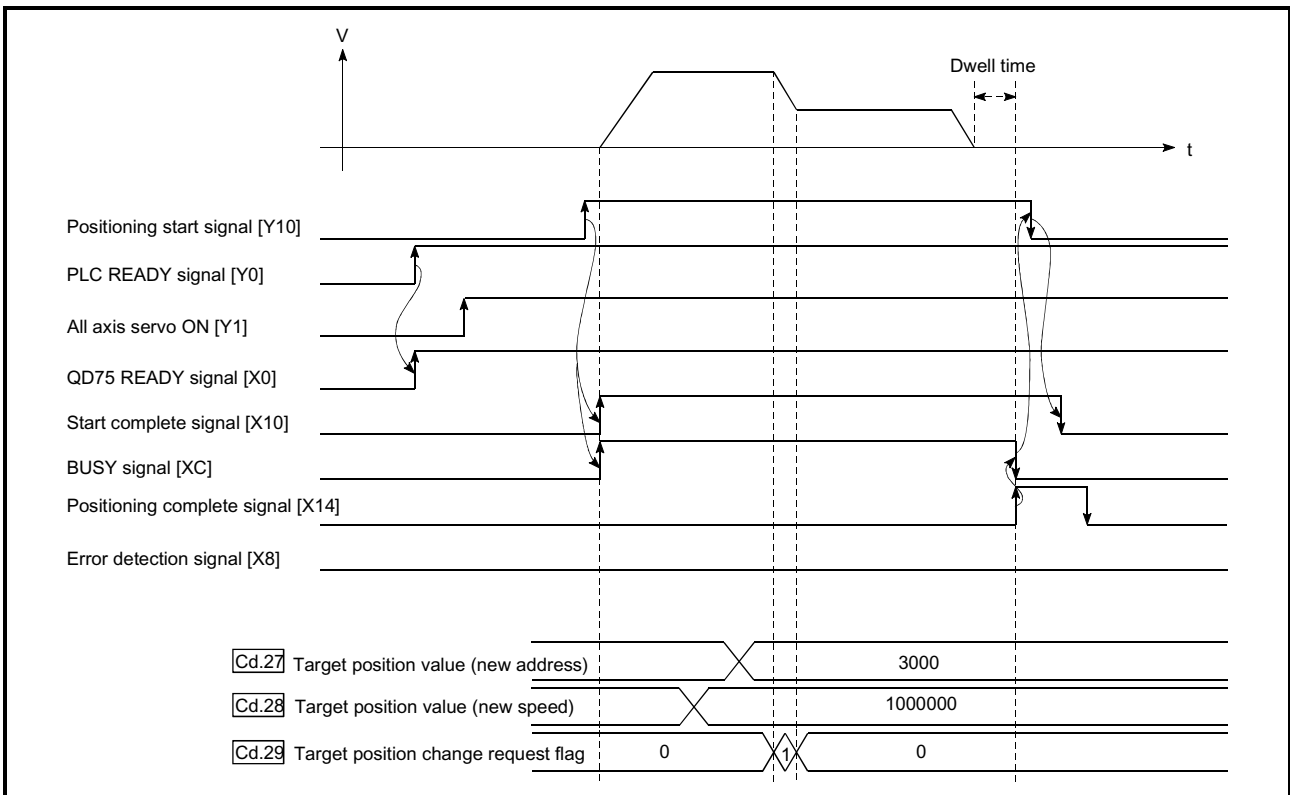


Fig. 12.40 Time chart for target position change from PLC CPU

(3) The following PLC program is added to the control program, and written to the PLC CPU.

Example

\*  
 \* No.22 Target position change program  
 \*

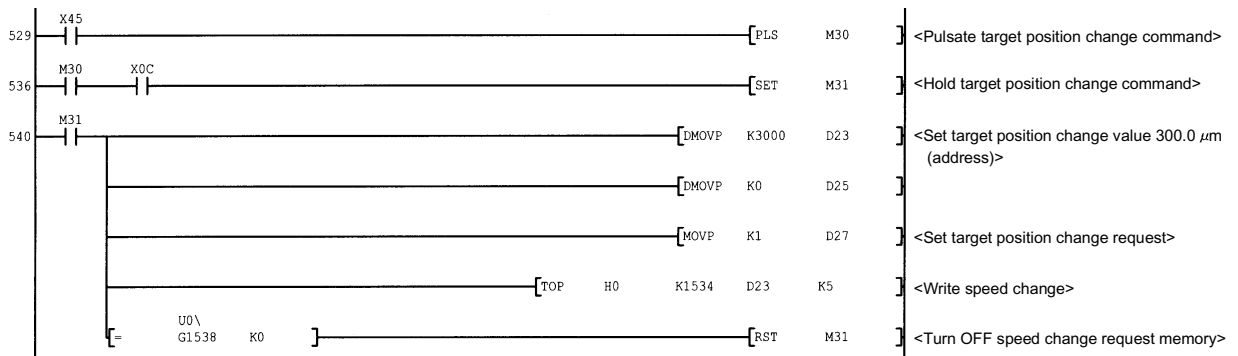

12.7.6 Command in-position function

The "command in-position function" checks the remaining distance to the stop position during the automatic deceleration of positioning control, and sets "1". This flag is called the "command in-position flag". The command in-position flag is used as a front-loading signal indicating beforehand the completion of the position control.

The details shown below explain about the "command in-position function".

- [1] Control details
- [2] Precautions during control
- [3] Setting the command in-position function
- [4] Confirming the command in-position flag

[1] Control details

The following shows control details of the command in-position function.

- (1) When the remaining distance to the stop position during the automatic deceleration of positioning control becomes equal to or less than the value set in " [Pr.16] Command in-position width", "1" is stored in the command in-position flag ( [Md.31] Status: b2).

(Command in-position width check)

Remaining distance  $\Omega$  " [Pr.16] Command in-position width" setting value

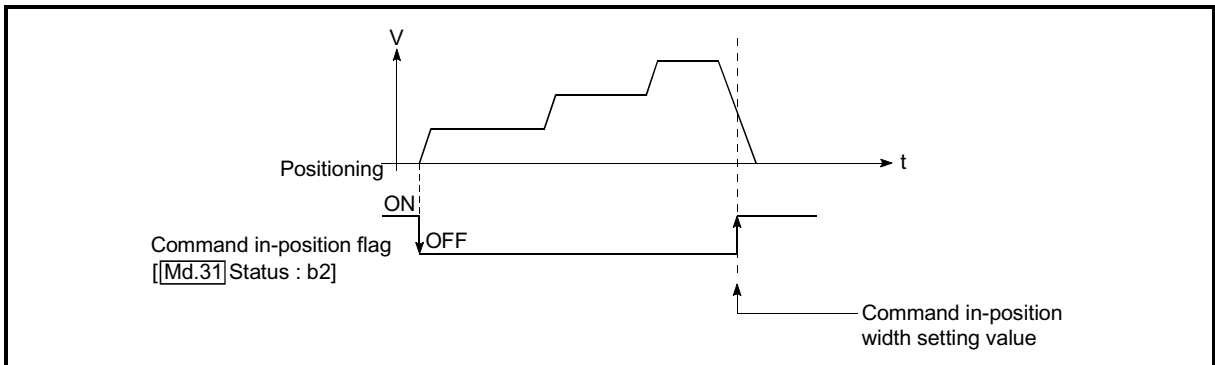


Fig. 12.41 Command in-position operation

- (2) A command in-position width check is carried out every 3.5ms.

## [2] Precautions during control

- (1) A command in-position width check will not be carried out in the following cases.
- ≠ During deceleration by a stop command or sudden stop command.
  - ≠ During position control, the operation pattern is "continuous path control"
  - ≠ During speed control, or during the speed control of speed-position switching or position-speed switching control.

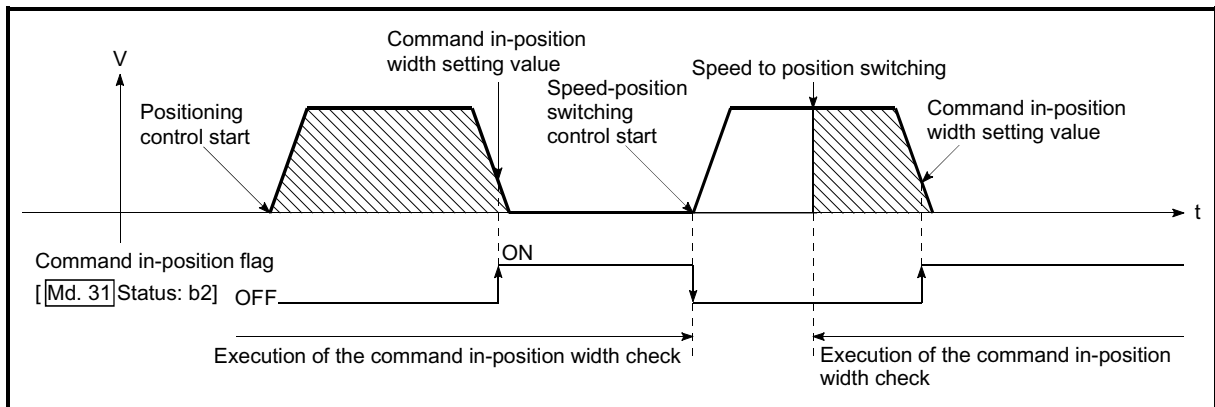


Fig. 12.42 Command in-position width check

- (2) The command in-position flag will be turned OFF in the following cases. ("0" will be stored in " [Md.31] Status: b2".)
- ≠ At the positioning control start
  - ≠ At the speed control start
  - ≠ At the speed-position switching control, position-speed switching control start
  - ≠ At the OPR control start
  - ≠ At the JOG operation start
  - ≠ At the inching operation start
  - ≠ When the manual pulse generator operation is enabled.
- (3) The " [Pr.16] Command in-position width" and command in-position flag ( [Md.31] Status: b2) of the reference axis are used during interpolation control.

**[3] Setting the command in-position function**

To use the "command in-position function", set the required value in the parameter shown in the following table, and write it to the QD75.

The set details are validated at the rising edge (OFF → ON) of the PLC READY signal (Y0).

Setting item		Setting value	Setting details	Factory-set initial value
Pr.16	Command in-position width	→	Turn ON the command in-position flag, and set the remaining distance to the stop position of the position control.	100

\* Refer to Section 5.2 "List of parameters" for setting details.

**[4] Confirming the command in-position flag**

The "command in-position flag" is stored in the following buffer memory.

Monitor item	Monitor value	Storage details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Md.31	Status	→	The command in-position flag is stored in the "b2" position.			
			817	917	1017	1117

\* Refer to Section 5.6 "List of monitor data" for information on the storage details.

**REMARK**

≠ Parameters are set for each axis.

≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

## 12.7.7 Acceleration/deceleration processing function

The "acceleration/deceleration processing function" adjusts the acceleration/deceleration when each control is executed.

Adjusting the acceleration/deceleration processing to match the control enables more precise control to be carried out.

There are two acceleration/deceleration adjustment items that can be set:

"Acceleration/deceleration time 0 to 3", and "acceleration/deceleration method setting".

The details shown below explain about the "acceleration/deceleration processing function".

[1] "Acceleration/deceleration time 0 to 3" control details and setting

[2] "Acceleration/deceleration method setting" control details and setting

[1] "Acceleration/deceleration time 0 to 3" control details and setting

In the QD75, four types each of acceleration time and deceleration time can be set. By using separate acceleration/deceleration times, control can be carried out with different acceleration/deceleration times for positioning control, JOG operation, OPR, etc.

Set the required values for the acceleration/deceleration time in the parameters shown in the following table, and write them to the QD75.

The set details are validated when written to the QD75.

Setting item	Setting value	Setting details	Factory-set initial value
Pr.9	Acceleration time 0	→	1000
Pr.25	Acceleration time 1	→	1000
Pr.26	Acceleration time 2	→	1000
Pr.27	Acceleration time 3	→	1000
Pr.10	Deceleration time 0	→	1000
Pr.28	Deceleration time 1	→	1000
Pr.29	Deceleration time 2	→	1000
Pr.30	Deceleration time 3	→	1000

\* Refer to Section 5.2 "List of parameters" for setting details.



[2] "Acceleration/deceleration method setting" control details and setting

In the "acceleration/deceleration method setting", the acceleration/deceleration processing method is selected and set. The set acceleration/deceleration processing is applied to all acceleration/deceleration.

The two types of "acceleration/deceleration method setting" are shown below.

(1) Automatic trapezoidal acceleration/deceleration processing method

This is a method in which linear acceleration/deceleration is carried out based on the acceleration time, deceleration time, and speed limit value set by the user.

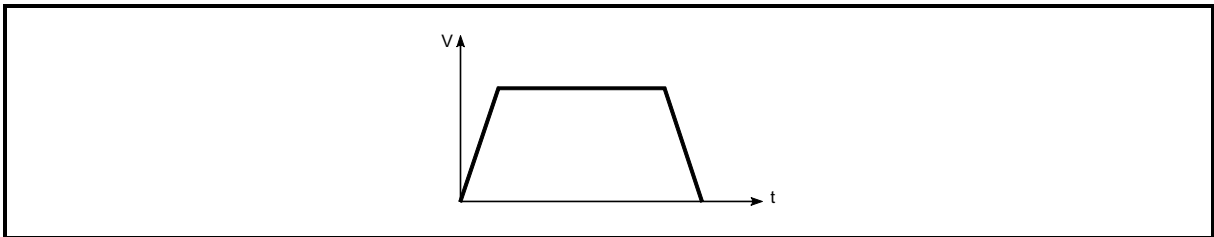


Fig. 12.43 Automatic trapezoidal acceleration/deceleration processing method

(2) S-pattern acceleration/deceleration processing method

In this method, the motor burden is reduced during starting and stopping.

This is a method in which acceleration/deceleration is carried out gradually, based on the acceleration time, deceleration time, speed limit value, and

" Pr.35 S-pattern proportion" (1 to 100%) set by the user.

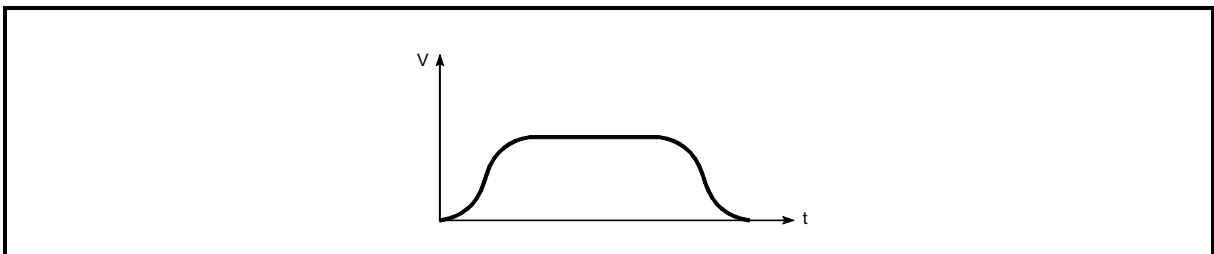


Fig. 12.44 S-pattern acceleration/deceleration processing method

When a speed change request is given during S-pattern acceleration/ deceleration processing, S-pattern acceleration/deceleration processing begins at a speed change request start.

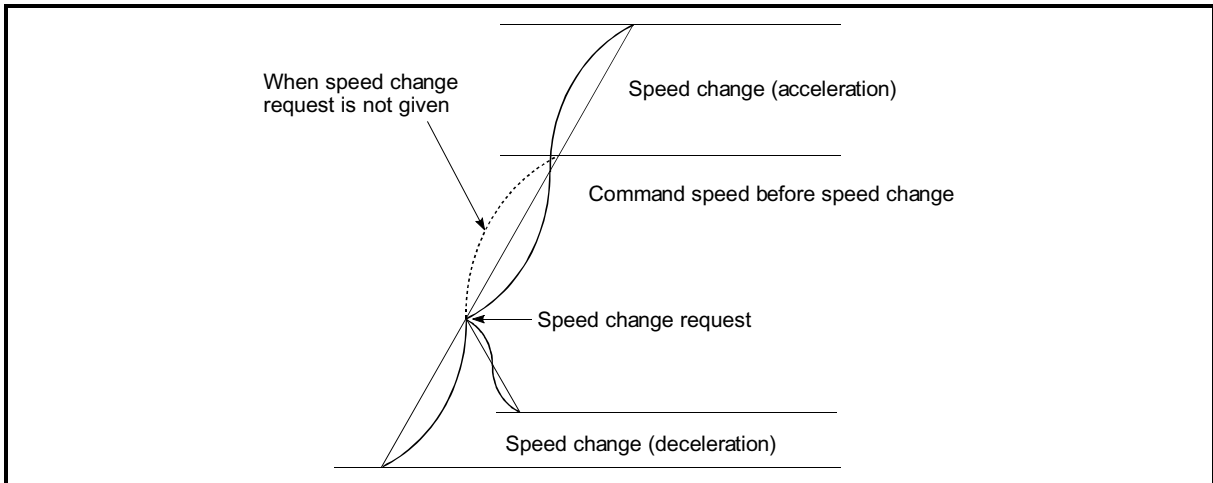


Fig. 12.45 Speed change during S-pattern acceleration/deceleration processing

Set the required values for the "acceleration/deceleration method setting" in the parameters shown in the following table, and write them to the QD75. The set details are validated when written to the QD75.

Setting item	Setting value	Setting details	Factory-set initial value
Pr.34 Acceleration/ deceleration process selection	→	Set the acceleration/deceleration method. 0: Automatic trapezoidal acceleration/deceleration processing 1: S-pattern acceleration/deceleration processing	0
Pr.35 S-pattern proportion	→	Set the acceleration/deceleration curve when "1" is set in " Pr.34 Acceleration/deceleration processing selection".	100

\* Refer to Section 5.2 "List of parameters" for setting details.

**REMARK**

- ≠ Parameters are set for each axis.
- ≠ It is recommended that the parameters be set whenever possible with GX Configurator-QP. Execution by PLC program uses many PLC programs and devices. The execution becomes complicated, and the scan times will increase.

12.7.8 Pre-reading start function

The "pre-reading start function" does not output pulses while the execution prohibition flag is ON if a positioning start request is given with the execution prohibition flag ON, and starts servo within 3ms after OFF of the execution prohibition flag is detected. The positioning start request is given when the axis is in a standby status, and the execution prohibition flag is turned OFF at the axis operating timing. This shortens the virtual start time. The QD75 normally takes 6 to 7ms from when it receives a positioning start request until it starts servo (start time). Some systems often need the start time to be shortened. This "pre-reading start function" can improve the tact time of the system.

The "pre-reading start function" will be explained below.

- [1] Controls
- [2] Precautions during control
- [3] Program examples

[1] Controls

The pre-reading start function is performed by turning ON the positioning start signal [Y10, Y11, Y12, Y13] with the execution prohibition flag [Y14, Y15, Y16, Y17] ON, or by executing the dedicated instruction (PSTRT1, PSTRT2, PSTRT3, PSTRT4). However, if positioning is started with the execution prohibition flag ON, the positioning data is analyzed but servo start is not provided. While the execution prohibition flag is ON, "Md.26 Axis operation status" remains unchanged from "5: Analyzing". Pulse output starts within 3ms after the execution prohibition flag [Y14, Y15, Y16, Y17] has turned OFF, and "Md.26 Axis operation status" changes to the status (e.g. during position control, during speed control) that matches the control system. (Refer to Fig. 12.46)

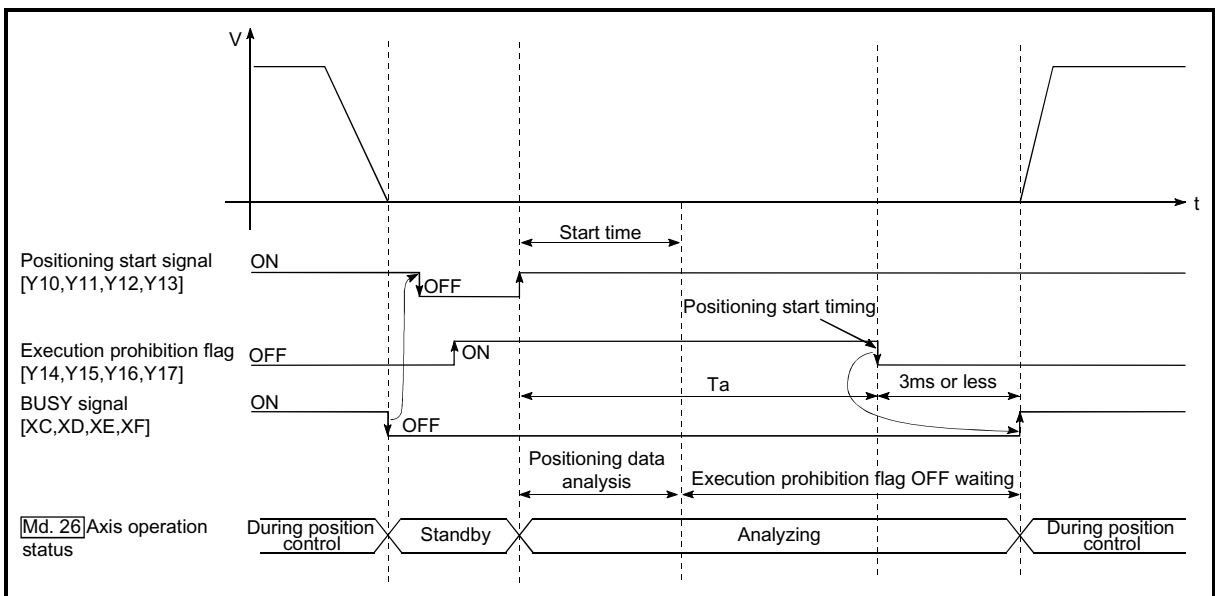


Fig. 12.46 Operations of pre-reading start function

The pre-reading start function is effective for the system as shown below.

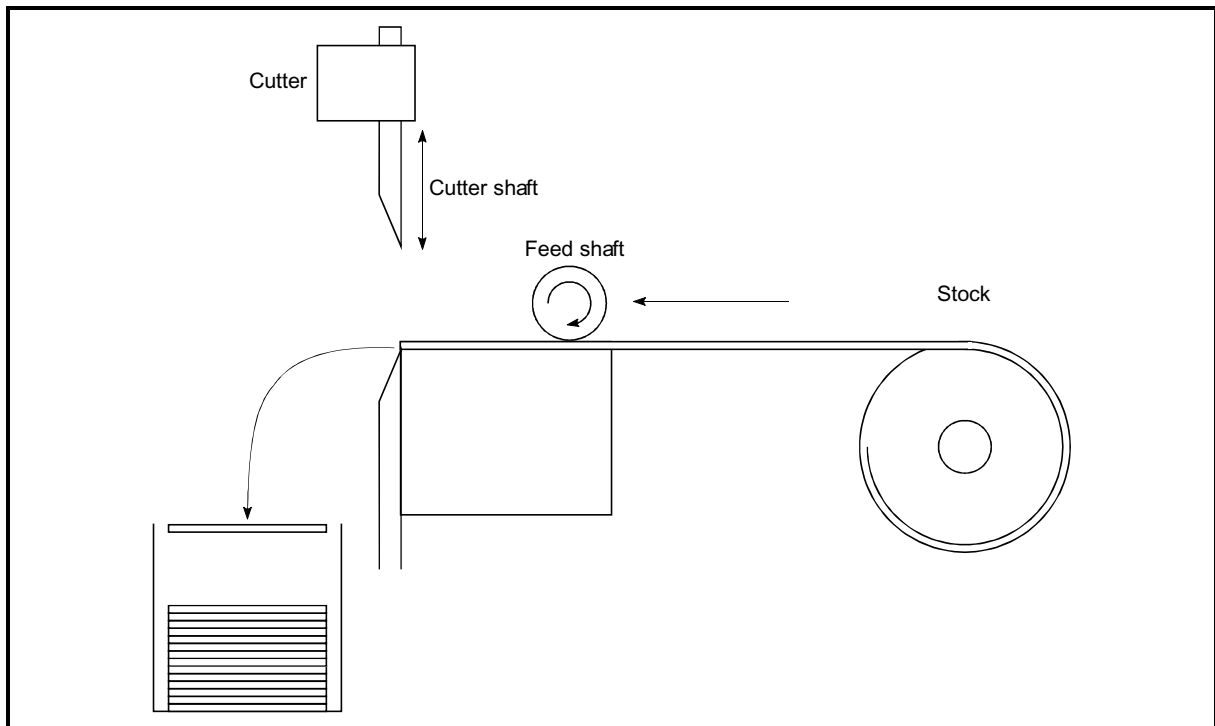


Fig. 12.47 System example using pre-reading start function

Fig. 12.47 shows a system example which repeats:

- 1) Feeding a stock with a feed shaft; and
- 2) Cutting it with a cutter

to cut the stock to fixed size. The operations of the feed shaft and cutter shaft are represented as shown in Fig. 12.48.

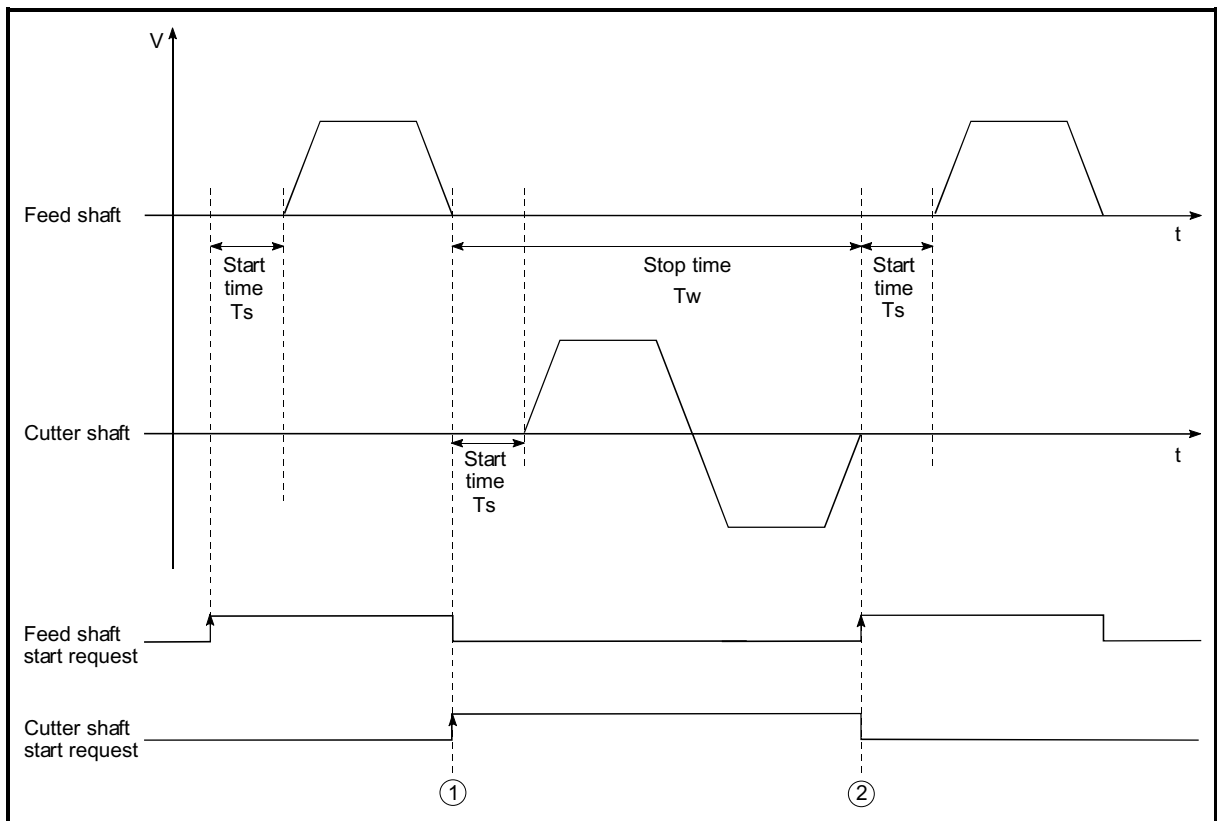


Fig. 12.48 Operation timings of system example

The cutter shaft starts from the moment the feed shaft has completed feeding the stock "①", and the feed shaft starts from the moment the cutter shaft has returned to the standby position "②". Actually, however, there is a delay of start time  $T_s$  (6 to 7ms) from when the QD75 receives a start request until it servo start. The system's tact time can be reduced by the shortening of this delay with the Pre-reading start function.

In Fig. 12.48, the feed shaft stands by during the stop time  $T_w$ .


Hence, pre-reading of the next data starts during the stop time  $T_w$ . If  $T_w$  is a certain period of time, the analysis of the next data is completed during that period, and the system is placed in an execution prohibition flag OFF waiting status. Therefore, replacing the positioning start timing at ② with the execution prohibition flag OFF allows the time from when the axis operation request turns ON until pulse output starts to be reduced to within 3ms in the PLC program. (Refer to Fig. 12.46)

[2] Precautions during control


- (1) The time required to analyze the positioning data is up to 7ms.
- (2) After positioning data analysis, the system is put in an execution prohibition flag OFF waiting status. Any change made to the positioning data in the execution prohibition flag OFF waiting status is not reflected on the positioning data. Change the positioning data before turning ON the positioning start signal.
- (3) The pre-reading start function is invalid if the execution prohibition flag is turned OFF between when the positioning start signal has turned ON and when positioning data analysis is completed (Ta < start time, Ta: Refer to Fig. 12.46).
- (4) The data No. which can be executed positioning start using "Cd.3 Positioning start No." with the pre-reading start function are No. 1 to 600 only. Performing the pre-reading start function at the setting of No. 7000 to 7004 or 9001 to 9004 will result in an outside start No. range error (Error code: 543).
- (5) Always turn ON the execution prohibition flag at the same time or before turning ON the positioning start signal. Pre-reading may not be started if the execution prohibition flag is turned ON during Ta after the positioning start signal is turned ON. The pre-reading start function is invalid if the execution prohibition flag is turned ON after positioning start (pulse output) with the execution prohibition flag OFF. (It is made valid at the next positioning start.)

[3] Program examples

\*  
 \* Pre-reading start function (when positioning start signal Y10 is used)  
 \*

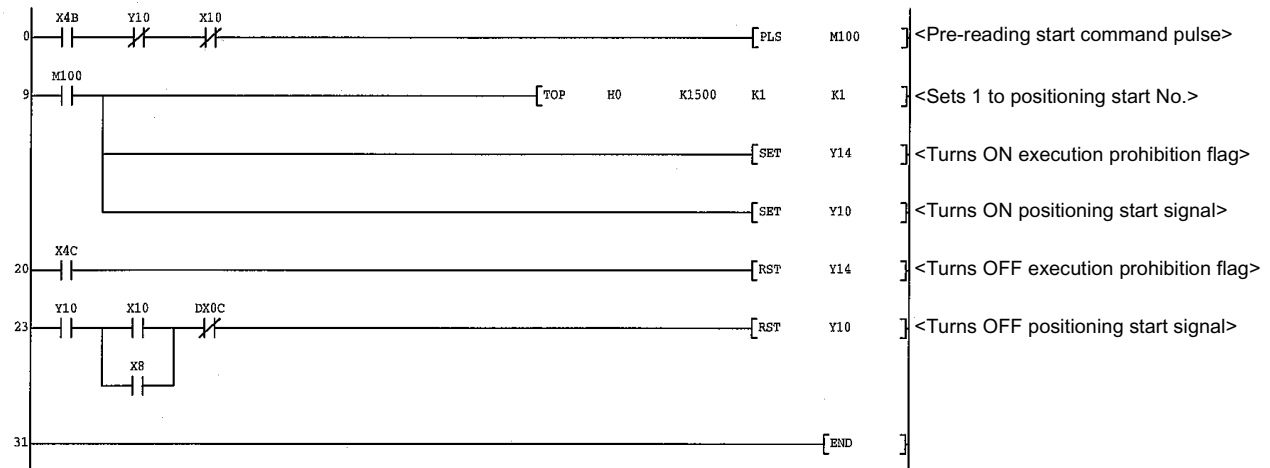

\*  
 \* Pre-reading start function (when dedicated instruction PSTRT1 is used)  
 \*

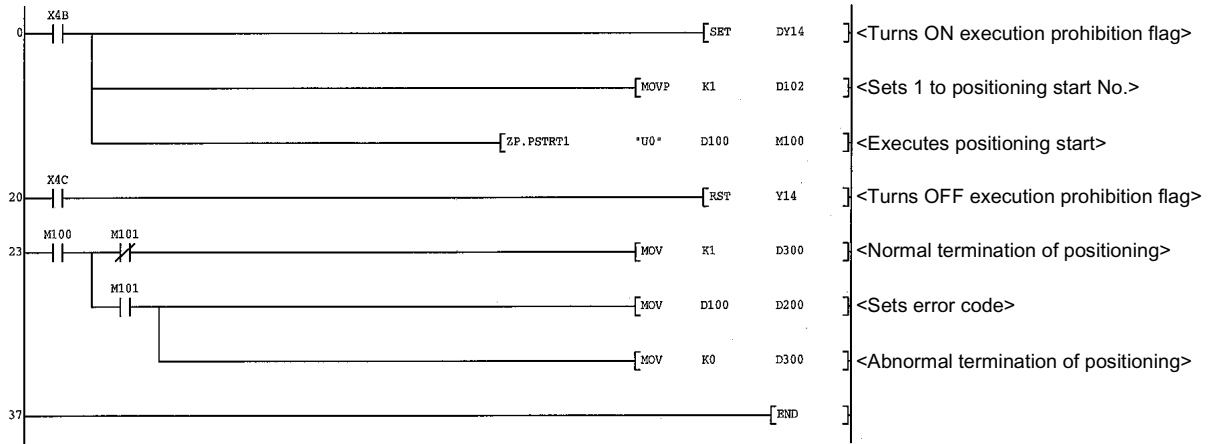

12.7.9 Deceleration start flag function \*

The "deceleration start flag function" turns ON the flag when the constant speed status or acceleration status switches to the deceleration status during position control whose operation pattern is "Positioning complete". This function can be used as a signal to start the operation to be performed by other equipment at each end of position control or to perform preparatory operation, etc. for the next position control.

For the "deceleration start flag function", the following will be explained.

- [1] Control details
- [2] Precautions during control
- [3] Deceleration start flag function setting method
- [4] Checking of deceleration start flag

\*: Usable with the module whose first six digits of SERIAL No. are "050224" or later.

[1] Control details

When deceleration for a stop is started in the position control whose operation pattern is "Positioning complete", "1" is stored into "Md.48 Deceleration start flag". When the next operation start is made or the manual pulse generator operation enable status is gained, "0" is stored. (Refer to Fig. 12.49.)

(1) Start made with positioning data No. specified

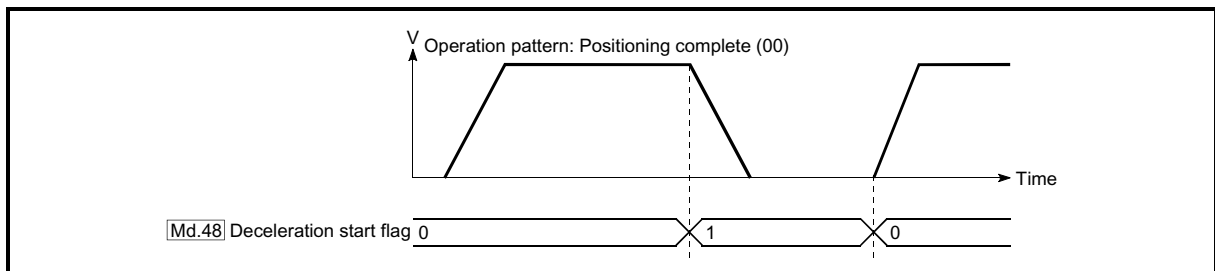


Fig. 12.49 Operation of deceleration start flag



(2) Block start

At a block start, this function is valid for only the position control whose operation pattern is "Positioning complete" at the point whose shape has been set to "End". (Refer to Fig. 12.50.)

The following table indicates the operation of the deceleration start flag in the case of the following block start data and positioning data.

Block start data	Da.11 Shape	Da.12 Start data No.	Da.13 Special start instruction
1st point	1: Continue	1	0: Block start
2nd point	1: Continue	3	0: Block start
3rd point	0: End	4	0: Block start
€			
€			

Positioning Data No.	Da.1 Operation pattern
1	01: Continuous positioning control
2	00: Positioning complete
3	00: Positioning complete
4	11: Continuous path control
5	00: Positioning complete
€	
€	


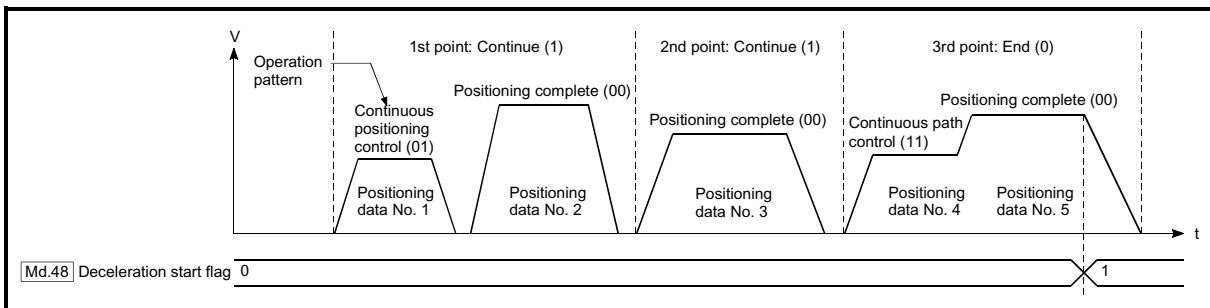



Fig. 12.50 Operation of deceleration start flag at block start

## [2] Precautions during control

- (1) The deceleration start flag function is valid for the control system of "1-axis linear control", "2-axis linear interpolation control", "3-axis linear interpolation control", "4-axis linear interpolation control", "speed-position switching control" or "position-speed switching control". (In the case of linear interpolation control, the function is valid for only the reference axis.) Refer to Section 3.2.4 "Combination of QD75 main functions and sub functions".
- (2) The deceleration start flag does not turn ON when the operation pattern is "continuous positioning control" or "continuous path control".
- (3) The deceleration start flag function is invalid for an OPR, JOG operation, inching operation, manual pulse generator operation, and deceleration made with a stop signal.
- (4) The deceleration start flag does not turn ON when a speed change or override is used to make deceleration.
- (5) If a target position change is made while the deceleration start flag is ON, the deceleration start flag remains ON.

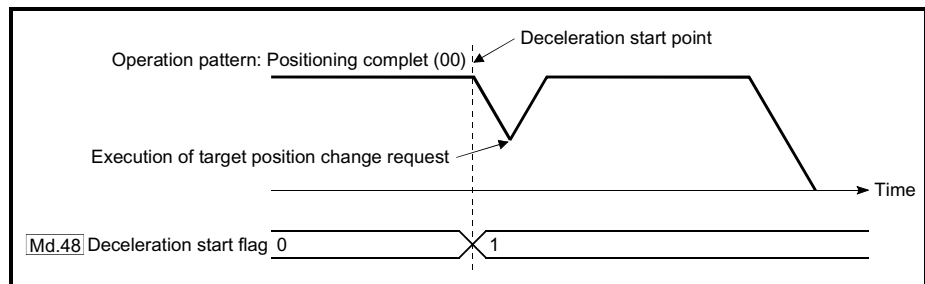

- (6) When the movement direction is reversed by a target position change, the deceleration start flag turns ON.

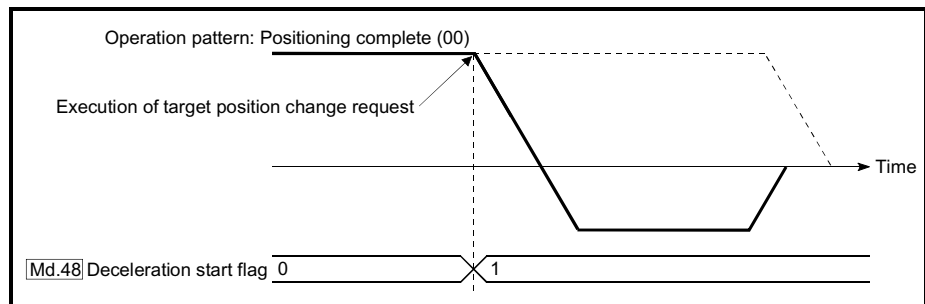

- (7) During position control of position-speed switching control, the deceleration start flag is turned ON by automatic deceleration. The deceleration start flag remains ON if position control is switched to speed control by the position-speed switching signal after the deceleration start flag has turned ON.
- (8) During skip operation, the deceleration start flag is valid for only the positioning data whose operation pattern is "Positioning complete".
- (9) If the condition start of a block start is not made since the condition is not satisfied, the deceleration start flag turns ON when the shape is "End".
- (10) When an interrupt request during continuous operation is issued, the deceleration start flag turns ON at a start of deceleration in the positioning data being executed.

### [3] Deceleration start flag function setting method

To use the "deceleration start flag function", set "1" to the following control data using a PLC program.

The set data is made valid on the rising edge (OFF to ON) of the PLC READY signal [Y0].

Setting item		Setting value	Setting details	Buffer memory address
Cd.41	Deceleration start flag valid	→	Set whether the deceleration start flag function is made valid or invalid. 0: Deceleration start flag invalid 1: Deceleration start flag valid	1905

\* Refer to Section 5.7 "List of control data" for details on the setting details.

### [4] Checking of deceleration start flag

The "deceleration start flag" is stored into the following buffer memory addresses.

Monitor item	Monitor value	Storage details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Md.48	Deceleration start flag	→	0: Status other than below 1: Status from deceleration start to next operation start or manual pulse generator operation enable			
			899	999	1099	1199

\* Refer to Section 5.6 "List of monitor data" for information on the storage details.

### 12.7.10 Stop command processing for deceleration stop function

The "stop command processing for deceleration stop function" is provided to set the deceleration curve if a stop cause occurs during deceleration stop processing (including automatic deceleration).

This function is valid for both automatic trapezoidal and S-pattern acceleration/deceleration processing methods.

(For the stop cause, refer to Section 1.2.3 Outline of stopping.)

The "stop command processing for deceleration stop function" performs the following two operations:

- (1) **Deceleration curve re-processing**  
Re-processes a deceleration curve starting from the speed at stop cause occurrence to stop, according to the preset deceleration time.
- (2) **Deceleration curve continuation**  
Continues the current deceleration curve after a stop cause has occurred.

This section explains the "stop command processing for deceleration stop function" as follows:

- [1] Control
- [2] Precautions for control
- [3] Setting method

#### [1] Control

The operation of "stop command processing for deceleration stop function" is explained below.

##### (1) Deceleration curve re-processing

A deceleration curve is re-processed starting from the speed at stop cause occurrence to stop, according to the preset deceleration time.

If a stop cause occurs during automatic deceleration of position control, the deceleration stop processing stops as soon as the target has reached the positioning address specified in the positioning data that is currently executed.

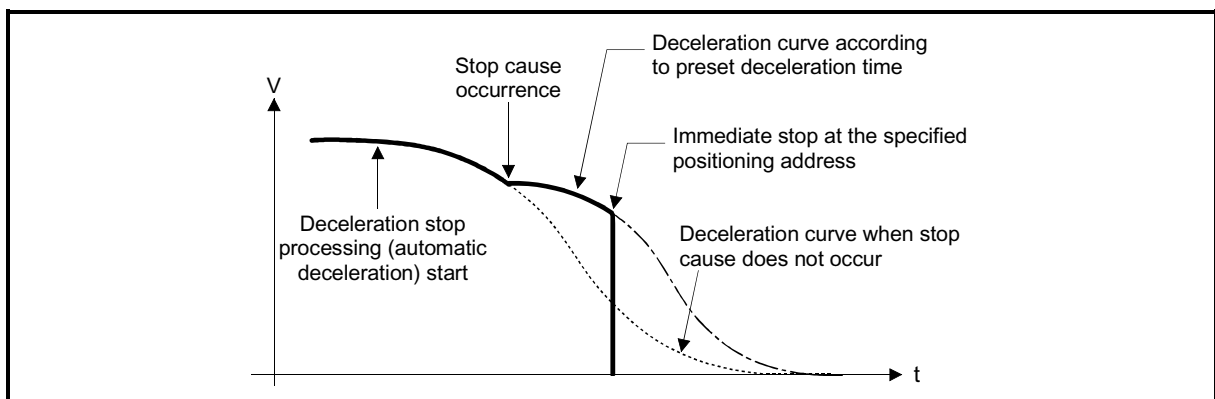


Fig. 12.51 Deceleration curve re-processing operation (for position control or S-pattern acceleration/deceleration processing)

(2) Deceleration curve continuation

The current deceleration curve is continued after a stop cause has occurred.

If a stop cause occurs during automatic deceleration of position control, the deceleration stop processing may be complete before the target has reached the positioning address specified in the positioning data that is currently executed.

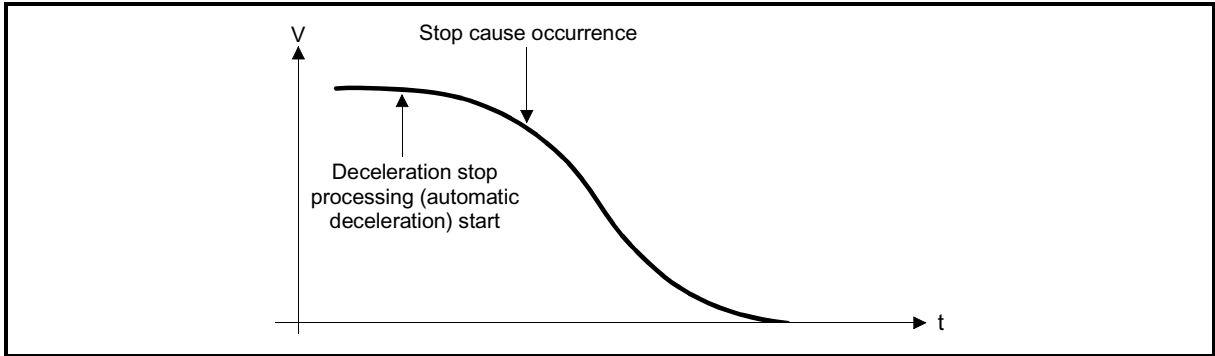


Fig. 12.52 Deceleration curve continuation operation (for position control or S-pattern acceleration/deceleration processing)

[2] Precautions for control

- (1) In manual control (JOG operation, inching operation, manual pulse generator operation), the stop command processing for deceleration stop function is invalid.
- (2) The stop command processing for deceleration stop function is valid when "0: Normal deceleration stop" is set in "Pr.37 Stop group 1 sudden stop selection" to "Pr.39 Stop group 3 sudden stop selection" as the stopping method for stop cause occurrence.
- (3) The stop command processing for deceleration stop function is invalid when "1: Sudden stop" is set in "Pr.37 Stop group 1 sudden stop selection" to "Pr.39 Stop group 3 sudden stop selection". (A deceleration curve is re-processed, according to the "Pr.36 Sudden stop deceleration time" (starting from the speed at stop cause occurrence to a stop))  
 In the position control (including position control of speed/position changeover control or position/speed changeover control) mode, positioning may stop immediately depending on the stop cause occurrence timing and "Pr.36 Sudden stop deceleration time" setting.

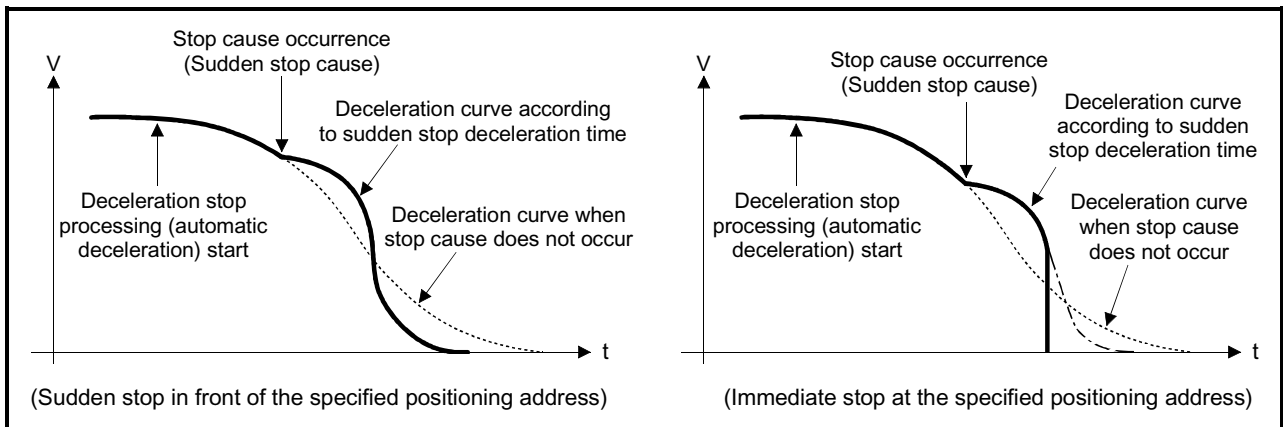


Fig. 12.53 Sudden stop operation (for position control or S-pattern acceleration/deceleration processing)

## [3] Setting method

To use the "stop command processing for deceleration stop function", set the following control data in a PLC program.

The set data are made valid as soon as they are written to the buffer memory.

The PLC ready signal [Y0] is irrelevant.

Setting item		Setting value	Setting details	Buffer memory address
<u>Cd.42</u>	Stop command processing for deceleration stop selection	→	Set the stop command processing for deceleration stop function. 0: Deceleration curve re-processing 1: Deceleration curve continuation	1907

\* For details of the setting details, refer to Section 5.7 "Control data list".

12.8 Servo ON/OFF

12.8.1 Servo ON/OFF

The servo amplifiers connected to the QD75 is executed servo ON or OFF. By establishing the servo ON status with the servo ON command, servo motor operation is enabled.

The following two types of servo ON or OFF can be used.

- All axis servo ON [Y1]
- [Cd.100]Each axis servo OFF (Buffer memory addresses: 1551, 1651, 1751, 1851)

A list of the "All axis servo ON [Y1]" and "[Cd.100]Each axis servo OFF" is given below.

		[Cd.100]Each axis servo OFF	
		Setting value "0"	Setting value "1"
All axis servo ON: Y1	OFF	×	×
	ON	○	×

○: Servo ON (Servo operation enabled) , ×: Servo OFF (Servo operation disabled)

[1] Servo ON (Servo operation enabled)

The following shows the procedure for servo ON.

- (1) Make sure that the servo LED indicates "b $\ddot{Y}$ ".  
(The initial value for "All axis servo ON [Y1]" is "OFF".)
- (2) Set "0" for "[Cd.100]Each axis servo OFF" (Buffer memory: 1551, 1651, 1751, 1851).
- (3) Turn ON "All axis servo ON [Y1]".  
Now the servo amplifier turns ON the servo (servo operation enabled state).  
(The servo LED indicates "d $\ddot{Y}$ ".)

[2] Servo OFF (Servo operation disabled)

The following shows the procedure for servo OFF.

- (1) Set "1" for "[Cd.100]Each axis servo OFF" (Buffer memory: 1551, 1651, 1751, 1851). (The servo LED indicates "c $\ddot{Y}$ ".)  
(If the "[Cd.100]Each axis servo OFF" set "0" again, after the servo operation enabled.)
- (2) Turn OFF "All axis servo ON [Y1]".  
(The servo LED indicates "b $\ddot{Y}$ ".)

POINT
<ul style="list-style-type: none"> <li>• If the servomotor is rotated by external force during the servo OFF status, follow up processing is performed.</li> <li>• Change between servo ON or OFF status while operation is stopped. The servo OFF command of during operation will be ignored.</li> <li>• When the servo OFF is given to all axes, "All axis servo ON [Y1]" is applied even if all axis servo ON command is turned ON to OFF with "[Cd.100]Each axis servo OFF" set "0".</li> </ul>

12.8.2 Follow up function

(1) Follow up function

The follow up function monitors the number of motor rotations (actual present value) with the servo OFF and reflects the value in the present feed value. Therefore, even if the servomotor rotates while the servo OFF, the servomotor will not just rotate for the quantify of droop pulses the next time the servo turns ON but positioning can be performed from the stop position.

(2) Execution follow up

Follow up function is executed continually during the servo OFF status.

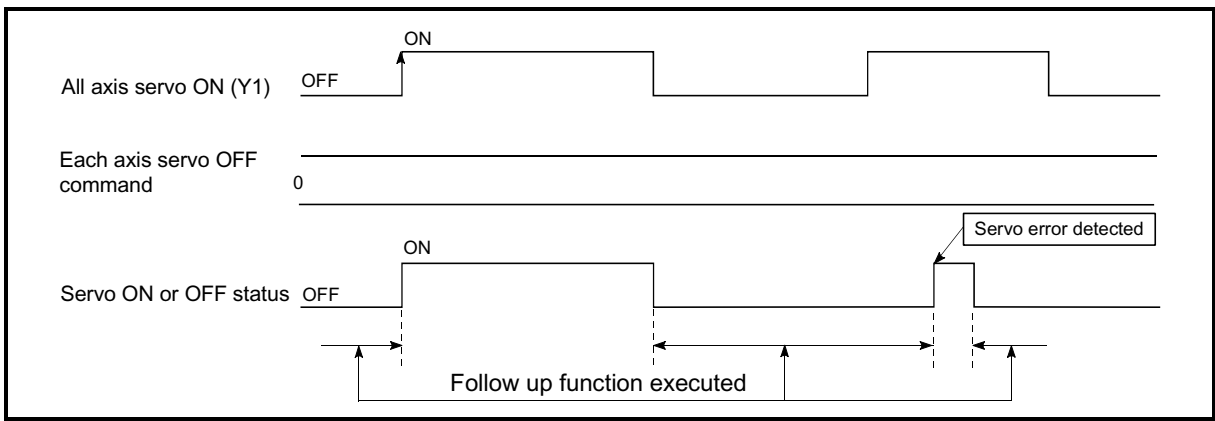


Fig. 12.54 Operation timings of follow up function

**POINT**

- The follow-up function performs the process if the QD75 and the servo is turned ON (servo LED indicates "b $\ddot{Y}$ ", "c $\ddot{Y}$ ", or "d $\ddot{Y}$ ".) regardless of the presence of the absolute position system.



## 12.9 Precautions for MR-J2M-B connection

## [1] Servo parameters

- (1) " Pr.100 Servo series" is to choose "3: MR-J2S-B/MR-J2M-B".
- (2) Write the setting value "0 $\dot{Y}$  12"of the " Pr.102 Regenerative brake resistor" inside buffer memory with PLC program when you use "MR-RB14".
- (3) There are two kinds of parameters of DRU (drive unit) and IFU (interface unit) in MR-J2M-B. The servo parameters set the only DRU parameters. Don't set (change) IFU parameters from QD75. The IFU parameters set (change) "the unit operation section pushbutton switches of the MR-J2M-B interface unit" or "setup software".
- (4) Don't change setting value " Pr.122 Analog monitor output: 0001 (initial value)", " Pr.127 Monitor output 1 offset: 0000 (initial value)" and " Pr.128 Monitor output 2 offset: 0000 (initial value)". Set up IFU parameters " Pr.3 to Pr.8 " when you use analog monitor.
- (5) You cannot change parameter "serial communication response delay time setting" and "serial communication baud rate setting" of " Pr.133 Optional function 6".

# Chapter 13 Common Functions

The details and usage of the "common functions" executed according to the user's requirements are explained in this chapter.

Common functions include functions required when using the QD75, such as parameter initialization and execution data backup.

Read the setting and execution procedures for each common function indicated in this chapter thoroughly, and execute the appropriate function where required.

13.1	Outline of common functions.....	13- 2
13.2	Parameter initialization function .....	13- 3
13.3	Execution data backup function .....	13- 5
13.4	External I/O signal logic switching function.....	13- 7
13.5	External I/O signal monitor function .....	13- 8

## 13.1 Outline of common functions

"Common functions" are executed according to the user's requirements, regardless of the control system, etc. These common functions are executed by peripheral devices or using PLC programs.

The following table shows the functions included in the "common functions".

Common function	Details	Means	
		PLC program	Peripheral devices
Parameter initialization	This function returns the parameter stored in the QD75 buffer memory and flash ROM to the factory-set initial value.	○	○
Execution data backup	This function writes the "execution data", currently being used for control, to the flash ROM.	○	○
External I/O signal logic switching	This function switches I/O signal logic according to the equipment connected to the QD75. For the system in which with b-contact, upper limit switch, and lower limit switch are not used, the parameter logic setting can be controlled without wiring if it is changed to a "positive logic".	○	○
External I/O signal monitor	This function monitors the external I/O signal monitor information in the module's detailed information which can be displayed on the system monitor of GX Developer*.	∞	∞

\* Usable on GX Developer (SW6D5C-GPPW-E or later).

## 13.2 Parameter initialization function

"The parameter initialization function" is used to return the setting data set in the QD75 buffer memory and flash ROM to their factory-set initial values.

The details shown below explain about the "parameter initialization function".

- [1] Parameter initialization means
- [2] Control details
- [3] Precautions during control
- [4] Parameter initialization method

### [1] Parameter initialization means

- Initialization is executed with a PLC program.
- Initialization is executed by peripheral device.

Refer to GX Configurator-QP Operating Manual for the execution method by peripheral device.

### [2] Control details

The following table shows the setting data initialized by the "parameter initialization function".

(The data initialized are "buffer memory" and " flash ROM " setting data.)

Setting data
Basic parameters ( Pr.1 to Pr.10 )
Detailed parameters ( Pr.11 to Pr.42 , Pr.200, Pr.201)
OPR basic parameters ( Pr.43 to Pr.48 )
OPR detailed parameters ( Pr.49 to Pr.57 )
Servo parameters (Pr.100 to Pr.161)
Positioning data (No.1 to 600)
Block start data (No.7000 to 7004)

### [3] Precautions during control

- (1) Parameter initialization is only executed when the positioning control is not carried out (when the PLC READY signal (Y0) is OFF).  
A warning "In PLC READY (warning code: 111)" will occur if executed when the PLC READY signal (Y0) is ON.
- (2) A writing to the flash ROM is up to 100,000 times. If writing to the flash ROM exceeds 100,000 times, the writing may become impossible, and a flash ROM writing error (error code: 801) will occur.
- (3) A "PLC CPU reset" or "PLC power restart" must be carried out after the parameters are initialized.
- (4) If an error occurs on the parameter set in the QD75 when the PLC READY signal [Y0] is turned ON, the QD75 READY signal [X0] will not be turned ON and the control cannot be carried out.

#### Important

Parameter initialization takes about 10 seconds. (Up to 30 seconds are sometimes required.)

Do not turn the power ON/OFF; reset the PLC CPU, etc., during parameter initialization. The flash ROM data may be corrupted.

## [4] Parameter initialization method

(1) Parameter initialization is carried out using the dedicated instruction "PINIT".  
(Refer to Chapter 14 "Dedicated instructions" for details.)

(2) Parameter initialization can also be carried out by the writing of the data shown in the table below to the buffer memory using the TO command/intelligent function device.

The initialization of the parameter is executed at the time point the data is written to the QD75 buffer memory.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
Cd.2 Parameter initialization request	1	Set "1" (parameter initialization request).	1901			

\* Refer to Section 5.7 "List of control data" for details on the setting details.

When the initialization is complete, "0" will be set in "Cd.2 Parameter initialization request" by the QD75 automatically.

13.3 Execution data backup function

When the QD75 buffer memory data is rewritten from the PLC CPU, "the data backed up in the QD75 flash ROM" may differ from "the data (buffer memory data) for which control is being executed".

In cases like these, the data being executed will be lost when the PLC power is turned OFF. (Refer to Chapter 7.)

In cases like these, the "execution data backup function" backs up the data being executed by writing it to the flash ROM. The data that was backed up is then written to the buffer memory when the power is turned ON next.

The details shown below explain about the "execution data backup function".

- [1] Execution data backup means
- [2] Control details
- [3] Precautions during control
- [4] Execution data backup method


[1] Execution data backup (written to flash ROM) means

- The backup is executed with a PLC program.
- The backup is executed by peripheral device.

Refer to GX Configurator-QP Operating Manual for execution data backup method by peripheral device.

[2] Control details

The following shows the data that can be written to the flash ROM using the "execution data backup function".

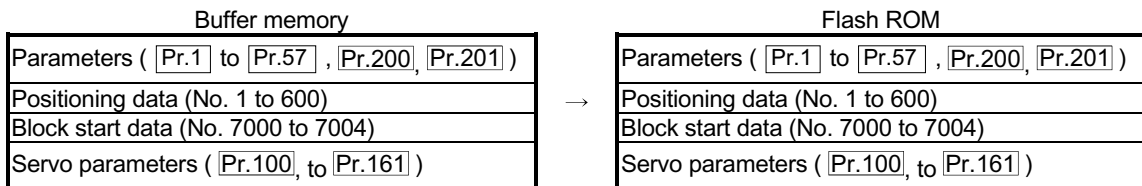

[3] Precautions during control

- (1) Data can only be written to the flash ROM when the positioning control is not carried out (when the PLC READY signal (Y0) is OFF).
- (2) Writing to the flash ROM can be executed up to 100,000 times. If writing to the flash ROM exceeds 100,000 times, the writing may become impossible, and a "flash ROM writing error (error code: 801)" will occur.
- (3) After one power ON/PLC CPU reset operation, writing to the flash ROM using a PLC program is limited to up to 25 times. If the 26th writing is executed, a "flash ROM write number error (error code: 805)" will occur. If this error occurs, carry out the power OFF→ON/PLC CPU reset operation again.

Refer to [Md.19] of Section 5.1.7 "Types and roles of monitor data" for details.

**Important**  
Do not turn the power ON/OFF, reset the PLC CPU, during writing to the flash ROM. The flash ROM data may be corrupted.

## [4] Execution data backup method

- (1) Execution data backup (writing to the flash ROM) is carried out using the dedicated instruction "PFWRT". (Refer to "Chapter 14 Dedicated instructions" for details.)
- (2) Refer to Section 7.2 "Data transmission process" for the data transmission processing at the backup of the execution data.
- (3) Execution data backup can also be carried out by the writing of the data shown in the table below to the QD75 buffer memory using the TO command/intelligent function device.  
The writing to the flash ROM is executed at the time point the data is written to the QD75 buffer memory.

Setting item	Setting value	Setting details	Buffer memory address			
			Axis 1	Axis 2	Axis 3	Axis 4
<span style="border: 1px solid black; padding: 2px;">Cd.1</span> Flash ROM write request	1	Set "1" (flash ROM write request).	1900			

\* Refer to Section 5.7 "List of control data" for details on the setting details.

When the writing to the flash ROM is complete, "0" will be set in " Cd.1 Flash ROM write request" by the QD75 automatically.

13.4 External I/O signal logic switching function

This function switches the signal logic according to the external equipment connected to the QD75.

For the system in which b-contact, upper limit switch, and lower limit switch are not used, the parameter logic setting can be controlled without wiring if it is changed to a "positive logic".

When the upper limit switch, and lower limit switch are used, ensure to use them with b-contact.

The details shown below explain about the "External I/O signal logic switching function".

[1] Parameter setting details

[2] Precautions on parameter setting

[1] Parameter setting details

To use the "External I/O signal logic switching function", set the parameters shown in the following table.

Setting item	Setting details	Factory-set initial value	Buffer memory address					
			Axis 1	Axis 2	Axis 3	Axis 4		
[Pr.22] Input signal logic selection	• Selection of logic of signals input from external source to QD75		0	31	181	331	481	
	b0	Lower limit						0: Negative logic, 1: Positive logic
	b1	Upper limit						0: Negative logic, 1: Positive logic
	b2	Not used						Set "0".
	b3	Stop signal						0: Negative logic, 1: Positive logic
	b4	External command						0: Negative logic, 1: Positive logic
	b5	Not used						Set "0".
	b6	Near-point signal						0: Negative logic, 1: Positive logic
	b7	Not used						Set "0".
	b8	Manual pulse generator input						0: Negative logic, 1: Positive logic
	b9 to b15	Not used						Set "0".

\* Refer to Section 5.2 "List of parameters" for the information on detail settings.

[2] Precautions on parameter setting

(1) The external I/O signal logic switching parameters are validated when the PLC READY signal [Y0] is turned OFF to ON. (The logic is negative right after power-on.)

(2) If each signal logic is set erroneously, the operation may not be carried out correctly.


Before setting, check the specifications of the equipment to be used.



13.5 External I/O signal monitor function

The "External I/O signal monitor function" monitors the module's information and external I/O signal monitor information in the module's detailed information which can be displayed on the system monitor of GX Developer\*.

The information that can be monitored are the module's information (same as the QD75 front "RUN", "ERR" LED indicators) and the following external I/O signals. (Set the logic of the external I/O signals in " Pr.22 Input signal logic selection" and " Pr.23 Output signal logic selection".)

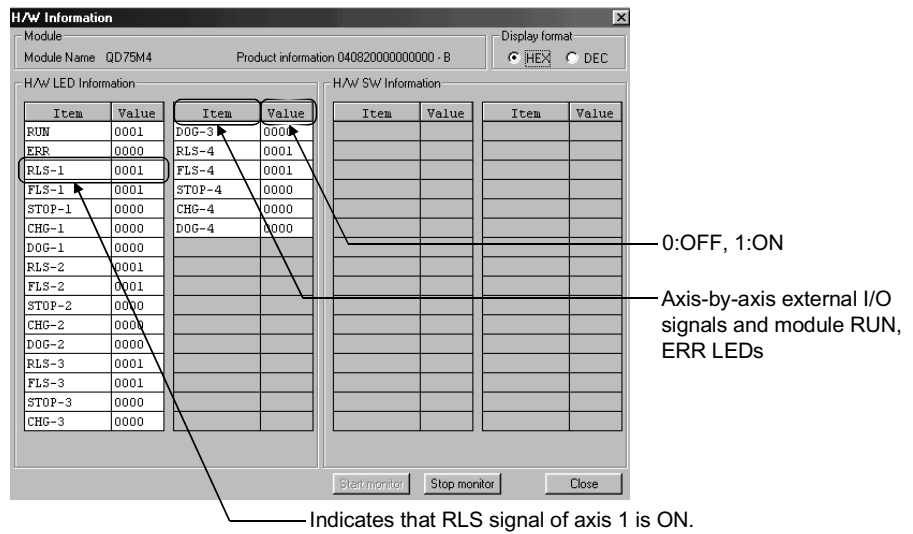

\*: Use GX Developer of version 6.05F or later. Refer to GX Developer Operating Manual for the system monitor of GX Developer.

# Chapter 14 Dedicated Instructions

The QD75 dedicated instructions are explained in this chapter.

These instructions are used to facilitate the programming for the use of the functions of the intelligent function module.

Using the dedicated instructions, the programming can be carried out without being aware of the QD75 buffer memory address and interlock signal.

14.1	List of dedicated instructions .....	14- 2
14.2	Interlock during dedicated instruction is executed .....	14- 2
14.3	PSTRT1, PSTRT2, PSTRT3, PSTRT4 .....	14- 3
14.4	TEACH1, TEACH2, TEACH3, TEACH4 .....	14- 7
14.5	PFWRT .....	14- 11
14.6	PINIT .....	14- 15

14.1 List of dedicated instructions

The dedicated instructions explained in this Chapter are listed in Table 14.1.


Table 14.1 List of dedicated instructions

Application	Dedicated instruction	Outline of functions	Reference
Positioning start	PSTRT1	This function starts the positioning control of the designated axis of the QD75.	Section 14.4
	PSTRT2		
	PSTRT3		
	PSTRT4		
Teaching	TEACH1	This function carries out teaching the designated axis of the QD75.	Section 14.5
	TEACH2		
	TEACH3		
	TEACH4		
Writing to flash ROM	PFWRT	This function writes the buffer memory parameters, positioning data and block start data to the flash ROM.	Section 14.6
Parameter initialization	PINIT	This function initializes the buffer memory and flash ROM setting data to the factory-set data (initial values).	Section 14.7

14.2 Interlock during dedicated instruction is executed

The positioning start instruction (PSTRT□) and teaching instruction (TEACH□) cannot be executed simultaneously in each axis. If they are executed at the same time, the second and later instructions are ignored by an internal interlock (no error will occur).


The timing of the positioning start dedicated instruction (PSTRT□) is as shown below.

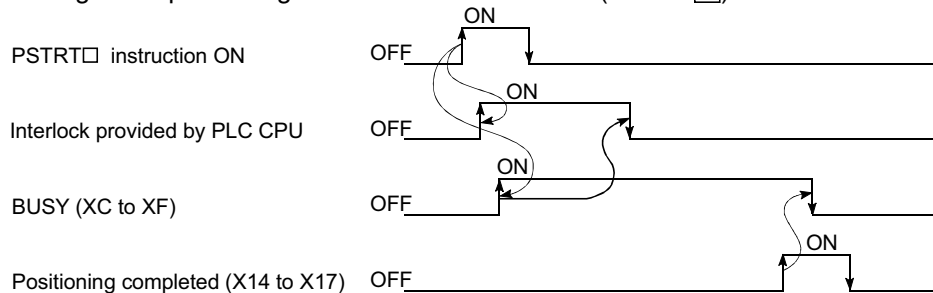

14.3 PSTRT1, PSTRT2, PSTRT3, PSTRT4

These dedicated instructions are used to start the positioning of the designated axis.

Setting data	Usable device								
	Internal device		File register	MELSECNET/10 direct J□□		Special module U□\G□	Index register Zn	Constant K, H, \$	Others
	Bit	Word		Bit	Word				
(S)	-	○						-	-
(D)	○	○	-					-	-

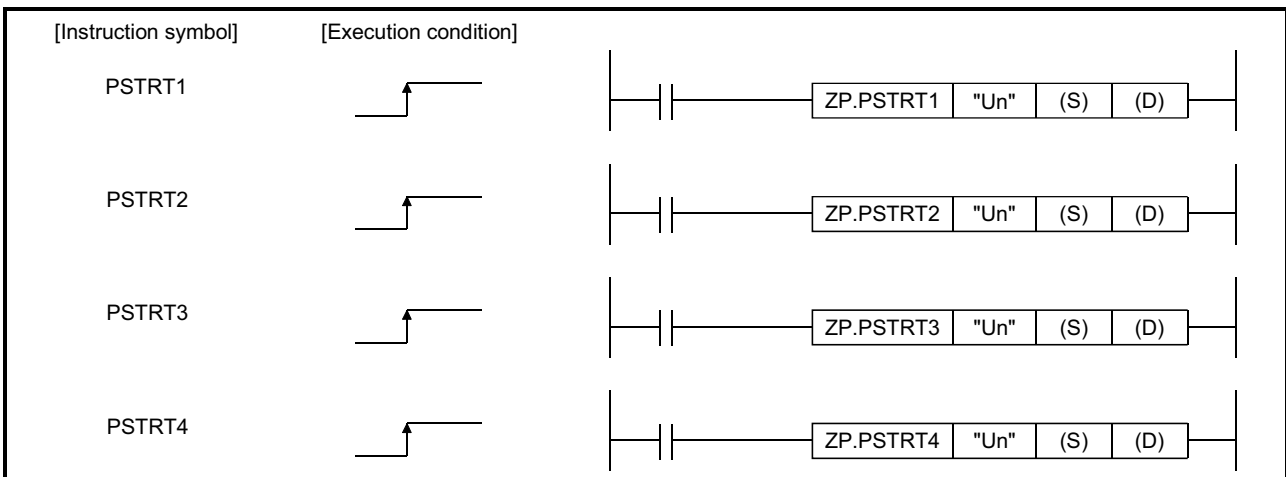

When PSTRT1, PSTRT2, PSTRT3, and PSTRT4 are common to each other, they are designated as "PSTRT□".

[Setting data]

Setting data	Setting details	Setting side (*1)	Data type
"Un"	QD75 head I/O number (00 to FE: High-order two digits of I/O number expressed in three digits)	User	BIN 16 bits
(S)	Head number of a device in which control data is stored	-	Device
(D)	Head number of a bit device which turns ON the operation by one scan at the time of completion of the instruction. If the instruction is completed abnormally, ((D) + 1) will also be turned ON.	System	Bit

Note) The file register of each of the local device and the program cannot be used as a device for setting data.

## [Control data]

Device	Item	Setting data	Setting range	Setting side (*1)
(S)+0	System area	–	–	–
(S)+1	Complete status	The state at the time of completion is stored. <ul style="list-style-type: none"> <li>• 0 : Normal completion</li> <li>• Other than 0: Abnormal completion (error code)(*2)</li> </ul>	–	System
(S)+2	Start No.	The following data Nos. to be started by the PSTRT□ instruction are designated. <ul style="list-style-type: none"> <li>• Positioning data No. : 1 to 600</li> <li>• Block start : 7000 to 7004</li> <li>• Machine OPR : 9001</li> <li>• Fast OPR : 9002</li> <li>• Current value changing : 9003</li> <li>• Multiple axes simultaneous start : 9004</li> </ul>	1 to 600 7000 to 7004 9000 to 9004	User


\*1: The data on the setting side is as follows.

- User : Data before the execution of dedicated instructions is stored by user.
- System: Data after the execution of dedicated instruction is stored by PLC CPU.

\*2: Refer to Section 15.2 for error codes at abnormal completion.

## [Functions]

- (1) The positioning start of the axes to be processed (See below) is carried out.
  - PSTRT1: Axis 1
  - PSTRT2: Axis 2
  - PSTRT3: Axis 3
  - PSTRT4: Axis 4
  
- (2) The block start, OPR start, current value changing, and multiple axes simultaneous start can be carried out by the setting of "start number" 7000 to 7004/9001 to 9004 in ((S)+2).
  
- (3) The PSTRT□ instruction completion can be confirmed using the complete devices ((D)+0) and ((D)+1).
  - (a) Complete device ((D)+0)  
This device is turned ON by the END processing of the scan for which PSTRT□ instruction is completed, and turned OFF by the next END processing.
  - (b) Complete state display device ((D)+1)  
This device is turned ON and OFF according to the state in which PSTRT□ instruction is completed.
    - When completed normally : Kept unchanged at OFF.
    - When completed abnormally: This device is turned ON by the END processing of the scan for which PSTRT□ instruction is completed, and turned OFF by the next END processing. (same ON/OFF operation as complete device).

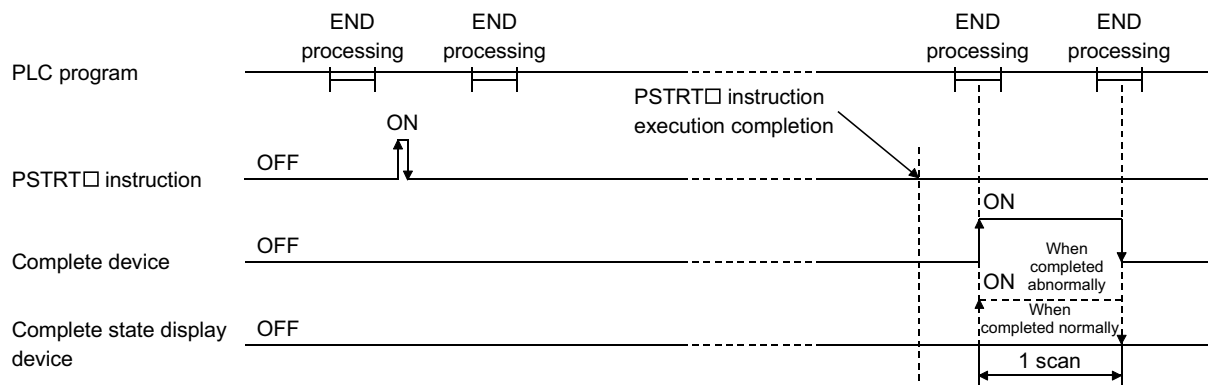

### [Errors]

- (1) When an PSTRT instruction is completed abnormally, the error complete signal ((D)+1) is turned ON, and the error code is stored in the complete status ((S)+1). Check and take a measure against the error referring to Section 15.2 "List of error codes".

### [Precautions]

- (1) If the positioning is started by the PSTRT instruction, the positioning start signals (Y10 to Y13) will not turn ON.  
Confirm the operation during the positioning control using the PSTRT start instruction and start complete signals (X10 to X13).
- (2) If the stop instruction is input before completion of the positioning which has been started by the PSTRT instruction, the completion device (D) turns the 1-scan ON to complete execution of the PSTRT instruction.
- (3) The following dedicated instructions cannot be executed simultaneously for the same axis.  
(Can be executed simultaneously for different axes.)
  - Positioning start instructions (PSTRT1 to PSTRT4)
  - Teaching instructions (TEACH1 to TEACH4)
- (4) The PSTRT instruction can only be executed when the QD75 READY signal (X0) is turned ON.  
Even if the PSTRT instruction execution request is given when the QD75 READY signal is turned OFF, the PSTRT instruction will not be executed. (not processed.)  
Before executing the PSTRT instruction, turn ON the PLC READY signal (Y0), and turn ON the QD75 READY signal (X0).
- (5) When the remote I/O station\* (Q Corresponding MELSECNET/H network remote I/O module) is used, the dedicated instruction (PSTRT) is unusable.

\*: For details of the remote I/O station, refer to Q Corresponding MELSECNET/H Network System Reference Manual (Remote I/O Network).

(6) If the PSTRT□ instruction is executed in either of the following cases, an error "Dedicated instruction error" (error code: 804) will occur and positioning cannot be started.


- Any value other than 1 to 600, 7000 to 7004, and 9001 to 9004 is set to "Starting number" (device: (S)+2) of the control data.
- The instruction for a non-existent axis is specified.

(Example: The PSTRT2 instruction is specified when the QD75M1 is used.)


[Program examples]

- The following program executes the positioning start of positioning data No. 1 when X100 turns ON.

Use D30 to D32 as the control data devices of positioning data No. 1, and M32 and M33 as the completion devices.

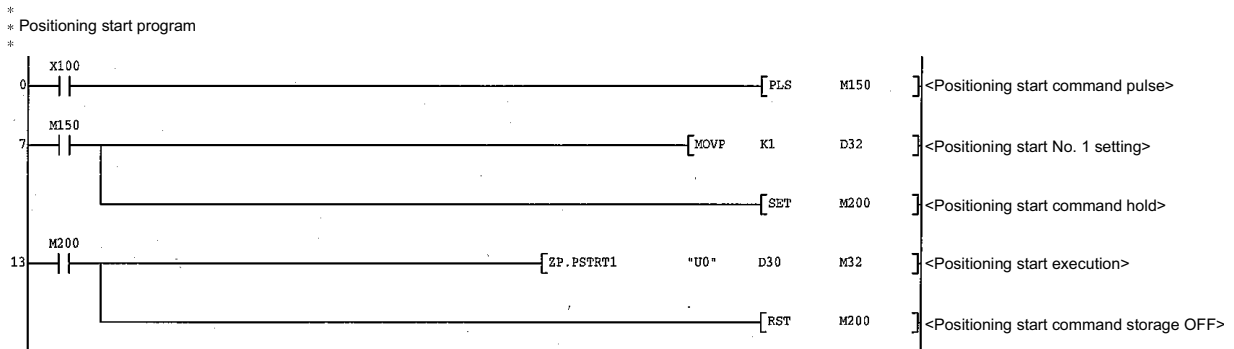


[Program example for use when dedicated instruction is not used]

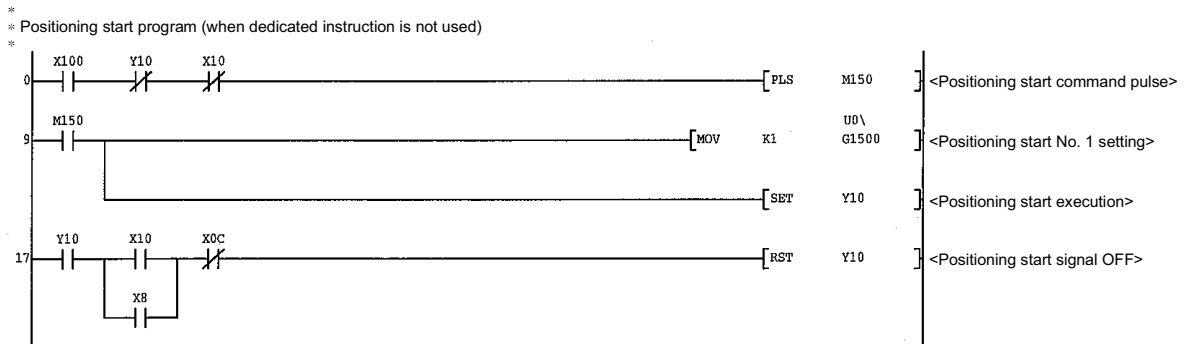

14.4 TEACH1, TEACH2, TEACH3, TEACH4

These dedicated instructions are used to teach the designated axis.

Setting data	Usable device								
	Internal device		File register	MELSECNET/10 direct J□□		Special module U□\G□	Index register Zn	Constant K, H, \$	Others
	Bit	Word		Bit	Word				
(S)	-	○						-	-
(D)	○	○	-					-	-

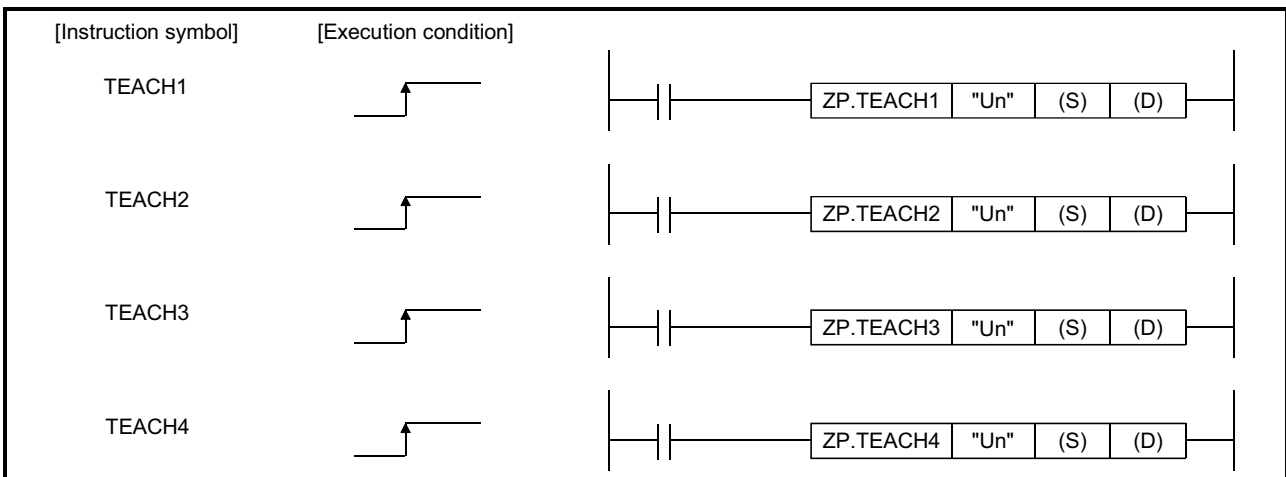

When TEACH1, TEACH2, TEACH3, and TEACH4 are common to each other, they are designated as "TEACH□".

[Setting data]

Setting data	Setting details	Setting side (*1)	Data type
"Un"	QD75 head I/O number (00 to FE: High-order two digits of I/O number expressed in three digits)	User	BIN 16 bits
(S)	Head number of a device in which control data is stored	-	Device
(D)	Head number of a bit device which turns ON the operation by one scan at the time of completion of the instruction. If the instruction is completed abnormally, ((D) + 1) will also be turned ON.	System	Bit

Note) The file register of each of the local device and the program cannot be used as a device for setting data.



## [Control data]

Device	Item	Setting data	Setting range	Setting side (*1)
(S)+0	System area	–	–	–
(S)+1	Complete status	The state at the time of completion is stored. 0 : Normal completion Other than 0: Abnormal completion (error code)(*2)	–	System
(S)+2	Teaching data selection	The address (positioning address/arc address) to which the current feed value is written is set. 0: Current feed value is written to positioning address. 1: Current feed value is written to arc address.	0, 1	User
(S)+3	Positioning data No.	The positioning data No. for which teaching is carried out is set.	1 to 600	User


\*1: The data on the setting side is as follows.

- User : Data before the execution of dedicated instructions is stored by user.
- System: Data after the execution of dedicated instruction is stored by PLC CPU.

\*2: Refer to Section 15.2 for error codes at abnormal completion.

## [Functions]

- (1) The "current feed value" of the axes to be set (See below) is set in the positioning address or arc address.  
The positioning data other than the positioning addresses and arc addresses are set by peripheral device or using a PLC program.
  - TEACH1: Axis 1
  - TEACH2: Axis 2
  - TEACH3: Axis 3
  - TEACH4: Axis 4
- (2) Teaching can be carried out for the positioning data No. 1 to 600.
- (3) The movement of the machine to the address (position) set in the positioning address/arc address of the positioning data is carried out by the JOG operation, inching operation, or manual pulse generator operation.
- (4) The TEACH□ instruction completion can be confirmed using the complete devices ((D)+0) and ((D)+1).
  - (a) Complete device ((D)+0)  
This device is turned ON by the END processing of the scan for which TEACH□ instruction is completed, and turned OFF by the next END processing.
  - (b) Complete state display device ((D)+1)  
This device is turned ON and OFF according to the state in which TEACH□ instruction is completed.
    - When completed normally :Kept unchanged at OFF.
    - When completed abnormally: This device is turned ON by the END processing of the scan for which TEACH□ instruction is completed, and turned OFF by the next END processing. (same ON/OFF operation as complete device).

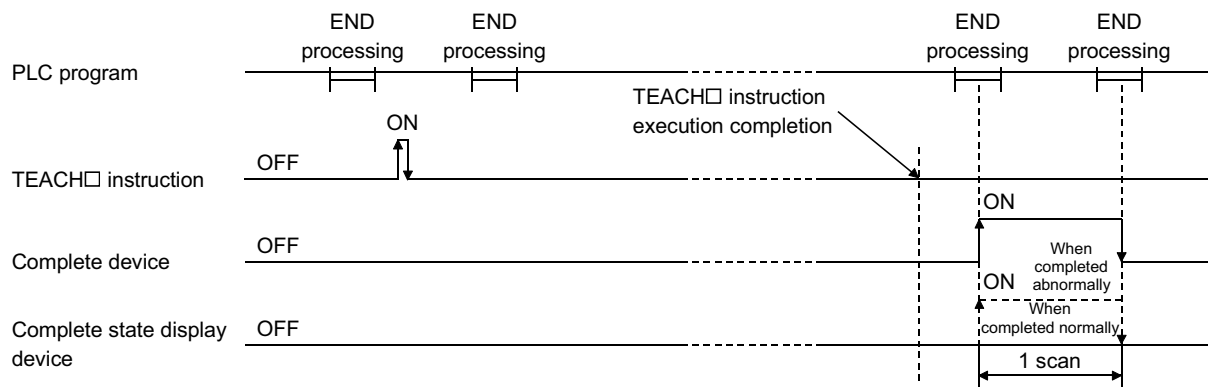

[Errors]


- (1) When a TEACH instruction is completed abnormally, the error complete signal ((D)+1) is turned ON, and the error code is stored in the complete status (S)+1. Check and take a measure against the error referring to section 15.2 "List of error codes".

[Precautions]


- (1) The following dedicated instructions cannot be executed simultaneously for the same axis.  
(Can be executed simultaneously for different axes.)
  - Positioning start instructions (PSTRT1 to PSTRT4)
  - Teaching instructions (TEACH1 to TEACH4)
- (2) The TEACH instruction can only be executed when the BUSY signal (XC, XD, XE, XF) is turned OFF.  
When the BUSY signal is turned ON, the TEACH instruction will not be executed. (not processed.)  
Before executing the PFWRT instruction, make sure that the BUSY signal for the axis to be processed is turned OFF.
- (3) When the remote I/O station\* (Q Corresponding MELSECNET/H network remote I/O module) is used, the dedicated instruction (TEACH) is unusable.  
  
\*: For details of the remote I/O station, refer to Q Corresponding MELSECNET/H Network System Reference Manual (Remote I/O Network).
- (4) If the TEACH instruction is executed in any of the following cases, an error "Dedicated instruction error" (error code: 804) will occur and teaching cannot be performed.
  - Any value other than 0 and 1 is set to "Teaching selection" (device: (S)+2) of the control data.
  - Any value other than 1 to 600 is set to "Positioning No." (device: (S)+3) of the control data.
  - The instruction for a non-existent axis is specified.  
(Example: The TEACH2 instruction is specified when the QD75M1 is used.)

[Program example]

Program to execute the teaching of the positioning data No. 3 of the axis 1 when X39 is turned ON.

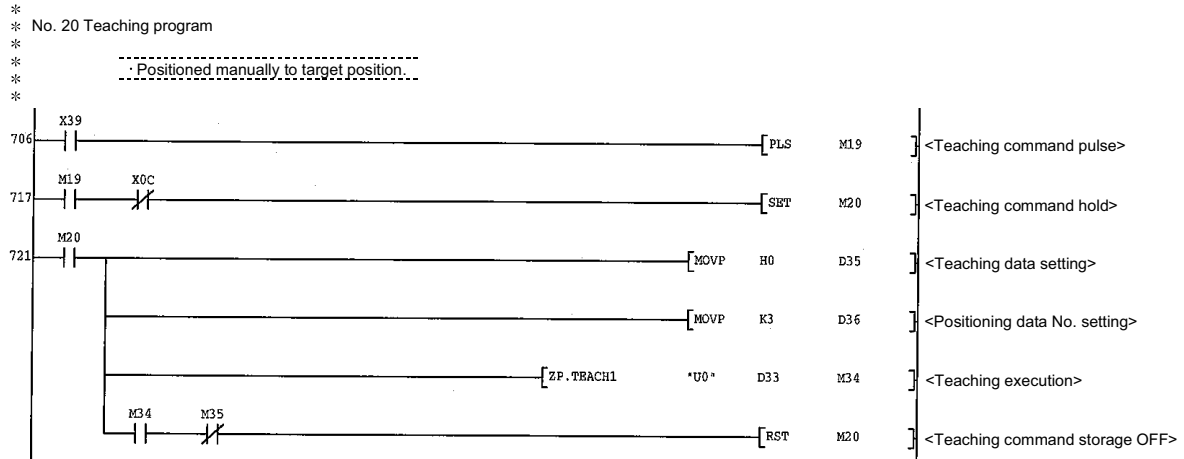


[Program example for use when dedicated instruction is not used]

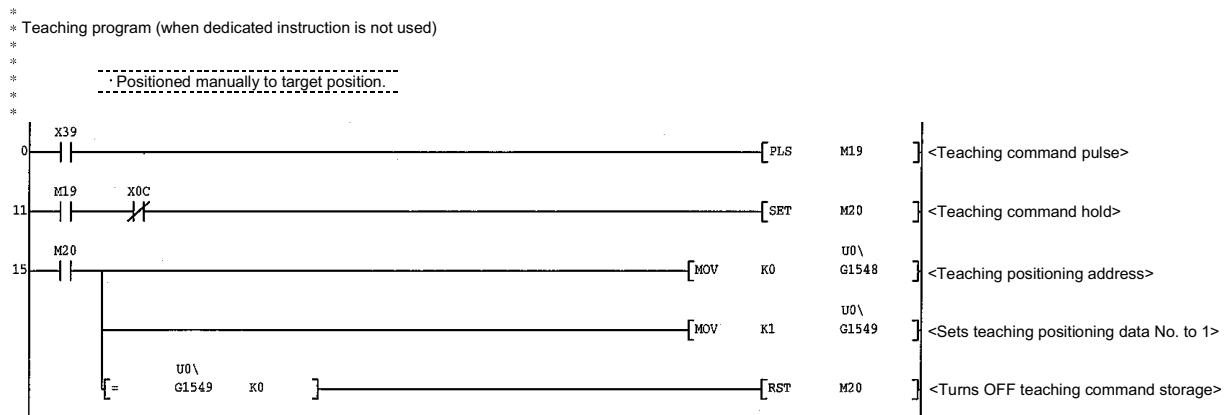

14.5 PFWRT

These dedicated instructions are used to write the QD75 parameters, positioning data and block start data to the flash ROM.

Setting data	Usable device								
	Internal device		File register	MELSECNET/10 direct J□\□		Special module U□\G□	Index register Zn	Constant K, H, \$	Others
	Bit	Word		Bit	Word				
(S)	–	○	○	–	–	–	–	–	
(D)	○	○	–	–	–	–	–	–	

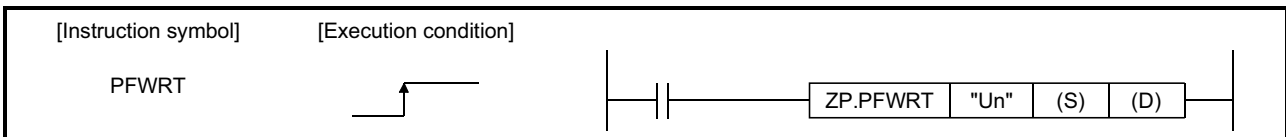

[Setting data]

Setting data	Setting details	Setting side (*1)	Data type
"Un"	QD75 head I/O number (00 to FE: High-order two digits of I/O number expressed in three digits)	User	BIN 16 bits
(S)	Head number of a device in which control data is stored	–	Device
(D)	Head number of a bit device which turns ON the operation by one scan at the time of completion of the instruction. If the instruction is completed abnormally, ((D) + 1) will also be turned ON.	System	Bit

Note) The file register of each of the local device and the program cannot be used as a device for setting data.

[Control data]

Device	Item	Setting data	Setting Range	Setting side (*1)
(S)+0	System area	–	–	–
(S)+1	Complete status	The state at the time of completion is stored. 0 : Normal completion Other than 0 : Abnormal completion (error code)(*2)	–	System

\*1: The data on the setting side is as follows.

- User : Data before the execution of dedicated instructions is stored by user.
- System: Data after the execution of dedicated instruction is stored by PLC CPU.

\*2: Refer to Section 15.2 for error codes at abnormal completion.


[Functions]

- (1) The PFWRT instruction completion can be confirmed using the complete devices ((D)+0) and ((D)+1).
  - (a) Complete device ((D)+0)
 

This device is turned ON by the END processing of the scan for which PFWRT instruction is completed, and turned OFF by the next END processing.
  - (b) Complete state display device ((D)+1)
 

This device is turned ON and OFF according to the state in which PFWRT instruction is completed.

    - When completed normally : Kept unchanged at OFF.
    - When completed abnormally : This device is turned ON by the END processing of the scan for which PFWRT instruction is completed, and turned OFF by the next END processing. (same ON/OFF operation as complete device).

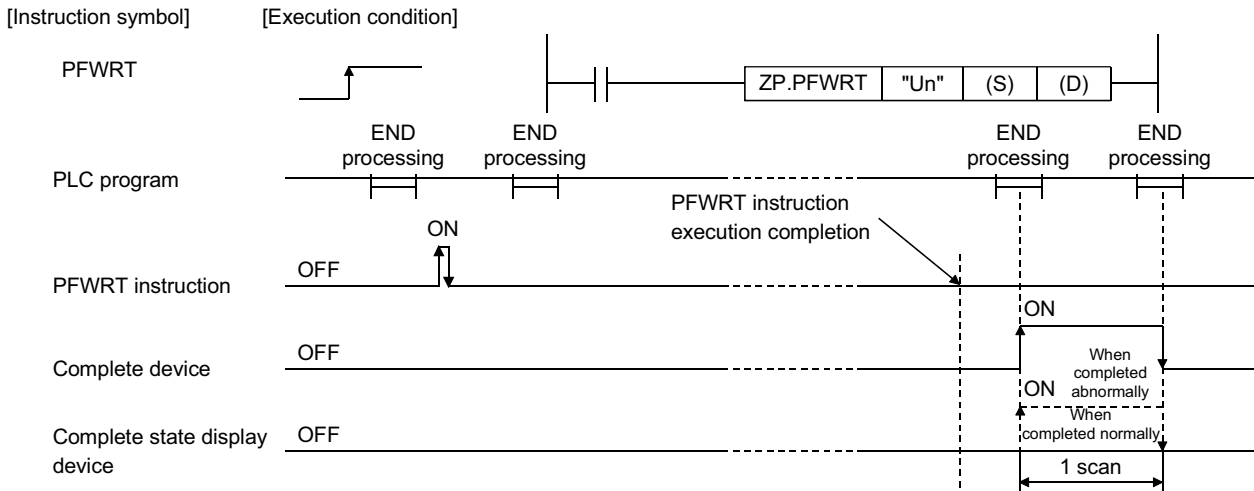

[Errors]

- (1) When a dedicated instruction is completed abnormally, the error complete signal ((D)+1) is turned ON, and the error code is stored in the complete status ((S)+1). Check and take measures against the error referring to Section 15.2 List of error codes.


## [Precautions]

- (1) Do not turn ON the power and reset the PLC CPU while parameters, positioning data and block start data are written to the flash ROM using the PFWRT instruction.  
A parameter error will occur or normal positioning start will become impossible because the parameters, positioning data and block start data are not written normally to the flash ROM.  
If this occurs, restart the operation by the method shown below.
  - For GX Configurator-QP, write the parameters, positioning data and block start data again to the flash ROM.
  - For a PLC program, write the parameters, positioning data and block start data to the QD75 after initializing the parameters (PINIT instruction execution and others).Then execute the PFWRT instruction again.
- (2) A writing to the flash ROM is up to 100,000 times.  
If writing to the flash ROM exceeds 100,000 times, the writing to the flash ROM will become impossible.
- (3) After the power ON and PLC CPU reset operation, writing to the flash ROM using a PLC program is limited to up to 25 times. (Not limited to up to 25 times when writing to the flash ROM is carried out by peripheral device.)  
If the 26th or more writing is requested after the power ON/PLC CPU reset operation, a flash ROM exceed writing error (error code: 805) will occur, and the writing will be disabled. If a flash ROM write error occurs by one writing to the flash ROM, check and correct the flash ROM writing program. Then reset the error or turn ON the power and reset the PLC CPU again.
- (4) The PFWRT instruction can only be executed when the QD75 READY signal (X0) is turned OFF.  
When the QD75 READY signal is turned ON, the PFWRT instruction cannot be executed.  
Before executing the PFWRT instruction, turn OFF the PLC READY signal (Y0) and then turn OFF the QD75 READY signal.
- (5) When the remote I/O station\* (Q Corresponding MELSECNET/H network remote I/O module) is used, the dedicated instruction (PFWRT) is unusable.
- (6) When the PLC READY signal (Y0) is turned ON, an error (error code : 1204) occurs in the case shown below. Execute the axis error reset after the error occurrence.
  - (a) The motor capacity ( Pr.104 ) of flash ROM is set in the value except for 0.
  - (b) LED of the amplifier is indicated b $\ddot{Y}$ .
  - (c) A set up of rotation direction was changed to 0 1 or 1 0 by PLC program or GX-configurator-QP.


\*: For details of the remote I/O station, refer to Q Corresponding MELSECNET/H Network System Reference Manual (Remote I/O Network).

[Program example]

Program used to write the parameters and positioning data stored in the buffer memory to the flash ROM when X3D is turned ON.

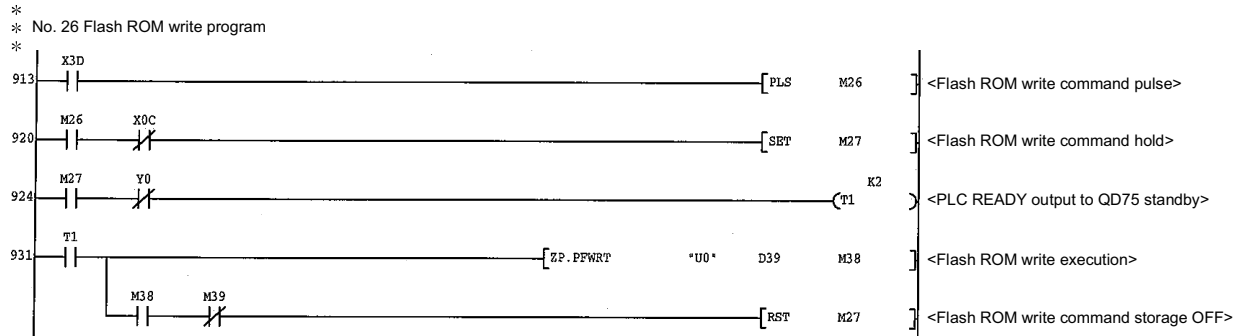


[Program example for use when dedicated instruction is not used]

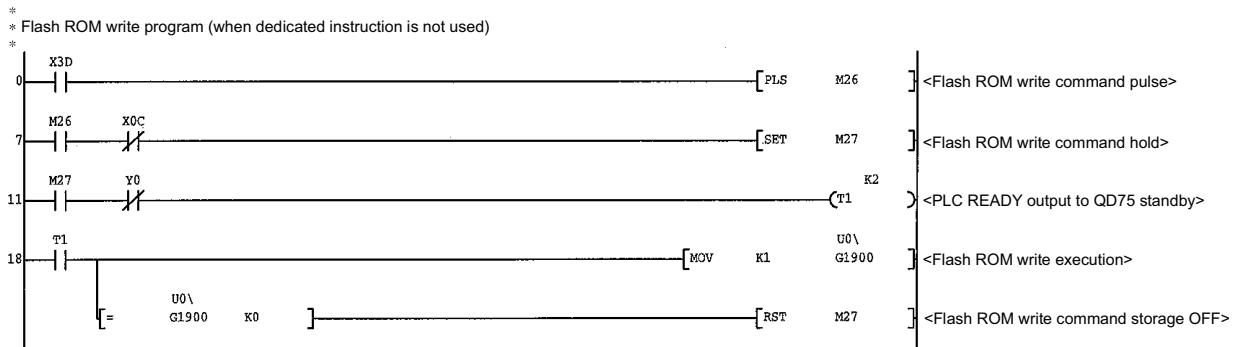

14.6 PINIT

This dedicated instruction is used to initialize the setting data of the QD75.

Setting data	Usable device								
	Internal device		File register	MELSECNET/10 direct J□\□		Special module U□\G□	Index register Zn	Constant K, H, \$	Others
	Bit	Word		Bit	Word				
(S)	–	○	–	–	–	–	–	–	
(D)	○	○	–	–	–	–	–	–	

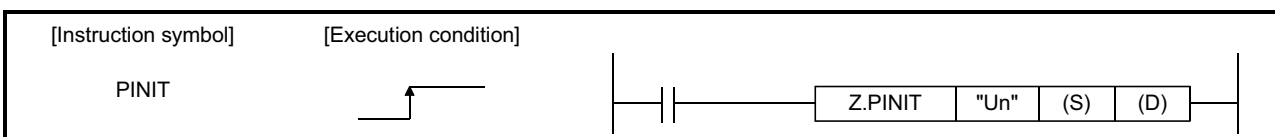

[Setting data]

Setting data	Setting details	Setting side (*1)	Data type
"Un"	QD75 head I/O number (00 to FE: High-order two digits of I/O number expressed in three digits)	User	BIN 16 bits
(S)	Head number of a device in which control data is stored	–	Device
(D)	Head number of a bit device which turns ON the operation by one scan at the time of completion of the instruction. If the instruction is completed abnormally, ((D) + 1) will also be turned ON.	System	Bit

Note) The file register of each of the local device and the program cannot be used as a device for setting data.

[Control data]

Device	Item	Setting data	Setting range	Setting side (*1)
(S)+0	System area	–	–	–
(S)+1	Complete status	The state at the time of completion is stored. 0 : Normal completion Other than 0: Abnormal completion (error code)(*2)	–	System

\*1: The data on the setting side is as follows.

- User : Data before the execution of dedicated instructions is stored by user.
- System: Data after the execution of dedicated instruction is stored by PLC CPU.

\*2: Refer to Section 15.2 for error codes at abnormal completion.



[Functions]

- (1) This dedicated instruction is used to return the setting data set in the QD75 buffer memory and flash ROM to their factory-set data (initial values).

Setting data
Basic parameters ( [Pr.1] to [Pr.10] )
Detailed parameters ( [Pr.11] to [Pr.42] , [Pr.200], [Pr.201] )
OPR basic parameters ( [Pr.43] to [Pr.48] )
OPR detailed parameters ( [Pr.49] to [Pr.57] )
Servo parameters ([Pr.100] to [Pr.161])
Positioning data (No.1 to 600)
Block start data (No.7000 to 7004)

- (2) The PINIT instruction completion can be confirmed using the complete devices ((D)+0) and ((D)+1).


- (a) Complete device ((D)+0)

This device is turned ON by the END processing of the scan for which PINIT instruction is completed, and turned OFF by the next END processing.

- (b) Complete state display device ((D)+1)

This device is turned ON and OFF according to the state in which PINIT instruction is completed.

- When completed normally : Kept unchanged at OFF.
- When completed abnormally : This device is turned ON by the END processing of the scan for which PINIT instruction is completed, and turned OFF by the next END processing. (same ON/OFF operation as complete device).

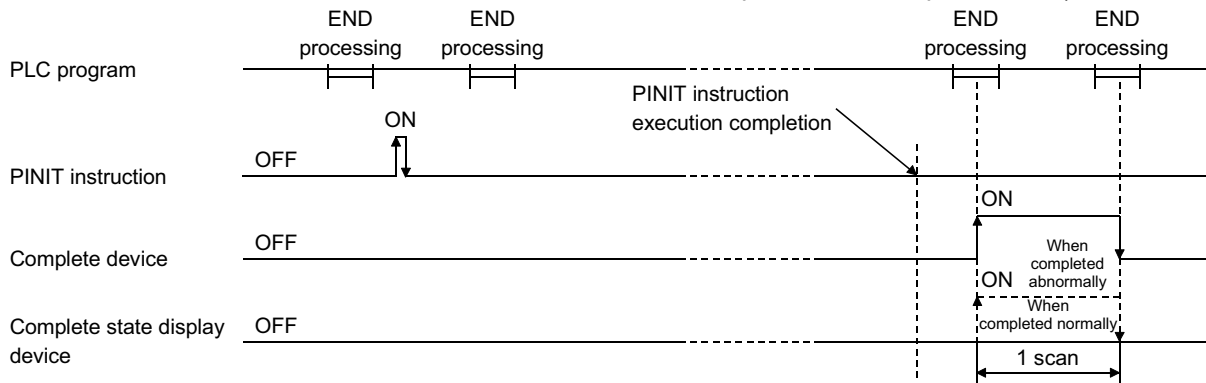

[Errors]


- (1) When a dedicated instruction is completed abnormally, the error complete signal ((D)+1) is turned ON, and the error code is stored in the complete status ((S)+1). Check and take measures against the error referring to section 15.2 List of error codes.

[Precautions]


- (1) The PINIT instruction can only be executed when the QD75 READY signal (X0) is turned OFF.  
 When the QD75 READY signal is turned ON, the PINIT instruction cannot be executed.  
 Before executing the PINIT instruction, turn OFF the PLC READY signal (Y0) and then turn OFF the QD75 READY signal.
- (2) When the remote I/O station\* (Q Corresponding MELSECNET/H network remote I/O module) is used, the dedicated instruction (PINIT) is unusable.  
 \*: For details of the remote I/O station, refer to Q Corresponding MELSECNET/H Network System Reference Manual (Remote I/O Network).

[Program example]

The following program initializes the parameters in buffer memory and flash ROM when X3C turns ON.

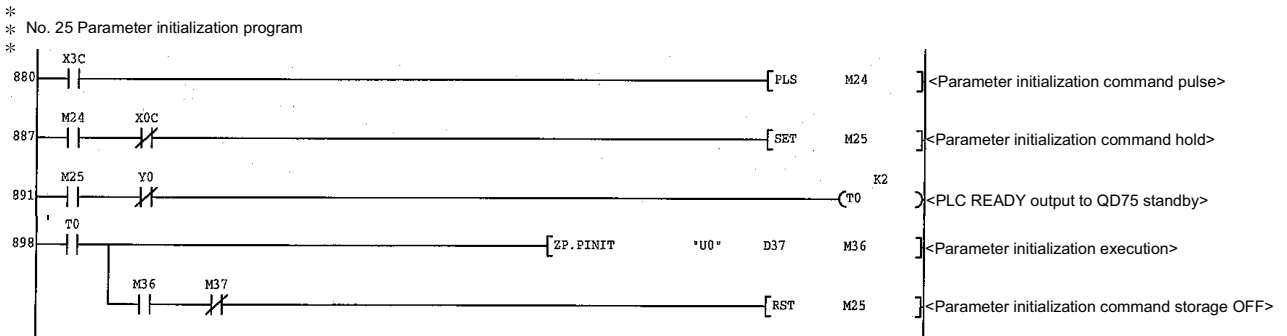

[Program example for use when dedicated instruction is not used]

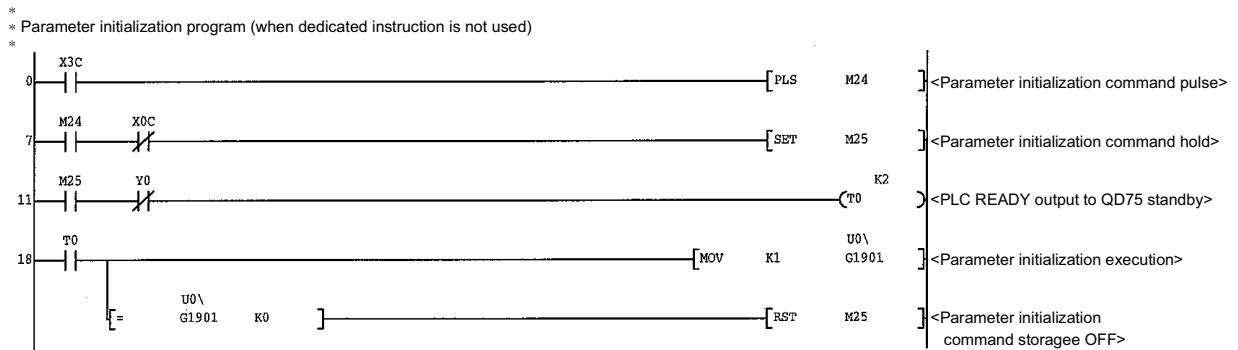



# Chapter 15 Troubleshooting

The "errors" and "warnings" detected by the QD75 are explained in this chapter.

Errors can be confirmed with the QD75 LED display and peripheral devices.  
When an error or warning is detected, confirm the detection details and carry out the required measures.

15.1	Error and warning details.....	15- 2
15.2	List of errors .....	15- 6
15.2.1	QD75 detection error .....	15- 6
15.2.2	MR-H-BN detection error .....	15- 34
15.2.3	MR-J2-B detection error.....	15- 46
15.2.4	MR-J2S-B detection error .....	15- 56
15.2.5	MR-J2-Jr detection error .....	15- 66
15.2.6	MR-J2M-B detection error .....	15- 76
15.3	List of warnings .....	15- 90
15.3.1	QD75 detection warning .....	15- 90
15.3.2	MR-H-BN detection warning .....	15- 96
15.3.3	MR-J2-B detection warning .....	15- 98
15.3.4	MR-J2S-B detection warning .....	15-100
15.3.5	MR-J2-Jr detection warning .....	15-102
15.3.6	MR-J2M-B detection warning .....	15-104
15.4	LED display functions .....	15-106

## 15.1 Error and warning details

### [1] Errors

#### ■ Types of errors

Errors detected by the QD75 include parameter setting range errors, errors at the operation start or during operation and errors detected by servo amplifier.

- (1) Errors detected by the QD75 include parameter setting range errors  
 The parameters are checked when the power is turned ON and at the rising edge (OFF → ON) of the PLC READY signal [Y0]. An error will occur if there is a mistake in the parameter setting details at that time.  
 When this kind of error occurs, the QD75 READY signal does not turn ON.  
 To cancel this kind of error, set the correct value in the parameter for which the error occurred, and then turn ON the PLC READY signal [Y0].

POINT
Execute the re-setup of the parameter after you execute the initialization (refer to the Section 13.2) of the parameter when the error (error code: 900 to 997) occurs in many and QD75 doesn't start.

- (2) Errors at the operation start or during operation (QD75 detection errors)  
 These are errors that occur at the operation start or during operation when the positioning control, JOG operation, or inching operation is used. If an axis error occurs during interpolation operation, the error No. will be stored in both the reference axis and the interpolation axis.  
 Note that, in the following cases (a) and (b), the axis error No. will be stored only in the reference axis during analysis of the positioning data set in each point of the positioning start data table.  
 (a) When the interpolation axis is BUSY.  
 (b) When the error occurred in positioning data or parameters unrelated to interpolation control.

If the error occurred at the simultaneous start of a positioning operation, the axis error storage details will differ depending on whether the error occurred before or after the simultaneous start.

≠ If the error occurred before the simultaneous start (illegal axis No., other axis BUSY, etc.), an "error before simultaneous start" will occur.

≠ If the error occurred after the simultaneous start (positioning data error, software stroke limit error, etc.), an error code corresponding to the axis in which the error occurred will be stored. Because a simultaneous start cannot be carried out due to this, a "simultaneous start not possible error" error code will be stored in all axes in which an error has not occurred.

The axis operation status will be displayed as "error occurring" for axes in which an error occurred.

If an error occurs during operation, any moving axes will deceleration stop, and their operation status will be displayed as "error occurring".

All axes will decelerate to a stop during interpolation operations, even if the error occurs in only one axis.

- (3) Servo amplifier detection errors

These are errors that occur at the hardware error such as servo amplifier and servomotor or the servo parameter error.

Servo is turned off at the error occurrence, and axis stop. If you remove an error factor, reset the servo amplifier.

## (4) Types of error codes

Error code	Classification of errors
001 to 009	Fatal errors
100 to 199	Common errors
200 to 299	OPR or absolute position restoration errors
300 to 399	JOG operation or inching operation errors
500 to 599	Positioning operation errors
800 to 899	I/F (Interface) errors
900 to 999	Parameter setting range errors
1201 to 1209	Encoder errors
2000 to 2099	Servo amplifier errors

## ■ Error storage

When an error occurs, the error detection signal turns ON, and the error code corresponding to the error details is stored in the following buffer memory address ( [Md.23] Axis error No.) for axis error No. storage. Note that there is a delay of up to 3.5 ms after the error detection signal turns ON until the error code is stored.

Axis No.	Error detection signal	Buffer memory address
1	X8	806
2	X9	906
3	XA	1006
4	XB	1106

A new error code is stored in the buffer memory address ( [Md.23] Axis error No.) for axis error storage every time an error occurs.

## [2] Warnings

## ■ Types of warnings

Warnings detected by the QD75 include system warnings, axis warnings and warnings detected by servo amplifier.

## (1) Warnings include system warnings.

The types of system warnings are shown below.

⊖ System control data setting warnings

An axis warning for axis 1 will occur.

⊖ Positioning data setting warnings

An axis warning for each axis will occur.

Note that a warning will occur for the reference axis when an interpolation designation or axis setting warning occurs.

## (2) Warnings include axis warnings.

⊖ Axis warnings occur due to setting warnings from operations such as positioning operations, JOG operations or manual pulse generator operations.

⊖ Axis warnings occur due to system warnings.

The axis operation status does not change even if an axis warning occurs.

## (3) Servo amplifier detection warnings

These are warning that occur at the hardware error such as servo amplifier and servomotor or the inapplicable servo parameters.

Error or normality operation can't be executed by warning when warning is left as it is though servo off isn't executed.

If you remove a warning factor, reset the servo amplifier.

## (4) Types of warning codes

Warning code	Classification of warnings
100 to 199	Common warnings
300 to 399	JOG operation warnings
400 to 499	Manual pulse generator operation warnings
500 to 599	Positioning operation warnings
900 to 999	System control data setting range check warnings
2090 to 2999	Servo amplifier warnings (The contents of a vary in the model of servo amplifier.)

### ■ Warning storage

- (1) When an axis warning occurs, the warning code corresponding to the warning details is stored in the following buffer memory ( [Md.24](#) Axis warning No.) for axis warning No. storage.

Axis No.	Buffer memory address
1	807
2	907
3	1007
4	1107

- (2) When an axis warning occurs in a positioning operation, etc., "1" is set in bit 9 (b9) of the following buffer memory ( [Md.31](#) Status) for axis status storage.

Axis No.	Buffer memory address
1	817
2	917
3	1017
4	1117

### [3] Resetting errors and warnings

An error or warning state is canceled after the following processing has been carried out by setting a "1" in the address [1502 (for axis 1)], [1602 (for axis 2)], [1702 (for axis 3)], and [1802 (for axis 4)] of the buffer memory for axis error resetting ( [Cd.5](#) Axis error reset).

- € Axis error detection signal turned OFF
- € "[Md.23](#) Axis error No." cleared
- € "[Md.24](#) Axis warning No." cleared
- € Changing of "[Md.26](#) operation status" from "Error" to "Standby".
- € "[Md.31](#) Axis warning detection (b9)" turned OFF

#### [4] Invalid operations

For the following operations, the setting details will be invalidated, and an error or warning will not occur.

- ⊖ Speed change during machine OPR
- ⊖ Speed change before operation  
(Speed override change, skip command, continuous operation interruption request, target position change request)
- ⊖ Axis stop during axis stop
- ⊖ Axis sudden stop during axis stop
- ⊖ Axis stop before axis operation
- ⊖ Axis sudden stop before axis operation
- ⊖ Writing to the buffer memory monitoring area

#### [5] Confirming the error and warning definitions

The error and warning definitions can be confirmed with the error and warning codes. Confirming them requires GX Developer or GX Configurator-QP. For details, refer to GX Developer Operating Manual or GX Configurator-QP Operating Manual. (Refer to Section 15.2 and Section 15.3 for details of the error and warning codes.)



15.2 List of errors

The following table shows the error details and remedies to be taken when an error occurs.

15.2.1 QD75 detection error

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
—	000	(Normal status)	—	—
Fatal errors	001	Fault	Hardware fault.	The system stops.
	002	Internal circuit fault		
Common errors	101	PLC READY signal OFF during operation	The PLC READY signal (Y0) is turned OFF during operation.	The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 Sudden stop selection (stop group 2). (Note that the deceleration stop only occurs during the manual pulse generator operation.)
	102	Servo READY signal OFF during operation	The Servo READY signal is turned OFF during operation.	The system stops immediately.
	103	Test mode faults during operation	The personal computer cannot communicate with the CPU unit.	The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 Sudden stop selection (stop group 2). (Note that the deceleration stop only occurs during the manual pulse generator operation.)
	104	Hardware stroke limit (+)	The hardware stroke limit (upper limit signal FLS) is input turned OFF.	The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 Sudden stop selection (stop group 1). (Note that the deceleration stop only occurs during the manual pulse generator operation.)
	105	Hardware stroke limit (-)	The hardware stroke limit (lower limit signal RLS) is input turned OFF.	
	106	Stop signal ON at start	Start is requested when a stop signal is turned ON.	The system does not start positioning.
	107	READY OFF → ON during BUSY signal	The PLC READY signal is turned from OFF to ON when BUSY signal is turned ON.	• The QD75 READY signal (X0) is not turned ON.
	108	Impossible to start	Start is requested when start is not possible in the axis operation state.	The system does not start positioning.

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—	—	—	—
—	—	—	—	—	—	<ul style="list-style-type: none"> <li>• Check that there is no influence from noise.</li> <li>• Check hardware for possibility of fault.</li> </ul>
—	—	—	—	—	—	<ul style="list-style-type: none"> <li>• Review the PLC program which turns ON/OFF PLC READY signal (Y0).</li> <li>• Cancel the error with an axis error reset. (Refer to Section 15.1[3])</li> </ul>
—	—	—	—	—	—	Check the servo amplifier power, wiring with the servo amplifier, and connection of connectors, and cancel the error with an axis error reset. (Refer to Section 15.1[3])
—	—	—	—	—	—	<ul style="list-style-type: none"> <li>• Check that there is no error on the personal computer side I/F to which a cable is connected.</li> <li>• Change the transmission speed (serial communication baud rate selection) between the personal computer and the QD75. (Refer to Section 5.2.9 [Pr.133] )</li> </ul>
—	—	—	—	—	—	After making an axis error reset (refer to [3] in Section 15.1), perform manual control operation (refer to Chapter 11) to move the axis to the other position in order that the upper limit signal (FLS) will turn ON.
—	—	—	—	—	—	After making an axis error reset (refer to [3] in Section 15.1), perform manual control operation (refer to Chapter 11) to move the axis to the other position in order that the lower limit signal (RLS) will turn ON.
—	—	—	—	—	—	<p>Check whether the stop commands (output signals/external inputs to QD75) are turned ON or OFF. Turn OFF the ON commands.</p> <ul style="list-style-type: none"> <li>• Output signals to QD75 Axis 1: Y4, Axis 2: Y5, Axis 3: Y6, Axis 4: Y7</li> <li>• External input Connectors for external device connection: Stop signals (STOP)</li> </ul> <p>After confirming the stop command status, cancel the error with an axis error reset. Then turn ON a start signal. (Refer to Section 15.1[3])</p>
—	—	—	—	—	—	The PLC READY signal (Y0) is turned from OFF to ON when all BUSY signal is turned OFF.
—	—	—	—	—	—	Do not request the start when the axis operation state is other than "standby", "stop", and "step standby".

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Home position return (OPR) or absolute position restoration errors	201	Start at home position (OP) fault	When the machine home position return (OPR) retry invalid is set, the near-point dog home position return (OPR) is started with the home position return (OPR) complete flag turned ON.	The machine home position return (OPR) is not started.
	203	Dog detection timing fault	The near-point dog signal is turned OFF during the deceleration from a home position return (OPR) speed to a creep speed by the near-point dog home position return (OPR).	The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 Sudden stop selection (stop group 3). (Note that the deceleration stop only occurs during the manual pulse generator operation.)
	204	Home position (OP) detection timing fault	The zero signal is turned OFF during the deceleration from a home position return (OPR) speed to a creep speed by the stopper method 2) - home position return (OPR).	
	205	Dwell time fault	A dwell time is passed during the deceleration from a creep speed to a home position return (OPR) speed by the stopper method 1) - home position return (OPR).	
	206	Count method movement amount fault	In the count method 1) and 2) – machine home position return (OPR), a parameter "Setting of movement amount after near-point dog ON" is smaller than a distance necessary for deceleration stop from a home position return (OPR) speed.	The machine home position return (OPR) is not started.
	207	Home position return (OPR) request flag ON	The OPR request flag is turned ON when a fast - home position return (OPR) is started (positioning start No. 9002).	The fast - home position return (OPR) is not started.
	209	Home position return (OPR) restart not possible	The restart command is turned ON after the machine home position return (OPR) is stopped using a stop signal.	The restart is not carried out.
	210	Home position return (OPR) restart zero point not passed	The zero point is not passed when the dog or count method home position return (OPR) is re-started, or data set method home position return (OPR) is made.	The home position return (OPR) is not completed.
	211	ZCT read error	The data is not loaded from the servo amplifier properly upon the home position return (OPR).	
	212	ABS reference point read error	The data is not loaded from the servo amplifier properly upon the home position return (OPR).	The absolute position restoration is not carried out.
	213	ABS transmission time	Communication cannot be carried out with the servo-amplifier using an absolute position restoration instruction.	
214	ABS transmission SUM			

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
78	228	378	528		<OPR retry> 0, 1	<ul style="list-style-type: none"> <li>• Validate the home position return (OPR) retry function (set value: 1). (Refer to Section 12.2.1)</li> <li>• Move the workpiece from the current position (on home position (OP) ) using the manual control operation (refer to chapter 11), then carry out an original position return again.</li> </ul>
74 75	224 225	374 375	524 525		<OPR speed> 1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	<ul style="list-style-type: none"> <li>• Lower the home position return (OPR) speed.</li> <li>• Increase the dog signal input time. (Refer to Section 8.2.3)</li> </ul>
74 75	224 225	374 375	524 525			<ul style="list-style-type: none"> <li>• Lower the home position return (OPR) speed.</li> <li>• Input external zero signals during the movement at a creep speed. (Refer to Section 8.2.5)</li> </ul>
74 75	224 225	374 375	524 525			<ul style="list-style-type: none"> <li>• Lower the home position return (OPR) speed.</li> </ul>
79	229	379	529		<OPR dwell time> 0 to 65535	<ul style="list-style-type: none"> <li>• Increase the OPR dwell time. (Refer to Section 8.2.4)</li> </ul>
80 81	230 231	380 381	530 531		<Movement amount setting after near-point dog ON> 0 to 2147483647	<ul style="list-style-type: none"> <li>• Calculate the movement distance using a speed limit, home position return (OPR) speed, and deceleration time, and set the movement amount after near-point dog ON so that the distance becomes a deceleration distance or longer.</li> <li>• Lower the home position return (OPR) speed.</li> <li>• Adjust the near-point dog position so that the movement amount after near-point dog ON becomes longer. (Refer to Section 8.2.7, 8.2.8)</li> </ul>
74 75	224 225	374 375	524 525		<OPR speed> 1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min]	
1500	1600	1700	1800		<Positioning start No.> 1 to 600 7000 to 7004 9001 to 9004	Execute the machine home position return (OPR) (positioning No. 9001). (Refer to Section 8.2)
1500	1600	1700	1800		<Positioning start No.> 1 to 600 7000 to 7004 9001 to 9004	Start the machine home position return (OPR) (positioning start No. 9001) again. (Refer to Section 8.2)
—	—	—	—		—	Turn the motor more than one revolution using JOG or positioning operation.
—	—	—	—		—	Execute the home position return (OPR) again.
—	—	—	—		—	Execute the home position return (OPR) again.
—	—	—	—		—	<ul style="list-style-type: none"> <li>• Review the wiring. (Refer to Section 12.6)</li> <li>• Review the PLC program.</li> </ul>
—	—	—	—		—	<ul style="list-style-type: none"> <li>• Review the wiring. (Refer to Section 12.6)</li> <li>• Review the PLC program.</li> <li>• Review the dedicated instruction parameters. (Refer to Section 14.3)</li> </ul>

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
JOG operation or inching operation errors	300	Outside JOG speed range	At the time of JOG starting, the JOG speed comes out of a specified range.	The JOG operation is not carried out when the JOG speed is outside the setting range at the time of JOG start.
	301	Inching movement amount error	The inching movement amount exceeds the JOG speed limit.	The inching operation is not carried out when the inching movement amount exceeds a JOG speed limit at the time of inching start.
Positioning operation errors	500	Illegal condition data No.	The condition data No. is outside the setting range when a block using the condition data is started by a special starting (conditional start, wait start, simultaneous start, FOR (condition)). (1 ≤ Condition data No. ≤ 10)	The operation is terminated.
	501	Error before simultaneous start	<p>&lt;When blocks are started simultaneously&gt;</p> <ul style="list-style-type: none"> <li>The partner axis for simultaneous start is BUSY.</li> </ul> <p>&lt;When multiple axes are started and controlled simultaneously&gt;</p> <ul style="list-style-type: none"> <li>The partner axis for simultaneous start is BUSY.</li> <li>The "Simultaneous start axis start data No." of the start axis is 0 or is outside the setting range.</li> <li>The "Simultaneous start axis start data No." of those axes other than the start axis is outside the setting range.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops immediately.</p>
	502	Illegal data No.	<ul style="list-style-type: none"> <li>The positioning data No. tried to be executed is outside the ranges of 1 to 600, 7000 to 7004, and 9001 to 9004.</li> <li>The designation of a JUMP destination is executed currently.</li> <li>The designation of a JUMP destination is outside the ranges of 1 to 600.</li> </ul>	The positioning data is not executed.
	503	Command speed is not set	<ul style="list-style-type: none"> <li>At the start of positioning, a current speed (-1) is set for the command speed of the positioning data to be initially executed.</li> <li>The current speed is set by speed control.</li> <li>The current speed is set for speed-position switching control.</li> </ul>	At the start of positioning, operation does not start.

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
1518 1519	1618 1619	1718 1719	1818 1819		<JOG speed> 1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	Bring JOG speed into the setting range. (Refer to Section 11.2)
1517	1617	1717	1817		<Inching movement amount> 0 to 65535	Reduce the inching movement amount. (Refer to Section 11.3)
Refer to Section 5.4 "List of block start data"					<Condition data No.> 1 to 10	Review the condition data No. (Refer to Section 5.4 [Da.14] )
Refer to Section 5.5 "List of condition data"					<Condition operators> Axis designation: 10H, 20H, 30H, 40H, 50H, 60H, 70H, 80H, 90H, A0H, B0H, C0H, D0H, E0H	Review the simultaneous start axis start data No. . (Refer to Section 5.5 [Da.16] )
1540	1640	1740	1840	Axis 1 start data No.	Simultaneous start axis start data No.  0 to 600	Review the simultaneous start axis start data No. to correct value. (Refer to Section 10.5)
1541	1641	1741	1841	Axis 2 start data No.		
1542	1642	1742	1842	Axis 3 start data No.		
1543	1643	1743	1843	Axis 4 start data No.		
1500	1600	1700	1800		<Positioning start No.> 1 to 600, 7000 to 7004, 9001 to 9004	Review the positioning start No., positioning start data (in block start), and positioning data (in JUMP instruction) to correct value.
Refer to Section 5.3 "List of positioning data"					<JUMP destination> 1 to 600	
Refer to Section 5.3 "List of positioning data"					<Command speed> 1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	Review the positioning data to correct value.

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Positioning operation errors	504	Outside linear movement amount range	<ul style="list-style-type: none"> <li>When the parameter "interpolation speed designation method" performs a linear interpolation in setting a "composite speed", the axis movement amount for each positioning data exceeds <math>1073741824(2^{30})</math>.</li> <li>The positioning address is <math>-360.00000</math> or less or <math>360.00000</math> or more using INC instruction, where the control unit is set to "degree" and software stroke limit upper limit is not equal to the software stroke limit lower limit.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops immediately.</p>
	506	Outside circular interpolation error allowable limit	When an arc is interpolated by the designation of the center point, a difference between a radius of start point-center point and a radius of end point-center point exceeds the parameter "Circular interpolation error allowable limit".	<p>At start: The circular interpolation control by center point designation is not executed.</p> <p>During operation : The system will stop immediately.</p>

Related buffer memory address				Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4		
Refer to Section 5.3 "List of positioning data"				<Positioning address/movement amount> • ABS unit [mm] [PLS] [inch] -2147483648 to 2147483647 Unit [degree] 0 to 35999999 • INC (When software stroke limits are valid) Unit [degree]: -35999999 to 35999999 Unit [mm], [PLS], [inch]: -2147483648 to 2147483647 (When software stroke limits are invalid) -2147483648 to 2147483647 • Speed-position switching INC mode: 0 to 2147483647 ABS mode: 0 to 35999999 • Position-speed switching 0 to 2147483647 <Arc address> -2147483648 to 2147483647	Review the positioning address.  • Center point address (positioning address) } Correct. • End address (arc address)
				60 61	210 211



Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Positioning operation errors	507	Software stroke limit+	<ul style="list-style-type: none"> <li>Positioning is carried out at a position beyond the software stroke limit upper limit.</li> <li>The positioning address and new current value exceed the software stroke limit upper limit.</li> <li>In the circular interpolation by the designation of the sub points, the sub points exceed the software stroke limit upper limit.</li> </ul>	At start: The system will not operate. In the analysis of new current value: Current value is not changed. During operation: <ul style="list-style-type: none"> <li>The system stops immediately when the positioning address during position control (including position control in speed-position switching control or position-speed switching control) is switched to the data outside the software stroke limit range.</li> </ul>
	508	Software stroke limit-	<ul style="list-style-type: none"> <li>Positioning is carried out at a position beyond the software stroke limit lower limit.</li> <li>The positioning address and new current value exceed the software stroke limit lower limit.</li> <li>In the circular interpolation by the designation of the sub points, the sub points exceed the software stroke limit lower limit.</li> </ul>	<ul style="list-style-type: none"> <li>The system makes a stop at the setting (normal deceleration stop only) of sudden stop selection (stop group 3) in the detailed parameter 2 when the current feed value or machine feed value during speed control (including speed control in speed-position switching control or position-speed switching control) or during manual control falls outside the software stroke limit range.</li> </ul>
	514	Outside new current value range	The new current address is outside the ranges of 0 to 359.99999, where the control unit is set to "degree".	
	515	New current value invalid	<ul style="list-style-type: none"> <li>The control system sets an operation pattern (continuous path control) using new current positioning data.</li> <li>The operation pattern sets a "new current value" in the control system using the data following the "continuous path control" positioning data.</li> </ul>	The current value is not changed.
	516	Continuous path control invalid	<ul style="list-style-type: none"> <li>The continuous path control is designated using a control system which is not allowed to use for continuous path control such as speed control, speed-position switching control, position-speed switching control, and fixed-feed.</li> <li>The previous data such as those on speed control, speed-position switching control, position-speed switching control, and fixed-feed shows a continuous path control.</li> <li>The continuous positioning control is designated for speed control or position-speed switching control.</li> </ul>	At start, the system will not operate.

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
New current value						<p>At start: Bring the current feed value into the software stroke limit using the manual control operation. (Refer to Chapter 11) Correct the positioning address (Also check the arc address in circular interpolation with sub points designated).</p>
1506 1507	1606 1607	1706 1707	1806 1807			
Software stroke limit upper limit						
18 19	168 169	318 319	468 469	<p>&lt;New current value&gt; &lt;Software stroke upper and lower limits&gt;</p> <ul style="list-style-type: none"> <li>• [mm] [inch] [PLS] -2147483648 to 2147483647</li> <li>• [degree] 0 to 35999999</li> </ul>	<p>New current value: Bring the new current value into the software stroke limit. (Refer to Section 9.2.19)</p> <p>During operation: Correct the positioning address. (For the positioning and arc addresses, refer to <a href="#">Da.6</a> and <a href="#">Da.7</a> in Section 5.3.)</p>	
Software stroke limit lower limit						
20 21	170 171	320 321	470 471			
1506 1507	1606 1607	1706 1707	1806 1807	<New current value> [degree] 0 to 35999999	Bring the new current value into the setting range. (Refer to Section 9.2.19)	
Refer to Section 5.3 "List of positioning data"					<p>&lt;Control system&gt; 01H to 1EH, 80H to 84H</p> <ul style="list-style-type: none"> <li>• 03H, 0CH, 17H, 1CH: 1 to 4 axis fixed-feed control</li> <li>• 04H, 05H, 13H, 14H, 18H, 19H, 1DH, 1EH: 1 to 4 axis speed control</li> <li>• 81H: current value changing</li> <li>• Speed-position switching control: 06H, 07H</li> <li>• Position-speed switching control: 08H, 09H</li> </ul> <p>&lt;Operation pattern&gt; 00, 01, 11</p> <ul style="list-style-type: none"> <li>• 01: Continuous positioning control</li> <li>• 11: Continuous path control</li> </ul>	<ul style="list-style-type: none"> <li>• Do not designate a current value changing using the positioning data following the continuous path control.</li> <li>• Do not designate a "current value changing" using the positioning data following the continuous path control. (Refer to Section 9.2.19)</li> </ul>
					<ul style="list-style-type: none"> <li>• Do not designate a speed control, fixed-feed, speed-position switching control, and position-speed switching control using the positioning data following the continuous path control data.</li> <li>• Do not carry out the fixed-feed, speed control, speed-position switching control, and position-speed switching control using the continuous path control operation pattern.</li> <li>• Do not carry out the speed control and position-speed switching control using the continuous path control operation pattern. (Refer to Chapter 9)</li> </ul>	

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Positioning operation errors	518	Outside operation pattern range	<ul style="list-style-type: none"> <li>The operation pattern set value is 2.</li> <li>A target position change is requested on those control systems other than ABS1 and INC1.</li> <li>A target position change is carried out in continuous path control.</li> <li>A changed address is outside the software stroke limit.</li> <li>A target position change is carried out during deceleration stop.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 Sudden stop selection (stop group 3).</p> <p>(Note that the deceleration stop only occurs during the manual pulse generator operation.)</p>
	519	Interpolation while interpolation axis BUSY	Interpolation is started during the operation of the interpolation axis.	
	520	Unit group unmatched	The reference and interpolation axis units are different at the parameter "interpolation speed designation method" setting of "composite speed".	
	521	Illegal interpolation description command	<ul style="list-style-type: none"> <li>The number of axes necessary for interpolation operation is not present in the unit.</li> <li>In 2-axis interpolation, the axis to be interpolated is the self axis or an axis not present.</li> </ul>	
	522	Command speed setting error	<p>The command speed is outside the setting range.</p> <p>Linear interpolation, circular interpolation: Reference axis is outside the setting range.</p> <p>Speed control interpolation: Either of reference axis and interpolation axis is outside the speed range.</p>	
	523	Interpolation mode error	<ul style="list-style-type: none"> <li>For starting, a composite speed is designated in the reference axis parameter "Interpolation speed designation method" using the speed interpolation control or 4-axis linear interpolation control.</li> <li>For starting, a reference axis speed is designated in the reference axis parameter "Interpolation speed designation method" using the circular interpolation control.</li> </ul>	

Related buffer memory address				Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4		
Same as error codes 515 to 516					Correct the operation pattern. (Refer to Section 5.3 <a href="#">Da.1</a> )
					Correct the control system. (Refer to Section 5.3 <a href="#">Da.2</a> )
0	150	300	450	<Unit setting> 0, 1, 2, 3	Correct the positioning data or change the parameter "Unit setting" of the axis to be interpolated. (Refer to Section 9.1.6)
Same as error codes 515 to 516					<ul style="list-style-type: none"> <li>• Correct the control system. (Refer to Section 5.3 <a href="#">Da.2</a> )</li> <li>• Correct the axis to be interpolated. (Refer to Section 5.3 <a href="#">Da.5</a> )</li> </ul>
Command speed storage addresses of positioning data No. 1 to 600				<Command speed> 1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	Correct the command speed. (Refer to Section 5.3 <a href="#">Da.8</a> )
29	179	329	479	<Interpolation speed designation method> 0: Composite speed 1: Reference axis speed	Set the "Interpolation speed designation method" correctly. (Refer to Section 9.1.6)

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Positioning operation errors	524	Control system setting error	<ul style="list-style-type: none"> <li>The control system setting value is outside the specified limit.</li> <li>The number of control axes differs from the previous data when continuous positioning control or continuous path control is to be exercised for continuously.</li> <li>Machine OPR, fast OPR, or speed-position or position-speed switching control was performed in the wiring-less mode.</li> <li>The NOP instruction was set to the control system of positioning data No. 600.</li> <li>Any value other than 0 was set at buffer memory address 1906 (use prohibited area).</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops with the setting (deceleration stop/sudden stop) of the detail parameter 2 Sudden stop selection (stop group 3).</p> <p>(Note that the deceleration stop only occurs during the manual pulse generator operation.)</p>
	525	Sub point setting error	<p>Either of the following applies in the circular interpolation with sub points designated.</p> <ul style="list-style-type: none"> <li>Start point = sub point</li> <li>End point = sub point</li> <li>Start point, end point, and sub point are in line with each other.</li> <li>Sub point and center point are outside the range of -2147483648 to 2147483647.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops immediately.</p>
	526	End point setting error	<ul style="list-style-type: none"> <li>Start point is equal to end point in the circular interpolation with sub points designated.</li> <li>End point address is outside the range of -2147483648 to 2147483647.</li> </ul>	
	527	Center point setting error	<p>In an arc with designated center point, either of the following applies.</p> <ul style="list-style-type: none"> <li>Start point = Center point</li> <li>End point = Center point</li> <li>Center point address is outside the range of -2147483648 to 2147483647.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops immediately.</p>
	530	Outside address range	<ul style="list-style-type: none"> <li>In the speed-position switching control and the position-speed switching control, the setting value of a positioning address is negative.</li> <li>In ABS1, ABS2, ABS3 and ABS4, the setting value of a positioning address is outside the range of 0 to 359.99999 degrees.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system stops immediately with the setting (deceleration stop/sudden stop) of the detailed parameter 2 sudden stop selection (stop group 3).</p> <p>(Note that the deceleration stop only occurs during the manual pulse generator operation.)</p>
	532	Simultaneous start not possible	<p>Among the axes to be started simultaneously, there is an axis on which an error other than this error occurs.</p>	

	Related buffer memory address				Set range (Setting with PLC program)	Remedy
	Axis 1	Axis 2	Axis 3	Axis 4		
	Same as error codes 515 to 516					<ul style="list-style-type: none"> <li>• Correct the control system or parameter. (Refer to section 9.1.6, 9.2.20)</li> <li>• Do not make setting at buffer memory address 1906 (use prohibited area).</li> </ul>
	Refer to Section 5.3 "List of positioning data"				<Positioning address/movement amount> • unit [mm] [PLS] [inch] –2147483648 to 2147483647 (Unit [degree]) cannot be set. <Arc address> –2147483648 to 2147483647	Correct the sub address (arc address). (Refer to Section 9.2.10)
						Correct the end address (positioning address). (Refer to Section 9.2.10)
	Same as in error codes 525 to 526.					Correct the center point address (arc address). (Refer to Section 9.2.11)
	Same as in error codes 504, 506.					Correct the positioning address. (Refer to Section 9.2.16, 9.2.17, 9.2.18)
	Refer to Section 5.3 "List of positioning data" and Section 5.4 "Block start data"				—	In the error history, check the axis where the error other than this error occurred, and remove the error factor. Correct the block start data and positioning data.

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Positioning operation errors	533	Condition data error	<ul style="list-style-type: none"> <li>The condition setting values are not set or outside the setting range.</li> <li>The condition operator setting values are not set or outside the setting range.</li> <li>The condition operator is a bit operator, and the parameter 1 is 32 or more.</li> <li>An unusable condition operator is set for the set condition.</li> <li>The conditional operator is the range operator and parameter 1 is greater than parameter 2.</li> </ul>	The operation is terminated.
	534	Special start instruction error	<ul style="list-style-type: none"> <li>The partner axis designation for simultaneous start includes the self-axis.</li> <li>No applicable special start instruction is present.</li> </ul>	
	535	Circular interpolation not possible	Circular interpolation is carried out on an axis in the unit of degree.	
	536	M code signal ON at positioning start	The positioning start is carried out when an M code ON signal (X4 to X7) is turned ON.	At start, the system will not operate.
	537	PLC READY signal OFF at positioning start	The positioning start is carried out when the PLC READY signal (Y0) is turned OFF.	
	538	READY signal OFF at positioning start	The positioning start is carried out when the QD75 READY signal (X0) is turned OFF.	
	543	Outside start No. range	<ul style="list-style-type: none"> <li>At the start of positioning, the setting value of the "positioning start No." of the axis control data is outside the ranges of 1 to 600, 7000 to 7004, and 9000 to 9004.</li> <li>At a Pre-reading start, the "positioning start No." setting of the axis control data is other than 1 to 600.</li> </ul>	
	544	Outside radius range	The arc radius exceeds 536870912.	At start: The system will not operate. During operation: The system stops immediately.
	545	Control system LOOP setting error	A "0" is set in the control system "LOOP".	The operation is terminated.

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
Refer to Section 5.4 "Block start data"					—	Normalize the block start data.
					<Special start instruction> 00H to 06H	Correct the instruction code of the special start data. (Refer to Section 5.4 <a href="#">Da.13</a> )
Refer to Section 5.3 "List of positioning data"					—	Correct the control system. (Refer to Section 5.3 <a href="#">Da.2</a> )
1504	1604	1704	1804	<M code OFF request> 1: M code ON signal is turned OFF	After turning OFF the M code ON signal, start the system. (Refer to Section 12.7.3)	
—	—	—	—	—	Check the PLC program which turns ON/OFF the PLC READY signal (Y0), and turn ON the PLC READY signal. Then start the system.	
—	—	—	—	—	Check the QD75 READY ON signal, and then start the system. (Refer to Section 3.3.2)	
1500	1600	1700	1800	<Positioning start No.> 1 to 600, 7000 to 7004, 9001 to 9004	Review the positioning start No. to correct value. (Refer to Section 12.7.8)	
Refer to Section 5.3 "List of positioning data"					<Maximum radius> 536870912	Correct the positioning data. (Refer to Section 9.2.10, 9.2.11)
					<LOOP to LEND> 1 to 65535	Set 1 to 65535 in LOOP. (Refer to Section 9.2.22)



Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Positioning operation errors	546	Illegal setting of ABS direction in unit of degree	<p>The setting value of ABS direction in the unit of degree is as follows.</p> <ul style="list-style-type: none"> <li>• Set outside the setting range.</li> <li>• A figure other than "0" is set when the software stroke limit is valid.</li> </ul>	<p>At start: The system will not operate.</p> <p>During operation: The system decelerates to a stop.</p> <p>(Note that, in the continuous positioning control and continuous path control, the system continues operating with the setting set at the time of start even if the setting is changed during the operation.)</p>
I/F errors	800	Hold error	In the PLC CPU unit parameter "Output at error stop", the setting for QD75 is "Hold".	<p>At start: The system will not operate.</p> <p>During operation: The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 sudden stop selection (stop group 3).</p> <p>(Note that the deceleration stop only occurs during the manual pulse generator operation.)</p>
	801	Flash ROM writing error	Data is not written to the flash ROM.	At start: The system will not operate.
	802	Flash ROM sum check error	While data is written to the flash ROM, the power is turned OFF.	
	803	PLC CPU error	The PLC CPU has an error.	<p>At start: The system will not operate.</p> <p>During operation: The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 sudden stop selection (stop group 3).</p> <p>(Note that the deceleration stop only occurs during the manual pulse generator operation.)</p>
	804	Dedicated instruction error	<ul style="list-style-type: none"> <li>• The ABRST□ instruction is executed with the status set to other than 0.</li> <li>• The PSTRT□ instruction is executed with the start No. set to other than 1 to 600, 7000 to 7004 and 9001 to 9004.</li> <li>• The TEACH□ instruction is executed with the teaching data selection set to other than 0 and 1.</li> <li>• The TEACH□ instruction is executed with the positioning data No. set to other than 1 to 600.</li> <li>• The instruction of a non-existent axis is specified by the ABRST□, PSTRT□ or TEACH□ instruction.</li> </ul>	
	805	Flash ROM exceed writing error	Data is written to the flash ROM continuously 25 times or more from the PLC program.	

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
ABS setting direction in the unit of degree					0: Shortcut 1: Clockwise 2: Counterclockwise	<ul style="list-style-type: none"> <li>Set the ABS setting direction in the unit of degree within the setting range.</li> <li>Set "0" when the software stroke limits are valid. (Refer to Section 9.1.5)</li> </ul>
1550	1650	1750	1850			
Software stroke limit upper limit					<ul style="list-style-type: none"> <li>[mm] [inch] [PLS] -2147483648 to 2147483647</li> <li>[degree] 0 to 35999999</li> </ul>	Invalidate the software stroke limit. (To invalidate, set the software stroke limit upper limit value to the software stroke limit lower limit value.) (Refer to Section 9.1.5)
18	168	318	468			
19	169	319	469			
Software stroke limit lower limit						
20	170	320	470			
21	171	321	471			
—	—	—	—	—	—	Clear the setting of the PLC CPU module parameter "Output at error stop". (Refer to "QCPU User's Manual")
—	—	—	—	—	—	Replace the flash ROM with a new one.
1901					<Parameter initialization request> 1: Parameter initialization is requested	Return the parameter to that set at the time of delivery from the plant. (Refer to Section 13.2)
—	—	—	—	—	—	(Refer to "QCPU User's Manual")
—	—	—	—	—	<ABRST□ status> 0: Communication complete (received from the servo amplifier) <PSTRT□ start No.> 1 to 600, 7000 to 7004, 9001 to 9004 <TEACH□ teaching data selection> 0: The current feed value is written to the positioning address. 1: The current feed value is written to the arc address. <TEACH□ positioning data No.> 1 to 600	<ul style="list-style-type: none"> <li>When executing the ABRST□ instruction, set the status to 0 (refer to Section 14.3).</li> <li>When executing the PSTRT□ instruction, set the start No. to within the setting range (refer to Section 14.4).</li> <li>When executing the TEACH□ instruction, set the teaching data selection and positioning data No. to within the setting range (refer to Section 14.5).</li> <li>Do not specify the instruction of a non-existent axis by the ABRST□, PSTRT□ and TEACH□ instructions (refer to Section 14.3 to Section 14.5).</li> </ul>
—	—	—	—	—	—	Review the PLC program so that data is not written continuously to the flash ROM. (Using "[Md.19]" in Section 5.6.1, the number of flash ROM write times can be monitored.)  (If this error has occurred in a proper using method, writing is enabled by resetting the error, switching power OFF, then ON, or resetting the PLC CPU.)

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
I/F errors	806	Dedicated instruction I/F error	Mismatching occurs between the PLC CPU and QD75.	At start: The system will not operate.
Parameter setting range errors	900	Outside unit setting range	The set range of the basic parameter 1 "Unit setting" is outside the setting range.	The QD75 READY signal (X0) is not turned ON.
	901	Outside pulse number per rotation range	The set range of the basic parameter 1 "No. of pulses per rotation" is outside the setting range.	
	902	Outside movement amount per rotation range	The set range of the basic parameter 1 "Movement amount per rotation" is outside the setting range.	
	905	Rotation direction setting error	The set range of the basic parameter 1 "Rotation direction setting" is outside the setting range.	
	906	Outside bias speed range	<ul style="list-style-type: none"> <li>The set range of the basic parameter 1 "Bias speed at start" is outside the setting range.</li> <li>The bias speed exceeds the speed limit.</li> </ul>	
	910	Outside speed limit value range	<ul style="list-style-type: none"> <li>The set range of the basic parameter 2 "Speed limit value" is outside the setting range.</li> <li>The value obtained by the conversion of the speed limit value with respect to the frequency exceeds the maximum output frequency of the unit.</li> <li>The speed limit value is smaller than the OPR speed.</li> </ul>	When the power is turned ON or PLC READY signal (Y0) is turned from OFF to ON: QD75 READY signal (X0) is not turned ON.
	911	Outside acceleration time 0 range	The set range of the basic parameter 2 "Acceleration time 0" is outside the setting range.	At start: The system will not operate.
	912	Outside deceleration time 0 range	The set range of the basic parameter 2 "Deceleration time 0" is outside the setting range.	
	920	Backlash compensation amount error	<p>The calculation result of the following equation is smaller than 0 or larger than 65536.</p> $0 \leq \frac{\text{Pr.11} \times \text{Pr.2}}{\text{Pr.3}} \leq 65536$	The QD75 READY signal (X0) is not turned ON.
921	Software stroke limit upper limit	<ul style="list-style-type: none"> <li>In the unit of degree, the set value of the detailed parameter 1 "Software stroke limit upper limit value" is outside the setting range.</li> <li>In a unit other than degree, the software stroke limit upper limit value is smaller than the software stroke limit lower limit value.</li> </ul>		

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—	—	—	A trouble occurs. Repair.
0	150	300	450	0, 1, 2, 3	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.	
2 3	152 153	302 303	452 453	1 to 20000000		
4 5	154 155	304 305	454 455	1 to 20000000		
1	151	301	451	1,10,100,1000		
6 7	156 157	306 307	456 457	0 [PLS/s] 0 [mm/min or others]	<ul style="list-style-type: none"> <li>• Set the bias speed to not more than "0".</li> <li>• After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.</li> </ul>	
10 11	160 161	310 311	460 461	1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	<ul style="list-style-type: none"> <li>• Set a value which is not less than the home position return (OPR) speed.</li> <li>• After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.</li> </ul>	
12 13	162 163	312 313	462 463	1 to 8388608	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.	
14 15	164 165	314 315	464 465	1 to 8388608		
17	167	317	467	$0 \Omega \frac{\boxed{\text{Pr.11}} \times \boxed{\text{Pr.2}}}{\boxed{\text{Pr.3}}} \Omega 65535$	Correct the parameters. <ul style="list-style-type: none"> <li>• " <math>\boxed{\text{Pr.2}}</math> No. of pulses per rotation",</li> <li>" <math>\boxed{\text{Pr.3}}</math> Movement amount per pulse" and</li> <li>" <math>\boxed{\text{Pr.11}}</math> Backlash compensation amount"</li> </ul> (Refer to Section 5.2.3)	
18 19	168 169	318 319	468 469	<ul style="list-style-type: none"> <li>• [mm] [inch] [PLS] -2147483648 to 2147483647</li> <li>• [degree] 0 to 35999999</li> </ul>	<ul style="list-style-type: none"> <li>• Set the value inside the setting range.</li> <li>• In a unit other than degree, set the setting so that the lower limit value is smaller than the upper limit value.</li> </ul>	

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Parameter setting range errors	922	Software stroke limit under lower limit	<ul style="list-style-type: none"> <li>In case unit is "degree", the set range of the detailed parameter 1 "Software stroke limit lower limit value" is outside the setting range.</li> <li>In case unit is different than "degree", the software stroke limit upper limit value is smaller than the software stroke limit lower limit value.</li> </ul>	The QD75 READY signal (X0) is not turned ON.
	923	Software stroke limit selection error	The set range of the detailed parameter 1 "Software stroke limit selection" is outside the setting range.	
	924	Software stroke limit valid/invalid setting error	The set range of the detailed parameter 1 "Software stroke limit valid/invalid setting" is outside the setting range.	
	925	Command in-position width error	The set range of the detailed parameter 1 "Command in-position width" is outside the setting range.	
	926	Illegal torque limit setting value error	The set range of the detailed parameter 1 "Torque limit setting value" is outside the setting range.	
	927	M code ON timing error	The set range of the detailed parameter 1 "M code ON signal output timing" is outside the setting range.	
	928	Speed switching mode error	The set range of the detailed parameter 1 "Speed switching mode" is outside the setting range.	
	929	Interpolation speed designation method error	The set range of the detailed parameter 1 "Interpolation speed designation method" is outside the setting range.	
	930	Current value update request error	The set range of the detailed parameter 1 "Current feed value during speed control" is outside the setting range.	
	932	Manual pulse generator input mode error	The set range of the detailed parameter 1 "Manual pulse generator input selection" is outside the setting range.	
	935	Speed-position function selection error	The detailed parameter 1 "speed-position function selection" is preset to 2 and the following three conditions are not satisfied: 1) Unit is "degree". 2) Software stroke limits are invalid. 3) Update current feed value.	
	950	Acceleration time 1 setting error	The set range of the detailed parameter 2 "Acceleration time 1" is outside the setting range.	At start: The system will not operate.
	951	Acceleration time 2 setting error	The set range of the detailed parameter 2 "Acceleration time 2" is outside the setting range.	During operation: The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 sudden stop selection (stop group 3).
	952	Acceleration time 3 setting error	The set range of the detailed parameter 2 "Acceleration time 3" is outside the setting range.	
953	Deceleration time 1 setting error	The set range of the detailed parameter 2 "Deceleration time 1" is outside the setting range.	(Note that the deceleration stop only occurs during the manual pulse generator operation.)	

	Related buffer memory address				Set range (Setting with PLC program)	Remedy
	Axis 1	Axis 2	Axis 3	Axis 4		
	20 21	170 171	320 321	470 471	<ul style="list-style-type: none"> <li>• [mm] [inch] [PLS] -2147483648 to 2147483647</li> <li>• [degree] 0 to 35999999</li> </ul>	<ul style="list-style-type: none"> <li>• In case unit is "degree" set the value inside the setting range.</li> <li>• In case unit is different than "degree", set so that the lower limit value is smaller than the upper limit value.</li> </ul>
	22	172	322	472	0, 1	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.
	23	173	323	473	0, 1	
	24 25	174 175	324 325	474 475	1 to 2147483647	
	26	176	326	476	1 to 500	
	27	177	327	477	0, 1	
	28	178	328	478	0, 1	
	29	179	329	479	0, 1	
	30	180	330	480	0, 1, 2	
	33	—	—	—	0, 1, 2, 3	
	34	184	334	484	0, 2	Speed-position switching control (ABS mode) should satisfy the conditions 1) to 3) given on the left. When speed-position switching control (ABS mode) is not used, set 0 to speed-position function selection and turn the PLC READY signal (Y0) from OFF to ON.
	36 37	186 187	336 337	486 487	1 to 8388608	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.
	38 39	188 189	338 339	488 489	1 to 8388608	
	40 41	190 191	340 341	490 491	1 to 8388608	
	42 43	192 193	342 343	492 493	1 to 8388608	

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Parameter setting range errors	954	Deceleration time 2 setting error	The set range of the detailed parameter 2 "Deceleration time 2" is outside the setting range.	At start: The system will not operate. During operation: The system stops with the setting (deceleration stop/sudden stop) of the detailed parameter 2 Sudden stop selection (stop group 3). (Note that the deceleration stop only occurs during the manual pulse generator operation.)
	955	Deceleration time 3 setting error	The set range of the detailed parameter 2 "Deceleration time 3" is outside the setting range.	
	956	JOG speed limit value error	<ul style="list-style-type: none"> <li>The set range of the detailed parameter 2 "JOG speed limit value" is outside the setting range.</li> <li>The set range of the detailed parameter 2 "JOG speed limit value" exceeds the speed limit.</li> </ul>	
	957	JOG acceleration time selection setting error	The set range of the detailed parameter 2 "JOG acceleration time selection setting" is outside the setting range.	
	958	JOG deceleration time selection setting error	The set range of the detailed parameter 2 "JOG deceleration time selection setting" is outside the setting range.	
	959	Acceleration/ deceleration process selection setting error	The set range of the detailed parameter 2 "Acceleration/deceleration process selection setting" is outside the setting range.	
	960	S-pattern ratio setting error	The set range of the detailed parameter 2 "S-pattern ratio" is outside the setting range.	
	961	Illegal sudden stop deceleration time	The set range of the detailed parameter 2 "Sudden stop deceleration time" is outside the setting range.	
	962	Stop group 1 sudden stop selection error	The set range of the detailed parameter 2 "Stop group 1 sudden stop selection" is outside the setting range.	
	963	Stop group 2 sudden stop selection error	The set range of the detailed parameter 2 "Stop group 2 sudden stop selection" is outside the setting range.	
	964	Stop group 3 sudden stop selection error	The set range of the detailed parameter 2 "Stop group 3 sudden stop selection" is outside the setting range.	
	966	Outside allowance circular interpolation error width	The set range of the detailed parameter 2 "Allowance circular interpolation error width" is outside the setting range.	
	967	External command function selection error	The set range of the detailed parameter 2 "External command function selection" is outside the setting range.	
	970	Restart allowable range error	The set range of the detailed parameter 2 "Restart allowable value setting range of the servo ON to OFF" is outside the setting range.	The QD75 READY complete flag is not turned ON.

		Related buffer memory address				Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4				
44 45	194 195	344 345	494 495		1 to 8388608	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.	
46 47	196 197	346 347	496 497		1 to 8388608		
48 49	198 199	348 349	498 499		1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	<ul style="list-style-type: none"> <li>• After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.</li> <li>• Change the setting into the speed limit value or below.</li> </ul>	
50	200	350	500		0, 1, 2, 3	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.	
51	201	351	501		0, 1, 2, 3		
52	202	352	502		0, 1		
53	203	353	503		1 to 100		
54 55	204 205	354 355	504 505		1 to 8388608		
56	206	356	506		0, 1		
57	207	357	507		0, 1		
58	208	358	508		0, 1		
60 61	210 211	360 361	510 511		0 to 10000		
62	212	362	512		0, 1, 2, 3		
64 65	214 215	364 365	514 515		0 to 163840		



Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Parameter setting range errors	980	Home position return (OPR) method error	The set range of the home position return (OPR) basic parameter "Home position return (OPR) method" is outside the setting range.	The QD75 READY signal (X0) is not turned ON.
	981	Home position return (OPR) direction error	The set range of the home position return (OPR) basic parameter "Home position return (OPR) direction" is outside the setting range.	
	982	Home position (OP) address setting error	The set range of the home position return (OPR) basic parameter "Home position (OP) address" is outside the setting range.	
	983	Home position return (OPR) speed error	<ul style="list-style-type: none"> <li>The set range of the home position return (OPR) basic parameter "Home position return (OPR) speed" is outside the setting range.</li> <li>The set range of the home position return (OPR) basic parameter "Home position return (OPR) speed" is smaller than the bias speed at start.</li> </ul>	
	984	Creep speed error	<ul style="list-style-type: none"> <li>The set range of the home position return (OPR) basic parameter "Creep speed" is outside the setting range.</li> <li>The set range of the home position return (OPR) basic parameter "Creep speed" is larger than the home position return (OPR) speed.</li> <li>The set range of the home position return (OPR) basic parameter "Creep speed" is smaller than the bias speed at start.</li> </ul>	
	985	Home position return (OPR) retry error	The set range of the home position return (OPR) basic parameter "Home position return (OPR) retry" is outside the setting range.	
	990	Home position return (OPR) error	The set range of the home position return (OPR) detailed parameter "Home position return (OPR)" is outside the setting range.	
	991	Setting for the movement amount after near-point dog ON error	The set range of the home position return (OPR) detailed parameter "Setting for the movement amount after near-point dog ON" is outside the setting range.	
	992	Home position return (OPR) acceleration time selection error	The set range of the home position return (OPR) detailed parameter "Home position return (OPR) acceleration time selection" is outside the setting range.	
	993	Home position return (OPR) deceleration time selection error	The set range of the home position return (OPR) detailed parameter "Home position return (OPR) deceleration time selection" is outside the setting range.	

Related buffer memory address				Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4		
70	220	370	520	0, 1, 4, 5, 6	After setting the value inside the setting range, turn the PLC READY signal [Y0] from OFF to ON.
71	221	371	521	0, 1	
72 73	222 223	372 373	522 523	• [mm] [inch] [PLS] -2147483648 to 2147483647 • [degree] 0 to 35999999	
74 75	224 225	374 375	524 525	1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	<ul style="list-style-type: none"> <li>Set the value inside the setting range.</li> <li>Set the speed to the bias speed at start or higher. (Refer to Section 5.2.5)</li> </ul>
76 77	226 227	376 377	526 527	1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or others]	<ul style="list-style-type: none"> <li>Set the value inside the setting range.</li> <li>Set the speed to that below the home position return (OPR) speed.</li> <li>Set the value to the bias speed at start or higher. (Refer to Section 5.2.5)</li> </ul>
78	228	378	528	0, 1	Home position return (OPR), turn the PLC READY signal [Y0] from OFF to ON.
79	229	379	529	0 to 65535	
80 81	230 231	380 381	530 531	0 to 2147483647	
82	232	382	532	0, 1, 2, 3	
83	233	383	533	0, 1, 2, 3	

Classification of errors	Error code	Error name	Error	Operation status at error occurrence
Encoder errors	995	Home position return (OPR) torque limit value error	<ul style="list-style-type: none"> <li>The set range of the home position return (OPR) detailed parameter "Home position return (OPR) torque limit value" is outside the setting range.</li> <li>The home position return (OPR) detailed parameter "Home position return (OPR) torque limit value" has exceeded the detailed parameter 1 "Torque limit setting value".</li> </ul>	The QD75 READY signal (X0) is not turned ON.
	997	Speed designation during home position (OP) shift error	The set range of the home position return (OPR) detailed parameter "Speed designation during home position (OP) shift" is outside the setting range.	Continue the operation.
	1201	Home position return (OPR) data incorrect	The backup data for absolute position restoration is illegal.	
	1203	Encoder error 1	The change amount of the encoder current value during operation is shown below. "Change amount of the encoder current value/ 3.5 [ms] > Motor 180° " Check any time (both servo ON/OFF) after the servo amplifier is turned ON.	
	1204	Encoder error 2	The following equation is established during operation. "Encoder current value (encoder raw data) [PLS] ≠ Feedback current value (data inside servo amplifier) [PLS] (number of encoder significant bits)" Check any time (both servo ON/OFF) after the servo amplifier is turned ON.	

Related buffer memory address				Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4		
86	236	386	536	1 to 300	Home position return (OPR), turn the PLC READY signal [Y0] from OFF to ON.
88	238	388	538	0, 1	
—	—	—	—	—	Execute the home position return (OPR).
—	—	—	—	—	<ul style="list-style-type: none"> <li>• Check the servomotor and encoder cable.</li> <li>• Take measures against noise.</li> </ul>
—	—	—	—	—	<ul style="list-style-type: none"> <li>• Check the servomotor and encoder cable.</li> <li>• Take measures against noise.</li> <li>• Check whether the rotation direction ( [Pr.107] Rotation direction selection ) is set "0 → 1" or "1 → 0" by PLC program or GX-configurator-QP. (Refer to Section 14.5 "PFWRT" precaution (6). )</li> </ul>

15.2.2 MR-H-BN detection error

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2010	10	Under voltage	The power supply voltage to drop.	The power supply voltage is low.	
					For MR-H700BN or less: There was an instantaneous control power failure of 15ms or longer.	
					For MR-H11KBN or less: There was an instantaneous control power failure of 10ms or longer.	
					Shortage of power supply capacity caused the power supply voltage to drop at start, etc. .	
					Power was restored after the bus voltage had dropped to 200VDC. (Main circuit power switched on within 5s after it had switched off.)	
						Faulty parts in the servo amplifier.
	2012	12	Memory error 1	ROM or RAM memory error.	Faulty parts in the servo amplifier.	
	2013	13	Clock error	Printed circuit board fault.		
	2014	14	Watchdog error	CPU parts of the circuit fault.		
	2015	15	Memory error 2	EED-ROM error.		
	2016	16	Encoder error 1	Communication error occurred between encoder and servo amplifier.	The encoder connector is disconnected.	
					Fault in the encoder.	
					Encoder cable fault. (Wire breakage or shot)	
					Improper motor was connected with servo amplifier.	
	2017	17	Board error 2	CPU or parts of the circuit fault.	Faulty parts in the servo amplifier.	
2019	19	Memory error 3	Flash memory error.			
2020	1A	Servomotor combination error	Servomotor and servo amplifier combination	When using servomotor, improper motor was connected with servo amplifier.		
2020	20	Encoder error 2	Communication error occurred between encoder and servo amplifier.	The encoder connector is disconnected.		
				Fault in the encoder.		
				Encoder cable fault. (Wire breakage or shot)		
2024	24	Motor output side ground fault	Servomotor output (U, V, W phase) ground fault.	Power input cable and servomotor output cable are making contact at the main circuit terminal block(TE1).		
				Servomotor power cable insulation deteriorated.		

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Reconsider the power supply voltage.
	—	—	—	—	Alarm (A.10) occurs if interface unit is changed.	Change the servo amplifier.
	—	—	—	—	Alarm (any of A.12 to 15) occurs if power is switched on after disconnection of all cables but the control circuit power supply cables.	Change the servo amplifier.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the servomotor.
	—	—	—	—		Repair or change the cable.
	—	—	—	—		Use correct combination.
	—	—	—	—	Alarm (A.17, A.19) occurs if interface unit is changed.	Change the servo amplifier.
	—	—	—	—		Use correct combination.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the servomotor.
	—	—	—	—		Repair or change the cable.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the cable.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2025	25	Absolute position lost	Absolute position data in error.	Voltage low in the super capacitor in the encoder.
					Battery voltage low.
					Battery cable or battery fault.
				Power was switched on for the first time in the absolute position detection system.	Super capacitor of the absolute position encoder is not charged.
	2030	30	Regenerative error	Permissible regenerative power of the built-in regenerative brake resistor or regenerative brake option is exceeded.	Parameter " [Pr.102] Regenerative brake resistor" setting value error.
					Built-in regenerative brake resistor or regenerative brake option is not connected.
					High-duty operation or continuous regenerative operation caused the permissible regenerative power of the regenerative brake option to be exceeded.
					Power supply voltage is abnormal. (260VAC or more)
					Regenerative brake option faulty.
				Regenerative transistor fault	Regenerative transistor faulty.
				Cooling fan stopped.	Unusual overheat due to cooling fan stop.
	2031	31	Overspeed	Speed has exceeded the instantaneous permissible speed.	Small acceleration/deceleration time constant caused overshoot to be large.
Servo system is instable to cause overshoot.					

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		After alarm has occurred, hold power on for a few minutes, and switch it off once, then on again. Make OPR again.
						Change the battery. Make OPR again.
	—	—	—	—		After alarm has occurred, hold power on for a few minutes, and switch it off once, then on again. Make OPR again.
	Regenerative resistor brake option					Set correctly.
	30102	30202	30203	30204		
	—	—	—	—		Connect correctly
	—	—	—	—	Call the status display and check the regenerative load ratio.	<ul style="list-style-type: none"> <li>Reduce the frequency of positioning.</li> <li>Use the regenerative brake option of larger capacity.</li> <li>Reduce the load.</li> </ul>
	—	—	—	—		Review power supply.
						Change the regenerative brake option.
	—	—	—	—	<ul style="list-style-type: none"> <li>The regenerative brake option has overheated abnormally.</li> <li>The alarm occurs even after removal of the built-in regenerative brake resistor or regenerative brake option.</li> </ul>	Change the servo amplifier.
						Change the servo amplifier or regenerative brake option.
	—	—	—	—		<ul style="list-style-type: none"> <li>Change the servo amplifier or cooling fan.</li> <li>Reduce ambient temperature.</li> </ul>
	Load inertia ratio					Increase acceleration/deceleration time constant.
	30112	30212	30312	30412		
	Acceleration time					
	12, 13	162, 163	312, 313	462, 463		
	36, 37	186, 187	336, 337	486, 487		
	38, 39	188, 189	338, 389	488, 489		
	40, 41	190, 191	340, 341	490, 491		
	Deceleration time					
	14, 15	164, 165	314, 315	464, 465		
	42, 43	192, 193	342, 343	492, 493		
	44, 45	194, 195	344, 345	494, 495		
	46, 47	196, 197	346, 347	496, 497		<ul style="list-style-type: none"> <li>Reset servo gain to proper value.</li> <li>If servo gain cannot be set to proper value:                             <ol style="list-style-type: none"> <li>Reduce "Pr.112 Load inertia moment";</li> <li>or</li> <li>Reexamine acceleration/deceleration time constant.</li> </ol> </li> </ul>



Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2031	31	Overspeed	Speed has exceeded the instantaneous permissible speed.	Parameter <a href="#">Pr.103</a> to <a href="#">Pr.105</a> setting error.
					Fault in the encoder.
	2032	32	Overcurrent	Current that flew is higher than the permissible current of the servo amplifier.	Output U, V, W phases of the servo amplifier were connected with each other.
					Transistor of the servo amplifier damaged.
					Short circuit in the servo amplifier output U, V, W phases.
					Noise entered the overcurrent detection circuit.
	2033	33	Overvoltage	Converter bus voltage exceeded 400VDC.	Lead of built-in regenerative brake resistor or regenerative brake option is open or disconnected.
					Though the regenerative brake option is used, the DRU parameter " <a href="#">Pr.102</a> Regenerative brake resistor" setting value is "0Y 00 (not used)".
					Regenerative brake option is open or disconnected.
					Regenerative transistor faulty.
					Wire breakage of built-in regenerative brake resistor or regenerative brake option.
					Capacity of built-in regenerative brake resistor or regenerative brake option is insufficient.
					Power supply voltage high.
	2034	34	CRC error	SSCNET cable communication fault	The SSCNET cable is disconnected.
					Bus cable fault.
					Noise has entered the bus cable.
The terminal connector is disconnected.					
The same No. exists in the servo amplifier side axis setting.					

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Motor type						Set correctly ( [Pr.103] to [Pr.105] ).
30102	30202	30302	30402			
Motor capacity						
30103	30203	30303	30403			
Motor rotation speed						
30104	30204	30304	30404			
—	—	—	—		Change servomotor.	
—	—	—	—		Correct the U, V, W phase wiring of the servo amplifier.	
—	—	—	—	Alarm (A.32) occurs if power is switched on after disconnection of the U, V, W phase power cables.	Change the servo amplifier.	
—	—	—	—		Correct the U, V, W phase wiring of the servo amplifier.	
—	—	—	—		Take noise suppression measures.	
—	—	—	—		<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>	
Regenerative brake option						Set correctly.
30102	30202	30302	30402			
—	—	—	—		<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>	
—	—	—	—		Change the servo amplifier.	
—	—	—	—		<ul style="list-style-type: none"> <li>• For wire breakage of built-in regenerative brake resistor, change the servo amplifier.</li> <li>• For wire breakage of regenerative brake option, change regenerative brake option.</li> </ul>	
—	—	—	—		Add regenerative brake option or increase capacity.	
—	—	—	—		Review the power supply.	
—	—	—	—		Connect correctly.	
—	—	—	—		Change the SSCNET cable.	
—	—	—	—		Take measures against noise.	
—	—	—	—		Connect terminal connector.	
—	—	—	—		Set correctly.	

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2035	35	Command pulse frequency error	Input frequency of too high.	Command given is greater than the maximum speed of the servomotor.
					Noise has entered the SSCNET cable.
					Fault in the QD75M.
	2036	36	Transfer error	SSCNET cable or printed board is faulty.	The SSCNET cable is disconnected.
					The SSCNET cable fault.
					Printed circuit board (H-C10) fault.
					The terminal connector is disconnected.
	2037	37	Parameter error	Parameter setting is wrong.	Servo amplifier fault caused the parameter setting to be rewritten.
					Parameter data mis-setting by QD75M.
	2042	42	Feedback error	The motor encoder signal is abnormal.	The motor encoder fault.
	2045	45	Main circuit device over heated	Main circuit device overheat	Air cooling fan of servo amplifier stops.
					The power supply was turned on and off continuously by overloaded status.
					Servo amplifier abnormal.
	2046	46	Servomotor heated	Servo motor temperature rise actuated the thermal protector.	Servo motor ambient temperature exceeded the operating value of 40°C.
Servomotor overloaded.					
Thermal protector in encoder is faulty.					
2050	50	Overload 1	Load exceeded overload protection characteristic of servo amplifier. Load ratio 300%: 2.5s or more Load ratio 200%: 100s or more	The current exceeded the continuous output current of the servo amplifier.	
				The servo system is unstable, causing hunting.	
				Collision with the machine.	
				Servo motor miswiring servo amplifier terminals U, V, W phase do not mach motor terminals U, V, W phase.	

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Review operation program. Take measures against noise. Change QD75M.
	—	—	—	—		Connect the connector of the SSCNET cable. Change the SSCNET cable. Change the servo amplifier. Connect terminal connector.
	—	—	—	—		Change the servo amplifier. Change the parameter value to within the setting range.
	—	—	—	—		Change the servomotor.
	—	—	—	—		<ul style="list-style-type: none"> <li>Change the servo amplifier or cooling fan.</li> <li>Reduce ambient temperature.</li> </ul> Review operation method. Change the servo amplifier or cooling fan.
	—	—	—	—		Review environment so that ambient temperature is 0 to 40°C. <ul style="list-style-type: none"> <li>Reduce load.</li> <li>Review operation pattern.</li> <li>Use servomotor that provides larger output.</li> </ul> Change the servomotor.
	—	—	—	—		<ul style="list-style-type: none"> <li>Reduce load.</li> <li>Review operation pattern.</li> <li>Use servomotor that provides larger output.</li> </ul>
	Auto tuning					<ul style="list-style-type: none"> <li>Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>Change " [Pr.109] Servo response" setting.</li> <li>Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
	30108	30208	30308	30408		
	Servo response					
	30109	30209	30309	30409		
	Input signal logic selection					<ul style="list-style-type: none"> <li>Review operation pattern.</li> <li>Install limit switches.</li> </ul>
	31	181	331	481		
	—	—	—	—		Connect correctly.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2050	50	Overload 1	Load exceeded overload protection characteristic of servo amplifier. Load ratio 300%: 2.5s or more Load ratio 200%: 100s or more	The motor encoder fault.
	2051	51	Overload 2	Machine collision or the like caused max. output current to flow successively for several seconds. Servomotor locked: 1s or more	Collision with the machine.
					Servo motor miswiring servo amplifier terminals U, V, W phase do not match motor terminals U, V, W phase.
					The servo system is unstable, causing hunting.
					The bus voltage of the unit has decreased.
	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value(Initial value: 80kPLS) of the parameter <u>Pr.131</u> .	Encoder faulty.
					Acceleration/deceleration time constant too small.
					Torque limit value too small.
					Start disabled due to insufficient torque caused drop in power supply voltage.

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—		When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.	Change servomotor.
Input signal logic selection						<ul style="list-style-type: none"> <li>Review operation pattern.</li> <li>Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
Auto tuning						<ul style="list-style-type: none"> <li>Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>Change " [Pr.109] Servo response" setting.</li> <li>Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
—	—	—	—			Change the servo amplifier.
—	—	—	—		When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.	Change the servomotor.
Acceleration time						Increase the acceleration/deceleration time constant.
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			
Torque limit value						Increase the torque limit value.
26	176	326	476			
OPR torque limit value						
86	236	386	536			
Torque output setting value						
1552	1652	1752	1852			
—	—	—	—			<ul style="list-style-type: none"> <li>Review the power supply capacity.</li> <li>Use servomotor which provides larger output.</li> </ul>
Positioning gain 1						Increase set value and adjust to ensure proper operation.
30113	30213	30313	30413			

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value (Initial value: 8 rotation) of the parameter [Pr.131] .	Servo motor shaft was rotated by external force.	
					Collision with the machine	
					The motor encoder fault.	
					Servo motor miswiring servo amplifier terminals U, V, W phase don't mach motor terminals U, V, W phase.	
					The bus voltage of the unit due to the breakdown.	
	2086	8E	Serial communication error	The fault has occurred in communication between the servo amplifier and communication devices (e.g. personal computer).	The communication cable fault. (Wire breakage or shot)	
				The communication devices (e.g. personal computer) fault.		

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Torque limit value						<ul style="list-style-type: none"> <li>• When torque is limited, increase the limit value.</li> <li>• Reduce load.</li> <li>• Use servomotor that provides larger output.</li> </ul>
26	176	326	476			
OPR torque limit value						
86	236	386	536			
Torque output setting value						
1552	1652	1752	1852			
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—		Change the servomotor.	
—	—	—	—		Connect correctly.	
—	—	—	—		Change the servo amplifier.	
—	—	—	—		Repair or change the cable.	
—	—	—	—		Change the communication devices (e.g. personal computer).	



15.2.3 MR-J2-B detection error

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2010	10	Under voltage	•For MR-J2-Ÿ B: The power supply voltage dropped to 160VAC or less. • For MR-J2-Ÿ B1: The power supply voltage dropped to 83VAC or less.	The power supply voltage is low.
					There was an instantaneous control power failure of 15ms or longer.
					Shortage of power supply capacity caused the power supply voltage to drop at start, etc. .
					Power was restored after the bus voltage had dropped to 200VDC. (Main circuit power switched on within 5s after it had switched off.)
					Faulty parts in the servo amplifier.
	2011	11	Board error 1	Printed circuit board fault.	Faulty parts in the servo amplifier.
	2012	12	Memory error 1	RAM memory error.	
	2013	13	Clock error	Printed circuit board fault.	
	2015	15	Memory error 2	EED-ROM error	
	2016	16	Encoder error 1	Communication error occurred between encoder and servo amplifier.	The encoder connector (CN2) is disconnected.
					Fault in the encoder.
					Encoder cable fault. (Wire breakage or shot)
					Improper motor was connected with servo amplifier.
	2017	17	Board error 2	CPU or parts of the circuit fault.	Faulty parts in the servo amplifier.
	2018	18	Board error 3	ROM memory error.	
2020	20	Encoder error 2	Communication error occurred between encoder and servo amplifier.	The encoder connector (CN2) is disconnected.	
				Fault in the encoder.	
				Encoder cable fault. (Wire breakage or shot)	
2024	24	Motor output side ground fault	Servomotor output (U, V, W phase) of the servo amplifier ground fault.	Servo amplifier output (U, V, W phase) ground fault.	
2025	25	Absolute position lost	Absolute position data in error.	Voltage low in the super capacitor in the encoder.	
				Battery voltage low.	
				Battery cable or battery fault.	
			Power was switched on for the first time in the absolute position detection system.	Super capacitor of the absolute position encoder is not charged.	

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Reconsider the power supply voltage.
	—	—	—	—	Alarm (A.10) occurs if power is switched on after disconnection of the CN1A, CN1B and CN3 connector.	Change the servo amplifier.
	—	—	—	—	Alarm (any of A.12 to 13, 15) occurs if power is switched on after disconnection of CN1A, CN1B and CN3 connector.	Change the servo amplifier.
	—	—	—	—		Connect correctly.
						Change the servomotor.
						Repair or change the cable.
						Use correct combination.
	—	—	—	—	Alarm (A.17, A.18) occurs if power is switched on after disconnection of the CN1A, CN1B and CN3 connector.	Change the servo amplifier.
	—	—	—	—		Connect correctly.
						Change the servomotor.
						Repair or change the cable.
	—	—	—	—		Change the cable.
	—	—	—	—		After leaving the alarm occurring for few minutes, switch power off, then on again. Always make OPR setting again.
						Change the battery unit. Always make OPR setting again.
	—	—	—	—		After alarm has occurred, hold power on for a few minutes, and switch it off once, then on again. Always make OPR setting again.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2030	30	Regenerative error	Permissible regenerative power of the built-in regenerative brake resistor or regenerative brake option is exceeded.	Parameter " [Pr.102] Regenerative brake resistor" setting value error.
					Built-in regenerative brake resistor or regenerative brake option is not connected.
					High-duty operation or continuous regenerative operation caused the permissible regenerative power of the regenerative brake option to be exceeded.
					Power supply voltage is abnormal. MR-J2-B: 260VAC or more MR-J2-B1: 135VAC or more
					Regenerative brake option faulty.
				Regenerative transistor fault	Regenerative transistor faulty.
					Built-in regenerative brake resistor or regenerative brake option faulty.
	2031	31	Overspeed	Speed has exceeded the instantaneous permissible speed.	Small acceleration/deceleration time constant caused overshoot to be large.
					Servo system is instable to cause overshoot.
	2032	32	Overcurrent	Current that flew is higher than the permissible current of the servo amplifier.	Fault in the encoder.
Output phases U, V, W phase of the servo amplifier were connected with each other.					
Transistor of the servo amplifier damaged.					
Short circuit in the servo amplifier out put phase U, V, W phase.					
				Noise entered the overcurrent detection circuit.	

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	Regenerative resistor brake option					Set correctly.
	30102	30202	30203	30204		
	—	—	—	—		Connect correctly.
	—	—	—	—	Call the status display and check the regenerative load ratio.	<ul style="list-style-type: none"> <li>Reduce the frequency of positioning.</li> <li>Use the regenerative brake option of larger capacity.</li> <li>Reduce the load.</li> </ul>
	—	—	—	—		Review power supply.
	—	—	—	—		Change the regenerative brake option.
	—	—	—	—	<ul style="list-style-type: none"> <li>The regenerative brake option has overheated abnormally.</li> <li>The alarm occurs even after removal of the built-in regenerative brake resistor or regenerative brake option.</li> </ul>	Change the servo amplifier.
	—	—	—	—		Change the servo amplifier or regenerative brake option.
	Load inertia ratio					Increase acceleration/deceleration time constant.
	30112	30212	30312	30412		
	Acceleration time					
	12, 13	162, 163	312, 313	462, 463		
	36, 37	186, 187	336, 337	486, 487		
	38, 39	188, 189	338, 339	488, 489		
	40, 41	190, 191	340, 341	490, 491		
	Deceleration time					
	14, 15	164, 165	314, 315	464, 465		
	42, 43	192, 193	342, 343	492, 493		
	44, 45	194, 195	344, 345	494, 495		
	46, 47	196, 197	346, 347	496, 497		
	—	—	—	—		Change servomotor.
	—	—	—	—		Correct the U, V, W phase wiring of the servo amplifier.
	—	—	—	—	Alarm (A.32) occurs if power is switched on after disconnection of the U, V, W phase power cables.	Change the servo amplifier.
	—	—	—	—		Correct the U, V, W phase wiring of the servo amplifier.
	—	—	—	—		Take noise suppression measures.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2033	33	Overvoltage	Converter bus voltage exceeded 400VDC.	Lead of built-in regenerative brake resistor or regenerative brake option is open or disconnected.
					Though the regenerative brake option is used, the DRU parameter "Pr.102 Regenerative brake resistor" setting value is "0" (not used).
					Regenerative brake option is open or disconnected.
					Regenerative transistor faulty.
					Wire breakage of built-in regenerative brake resistor or regenerative brake option
					Capacity of built-in regenerative brake resistor or regenerative brake option is insufficient.
					Power supply voltage high.
	2034	34	CRC error	SSCNET cable communication fault	The SSCNET cable is disconnected.
					SSCNET cable fault.
					Noise has entered the SSCNET cable.
					The terminal connector is disconnected.
					The same No. exists in the servo amplifier side axis setting.
	2035	35	Command pulse frequency error	Input frequency of too high.	Command given is greater than the maximum speed of the servomotor.
					Noise has entered the SSCNET cable.
					Fault in the QD75M.
	2036	36	Transfer error	SSCNET cable or printed board is faulty.	The SSCNET cable is disconnected.
					The SSCNET cable fault.
					Printed circuit board fault.
					The terminal connector is disconnected.
	2037	37	Parameter error	Parameter setting is wrong.	Servo amplifier fault caused the parameter setting to be rewritten.
					Parameter data mis-setting by QD75M.
	2046	46	Servomotor heated	Servo motor temperature rise actuated the thermal protector.	Servo motor ambient temperature exceeded the operating value of 40°C.
					Servomotor overloaded.
					Thermal protector in encoder is faulty.

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>
	Regenerative brake option					Connect correctly.
	30102	30202	30302	30402		
	—	—	—	—		<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>
						Change the servo amplifier.
	—	—	—	—		<ul style="list-style-type: none"> <li>• For wire breakage of built-in regenerative brake resistor, change the servo amplifier.</li> <li>• For wire breakage of regenerative brake option, change regenerative brake option.</li> </ul>
						Add regenerative brake option or increase capacity.
						Review the power supply.
	—	—	—	—		Connect correctly.
						Change the SSCNET cable.
	—	—	—	—		Take measures against noise.
						Connect terminal connector.
						Set correctly.
	—	—	—	—		Review operation program.
						Take measures against noise.
						Change QD75M.
	—	—	—	—		Connect the connector of the SSCNET cable.
						Change the SSCNET cable.
						Change the servo amplifier.
						Connect terminal connector.
	—	—	—	—		Change the servo amplifier.
						Change the parameter value to within the setting range.
	—	—	—	—		Review environment so that ambient temperature is 0 to 40°C.
						<ul style="list-style-type: none"> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>
						Change the servomotor.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2050	50	Overload 1	Load exceeded overload protection characteristic of servo amplifier. Load ratio 300%: 2.5s or more Load ratio 200%: 100s or more	The current exceeded the continuous output current of the servo amplifier.	
					The servo system is unstable, causing hunting.	
					Collision with the machine.	
					Servo motor miswiring servo amplifier terminals U, V, W phase do not mach motor terminals U, V, W phase.	
					The motor encoder fault.	
	2051	51	Overload 2	Machine collision or the like caused max. output current to flow successively for several seconds. Servomotor locked: 1s or more	Collision with the machine.	
					Servo motor miswiring servo amplifier terminals U, V, W phase don't mach motor terminals U, V, W phase.	
					The servo system is unstable, causing hunting.	
					The motor encoder fault.	
	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value (Initial value: 80kPLS) of the parameter <u>Pr.131</u> .	Acceleration/deceleration time constant too small.	

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—			<ul style="list-style-type: none"> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>• Change " [Pr.109] Servo response" setting.</li> <li>• Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
—	—	—	—	When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.		Change servomotor.
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>• Change " [Pr.109] Servo response" setting.</li> <li>• Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
—	—	—	—	When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.		Change the servomotor.
Acceleration time						Increase the acceleration/deceleration time constant.
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			



Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value of the parameter <u>Pr.131</u> .	Torque limit value too small.
					Start disabled due to insufficient torque caused drop in power supply voltage.
					The setting value for " <u>Pr.113</u> Position control gain 1" too small.
					Servo motor shaft was rotated by external force.
					Collision with the machine.
					The motor encoder fault.
					Servo motor miswiring servo amplifier terminals U, V, W do not mach motor terminals U, V, W.
2086	8E	Serial communication error	The fault has occurred in communication between the servo amplifier and communication devices (e.g. personal computer).	The communication cable fault. (Wire breakage or shot)	
				The communication devices (e.g. personal computer) fault.	

Related buffer memory address				Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4		
Torque limit value					Increase the torque limit value.
26	176	326	476		
OPR torque limit value					
86	236	386	536		
Torque output setting value					
1552	1652	1752	1852		
—	—	—	—		<ul style="list-style-type: none"> <li>• When torque is limited, increase the limit value.</li> <li>• Use servomotor that provides larger output.</li> </ul>
Positioning gain 1					Increase set value and adjust to ensure proper operation.
30113	30213	30313	30413		
Torque limit value					<ul style="list-style-type: none"> <li>• When torque is limited, increase the limit value.</li> <li>• Reduce load.</li> <li>• Use servomotor that provides larger output.</li> </ul>
26	176	326	476		
OPR torque limit value					
86	236	386	536		
Torque output setting value					
1552	1652	1752	1852		
Input signal logic selection					<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481		
—	—	—	—		Change the servomotor.
—	—	—	—		Connect correctly.
—	—	—	—		Repair or change the cable.
—	—	—	—		Change the communication devices (e.g. personal computer).

15.2.4 MR-J2S-B detection error

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2010	10	Under voltage	<ul style="list-style-type: none"> <li>•For MR-J2S-Ÿ B: The power supply voltage dropped to 160VAC or less.</li> <li>• For MR-J2S-Ÿ B1: The power supply voltage dropped to 83VAC or less.</li> </ul>	The power supply voltage is low.	
					There was an instantaneous control power failure of 60ms or longer.	
					Shortage of power supply capacity caused the power supply voltage to drop at start, etc. .	
					Power was restored after the bus voltage had dropped to 200VDC. (Main circuit power switched on within 5s after it had switched off.)	
					Faulty parts in the servo amplifier.	
	2012	12	Memory error 1	RAM memory error.	Faulty parts in the servo amplifier.	
	2013	13	Clock error	Printed circuit board fault.		
	2015	15	Memory error 2	EEP-ROM error		
	2016	16	Encoder error 1	Communication error occurred between encoder and servo amplifier.	The encoder connector (CN2) is disconnected.	
					Fault in the encoder.	
					Encoder cable fault. (Wire breakage or shot)	
	2017	17	Board error 2	CPU or parts of the circuit fault.	Faulty parts in the servo amplifier.	
	2019	19	Memory error 3	ROM memory error.		
	2020	1A	Servomotor combination error	Wrong combination of servo amplifier and servomotor.	Wrong combination of servo amplifier and servomotor connected.	
	2020	20	Encoder error 2	Communication error occurred between encoder and servo amplifier.	The encoder connector (CN2) is disconnected.	
Fault in the encoder.						
Encoder cable fault. (Wire breakage or shot)						
2024	24	Motor output side ground fault	Servomotor output (U, V, W phase) ground fault.	Power input wires and servomotor output wires are in contact at main circuit terminal block (TE1).		
				Sheathes of servomotor power cables deteriorated, resulting in ground fault.		
2025	25	Absolute position lost	Absolute position data in error.	Voltage low in the super capacitor in the encoder.		
				Battery voltage low.		
				Battery cable or battery fault.		
			Power was switched on for the first time in the absolute position detection system.	Super capacitor of the absolute position encoder is not charged.		

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Reconsider the power supply voltage.
	—	—	—	—	Alarm (A.10) occurs if power is switched on after disconnection of the CN1A, CN1B and CN3 connector.	Change the servo amplifier.
	—	—	—	—	Alarm (any of A.12 to 13,15) occurs if power is switched on after disconnection of CN1A, CN1B and CN3 connector.	Change the servo amplifier.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the servomotor.
	—	—	—	—		Repair or change the cable.
	—	—	—	—	Alarm (A.17, A.19) occurs if power is switched on after disconnection of the CN1A, CN1B and CN3 connector.	Change the servo amplifier.
	—	—	—	—		Use correct combination.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the servomotor.
	—	—	—	—		Repair or change the cable.
	—	—	—	—		Change the cable.
	—	—	—	—		After leaving the alarm occurring for few minutes, switch power off, then on again. Always make OPR setting again.
	—	—	—	—		Change the battery. Always make OPR setting again.
	—	—	—	—		After leaving the alarm occurring for few minutes, switch power off, then on again. Always make OPR setting again.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2030	30	Regenerative error	Permissible regenerative power of the built-in regenerative brake resistor or regenerative brake option is exceeded.	Parameter " Pr.102 Regenerative brake resistor" setting value error.
					Built-in regenerative brake resistor or regenerative brake option is not connected.
					High-duty operation or continuous regenerative operation caused the permissible regenerative power of the regenerative brake option to be exceeded.
					Power supply voltage is abnormal. MR-J2S-B: 260VAC or more MR-J2S-B1: 135VAC or more
					Regenerative brake option faulty.
				Regenerative transistor fault	Regenerative transistor faulty.
					Built-in regenerative brake resistor or regenerative brake option faulty.
	2031	31	Overspeed	Speed has exceeded the instantaneous permissible speed.	Small acceleration/deceleration time constant caused overshoot to be large.
					Servo system is instable to cause overshoot.
	2032	32	Overcurrent	Current that flew is higher than the permissible current of the servo amplifier.	Fault in the encoder.
Output phases U, V, W phase of the servo amplifier were connected with each other.					
Transistor of the servo amplifier damaged.					
Short circuit in the servo amplifier output phase U, V, W phase.					
				Noise entered the overcurrent detection circuit.	

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Regenerative resistor brake option						Set correctly.
30102	30202	30302	30402			
—	—	—	—			Connect correctly
—	—	—	—	Call the status display and check the regenerative load ratio.		<ul style="list-style-type: none"> <li>Reduce the frequency of positioning.</li> <li>Use the regenerative brake option of larger capacity.</li> <li>Reduce the load.</li> </ul>
—	—	—	—			Review power supply.
—	—	—	—			Change the regenerative brake option.
—	—	—	—	<ul style="list-style-type: none"> <li>The regenerative brake option has overheated abnormally.</li> <li>The alarm occurs even after removal of the built-in regenerative brake resistor or regenerative brake option.</li> </ul>		Change the servo amplifier.
—	—	—	—			Change the servo amplifier or regenerative brake option.
Load inertia ratio						Increase acceleration/deceleration time constant.
30112	30212	30312	30412			
Acceleration time						
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			
—	—	—	—			Change servomotor.
—	—	—	—			Correct the U, V, W phase wiring of the servo amplifier.
—	—	—	—	Alarm (A.32) occurs if power is switched on after disconnection of the U, V, W phase power cables.		Change the servo amplifier.
—	—	—	—			Correct the U, V, W phase wiring of the servo amplifier.
—	—	—	—			Take noise suppression measures.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2033	33	Overvoltage	Converter bus voltage exceeded 400VDC.	Lead of built-in regenerative brake resistor or regenerative brake option is open or disconnected.
					Though the regenerative brake option is used, the DRU parameter "Pr.102 Regenerative brake resistor" setting value is "0" (not used)".
					Regenerative brake option is open or disconnected.
					Regenerative transistor faulty.
					Wire breakage of built-in regenerative brake resistor or regenerative brake option
					Capacity of built-in regenerative brake resistor or regenerative brake option is insufficient.
					Power supply voltage high.
	2034	34	CRC error	SSCNET cable communication fault	The SSCNET cable is disconnected.
					SSCNET cable fault.
					Noise has entered the SSCNET cable.
					The terminal connector is disconnected.
					The same No. exists in the servo amplifier side axis setting.
	2035	35	Command pulse frequency error	Input frequency of too high.	Command given is greater than the maximum speed of the servomotor.
					Noise has entered the SSCNET cable.
					Fault in the QD75M.
	2036	36	Transfer error	SSCNET cable or printed board is faulty.	The SSCNET cable is disconnected.
					SSCNET cable fault.
					Printed circuit board fault.
					The terminal connector is disconnected.
	2037	37	Parameter error	Parameter setting is wrong.	Servo amplifier fault caused the parameter setting to be rewritten.
					Parameter data mis-setting by QD75M.
The number of write times to EEPROM exceeded 100,000 due to parameter write, etc.					

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>
	Regenerative brake option					
	30102	30202	30302	30402		Connect correctly.
						<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>
						Change the servo amplifier.
	—	—	—	—		<ul style="list-style-type: none"> <li>• For wire breakage of built-in regenerative brake resistor, change the servo amplifier.</li> <li>• For wire breakage of regenerative brake option, change regenerative brake option.</li> </ul>
						Add regenerative brake option or increase capacity.
						Review the power supply.
						Connect correctly.
						Change the SSCNET cable.
	—	—	—	—		Take measures against noise.
						Connect terminal connector.
						Set correctly.
	—	—	—	—		Review operation program.
						Take measures against noise.
						Change QD75M.
	—	—	—	—		Connect the connector of the SSCNET cable.
						Change the SSCNET cable.
						Change the servo amplifier.
						Connect terminal connector.
	—	—	—	—		Change the servo amplifier.
						Change the parameter value to within the setting range.
						Change the servo amplifier.





Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—		<ul style="list-style-type: none"> <li>• Change the servo amplifier or cooling fan.</li> <li>• Reduce ambient temperature.</li> </ul>	
—	—	—	—		<ul style="list-style-type: none"> <li>• The drive method is reviewed.</li> <li>• Change the servo amplifier.</li> </ul>	
—	—	—	—		<ul style="list-style-type: none"> <li>• Review environment so that ambient temperature is 0 to 40°C.</li> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>	
—	—	—	—		<ul style="list-style-type: none"> <li>• Change the servomotor.</li> </ul>	
—	—	—	—		<ul style="list-style-type: none"> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>	
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>• Change " [Pr.109] Servo response" setting.</li> <li>• Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—		<ul style="list-style-type: none"> <li>• Connect correctly.</li> </ul>	
—	—	—	—	When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.	<ul style="list-style-type: none"> <li>• Change servomotor.</li> </ul>	
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—		<ul style="list-style-type: none"> <li>• Connect correctly.</li> </ul>	
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>• Change " [Pr.109] Servo response" setting.</li> <li>• Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
—	—	—	—	When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.	<ul style="list-style-type: none"> <li>• Change the servomotor.</li> </ul>	

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value (Initial value: 8 rotation) of the parameter <u>Pr.131</u> .	Acceleration/deceleration time constant too small.	
					Torque limit value too small.	
					Start disabled due to insufficient torque caused drop in power supply voltage.	
					The setting value for " <u>Pr.113</u> Position control gain 1" too small.	
					Servo motor shaft was rotated by external force.	
					Collision with the machine	
					The motor encoder fault.	
	Servo motor miswiring servo amplifier terminals U, V, W phase don't mach motor terminals U, V, W phase.					
2086	8E	Serial communication error	The fault has occurred in communication between the servo amplifier and communication devices (e.g. personal computer).	The communication cable fault. (Wire breakage or shot)		
				The communication devices (e.g. personal computer) fault.		

Related buffer memory address				Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4		
Acceleration time					Increase the acceleration/deceleration time constant.
12, 13	162, 163	312, 313	462, 463		
36, 37	186, 187	336, 337	486, 487		
38, 39	188, 189	338, 339	488, 489		
40, 41	190, 191	340, 341	490, 491		
Deceleration time					
14, 15	164, 165	314, 315	464, 465		
42, 43	192, 193	342, 343	492, 493		
44, 45	194, 195	344, 345	494, 495		
46, 47	196, 197	346, 347	496, 497		
Torque limit value					Increase the torque limit value.
26	176	326	476		
OPR torque limit value					
86	236	386	536		
Torque output setting value					
1552	1652	1752	1852		
—	—	—	—		<ul style="list-style-type: none"> <li>• Review the power supply capacity.</li> <li>• Use servomotor which provides larger output.</li> </ul>
Positioning gain 1					Increase set value and adjust to ensure proper operation.
30113	30213	30313	30413		
Torque limit value					<ul style="list-style-type: none"> <li>• When torque is limited, increase the limit value.</li> <li>• Reduce load.</li> <li>• Use servomotor that provides larger output.</li> </ul>
26	176	326	476		
OPR torque limit value					
86	236	386	536		
Torque output setting value					
1552	1652	1752	1852		
Input signal logic selection					<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481		
—	—	—	—		Change the servomotor.
—	—	—	—		Connect correctly.
—	—	—	—		Repair or change the cable.
—	—	—	—		Change the communication devices (e.g. personal computer).

15.2.5 MR-J2-Jr detection error

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2010	10	Under voltage	The power supply voltage dropped to 20VDC or less.	The power supply voltage is low.	
					There was an instantaneous control power failure of 40ms or longer.	
					Shortage of power supply capacity caused the power supply voltage to drop at start, etc. .	
					Power was restored after the bus voltage had dropped to 15VDC. (Main circuit power switched on within 5s after it had switched off.)	
					Faulty parts in the servo amplifier.	
	2011	11	Board error 1	Printed circuit board fault.	Faulty parts in the servo amplifier.	
	2012	12	Memory error 1	ROM or RAM memory error.		
	2013	13	Clock error	Printed circuit board fault.		
	2015	15	Memory error 2	EEP-ROM error		
	2016	16	Encoder error 1	Communication error occurred between encoder and servo amplifier.	The encoder connector (CNP2) is disconnected.	
					Fault in the encoder.	
					Encoder cable fault. (Wire breakage or shot)	
2017	17	Board error 2	CPU or parts of the circuit fault.	Faulty parts in the servo amplifier.		
2020	20	Encoder error 2	Communication error occurred between encoder and servo amplifier.	The encoder connector (CNP2) is disconnected.		
				Fault in the encoder.		
				Encoder cable fault. (Wire breakage or shot)		
2024	24	Motor output side ground fault	Servomotor output (U, V, W phase) ground fault.	Contact of power supply input cables and servomotor outputs in main circuit terminal block.		
				Sheathes of servomotor power cables deteriorated, resulting in ground fault.		

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Reconsider the power supply voltage.
	—	—	—	—	Alarm (A.10) occurs if power is switched on after disconnection of the CN1A, CN1B, CNP2 and CNP3 connector.	Change the servo amplifier.
	—	—	—	—	Alarm (any of A.12 to 15) occurs if power is switched on after disconnection of CN1A, CN1B, CNP2 and CNP3 connector.	Change the servo amplifier.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the servo amplifier.
	—	—	—	—		Repair or change the cable.
	—	—	—	—	Alarm (A.17) occurs if power is switched on after disconnection of the CN1A, CN1B, CNP2 and CNP3 connector.	Change the servomotor.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the servomotor.
	—	—	—	—		Repair or change the cable.
	—	—	—	—	Alarm (2024) occurs if power is switched on after disconnection of the CNP2 connector.	Connect correctly.
	—	—	—	—		Change the cable.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2031	31	Overspeed	Speed has exceeded the instantaneous permissible speed.	Small acceleration/deceleration time constant caused overshoot to be large.
					Servo system is instable to cause overshoot.
	2032	32	Overcurrent	Current that flew is higher than the permissible current of the servo amplifier.	Fault in the encoder.
					Output phases U, V, W phase of the servo amplifier were connected with each other.
				Transistor of the servo amplifier damaged.	
				Short circuit in the servo amplifier output phase U, V, W phase.	
				Noise entered the overcurrent detection circuit.	

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Load inertia ratio						Increase acceleration/ deceleration time constant.
30112	30212	30312	30412			
Acceleration time						
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			
—	—	—	—		Change servomotor.	
—	—	—	—		Correct the U, V, W phase wiring of the servo amplifier.	
—	—	—	—	Alarm (A.32) occurs if power is switched on after disconnection of the CNP2 connector.	Change the servo amplifier.	
—	—	—	—		Correct the U, V, W phase wiring of the servo amplifier.	
—	—	—	—		Take noise suppression measures.	



Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2033	33	Overvoltage	Converter bus voltage exceeded 35VDC.	Power supply voltage high.	
	2034	34	CRC error	SSCNET cable communication fault	The SSCNET cable is disconnected.	
					SSCNET cable fault.	
					Noise has entered the SSCNET cable.	
					The terminal connector is disconnected.	
	2035	35	Command pulse frequency error	Input frequency of too high.	The same No. exists in the servo amplifier side axis setting.	
					Command given is greater than the maximum speed of the servomotor.	
					Noise has entered the SSCNET cable.	
	2036	36	Transfer error	Bus cable or printed board is faulty.	Fault in the QD75M.	
					The SSCNET cable is disconnected.	
					The SSCNET cable fault.	
					Printed circuit board fault.	
	2037	37	Parameter error	Parameter setting is wrong.	The terminal connector is disconnected.	
					Servo amplifier fault caused the parameter setting to be rewritten.	
					Parameter data mis-setting by QD75M.	
					The number of write times to EEPROM exceeded 100,000 due to parameter write, etc.	

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Review the power supply.
						Connect correctly.
						Change the SSCNET cable.
	—	—	—	—		Take measures against noise.
						Connect terminal connector.
						Set correctly.
	—	—	—	—		Review operation program.
						Take measures against noise.
						Change QD75M.
						Connect the connector of the SSCNET cable.
	—	—	—	—		Change the SSCNET cable.
						Change the servo amplifier.
						Connect terminal connector.
						Change the servo amplifier.
	—	—	—	—		Change the parameter value to within the setting range.
						Change the servo amplifier.

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause
Servo amplifier errors	2050	50	Overload 1	Load exceeded overload protection characteristic of servo amplifier. Load ratio 200%: 85s or more	The current exceeded the continuous output current of the servo amplifier.
					The servo system is unstable, causing hunting.
					Collision with the machine.
					Servo motor miswiring servo amplifier terminals U, V, W phase do not match motor terminals U, V, W phase.
					The motor encoder fault.
	2051	51	Overload 2	Machine collision or the like caused max. output current to flow successively for several seconds. Servomotor locked: 1s or more During rotation: 2.5s or more	Collision with the machine
					Servo motor miswiring servo amplifier terminals U, V, W phase do not match motor terminals U, V, W phase.
					The servo system is unstable, causing hunting.
					The bus voltage of the unit has decreased.
					Encoder faulty.
	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value of the parameter <u>Pr.131</u> .	Acceleration/deceleration time constant too small.

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—			<ul style="list-style-type: none"> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute "Pr.108 Auto tuning".</li> <li>• Change "Pr.109 Servo response" setting.</li> <li>• Set "Pr.108 Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
—	—	—	—		When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.	Change servomotor.
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute "Pr.108 Auto tuning".</li> <li>• Change "Pr.109 Servo response" setting.</li> <li>• Set "Pr.108 Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
—	—	—	—			Change the servo amplifier.
—	—	—	—		When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.	Change the servomotor.
Acceleration time						Increase the acceleration/deceleration time constant.
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			

Classification of errors	Error code	LED indicator of servo amplifier	Error name	Description	Cause	
Servo amplifier errors	2052	52	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value (default value: 80kPLS) of the parameter <u>Pr.131</u> .	Torque limit value too small.	
					Start disabled due to insufficient torque caused drop in power supply voltage.	
					The setting value for " <u>Pr.113</u> Position control gain 1" too small.	
					Servo motor shaft was rotated by external force.	
					Collision with the machine	
					The motor encoder fault.	
					Servo motor miswiring servo amplifier terminals U, V, W phase don't mach motor terminals U, V, W phase.	
					The bus voltage of the unit due to the breakdown.	
2086	8E	Serial communication error	The fault has occurred in communication between the servo amplifier and communication devices (e.g. personal computer).	The communication cable fault. (Wire breakage or shot)		
				The communication devices (e.g. personal computer) fault.		

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Torque limit value						Increase the torque limit value.
26	176	326	476			
OPR torque limit value						
86	236	386	536			
Torque output setting value						
1552	1652	1752	1852			
—	—	—	—		<ul style="list-style-type: none"> <li>• Review the power supply capacity.</li> <li>• Use servomotor which provides larger output.</li> </ul>	
Positioning gain 1						Increase set value and adjust to ensure proper operation.
30113	30213	30313	30413			
Torque limit value						<ul style="list-style-type: none"> <li>• When torque is limited, increase the limit value.</li> <li>• Reduce load.</li> <li>• Use servomotor that provides larger output.</li> </ul>
26	176	326	476			
OPR torque limit value						
86	236	386	536			
Torque output setting value						
1552	1652	1752	1852			
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—		Change the servomotor.	
—	—	—	—		Connect correctly.	
—	—	—	—		Change servomotor.	
—	—	—	—		Repair or change the cable.	
					Change the communication device (e.g. personal computer).	

## 15.2.6 MR-J2M-B detection error

Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause	
		IFU	DRU				
Servo amplifier errors	2010	FA. 10	—	Under voltage	The power supply voltage dropped to 160VAC or less.	The power supply voltage is low.	
						There was an instantaneous control power failure of 30ms or longer.	
						Shortage of power supply capacity caused the power supply voltage to drop at start, etc. .	
						Power was restored after the bus voltage had dropped to 200VDC. (Main circuit power switched on within 5s after it had switched off.)	
						Faulty parts in the base unit.	
						Faulty parts in interface unit.	
						CNP3 or CNP1B connector unplugged.	
	2012	FA.12	—	Memory error 1	ROM or RAM memory error.	Faulty parts in interface unit.	
	2013	FA.13	—	Clock error	Printed circuit board fault.		
	2014	FA.14	—	Watchdog error	CPU parts of the circuit fault.		
	2015	FA.15	—	Memory error 2	EED-ROM error		
	2012	—	@A.12#	Memory error 1	ROM or RAM memory error.	Faulty parts in the drive unit.	
	2013	—	@A.13#	Clock error	Printed circuit board fault.		
	2014	—	@A.14#	Watchdog error	CPU parts of the circuit fault.		
	2015	—	@A.15#	Memory error 2	EED-ROM error		
2016	—	@A.16#	Encoder error 1	Communication error occurred between encoder and drive unit.	The encoder connector is disconnected.		
					Fault in the encoder. Encoder cable fault. (Wire breakage or shot)		
2017	—	@A.17#	Board error 2	CPU or parts of the circuit fault.	Faulty parts in the drive unit.		
2019	FA.19	@A.19#	Memory error 3	Flash memory error.	Faulty parts in the interface unit or drive unit.		
2020	—	@A.1A#	Servomotor combination error	Wrong combination of drive unit and servomotor.	Wrong combination of drive unit and servomotor connected.		
2021	FA.1B	—	Axis set error	Drive unit installed on the same base unit have the same axis.	IFU parameter <a href="#">Pr.111</a> to <a href="#">Pr.118</a> setting mistake.		

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Reconsider the power supply voltage.
	—	—	—	—	Alarm (A.10) occurs if interface unit is changed.	Change the base unit.
	—	—	—	—	Alarm (A.10) occurs if base unit is changed.	Change the interface unit.
	—	—	—	—		Connect correctly.
	—	—	—	—	Alarm (any of A.12 to 15) occurs if power is switched on after disconnection of all cables but the control circuit power supply cables.	Change the interface unit.
	—	—	—	—	Alarm (any of A.12 to 15) occurs if power is switched on after disconnection of all cables but the control circuit power supply cables.	Change the drive unit.
	—	—	—	—		Connect correctly.
	—	—	—	—		Change the drive unit.
	—	—	—	—		Repair or change the cable.
	—	—	—	—	Alarm (A.17) occurs if power is switched on after disconnection of all cables but the control circuit power supply cables.	Change the drive unit.
	—	—	—	—	Alarm (A.19) occurs if power is switched on after disconnection of all cables but the control circuit power supply cables.	Change the interface unit or drive unit.
	—	—	—	—		Use correct combination.
	—	—	—	—		Connect correctly.



Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause	
		IFU	DRU				
Servo amplifier errors	2022	FA.1C	—	Base unit bus error 1	There is error in communication between interface unit and drive unit.	Interface unit connection fault.	
						Interface unit failure.	
						Base unit failure.	
	2023	FA.1D	—	Base unit bus error 2	There is error in communication between interface unit and drive unit.	Drive unit connection fault.	
						Drive unit failure.	
						Base unit failure.	
	2024	FA.1E	—	Servo amplifier mounting error	Drive unit came off the base unit after initialization.	Drive unit connection fault.	
						Base unit failure.	
	2020	—	@A.20#	Encoder error 2	Communication error occurred between encoder and drive unit.	The encoder connector is disconnected.	
						Encoder fault.	
						Encoder cable faulty. (Wire breakage or shorted)	
	2024	—	@A.24#	Motor output side ground fault	Servomotor output (U, V, W phase) ground fault.	Power input wires and servo motor output wires are in contact at CNP2.	
Sheathes of servo motor power cables deteriorated, resulting in ground fault.							
					Main circuit of drive unit failed.		
2025	—	@A.25#	Absolute position lost	Absolute position data in error.	Battery unit voltage low.		
					Battery cable or battery fault.		
				Power was switched on for the first time in the absolute position detection system.	Super capacitor of the absolute position encoder is not charged.		

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Connect the interface unit to the base unit properly. Change the interface unit. Change the base unit.
	—	—	—	—		Connect the drive unit to the base unit properly. Change the drive unit. Change the base unit.
	—	—	—	—		Connect the drive unit to the base unit properly. Change the base unit.
	—	—	—	—	Alarm (A.1E) occurs if power is switched on after disconnection of the U, V, W phase power cables.	Change the drive unit.
	—	—	—	—		Connect correctly. Change the servomotor. Repair or change cable.
	—	—	—	—		Connect correctly. Change the cable.
	—	—	—	—	Alarm (A.24) occurs if power is switched on after disconnection of the U, V, W phase power cables.	Change the drive unit.
	—	—	—	—		Change battery unit. Always make home position setting again.
	—	—	—	—		After leaving the alarm occurring for a few minutes, switch power off, then on again. Always make home position setting again

Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause	
		IFU	DRU				
Servo amplifier errors	2030	FA.30	—	Regenerative error	Permissible regenerative power of the built-in regenerative brake resistor or regenerative brake option is exceeded.	Parameter " [Pr.102] Regenerative brake resistor" setting value error.	
						Built-in regenerative brake resistor or regenerative brake option is not connected.	
						High-duty operation or continuous regenerative operation caused the permissible regenerative power of the regenerative brake option to be exceeded.	
						Power supply voltage is abnormal. (260VAC or more)	
						Regenerative brake option faulty.	
					Regenerative transistor fault	Regenerative transistor faulty.	
	2031	—	@A.31#	Overspeed	Speed has exceeded the instantaneous permissible speed.	Small acceleration/deceleration time constant caused overshoot to be large.	
						Servo system is instable to cause overshoot.	
						Fault in the encoder.	
	2032	—	@A.32#	Overcurrent	Current that flew is higher than the permissible current of the drive unit.	Output phases U, V, W phases of the drive unit were connected with each other.	
Transistor of the drive unit damaged.							
Short circuit in the drive unit out put phase U, V, W phases.							
Noise entered the overcurrent detection circuit.							

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Regenerative resistor brake option						Set correctly.
30102	30202	30302	30402			
—	—	—	—			Connect correctly
—	—	—	—	Call the status display and check the regenerative load ratio.	<ul style="list-style-type: none"> <li>Reduce the frequency of positioning.</li> <li>Use the regenerative brake option of larger capacity.</li> <li>Reduce the load.</li> </ul>	
—	—	—	—			Review power supply.
—	—	—	—			Change the regenerative brake option.
—	—	—	—	<ul style="list-style-type: none"> <li>The regenerative brake option has overheated abnormally.</li> <li>The alarm occurs even after removal of the built-in regenerative brake resistor or regenerative brake option.</li> </ul>		Change the base unit.
Load inertia ratio						Increase acceleration/deceleration time constant.
30112	30212	30312	30412			
Acceleration time						
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			
—	—	—	—			Change servomotor.
—	—	—	—			Correct the U, V, W phase wiring of the servo amplifier.
—	—	—	—	Alarm (A.32) occurs if power is switched on after disconnection of the U, V, W phase power cables.		Change the drive unit.
—	—	—	—			Correct the U, V, W phase wiring of the servo amplifier.
—	—	—	—			Take noise suppression measures.

Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause	
		IFU	DRU				
Servo amplifier errors	2033	FA.33	—	Overvoltage	Converter bus voltage exceeded 400VDC.	Don't using the regenerative brake option.	
						Though the regenerative brake option is used, the DRU parameter "Pr.102 Regenerative brake resistor" setting value is "0" (not used)".	
						Regenerative brake option is open or disconnected.	
						Regenerative transistor faulty.	
						Wire breakage of built-in regenerative brake resistor or regenerative brake option	
						Power supply voltage high.	
	2034	FA.34	—	CRC error	SSCNET cable communication fault	The SSCNET cable is disconnected.	
						The SSCNET cable fault.	
						Noise has entered the SSCNET cable.	
						The terminal connector is disconnected.	
	2035	—	@A.35#	Command pulse frequency error	Input frequency of too high.	Command given is greater than the maximum speed of the servomotor.	
						Noise has entered the SSCNET cable.	
						Fault in the QD75M.	
	2036	FA.36	—	Transfer error	SSCNET cable or printed board is faulty.	The SSCNET cable is disconnected.	
						The SSCNET cable fault.	
						Printed circuit board fault.	
	2037	FA.37	—	IFU parameter error	IFU parameter setting is wrong.	Interface unit fault caused the IFU parameter setting to be rewritten.	
						There is a IFU parameter whose value was set to outside the setting range by QD75M.	

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	—	—	—	—		Use the regenerative brake option.
	Regenerative brake option					Set correctly.
	30102	30202	30302	30402		
						<ul style="list-style-type: none"> <li>• Change lead.</li> <li>• Connect correctly.</li> </ul>
						Change base unit.
	—	—	—	—		For wire breakage of regenerative brake option, change regenerative brake option.
						Review the power supply.
						Connect correctly.
						Change the SSCNET cable.
	—	—	—	—		Take measures against noise.
						Connect terminal connector.
						Set correctly.
						Review operation program.
	—	—	—	—		Take measures against noise.
						Change the QD75M.
						Connect the connector of the SSCNET cable.
	—	—	—	—		Change the SSCNET cable.
						Change the interface unit.
						Connect terminal connector.
						Change the interface unit.
	—	—	—	—		Change the IFU parameter value to within the setting range.

Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause
		IFU	DRU			
Servo amplifier errors	2037	—	@A.37#	DRU parameter error	DRU parameter setting is wrong.	Drive unit fault caused the DRU parameter setting to be rewritten.
						There is a DRU parameter whose value was set to outside the setting range by QD75M.
						The number of write times to EEPROM exceeded 100,000 due to parameter write, etc.
	2038	FA.38	—	DRU adjustment error	In some drive unit, the parameter which requires all axes to be set for the same value differs from those of the other axes.	There is a drive unit whose DRU parameter [Pr.102] or [Pr.123] setting is different from others.
	2045	—	@A.45#	Main circuit device overheat	Main circuit device overheat.	Air cooling fan of the drive unit stops
						The power supply was turned on and off continuously by overloaded status.
						Drive unit faulty.
	2046	—	@A.46#	Servomotor heated	Servo motor temperature rise actuated the thermal protector.	Servo motor ambient temperature exceeded the operating value of 40°C.
						Servomotor overloaded.
						Thermal protector in encoder is faulty.
	2050	—	@A.50#	Overload 1	Load exceeded overload protection characteristic of drive unit. Load ratio 300%: 1s or more Load ratio 200%: 10s or more	The current exceeded the continuous output current of the drive unit.
						The servo system is unstable, causing hunting.
Collision with the machine.						
Servomotor miswiring drive unit terminals U, V, W phase do not match motor terminals U, V, W phase.						
					The motor encoder fault.	

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—			Change the drive unit.
—	—	—	—			Change the DRU parameter value to within the setting range.
—	—	—	—			Change the servo amplifier.
Regenerative resistor brake option						Set correctly.
30102	30202	30302	30402			
Optional function 1						
30123	30223	30323	30423			
—	—	—	—			<ul style="list-style-type: none"> <li>• Change the drive unit or cooling fan.</li> <li>• Reduce ambient temperature.</li> </ul>
—	—	—	—			The drive method is reviewed.
—	—	—	—			Change the drive unit or cooling fan.
—	—	—	—			Review environment so that ambient temperature is 0 to 40°C.
—	—	—	—			<ul style="list-style-type: none"> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>
—	—	—	—			Change the servomotor.
—	—	—	—			<ul style="list-style-type: none"> <li>• Reduce load.</li> <li>• Review operation pattern.</li> <li>• Use servomotor that provides larger output.</li> </ul>
Auto tuning						<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>• Change " [Pr.109] Servo response" setting.</li> <li>• Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
Input signal logic selection						<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
—	—	—	—			When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.
—	—	—	—			Change servomotor.



Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause	
		IFU	DRU				
	2051	—	@A.51#	Overload 2	Machine collision or the like caused max. output current to flow successively for several seconds. Servomotor locked: 0.3s or more During rotation: 2.5s or more	Collision with the machine	
						Servomotor miswiring drive unit terminals U, V, W phase don't mach motor terminals U, V, W phase.	
						Wrong connection of servomotor. Drive unit's output U, V, W do not match servo motor's input U, V, W.	
						The servo system is unstable, causing hunting.	
						The motor encoder fault.	
Servo amplifier errors	2052	—	@A.52#	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value (Initial value: 2 rotation) of the parameter "Pr.131".	Acceleration/deceleration time constant too small.	
						Torque limit value too small.	
						Start disabled due to insufficient torque caused drop in power supply voltage.	
						The setting value for "Pr.113 Position control gain 1" too small.	
						Servomotor shaft was rotated by external force.	

Related buffer memory address					Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
Input signal logic selection						<ul style="list-style-type: none"> <li>Review operation pattern.</li> <li>Install limit switches.</li> </ul>
31	181	331	481			
—	—	—	—			Connect correctly.
—	—	—	—			Connect correctly.
Auto tuning						<ul style="list-style-type: none"> <li>Repeat acceleration/deceleration to execute "Pr.108 Auto tuning".</li> <li>Change "Pr.109 Servo response" setting.</li> <li>Set "Pr.108 Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
30108	30208	30308	30408			
Servo response						
30109	30209	30309	30409			
—	—	—	—	When the servomotor shaft is rotated with the servo off, the cumulative feedback pulses should vary in proportion to the rotary angle. If the indication skips or returns midway the encoder if faulty.		Change servomotor.
Acceleration time						Increase the acceleration/deceleration time constant.
12, 13	162, 163	312, 313	462, 463			
36, 37	186, 187	336, 337	486, 487			
38, 39	188, 189	338, 339	488, 489			
40, 41	190, 191	340, 341	490, 491			
Deceleration time						
14, 15	164, 165	314, 315	464, 465			
42, 43	192, 193	342, 343	492, 493			
44, 45	194, 195	344, 345	494, 495			
46, 47	196, 197	346, 347	496, 497			
Torque limit value						Increase the torque limit value.
26	176	326	476			
OPR torque limit value						
86	236	386	536			
Torque output setting value						
1552	1652	1752	1852			
—	—	—	—			<ul style="list-style-type: none"> <li>Review the power supply capacity.</li> <li>Use servomotor which provides larger output.</li> </ul>
Positioning gain 1						Increase set value and adjust to ensure proper operation.
30113	30213	30313	30413			
Torque limit value						<ul style="list-style-type: none"> <li>When torque is limited, increase the limit value.</li> <li>Reduce load.</li> <li>Use servomotor that provides larger output.</li> </ul>
26	176	326	476			
OPR torque limit value						
86	236	386	536			
Torque output setting value						
1552	1652	1752	1852			

Classification of errors	Error code	LED indicator of servo amplifier		Error name	Description	Cause	
		IFU	DRU				
Servo amplifier errors	2052	—	@A.52#	Error excessive	Droop pulse of the deviation counter reached or exceeded setting value (Initial value: 2 rotation) of the parameter [Pr.131].	Collision with the machine	
						The motor encoder fault.	
						Servomotor miswiring drive unit terminals U, V, W phase do not match motor terminals U, V, W phase.	
	2053	FA.53	—	Multiple axis overload	Drive unit whose effective load factor is 85% or more is adjacent.	Drive unit having large load is adjacent.	
						Servo system is instable and hunting.	
						Encoder cable and power cable (U, V, W phase) coming out of one drive unit are connected to the incorrect servomotor.	
	2054	FA.54	—	Drive unit alarm	Alarm occurred in one or more axes of drive units installed to the base unit.	Remove the alarm causes of all drive units where alarm has occurred.	
	2090	FA.8A	—	Serial communication time-out	Serial communication stopped for longer than the time set in IFU parameter [Pr.1].	Communication cable fault. (Wire break or short circuit)	
						Communication cycle is longer than the IFU parameter [Pr.1] setting.	
						Protocol is incorrect.	
2086	FA.8E	—	Serial communication error	The fault has occurred in communication between the interface unit and communication devices (e.g. personal computer).	The communication cable fault. (Wire breakage or shot)		
					The communication devices (e.g. personal computer) fault.		

	Related buffer memory address				Check point	Corrective action
	Axis 1	Axis 2	Axis 3	Axis 4		
	Input signal logic selection					<ul style="list-style-type: none"> <li>• Review operation pattern.</li> <li>• Install limit switches.</li> </ul>
	31	181	331	481		Change the servomotor.
	—	—	—	—		Connect correctly.
	—	—	—	—		<ul style="list-style-type: none"> <li>• Change the slot of the drive unit whose load is large.</li> <li>• Reduce the load.</li> <li>• Reexamine the operation pattern.</li> <li>• Use a servomotor whose output is large.</li> </ul>
	Auto tuning					<ul style="list-style-type: none"> <li>• Repeat acceleration/deceleration to execute " [Pr.108] Auto tuning".</li> <li>• Change " [Pr.109] Servo response" setting.</li> <li>• Set " [Pr.108] Auto tuning" to OFF and make gain adjustment manually.</li> </ul>
	30108	30208	30308	30408		
	Servo response					
	30109	30209	30309	30409		
	—	—	—	—		Connect correctly.
	—	—	—	—		Remove the alarm causes of all drive units where alarm has occurred.
						Repair or change the cable.
	—	—	—	—		Set the IFU parameter value correctly. IFU parameter [Pr.1] .
						Correct the protocol.
	—	—	—	—		Repair or change the cable.
						Change the communication device (e.g. personal computer).

## 15.3 List of warnings

The following table shows the warning details and remedies to be taken when a warning occurs.

## 15.3.1 QD75 detection warning

Classification of warnings	Warning code	Warning name	Warning	Operation status at warning occurrence	
—	000	(Normal status)	—	—	
Common warnings	100	Start during operation	The start request is issued while the axis is BUSY.	Continue the operation.	
	104	Restart not possible	The restart command is issued when the axis operation status is not "Stopped".	Continue the operation.	
	109	Teaching in BUSY	The teaching request is issued while the axis is BUSY.	The warning is issued for the axis designated at the time of the teaching request.	
	110	Less than minimum speed	The overridden speed becomes "0".	The system is controlled with the currently executing unit of 1.	
	111	In PLC READY	The request for writing to the flash ROM is issued when the PLC READY is turned ON (at the time of teaching request).	The warning for axis 1 is issued.	
	112	Illegal override value	A value other than 1 to 300 is set for the override value.	<ul style="list-style-type: none"> <li>Controlled at a setting value of 0 : 100.</li> <li>Controlled at a setting value of 301 or over : 300.</li> </ul>	
	113	Outside new torque value range	A value other than 1 to 500 is set for the new torque value.	The torque change is not carried out.	
	114	Below bias speed	The command speed is below the bias speed at start. Programming error between QD75P and QD75M.	Operate by the bias speed at start.	
JOG operation warnings	300	Speed change during deceleration	The speed change request is issued during deceleration stop with JOG start signal OFF.	The speed change is not carried out.	
	301	JOG speed limit value	The new speed value exceeds the JOG speed limit value when the speed is changed during operation.	<ul style="list-style-type: none"> <li>When the speed exceeds the JOG speed limit, the JOG operation is carried out with the JOG speed limit value.</li> <li>While the speed is limited by the JOG speed limit value, the "Speed limiting flag" is turned ON.</li> </ul>	

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—	—	—	—
—	—	—	—	—	—	Normalize the start request ON timing.
1503	1603	1703	1803	<Restart command> 1: Restart	Normalize the start request ON timing. (Refer to Section 6.5.5) (Do not issue the restart command when the axis operation is not stopped.)	
1548 1549	1648 1649	1748 1749	1848 1849	<Teaching data selection> 0, 1 <Teaching positioning data No.> 1 to 600	Carry out the teaching request when the axis is not BUSY. (Refer to Section 12.7.4)	
1513	1613	1713	1813	<Positioning operation speed override> 1 to 300	Prevent the overridden speed from being reduced to 0. (Refer to Section 12.5.2)	
Same as warning code 109						None (If the PLC READY signal (Y0) is turned OFF, respond to the teaching write request).
1513	1613	1713	1813	<Positioning operation speed override> 1 to 300	Set a value within the setting range.	
1525	1625	1725	1825	<New torque value> 1 to [Torque limit set value]		
26	176	326	476	<Torque limit set value> 1 to 500		
Refer to Section 5.3 "List of positioning data" for command speed					<Command speed> 1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or another]	Re-set the command speed/bias speed at start so that the command speed is equal to or larger than the bias speed at start. Set 0 for the bias speed.
Bias speed at start					<Bias speed at start> 0 [PLS/s] 0 [mm/min or another]	
6 7	156 157	306 307	456 457			
1516	1616	1716	1816	<Speed change request> 1: Speed change is requested	Do not carry out the JOG speed change during deceleration with the JOG start signal OFF.	
New speed value					0 to 10000000 [PLS/s] 0 to 2000000000 [mm/min or another]	Bring the set value into the setting range.
1514 1515	1614 1615	1714 1715	1814 1815			
JOG speed limit value						
48 49	198 199	348 349	498 499	1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or another]		

Classification of warnings	Warning code	Warning name	Warning	Operation status at warning occurrence	
Manual pulse generator operation warnings	401	Outside manual pulse generator input magnification range	The manual pulse generator 1 pulse input magnification is set at 0 or 101 or higher.	<ul style="list-style-type: none"> <li>When input magnification is set at 101 or higher: Re-set to 100.</li> <li>When input magnification is set at 0: Re-set to 1.</li> </ul>	
Positioning operation warnings	500	Deceleration/stop speed change	The speed change request is issued during deceleration stop.	The speed change is not carried out.	
	501	Speed limit value over	The new value exceeds the speed limit value when the speed is changed during operation.	<ul style="list-style-type: none"> <li>The speed is controlled with the speed limit value.</li> <li>The "speed limiting flag" is turned ON.</li> </ul>	
	503	M code ON signal ON start	The M code ON signal is turned ON when the positioning data is executed.	Continue executing the positioning data.	
	505	No operation termination setting	In the positioning by block starting, the 50th point of the positioning start data is set to CONTINUE.	The operation is terminated.	
	506	FOR to NEXT nest construction	FOR to NEXT is nested.	The operation is continued.	
	508	Speed-position switching (during acceleration) signal ON	The switching signal for speed-position switching control (INC mode) is turned ON during acceleration.		
	509	Insufficient remaining distance	<ul style="list-style-type: none"> <li>At a continuous operation interrupt request, the distance required deceleration stop is not long enough.</li> <li>At a speed change request, the remaining distance is shorter than the distance required for speed change.</li> </ul>	<ul style="list-style-type: none"> <li>When a command speed is changed: Change to a value as near a new speed value as possible.</li> <li>When a target position is changed: Adjust the speed to a value as near the command speed as possible, and then change to a target position.</li> </ul> (When the operation pattern is a continuous path control, ignore the operations stated above.)	
	511	Step not possible	Code 1 is set for the step start information when the step is outside standby.	The step will not start.	
	512	Illegal external command function	The detailed parameter 2 "External command function selection" setting range is exceeded.	Even if the external command signal is turned ON, the system will not perform anything.	
	513	Insufficient movement amount	The movement amount is not large enough for automatic deceleration.	The system stops immediately after it reaches the positioning address.	

Related buffer memory address					Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4			
1522 1523	1622 1623	1722 1723	1822 1823	<Manual pulse generator 1 pulse input magnification> 1 to 100	Set the manual pulse generator 1 pulse input magnification to within the setting range.	
1516	1616	1716	1816	<Speed change request> 1: Speed change is requested	Do not carry out the speed change during deceleration with a stop command, during stoppage, or during automatic deceleration with position control.	
New speed value					0 to 10000000 [PLS/s] 0 to 2000000000 [mm/min or another]	Set the new speed value to a range of 0 to "speed limit value".
1514 1515	1614 1615	1714 1715	1814 1815			
Speed limit value					1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or another]	
10 11	160 161	310 311	460 461			
1504	1604	1704	1804	<M code OFF request> 1: M code ON signal is turned OFF	Normalize the ON and OFF timings of the "M code OFF request". (Refer to Section 12.7.3)	
Refer to Section 5.3 "List of positioning data"					<Operation pattern> 00: Positioning end 01: Continuous positioning control 11: Continuous path control	Set the operation termination to the 50th point. (Refer to Chapter 10)
—	—	—	—	—	Make 1 nest construction for FOR to NEXT. (Refer to Section 10.3.8)	
—	—	—	—	—	Do not turn ON the speed-position switching signal during acceleration. (Refer to Section 9.2.16)	
—	—	—	—	—	Give a request at the position where there is an enough remaining distance.	
1546	1646	1746	1846	<Step start information> 1: Step is continued 2: Re-start is carried out	Do not set a "1" to the step start information when the step is not in standby state. (Refer to Section 12.7.1)	
62	212	362	512	<External command function selection> 0, 1, 2, 3	Set the detailed parameter 2 "External command function selection" to within the setting range.	
Refer to Section 5.3 "List of positioning data"					—	Set a decelerating address or a movement amount to the positioning data.



Classification of warnings	Warning code	Warning name	Warning	Operation status at warning occurrence	
Positioning operation warnings	514	Outside command speed range	The command speed exceeds the speed limit.	<ul style="list-style-type: none"> <li>The command speed is controlled at the "speed limit value".</li> <li>The "speed limiting flag" turns ON.</li> </ul>	
	516	Illegal teaching data No.	The positioning data No. is set outside the setting range.	Teaching is not carried out when the set value is 0 or 601 or more. (A "0" is canceled by the QD75M automatically even when a "0" or "601" or more is set.)	
	517	Illegal teaching data selection	The teaching data selection set value is outside the setting range.	Teaching is not carried out.	
	518	Target position change not possible	<ul style="list-style-type: none"> <li>A target position change request was given for the control system other than ABS1 and INC1.</li> <li>The target position change request is turned ON during continuous path control.</li> <li>A new target position address is outside the software stroke limit range.</li> <li>A target position change request was given during deceleration to a stop.</li> </ul>	The target position change is not carried out.	

Related buffer memory address				Set range (Setting with PLC program)	Remedy
Axis 1	Axis 2	Axis 3	Axis 4		
For command speed, refer to Section 5.3 "List of positioning data"				1 to 1000000 [PLS/s] 1 to 2000000000 [mm/min or another]	Set the command speed to within the setting range.
Speed limit value				1 to 10000000 [PLS/s] 1 to 2000000000 [mm/min or another]	
10 11	160 161	310 311	460 461		
1549	1649	1749	1849	<Teaching positioning data No.> 1 to 600	Set the positioning data No. to within the setting range.
1548	1648	1748	1848	<Teaching data selection> 0, 1	Set the teaching data selection set value to within the setting range.
1538	1638	1738	1838	<Target position change request flag> 1: Target position change request	<ul style="list-style-type: none"> <li>Do not turn ON the target position change request in the following cases. A control system other than ABS1, and INC1 is used. During deceleration stop. An operating pattern "continuous path control" is used.</li> <li>When the target position change address is outside the stroke limit, correct the target position change address. (Refer to Section 12.7.5)</li> </ul>

15.3.2 MR-H-BN detection warning

Classification of warnings	Warning code	LED display of the servo amplifier	Warning name	Warning	Cause
Servo amplifier warnings	2092	92	Open battery cable warning	Absolute position detection system battery voltage is low.	Battery cable is open.
					Battery voltage dropped to 2.8VDC or less
	2096	96	OPR setting error warning	OPR was not performed successfully.	Droop pulses remaining are greater than the in-position range setting.
					OPR was executed during operation command.
					Creep speed high.
	2102	9F	Battery warning	Voltage of battery for absolute position detection system reduced.	Battery voltage fell to 3.2VDC or less.
	2140	E0	Excessive regenerative load warning	There is a possibility that regenerative power may exceed permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.	Regenerative power increased to 85% or more of permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.
	2141	E1	Over load warning	There is a possibility that overload alarm 1 (error code: 2050) or 2 (error code: 2051) may occur.	Load increased to 85% or more of over load alarm 1 (error code: 2050) or 2 (error code: 2051) occurrence level.
	2144	E4	Parameter alarm warning	Parameter is out of setting range.	Parameter has been set to a value that is out of setting range from QD75M.
	2146	E6	Servo emergency stop warning	EMG1-SG is open.	Emergency stop was made valid. (EMG1-SG was opened.)
2147	E7	Controller emergency stop warning	An emergency stop signal is input to the QD75M.	EMG (6 pin) or EMG* (16 pin) in the SSCNET cable is open.	
				Fault of connector in the servo amplifier.	
				Fault of connector in the QD75. A "watchdog error" will be occurred in the QD75.	
2149	E9	Main circuit of warning	Servo ON signal is turned ON while the main circuit power is off.	Servo ON signal is turned ON while the main circuit power is off.	

Related buffer memory address				Servo amplifier status of the warning occurrence.	Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4			
—	—	—	—	Servo ON continued		Repair cable or battery changed.
						Change battery.
In-position range						Remove the cause of droop pulse occurrence.
30120	30220	30320	30420			OPR wasn't executed during operation command.
—	—	—	—			Reduce creep speed.
Creep speed						
76, 77	226, 227	376, 377	526, 527			
—	—	—	—			Change battery.
—	—	—	—			Reduce frequency of positioning.
					Call the status display and check regenerative load ratio.	Change regenerative brake option for the one with larger capacity.
					Reduce load.	
—	—	—	—		Refer to error code (2050, 2051) (Refer to Section 15.2.3)	Refer to error code (2050, 2051) (Refer to Section 15.2.3)
Refer to Section 5.2.7 to 5.2.10						Set the parameter properly.
Servo emergency stop selection				Servo OFF		Check for safety and release the emergency stop.
30123	30223	30323	30423			
—	—	—	—		Check continuity status of the SSCNET cable	Repair cable or battery changed.
—	—	—	—			Change servo amplifier.
—	—	—	—			Change QD75.
—	—	—	—			Switch on main circuit power.

15.3.3 MR-J2-B detection warning

Classification of warnings	Warning code	LED display of the servo amplifier	Warning name	Warning	Cause
Servo amplifier warnings	2092	92	Open battery cable warning	Absolute position detection system battery voltage is low.	Battery cable is open.
					Battery voltage dropped to 2.8VDC or less
	2096	96	OPR setting error warning	OPR was not performed successfully.	Droop pulses remaining are greater than the in-position range setting.
					OPR was executed during operation command.
					Creep speed high.
	2140	E0	Excessive regenerative load warning	There is a possibility that regenerative power may exceed permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.	Regenerative power increased to 85% or more of permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.
	2141	E1	Over load warning	There is a possibility that overload alarm 1 (error code: 2050) or 2 (error code: 2051) may occur.	Load increased to 85% or more of over load alarm 1 (error code: 2050) or 2 (error code: 2051) occurrence level.
	2143	E3	Absolute position counter warning	Absolute position encoder pulses faulty.	Noise entered the encoder.
					Fault of the encoder.
	2144	E4	Parameter warning	Parameter outside setting range.	Parameter value set from QD75 controller is outside setting range.
	2146	E6	Servo emergency stop warning	EMG1-SG is open.	Emergency stop was made valid. (EMG1-SG was opened.)
2147	E7	Controller emergency stop warning	An emergency stop signal is input to the QD75.	EMG (6 pin) or EMG* (16 pin) in the SSCNET cable is open.	
				Fault of connector in the servo amplifier.	
				Fault of connector in the QD75. A "watchdog error" will be occurred in the QD75.	
2149	E9	Main circuit of warning	Servo ON signal is turned ON while the main circuit power is off.	Servo ON signal is turned ON while the main circuit power is off.	

Related buffer memory address				Servo amplifier status of the warning occurrence.	Check point	Corrective action	
Axis 1	Axis 2	Axis 3	Axis 4				
—	—	—	—	Servo ON continued		Repair cable or battery changed. Change battery.	
In-position range						Remove the cause of droop pulse occurrence.	
30120	30220	30320	30420			OPR wasn't executed during operation command.	
—	—	—	—			Reduce creep speed.	
Creep speed						Call the status display and check regenerative load ratio.	<ul style="list-style-type: none"> <li>• Reduce frequency of positioning.</li> <li>• Change regenerative brake option for the one with larger capacity.</li> <li>• Reduce load.</li> </ul>
76, 77	226, 227	376, 377	526, 527				
—	—	—	—			Refer to error code (2050, 2051) (Refer to Section 15.2.3)	Refer to error code (2050, 2051) (Refer to Section 15.2.3)
—	—	—	—				Take noise suppression measures.
—	—	—	—				Change servomotor.
Refer to Section 5.2.7 to 5.2.10							Set the parameter properly.
Servo emergency stop selection				Servo OFF		Check for safety and release the emergency stop.	
30123	30223	30323	30423		Check continuity status of the SSCNET cable	Repair cable or battery changed. Change servo amplifier.	
—	—	—	—			Change QD75.	
—	—	—	—			Switch on main circuit power.	
—	—	—	—				
—	—	—	—				

## 15.3.4 MR-J2S-B detection warning

Classification of warnings	Warning code	LED display of the servo amplifier	Warning name	Warning	Cause
Servo amplifier warnings	2092	92	Open battery cable warning	Absolute position detection system battery voltage is low.	Battery cable is open.
					Battery voltage dropped to 2.8VDC or less
	2096	96	OPR setting error warning	OPR was not performed successfully.	Droop pulses remaining are greater than the in-position range setting.
					OPR was executed during operation command.
					Creep speed high.
	2102	9F	Battery warning	Voltage of battery for absolute position detection system reduced.	Battery voltage fell to 3.2VDC or less.
	2140	E0	Excessive regenerative load warning	There is a possibility that regenerative power may exceed permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.	Regenerative power increased to 85% or more of permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.
	2141	E1	Over load warning	There is a possibility that overload alarm 1 (error code: 2050) or 2 (error code: 2051) may occur.	Load increased to 85% or more of over load alarm 1 (error code: 2050) or 2 (error code: 2051) occurrence level.
	2143	E3	Absolute position counter warning	Absolute position encoder pulses faulty.	Noise entered the encoder.
					Fault of the encoder.
	2144	E4	Parameter warning	Parameter outside setting range.	Parameter value set from QD75 controller is outside setting range.
	2146	E6	Servo emergency stop warning	EMG1-SG is open.	Emergency stop was made valid. (EMG1-SG was opened.)
2147	E7	Controller emergency stop warning	An emergency stop signal is input to the QD75.	EMG (6 pin) or EMG* (16 pin) in the SSCNET cable is open.	
				Fault of connector in the servo amplifier.	
				Fault of connector in the QD75.	
2149	E9	Main circuit of warning	Servo ON signal is turned ON while the main circuit power is off.	Servo ON signal is turned ON while the main circuit power is off.	

Related buffer memory address					Servo amplifier status of the warning occurrence.	Check point	Corrective action		
Axis 1	Axis 2	Axis 3	Axis 4						
—	—	—	—		Servo ON continued	Repair cable or battery changed.			
						Change battery.			
In-position range						Servo ON continued	Remove the cause of droop pulse occurrence.		
30120	30220	30320	30420				OPR wasn't executed during operation command.		
—	—	—	—				Reduce creep speed.		
Creep speed							Servo ON continued		
76, 77	226, 227	376, 377	526, 527					Change battery.	
—	—	—	—					Call the status display and check regenerative load ratio.	
—	—	—	—					<ul style="list-style-type: none"> <li>• Reduce frequency of positioning.</li> <li>• Change regenerative brake option for the one with larger capacity.</li> <li>• Reduce load.</li> </ul>	
—	—	—	—					Refer to error code (2050, 2051) (Refer to Section 15.2.3)	
—	—	—	—					Refer to error code (2050, 2051) (Refer to Section 15.2.3)	
—	—	—	—					Take noise suppression measures.	
—	—	—	—					Change servomotor.	
Refer to Section 5.2.7 to 5.2.10								Servo OFF	Set the parameter properly.
Servo emergency stop selection					Servo OFF				Check for safety and release the emergency stop.
30123	30223	30323	30423						Check continuity status of the SSCNET cable
—	—	—	—			Repair cable or battery changed.			
—	—	—	—			Change servo amplifier.			
—	—	—	—			Change QD75.			
—	—	—	—			Switch on main circuit power.			



## 15.3.5 MR-J2-Jr detection warning

Classification of warnings	Warning code	LED display of the servo amplifier	Warning name	Warning	Cause
Servo amplifier warnings	2141	E1	Over load warning	There is a possibility that overload alarm 1 (error code: 2050) or 2 (error code: 2051) may occur.	Load increased to 85% or more of over load alarm 1 (error code: 2050) or 2 (error code: 2051) occurrence level.
	2144	E4	Parameter warning	Parameter outside setting range.	Parameter value set from QD75M controller is outside setting range.
	2146	E6	Servo emergency stop warning	EMG1-SG is open.	Emergency stop was made valid. (EMG1-SG was opened.)
	2147	E7	Controller emergency stop warning	An emergency stop signal is input to the QD75.	EMG (6 pin) or EMG* (16 pin) in the SSCNET cable is open.
					Fault of connector in the servo amplifier.
Fault of connector in the QD75.					
2149	E9	Main circuit of warning	Servo ON signal is turned ON while the main circuit power is off.	Servo ON signal is turned ON while the main circuit power is off.	

Related buffer memory address					Servo amplifier status of the warning occurrence.	Check point	Corrective action	
Axis 1	Axis 2	Axis 3	Axis 4					
—	—	—	—	—	Servo ON continued	Refer to error code (2050, 2051) (Refer to Section 15.2.3)	Refer to error code (2050, 2051) (Refer to Section 15.2.3)	
Refer to Section 5.2.7 to 5.2.10								Set the parameter properly.
Servo emergency stop selection					Servo OFF		Check for safety and release the emergency stop.	
30123	30223	30323	30423				Check continuity status of the SSCNET cable	Repair cable or battery changed.
—	—	—	—					Change servo amplifier.
—	—	—	—					Change QD75.
—	—	—	—					Switch on main circuit power.
—	—	—	—					

15.3.6 MR-J2M-B detection warning


@ in the indication field denotes the slot number of the base unit and # the axis number of the servo amplifier.

Classification of warnings	Warning code	LED display of the servo amplifier		Warning name	Warning	Cause	
		IFU	DRU				
Servo amplifier warnings	2092	—	@A.92#	Open battery cable warning	Absolute position detection system battery voltage is low.	Battery cable is open.	
						Battery voltage dropped to 2.8VDC or less	
						Encoder cable is open.	
	2096	—	@A.96#	OPR setting error warning	OPR was not performed successfully.	Droop pulses remaining are greater than the in-position range setting.	
						OPR was executed during operation command.	
						Creep speed high.	
	2102	FA.9F	—	Battery warning	Voltage of battery for absolute position detection system reduced.	Battery voltage fell to 3.2VDC or less.	
	2140	FA.E0	—	Excessive regenerative load warning	There is a possibility that regenerative power may exceed permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.	Regenerative power increased to 85% or more of permissible regenerative power of built-in regenerative brake resistor or regenerative brake option.	
	2141	—	@A.E1#	Over load warning	There is a possibility that overload alarm 1 (error code: 2050) or 2 (error code: 2051) may occur.	Load increased to 85% or more of over load alarm 1 (error code: 2050) or 2 (error code: 2051) occurrence level.	
	2143	—	@A.E3#	Absolute position counter warning	Absolute position encoder pulses faulty.	Noise entered the encoder.	
Fault of the encoder.							
2144	—	@A.E4#	Parameter warning	Parameter outside setting range.	Parameter value set from QD75 controller is outside setting range.		
2146	FA.E6	—	Servo emergency stop warning	EMG1-SG is open.	Emergency stop was made valid. (EMG1-SG was opened.)		
2147	FA.E7	—	Controller emergency stop warning	An emergency stop signal is input to the QD75.	EMG (6 pin) or EMG* (16 pin) in the SSCNET cable is open.		
					Fault of connector in the servo amplifier.		
					Fault of connector in the QD75.		
					A "watchdog error" will be occurred in the QD75.		
2149	FA.E9	—	Main circuit of warning	Servo ON signal is turned ON while the main circuit power is off.	Servo ON signal is turned ON while the main circuit power is off.		

Related buffer memory address					Servo amplifier status of the warning occurrence.	Check point	Corrective action
Axis 1	Axis 2	Axis 3	Axis 4				
—	—	—	—		Servo ON continued	Repair cable or battery changed.	
—	—	—	—			Change battery.	
—	—	—	—			Change encoder cable.	
In-position range						Remove the cause of droop pulse occurrence.	
30120	30220	30320	30420				
—	—	—	—			OPR wasn't executed during operation command.	
Creep speed						Reduce creep speed.	
76, 77	226, 227	376, 377	526, 527				
—	—	—	—			Change battery unit.	
—	—	—	—			Call the status display and check regenerative load ratio.	Reduce frequency of positioning.
—	—	—	—				Change regenerative brake option for the one with larger capacity.
—	—	—	—				Reduce load.
—	—	—	—			Refer to error code (2050, 2051) (Refer to Section 15.2.3)	Refer to error code (2050, 2051) (Refer to Section 15.2.3)
—	—	—	—				Take noise suppression measures.
—	—	—	—		Change servomotor.		
Refer to Section 5.2.7 to 5.2.10						Set the parameter properly.	
Servo emergency stop selection					Servo OFF	Check for safety and release the emergency stop.	
30123	30223	30323	30423			Check continuity status of the SSCNET cable	
—	—	—	—			Repair cable or battery changed.	
—	—	—	—			Change servo amplifier.	
—	—	—	—			Change QD75.	
—	—	—	—			Switch on main circuit power.	

15.4 LED display functions

The states of QD75 and each axis control can be confirmed by the LEDs located on the front panel of the QD75 main unit.

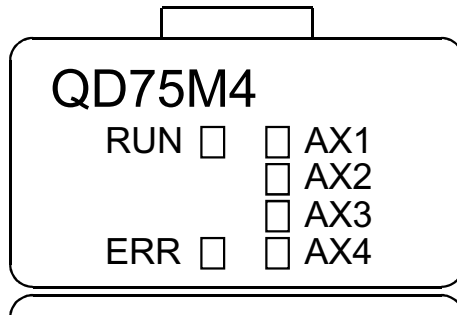

Each axis can be monitored by the states of the LEDs.  
The operation and indications of the LEDs are as shown below.

Details of indication Goes OFF <input type="checkbox"/> Goes ON <input checked="" type="checkbox"/> Flashes <input checked="" type="checkbox"/>	Points to be confirmed	Error	Remedy
RUN <input type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	Extinguishment of RUN LED	The hardware is faulty or watch dog timer error occurs.	If the RUN LED does not light up even when the power is turned ON, the module may be out of order. Replace the module with a new one.
RUN <input checked="" type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	Lighting of RUN LED, Extinguishment of ERR LED	The module is normal.	—
RUN <input checked="" type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input checked="" type="checkbox"/> <input type="checkbox"/> AX4	Lighting of ERR LED	System error	An operation condition setting error or installation PLC CPU type error occurs. (The setting and PLC CPU type are outside the specification range.) Set the PLC CPU type to a one contained in the specification.
RUN <input checked="" type="checkbox"/> <input type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	Extinguishment of AX1 to AX4 LEDs	During axis stop, during axis standby	—
RUN <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input type="checkbox"/> <input type="checkbox"/> AX4	Lighting of AX1 (Same even if the other axis is lit)	During axis operation	This lights up from the positioning start until the positioning is completed, stopped temporarily, or stopped by error (corresponding at a ratio of 1 : 1 to BUSY signals).
RUN <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX1 <input type="checkbox"/> AX2 <input type="checkbox"/> AX3 ERR <input checked="" type="checkbox"/> <input type="checkbox"/> AX4	Flashing of ERR LED Flashing of AX1 LED (Same even if the other axis flashes)	Axis error	Check the error observed on the buffer memory batch processing monitor of a peripheral device and correct the applicable parameters and positioning data.
RUN <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX1 <input checked="" type="checkbox"/> AX2 <input checked="" type="checkbox"/> AX3 ERR <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> AX4	Lighting of all LEDs	The hardware is faulty	The module comes out of order. Replace the module with a new one.

# Appendices

Appendix 1 Functions .....	Appendix- 3
Appendix 1.1 Multiple CPU correspond function.....	Appendix- 3
Appendix 1.2 The combination of software package for QD75 and QCPU .....	Appendix- 3
Appendix 2 Positioning data (No.1 to 600) List of buffer memory addresses .....	Appendix- 4
Appendix 3 Connection with servo amplifiers.....	Appendix- 28
Appendix 3.1 Connection of SSCNET cables .....	Appendix- 28
Appendix 3.2 Wiring of SSCNET cables .....	Appendix- 30
Appendix 4 Connection with external device connector .....	Appendix- 34
Appendix 4.1 Connector.....	Appendix- 34
Appendix 4.2 Wiring of manual pulse generator .....	Appendix- 36
Appendix 5 Comparisons with conventional positioning modules .....	Appendix- 37
Appendix 5.1 Comparisons with QD75P model.....	Appendix- 37
Appendix 5.2 Comparisons with A1SD75M1/A1SD75M2/ A1SD75M3 models .....	Appendix- 38
Appendix 6 Positioning control troubleshooting .....	Appendix- 57
Appendix 7 List of buffer memory addresses .....	Appendix- 63
Appendix 8 External dimension drawing .....	Appendix- 75



## Appendix 1 Functions

### Appendix 1.1 Multiple CPU correspond function

Refer to the QCPU (Q Mode) User's Manual (Function Explanation/Program Fundamentals). (SH-080038)

### Appendix 1.2 The combination of software package for QD75 and QCPU

Refer to the GX Configurator-QP Operating Manual. (SH-080172)



Appendix 2 Positioning data (No.1 to 600)  
List of buffer memory addresses

(1) For axis 1

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
1	2000	2001	2002	2004	2005	2006	2007	2008	2009
2	2010	2011	2012	2014	2015	2016	2017	2018	2019
3	2020	2021	2022	2024	2025	2026	2027	2028	2029
4	2030	2031	2032	2034	2035	2036	2037	2038	2039
5	2040	2041	2042	2044	2045	2046	2047	2048	2049
6	2050	2051	2052	2054	2055	2056	2057	2058	2059
7	2060	2061	2062	2064	2065	2066	2067	2068	2069
8	2070	2071	2072	2074	2075	2076	2077	2078	2079
9	2080	2081	2082	2084	2085	2086	2087	2088	2089
10	2090	2091	2092	2094	2095	2096	2097	2098	2099
11	2100	2101	2102	2104	2105	2106	2107	2108	2109
12	2110	2111	2112	2114	2115	2116	2117	2118	2119
13	2120	2121	2122	2124	2125	2126	2127	2128	2129
14	2130	2131	2132	2134	2135	2136	2137	2138	2139
15	2140	2141	2142	2144	2145	2146	2147	2148	2149
16	2150	2151	2152	2154	2155	2156	2157	2158	2159
17	2160	2161	2162	2164	2165	2166	2167	2168	2169
18	2170	2171	2172	2174	2175	2176	2177	2178	2179
19	2180	2181	2182	2184	2185	2186	2187	2188	2189
20	2190	2191	2192	2194	2195	2196	2197	2198	2199
21	2200	2201	2202	2204	2205	2206	2207	2208	2209
22	2210	2211	2212	2214	2215	2216	2217	2218	2219
23	2220	2221	2222	2224	2225	2226	2227	2228	2229
24	2230	2231	2232	2234	2235	2236	2237	2238	2239
25	2240	2241	2242	2244	2245	2246	2247	2248	2249
26	2250	2251	2252	2254	2255	2256	2257	2258	2259
27	2260	2261	2262	2264	2265	2266	2267	2268	2269
28	2270	2271	2272	2274	2275	2276	2277	2278	2279
29	2280	2281	2282	2284	2285	2286	2287	2288	2289
30	2290	2291	2292	2294	2295	2296	2297	2298	2299
31	2300	2301	2302	2304	2305	2306	2307	2308	2309
32	2310	2311	2312	2314	2315	2316	2317	2318	2319
33	2320	2321	2322	2324	2325	2326	2327	2328	2329
34	2330	2331	2332	2334	2335	2336	2337	2338	2339
35	2340	2341	2342	2344	2345	2346	2347	2348	2349
36	2350	2351	2352	2354	2355	2356	2357	2358	2359
37	2360	2361	2362	2364	2365	2366	2367	2368	2369
38	2370	2371	2372	2374	2375	2376	2377	2378	2379
39	2380	2381	2382	2384	2385	2386	2387	2388	2389
40	2390	2391	2392	2394	2395	2396	2397	2398	2399
41	2400	2401	2402	2404	2405	2406	2407	2408	2409
42	2410	2411	2412	2414	2415	2416	2417	2418	2419
43	2420	2421	2422	2424	2425	2426	2427	2428	2429
44	2430	2431	2432	2434	2435	2436	2437	2438	2439
45	2440	2441	2442	2444	2445	2446	2447	2448	2449
46	2450	2451	2452	2454	2455	2456	2457	2458	2459
47	2460	2461	2462	2464	2465	2466	2467	2468	2469
48	2470	2471	2472	2474	2475	2476	2477	2478	2479
49	2480	2481	2482	2484	2485	2486	2487	2488	2489
50	2490	2491	2492	2494	2495	2496	2497	2498	2499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
51	2500	2501	2502	2504	2505	2506	2507	2508	2509
52	2510	2511	2512	2514	2515	2516	2517	2518	2519
53	2520	2521	2522	2524	2525	2526	2527	2528	2529
54	2530	2531	2532	2534	2535	2536	2537	2538	2539
55	2540	2541	2542	2544	2545	2546	2547	2548	2549
56	2550	2551	2552	2554	2555	2556	2557	2558	2559
57	2560	2561	2562	2564	2565	2566	2567	2568	2569
58	2570	2571	2572	2574	2575	2576	2577	2578	2579
59	2580	2581	2582	2584	2585	2586	2587	2588	2589
60	2590	2591	2592	2594	2595	2596	2597	2598	2599
61	2600	2601	2602	2604	2605	2606	2607	2608	2609
62	2610	2611	2612	2614	2615	2616	2617	2618	2619
63	2620	2621	2622	2624	2625	2626	2627	2628	2629
64	2630	2631	2632	2634	2635	2636	2637	2638	2639
65	2640	2641	2642	2644	2645	2646	2647	2648	2649
66	2650	2651	2652	2654	2655	2656	2657	2658	2659
67	2660	2661	2662	2664	2665	2666	2667	2668	2669
68	2670	2671	2672	2674	2675	2676	2677	2678	2679
69	2680	2681	2682	2684	2685	2686	2687	2688	2689
70	2690	2691	2692	2694	2695	2696	2697	2698	2699
71	2700	2701	2702	2704	2705	2706	2707	2708	2709
72	2710	2711	2712	2714	2715	2716	2717	2718	2719
73	2720	2721	2722	2724	2725	2726	2727	2728	2729
74	2730	2731	2732	2734	2735	2736	2737	2738	2739
75	2740	2741	2742	2744	2745	2746	2747	2748	2749
76	2750	2751	2752	2754	2755	2756	2757	2758	2759
77	2760	2761	2762	2764	2765	2766	2767	2768	2769
78	2770	2771	2772	2774	2775	2776	2777	2778	2779
79	2780	2781	2782	2784	2785	2786	2787	2788	2789
80	2790	2791	2792	2794	2795	2796	2797	2798	2799
81	2800	2801	2802	2804	2805	2806	2807	2808	2809
82	2810	2811	2812	2814	2815	2816	2817	2818	2819
83	2820	2821	2822	2824	2825	2826	2827	2828	2829
84	2830	2831	2832	2834	2835	2836	2837	2838	2839
85	2840	2841	2842	2844	2845	2846	2847	2848	2849
86	2850	2851	2852	2854	2855	2856	2857	2858	2859
87	2860	2861	2862	2864	2865	2866	2867	2868	2869
88	2870	2871	2872	2874	2875	2876	2877	2878	2879
89	2880	2881	2882	2884	2885	2886	2887	2888	2889
90	2890	2891	2892	2894	2895	2896	2897	2898	2899
91	2900	2901	2902	2904	2905	2906	2907	2908	2909
92	2910	2911	2912	2914	2915	2916	2917	2918	2919
93	2920	2921	2922	2924	2925	2926	2927	2928	2929
94	2930	2931	2932	2934	2935	2936	2937	2938	2939
95	2940	2941	2942	2944	2945	2946	2947	2948	2949
96	2950	2951	2952	2954	2955	2956	2957	2958	2959
97	2960	2961	2962	2964	2965	2966	2967	2968	2969
98	2970	2971	2972	2974	2975	2976	2977	2978	2979
99	2980	2981	2982	2984	2985	2986	2987	2988	2989
100	2990	2991	2992	2994	2995	2996	2997	2998	2999

(1) For axis 1

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
101	3000	3001	3002	3004	3005	3006	3007	3008	3009
102	3010	3011	3012	3014	3015	3016	3017	3018	3019
103	3020	3021	3022	3024	3025	3026	3027	3028	3029
104	3030	3031	3032	3034	3035	3036	3037	3038	3039
105	3040	3041	3042	3044	3045	3046	3047	3048	3049
106	3050	3051	3052	3054	3055	3056	3057	3058	3059
107	3060	3061	3062	3064	3065	3066	3067	3068	3069
108	3070	3071	3072	3074	3075	3076	3077	3078	3079
109	3080	3081	3082	3084	3085	3086	3087	3088	3089
110	3090	3091	3092	3094	3095	3096	3097	3098	3099
111	3100	3101	3102	3104	3105	3106	3107	3108	3109
112	3110	3111	3112	3114	3115	3116	3117	3118	3119
113	3120	3121	3122	3124	3125	3126	3127	3128	3129
114	3130	3131	3132	3134	3135	3136	3137	3138	3139
115	3140	3141	3142	3144	3145	3146	3147	3148	3149
116	3150	3151	3152	3154	3155	3156	3157	3158	3159
117	3160	3161	3162	3164	3165	3166	3167	3168	3169
118	3170	3171	3172	3174	3175	3176	3177	3178	3179
119	3180	3181	3182	3184	3185	3186	3187	3188	3189
120	3190	3191	3192	3194	3195	3196	3197	3198	3199
121	3200	3201	3202	3204	3205	3206	3207	3208	3209
122	3210	3211	3212	3214	3215	3216	3217	3218	3219
123	3220	3221	3222	3224	3225	3226	3227	3228	3229
124	3230	3231	3232	3234	3235	3236	3237	3238	3239
125	3240	3241	3242	3244	3245	3246	3247	3248	3249
126	3250	3251	3252	3254	3255	3256	3257	3258	3259
127	3260	3261	3262	3264	3265	3266	3267	3268	3269
128	3270	3271	3272	3274	3275	3276	3277	3278	3279
129	3280	3281	3282	3284	3285	3286	3287	3288	3289
130	3290	3291	3292	3294	3295	3296	3297	3298	3299
131	3300	3301	3302	3304	3305	3306	3307	3308	3309
132	3310	3311	3312	3314	3315	3316	3317	3318	3319
133	3320	3321	3322	3324	3325	3326	3327	3328	3329
134	3330	3331	3332	3334	3335	3336	3337	3338	3339
135	3340	3341	3342	3344	3345	3346	3347	3348	3349
136	3350	3351	3352	3354	3355	3356	3357	3358	3359
137	3360	3361	3362	3364	3365	3366	3367	3368	3369
138	3370	3371	3372	3374	3375	3376	3377	3378	3379
139	3380	3381	3382	3384	3385	3386	3387	3388	3389
140	3390	3391	3392	3394	3395	3396	3397	3398	3399
141	3400	3401	3402	3404	3405	3406	3407	3408	3409
142	3410	3411	3412	3414	3415	3416	3417	3418	3419
143	3420	3421	3422	3424	3425	3426	3427	3428	3429
144	3430	3431	3432	3434	3435	3436	3437	3438	3439
145	3440	3441	3442	3444	3445	3446	3447	3448	3449
146	3450	3451	3452	3454	3455	3456	3457	3458	3459
147	3460	3461	3462	3464	3465	3466	3467	3468	3469
148	3470	3471	3472	3474	3475	3476	3477	3478	3479
149	3480	3481	3482	3484	3485	3486	3487	3488	3489
150	3490	3491	3492	3494	3495	3496	3497	3498	3499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
151	3500	3501	3502	3504	3505	3506	3507	3508	3509
152	3510	3511	3512	3514	3515	3516	3517	3518	3519
153	3520	3521	3522	3524	3525	3526	3527	3528	3529
154	3530	3531	3532	3534	3535	3536	3537	3538	3539
155	3540	3541	3542	3544	3545	3546	3547	3548	3549
156	3550	3551	3552	3554	3555	3556	3557	3558	3559
157	3560	3561	3562	3564	3565	3566	3567	3568	3569
158	3570	3571	3572	3574	3575	3576	3577	3578	3579
159	3580	3581	3582	3584	3585	3586	3587	3588	3589
160	3590	3591	3592	3594	3595	3596	3597	3598	3599
161	3600	3601	3602	3604	3605	3606	3607	3608	3609
162	3610	3611	3612	3614	3615	3616	3617	3618	3619
163	3620	3621	3622	3624	3625	3626	3627	3628	3629
164	3630	3631	3632	3634	3635	3636	3637	3638	3639
165	3640	3641	3642	3644	3645	3646	3647	3648	3649
166	3650	3651	3652	3654	3655	3656	3657	3658	3659
167	3660	3661	3662	3664	3665	3666	3667	3668	3669
168	3670	3671	3672	3674	3675	3676	3677	3678	3679
169	3680	3681	3682	3684	3685	3686	3687	3688	3689
170	3690	3691	3692	3694	3695	3696	3697	3698	3699
171	3700	3701	3702	3704	3705	3706	3707	3708	3709
172	3710	3711	3712	3714	3715	3716	3717	3718	3719
173	3720	3721	3722	3724	3725	3726	3727	3728	3729
174	3730	3731	3732	3734	3735	3736	3737	3738	3739
175	3740	3741	3742	3744	3745	3746	3747	3748	3749
176	3750	3751	3752	3754	3755	3756	3757	3758	3759
177	3760	3761	3762	3764	3765	3766	3767	3768	3769
178	3770	3771	3772	3774	3775	3776	3777	3778	3779
179	3780	3781	3782	3784	3785	3786	3787	3788	3789
180	3790	3791	3792	3794	3795	3796	3797	3798	3799
181	3800	3801	3802	3804	3805	3806	3807	3808	3809
182	3810	3811	3812	3814	3815	3816	3817	3818	3819
183	3820	3821	3822	3824	3825	3826	3827	3828	3829
184	3830	3831	3832	3834	3835	3836	3837	3838	3839
185	3840	3841	3842	3844	3845	3846	3847	3848	3849
186	3850	3851	3852	3854	3855	3856	3857	3858	3859
187	3860	3861	3862	3864	3865	3866	3867	3868	3869
188	3870	3871	3872	3874	3875	3876	3877	3878	3879
189	3880	3881	3882	3884	3885	3886	3887	3888	3889
190	3890	3891	3892	3894	3895	3896	3897	3898	3899
191	3900	3901	3902	3904	3905	3906	3907	3908	3909
192	3910	3911	3912	3914	3915	3916	3917	3918	3919
193	3920	3921	3922	3924	3925	3926	3927	3928	3929
194	3930	3931	3932	3934	3935	3936	3937	3938	3939
195	3940	3941	3942	3944	3945	3946	3947	3948	3949
196	3950	3951	3952	3954	3955	3956	3957	3958	3959
197	3960	3961	3962	3964	3965	3966	3967	3968	3969
198	3970	3971	3972	3974	3975	3976	3977	3978	3979
199	3980	3981	3982	3984	3985	3986	3987	3988	3989
200	3990	3991	3992	3994	3995	3996	3997	3998	3999

(1) For axis 1

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
201	4000	4001	4002	4004	4005	4006	4007	4008	4009
202	4010	4011	4012	4014	4015	4016	4017	4018	4019
203	4020	4021	4022	4024	4025	4026	4027	4028	4029
204	4030	4031	4032	4034	4035	4036	4037	4038	4039
205	4040	4041	4042	4044	4045	4046	4047	4048	4049
206	4050	4051	4052	4054	4055	4056	4057	4058	4059
207	4060	4061	4062	4064	4065	4066	4067	4068	4069
208	4070	4071	4072	4074	4075	4076	4077	4078	4079
209	4080	4081	4082	4084	4085	4086	4087	4088	4089
210	4090	4091	4092	4094	4095	4096	4097	4098	4099
211	4100	4101	4102	4104	4105	4106	4107	4108	4109
212	4110	4111	4112	4114	4115	4116	4117	4118	4119
213	4120	4121	4122	4124	4125	4126	4127	4128	4129
214	4130	4131	4132	4134	4135	4136	4137	4138	4139
215	4140	4141	4142	4144	4145	4146	4147	4148	4149
216	4150	4151	4152	4154	4155	4156	4157	4158	4159
217	4160	4161	4162	4164	4165	4166	4167	4168	4169
218	4170	4171	4172	4174	4175	4176	4177	4178	4179
219	4180	4181	4182	4184	4185	4186	4187	4188	4189
220	4190	4191	4192	4194	4195	4196	4197	4198	4199
221	4200	4201	4202	4204	4205	4206	4207	4208	4209
222	4210	4211	4212	4214	4215	4216	4217	4218	4219
223	4220	4221	4222	4224	4225	4226	4227	4228	4229
224	4230	4231	4232	4234	4235	4236	4237	4238	4239
225	4240	4241	4242	4244	4245	4246	4247	4248	4249
226	4250	4251	4252	4254	4255	4256	4257	4258	4259
227	4260	4261	4262	4264	4265	4266	4267	4268	4269
228	4270	4271	4272	4274	4275	4276	4277	4278	4279
229	4280	4281	4282	4284	4285	4286	4287	4288	4289
230	4290	4291	4292	4294	4295	4296	4297	4298	4299
231	4300	4301	4302	4304	4305	4306	4307	4308	4309
232	4310	4311	4312	4314	4315	4316	4317	4318	4319
233	4320	4321	4322	4324	4325	4326	4327	4328	4329
234	4330	4331	4332	4334	4335	4336	4337	4338	4339
235	4340	4341	4342	4344	4345	4346	4347	4348	4349
236	4350	4351	4352	4354	4355	4356	4357	4358	4359
237	4360	4361	4362	4364	4365	4366	4367	4368	4369
238	4370	4371	4372	4374	4375	4376	4377	4378	4379
239	4380	4381	4382	4384	4385	4386	4387	4388	4389
240	4390	4391	4392	4394	4395	4396	4397	4398	4399
241	4400	4401	4402	4404	4405	4406	4407	4408	4409
242	4410	4411	4412	4414	4415	4416	4417	4418	4419
243	4420	4421	4422	4424	4425	4426	4427	4428	4429
244	4430	4431	4432	4434	4435	4436	4437	4438	4439
245	4440	4441	4442	4444	4445	4446	4447	4448	4449
246	4450	4451	4452	4454	4455	4456	4457	4458	4459
247	4460	4461	4462	4464	4465	4466	4467	4468	4469
248	4470	4471	4472	4474	4475	4476	4477	4478	4479
249	4480	4481	4482	4484	4485	4486	4487	4488	4489
250	4490	4491	4492	4494	4495	4496	4497	4498	4499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
251	4500	4501	4502	4504	4505	4506	4507	4508	4509
252	4510	4511	4512	4514	4515	4516	4517	4518	4519
253	4520	4521	4522	4524	4525	4526	4527	4528	4529
254	4530	4531	4532	4534	4535	4536	4537	4538	4539
255	4540	4541	4542	4544	4545	4546	4547	4548	4549
256	4550	4551	4552	4554	4555	4556	4557	4558	4559
257	4560	4561	4562	4564	4565	4566	4567	4568	4569
258	4570	4571	4572	4574	4575	4576	4577	4578	4579
259	4580	4581	4582	4584	4585	4586	4587	4588	4589
260	4590	4591	4592	4594	4595	4596	4597	4598	4599
261	4600	4601	4602	4604	4605	4606	4607	4608	4609
262	4610	4611	4612	4614	4615	4616	4617	4618	4619
263	4620	4621	4622	4624	4625	4626	4627	4628	4629
264	4630	4631	4632	4634	4635	4636	4637	4638	4639
265	4640	4641	4642	4644	4645	4646	4647	4648	4649
266	4650	4651	4652	4654	4655	4656	4657	4658	4659
267	4660	4661	4662	4664	4665	4666	4667	4668	4669
268	4670	4671	4672	4674	4675	4676	4677	4678	4679
269	4680	4681	4682	4684	4685	4686	4687	4688	4689
270	4690	4691	4692	4694	4695	4696	4697	4698	4699
271	4700	4701	4702	4704	4705	4706	4707	4708	4709
272	4710	4711	4712	4714	4715	4716	4717	4718	4719
273	4720	4721	4722	4724	4725	4726	4727	4728	4729
274	4730	4731	4732	4734	4735	4736	4737	4738	4739
275	4740	4741	4742	4744	4745	4746	4747	4748	4749
276	4750	4751	4752	4754	4755	4756	4757	4758	4759
277	4760	4761	4762	4764	4765	4766	4767	4768	4769
278	4770	4771	4772	4774	4775	4776	4777	4778	4779
279	4780	4781	4782	4784	4785	4786	4787	4788	4789
280	4790	4791	4792	4794	4795	4796	4797	4798	4799
281	4800	4801	4802	4804	4805	4806	4807	4808	4809
282	4810	4811	4812	4814	4815	4816	4817	4818	4819
283	4820	4821	4822	4824	4825	4826	4827	4828	4829
284	4830	4831	4832	4834	4835	4836	4837	4838	4839
285	4840	4841	4842	4844	4845	4846	4847	4848	4849
286	4850	4851	4852	4854	4855	4856	4857	4858	4859
287	4860	4861	4862	4864	4865	4866	4867	4868	4869
288	4870	4871	4872	4874	4875	4876	4877	4878	4879
289	4880	4881	4882	4884	4885	4886	4887	4888	4889
290	4890	4891	4892	4894	4895	4896	4897	4898	4899
291	4900	4901	4902	4904	4905	4906	4907	4208	4209
292	4910	4911	4912	4914	4915	4916	4917	4218	4219
293	4920	4921	4922	4924	4925	4926	4927	4228	4229
294	4930	4931	4932	4934	4935	4936	4937	4238	4239
295	4940	4941	4942	4944	4945	4946	4947	4248	4249
296	4950	4951	4952	4954	4955	4956	4957	4958	4959
297	4960	4961	4962	4964	4965	4966	4967	4968	4969
298	4970	4971	4972	4974	4975	4976	4977	4978	4979
299	4980	4981	4982	4984	4985	4986	4987	4988	4989
300	4990	4991	4992	4994	4995	4996	4997	4998	4999

(1) For axis 1

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
301	5000	5001	5002	5004	5005	5006	5007	5008	5009
302	5010	5011	5012	5014	5015	5016	5017	5018	5019
303	5020	5021	5022	5024	5025	5026	5027	5028	5029
304	5030	5031	5032	5034	5035	5036	5037	5038	5039
305	5040	5041	5042	5044	5045	5046	5047	5048	5049
306	5050	5051	5052	5054	5055	5056	5057	5058	5059
307	5060	5061	5062	5064	5065	5066	5067	5068	5069
308	5070	5071	5072	5074	5075	5076	5077	5078	5079
309	5080	5081	5082	5084	5085	5086	5087	5088	5089
310	5090	5091	5092	5094	5095	5096	5097	5098	5099
311	5100	5101	5102	5104	5105	5106	5107	5108	5109
312	5110	5111	5112	5114	5115	5116	5117	5118	5119
313	5120	5121	5122	5124	5125	5126	5127	5128	5129
314	5130	5131	5132	5134	5135	5136	5137	5138	5139
315	5140	5141	5142	5144	5145	5146	5147	5148	5149
316	5150	5151	5152	5154	5155	5156	5157	5158	5159
317	5160	5161	5162	5164	5165	5166	5167	5168	5169
318	5170	5171	5172	5174	5175	5176	5177	5178	5179
319	5180	5181	5182	5184	5185	5186	5187	5188	5189
320	5190	5191	5192	5194	5195	5196	5197	5198	5199
321	5200	5201	5202	5204	5205	5206	5207	5208	5209
322	5210	5211	5212	5214	5215	5216	5217	5218	5219
323	5220	5221	5222	5224	5225	5226	5227	5228	5229
324	5230	5231	5232	5234	5235	5236	5237	5238	5239
325	5240	5241	5242	5244	5245	5246	5247	5248	5249
326	5250	5251	5252	5254	5255	5256	5257	5258	5259
327	5260	5261	5262	5264	5265	5266	5267	5268	5269
328	5270	5271	5272	5274	5275	5276	5277	5278	5279
329	5280	5281	5282	5284	5285	5286	5287	5288	5289
330	5290	5291	5292	5294	5295	5296	5297	5298	5299
331	5300	5301	5302	5304	5305	5306	5307	5308	5309
332	5310	5311	5312	5314	5315	5316	5317	5318	5319
333	5320	5321	5322	5324	5325	5326	5327	5328	5329
334	5330	5331	5332	5334	5335	5336	5337	5338	5339
335	5340	5341	5342	5344	5345	5346	5347	5348	5349
336	5350	5351	5352	5354	5355	5356	5357	5358	5359
337	5360	5361	5362	5364	5365	5366	5367	5368	5369
338	5370	5371	5372	5374	5375	5376	5377	5378	5379
339	5380	5381	5382	5384	5385	5386	5387	5388	5389
340	5390	5391	5392	5394	5395	5396	5397	5398	5399
341	5400	5401	5402	5404	5405	5406	5407	5408	5409
342	5410	5411	5412	5414	5415	5416	5417	5418	5419
343	5420	5421	5422	5424	5425	5426	5427	5428	5429
344	5430	5431	5432	5434	5435	5436	5437	5438	5439
345	5440	5441	5442	5444	5445	5446	5447	5448	5449
346	5450	5451	5452	5454	5455	5456	5457	5458	5459
347	5460	5461	5462	5464	5465	5466	5467	5468	5469
348	5470	5471	5472	5474	5475	5476	5477	5478	5479
349	5480	5481	5482	5484	5485	5486	5487	5488	5489
350	5490	5491	5492	5494	5495	5496	5497	5498	5499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
351	5500	5501	5502	5504	5505	5506	5507	5508	5509
352	5510	5511	5512	5514	5515	5516	5517	5518	5519
353	5520	5521	5522	5524	5525	5526	5527	5528	5529
354	5530	5531	5532	5534	5535	5536	5537	5538	5539
355	5540	5541	5542	5544	5545	5546	5547	5548	5549
356	5550	5551	5552	5554	5555	5556	5557	5558	5559
357	5560	5561	5562	5564	5565	5566	5567	5568	5569
358	5570	5571	5572	5574	5575	5576	5577	5578	5579
359	5580	5581	5582	5584	5585	5586	5587	5588	5589
360	5590	5591	5592	5594	5595	5596	5597	5598	5599
361	5600	5601	5602	5604	5605	5606	5607	5608	5609
362	5610	5611	5612	5614	5615	5616	5617	5618	5619
363	5620	5621	5622	5624	5625	5626	5627	5628	5629
364	5630	5631	5632	5634	5635	5636	5637	5638	5639
365	5640	5641	5642	5644	5645	5646	5647	5648	5649
366	5650	5651	5652	5654	5655	5656	5657	5658	5659
367	5660	5661	5662	5664	5665	5666	5667	5668	5669
368	5670	5671	5672	5674	5675	5676	5677	5678	5679
369	5680	5681	5682	5684	5685	5686	5687	5688	5689
370	5690	5691	5692	5694	5695	5696	5697	5698	5699
371	5700	5701	5702	5704	5705	5706	5707	5708	5709
372	5710	5711	5712	5714	5715	5716	5717	5718	5719
373	5720	5721	5722	5724	5725	5726	5727	5728	5729
374	5730	5731	5732	5734	5735	5736	5737	5738	5739
375	5740	5741	5742	5744	5745	5746	5747	5748	5749
376	5750	5751	5752	5754	5755	5756	5757	5758	5759
377	5760	5761	5762	5764	5765	5766	5767	5768	5769
378	5770	5771	5772	5774	5775	5776	5777	5778	5779
379	5780	5781	5782	5784	5785	5786	5787	5788	5789
380	5790	5791	5792	5794	5795	5796	5797	5798	5799
381	5800	5801	5802	5804	5805	5806	5807	5808	5809
382	5810	5811	5812	5814	5815	5816	5817	5818	5819
383	5820	5821	5822	5824	5825	5826	5827	5828	5829
384	5830	5831	5832	5834	5835	5836	5837	5838	5839
385	5840	5841	5842	5844	5845	5846	5847	5848	5849
386	5850	5851	5852	5854	5855	5856	5857	5858	5859
387	5860	5861	5862	5864	5865	5866	5867	5868	5869
388	5870	5871	5872	5874	5875	5876	5877	5878	5879
389	5880	5881	5882	5884	5885	5886	5887	5888	5889
390	5890	5891	5892	5894	5895	5896	5897	5898	5899
391	5900	5901	5902	5904	5905	5906	5907	5908	5909
392	5910	5911	5912	5914	5915	5916	5917	5918	5919
393	5920	5921	5922	5924	5925	5926	5927	5928	5929
394	5930	5931	5932	5934	5935	5936	5937	5938	5939
395	5940	5941	5942	5944	5945	5946	5947	5948	5949
396	5950	5951	5952	5954	5955	5956	5957	5958	5959
397	5960	5961	5962	5964	5965	5966	5967	5968	5969
398	5970	5971	5972	5974	5975	5976	5977	5978	5979
399	5980	5981	5982	5984	5985	5986	5987	5988	5989
400	5990	5991	5992	5994	5995	5996	5997	5998	5999

(1) For axis 1

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
401	6000	6001	6002	6004	6005	6006	6007	6008	6009
402	6010	6011	6012	6014	6015	6016	6017	6018	6019
403	6020	6021	6022	6024	6025	6026	6027	6028	6029
404	6030	6031	6032	6034	6035	6036	6037	6038	6039
405	6040	6041	6042	6044	6045	6046	6047	6048	6049
406	6050	6051	6052	6054	6055	6056	6057	6058	6059
407	6060	6061	6062	6064	6065	6066	6067	6068	6069
408	6070	6071	6072	6074	6075	6076	6077	6078	6079
409	6080	6081	6082	6084	6085	6086	6087	6088	6089
410	6090	6091	6092	6094	6095	6096	6097	6098	6099
411	6100	6101	6102	6104	6105	6106	6107	6108	6109
412	6110	6111	6112	6114	6115	6116	6117	6118	6119
413	6120	6121	6122	6124	6125	6126	6127	6128	6129
414	6130	6131	6132	6134	6135	6136	6137	6138	6139
415	6140	6141	6142	6144	6145	6146	6147	6148	6149
416	6150	6151	6152	6154	6155	6156	6157	6158	6159
417	6160	6161	6162	6164	6165	6166	6167	6168	6169
418	6170	6171	6172	6174	6175	6176	6177	6178	6179
419	6180	6181	6182	6184	6185	6186	6187	6188	6189
420	6190	6191	6192	6194	6195	6196	6197	6198	6199
421	6200	6201	6202	6204	6205	6206	6207	6208	6209
422	6210	6211	6212	6214	6215	6216	6217	6218	6219
423	6220	6221	6222	6224	6225	6226	6227	6228	6229
424	6230	6231	6232	6234	6235	6236	6237	6238	6239
425	6240	6241	6242	6244	6245	6246	6247	6248	6249
426	6250	6251	6252	6254	6255	6256	6257	6258	6259
427	6260	6261	6262	6264	6265	6266	6267	6268	6269
428	6270	6271	6272	6274	6275	6276	6277	6278	6279
429	6280	6281	6282	6284	6285	6286	6287	6288	6289
430	6290	6291	6292	6294	6295	6296	6297	6298	6299
431	6300	6301	6302	6304	6305	6306	6307	6308	6309
432	6310	6311	6312	6314	6315	6316	6317	6318	6319
433	6320	6321	6322	6324	6325	6326	6327	6328	6329
434	6330	6331	6332	6334	6335	6336	6337	6338	6339
435	6340	6341	6342	6344	6345	6346	6347	6348	6349
436	6350	6351	6352	6354	6355	6356	6357	6358	6359
437	6360	6361	6362	6364	6365	6366	6367	6368	6369
438	6370	6371	6372	6374	6375	6376	6377	6378	6379
439	6380	6381	6382	6384	6385	6386	6387	6388	6389
440	6390	6391	6392	6394	6395	6396	6397	6398	6399
441	6400	6401	6402	6404	6405	6406	6407	6408	6409
442	6410	6411	6412	6414	6415	6416	6417	6418	6419
443	6420	6421	6422	6424	6425	6426	6427	6428	6429
444	6430	6431	6432	6434	6435	6436	6437	6438	6439
445	6440	6441	6442	6444	6445	6446	6447	6448	6449
446	6450	6451	6452	6454	6455	6456	6457	6458	6459
447	6460	6461	6462	6464	6465	6466	6467	6468	6469
448	6470	6471	6472	6474	6475	6476	6477	6478	6479
449	6480	6481	6482	6484	6485	6486	6487	6488	6489
450	6490	6491	6492	6494	6495	6496	6497	6498	6499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
451	6500	6501	6502	6504	6505	6506	6507	6508	6509
452	6510	6511	6512	6514	6515	6516	6517	6518	6519
453	6520	6521	6522	6524	6525	6526	6527	6528	6529
454	6530	6531	6532	6534	6535	6536	6537	6538	6539
455	6540	6541	6542	6544	6545	6546	6547	6548	6549
456	6550	6551	6552	6554	6555	6556	6557	6558	6559
457	6560	6561	6562	6564	6565	6566	6567	6568	6569
458	6570	6571	6572	6574	6575	6576	6577	6578	6579
459	6580	6581	6582	6584	6585	6586	6587	6588	6589
460	6590	6591	6592	6594	6595	6596	6597	6598	6599
461	6600	6601	6602	6604	6605	6606	6607	6608	6609
462	6610	6611	6612	6614	6615	6616	6617	6618	6619
463	6620	6621	6622	6624	6625	6626	6627	6628	6629
464	6630	6631	6632	6634	6635	6636	6637	6638	6639
465	6640	6641	6642	6644	6645	6646	6647	6648	6649
466	6650	6651	6652	6654	6655	6656	6657	6658	6659
467	6660	6661	6662	6664	6665	6666	6667	6668	6669
468	6670	6671	6672	6674	6675	6676	6677	6678	6679
469	6680	6681	6682	6684	6685	6686	6687	6688	6689
470	6690	6691	6692	6694	6695	6696	6697	6698	6699
471	6700	6701	6702	6704	6705	6706	6707	6708	6709
472	6710	6711	6712	6714	6715	6716	6717	6718	6719
473	6720	6721	6722	6724	6725	6726	6727	6728	6729
474	6730	6731	6732	6734	6735	6736	6737	6738	6739
475	6740	6741	6742	6744	6745	6746	6747	6748	6749
476	6750	6751	6752	6754	6755	6756	6757	6758	6759
477	6760	6761	6762	6764	6765	6766	6767	6768	6769
478	6770	6771	6772	6774	6775	6776	6777	6778	6779
479	6780	6781	6782	6784	6785	6786	6787	6788	6789
480	6790	6791	6792	6794	6795	6796	6797	6798	6799
481	6800	6801	6802	6804	6805	6806	6807	6808	6809
482	6810	6811	6812	6814	6815	6816	6817	6818	6819
483	6820	6821	6822	6824	6825	6826	6827	6828	6829
484	6830	6831	6832	6834	6835	6836	6837	6838	6839
485	6840	6841	6842	6844	6845	6846	6847	6848	6849
486	6850	6851	6852	6854	6855	6856	6857	6858	6859
487	6860	6861	6862	6864	6865	6866	6867	6868	6869
488	6870	6871	6872	6874	6875	6876	6877	6878	6879
489	6880	6881	6882	6884	6885	6886	6887	6888	6889
490	6890	6891	6892	6894	6895	6896	6897	6898	6899
491	6900	6901	6902	6904	6905	6906	6907	6908	6909
492	6910	6911	6912	6914	6915	6916	6917	6918	6919
493	6920	6921	6922	6924	6925	6926	6927	6928	6929
494	6930	6931	6932	6934	6935	6936	6937	6938	6939
495	6940	6941	6942	6944	6945	6946	6947	6948	6949
496	6950	6951	6952	6954	6955	6956	6957	6958	6959
497	6960	6961	6962	6964	6965	6966	6967	6968	6969
498	6970	6971	6972	6974	6975	6976	6977	6978	6979
499	6980	6981	6982	6984	6985	6986	6987	6988	6989
500	6990	6991	6992	6994	6995	6996	6997	6998	6999

(1) For axis 1

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
501	7000	7001	7002	7004	7005	7006	7007	7008	7009
502	7010	7011	7012	7014	7015	7016	7017	7018	7019
503	7020	7021	7022	7024	7025	7026	7027	7028	7029
504	7030	7031	7032	7034	7035	7036	7037	7038	7039
505	7040	7041	7042	7044	7045	7046	7047	7048	7049
506	7050	7051	7052	7054	7055	7056	7057	7058	7059
507	7060	7061	7062	7064	7065	7066	7067	7068	7069
508	7070	7071	7072	7074	7075	7076	7077	7078	7079
509	7080	7081	7082	7084	7085	7086	7087	7088	7089
510	7090	7091	7092	7094	7095	7096	7097	7098	7099
511	7100	7101	7102	7104	7105	7106	7107	7108	7109
512	7110	7111	7112	7114	7115	7116	7117	7118	7119
513	7120	7121	7122	7124	7125	7126	7127	7128	7129
514	7130	7131	7132	7134	7135	7136	7137	7138	7139
515	7140	7141	7142	7144	7145	7146	7147	7148	7149
516	7150	7151	7152	7154	7155	7156	7157	7158	7159
517	7160	7161	7162	7164	7165	7166	7167	7168	7169
518	7170	7171	7172	7174	7175	7176	7177	7178	7179
519	7180	7181	7182	7184	7185	7186	7187	7188	7189
520	7190	7191	7192	7194	7195	7196	7197	7198	7199
521	7200	7201	7202	7204	7205	7206	7207	7208	7209
522	7210	7211	7212	7214	7215	7216	7217	7218	7219
523	7220	7221	7222	7224	7225	7226	7227	7228	7229
524	7230	7231	7232	7234	7235	7236	7237	7238	7239
525	7240	7241	7242	7244	7245	7246	7247	7248	7249
526	7250	7251	7252	7254	7255	7256	7257	7258	7259
527	7260	7261	7262	7264	7265	7266	7267	7268	7269
528	7270	7271	7272	7274	7275	7276	7277	7278	7279
529	7280	7281	7282	7284	7285	7286	7287	7288	7289
530	7290	7291	7292	7294	7295	7296	7297	7298	7299
531	7300	7301	7302	7304	7305	7306	7307	7308	7309
532	7310	7311	7312	7314	7315	7316	7317	7318	7319
533	7320	7321	7322	7324	7325	7326	7327	7328	7329
534	7330	7331	7332	7334	7335	7336	7337	7338	7339
535	7340	7341	7342	7344	7345	7346	7347	7348	7349
536	7350	7351	7352	7354	7355	7356	7357	7358	7359
537	7360	7361	7362	7364	7365	7366	7367	7368	7369
538	7370	7371	7372	7374	7375	7376	7377	7378	7379
539	7380	7381	7382	7384	7385	7386	7387	7388	7389
540	7390	7391	7392	7394	7395	7396	7397	7398	7399
541	7400	7401	7402	7404	7405	7406	7407	7408	7409
542	7410	7411	7412	7414	7415	7416	7417	7418	7419
543	7420	7421	7422	7424	7425	7426	7427	7428	7429
544	7430	7431	7432	7434	7435	7436	7437	7438	7439
545	7440	7441	7442	7444	7445	7446	7447	7448	7449
546	7450	7451	7452	7454	7455	7456	7457	7458	7459
547	7460	7461	7462	7464	7465	7466	7467	7468	7469
548	7470	7471	7472	7474	7475	7476	7477	7478	7479
549	7480	7481	7482	7484	7485	7486	7487	7488	7489
550	7490	7491	7492	7494	7495	7496	7497	7498	7499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
551	7500	7501	7502	7504	7505	7506	7507	7508	7509
552	7510	7511	7512	7514	7515	7516	7517	7518	7519
553	7520	7521	7522	7524	7525	7526	7527	7528	7529
554	7530	7531	7532	7534	7535	7536	7537	7538	7539
555	7540	7541	7542	7544	7545	7546	7547	7548	7549
556	7550	7551	7552	7554	7555	7556	7557	7558	7559
557	7560	7561	7562	7564	7565	7566	7567	7568	7569
558	7570	7571	7572	7574	7575	7576	7577	7578	7579
559	7580	7581	7582	7584	7585	7586	7587	7588	7589
560	7590	7591	7592	7594	7595	7596	7597	7598	7599
561	7600	7601	7602	7604	7605	7606	7607	7608	7609
562	7610	7611	7612	7614	7615	7616	7617	7618	7619
563	7620	7621	7622	7624	7625	7626	7627	7628	7629
564	7630	7631	7632	7634	7635	7636	7637	7638	7639
565	7640	7641	7642	7644	7645	7646	7647	7648	7649
566	7650	7651	7652	7654	7655	7656	7657	7658	7659
567	7660	7661	7662	7664	7665	7666	7667	7668	7669
568	7670	7671	7672	7674	7675	7676	7677	7678	7679
569	7680	7681	7682	7684	7685	7686	7687	7688	7689
570	7690	7691	7692	7694	7695	7696	7697	7698	7699
571	7700	7701	7702	7704	7705	7706	7707	7708	7709
572	7710	7711	7712	7714	7715	7716	7717	7718	7719
573	7720	7721	7722	7724	7725	7726	7727	7728	7729
574	7730	7731	7732	7734	7735	7736	7737	7738	7739
575	7740	7741	7742	7744	7745	7746	7747	7748	7749
576	7750	7751	7752	7754	7755	7756	7757	7758	7759
577	7760	7761	7762	7764	7765	7766	7767	7768	7769
578	7770	7771	7772	7774	7775	7776	7777	7778	7779
579	7780	7781	7782	7784	7785	7786	7787	7788	7789
580	7790	7791	7792	7794	7795	7796	7797	7798	7799
581	7800	7801	7802	7804	7805	7806	7807	7808	7809
582	7810	7811	7812	7814	7815	7816	7817	7818	7819
583	7820	7821	7822	7824	7825	7826	7827	7828	7829
584	7830	7831	7832	7834	7835	7836	7837	7838	7839
585	7840	7841	7842	7844	7845	7846	7847	7848	7849
586	7850	7851	7852	7854	7855	7856	7857	7858	7859
587	7860	7861	7862	7864	7865	7866	7867	7868	7869
588	7870	7871	7872	7874	7875	7876	7877	7878	7879
589	7880	7881	7882	7884	7885	7886	7887	7888	7889
590	7890	7891	7892	7894	7895	7896	7897	7898	7899
591	7900	7901	7902	7904	7905	7906	7907	7908	7909
592	7910	7911	7912	7914	7915	7916	7917	7918	7919
593	7920	7921	7922	7924	7925	7926	7927	7928	7929
594	7930	7931	7932	7934	7935	7936	7937	7938	7939
595	7940	7941	7942	7944	7945	7946	7947	7948	7949
596	7950	7951	7952	7954	7955	7956	7957	7958	7959
597	7960	7961	7962	7964	7965	7966	7967	7968	7969
598	7970	7971	7972	7974	7975	7976	7977	7978	7979
599	7980	7981	7982	7984	7985	7986	7987	7988	7989
600	7990	7991	7992	7994	7995	7996	7997	7998	7999

(2) For axis 2

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
1	8000	8001	8002	8004	8005	8006	8007	8008	8009
2	8010	8011	8012	8014	8015	8016	8017	8018	8019
3	8020	8021	8022	8024	8025	8026	8027	8028	8029
4	8030	8031	8032	8034	8035	8036	8037	8038	8039
5	8040	8041	8042	8044	8045	8046	8047	8048	8049
6	8050	8051	8052	8054	8055	8056	8057	8058	8059
7	8060	8061	8062	8064	8065	8066	8067	8068	8069
8	8070	8071	8072	8074	8075	8076	8077	8078	8079
9	8080	8081	8082	8084	8085	8086	8087	8088	8089
10	8090	8091	8092	8094	8095	8096	8097	8098	8099
11	8100	8101	8102	8104	8105	8106	8107	8108	8109
12	8110	8111	8112	8114	8115	8116	8117	8118	8119
13	8120	8121	8122	8124	8125	8126	8127	8128	8129
14	8130	8131	8132	8134	8135	8136	8137	8138	8139
15	8140	8141	8142	8144	8145	8146	8147	8148	8149
16	8150	8151	8152	8154	8155	8156	8157	8158	8159
17	8160	8161	8162	8164	8165	8166	8167	8168	8169
18	8170	8171	8172	8174	8175	8176	8177	8178	8179
19	8180	8181	8182	8184	8185	8186	8187	8188	8189
20	8190	8191	8192	8194	8195	8196	8197	8198	8199
21	8200	8201	8202	8204	8205	8206	8207	8208	8209
22	8210	8211	8212	8214	8215	8216	8217	8218	8219
23	8220	8221	8222	8224	8225	8226	8227	8228	8229
24	8230	8231	8232	8234	8235	8236	8237	8238	8239
25	8240	8241	8242	8244	8245	8246	8247	8248	8249
26	8250	8251	8252	8254	8255	8256	8257	8258	8259
27	8260	8261	8262	8264	8265	8266	8267	8268	8269
28	8270	8271	8272	8274	8275	8276	8277	8278	8279
29	8280	8281	8282	8284	8285	8286	8287	8288	8289
30	8290	8291	8292	8294	8295	8296	8297	8298	8299
31	8300	8301	8302	8304	8305	8306	8307	8308	8309
32	8310	8311	8312	8314	8315	8316	8317	8318	8319
33	8320	8321	8322	8324	8325	8326	8327	8328	8329
34	8330	8331	8332	8334	8335	8336	8337	8338	8339
35	8340	8341	8342	8344	8345	8346	8347	8348	8349
36	8350	8351	8352	8354	8355	8356	8357	8358	8359
37	8360	8361	8362	8364	8365	8366	8367	8368	8369
38	8370	8371	8372	8374	8375	8376	8377	8378	8379
39	8380	8381	8382	8384	8385	8386	8387	8388	8389
40	8390	8391	8392	8394	8395	8396	8397	8398	8399
41	8400	8401	8402	8404	8405	8406	8407	8408	8409
42	8410	8411	8412	8414	8415	8416	8417	8418	8419
43	8420	8421	8422	8424	8425	8426	8427	8428	8429
44	8430	8431	8432	8434	8435	8436	8437	8438	8439
45	8440	8441	8442	8444	8445	8446	8447	8448	8449
46	8450	8451	8452	8454	8455	8456	8457	8458	8459
47	8460	8461	8462	8464	8465	8466	8467	8468	8469
48	8470	8471	8472	8474	8475	8476	8477	8478	8479
49	8480	8481	8482	8484	8485	8486	8487	8488	8489
50	8490	8491	8492	8494	8495	8496	8497	8498	8499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
51	8500	8501	8502	8504	8505	8506	8507	8508	8509
52	8510	8511	8512	8514	8515	8516	8517	8518	8519
53	8520	8521	8522	8524	8525	8526	8527	8528	8529
54	8530	8531	8532	8534	8535	8536	8537	8538	8539
55	8540	8541	8542	8544	8545	8546	8547	8548	8549
56	8550	8551	8552	8554	8555	8556	8557	8558	8559
57	8560	8561	8562	8564	8565	8566	8567	8568	8569
58	8570	8571	8572	8574	8575	8576	8577	8578	8579
59	8580	8581	8582	8584	8585	8586	8587	8588	8589
60	8590	8591	8592	8594	8595	8596	8597	8598	8599
61	8600	8601	8602	8604	8605	8606	8607	8608	8609
62	8610	8611	8612	8614	8615	8616	8617	8618	8619
63	8620	8621	8622	8624	8625	8626	8627	8628	8629
64	8630	8631	8632	8634	8635	8636	8637	8638	8639
65	8640	8641	8642	8644	8645	8646	8647	8648	8649
66	8650	8651	8652	8654	8655	8656	8657	8658	8659
67	8660	8661	8662	8664	8665	8666	8667	8668	8669
68	8670	8671	8672	8674	8675	8676	8677	8678	8679
69	8680	8681	8682	8684	8685	8686	8687	8688	8689
70	8690	8691	8692	8694	8695	8696	8697	8698	8699
71	8700	8701	8702	8704	8705	8706	8707	8708	8709
72	8710	8711	8712	8714	8715	8716	8717	8718	8719
73	8720	8721	8722	8724	8725	8726	8727	8728	8729
74	8730	8731	8732	8734	8735	8736	8737	8738	8739
75	8740	8741	8742	8744	8745	8746	8747	8748	8749
76	8750	8751	8752	8754	8755	8756	8757	8758	8759
77	8760	8761	8762	8764	8765	8766	8767	8768	8769
78	8770	8771	8772	8774	8775	8776	8777	8778	8779
79	8780	8781	8782	8784	8785	8786	8787	8788	8789
80	8790	8791	8792	8794	8795	8796	8797	8798	8799
81	8800	8801	8802	8804	8805	8806	8807	8808	8809
82	8810	8811	8812	8814	8815	8816	8817	8818	8819
83	8820	8821	8822	8824	8825	8826	8827	8828	8829
84	8830	8831	8832	8834	8835	8836	8837	8838	8839
85	8840	8841	8842	8844	8845	8846	8847	8848	8849
86	8850	8851	8852	8854	8855	8856	8857	8858	8859
87	8860	8861	8862	8864	8865	8866	8867	8868	8869
88	8870	8871	8872	8874	8875	8876	8877	8878	8879
89	8880	8881	8882	8884	8885	8886	8887	8888	8889
90	8890	8891	8892	8894	8895	8896	8897	8898	8899
91	8900	8901	8902	8904	8905	8906	8907	8908	8909
92	8910	8911	8912	8914	8915	8916	8917	8918	8919
93	8920	8921	8922	8924	8925	8926	8927	8928	8929
94	8930	8931	8932	8934	8935	8936	8937	8938	8939
95	8940	8941	8942	8944	8945	8946	8947	8948	8949
96	8950	8951	8952	8954	8955	8956	8957	8958	8959
97	8960	8961	8962	8964	8965	8966	8967	8968	8969
98	8970	8971	8972	8974	8975	8976	8977	8978	8979
99	8980	8981	8982	8984	8985	8986	8987	8988	8989
100	8990	8991	8992	8994	8995	8996	8997	8998	8999

(2) For axis 2

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
101	9000	9001	9002	9004	9005	9006	9007	9008	9009
102	9010	9011	9012	9014	9015	9016	9017	9018	9019
103	9020	9021	9022	9024	9025	9026	9027	9028	9029
104	9030	9031	9032	9034	9035	9036	9037	9038	9039
105	9040	9041	9042	9044	9045	9046	9047	9048	9049
106	9050	9051	9052	9054	9055	9056	9057	9058	9059
107	9060	9061	9062	9064	9065	9066	9067	9068	9069
108	9070	9071	9072	9074	9075	9076	9077	9078	9079
109	9080	9081	9082	9084	9085	9086	9087	9088	9089
110	9090	9091	9092	9094	9095	9096	9097	9098	9099
111	9100	9101	9102	9104	9105	9106	9107	9108	9109
112	9110	9111	9112	9114	9115	9116	9117	9118	9119
113	9120	9121	9122	9124	9125	9126	9127	9128	9129
114	9130	9131	9132	9134	9135	9136	9137	9138	9139
115	9140	9141	9142	9144	9145	9146	9147	9148	9149
116	9150	9151	9152	9154	9155	9156	9157	9158	9159
117	9160	9161	9162	9164	9165	9166	9167	9168	9169
118	9170	9171	9172	9174	9175	9176	9177	9178	9179
119	9180	9181	9182	9184	9185	9186	9187	9188	9189
120	9190	9191	9192	9194	9195	9196	9197	9198	9199
126	9250	9251	9252	9254	9255	9256	9257	9258	9259
127	9260	9261	9262	9264	9265	9266	9267	9268	9269
128	9270	9271	9272	9274	9275	9276	9277	9278	9279
129	9280	9281	9282	9284	9285	9286	9287	9288	9289
130	9290	9291	9292	9294	9295	9296	9297	9298	9299
131	9300	9301	9302	9304	9305	9306	9307	9308	9309
132	9310	9311	9312	9314	9315	9316	9317	9318	9319
133	9320	9321	9322	9324	9325	9326	9327	9328	9329
134	9330	9331	9332	9334	9335	9336	9337	9338	9339
135	9340	9341	9342	9344	9345	9346	9347	9348	9349
136	9350	9351	9352	9354	9355	9356	9357	9358	9359
137	9360	9361	9362	9364	9365	9366	9367	9368	9369
138	9370	9371	9372	9374	9375	9376	9377	9378	9379
139	9380	9381	9382	9384	9385	9386	9387	9388	9389
140	9390	9391	9392	9394	9395	9396	9397	9398	9399
141	9400	9401	9402	9404	9405	9406	9407	9408	9409
142	9410	9411	9412	9414	9415	9416	9417	9418	9419
143	9420	9421	9422	9424	9425	9426	9427	9428	9429
144	9430	9431	9432	9434	9435	9436	9437	9438	9439
145	9440	9441	9442	9444	9445	9446	9447	9448	9449
146	9450	9451	9452	9454	9455	9456	9457	9458	9459
147	9460	9461	9462	9464	9465	9466	9467	9468	9469
148	9470	9471	9472	9474	9475	9476	9477	9478	9479
149	9480	9481	9482	9484	9485	9486	9487	9488	9489
150	9490	9491	9492	9494	9495	9496	9497	9498	9499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
151	9500	9501	9502	9504	9505	9506	9507	9508	9509
152	9510	9511	9512	9514	9515	9516	9517	9518	9519
153	9520	9521	9522	9524	9525	9526	9527	9528	9529
154	9530	9531	9532	9534	9535	9536	9537	9538	9539
155	9540	9541	9542	9544	9545	9546	9547	9548	9549
156	9550	9551	9552	9554	9555	9556	9557	9558	9559
157	9560	9561	9562	9564	9565	9566	9567	9568	9569
158	9570	9571	9572	9574	9575	9576	9577	9578	9579
159	9580	9581	9582	9584	9585	9586	9587	9588	9589
160	9590	9591	9592	9594	9595	9596	9597	9598	9599
161	9600	9601	9602	9604	9605	9606	9607	9608	9609
162	9610	9611	9612	9614	9615	9616	9617	9618	9619
163	9620	9621	9622	9624	9625	9626	9627	9628	9629
164	9630	9631	9632	9634	9635	9636	9637	9638	9639
165	9640	9641	9642	9644	9645	9646	9647	9648	9649
166	9650	9651	9652	9654	9655	9656	9657	9658	9659
167	9660	9661	9662	9664	9665	9666	9667	9668	9669
168	9670	9671	9672	9674	9675	9676	9677	9678	9679
169	9680	9681	9682	9684	9685	9686	9687	9688	9689
170	9690	9691	9692	9694	9695	9696	9697	9698	9699
176	9750	9751	9752	9754	9755	9756	9757	9758	9759
177	9760	9761	9762	9764	9765	9766	9767	9768	9769
178	9770	9771	9772	9774	9775	9776	9777	9778	9779
179	9780	9781	9782	9784	9785	9786	9787	9788	9789
180	9790	9791	9792	9794	9795	9796	9797	9798	9799
181	9800	9801	9802	9804	9805	9806	9807	9808	9809
182	9810	9811	9812	9814	9815	9816	9817	9818	9819
183	9820	9821	9822	9824	9825	9826	9827	9828	9829
184	9830	9831	9832	9834	9835	9836	9837	9838	9839
185	9840	9841	9842	9844	9845	9846	9847	9848	9849
186	9850	9851	9852	9854	9855	9856	9857	9858	9859
187	9860	9861	9862	9864	9865	9866	9867	9868	9869
188	9870	9871	9872	9874	9875	9876	9877	9878	9879
189	9880	9881	9882	9884	9885	9886	9887	9888	9889
190	9890	9891	9892	9894	9895	9896	9897	9898	9899
191	9900	9901	9902	9904	9905	9906	9907	9908	9909
192	9910	9911	9912	9914	9915	9916	9917	9918	9919
193	9920	9921	9922	9924	9925	9926	9927	9928	9929
194	9930	9931	9932	9934	9935	9936	9937	9938	9939
195	9940	9941	9942	9944	9945	9946	9947	9948	9949
196	9950	9951	9952	9954	9955	9956	9957	9958	9959
197	9960	9961	9962	9964	9965	9966	9967	9968	9969
198	9970	9971	9972	9974	9975	9976	9977	9978	9979
199	9980	9981	9982	9984	9985	9986	9987	9988	9989
200	9990	9991	9992	9994	9995	9996	9997	9998	9999



(2) For axis 2

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
201	10000	10001	10002	10004	10005	10006	10007	10008	10009
202	10010	10011	10012	10014	10015	10016	10017	10018	10019
203	10020	10021	10022	10024	10025	10026	10027	10028	10029
204	10030	10031	10032	10034	10035	10036	10037	10038	10039
205	10040	10041	10042	10044	10045	10046	10047	10048	10049
206	10050	10051	10052	10054	10055	10056	10057	10058	10059
207	10060	10061	10062	10064	10065	10066	10067	10068	10069
208	10070	10071	10072	10074	10075	10076	10077	10078	10079
209	10080	10081	10082	10084	10085	10086	10087	10088	10089
210	10090	10091	10092	10094	10095	10096	10097	10098	10099
211	10100	10101	10102	10104	10105	10106	10107	10108	10109
212	10110	10111	10112	10114	10115	10116	10117	10118	10119
213	10120	10121	10122	10124	10125	10126	10127	10128	10129
214	10130	10131	10132	10134	10135	10136	10137	10138	10139
215	10140	10141	10142	10144	10145	10146	10147	10148	10149
216	10150	10151	10152	10154	10155	10156	10157	10158	10159
217	10160	10161	10162	10164	10165	10166	10167	10168	10169
218	10170	10171	10172	10174	10175	10176	10177	10178	10179
219	10180	10181	10182	10184	10185	10186	10187	10188	10189
220	10190	10191	10192	10194	10195	10196	10197	10198	10199
221	10200	10201	10202	10204	10205	10206	10207	10208	10209
222	10210	10211	10212	10214	10215	10216	10217	10218	10219
223	10220	10221	10222	10224	10225	10226	10227	10228	10229
224	10230	10231	10232	10234	10235	10236	10237	10238	10239
225	10240	10241	10242	10244	10245	10246	10247	10248	10249
226	10250	10251	10252	10254	10255	10256	10257	10258	10259
227	10260	10261	10262	10264	10265	10266	10267	10268	10269
228	10270	10271	10272	10274	10275	10276	10277	10278	10279
229	10280	10281	10282	10284	10285	10286	10287	10288	10289
230	10290	10291	10292	10294	10295	10296	10297	10298	10299
231	10300	10301	10302	10304	10305	10306	10307	10308	10309
232	10310	10311	10312	10314	10315	10316	10317	10318	10319
233	10320	10321	10322	10324	10325	10326	10327	10328	10329
234	10330	10331	10332	10334	10335	10336	10337	10338	10339
235	10340	10341	10342	10344	10345	10346	10347	10348	10349
236	10350	10351	10352	10354	10355	10356	10357	10358	10359
237	10360	10361	10362	10364	10365	10366	10367	10368	10369
238	10370	10371	10372	10374	10375	10376	10377	10378	10379
239	10380	10381	10382	10384	10385	10386	10387	10388	10389
240	10390	10391	10392	10394	10395	10396	10397	10398	10399
241	10400	10401	10402	10404	10405	10406	10407	10408	10409
242	10410	10411	10412	10414	10415	10416	10417	10418	10419
243	10420	10421	10422	10424	10425	10426	10427	10428	10429
244	10430	10431	10432	10434	10435	10436	10437	10438	10439
245	10440	10441	10442	10444	10445	10446	10447	10448	10449
246	10450	10451	10452	10454	10455	10456	10457	10458	10459
247	10460	10461	10462	10464	10465	10466	10467	10468	10469
248	10470	10471	10472	10474	10475	10476	10477	10478	10479
249	10480	10481	10482	10484	10485	10486	10487	10488	10489
250	10490	10491	10492	10494	10495	10496	10497	10498	10499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
251	10500	10501	10502	10504	10505	10506	10507	10508	10509
252	10510	10511	10512	10514	10515	10516	10517	10518	10519
253	10520	10521	10522	10524	10525	10526	10527	10528	10529
254	10530	10531	10532	10534	10535	10536	10537	10538	10539
255	10540	10541	10542	10544	10545	10546	10547	10548	10549
256	10550	10551	10552	10554	10555	10556	10557	10558	10559
257	10560	10561	10562	10564	10565	10566	10567	10568	10569
258	10570	10571	10572	10574	10575	10576	10577	10578	10579
259	10580	10581	10582	10584	10585	10586	10587	10588	10589
260	10590	10591	10592	10594	10595	10596	10597	10598	10599
261	10600	10601	10602	10604	10605	10606	10607	10608	10609
262	10610	10611	10612	10614	10615	10616	10617	10618	10619
263	10620	10621	10622	10624	10625	10626	10627	10628	10629
264	10630	10631	10632	10634	10635	10636	10637	10638	10639
265	10640	10641	10642	10644	10645	10646	10647	10648	10649
266	10650	10651	10652	10654	10655	10656	10657	10658	10659
267	10660	10661	10662	10664	10665	10666	10667	10668	10669
268	10670	10671	10672	10674	10675	10676	10677	10678	10679
269	10680	10681	10682	10684	10685	10686	10687	10688	10689
270	10690	10691	10692	10694	10695	10696	10697	10698	10699
271	10700	10701	10702	10704	10705	10706	10707	10708	10709
272	10710	10711	10712	10714	10715	10716	10717	10718	10719
273	10720	10721	10722	10724	10725	10726	10727	10728	10729
274	10730	10731	10732	10734	10735	10736	10737	10738	10739
275	10740	10741	10742	10744	10745	10746	10747	10748	10749
276	10750	10751	10752	10754	10755	10756	10757	10758	10759
277	10760	10761	10762	10764	10765	10766	10767	10768	10769
278	10770	10771	10772	10774	10775	10776	10777	10778	10779
279	10780	10781	10782	10784	10785	10786	10787	10788	10789
280	10790	10791	10792	10794	10795	10796	10797	10798	10799
281	10800	10801	10802	10804	10805	10806	10807	10808	10809
282	10810	10811	10812	10814	10815	10816	10817	10818	10819
283	10820	10821	10822	10824	10825	10826	10827	10828	10829
284	10830	10831	10832	10834	10835	10836	10837	10838	10839
285	10840	10841	10842	10844	10845	10846	10847	10848	10849
286	10850	10851	10852	10854	10855	10856	10857	10858	10859
287	10860	10861	10862	10864	10865	10866	10867	10868	10869
288	10870	10871	10872	10874	10875	10876	10877	10878	10879
289	10880	10881	10882	10884	10885	10886	10887	10888	10889
290	10890	10891	10892	10894	10895	10896	10897	10898	10899
291	10900	10901	10902	10904	10905	10906	10907	10908	10909
292	10910	10911	10912	10914	10915	10916	10917	10918	10919
293	10920	10921	10922	10924	10925	10926	10927	10928	10929
294	10930	10931	10932	10934	10935	10936	10937	10938	10939
295	10940	10941	10942	10944	10945	10946	10947	10948	10949
296	10950	10951	10952	10954	10955	10956	10957	10958	10959
297	10960	10961	10962	10964	10965	10966	10967	10968	10969
298	10970	10971	10972	10974	10975	10976	10977	10978	10979
299	10980	10981	10982	10984	10985	10986	10987	10988	10989
300	10990	10991	10992	10994	10995	10996	10997	10998	10999

(2) For axis 2

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
301	11000	11001	11002	11004	11005	11006	11007	11008	11009
302	11010	11011	11012	11014	11015	11016	11017	11018	11019
303	11020	11021	11022	11024	11025	11026	11027	11028	11029
304	11030	11031	11032	11034	11035	11036	11037	11038	11039
305	11040	11041	11042	11044	11045	11046	11047	11048	11049
306	11050	11051	11052	11054	11055	11056	11057	11058	11059
307	11060	11061	11062	11064	11065	11066	11067	11068	11069
308	11070	11071	11072	11074	11075	11076	11077	11078	11079
309	11080	11081	11082	11084	11085	11086	11087	11088	11089
310	11090	11091	11092	11094	11095	11096	11097	11098	11099
311	11100	11101	11102	11104	11105	11106	11107	11108	11109
312	11110	11111	11112	11114	11115	11116	11117	11118	11119
313	11120	11121	11122	11124	11125	11126	11127	11128	11129
314	11130	11131	11132	11134	11135	11136	11137	11138	11139
315	11140	11141	11142	11144	11145	11146	11147	11148	11149
316	11150	11151	11152	11154	11155	11156	11157	11158	11159
317	11160	11161	11162	11164	11165	11166	11167	11168	11169
318	11170	11171	11172	11174	11175	11176	11177	11178	11179
319	11180	11181	11182	11184	11185	11186	11187	11188	11189
320	11190	11191	11192	11194	11195	11196	11197	11198	11199
321	11200	11201	11202	11204	11205	11206	11207	11208	11209
322	11210	11211	11212	11214	11215	11216	11217	11218	11219
323	11220	11221	11222	11224	11225	11226	11227	11228	11229
324	11230	11231	11232	11234	11235	11236	11237	11238	11239
325	11240	11241	11242	11244	11245	11246	11247	11248	11249
326	11250	11251	11252	11254	11255	11256	11257	11258	11259
327	11260	11261	11262	11264	11265	11266	11267	11268	11269
328	11270	11271	11272	11274	11275	11276	11277	11278	11279
329	11280	11281	11282	11284	11285	11286	11287	11288	11289
330	11290	11291	11292	11294	11295	11296	11297	11298	11299
331	11300	11301	11302	11304	11305	11306	11307	11308	11309
332	11310	11311	11312	11314	11315	11316	11317	11318	11319
333	11320	11321	11322	11324	11325	11326	11327	11328	11329
334	11330	11331	11332	11334	11335	11336	11337	11338	11339
335	11340	11341	11342	11344	11345	11346	11347	11348	11349
336	11350	11351	11352	11354	11355	11356	11357	11358	11359
337	11360	11361	11362	11364	11365	11366	11367	11368	11369
338	11370	11371	11372	11374	11375	11376	11377	11378	11379
339	11380	11381	11382	11384	11385	11386	11387	11388	11389
340	11390	11391	11392	11394	11395	11396	11397	11398	11399
341	11400	11401	11402	11404	11405	11406	11407	11408	11409
342	11410	11411	11412	11414	11415	11416	11417	11418	11419
343	11420	11421	11422	11424	11425	11426	11427	11428	11429
344	11430	11431	11432	11434	11435	11436	11437	11438	11439
345	11440	11441	11442	11444	11445	11446	11447	11448	11449
346	11450	11451	11452	11454	11455	11456	11457	11458	11459
347	11460	11461	11462	11464	11465	11466	11467	11468	11469
348	11470	11471	11472	11474	11475	11476	11477	11478	11479
349	11480	11481	11482	11484	11485	11486	11487	11488	11489
350	11490	11491	11492	11494	11495	11496	11497	11498	11499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
351	11500	11501	11502	11504	11505	11506	11507	11508	11509
352	11510	11511	11512	11514	11515	11516	11517	11518	11519
353	11520	11521	11522	11524	11525	11526	11527	11528	11529
354	11530	11531	11532	11534	11535	11536	11537	11538	11539
355	11540	11541	11542	11544	11545	11546	11547	11548	11549
356	11550	11551	11552	11554	11555	11556	11557	11558	11559
357	11560	11561	11562	11564	11565	11566	11567	11568	11569
358	11570	11571	11572	11574	11575	11576	11577	11578	11579
359	11580	11581	11582	11584	11585	11586	11587	11588	11589
360	11590	11591	11592	11594	11595	11596	11597	11598	11599
361	11600	11601	11602	11604	11605	11606	11607	11608	11609
362	11610	11611	11612	11614	11615	11616	11617	11618	11619
363	11620	11621	11622	11624	11625	11626	11627	11628	11629
364	11630	11631	11632	11634	11635	11636	11637	11638	11639
365	11640	11641	11642	11644	11645	11646	11647	11648	11649
366	11650	11651	11652	11654	11655	11656	11657	11658	11659
367	11660	11661	11662	11664	11665	11666	11667	11668	11669
368	11670	11671	11672	11674	11675	11676	11677	11678	11679
369	11680	11681	11682	11684	11685	11686	11687	11688	11689
370	11690	11691	11692	11694	11695	11696	11697	11698	11699
371	11700	11701	11702	11704	11705	11706	11707	11708	11709
372	11710	11711	11712	11714	11715	11716	11717	11718	11719
373	11720	11721	11722	11724	11725	11726	11727	11728	11729
374	11730	11731	11732	11734	11735	11736	11737	11738	11739
375	11740	11741	11742	11744	11745	11746	11747	11748	11749
376	11750	11751	11752	11754	11755	11756	11757	11758	11759
377	11760	11761	11762	11764	11765	11766	11767	11768	11769
378	11770	11771	11772	11774	11775	11776	11777	11778	11779
379	11780	11781	11782	11784	11785	11786	11787	11788	11789
380	11790	11791	11792	11794	11795	11796	11797	11798	11799
381	11800	11801	11802	11804	11805	11806	11807	11808	11809
382	11810	11811	11812	11814	11815	11816	11817	11818	11819
383	11820	11821	11822	11824	11825	11826	11827	11828	11829
384	11830	11831	11832	11834	11835	11836	11837	11838	11839
385	11840	11841	11842	11844	11845	11846	11847	11848	11849
386	11850	11851	11852	11854	11855	11856	11857	11858	11859
387	11860	11861	11862	11864	11865	11866	11867	11868	11869
388	11870	11871	11872	11874	11875	11876	11877	11878	11879
389	11880	11881	11882	11884	11885	11886	11887	11888	11889
390	11890	11891	11892	11894	11895	11896	11897	11898	11899
391	11900	11901	11902	11904	11905	11906	11907	11908	11909
392	11910	11911	11912	11914	11915	11916	11917	11918	11919
393	11920	11921	11922	11924	11925	11926	11927	11928	11929
394	11930	11931	11932	11934	11935	11936	11937	11938	11939
395	11940	11941	11942	11944	11945	11946	11947	11948	11949
396	11950	11951	11952	11954	11955	11956	11957	11958	11959
397	11960	11961	11962	11964	11965	11966	11967	11968	11969
398	11970	11971	11972	11974	11975	11976	11977	11978	11979
399	11980	11981	11982	11984	11985	11986	11987	11988	11989
400	11990	11991	11992	11994	11995	11996	11997	11998	11999

(2) For axis 2

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
401	12000	12001	12002	12004	12005	12006	12007	12008	12009
402	12010	12011	12012	12014	12015	12016	12017	12018	12019
403	12020	12021	12022	12024	12025	12026	12027	12028	12029
404	12030	12031	12032	12034	12035	12036	12037	12038	12039
405	12040	12041	12042	12044	12045	12046	12047	12048	12049
406	12050	12051	12052	12054	12055	12056	12057	12058	12059
407	12060	12061	12062	12064	12065	12066	12067	12068	12069
408	12070	12071	12072	12074	12075	12076	12077	12078	12079
409	12080	12081	12082	12084	12085	12086	12087	12088	12089
410	12090	12091	12092	12094	12095	12096	12097	12098	12099
411	12100	12101	12102	12104	12105	12106	12107	12108	12109
412	12110	12111	12112	12114	12115	12116	12117	12118	12119
413	12120	12121	12122	12124	12125	12126	12127	12128	12129
414	12130	12131	12132	12134	12135	12136	12137	12138	12139
415	12140	12141	12142	12144	12145	12146	12147	12148	12149
416	12150	12151	12152	12154	12155	12156	12157	12158	12159
417	12160	12161	12162	12164	12165	12166	12167	12168	12169
418	12170	12171	12172	12174	12175	12176	12177	12178	12179
419	12180	12181	12182	12184	12185	12186	12187	12188	12189
420	12190	12191	12192	12194	12195	12196	12197	12198	12199
421	12200	12201	12202	12204	12205	12206	12207	12208	12209
422	12210	12211	12212	12214	12215	12216	12217	12218	12219
423	12220	12221	12222	12224	12225	12226	12227	12228	12229
424	12230	12231	12232	12234	12235	12236	12237	12238	12239
425	12240	12241	12242	12244	12245	12246	12247	12248	12249
426	12250	12251	12252	12254	12255	12256	12257	12258	12259
427	12260	12261	12262	12264	12265	12266	12267	12268	12269
428	12270	12271	12272	12274	12275	12276	12277	12278	12279
429	12280	12281	12282	12284	12285	12286	12287	12288	12289
430	12290	12291	12292	12294	12295	12296	12297	12298	12299
431	12300	12301	12302	12304	12305	12306	12307	12308	12309
432	12310	12311	12312	12314	12315	12316	12317	12318	12319
433	12320	12321	12322	12324	12325	12326	12327	12328	12329
434	12330	12331	12332	12334	12335	12336	12337	12338	12339
435	12340	12341	12342	12344	12345	12346	12347	12348	12349
436	12350	12351	12352	12354	12355	12356	12357	12358	12359
437	12360	12361	12362	12364	12365	12366	12367	12368	12369
438	12370	12371	12372	12374	12375	12376	12377	12378	12379
439	12380	12381	12382	12384	12385	12386	12387	12388	12389
440	12390	12391	12392	12394	12395	12396	12397	12398	12399
441	12400	12401	12402	12404	12405	12406	12407	12408	12409
442	12410	12411	12412	12414	12415	12416	12417	12418	12419
443	12420	12421	12422	12424	12425	12426	12427	12428	12429
444	12430	12431	12432	12434	12435	12436	12437	12438	12439
445	12440	12441	12442	12444	12445	12446	12447	12448	12449
446	12450	12451	12452	12454	12455	12456	12457	12458	12459
447	12460	12461	12462	12464	12465	12466	12467	12468	12469
448	12470	12471	12472	12474	12475	12476	12477	12478	12479
449	12480	12481	12482	12484	12485	12486	12487	12488	12489
450	12490	12491	12492	12494	12495	12496	12497	12498	12499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
451	12500	12501	12502	12504	12505	12506	12507	12508	12509
452	12510	12511	12512	12514	12515	12516	12517	12518	12519
453	12520	12521	12522	12524	12525	12526	12527	12528	12529
454	12530	12531	12532	12534	12535	12536	12537	12538	12539
455	12540	12541	12542	12544	12545	12546	12547	12548	12549
456	12550	12551	12552	12554	12555	12556	12557	12558	12559
457	12560	12561	12562	12564	12565	12566	12567	12568	12569
458	12570	12571	12572	12574	12575	12576	12577	12578	12579
459	12580	12581	12582	12584	12585	12586	12587	12588	12589
460	12590	12591	12592	12594	12595	12596	12597	12598	12599
461	12600	12601	12602	12604	12605	12606	12607	12608	12609
462	12610	12611	12612	12614	12615	12616	12617	12618	12619
463	12620	12621	12622	12624	12625	12626	12627	12628	12629
464	12630	12631	12632	12634	12635	12636	12637	12638	12639
465	12640	12641	12642	12644	12645	12646	12647	12648	12649
466	12650	12651	12652	12654	12655	12656	12657	12658	12659
467	12660	12661	12662	12664	12665	12666	12667	12668	12669
468	12670	12671	12672	12674	12675	12676	12677	12678	12679
469	12680	12681	12682	12684	12685	12686	12687	12688	12689
470	12690	12691	12692	12694	12695	12696	12697	12698	12699
471	12700	12701	12702	12704	12705	12706	12707	12708	12709
472	12710	12711	12712	12714	12715	12716	12717	12718	12719
473	12720	12721	12722	12724	12725	12726	12727	12728	12729
474	12730	12731	12732	12734	12735	12736	12737	12738	12739
475	12740	12741	12742	12744	12745	12746	12747	12748	12749
476	12750	12751	12752	12754	12755	12756	12757	12758	12759
477	12760	12761	12762	12764	12765	12766	12767	12768	12769
478	12770	12771	12772	12774	12775	12776	12777	12778	12779
479	12780	12781	12782	12784	12785	12786	12787	12788	12789
480	12790	12791	12792	12794	12795	12796	12797	12798	12799
481	12800	12801	12802	12804	12805	12806	12807	12808	12809
482	12810	12811	12812	12814	12815	12816	12817	12818	12819
483	12820	12821	12822	12824	12825	12826	12827	12828	12829
484	12830	12831	12832	12834	12835	12836	12837	12838	12839
485	12840	12841	12842	12844	12845	12846	12847	12848	12849
486	12850	12851	12852	12854	12855	12856	12857	12858	12859
487	12860	12861	12862	12864	12865	12866	12867	12868	12869
488	12870	12871	12872	12874	12875	12876	12877	12878	12879
489	12880	12881	12882	12884	12885	12886	12887	12888	12889
490	12890	12891	12892	12894	12895	12896	12897	12898	12899
491	12900	12901	12902	12904	12905	12906	12907	12908	12909
492	12910	12911	12912	12914	12915	12916	12917	12918	12919
493	12920	12921	12922	12924	12925	12926	12927	12928	12929
494	12930	12931	12932	12934	12935	12936	12937	12938	12939
495	12940	12941	12942	12944	12945	12946	12947	12948	12949
496	12950	12951	12952	12954	12955	12956	12957	12958	12959
497	12960	12961	12962	12964	12965	12966	12967	12968	12969
498	12970	12971	12972	12974	12975	12976	12977	12978	12979
499	12980	12981	12982	12984	12985	12986	12987	12988	12989
500	12990	12991	12992	12994	12995	12996	12997	12998	12999

(2) For axis 2

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
501	13000	13001	13002	13004	13005	13006	13007	13008	13009
502	13010	13011	13012	13014	13015	13016	13017	13018	13019
503	13020	13021	13022	13024	13025	13026	13027	13028	13029
504	13030	13031	13032	13034	13035	13036	13037	13038	13039
505	13040	13041	13042	13044	13045	13046	13047	13048	13049
506	13050	13051	13052	13054	13055	13056	13057	13058	13059
507	13060	13061	13062	13064	13065	13066	13067	13068	13069
508	13070	13071	13072	13074	13075	13076	13077	13078	13079
509	13080	13081	13082	13084	13085	13086	13087	13088	13089
510	13090	13091	13092	13094	13095	13096	13097	13098	13099
511	13100	13101	13102	13104	13105	13106	13107	13108	13109
512	13110	13111	13112	13114	13115	13116	13117	13118	13119
513	13120	13121	13122	13124	13125	13126	13127	13128	13129
514	13130	13131	13132	13134	13135	13136	13137	13138	13139
515	13140	13141	13142	13144	13145	13146	13147	13148	13149
516	13150	13151	13152	13154	13155	13156	13157	13158	13159
517	13160	13161	13162	13164	13165	13166	13167	13168	13169
518	13170	13171	13172	13174	13175	13176	13177	13178	13179
519	13180	13181	13182	13184	13185	13186	13187	13188	13189
520	13190	13191	13192	13194	13195	13196	13197	13198	13199
521	13200	13201	13202	13204	13205	13206	13207	13208	13209
522	13210	13211	13212	13214	13215	13216	13217	13218	13219
523	13220	13221	13222	13224	13225	13226	13227	13228	13229
524	13230	13231	13232	13234	13235	13236	13237	13238	13239
525	13240	13241	13242	13244	13245	13246	13247	13248	13249
526	13250	13251	13252	13254	13255	13256	13257	13258	13259
527	13260	13261	13262	13264	13265	13266	13267	13268	13269
528	13270	13271	13272	13274	13275	13276	13277	13278	13279
529	13280	13281	13282	13284	13285	13286	13287	13288	13289
530	13290	13291	13292	13294	13295	13296	13297	13298	13299
531	13300	13301	13302	13304	13305	13306	13307	13308	13309
532	13310	13311	13312	13314	13315	13316	13317	13318	13319
533	13320	13321	13322	13324	13325	13326	13327	13328	13329
534	13330	13331	13332	13334	13335	13336	13337	13338	13339
535	13340	13341	13342	13344	13345	13346	13347	13348	13349
536	13350	13351	13352	13354	13355	13356	13357	13358	13359
537	13360	13361	13362	13364	13365	13366	13367	13368	13369
538	13370	13371	13372	13374	13375	13376	13377	13378	13379
539	13380	13381	13382	13384	13385	13386	13387	13388	13389
540	13390	13391	13392	13394	13395	13396	13397	13398	13399
541	13400	13401	13402	13404	13405	13406	13407	13408	13409
542	13410	13411	13412	13414	13415	13416	13417	13418	13419
543	13420	13421	13422	13424	13425	13426	13427	13428	13429
544	13430	13431	13432	13434	13435	13436	13437	13438	13439
545	13440	13441	13442	13444	13445	13446	13447	13448	13449
546	13450	13451	13452	13454	13455	13456	13457	13458	13459
547	13460	13461	13462	13464	13465	13466	13467	13468	13469
548	13470	13471	13472	13474	13475	13476	13477	13478	13479
549	13480	13481	13482	13484	13485	13486	13487	13488	13489
550	13490	13491	13492	13494	13495	13496	13497	13498	13499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
551	13500	13501	13502	13504	13505	13506	13507	13508	13509
552	13510	13511	13512	13514	13515	13516	13517	13518	13519
553	13520	13521	13522	13524	13525	13526	13527	13528	13529
554	13530	13531	13532	13534	13535	13536	13537	13538	13539
555	13540	13541	13542	13544	13545	13546	13547	13548	13549
556	13550	13551	13552	13554	13555	13556	13557	13558	13559
557	13560	13561	13562	13564	13565	13566	13567	13568	13569
558	13570	13571	13572	13574	13575	13576	13577	13578	13579
559	13580	13581	13582	13584	13585	13586	13587	13588	13589
560	13590	13591	13592	13594	13595	13596	13597	13598	13599
561	13600	13601	13602	13604	13605	13606	13607	13608	13609
562	13610	13611	13612	13614	13615	13616	13617	13618	13619
563	13620	13621	13622	13624	13625	13626	13627	13628	13629
564	13630	13631	13632	13634	13635	13636	13637	13638	13639
565	13640	13641	13642	13644	13645	13646	13647	13648	13649
566	13650	13651	13652	13654	13655	13656	13657	13658	13659
567	13660	13661	13662	13664	13665	13666	13667	13668	13669
568	13670	13671	13672	13674	13675	13676	13677	13678	13679
569	13680	13681	13682	13684	13685	13686	13687	13688	13689
570	13690	13691	13692	13694	13695	13696	13697	13698	13699
571	13700	13701	13702	13704	13705	13706	13707	13708	13709
572	13710	13711	13712	13714	13715	13716	13717	13718	13719
573	13720	13721	13722	13724	13725	13726	13727	13728	13729
574	13730	13731	13732	13734	13735	13736	13737	13738	13739
575	13740	13741	13742	13744	13745	13746	13747	13748	13749
576	13750	13751	13752	13754	13755	13756	13757	13758	13759
577	13760	13761	13762	13764	13765	13766	13767	13768	13769
578	13770	13771	13772	13774	13775	13776	13777	13778	13779
579	13780	13781	13782	13784	13785	13786	13787	13788	13789
580	13790	13791	13792	13794	13795	13796	13797	13798	13799
581	13800	13801	13802	13804	13805	13806	13807	13808	13809
582	13810	13811	13812	13814	13815	13816	13817	13818	13819
583	13820	13821	13822	13824	13825	13826	13827	13828	13829
584	13830	13831	13832	13834	13835	13836	13837	13838	13839
585	13840	13841	13842	13844	13845	13846	13847	13848	13849
586	13850	13851	13852	13854	13855	13856	13857	13858	13859
587	13860	13861	13862	13864	13865	13866	13867	13868	13869
588	13870	13871	13872	13874	13875	13876	13877	13878	13879
589	13880	13881	13882	13884	13885	13886	13887	13888	13889
590	13890	13891	13892	13894	13895	13896	13897	13898	13899
591	13900	13901	13902	13904	13905	13906	13907	13908	13909
592	13910	13911	13912	13914	13915	13916	13917	13918	13919
593	13920	13921	13922	13924	13925	13926	13927	13928	13929
594	13930	13931	13932	13934	13935	13936	13937	13938	13939
595	13940	13941	13942	13944	13945	13946	13947	13948	13949
596	13950	13951	13952	13954	13955	13956	13957	13958	13959
597	13960	13961	13962	13964	13965	13966	13967	13968	13969
598	13970	13971	13972	13974	13975	13976	13977	13978	13979
599	13980	13981	13982	13984	13985	13986	13987	13988	13989
600	13990	13991	13992	13994	13995	13996	13997	13998	13999

(3) For axis 3

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
1	14000	14001	14002	14004	14005	14006	14007	14008	14009
2	14010	14011	14012	14014	14015	14016	14017	14018	14019
3	14020	14021	14022	14024	14025	14026	14027	14028	14029
4	14030	14031	14032	14034	14035	14036	14037	14038	14039
5	14040	14041	14042	14044	14045	14046	14047	14048	14049
6	14050	14051	14052	14054	14055	14056	14057	14058	14059
7	14060	14061	14062	14064	14065	14066	14067	14068	14069
8	14070	14071	14072	14074	14075	14076	14077	14078	14079
9	14080	14081	14082	14084	14085	14086	14087	14088	14089
10	14090	14091	14092	14094	14095	14096	14097	14098	14099
11	14100	14101	14102	14104	14105	14106	14107	14108	14109
12	14110	14111	14112	14114	14115	14116	14117	14118	14119
13	14120	14121	14122	14124	14125	14126	14127	14128	14129
14	14140	14131	14132	14134	14135	14136	14137	14138	14139
15	14140	14141	14142	14144	14145	14146	14147	14148	14149
16	14150	14151	14152	14154	14155	14156	14157	14158	14159
17	14160	14161	14162	14164	14165	14166	14167	14168	14169
18	14170	14171	14172	14174	14175	14176	14177	14178	14179
19	14180	14181	14182	14184	14185	14186	14187	14188	14189
20	14190	14191	14192	14194	14195	14196	14197	14198	14199
21	14200	14201	14202	14204	14205	14206	14207	14208	14209
22	14210	14211	14212	14214	14215	14216	14217	14218	14219
23	14220	14221	14222	14224	14225	14226	14227	14228	14229
24	14230	14231	14232	14234	14235	14236	14237	14238	14239
25	14240	14241	14242	14244	14245	14246	14247	14248	14249
26	14250	14251	14252	14254	14255	14256	14257	14258	14259
27	14260	14261	14262	14264	14265	14266	14267	14268	14269
28	14270	14271	14272	14274	14275	14276	14277	14278	14279
29	14280	14281	14282	14284	14285	14286	14287	14288	14289
30	14290	14291	14292	14294	14295	14296	14297	14298	14299
31	14300	14301	14302	14304	14305	14306	14307	14308	14309
32	14310	14311	14312	14314	14315	14316	14317	14318	14319
33	14320	14321	14322	14324	14325	14326	14327	14328	14329
34	14330	14331	14332	14334	14335	14336	14337	14338	14339
35	14340	14341	14342	14344	14345	14346	14347	14348	14349
36	14350	14351	14352	14354	14355	14356	14357	14358	14359
37	14360	14361	14362	14364	14365	14366	14367	14368	14369
38	14370	14371	14372	14374	14375	14376	14377	14378	14379
39	14380	14381	14382	14384	14385	14386	14387	14388	14389
40	14390	14391	14392	14394	14395	14396	14397	14398	14399
41	14400	14401	14402	14404	14405	14406	14407	14408	14409
42	14410	14411	14412	14414	14415	14416	14417	14418	14419
43	14420	14421	14422	14424	14425	14426	14427	14428	14429
44	14430	14431	14432	14434	14435	14436	14437	14438	14439
45	14440	14441	14442	14444	14445	14446	14447	14448	14449
46	14450	14451	14452	14454	14455	14456	14457	14458	14459
47	14460	14461	14462	14464	14465	14466	14467	14468	14469
48	14470	14471	14472	14474	14475	14476	14477	14478	14479
49	14480	14481	14482	14484	14485	14486	14487	14488	14489
50	14490	14491	14492	14494	14495	14496	14497	14498	14499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
51	14500	14501	14502	14504	14505	14506	14507	14508	14509
52	14510	14511	14512	14514	14515	14516	14517	14518	14519
53	14520	14521	14522	14524	14525	14526	14527	14528	14529
54	14530	14531	14532	14534	14535	14536	14537	14538	14539
55	14540	14541	14542	14544	14545	14546	14547	14548	14549
56	14550	14551	14552	14554	14555	14556	14557	14558	14559
57	14560	14561	14562	14564	14565	14566	14567	14568	14569
58	14570	14571	14572	14574	14575	14576	14577	14578	14579
59	14580	14581	14582	14584	14585	14586	14587	14588	14589
60	14590	14591	14592	14594	14595	14596	14597	14598	14599
61	14600	14601	14602	14604	14605	14606	14607	14608	14609
62	14610	14611	14612	14614	14615	14616	14617	14618	14619
63	14620	14621	14622	14624	14625	14626	14627	14628	14629
64	14630	14631	14632	14634	14635	14636	14637	14638	14639
65	14640	14641	14642	14644	14645	14646	14647	14648	14649
66	14650	14651	14652	14654	14655	14656	14657	14658	14659
67	14660	14661	14662	14664	14665	14666	14667	14668	14669
68	14670	14671	14672	14674	14675	14676	14677	14678	14679
69	14680	14681	14682	14684	14685	14686	14687	14688	14689
70	14690	14691	14692	14694	14695	14696	14697	14698	14699
71	14700	14701	14702	14704	14705	14706	14707	14708	14709
72	14710	14711	14712	14714	14715	14716	14717	14718	14719
73	14720	14721	14722	14724	14725	14726	14727	14728	14729
74	14730	14731	14732	14734	14735	14736	14737	14738	14739
75	14740	14741	14742	14744	14745	14746	14747	14748	14749
76	14750	14751	14752	14754	14755	14756	14757	14758	14759
77	14760	14761	14762	14764	14765	14766	14767	14768	14769
78	14770	14771	14772	14774	14775	14776	14777	14778	14779
79	14780	14781	14782	14784	14785	14786	14787	14788	14789
80	14790	14791	14792	14794	14795	14796	14797	14798	14799
81	14800	14801	14802	14804	14805	14806	14807	14808	14809
82	14810	14811	14812	14814	14815	14816	14817	14818	14819
83	14820	14821	14822	14824	14825	14826	14827	14828	14829
84	14830	14831	14832	14834	14835	14836	14837	14838	14839
85	14840	14841	14842	14844	14845	14846	14847	14848	14849
86	14850	14851	14852	14854	14855	14856	14857	14858	14859
87	14860	14861	14862	14864	14865	14866	14867	14868	14869
88	14870	14871	14872	14874	14875	14876	14877	14878	14879
89	14880	14881	14882	14884	14885	14886	14887	14888	14889
90	14890	14891	14892	14894	14895	14896	14897	14898	14899
91	14900	14901	14902	14904	14905	14906	14907	14908	14909
92	14910	14911	14912	14914	14915	14916	14917	14918	14919
93	14920	14921	14922	14924	14925	14926	14927	14928	14929
94	14930	14931	14932	14934	14935	14936	14937	14938	14939
95	14940	14941	14942	14944	14945	14946	14947	14948	14949
96	14950	14951	14952	14954	14955	14956	14957	14958	14959
97	14960	14961	14962	14964	14965	14966	14967	14968	14969
98	14970	14971	14972	14974	14975	14976	14977	14978	14979
99	14980	14981	14982	14984	14985	14986	14987	14988	14989
100	14990	14991	14992	14994	14995	14996	14997	14998	14999

(3) For axis 3

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
101	15000	15001	15002	15004	15005	15006	15007	15008	15009
102	15010	15011	15012	15014	15015	15016	15017	15018	15019
103	15020	15021	15022	15024	15025	15026	15027	15028	15029
104	15030	15031	15032	15034	15035	15036	15037	15038	15039
105	15040	15041	15042	15044	15045	15046	15047	15048	15049
106	15050	15051	15052	15054	15055	15056	15057	15058	15059
107	15060	15061	15062	15064	15065	15066	15067	15068	15069
108	15070	15071	15072	15074	15075	15076	15077	15078	15079
109	15080	15081	15082	15084	15085	15086	15087	15088	15089
110	15090	15091	15092	15094	15095	15096	15097	15098	15099
111	15100	15101	15102	15104	15105	15106	15107	15108	15109
112	15110	15111	15112	15114	15115	15116	15117	15118	15119
113	15120	15121	15122	15124	15125	15126	15127	15128	15129
114	15130	15131	15132	15134	15135	15136	15137	15138	15139
115	15140	15141	15142	15144	15145	15146	15147	15148	15149
116	15150	15151	15152	15154	15155	15156	15157	15158	15159
117	15160	15161	15162	15164	15165	15166	15167	15168	15169
118	15170	15171	15172	15174	15175	15176	15177	15178	15179
119	15180	15181	15182	15184	15185	15186	15187	15188	15189
120	15190	15191	15192	15194	15195	15196	15197	15198	15199
121	15200	15201	15202	15204	15205	15206	15207	15208	15209
122	15210	15211	15212	15214	15215	15216	15217	15218	15219
123	15220	15221	15222	15224	15225	15226	15227	15228	15229
124	15230	15231	15232	15234	15235	15236	15237	15238	15239
125	15240	15241	15242	15244	15245	15246	15247	15248	15249
126	15250	15251	15252	15254	15255	15256	15257	15258	15259
127	15260	15261	15262	15264	15265	15266	15267	15268	15269
128	15270	15271	15272	15274	15275	15276	15277	15278	15279
129	15280	15281	15282	15284	15285	15286	15287	15288	15289
130	15290	15291	15292	15294	15295	15296	15297	15298	15299
131	15300	15301	15302	15304	15305	15306	15307	15308	15309
132	15310	15311	15312	15314	15315	15316	15317	15318	15319
133	15320	15321	15322	15324	15325	15326	15327	15328	15329
134	15330	15331	15332	15334	15335	15336	15337	15338	15339
135	15340	15341	15342	15344	15345	15346	15347	15348	15349
136	15350	15351	15352	15354	15355	15356	15357	15358	15359
137	15360	15361	15362	15364	15365	15366	15367	15368	15369
138	15370	15371	15372	15374	15375	15376	15377	15378	15379
139	15380	15381	15382	15384	15385	15386	15387	15388	15389
140	15390	15391	15392	15394	15395	15396	15397	15398	15399
141	15400	15401	15402	15404	15405	15406	15407	15408	15409
142	15410	15411	15412	15414	15415	15416	15417	15418	15419
143	15420	15421	15422	15424	15425	15426	15427	15428	15429
144	15430	15431	15432	15434	15435	15436	15437	15438	15439
145	15440	15441	15442	15444	15445	15446	15447	15448	15449
146	15450	15451	15452	15454	15455	15456	15457	15458	15459
147	15460	15461	15462	15464	15465	15466	15467	15468	15469
148	15470	15471	15472	15474	15475	15476	15477	15478	15479
149	15480	15481	15482	15484	15485	15486	15487	15488	15489
150	15490	15491	15492	15494	15495	15496	15497	15498	15499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
151	15500	15501	15502	15504	15505	15506	15507	15508	15509
152	15510	15511	15512	15514	15515	15516	15517	15518	15519
153	15520	15521	15522	15524	15525	15526	15527	15528	15529
154	15530	15531	15532	15534	15535	15536	15537	15538	15539
155	15540	15541	15542	15544	15545	15546	15547	15548	15549
156	15550	15551	15552	15554	15555	15556	15557	15558	15559
157	15560	15561	15562	15564	15565	15566	15567	15568	15569
158	15570	15571	15572	15574	15575	15576	15577	15578	15579
159	15580	15581	15582	15584	15585	15586	15587	15588	15589
160	15590	15591	15592	15594	15595	15596	15597	15598	15599
161	15600	15601	15602	15604	15605	15606	15607	15608	15609
162	15610	15611	15612	15614	15615	15616	15617	15618	15619
163	15620	15621	15622	15624	15625	15626	15627	15628	15629
164	15630	15631	15632	15634	15635	15636	15637	15638	15639
165	15640	15641	15642	15644	15645	15646	15647	15648	15649
166	15650	15651	15652	15654	15655	15656	15657	15658	15659
167	15660	15661	15662	15664	15665	15666	15667	15668	15669
168	15670	15671	15672	15674	15675	15676	15677	15678	15679
169	15680	15681	15682	15684	15685	15686	15687	15688	15689
170	15690	15691	15692	15694	15695	15696	15697	15698	15699
171	15700	15701	15702	15704	15705	15706	15707	15708	15709
172	15710	15711	15712	15714	15715	15716	15717	15718	15719
173	15720	15721	15722	15724	15725	15726	15727	15728	15729
174	15730	15731	15732	15734	15735	15736	15737	15738	15739
175	15740	15741	15742	15744	15745	15746	15747	15748	15749
176	15750	15751	15752	15754	15755	15756	15757	15758	15759
177	15760	15761	15762	15764	15765	15766	15767	15768	15769
178	15770	15771	15772	15774	15775	15776	15777	15778	15779
179	15780	15781	15782	15784	15785	15786	15787	15788	15789
180	15790	15791	15792	15794	15795	15796	15797	15798	15799
181	15800	15801	15802	15804	15805	15806	15807	15808	15809
182	15810	15811	15812	15814	15815	15816	15817	15818	15819
183	15820	15821	15822	15824	15825	15826	15827	15828	15829
184	15830	15831	15832	15834	15835	15836	15837	15838	15839
185	15840	15841	15842	15844	15845	15846	15847	15848	15849
186	15850	15851	15852	15854	15855	15856	15857	15858	15859
187	15860	15861	15862	15864	15865	15866	15867	15868	15869
188	15870	15871	15872	15874	15875	15876	15877	15878	15879
189	15880	15881	15882	15884	15885	15886	15887	15888	15889
190	15890	15891	15892	15894	15895	15896	15897	15898	15899
191	15900	15901	15902	15904	15905	15906	15907	15908	15909
192	15910	15911	15912	15914	15915	15916	15917	15918	15919
193	15920	15921	15922	15924	15925	15926	15927	15928	15929
194	15930	15931	15932	15934	15935	15936	15937	15938	15939
195	15940	15941	15942	15944	15945	15946	15947	15948	15949
196	15950	15951	15952	15954	15955	15956	15957	15958	15959
197	15960	15961	15962	15964	15965	15966	15967	15968	15969
198	15970	15971	15972	15974	15975	15976	15977	15978	15979
199	15980	15981	15982	15984	15985	15986	15987	15988	15989
200	15990	15991	15992	15994	15995	15996	15997	15998	15999

(3) For axis 3

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
201	16000	16001	16002	16004	16005	16006	16007	16008	16009
202	16010	16011	16012	16014	16015	16016	16017	16018	16019
203	16020	16021	16022	16024	16025	16026	16027	16028	16029
204	16030	16031	16032	16034	16035	16036	16037	16038	16039
205	16040	16041	16042	16044	16045	16046	16047	16048	16049
206	16050	16051	16052	16054	16055	16056	16057	16058	16059
207	16060	16061	16062	16064	16065	16066	16067	16068	16069
208	16070	16071	16072	16074	16075	16076	16077	16078	16079
209	16080	16081	16082	16084	16085	16086	16087	16088	16089
210	16090	16091	16092	16094	16095	16096	16097	16098	16099
211	16100	16101	16102	16104	16105	16106	16107	16108	16109
212	16110	16111	16112	16114	16115	16116	16117	16118	16119
213	16120	16121	16122	16124	16125	16126	16127	16128	16129
214	16130	16131	16132	16134	16135	16136	16137	16138	16139
215	16140	16141	16142	16144	16145	16146	16147	16148	16149
216	16150	16151	16152	16154	16155	16156	16157	16158	16159
217	16160	16161	16162	16164	16165	16166	16167	16168	16169
218	16170	16171	16172	16174	16175	16176	16177	16178	16179
219	16180	16181	16182	16184	16185	16186	16187	16188	16189
220	16190	16191	16192	16194	16195	16196	16197	16198	16199
221	16200	16201	16202	16204	16205	16206	16207	16208	16209
222	16210	16211	16212	16214	16215	16216	16217	16218	16219
223	16220	16221	16222	16224	16225	16226	16227	16228	16229
224	16230	16231	16232	16234	16235	16236	16237	16238	16239
225	16240	16241	16242	16244	16245	16246	16247	16248	16249
226	16250	16251	16252	16254	16255	16256	16257	16258	16259
227	16260	16261	16262	16264	16265	16266	16267	16268	16269
228	16270	16271	16272	16274	16275	16276	16277	16278	16279
229	16280	16281	16282	16284	16285	16286	16287	16288	16289
230	16290	16291	16292	16294	16295	16296	16297	16298	16299
231	16300	16301	16302	16304	16305	16306	16307	16308	16309
232	16310	16311	16312	16314	16315	16316	16317	16318	16319
233	16320	16321	16322	16324	16325	16326	16327	16328	16329
234	16330	16331	16332	16334	16335	16336	16337	16338	16339
235	16340	16341	16342	16344	16345	16346	16347	16348	16349
236	16350	16351	16352	16354	16355	16356	16357	16358	16359
237	16360	16361	16362	16364	16365	16366	16367	16368	16369
238	16370	16371	16372	16374	16375	16376	16377	16378	16379
239	16380	16381	16382	16384	16385	16386	16387	16388	16389
240	16390	16391	16392	16394	16395	16396	16397	16398	16399
241	16400	16401	16402	16404	16405	16406	16407	16408	16409
242	16410	16411	16412	16414	16415	16416	16417	16418	16419
243	16420	16421	16422	16424	16425	16426	16427	16428	16429
244	16430	16431	16432	16434	16435	16436	16437	16438	16439
245	16440	16441	16442	16444	16445	16446	16447	16448	16449
246	16450	16451	16452	16454	16455	16456	16457	16458	16459
247	16460	16461	16462	16464	16465	16466	16467	16468	16469
248	16470	16471	16472	16474	16475	16476	16477	16478	16479
249	16480	16481	16482	16484	16485	16486	16487	16488	16489
250	16490	16491	16492	16494	16495	16496	16497	16498	16499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
251	16500	16501	16502	16504	16505	16506	16507	16508	16509
252	16510	16511	16512	16514	16515	16516	16517	16518	16519
253	16520	16521	16522	16524	16525	16526	16527	16528	16529
254	16530	16531	16532	16534	16535	16536	16537	16538	16539
255	16540	16541	16542	16544	16545	16546	16547	16548	16549
256	16550	16551	16552	16554	16555	16556	16557	16558	16559
257	16560	16561	16562	16564	16565	16566	16567	16568	16569
258	16570	16571	16572	16574	16575	16576	16577	16578	16579
259	16580	16581	16582	16584	16585	16586	16587	16588	16589
260	16590	16591	16592	16594	16595	16596	16597	16598	16599
261	16600	16601	16602	16604	16605	16606	16607	16608	16609
262	16610	16611	16612	16614	16615	16616	16617	16618	16619
263	16620	16621	16622	16624	16625	16626	16627	16628	16629
264	16630	16631	16632	16634	16635	16636	16637	16638	16639
265	16640	16641	16642	16644	16645	16646	16647	16648	16649
266	16650	16651	16652	16654	16655	16656	16657	16658	16659
267	16660	16661	16662	16664	16665	16666	16667	16668	16669
268	16670	16671	16672	16674	16675	16676	16677	16678	16679
269	16680	16681	16682	16684	16685	16686	16687	16688	16689
270	16690	16691	16692	16694	16695	16696	16697	16698	16699
271	16700	16701	16702	16704	16705	16706	16707	16708	16709
272	16710	16711	16712	16714	16715	16716	16717	16718	16719
273	16720	16721	16722	16724	16725	16726	16727	16728	16729
274	16730	16731	16732	16734	16735	16736	16737	16738	16739
275	16740	16741	16742	16744	16745	16746	16747	16748	16749
276	16750	16751	16752	16754	16755	16756	16757	16758	16759
277	16760	16761	16762	16764	16765	16766	16767	16768	16769
278	16770	16771	16772	16774	16775	16776	16777	16778	16779
279	16780	16781	16782	16784	16785	16786	16787	16788	16789
280	16790	16791	16792	16794	16795	16796	16797	16798	16799
281	16800	16801	16802	16804	16805	16806	16807	16808	16809
282	16810	16811	16812	16814	16815	16816	16817	16818	16819
283	16820	16821	16822	16824	16825	16826	16827	16828	16829
284	16830	16831	16832	16834	16835	16836	16837	16838	16839
285	16840	16841	16842	16844	16845	16846	16847	16848	16849
286	16850	16851	16852	16854	16855	16856	16857	16858	16859
287	16860	16861	16862	16864	16865	16866	16867	16868	16869
288	16870	16871	16872	16874	16875	16876	16877	16878	16879
289	16880	16881	16882	16884	16885	16886	16887	16888	16889
290	16890	16891	16892	16894	16895	16896	16897	16898	16899
291	16900	16901	16902	16904	16905	16906	16907	16908	16909
292	16910	16911	16912	16914	16915	16916	16917	16918	16919
293	16920	16921	16922	16924	16925	16926	16927	16928	16929
294	16930	16931	16932	16934	16935	16936	16937	16938	16939
295	16940	16941	16942	16944	16945	16946	16947	16948	16949
296	16950	16951	16952	16954	16955	16956	16957	16958	16959
297	16960	16961	16962	16964	16965	16966	16967	16968	16969
298	16970	16971	16972	16974	16975	16976	16977	16978	16979
299	16980	16981	16982	16984	16985	16986	16987	16988	16989
300	16990	16991	16992	16994	16995	16996	16997	16998	16999

(3) For axis 3

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
301	17000	17001	17002	17004	17005	17006	17007	17008	17009
302	17010	17011	17012	17014	17015	17016	17017	17018	17019
303	17020	17021	17022	17024	17025	17026	17027	17028	17029
304	17030	17031	17032	17034	17035	17036	17037	17038	17039
305	17040	17041	17042	17044	17045	17046	17047	17048	17049
306	17050	17051	17052	17054	17055	17056	17057	17058	17059
307	17060	17061	17062	17064	17065	17066	17067	17068	17069
308	17070	17071	17072	17074	17075	17076	17077	17078	17079
309	17080	17081	17082	17084	17085	17086	17087	17088	17089
310	17090	17091	17092	17094	17095	17096	17097	17098	17099
311	17100	17101	17102	17104	17105	17106	17107	17108	17109
312	17110	17111	17112	17114	17115	17116	17117	17118	17119
313	17120	17121	17122	17124	17125	17126	17127	17128	17129
314	17130	17131	17132	17134	17135	17136	17137	17138	17139
315	17140	17141	17142	17144	17145	17146	17147	17148	17149
316	17150	17151	17152	17154	17155	17156	17157	17158	17159
317	17160	17161	17162	17164	17165	17166	17167	17168	17169
318	17170	17171	17172	17174	17175	17176	17177	17178	17179
319	17180	17181	17182	17184	17185	17186	17187	17188	17189
320	17190	17191	17192	17194	17195	17196	17197	17198	17199
321	17200	17201	17202	17204	17205	17206	17207	17208	17209
322	17210	17211	17212	17214	17215	17216	17217	17218	17219
323	17220	17221	17222	17224	17225	17226	17227	17228	17229
324	17230	17231	17232	17234	17235	17236	17237	17238	17239
325	17240	17241	17242	17244	17245	17246	17247	17248	17249
326	17250	17251	17252	17254	17255	17256	17257	17258	17259
327	17260	17261	17262	17264	17265	17266	17267	17268	17269
328	17270	17271	17272	17274	17275	17276	17277	17278	17279
329	17280	17281	17282	17284	17285	17286	17287	17288	17289
330	17290	17291	17292	17294	17295	17296	17297	17298	17299
331	17300	17301	17302	17304	17305	17306	17307	17308	17309
332	17310	17311	17312	17314	17315	17316	17317	17318	17319
333	17320	17321	17322	17324	17325	17326	17327	17328	17329
334	17330	17331	17332	17334	17335	17336	17337	17338	17339
335	17340	17341	17342	17344	17345	17346	17347	17348	17349
336	17350	17351	17352	17354	17355	17356	17357	17358	17359
337	17360	17361	17362	17364	17365	17366	17367	17368	17369
338	17370	17371	17372	17374	17375	17376	17377	17378	17379
339	17380	17381	17382	17384	17385	17386	17387	17388	17389
340	17390	17391	17392	17394	17395	17396	17397	17398	17399
341	17400	17401	17402	17404	17405	17406	17407	17408	17409
342	17410	17411	17412	17414	17415	17416	17417	17418	17419
343	17420	17421	17422	17424	17425	17426	17427	17428	17429
344	17430	17431	17432	17434	17435	17436	17437	17438	17439
345	17440	17441	17442	17444	17445	17446	17447	17448	17449
346	17450	17451	17452	17454	17455	17456	17457	17458	17459
347	17460	17461	17462	17464	17465	17466	17467	17468	17469
348	17470	17471	17472	17474	17475	17476	17477	17478	17479
349	17480	17481	17482	17484	17485	17486	17487	17488	17489
350	17490	17491	17492	17494	17495	17496	17497	17498	17499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
351	17500	17501	17502	17504	17505	17506	17507	17508	17509
352	17510	17511	17512	17514	17515	17516	17517	17518	17519
353	17520	17521	17522	17524	17525	17526	17527	17528	17529
354	17530	17531	17532	17534	17535	17536	17537	17538	17539
355	17540	17541	17542	17544	17545	17546	17547	17548	17549
356	17550	17551	17552	17554	17555	17556	17557	17558	17559
357	17560	17561	17562	17564	17565	17566	17567	17568	17569
358	17570	17571	17572	17574	17575	17576	17577	17578	17579
359	17580	17581	17582	17584	17585	17586	17587	17588	17589
360	17590	17591	17592	17594	17595	17596	17597	17598	17599
361	17600	17601	17602	17604	17605	17606	17607	17608	17609
362	17610	17611	17612	17614	17615	17616	17617	17618	17619
363	17620	17621	17622	17624	17625	17626	17627	17628	17629
364	17630	17631	17632	17634	17635	17636	17637	17638	17639
365	17640	17641	17642	17644	17645	17646	17647	17648	17649
366	17650	17651	17652	17654	17655	17656	17657	17658	17659
367	17660	17661	17662	17664	17665	17666	17667	17668	17669
368	17670	17671	17672	17674	17675	17676	17677	17678	17679
369	17680	17681	17682	17684	17685	17686	17687	17688	17689
370	17690	17691	17692	17694	17695	17696	17697	17698	17699
371	17700	17701	17702	17704	17705	17706	17707	17708	17709
372	17710	17711	17712	17714	17715	17716	17717	17718	17719
373	17720	17721	17722	17724	17725	17726	17727	17728	17729
374	17730	17731	17732	17734	17735	17736	17737	17738	17739
375	17740	17741	17742	17744	17745	17746	17747	17748	17749
376	17750	17751	17752	17754	17755	17756	17757	17758	17759
377	17760	17761	17762	17764	17765	17766	17767	17768	17769
378	17770	17771	17772	17774	17775	17776	17777	17778	17779
379	17780	17781	17782	17784	17785	17786	17787	17788	17789
380	17790	17791	17792	17794	17795	17796	17797	17798	17799
381	17800	17801	17802	17804	17805	17806	17807	17808	17809
382	17810	17811	17812	17814	17815	17816	17817	17818	17819
383	17820	17821	17822	17824	17825	17826	17827	17828	17829
384	17830	17831	17832	17834	17835	17836	17837	17838	17839
385	17840	17841	17842	17844	17845	17846	17847	17848	17849
386	17850	17851	17852	17854	17855	17856	17857	17858	17859
387	17860	17861	17862	17864	17865	17866	17867	17868	17869
388	17870	17871	17872	17874	17875	17876	17877	17878	17879
389	17880	17881	17882	17884	17885	17886	17887	17888	17889
390	17890	17891	17892	17894	17895	17896	17897	17898	17899
391	17900	17901	17902	17904	17905	17906	17907	17908	17909
392	17910	17911	17912	17914	17915	17916	17917	17918	17919
393	17920	17921	17922	17924	17925	17926	17927	17928	17929
394	17930	17931	17932	17934	17935	17936	17937	17938	17939
395	17940	17941	17942	17944	17945	17946	17947	17948	17949
396	17950	17951	17952	17954	17955	17956	17957	17958	17959
397	17960	17961	17962	17964	17965	17966	17967	17968	17969
398	17970	17971	17972	17974	17975	17976	17977	17978	17979
399	17980	17981	17982	17984	17985	17986	17987	17988	17989
400	17990	17991	17992	17994	17995	17996	17997	17998	17999



(3) For axis 3

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
401	18000	18001	18002	18004	18005	18006	18007	18008	18009
402	18010	18011	18012	18014	18015	18016	18017	18018	18019
403	18020	18021	18022	18024	18025	18026	18027	18028	18029
404	18030	18031	18032	18034	18035	18036	18037	18038	18039
405	18040	18041	18042	18044	18045	18046	18047	18048	18049
406	18050	18051	18052	18054	18055	18056	18057	18058	18059
407	18060	18061	18062	18064	18065	18066	18067	18068	18069
408	18070	18071	18072	18074	18075	18076	18077	18078	18079
409	18080	18081	18082	18084	18085	18086	18087	18088	18089
410	18090	18091	18092	18094	18095	18096	18097	18098	18099
411	18100	18101	18102	18104	18105	18106	18107	18108	18109
412	18110	18111	18112	18114	18115	18116	18117	18118	18119
413	18120	18121	18122	18124	18125	18126	18127	18128	18129
414	18130	18131	18132	18134	18135	18136	18137	18138	18139
415	18140	18141	18142	18144	18145	18146	18147	18148	18149
416	18150	18151	18152	18154	18155	18156	18157	18158	18159
417	18160	18161	18162	18164	18165	18166	18167	18168	18169
418	18170	18171	18172	18174	18175	18176	18177	18178	18179
419	18180	18181	18182	18184	18185	18186	18187	18188	18189
420	18190	18191	18192	18194	18195	18196	18197	18198	18199
421	18200	18201	18202	18204	18205	18206	18207	18208	18209
422	18210	18211	18212	18214	18215	18216	18217	18218	18219
423	18220	18221	18222	18224	18225	18226	18227	18228	18229
424	18230	18231	18232	18234	18235	18236	18237	18238	18239
425	18240	18241	18242	18244	18245	18246	18247	18248	18249
426	18250	18251	18252	18254	18255	18256	18257	18258	18259
427	18260	18261	18262	18264	18265	18266	18267	18268	18269
428	18270	18271	18272	18274	18275	18276	18277	18278	18279
429	18280	18281	18282	18284	18285	18286	18287	18288	18289
430	18290	18291	18292	18294	18295	18296	18297	18298	18299
431	18300	18301	18302	18304	18305	18306	18307	18308	18309
432	18310	18311	18312	18314	18315	18316	18317	18318	18319
433	18320	18321	18322	18324	18325	18326	18327	18328	18329
434	18330	18331	18332	18334	18335	18336	18337	18338	18339
435	18340	18341	18342	18344	18345	18346	18347	18348	18349
436	18350	18351	18352	18354	18355	18356	18357	18358	18359
437	18360	18361	18362	18364	18365	18366	18367	18368	18369
438	18370	18371	18372	18374	18375	18376	18377	18378	18379
439	18380	18381	18382	18384	18385	18386	18387	18388	18389
440	18390	18391	18392	18394	18395	18396	18397	18398	18399
441	18400	18401	18402	18404	18405	18406	18407	18408	18409
442	18410	18411	18412	18414	18415	18416	18417	18418	18419
443	18420	18421	18422	18424	18425	18426	18427	18428	18429
444	18430	18431	18432	18434	18435	18436	18437	18438	18439
445	18440	18441	18442	18444	18445	18446	18447	18448	18449
446	18450	18451	18452	18454	18455	18456	18457	18458	18459
447	18460	18461	18462	18464	18465	18466	18467	18468	18469
448	18470	18471	18472	18474	18475	18476	18477	18478	18479
449	18480	18481	18482	18484	18485	18486	18487	18488	18489
450	18490	18491	18492	18494	18495	18496	18497	18498	18499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
451	18500	18501	18502	18504	18505	18506	18507	18508	18509
452	18510	18511	18512	18514	18515	18516	18517	18518	18519
453	18520	18521	18522	18524	18525	18526	18527	18528	18529
454	18530	18531	18532	18534	18535	18536	18537	18538	18539
455	18540	18541	18542	18544	18545	18546	18547	18548	18549
456	18550	18551	18552	18554	18555	18556	18557	18558	18559
457	18560	18561	18562	18564	18565	18566	18567	18568	18569
458	18570	18571	18572	18574	18575	18576	18577	18578	18579
459	18580	18581	18582	18584	18585	18586	18587	18588	18589
460	18590	18591	18592	18594	18595	18596	18597	18598	18599
461	18600	18601	18602	18604	18605	18606	18607	18608	18609
462	18610	18611	18612	18614	18615	18616	18617	18618	18619
463	18620	18621	18622	18624	18625	18626	18627	18628	18629
464	18630	18631	18632	18634	18635	18636	18637	18638	18639
465	18640	18641	18642	18644	18645	18646	18647	18648	18649
466	18650	18651	18652	18654	18655	18656	18657	18658	18659
467	18660	18661	18662	18664	18665	18666	18667	18668	18669
468	18670	18671	18672	18674	18675	18676	18677	18678	18679
469	18680	18681	18682	18684	18685	18686	18687	18688	18689
470	18690	18691	18692	18694	18695	18696	18697	18698	18699
471	18700	18701	18702	18704	18705	18706	18707	18708	18709
472	18710	18711	18712	18714	18715	18716	18717	18718	18719
473	18720	18721	18722	18724	18725	18726	18727	18728	18729
474	18730	18731	18732	18734	18735	18736	18737	18738	18739
475	18740	18741	18742	18744	18745	18746	18747	18748	18749
476	18750	18751	18752	18754	18755	18756	18757	18758	18759
477	18760	18761	18762	18764	18765	18766	18767	18768	18769
478	18770	18771	18772	18774	18775	18776	18777	18778	18779
479	18780	18781	18782	18784	18785	18786	18787	18788	18789
480	18790	18791	18792	18794	18795	18796	18797	18798	18799
481	18800	18801	18802	18804	18805	18806	18807	18808	18809
482	18810	18811	18812	18814	18815	18816	18817	18818	18819
483	18820	18821	18822	18824	18825	18826	18827	18828	18829
484	18830	18831	18832	18834	18835	18836	18837	18838	18839
485	18840	18841	18842	18844	18845	18846	18847	18848	18849
486	18850	18851	18852	18854	18855	18856	18857	18858	18859
487	18860	18861	18862	18864	18865	18866	18867	18868	18869
488	18870	18871	18872	18874	18875	18876	18877	18878	18879
489	18880	18881	18882	18884	18885	18886	18887	18888	18889
490	18890	18891	18892	18894	18895	18896	18897	18898	18899
491	18900	18901	18902	18904	18905	18906	18907	18908	18909
492	18910	18911	18912	18914	18915	18916	18917	18918	18919
493	18920	18921	18922	18924	18925	18926	18927	18928	18929
494	18930	18931	18932	18934	18935	18936	18937	18938	18939
495	18940	18941	18942	18944	18945	18946	18947	18948	18949
496	18950	18951	18952	18954	18955	18956	18957	18958	18959
497	18960	18961	18962	18964	18965	18966	18967	18968	18969
498	18970	18971	18972	18974	18975	18976	18977	18978	18979
499	18980	18981	18982	18984	18985	18986	18987	18988	18989
500	18990	18991	18992	18994	18995	18996	18997	18998	18999

(3) For axis 3

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
501	19000	19001	19002	19004	19005	19006	19007	19008	19009
502	19010	19011	19012	19014	19015	19016	19017	19018	19019
503	19020	19021	19022	19024	19025	19026	19027	19028	19029
504	19030	19031	19032	19034	19035	19036	19037	19038	19039
505	19040	19041	19042	19044	19045	19046	19047	19048	19049
506	19050	19051	19052	19054	19055	19056	19057	19058	19059
507	19060	19061	19062	19064	19065	19066	19067	19068	19069
508	19070	19071	19072	19074	19075	19076	19077	19078	19079
509	19080	19081	19082	19084	19085	19086	19087	19088	19089
510	19090	19091	19092	19094	19095	19096	19097	19098	19099
511	19100	19101	19102	19104	19105	19106	19107	19108	19109
512	19110	19111	19112	19114	19115	19116	19117	19118	19119
513	19120	19121	19122	19124	19125	19126	19127	19128	19129
514	19130	19131	19132	19134	19135	19136	19137	19138	19139
515	19140	19141	19142	19144	19145	19146	19147	19148	19149
516	19150	19151	19152	19154	19155	19156	19157	19158	19159
517	19160	19161	19162	19164	19165	19166	19167	19168	19169
518	19170	19171	19172	19174	19175	19176	19177	19178	19179
519	19180	19181	19182	19184	19185	19186	19187	19188	19189
520	19190	19191	19192	19194	19195	19196	19197	19198	19199
521	19200	19201	19202	19204	19205	19206	19207	19208	19209
522	19210	19211	19212	19214	19215	19216	19217	19218	19219
523	19220	19221	19222	19224	19225	19226	19227	19228	19229
524	19230	19231	19232	19234	19235	19236	19237	19238	19239
525	19240	19241	19242	19244	19245	19246	19247	19248	19249
526	19250	19251	19252	19254	19255	19256	19257	19258	19259
527	19260	19261	19262	19264	19265	19266	19267	19268	19269
528	19270	19271	19272	19274	19275	19276	19277	19278	19279
529	19280	19281	19282	19284	19285	19286	19287	19288	19289
530	19290	19291	19292	19294	19295	19296	19297	19298	19299
531	19300	19301	19302	19304	19305	19306	19307	19308	19309
532	19310	19311	19312	19314	19315	19316	19317	19318	19319
533	19320	19321	19322	19324	19325	19326	19327	19328	19329
534	19330	19331	19332	19334	19335	19336	19337	19338	19339
535	19340	19341	19342	19344	19345	19346	19347	19348	19349
536	19350	19351	19352	19354	19355	19356	19357	19358	19359
537	19360	19361	19362	19364	19365	19366	19367	19368	19369
538	19370	19371	19372	19374	19375	19376	19377	19378	19379
539	19380	19381	19382	19384	19385	19386	19387	19388	19389
540	19390	19391	19392	19394	19395	19396	19397	19398	19399
541	19400	19401	19402	19404	19405	19406	19407	19408	19409
542	19410	19411	19412	19414	19415	19416	19417	19418	19419
543	19420	19421	19422	19424	19425	19426	19427	19428	19429
544	19430	19431	19432	19434	19435	19436	19437	19438	19439
545	19440	19441	19442	19444	19445	19446	19447	19448	19449
546	19450	19451	19452	19454	19455	19456	19457	19458	19459
547	19460	19461	19462	19464	19465	19466	19467	19468	19469
548	19470	19471	19472	19474	19475	19476	19477	19478	19479
549	19480	19481	19482	19484	19485	19486	19487	19488	19489
550	19490	19491	19492	19494	19495	19496	19497	19498	19499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
551	19500	19501	19502	19504	19505	19506	19507	19508	19509
552	19510	19511	19512	19514	19515	19516	19517	19518	19519
553	19520	19521	19522	19524	19525	19526	19527	19528	19529
554	19530	19531	19532	19534	19535	19536	19537	19538	19539
555	19540	19541	19542	19544	19545	19546	19547	19548	19549
556	19550	19551	19552	19554	19555	19556	19557	19558	19559
557	19560	19561	19562	19564	19565	19566	19567	19568	19569
558	19570	19571	19572	19574	19575	19576	19577	19578	19579
559	19580	19581	19582	19584	19585	19586	19587	19588	19589
560	19590	19591	19592	19594	19595	19596	19597	19598	19599
561	19600	19601	19602	19604	19605	19606	19607	19608	19609
562	19610	19611	19612	19614	19615	19616	19617	19618	19619
563	19620	19621	19622	19624	19625	19626	19627	19628	19629
564	19630	19631	19632	19634	19635	19636	19637	19638	19639
565	19640	19641	19642	19644	19645	19646	19647	19648	19649
566	19650	19651	19652	19654	19655	19656	19657	19658	19659
567	19660	19661	19662	19664	19665	19666	19667	19668	19669
568	19670	19671	19672	19674	19675	19676	19677	19678	19679
569	19680	19681	19682	19684	19685	19686	19687	19688	19689
570	19690	19691	19692	19694	19695	19696	19697	19698	19699
571	19700	19701	19702	19704	19705	19706	19707	19708	19709
572	19710	19711	19712	19714	19715	19716	19717	19718	19719
573	19720	19721	19722	19724	19725	19726	19727	19728	19729
574	19730	19731	19732	19734	19735	19736	19737	19738	19739
575	19740	19741	19742	19744	19745	19746	19747	19748	19749
576	19750	19751	19752	19754	19755	19756	19757	19758	19759
577	19760	19761	19762	19764	19765	19766	19767	19768	19769
578	19770	19771	19772	19774	19775	19776	19777	19778	19779
579	19780	19781	19782	19784	19785	19786	19787	19788	19789
580	19790	19791	19792	19794	19795	19796	19797	19798	19799
581	19800	19801	19802	19804	19805	19806	19807	19808	19809
582	19810	19811	19812	19814	19815	19816	19817	19818	19819
583	19820	19821	19822	19824	19825	19826	19827	19828	19829
584	19830	19831	19832	19834	19835	19836	19837	19838	19839
585	19840	19841	19842	19844	19845	19846	19847	19848	19849
586	19850	19851	19852	19854	19855	19856	19857	19858	19859
587	19860	19861	19862	19864	19865	19866	19867	19868	19869
588	19870	19871	19872	19874	19875	19876	19877	19878	19879
589	19880	19881	19882	19884	19885	19886	19887	19888	19889
590	19890	19891	19892	19894	19895	19896	19897	19898	19899
591	19900	19901	19902	19904	19905	19906	19907	19908	19909
592	19910	19911	19912	19914	19915	19916	19917	19918	19919
593	19920	19921	19922	19924	19925	19926	19927	19928	19929
594	19930	19931	19932	19934	19935	19936	19937	19938	19939
595	19940	19941	19942	19944	19945	19946	19947	19948	19949
596	19950	19951	19952	19954	19955	19956	19957	19958	19959
597	19960	19961	19962	19964	19965	19966	19967	19968	19969
598	19970	19971	19972	19974	19975	19976	19977	19978	19979
599	19980	19981	19982	19984	19985	19986	19987	19988	19989
600	19990	19991	19992	19994	19995	19996	19997	19998	19999

(4) For axis 4

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
1	20000	20001	20002	20004	20005	20006	20007	20008	20009
2	20010	20011	20012	20014	20015	20016	20017	20018	20019
3	20020	20021	20022	20024	20025	20026	20027	20028	20029
4	20030	20031	20032	20034	20035	20036	20037	20038	20039
5	20040	20041	20042	20044	20045	20046	20047	20048	20049
6	20050	20051	20052	20054	20055	20056	20057	20058	20059
7	20060	20061	20062	20064	20065	20066	20067	20068	20069
8	20070	20071	20072	20074	20075	20076	20077	20078	20079
9	20080	20081	20082	20084	20085	20086	20087	20088	20089
10	20090	20091	20092	20094	20095	20096	20097	20098	20099
11	20100	20101	20102	20104	20105	20106	20107	20108	20109
12	20110	20111	20112	20114	20115	20116	20117	20118	20119
13	20120	20121	20122	20124	20125	20126	20127	20128	20129
14	20140	20131	20132	20134	20135	20136	20137	20138	20139
15	20140	20141	20142	20144	20145	20146	20147	20148	20149
16	20150	20151	20152	20154	20155	20156	20157	20158	20159
17	20160	20161	20162	20164	20165	20166	20167	20168	20169
18	20170	20171	20172	20174	20175	20176	20177	20178	20179
19	20180	20181	20182	20184	20185	20186	20187	20188	20189
20	20190	20191	20192	20194	20195	20196	20197	20198	20199
21	20200	20201	20202	20204	20205	20206	20207	20208	20209
22	20210	20211	20212	20214	20215	20216	20217	20218	20219
23	20220	20221	20222	20224	20225	20226	20227	20228	20229
24	20230	20231	20232	20234	20235	20236	20237	20238	20239
25	20240	20241	20242	20244	20245	20246	20247	20248	20249
26	20250	20251	20252	20254	20255	20256	20257	20258	20259
27	20260	20261	20262	20264	20265	20266	20267	20268	20269
28	20270	20271	20272	20274	20275	20276	20277	20278	20279
29	20280	20281	20282	20284	20285	20286	20287	20288	20289
30	20290	20291	20292	20294	20295	20296	20297	20298	20299
31	20300	20301	20302	20304	20305	20306	20307	20308	20309
32	20310	20311	20312	20314	20315	20316	20317	20318	20319
33	20320	20321	20322	20324	20325	20326	20327	20328	20329
34	20330	20331	20332	20334	20335	20336	20337	20338	20339
35	20340	20341	20342	20344	20345	20346	20347	20348	20349
36	20350	20351	20352	20354	20355	20356	20357	20358	20359
37	20360	20361	20362	20364	20365	20366	20367	20368	20369
38	20370	20371	20372	20374	20375	20376	20377	20378	20379
39	20380	20381	20382	20384	20385	20386	20387	20388	20389
40	20390	20391	20392	20394	20395	20396	20397	20398	20399
41	20400	20401	20402	20404	20405	20406	20407	20408	20409
42	20410	20411	20412	20414	20415	20416	20417	20418	20419
43	20420	20421	20422	20424	20425	20426	20427	20428	20429
44	20430	20431	20432	20434	20435	20436	20437	20438	20439
45	20440	20441	20442	20444	20445	20446	20447	20448	20449
46	20450	20451	20452	20454	20455	20456	20457	20458	20459
47	20460	20461	20462	20464	20465	20466	20467	20468	20469
48	20470	20471	20472	20474	20475	20476	20477	20478	20479
49	20480	20481	20482	20484	20485	20486	20487	20488	20489
50	20490	20491	20492	20494	20495	20496	20497	20498	20499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
51	20500	20501	20502	20504	20505	20506	20507	20508	20509
52	20510	20511	20512	20514	20515	20516	20517	20518	20519
53	20520	20521	20522	20524	20525	20526	20527	20528	20529
54	20530	20531	20532	20534	20535	20536	20537	20538	20539
55	20540	20541	20542	20544	20545	20546	20547	20548	20549
56	20550	20551	20552	20554	20555	20556	20557	20558	20559
57	20560	20561	20562	20564	20565	20566	20567	20568	20569
58	20570	20571	20572	20574	20575	20576	20577	20578	20579
59	20580	20581	20582	20584	20585	20586	20587	20588	20589
60	20590	20591	20592	20594	20595	20596	20597	20598	20599
61	20600	20601	20602	20604	20605	20606	20607	20608	20609
62	20610	20611	20612	20614	20615	20616	20617	20618	20619
63	20620	20621	20622	20624	20625	20626	20627	20628	20629
64	20630	20631	20632	20634	20635	20636	20637	20638	20639
65	20640	20641	20642	20644	20645	20646	20647	20648	20649
66	20650	20651	20652	20654	20655	20656	20657	20658	20659
67	20660	20661	20662	20664	20665	20666	20667	20668	20669
68	20670	20671	20672	20674	20675	20676	20677	20678	20679
69	20680	20681	20682	20684	20685	20686	20687	20688	20689
70	20690	20691	20692	20694	20695	20696	20697	20698	20699
71	20700	20701	20702	20704	20705	20706	20707	20708	20709
72	20710	20711	20712	20714	20715	20716	20717	20718	20719
73	20720	20721	20722	20724	20725	20726	20727	20728	20729
74	20730	20731	20732	20734	20735	20736	20737	20738	20739
75	20740	20741	20742	20744	20745	20746	20747	20748	20749
76	20750	20751	20752	20754	20755	20756	20757	20758	20759
77	20760	20761	20762	20764	20765	20766	20767	20768	20769
78	20770	20771	20772	20774	20775	20776	20777	20778	20779
79	20780	20781	20782	20784	20785	20786	20787	20788	20789
80	20790	20791	20792	20794	20795	20796	20797	20798	20799
81	20800	20801	20802	20804	20805	20806	20807	20808	20809
82	20810	20811	20812	20814	20815	20816	20817	20818	20819
83	20820	20821	20822	20824	20825	20826	20827	20828	20829
84	20830	20831	20832	20834	20835	20836	20837	20838	20839
85	20840	20841	20842	20844	20845	20846	20847	20848	20849
86	20850	20851	20852	20854	20855	20856	20857	20858	20859
87	20860	20861	20862	20864	20865	20866	20867	20868	20869
88	20870	20871	20872	20874	20875	20876	20877	20878	20879
89	20880	20881	20882	20884	20885	20886	20887	20888	20889
90	20890	20891	20892	20894	20895	20896	20897	20898	20899
91	20900	20901	20902	20904	20905	20906	20907	20908	20909
92	20910	20911	20912	20914	20915	20916	20917	20918	20919
93	20920	20921	20922	20924	20925	20926	20927	20928	20929
94	20930	20931	20932	20934	20935	20936	20937	20938	20939
95	20940	20941	20942	20944	20945	20946	20947	20948	20949
96	20950	20951	20952	20954	20955	20956	20957	20958	20959
97	20960	20961	20962	20964	20965	20966	20967	20968	20969
98	20970	20971	20972	20974	20975	20976	20977	20978	20979
99	20980	20981	20982	20984	20985	20986	20987	20988	20989
100	20990	20991	20992	20994	20995	20996	20997	20998	20999

(4) For axis 4

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
101	21000	21001	21002	21004	21005	21006	21007	21008	21009
102	21010	21011	21012	21014	21015	21016	21017	21018	21019
103	21020	21021	21022	21024	21025	21026	21027	21028	21029
104	21030	21031	21032	21034	21035	21036	21037	21038	21039
105	21040	21041	21042	21044	21045	21046	21047	21048	21049
106	21050	21051	21052	21054	21055	21056	21057	21058	21059
107	21060	21061	21062	21064	21065	21066	21067	21068	21069
108	21070	21071	21072	21074	21075	21076	21077	21078	21079
109	21080	21081	21082	21084	21085	21086	21087	21088	21089
110	21090	21091	21092	21094	21095	21096	21097	21098	21099
111	21100	21101	21102	21104	21105	21106	21107	21108	21109
112	21110	21111	21112	21114	21115	21116	21117	21118	21119
113	21120	21121	21122	21124	21125	21126	21127	21128	21129
114	21130	21131	21132	21134	21135	21136	21137	21138	21139
115	21140	21141	21142	21144	21145	21146	21147	21148	21149
116	21150	21151	21152	21154	21155	21156	21157	21158	21159
117	21160	21161	21162	21164	21165	21166	21167	21168	21169
118	21170	21171	21172	21174	21175	21176	21177	21178	21179
119	21180	21181	21182	21184	21185	21186	21187	21188	21189
120	21190	21191	21192	21194	21195	21196	21197	21198	21199
121	21200	21201	21202	21204	21205	21206	21207	21208	21209
122	21210	21211	21212	21214	21215	21216	21217	21218	21219
123	21220	21221	21222	21224	21225	21226	21227	21228	21229
124	21230	21231	21232	21234	21235	21236	21237	21238	21239
125	21240	21241	21242	21244	21245	21246	21247	21248	21249
126	21250	21251	21252	21254	21255	21256	21257	21258	21259
127	21260	21261	21262	21264	21265	21266	21267	21268	21269
128	21270	21271	21272	21274	21275	21276	21277	21278	21279
129	21280	21281	21282	21284	21285	21286	21287	21288	21289
130	21290	21291	21292	21294	21295	21296	21297	21298	21299
131	21300	21301	21302	21304	21305	21306	21307	21308	21309
132	21310	21311	21312	21314	21315	21316	21317	21318	21319
133	21320	21321	21322	21324	21325	21326	21327	21328	21329
134	21330	21331	21332	21334	21335	21336	21337	21338	21339
135	21340	21341	21342	21344	21345	21346	21347	21348	21349
136	21350	21351	21352	21354	21355	21356	21357	21358	21359
137	21360	21361	21362	21364	21365	21366	21367	21368	21369
138	21370	21371	21372	21374	21375	21376	21377	21378	21379
139	21380	21381	21382	21384	21385	21386	21387	21388	21389
140	21390	21391	21392	21394	21395	21396	21397	21398	21399
141	21400	21401	21402	21404	21405	21406	21407	21408	21409
142	21410	21411	21412	21414	21415	21416	21417	21418	21419
143	21420	21421	21422	21424	21425	21426	21427	21428	21429
144	21430	21431	21432	21434	21435	21436	21437	21438	21439
145	21440	21441	21442	21444	21445	21446	21447	21448	21449
146	21450	21451	21452	21454	21455	21456	21457	21458	21459
147	21460	21461	21462	21464	21465	21466	21467	21468	21469
148	21470	21471	21472	21474	21475	21476	21477	21478	21479
149	21480	21481	21482	21484	21485	21486	21487	21488	21489
150	21490	21491	21492	21494	21495	21496	21497	21498	21499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
151	21500	21501	21502	21504	21505	21506	21507	21508	21509
152	21510	21511	21512	21514	21515	21516	21517	21518	21519
153	21520	21521	21522	21524	21525	21526	21527	21528	21529
154	21530	21531	21532	21534	21535	21536	21537	21538	21539
155	21540	21541	21542	21544	21545	21546	21547	21548	21549
156	21550	21551	21552	21554	21555	21556	21557	21558	21559
157	21560	21561	21562	21564	21565	21566	21567	21568	21569
158	21570	21571	21572	21574	21575	21576	21577	21578	21579
159	21580	21581	21582	21584	21585	21586	21587	21588	21589
160	21590	21591	21592	21594	21595	21596	21597	21598	21599
161	21600	21601	21602	21604	21605	21606	21607	21608	21609
162	21610	21611	21612	21614	21615	21616	21617	21618	21619
163	21620	21621	21622	21624	21625	21626	21627	21628	21629
164	21630	21631	21632	21634	21635	21636	21637	21638	21639
165	21640	21641	21642	21644	21645	21646	21647	21648	21649
166	21650	21651	21652	21654	21655	21656	21657	21658	21659
167	21660	21661	21662	21664	21665	21666	21667	21668	21669
168	21670	21671	21672	21674	21675	21676	21677	21678	21679
169	21680	21681	21682	21684	21685	21686	21687	21688	21689
170	21690	21691	21692	21694	21695	21696	21697	21698	21699
171	21700	21701	21702	21704	21705	21706	21707	21708	21709
172	21710	21711	21712	21714	21715	21716	21717	21718	21719
173	21720	21721	21722	21724	21725	21726	21727	21728	21729
174	21730	21731	21732	21734	21735	21736	21737	21738	21739
175	21740	21741	21742	21744	21745	21746	21747	21748	21749
176	21750	21751	21752	21754	21755	21756	21757	21758	21759
177	21760	21761	21762	21764	21765	21766	21767	21768	21769
178	21770	21771	21772	21774	21775	21776	21777	21778	21779
179	21780	21781	21782	21784	21785	21786	21787	21788	21789
180	21790	21791	21792	21794	21795	21796	21797	21798	21799
181	21800	21801	21802	21804	21805	21806	21807	21808	21809
182	21810	21811	21812	21814	21815	21816	21817	21818	21819
183	21820	21821	21822	21824	21825	21826	21827	21828	21829
184	21830	21831	21832	21834	21835	21836	21837	21838	21839
185	21840	21841	21842	21844	21845	21846	21847	21848	21849
186	21850	21851	21852	21854	21855	21856	21857	21858	21859
187	21860	21861	21862	21864	21865	21866	21867	21868	21869
188	21870	21871	21872	21874	21875	21876	21877	21878	21879
189	21880	21881	21882	21884	21885	21886	21887	21888	21889
190	21890	21891	21892	21894	21895	21896	21897	21898	21899
191	21900	21901	21902	21904	21905	21906	21907	21908	21909
192	21910	21911	21912	21914	21915	21916	21917	21918	21919
193	21920	21921	21922	21924	21925	21926	21927	21928	21929
194	21930	21931	21932	21934	21935	21936	21937	21938	21939
195	21940	21941	21942	21944	21945	21946	21947	21948	21949
196	21950	21951	21952	21954	21955	21956	21957	21958	21959
197	21960	21961	21962	21964	21965	21966	21967	21968	21969
198	21970	21971	21972	21974	21975	21976	21977	21978	21979
199	21980	21981	21982	21984	21985	21986	21987	21988	21989
200	21990	21991	21992	21994	21995	21996	21997	21998	21999

(4) For axis 4

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
201	22000	22001	22002	22004	22005	22006	22007	22008	22009
202	22010	22011	22012	22014	22015	22016	22017	22018	22019
203	22020	22021	22022	22024	22025	22026	22027	22028	22029
204	22030	22031	22032	22034	22035	22036	22037	22038	22039
205	22040	22041	22042	22044	22045	22046	22047	22048	22049
206	22050	22051	22052	22054	22055	22056	22057	22058	22059
207	22060	22061	22062	22064	22065	22066	22067	22068	22069
208	22070	22071	22072	22074	22075	22076	22077	22078	22079
209	22080	22081	22082	22084	22085	22086	22087	22088	22089
210	22090	22091	22092	22094	22095	22096	22097	22098	22099
211	22100	22101	22102	22104	22105	22106	22107	22108	22109
212	22110	22111	22112	22114	22115	22116	22117	22118	22119
213	22120	22121	22122	22124	22125	22126	22127	22128	22129
214	22130	22131	22132	22134	22135	22136	22137	22138	22139
215	22140	22141	22142	22144	22145	22146	22147	22148	22149
216	22150	22151	22152	22154	22155	22156	22157	22158	22159
217	22160	22161	22162	22164	22165	22166	22167	22168	22169
218	22170	22171	22172	22174	22175	22176	22177	22178	22179
219	22180	22181	22182	22184	22185	22186	22187	22188	22189
220	22190	22191	22192	22194	22195	22196	22197	22198	22199
221	22200	22201	22202	22204	22205	22206	22207	22208	22209
222	22210	22211	22212	22214	22215	22216	22217	22218	22219
223	22220	22221	22222	22224	22225	22226	22227	22228	22229
224	22230	22231	22232	22234	22235	22236	22237	22238	22239
225	22240	22241	22242	22244	22245	22246	22247	22248	22249
226	22250	22251	22252	22254	22255	22256	22257	22258	22259
227	22260	22261	22262	22264	22265	22266	22267	22268	22269
228	22270	22271	22272	22274	22275	22276	22277	22278	22279
229	22280	22281	22282	22284	22285	22286	22287	22288	22289
230	22290	22291	22292	22294	22295	22296	22297	22298	22299
231	22300	22301	22302	22304	22305	22306	22307	22308	22309
232	22310	22311	22312	22314	22315	22316	22317	22318	22319
233	22320	22321	22322	22324	22325	22326	22327	22328	22329
234	22330	22331	22332	22334	22335	22336	22337	22338	22339
235	22340	22341	22342	22344	22345	22346	22347	22348	22349
236	22350	22351	22352	22354	22355	22356	22357	22358	22359
237	22360	22361	22362	22364	22365	22366	22367	22368	22369
238	22370	22371	22372	22374	22375	22376	22377	22378	22379
239	22380	22381	22382	22384	22385	22386	22387	22388	22389
240	22390	22391	22392	22394	22395	22396	22397	22398	22399
241	22400	22401	22402	22404	22405	22406	22407	22408	22409
242	22410	22411	22412	22414	22415	22416	22417	22418	22419
243	22420	22421	22422	22424	22425	22426	22427	22428	22429
244	22430	22431	22432	22434	22435	22436	22437	22438	22439
245	22440	22441	22442	22444	22445	22446	22447	22448	22449
246	22450	22451	22452	22454	22455	22456	22457	22458	22459
247	22460	22461	22462	22464	22465	22466	22467	22468	22469
248	22470	22471	22472	22474	22475	22476	22477	22478	22479
249	22480	22481	22482	22484	22485	22486	22487	22488	22489
250	22490	22491	22492	22494	22495	22496	22497	22498	22499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
251	22500	22501	22502	22504	22505	22506	22507	22508	22509
252	22510	22511	22512	22514	22515	22516	22517	22518	22519
253	22520	22521	22522	22524	22525	22526	22527	22528	22529
254	22530	22531	22532	22534	22535	22536	22537	22538	22539
255	22540	22541	22542	22544	22545	22546	22547	22548	22549
256	22550	22551	22552	22554	22555	22556	22557	22558	22559
257	22560	22561	22562	22564	22565	22566	22567	22568	22569
258	22570	22571	22572	22574	22575	22576	22577	22578	22579
259	22580	22581	22582	22584	22585	22586	22587	22588	22589
260	22590	22591	22592	22594	22595	22596	22597	22598	22599
261	22600	22601	22602	22604	22605	22606	22607	22608	22609
262	22610	22611	22612	22614	22615	22616	22617	22618	22619
263	22620	22621	22622	22624	22625	22626	22627	22628	22629
264	22630	22631	22632	22634	22635	22636	22637	22638	22639
265	22640	22641	22642	22644	22645	22646	22647	22648	22649
266	22650	22651	22652	22654	22655	22656	22657	22658	22659
267	22660	22661	22662	22664	22665	22666	22667	22668	22669
268	22670	22671	22672	22674	22675	22676	22677	22678	22679
269	22680	22681	22682	22684	22685	22686	22687	22688	22689
270	22690	22691	22692	22694	22695	22696	22697	22698	22699
271	22700	22701	22702	22704	22705	22706	22707	22708	22709
272	22710	22711	22712	22714	22715	22716	22717	22718	22719
273	22720	22721	22722	22724	22725	22726	22727	22728	22729
274	22730	22731	22732	22734	22735	22736	22737	22738	22739
275	22740	22741	22742	22744	22745	22746	22747	22748	22749
276	22750	22751	22752	22754	22755	22756	22757	22758	22759
277	22760	22761	22762	22764	22765	22766	22767	22768	22769
278	22770	22771	22772	22774	22775	22776	22777	22778	22779
279	22780	22781	22782	22784	22785	22786	22787	22788	22789
280	22790	22791	22792	22794	22795	22796	22797	22798	22799
281	22800	22801	22802	22804	22805	22806	22807	22808	22809
282	22810	22811	22812	22814	22815	22816	22817	22818	22819
283	22820	22821	22822	22824	22825	22826	22827	22828	22829
284	22830	22831	22832	22834	22835	22836	22837	22838	22839
285	22840	22841	22842	22844	22845	22846	22847	22848	22849
286	22850	22851	22852	22854	22855	22856	22857	22858	22859
287	22860	22861	22862	22864	22865	22866	22867	22868	22869
288	22870	22871	22872	22874	22875	22876	22877	22878	22879
289	22880	22881	22882	22884	22885	22886	22887	22888	22889
290	22890	22891	22892	22894	22895	22896	22897	22898	22899
291	22900	22901	22902	22904	22905	22906	22907	22908	22909
292	22910	22911	22912	22914	22915	22916	22917	22918	22919
293	22920	22921	22922	22924	22925	22926	22927	22928	22929
294	22930	22931	22932	22934	22935	22936	22937	22938	22939
295	22940	22941	22942	22944	22945	22946	22947	22948	22949
296	22950	22951	22952	22954	22955	22956	22957	22958	22959
297	22960	22961	22962	22964	22965	22966	22967	22968	22969
298	22970	22971	22972	22974	22975	22976	22977	22978	22979
299	22980	22981	22982	22984	22985	22986	22987	22988	22989
300	22990	22991	22992	22994	22995	22996	22997	22998	22999

(4) For axis 4

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
301	23000	23001	23002	23004	23005	23006	23007	23008	23009
302	23010	23011	23012	23014	23015	23016	23017	23018	23019
303	23020	23021	23022	23024	23025	23026	23027	23028	23029
304	23030	23031	23032	23034	23035	23036	23037	23038	23039
305	23040	23041	23042	23044	23045	23046	23047	23048	23049
306	23050	23051	23052	23054	23055	23056	23057	23058	23059
307	23060	23061	23062	23064	23065	23066	23067	23068	23069
308	23070	23071	23072	23074	23075	23076	23077	23078	23079
309	23080	23081	23082	23084	23085	23086	23087	23088	23089
310	23090	23091	23092	23094	23095	23096	23097	23098	23099
311	23100	23101	23102	23104	23105	23106	23107	23108	23109
312	23110	23111	23112	23114	23115	23116	23117	23118	23119
313	23120	23121	23122	23124	23125	23126	23127	23128	23129
314	23130	23131	23132	23134	23135	23136	23137	23138	23139
315	23140	23141	23142	23144	23145	23146	23147	23148	23149
316	23150	23151	23152	23154	23155	23156	23157	23158	23159
317	23160	23161	23162	23164	23165	23166	23167	23168	23169
318	23170	23171	23172	23174	23175	23176	23177	23178	23179
319	23180	23181	23182	23184	23185	23186	23187	23188	23189
320	23190	23191	23192	23194	23195	23196	23197	23198	23199
321	23200	23201	23202	23204	23205	23206	23207	23208	23209
322	23210	23211	23212	23214	23215	23216	23217	23218	23219
323	23220	23221	23222	23224	23225	23226	23227	23228	23229
324	23230	23231	23232	23234	23235	23236	23237	23238	23239
325	23240	23241	23242	23244	23245	23246	23247	23248	23249
326	23250	23251	23252	23254	23255	23256	23257	23258	23259
327	23260	23261	23262	23264	23265	23266	23267	23268	23269
328	23270	23271	23272	23274	23275	23276	23277	23278	23279
329	23280	23281	23282	23284	23285	23286	23287	23288	23289
330	23290	23291	23292	23294	23295	23296	23297	23298	23299
331	23300	23301	23302	23304	23305	23306	23307	23308	23309
332	23310	23311	23312	23314	23315	23316	23317	23318	23319
333	23320	23321	23322	23324	23325	23326	23327	23328	23329
334	23330	23331	23332	23334	23335	23336	23337	23338	23339
335	23340	23341	23342	23344	23345	23346	23347	23348	23349
336	23350	23351	23352	23354	23355	23356	23357	23358	23359
337	23360	23361	23362	23364	23365	23366	23367	23368	23369
338	23370	23371	23372	23374	23375	23376	23377	23378	23379
339	23380	23381	23382	23384	23385	23386	23387	23388	23389
340	23390	23391	23392	23394	23395	23396	23397	23398	23399
341	23400	23401	23402	23404	23405	23406	23407	23408	23409
342	23410	23411	23412	23414	23415	23416	23417	23418	23419
343	23420	23421	23422	23424	23425	23426	23427	23428	23429
344	23430	23431	23432	23434	23435	23436	23437	23438	23439
345	23440	23441	23442	23444	23445	23446	23447	23448	23449
346	23450	23451	23452	23454	23455	23456	23457	23458	23459
347	23460	23461	23462	23464	23465	23466	23467	23468	23469
348	23470	23471	23472	23474	23475	23476	23477	23478	23479
349	23480	23481	23482	23484	23485	23486	23487	23488	23489
350	23490	23491	23492	23494	23495	23496	23497	23498	23499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
351	23500	23501	23502	23504	23505	23506	23507	23508	23509
352	23510	23511	23512	23514	23515	23516	23517	23518	23519
353	23520	23521	23522	23524	23525	23526	23527	23528	23529
354	23530	23531	23532	23534	23535	23536	23537	23538	23539
355	23540	23541	23542	23544	23545	23546	23547	23548	23549
356	23550	23551	23552	23554	23555	23556	23557	23558	23559
357	23560	23561	23562	23564	23565	23566	23567	23568	23569
358	23570	23571	23572	23574	23575	23576	23577	23578	23579
359	23580	23581	23582	23584	23585	23586	23587	23588	23589
360	23590	23591	23592	23594	23595	23596	23597	23598	23599
361	23600	23601	23602	23604	23605	23606	23607	23608	23609
362	23610	23611	23612	23614	23615	23616	23617	23618	23619
363	23620	23621	23622	23624	23625	23626	23627	23628	23629
364	23630	23631	23632	23634	23635	23636	23637	23638	23639
365	23640	23641	23642	23644	23645	23646	23647	23648	23649
366	23650	23651	23652	23654	23655	23656	23657	23658	23659
367	23660	23661	23662	23664	23665	23666	23667	23668	23669
368	23670	23671	23672	23674	23675	23676	23677	23678	23679
369	23680	23681	23682	23684	23685	23686	23687	23688	23689
370	23690	23691	23692	23694	23695	23696	23697	23698	23699
371	23700	23701	23702	23704	23705	23706	23707	23708	23709
372	23710	23711	23712	23714	23715	23716	23717	23718	23719
373	23720	23721	23722	23724	23725	23726	23727	23728	23729
374	23730	23731	23732	23734	23735	23736	23737	23738	23739
375	23740	23741	23742	23744	23745	23746	23747	23748	23749
376	23750	23751	23752	23754	23755	23756	23757	23758	23759
377	23760	23761	23762	23764	23765	23766	23767	23768	23769
378	23770	23771	23772	23774	23775	23776	23777	23778	23779
379	23780	23781	23782	23784	23785	23786	23787	23788	23789
380	23790	23791	23792	23794	23795	23796	23797	23798	23799
381	23800	23801	23802	23804	23805	23806	23807	23808	23809
382	23810	23811	23812	23814	23815	23816	23817	23818	23819
383	23820	23821	23822	23824	23825	23826	23827	23828	23829
384	23830	23831	23832	23834	23835	23836	23837	23838	23839
385	23840	23841	23842	23844	23845	23846	23847	23848	23849
386	23850	23851	23852	23854	23855	23856	23857	23858	23859
387	23860	23861	23862	23864	23865	23866	23867	23868	23869
388	23870	23871	23872	23874	23875	23876	23877	23878	23879
389	23880	23881	23882	23884	23885	23886	23887	23888	23889
390	23890	23891	23892	23894	23895	23896	23897	23898	23899
391	23900	23901	23902	23904	23905	23906	23907	23908	23909
392	23910	23911	23912	23914	23915	23916	23917	23918	23919
393	23920	23921	23922	23924	23925	23926	23927	23928	23929
394	23930	23931	23932	23934	23935	23936	23937	23938	23939
395	23940	23941	23942	23944	23945	23946	23947	23948	23949
396	23950	23951	23952	23954	23955	23956	23957	23958	23959
397	23960	23961	23962	23964	23965	23966	23967	23968	23969
398	23970	23971	23972	23974	23975	23976	23977	23978	23979
399	23980	23981	23982	23984	23985	23986	23987	23988	23989
400	23990	23991	23992	23994	23995	23996	23997	23998	23999

(4) For axis 4

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
401	24000	24001	24002	24004	24005	24006	24007	24008	24009
402	24010	24011	24012	24014	24015	24016	24017	24018	24019
403	24020	24021	24022	24024	24025	24026	24027	24028	24029
404	24030	24031	24032	24034	24035	24036	24037	24038	24039
405	24040	24041	24042	24044	24045	24046	24047	24048	24049
406	24050	24051	24052	24054	24055	24056	24057	24058	24059
407	24060	24061	24062	24064	24065	24066	24067	24068	24069
408	24070	24071	24072	24074	24075	24076	24077	24078	24079
409	24080	24081	24082	24084	24085	24086	24087	24088	24089
410	24090	24091	24092	24094	24095	24096	24097	24098	24099
411	24100	24101	24102	24104	24105	24106	24107	24108	24109
412	24110	24111	24112	24114	24115	24116	24117	24118	24119
413	24120	24121	24122	24124	24125	24126	24127	24128	24129
414	24130	24131	24132	24134	24135	24136	24137	24138	24139
415	24140	24141	24142	24144	24145	24146	24147	24148	24149
416	24150	24151	24152	24154	24155	24156	24157	24158	24159
417	24160	24161	24162	24164	24165	24166	24167	24168	24169
418	24170	24171	24172	24174	24175	24176	24177	24178	24179
419	24180	24181	24182	24184	24185	24186	24187	24188	24189
420	24190	24191	24192	24194	24195	24196	24197	24198	24199
421	24200	24201	24202	24204	24205	24206	24207	24208	24209
422	24210	24211	24212	24214	24215	24216	24217	24218	24219
423	24220	24221	24222	24224	24225	24226	24227	24228	24229
424	24230	24231	24232	24234	24235	24236	24237	24238	24239
425	24240	24241	24242	24244	24245	24246	24247	24248	24249
426	24250	24251	24252	24254	24255	24256	24257	24258	24259
427	24260	24261	24262	24264	24265	24266	24267	24268	24269
428	24270	24271	24272	24274	24275	24276	24277	24278	24279
429	24280	24281	24282	24284	24285	24286	24287	24288	24289
430	24290	24291	24292	24294	24295	24296	24297	24298	24299
431	24300	24301	24302	24304	24305	24306	24307	24308	24309
432	24310	24311	24312	24314	24315	24316	24317	24318	24319
433	24320	24321	24322	24324	24325	24326	24327	24328	24329
434	24330	24331	24332	24334	24335	24336	24337	24338	24339
435	24340	24341	24342	24344	24345	24346	24347	24348	24349
436	24350	24351	24352	24354	24355	24356	24357	24358	24359
437	24360	24361	24362	24364	24365	24366	24367	24368	24369
438	24370	24371	24372	24374	24375	24376	24377	24378	24379
439	24380	24381	24382	24384	24385	24386	24387	24388	24389
440	24390	24391	24392	24394	24395	24396	24397	24398	24399
441	24400	24401	24402	24404	24405	24406	24407	24408	24409
442	24410	24411	24412	24414	24415	24416	24417	24418	24419
443	24420	24421	24422	24424	24425	24426	24427	24428	24429
444	24430	24431	24432	24434	24435	24436	24437	24438	24439
445	24440	24441	24442	24444	24445	24446	24447	24448	24449
446	24450	24451	24452	24454	24455	24456	24457	24458	24459
447	24460	24461	24462	24464	24465	24466	24467	24468	24469
448	24470	24471	24472	24474	24475	24476	24477	24478	24479
449	24480	24481	24482	24484	24485	24486	24487	24488	24489
450	24490	24491	24492	24494	24495	24496	24497	24498	24499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
451	24500	24501	24502	24504	24505	24506	24507	24508	24509
452	24510	24511	24512	24514	24515	24516	24517	24518	24519
453	24520	24521	24522	24524	24525	24526	24527	24528	24529
454	24530	24531	24532	24534	24535	24536	24537	24538	24539
455	24540	24541	24542	24544	24545	24546	24547	24548	24549
456	24550	24551	24552	24554	24555	24556	24557	24558	24559
457	24560	24561	24562	24564	24565	24566	24567	24568	24569
458	24570	24571	24572	24574	24575	24576	24577	24578	24579
459	24580	24581	24582	24584	24585	24586	24587	24588	24589
460	24590	24591	24592	24594	24595	24596	24597	24598	24599
461	24600	24601	24602	24604	24605	24606	24607	24608	24609
462	24610	24611	24612	24614	24615	24616	24617	24618	24619
463	24620	24621	24622	24624	24625	24626	24627	24628	24629
464	24630	24631	24632	24634	24635	24636	24637	24638	24639
465	24640	24641	24642	24644	24645	24646	24647	24648	24649
466	24650	24651	24652	24654	24655	24656	24657	24658	24659
467	24660	24661	24662	24664	24665	24666	24667	24668	24669
468	24670	24671	24672	24674	24675	24676	24677	24678	24679
469	24680	24681	24682	24684	24685	24686	24687	24688	24689
470	24690	24691	24692	24694	24695	24696	24697	24698	24699
471	24700	24701	24702	24704	24705	24706	24707	24708	24709
472	24710	24711	24712	24714	24715	24716	24717	24718	24719
473	24720	24721	24722	24724	24725	24726	24727	24728	24729
474	24730	24731	24732	24734	24735	24736	24737	24738	24739
475	24740	24741	24742	24744	24745	24746	24747	24748	24749
476	24750	24751	24752	24754	24755	24756	24757	24758	24759
477	24760	24761	24762	24764	24765	24766	24767	24768	24769
478	24770	24771	24772	24774	24775	24776	24777	24778	24779
479	24780	24781	24782	24784	24785	24786	24787	24788	24789
480	24790	24791	24792	24794	24795	24796	24797	24798	24799
481	24800	24801	24802	24804	24805	24806	24807	24808	24809
482	24810	24811	24812	24814	24815	24816	24817	24818	24819
483	24820	24821	24822	24824	24825	24826	24827	24828	24829
484	24830	24831	24832	24834	24835	24836	24837	24838	24839
485	24840	24841	24842	24844	24845	24846	24847	24848	24849
486	24850	24851	24852	24854	24855	24856	24857	24858	24859
487	24860	24861	24862	24864	24865	24866	24867	24868	24869
488	24870	24871	24872	24874	24875	24876	24877	24878	24879
489	24880	24881	24882	24884	24885	24886	24887	24888	24889
490	24890	24891	24892	24894	24895	24896	24897	24898	24899
491	24900	24901	24902	24904	24905	24906	24907	24908	24909
492	24910	24911	24912	24914	24915	24916	24917	24918	24919
493	24920	24921	24922	24924	24925	24926	24927	24928	24929
494	24930	24931	24932	24934	24935	24936	24937	24938	24939
495	24940	24941	24942	24944	24945	24946	24947	24948	24949
496	24950	24951	24952	24954	24955	24956	24957	24958	24959
497	24960	24961	24962	24964	24965	24966	24967	24968	24969
498	24970	24971	24972	24974	24975	24976	24977	24978	24979
499	24980	24981	24982	24984	24985	24986	24987	24988	24989
500	24990	24991	24992	24994	24995	24996	24997	24998	24999

(4) For axis 4

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
501	25000	25001	25002	25004	25005	25006	25007	25008	25009
502	25010	25011	25012	25014	25015	25016	25017	25018	25019
503	25020	25021	25022	25024	25025	25026	25027	25028	25029
504	25030	25031	25032	25034	25035	25036	25037	25038	25039
505	25040	25041	25042	25044	25045	25046	25047	25048	25049
506	25050	25051	25052	25054	25055	25056	25057	25058	25059
507	25060	25061	25062	25064	25065	25066	25067	25068	25069
508	25070	25071	25072	25074	25075	25076	25077	25078	25079
509	25080	25081	25082	25084	25085	25086	25087	25088	25089
510	25090	25091	25092	25094	25095	25096	25097	25098	25099
511	25100	25101	25102	25104	25105	25106	25107	25108	25109
512	25110	25111	25112	25114	25115	25116	25117	25118	25119
513	25120	25121	25122	25124	25125	25126	25127	25128	25129
514	25130	25131	25132	25134	25135	25136	25137	25138	25139
515	25140	25141	25142	25144	25145	25146	25147	25148	25149
516	25150	25151	25152	25154	25155	25156	25157	25158	25159
517	25160	25161	25162	25164	25165	25166	25167	25168	25169
518	25170	25171	25172	25174	25175	25176	25177	25178	25179
519	25180	25181	25182	25184	25185	25186	25187	25188	25189
520	25190	25191	25192	25194	25195	25196	25197	25198	25199
521	25200	25201	25202	25204	25205	25206	25207	25208	25209
522	25210	25211	25212	25214	25215	25216	25217	25218	25219
523	25220	25221	25222	25224	25225	25226	25227	25228	25229
524	25230	25231	25232	25234	25235	25236	25237	25238	25239
525	25240	25241	25242	25244	25245	25246	25247	25248	25249
526	25250	25251	25252	25254	25255	25256	25257	25258	25259
527	25260	25261	25262	25264	25265	25266	25267	25268	25269
528	25270	25271	25272	25274	25275	25276	25277	25278	25279
529	25280	25281	25282	25284	25285	25286	25287	25288	25289
530	25290	25291	25292	25294	25295	25296	25297	25298	25299
531	25300	25301	25302	25304	25305	25306	25307	25308	25309
532	25310	25311	25312	25314	25315	25316	25317	25318	25319
533	25320	25321	25322	25324	25325	25326	25327	25328	25329
534	25330	25331	25332	25334	25335	25336	25337	25338	25339
535	25340	25341	25342	25344	25345	25346	25347	25348	25349
536	25350	25351	25352	25354	25355	25356	25357	25358	25359
537	25360	25361	25362	25364	25365	25366	25367	25368	25369
538	25370	25371	25372	25374	25375	25376	25377	25378	25379
539	25380	25381	25382	25384	25385	25386	25387	25388	25389
540	25390	25391	25392	25394	25395	25396	25397	25398	25399
541	25400	25401	25402	25404	25405	25406	25407	25408	25409
542	25410	25411	25412	25414	25415	25416	25417	25418	25419
543	25420	25421	25422	25424	25425	25426	25427	25428	25429
544	25430	25431	25432	25434	25435	25436	25437	25438	25439
545	25440	25441	25442	25444	25445	25446	25447	25448	25449
546	25450	25451	25452	25454	25455	25456	25457	25458	25459
547	25460	25461	25462	25464	25465	25466	25467	25468	25469
548	25470	25471	25472	25474	25475	25476	25477	25478	25479
549	25480	25481	25482	25484	25485	25486	25487	25488	25489
550	25490	25491	25492	25494	25495	25496	25497	25498	25499

Data No.	Positioning identifier	M code	Dwell time	Command speed		Positioning address		Arc data	
				Low-order	High-order	Low-order	High-order	Low-order	High-order
551	25500	25501	25502	25504	25505	25506	25507	25508	25509
552	25510	25511	25512	25514	25515	25516	25517	25518	25519
553	25520	25521	25522	25524	25525	25526	25527	25528	25529
554	25530	25531	25532	25534	25535	25536	25537	25538	25539
555	25540	25541	25542	25544	25545	25546	25547	25548	25549
556	25550	25551	25552	25554	25555	25556	25557	25558	25559
557	25560	25561	25562	25564	25565	25566	25567	25568	25569
558	25570	25571	25572	25574	25575	25576	25577	25578	25579
559	25580	25581	25582	25584	25585	25586	25587	25588	25589
560	25590	25591	25592	25594	25595	25596	25597	25598	25599
561	25600	25601	25602	25604	25605	19606	19607	19608	19609
562	25610	25611	25612	25614	25615	19616	19617	19618	19619
563	25620	25621	25622	25624	25625	19626	19627	19628	25629
564	25630	25631	25632	25634	25635	19636	19637	19638	25639
565	25640	25641	25642	25644	25645	19646	19647	19648	25649
566	25650	25651	25652	25654	25655	25656	25657	25658	25659
567	25660	25661	25662	25664	25665	25666	25667	25668	25669
568	25670	25671	25672	25674	25675	25676	25677	25678	25679
569	25680	25681	25682	25684	25685	25686	25687	25688	25689
570	25690	25691	25692	25694	25695	25696	25697	25698	25699
571	25700	25701	25702	25704	25705	25706	25707	25708	25709
572	25710	25711	25712	25714	25715	25716	25717	25718	25719
573	25720	25721	25722	25724	25725	25726	25727	25728	25729
574	25730	25731	25732	25734	25735	25736	25737	25738	25739
575	25740	25741	25742	25744	25745	25746	25747	25748	25749
576	25750	25751	25752	25754	25755	25756	25757	25758	25759
577	25760	25761	25762	25764	25765	25766	25767	25768	25769
578	25770	25771	25772	25774	25775	25776	25777	25778	25779
579	25780	25781	25782	25784	25785	25786	25787	25788	25789
580	25790	25791	25792	25794	25795	25796	25797	25798	25799
581	25800	25801	25802	25804	25805	25806	25807	25808	25809
582	25810	25811	25812	25814	25815	25816	25817	25818	25819
583	25820	25821	25822	25824	25825	25826	25827	25828	25829
584	25830	25831	25832	25834	25835	25836	25837	25838	25839
585	25840	25841	25842	25844	25845	25846	25847	25848	25849
586	25850	25851	25852	25854	25855	25856	25857	25858	25859
587	25860	25861	25862	25864	25865	25866	25867	25868	25869
588	25870	25871	25872	25874	25875	25876	25877	25878	25879
589	25880	25881	25882	25884	25885	25886	25887	25888	25889
590	25890	25891	25892	25894	25895	25896	25897	25898	25899
591	25900	25901	25902	25904	25905	25906	25907	25908	25909
592	25910	25911	25912	25914	25915	25916	25917	25918	25919
593	25920	25921	25922	25924	25925	25926	25927	25928	25929
594	25930	25931	25932	25934	25935	25936	25937	25938	25939
595	25940	25941	25942	25944	25945	25946	25947	25948	25949
596	25950	25951	25952	25954	25955	25956	25957	25958	25959
597	25960	25961	25962	25964	25965	25966	25967	25968	25969
598	25970	25971	25972	25974	25975	25976	25977	25978	25979
599	25980	25981	25982	25984	25985	25986	25987	25988	25989
600	25990	25991	25992	25994	25995	25996	25997	25998	25999








## Appendix 3 Connection with servo amplifiers

### Appendix 3.1 Connection of SSCNET cables


As the SSCNET cables or termination connector is different depending on the servo amplifiers, refer to the following connection example.

The SSCNET cables and termination connector used in the connection example are any of the models shown in the following table.

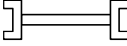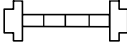
When absolute position detection control is executed, installed battery (MR-BAT/A6BAT) to servo amplifier.

Part name	Model name	Depiction in connection example	Description
SSCNET cable	MR-HBUS $\ddot{Y}$ M 0.5m (1.64ft.), 1m (3.28ft.), 5m (16.4ft.)		• Connection between (MR-H-BN/MR-H-BN4) and (MR-H-BN/ MR-H-BN4).
	MR-J2HBUS $\ddot{Y}$ M 0.5m (1.64ft.), 1m (3.28ft.), 5m (16.4ft.)		• Connection between QD75M $\ddot{Y}$ and (MR-J2-B/MR-J2S-B/ MR-J2-Jr/MR-J2M-B). • Connection between (MR-J2-B/MR-J2S-B/ MR-J2-Jr/MR- J2M-B) and (MR-J2-B/MR-J2S-B/ MR-J2-Jr/MR-J2M-B).
	MR-J2HBUS $\ddot{Y}$ M-A 0.5m (1.64ft.), 1m (3.28ft.), 5m (16.4ft.)		• Connection between (QD75M $\ddot{Y}$ /MR-J2-B/MR-J2S-B/ MR- J2-Jr/MR-J2M-B) and (MR-H-BN/MR-H-BN4).
Termination connector	MR-TM		• Connected to the last servo amplifier (MR-H-BN/MR-H- BN4) by SSCNET.
	MR-A-TM		• Connected to the last servo amplifier (MR-J2-B/MR-J2S-B/ MR-J2-Jr/MR-J2M-B) by SSCNET.


(1) MR-H-BN/MR-H-BN4 configuration

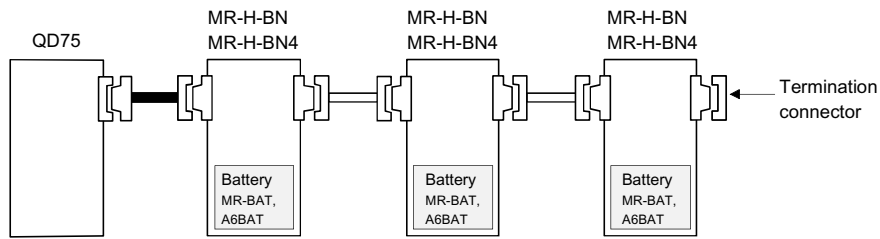

(2) MR-J2□-B configuration

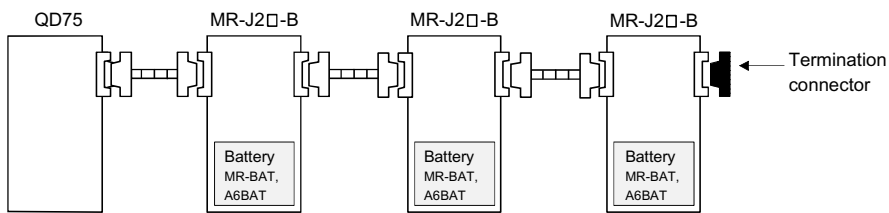

(3) MR-J2□-B/MR-H-BN/MR-H-BN4 configuration

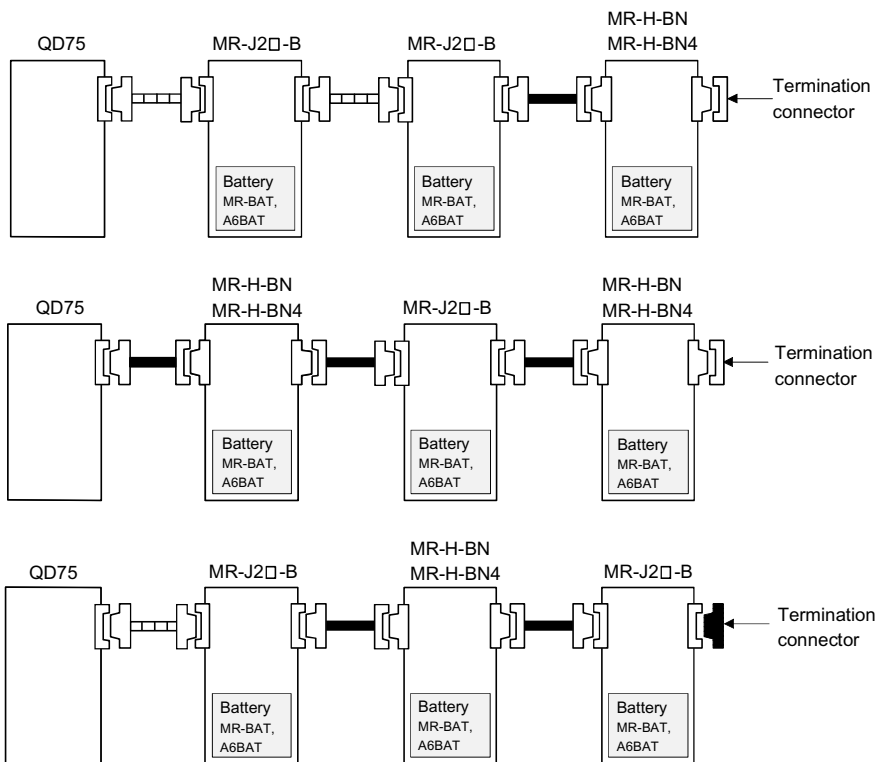

Appendix 3.2 Wiring of SSCNET cables

Generally use the SSCNET cables available as our options. If the required length is not found in our options, fabricate the cable on the customer side.

(1) SSCNET cable

The following table indicates the SSCNET cables used with each motion controller and the servo amplifiers. Make selection according to your operating conditions.

Table 1 Table of SSCNET cable

Type	Description
MR-HBUS $\ddot{Y}$ M	<ul style="list-style-type: none"> <li>• Connection between MR-H-BN/MR-H-BN4 and MR-H-BN/MR-H-BN4</li> <li>• MR-HBCNS: connector set (sold separately)</li> </ul>
MR-J2HBUS $\ddot{Y}$ M	<ul style="list-style-type: none"> <li>• Connection between QD75M<math>\ddot{Y}</math> and (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B)</li> <li>• Connection between (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B) and (MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B).</li> <li>• MR-J2CN1: connector set (sold separately)</li> </ul>
MR-J2HBUS $\ddot{Y}$ M-A	<ul style="list-style-type: none"> <li>• Connection between QD75M<math>\ddot{Y}</math> /MR-J2-B/MR-J2S-B/MR-J2-Jr/MR-J2M-B and MR-H-BN/MR-H-BN4.</li> <li>• MR-J2CN1-A: connector set (sold separately)</li> </ul>

Use the following or equivalent twisted pair cables as the SSCNET cables.


Table 2 Table of wire model

Type	Length [m(ft.)]	Wire model
MR-HBUS $\ddot{Y}$ M	0.5(1.64), 1(3.28), 5(16.4)	A14B2343 6 Pair
MR-J2HBUS $\ddot{Y}$ M		UL20276 AWG#28 10 pair(CREAM)
MR-J2HBUS $\ddot{Y}$ M-A		

Table 3 Table of wire specifications

Wire model	Core size [mm <sup>2</sup> ]	Number of cores	Characteristics of one core			Finish OD [mm] (Note-2)
			Structure [Number of wires/mm]	Conductor resistance [ $\Omega$ /km]	Insulating sheath OD d[mm] (Note-1)	
A14B2343 6P	0.2	12(6 pairs)	40/0.08	Max.105	0.88	7.2
UL20276 AWG#28 10 pair(CREAM)	0.08	20(10 pairs)	7/0.127	Max.222	0.38	6.1

(Note-1): d is as shown below.

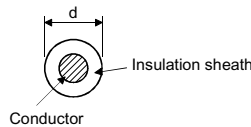

(Note-2): Standard OD. Max. OD is about 10% larger.

**⚠ CAUTION**

- When fabricating the bus cable, do not make incorrect connection. Wrong connection will cause runaway or explosion.

(a) MR-HBUS M

1) Model explanation


Type: MR-HBUS □ M

Symbol	Cable length [m(ft.)]
05	0.5(1.64)
1	1(3.28)
5	5(16.4)

- Connector: HONDA connectors make  
PCR-S20FS, PCR-LS20LA1

2) Connection diagram

When fabricating a cable, use the recommended wire given on Appendix 3.2, and make the cable as show in the following connection diagram. The overall distance of the SSCNET cables on the same bus is 30m(98.4ft.) .

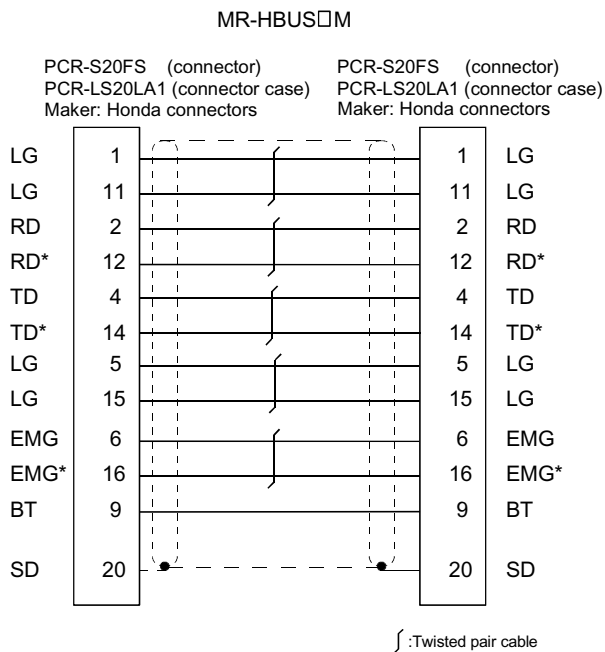

(b) MR-J2HBUS M

1) Model explanation

Type: MR-J2HBUS□M

Symbol	Cable length [m(ft.)]
05	0.5(1.64)
1	1(3.28)
5	5(16.4)


• Connector: Sumitomo 3M make

Insulation displacement type...10120-6000EL, 10320-3210-000

Solder connection type.....10120-3000VE, 10320-52F0-008

2) Connection diagram

When fabricating a cable, use the recommended wire given on Appendix 3.2, and make the cable as show in the following connection diagram. The overall distance of the SSCNET cables on the same bus is 30m(98.4ft.) .

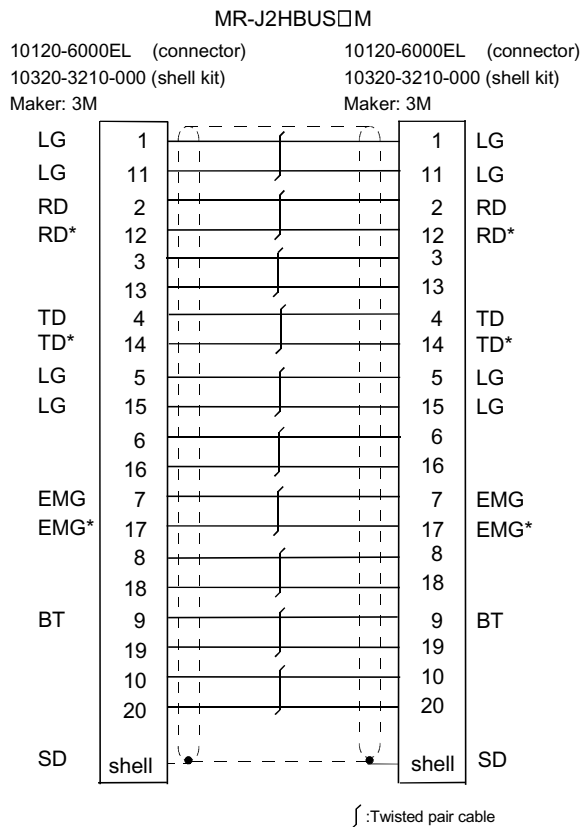

(c) MR-J2HBUS M-A

1) Model explanation

Type: MR-J2HBUS □ M-A

Symbol	Cable length [m(ft.)]
05	0.5(1.64)
1	1(3.28)
5	5(16.4)


• Connector: Sumitomo 3M make

Insulation displacement type...10120-6000EL, 10320-3210-000

Solder connection type.....10120-3000VE, 10320-52F0-008

2) Connection diagram

When fabricating a cable, use the recommended wire given on Appendix 3.2, and make the cable as show in the following connection diagram. The overall distance of the SSCNET cables on the same bus is 30m(98.4ft.) .

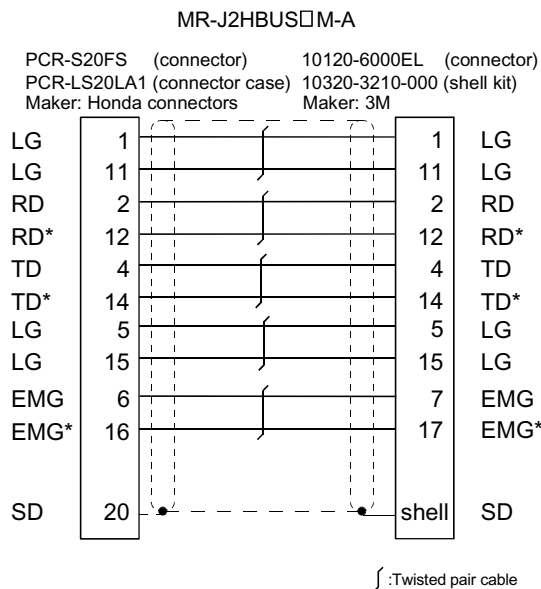


Appendix 4 Connection with external device connector

Appendix 4.1 Connector

Mounted onto an external device connector of the QD75 and used for wiring an external device. The "external device connector" includes the following 4 types.

(1) Appearance

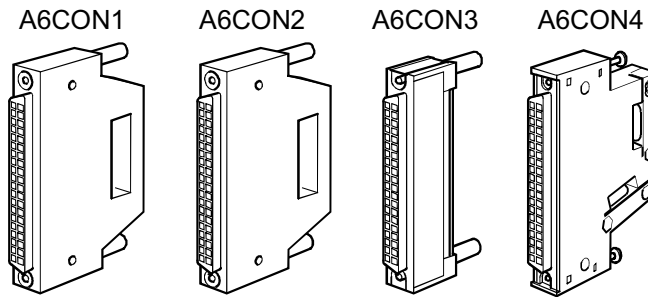


(2) Specifications of the connector

Part name	Specification		
Applicable connector	A6CON1, A6CON4	A6CON2	A6CON3
Applicable wire size	0.3 mm <sup>2</sup>	AWG#24 to 28	AWG#28 (twisted)/ AWG#30 (single wire)

※: The external device connector has been prepared.

- A6CON2 Crimp-contact tool  
Model name: FCN-363T-T005/H
- A6CON3 Pressure-displacement tool  
Model name: FCN-367T-T012/H (locator plate)  
: FCN-707T-T001/H (cable cutter)  
: FCN-707T-T101/H (hand press)
- Supplier's offices:
  - FUJITSU TAKAMISAWA AMERICA, INC 250E Caribbean Drive Sunnyvale, CA 94089 U.S.A  
Tel: (1-408) 745-4900
  - FUJITSU TAKAMISAWA EUROPE B.V. Jupiterstaat 13-15, our 2132 Hoofddorp, The Netherland  
Tel: (31) 23-5560910
  - FUJITSU TAKAMISAWA EUROPE B.V. Schatzbogen 86 D-81829 Munchen Germany  
Zweiniederlassung Deutschland Tel: (49) 89-42742320
  - FUJITSU TAKAMISAWA EUROPE (U K) Network House, Morres Drive, Maidenhead, Berkshire,  
SL6 4FJ United Kingdom  
Tel: (44) 1628-504600
  - FUJITSU TAKAMISAWA EUROPE B.V. 127 Chemin Des Bassins, Europarc, Cleteril 94035  
Cleteril 94035 France  
Tel: (33) 145139940
  - FUJITSU TAKAMISAWA ASIA PACIFIC 102E Pasir Panjang Road, # 04-01 Citilink  
PTE LIMITED Warehouse Complex, Singapore 118529  
Tel: (65) 375-8560
  - FUJITSU TAKAMISAWA HONG KONG Co., LTD Suite 913 Ocean Centre, 5 Canton Road. TST,  
Kowloon, Hong Kong  
Tel: (852) 2881-8495

(3) External dimension drawing

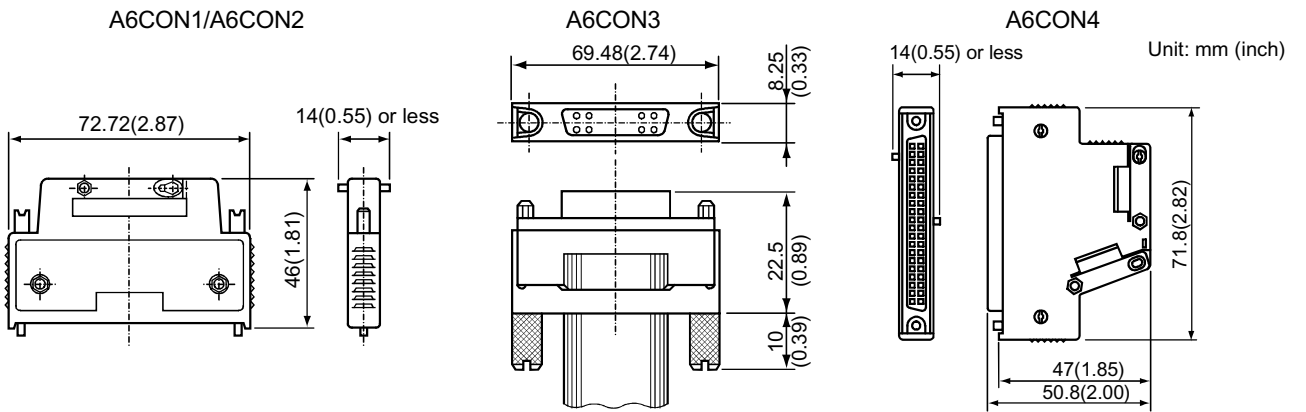



Appendix4.2 Wiring of manual pulse generator cable

There are no our option in the manual pulse generator. The manual pulse generator cable fabricate on the customer side.


(1) Manual pulse generator cable

The following table indicates the manual pulse generator cables used with motion controller and the manual pulse generator. Make selection according to your operating conditions.

Table 1 Table of wire specifications

Wire model	Core size [mm <sup>2</sup> ]	Number of cores	Characteristics of one core			Finish OD [mm] (Note-2)
			Structure [Number of wires/mm]	Conductor resistance [ $\Omega$ /km]	Insulating sheath OD d[mm] (Note-1)	
17/0.16-6P-SRV-SV(2464)K	0.3	12(6 pairs)	17/0.16	Max. 57.5	1.26	8.4
NFKEV-SB 0.3 mm <sup>2</sup> ×4P	0.3	8(4 pairs)	7/0.127	Max. 66.3	1.30	7.6

(Note-1): d is as shown below.

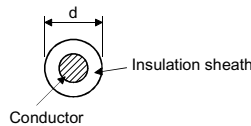


(Note-2): Standard OD. Max. OD is about 10% larger.

(a) Connection diagram

When fabricating a cable, use the recommended wire given on (1), and make the cable as show in the following connection diagram. The overall distance of the manual pulse generator cable on the same bus is 30m(98.4ft.) .

(Note): Connect the shield to ground only on the manual pulse generator side. (Only one side is connected.)

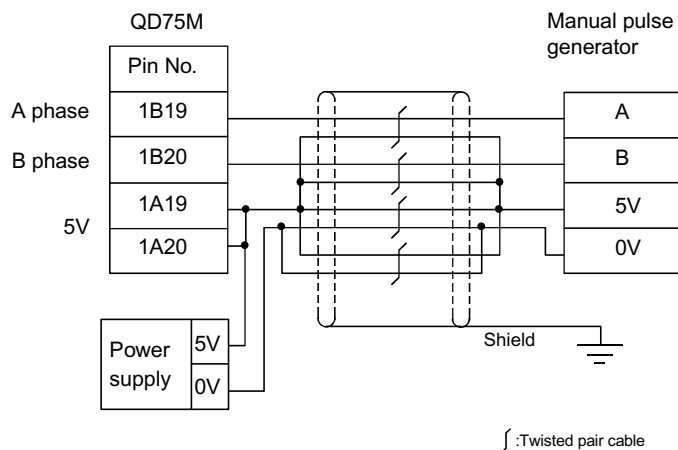

⚠ CAUTION
● When fabricating the cable, do not make incorrect connection. Wrong connection will cause runaway or explosion.

## Appendix 5 Comparisons with conventional positioning modules

## Appendix 5.1 Comparisons with QD75P model

Item		Model	QD75M1	QD75M2	QD75M4	QD75P
No. of control axes			1	2	4	4
No. of positioning data items			600/axis			600/axis
Interpolation functions	2-axis linear interpolation		×	○	○	○
	3-axis linear interpolation		×	×	○	○
	4-axis linear interpolation		×	×	○	○
	2-axis circular interpolation		×	○	○	○
Positioning systems	Position control		○			○
	Speed control		○			○
	Speed-position switching control		○ (INC/ABS mode)			○ (INC/ABS mode)
	Position-speed switching control		○			○
Machine OPR function (OPR method)			○ (4 types) Near-point dog method, Count method 1) 2) and Data set method			○ (6 types) Near-point dog method, Stopper method 1) to 3) and Count method 1) 2)
JOG operation			○			
Inching operation			○			
Manual pulse generator function			○			
Acceleration/ deceleration processing	Automatic trapezoidal acceleration/deceleration		○			
	S-pattern acceleration/deceleration		○			
Acceleration/deceleration time			Acceleration time and deceleration time setting possible (4 patterns each)			
Compensation			Electronic gears, backlash compensation			
Error display			Error LED			
History data storage (Start, error, warning)			Provided (3 types, 16 items/axis)			
Data storage destination			Flash ROM (battery-less backup)			
Connected to servo amplifier			SSCNET			Pulse signal Servo ON signal Servo READY signal Zero point signal
ABS function			Current value return function. Follow up function			—
Electronic gears ratio			Denominator/numerator (32 bit)			Denominator/numerator (16 bit)
Absolute positioning system (degree) with unlimited length feed can be configured grantee.			Provided			Improvided
No. of input/output points			32			
No. of module occupied slots			1			

○ : Possible, × : Not possible

Appendix 5.2 Comparisons with A1SD75M1/ A1SD75M2/ A1SD75M3 models

(1) Comparisons of performance specifications

Item		Model						
		QD75M1	QD75M2	QD75M4	A1SD75M1	A1SD75M2	A1SD75M3	
No. of control axes		1	2	4	1	2	3	
No. of positioning data items		600/axis			600/axis * 1			
Position control interpolation functions	2-axis linear interpolation	×	○	○	×	○	○	
	3-axis linear interpolation	×	×	○	×	×	×	
	4-axis linear interpolation	×	×	○	×	×	×	
	2-axis circular interpolation	×	○	○	×	○	○	
Positioning systems	Position control	○			○			
	Speed control	1-axis	○	○	○	○	○	○
		2-axis linear interpolation	×	○	○	×	×	×
		3-axis linear interpolation	×	×	○	×	×	×
		4-axis linear interpolation	×	×	○	×	×	×
	Speed-position switching control	○			○			
Position-speed switching control	○			×				
Positioning range	<Absolute system> -214748364.8 to 214748364.7 (μm) -21474.83648 to 21474.83647 (inch) 0 to 359.99999 (degree) -2147483648 to 2147483647 (PLS) <Incremental system > -214748364.8 to 214748364.7 (μm) -21474.83648 to 21474.83647 (inch) -21474.83648 to 21474.83647 (degree) -2147483648 to 2147483647 (PLS) <Speed-position or position-speed switching controls> 0 to 214748364.7 (μm) 0 to 21474.83647 (inch) 0 to 21474.83647 (degree)/ 0 to 359.99999 (degree) * 2 0 to 2147483647 (PLS)			<Absolute system > -214748364.8 to 214748364.7 (μm) /-13421772.8 to 13421772.7 (μm) -21474.83648 to 21474.83647 (inch) /-1342.17728 to 1342.17727 (inch) 0 to 359.99999 (degree) /0 to 359.99999 (degree) -2147483648 to 2147483647 (PLS) /-134217728 to 134217727 (PLS) <Incremental system > -214748364.8 to 214748364.7 (μm) /-13421772.8 to 13421772.7 (μm) -21474.83648 to 21474.83647 (inch) /-1342.17728 to 1342.17727 (inch) -21474.83648 to 21474.83647 (degree) /-1342.17728 to 1342.17727 (degree) -2147483648 to 2147483647 (PLS) /-134217728 to 134217727 (PLS) <Speed-position switching control> 0 to 214748364.7 (μm) /0 to 13421772.7 (μm) 0 to 21474.83647 (inch) /0 to 1342.17727 (inch) 0 to 21474.83647 (degree) /0 to 1342.17727 (degree) 0 to 2147483647 (PLS) /0 to 134217727 (PLS)				

Comparisons of performance specifications (Continued)

Item		Model						
		QD75M1	QD75M2	QD75M4	A1SD75M1	A1SD75M2	A1SD75M3	
Speed command range *2		0.01 to 2000000.00 (mm/min) 0.001 to 2000000.000 (inch/min) 0.001 to 2000000.000 (degree/min) 1 to 10000000 (PLS/s)			0.01 to 6000000.00 (mm/min) /0.01 to 375000.00 (mm/min) 0.001 to 600000.000 (inch/min) /0.001 to 37500.000 (inch/min) 0.001 to 600000.000 (degree/min) /0.001 to 37500.000 (degree/min) 1 to 1000000 (PLS/s) /1 to 62500 (PLS/s)			
Machine OPR function (OPR method)		○ (4 types)			○ (4 types)			
JOG operation		○			○			
Inching operation		○			×			
Manual pulse generator function		1 generator/module			1 generator/axis			
Acceleration /deceleration processing	Automatic trapezoidal acceleration /deceleration	○			○			
	S-pattern acceleration /deceleration	○			○			
Acceleration/deceleration time	No. of patterns	Acceleration time and deceleration time can be set independently. (4 patterns each)			Acceleration time and deceleration time can be set independently. (4 patterns each)			
	Setting range	1 to 8388608ms			1 to 65535ms/1 to 8388608ms selectable			
Compensation		Electronic gears, backlash compensation, near pass *3			Electronic gears, backlash compensation, near pass *3			
Error display		Error LED			17-segment LED			
History data storage (Start, error, warning)		Provided (3 types, 16 items/axis)			Provided (4 types, 16 items/axis)			
Data storage destination		Flash ROM (battery-less backup)			Flash ROM (battery-less backup)			
Connection connector		A6CON1, A6CON4 (Soldering type, optional)			10136-3000VE (Soldering type, supplied)			
		A6CON2 (Crimp contact type, optional)			10136-6000EL (Crimp type, optional)			
		A6CON3 (Pressure-displacement type, optional)			-			
Applicable wire size		A6CON1, A6CON4: 0.3mm <sup>2</sup>			10136-3000VE: AWG#24 to #30 (Approx. 0.05 to 0.2 SQ)			
		A6CON2: AWG#24 to 28			10136-6000EL: AWG#28 (Approx. 0.08 SQ)			
		A6CON3: AWG#28 (twisted), AWG#30 (single wire)			-			
SSCNET connector type		○						
SSCNET cable maximum connection distance (m/ft.)		30 (98.43)						
Internal current consumption (A) [5VDC]		QD75M1: 0.40A	QD75M2: 0.40A	QD75M4: 0.40A	0.7A or less			
Flash ROM write count		Max. 100000 times			Max. 100000 times			
No. of occupied I/O points		32			32			
No. of module occupied slots		1			1			
Outline dimensions (mm (inch))		98(3.86)(H)×27.4(1.08)(W)×90(3.55)(D)			130(5.12)(H)×34.5(1.36)(W)×93.6(3.69)(D)			
Weight (kg (lb))		0.15 (0.33)	0.15 (0.33)	0.16 (0.35)	0.35 (0.77)			

Comparisons of performance specifications (Continued)

Item		Model	QD75M1	QD75M2	QD75M4	A1SD75M1	A1SD75M2	A1SD75M3
I/O signal for external devices	CHG signal	External command signal (External start or speed-position switching selectable with parameters)				Speed-position switching signal		
	In-position (INP)		○ (for monitor)			○ (for monitor)		
	Signal logic switching		○			Command pulse output signal only		
Peripheral devices (data setting, etc.)	Connection with peripheral devices	Connection via PLC CPU, Q Corresponding Serial Communication Module, Q Corresponding MELSEC/H Remote I/O Module				Direct connection		
	AD71TU		×			×		
	AD75TU		×			○		
	A6GPP, A6PHP		×			○		
	A7GPP, A7PHP		×			○		
	PC-9800 <sup>®</sup> series		○			○		
	DOS/V personal computer		○			○		

○ : Possible, × : Not possible

- \*1: Up to 100 data items/axis of positioning data (No. 1 to 100) can be set using the buffer memory. The positioning data in the buffer memory is not backed up.
- \*2: Indicates the INC mode/ABS mode in speed-position switching control.
- \*3: The near pass function is valid only during the continuous path control. (A1SD75: Selected with parameters, QD75: Standard function)

(2) Function comparisons

Functions added to those of A1SD75M1/A1SD75M2/A1SD75M3

Added functions		Remarks
External I/O signal logic switching function		Refer to Section 13.4.
Inching operation		Refer to Section 11.3.
Target position change function		Refer to Section 12.7.5.
Multiple axes simultaneous start control		Refer to Section 10.5.
Control systems	3-axis linear interpolation control 4-axis linear interpolation control 3-axis fixed-feed control 4-axis fixed-feed control 2-axis speed control 3-axis speed control 4-axis speed control Position-speed switching control NOP instruction LOOP instruction, LEND instruction	Refer to Chapter 9.
Dedicated instructions	Positioning start Teaching Flash ROM writing Parameter initialization	Refer to Chapter 14.
Automatic refresh of intelligent function modules		Refer to GX Configurator-QP Operating Manual.
Output hold/clear parameter setting during PLC CPU error stop		Refer to QCPU (Q mode) User's Manual (Function Explanation, Program Fundamentals).
Flash ROM write limit		Refer to Section 13.3.
Speed-position switching control (ABS mode)		Refer to Section 9.2.17.
Pre-reading start function		Refer to Section 12.7.8.
External I/O signal monitor function		Refer to Section 13.5.
Multiple CPU correspond function		Refer to QCPU (Q mode) User's Manual (Function Explanation, Program Fundamentals).
Absolute positioning system (degree unlimited length feed can be configured)		Refer to Section 12.6
Deceleration start flag function		Refer to Section 12.7.9
Stop command processing for deceleration stop function		Refer to Section 12.7.10

## Functions deleted from those of A1SD75M1/A1SD75M2/A1SD75M3

Deleted functions	Remarks
OPR operation error (Error code: 208)	–
Fast machine OPR	–
Special start (stop)	–
Indirect designation	In the QD75, the start block area on the buffer memory is expanded to five blocks (0 to 4). Each start block can be directly designated with positioning start No. (7000 to 7004).
Block transfer	With the A1SD75, this interface is used to set positioning data Nos. 101 to 600 that do not exist on the buffer memory. Since all positioning data can be set in the buffer memory with the QD75, this function is deleted.
Positioning data I/F	
Start history storage during error	The contents are the same as those of the start history. Therefore, the QD75 stores only the start history.
System monitor data (module type, OS information, OS version)	These data were deleted because they can be displayed in system monitor "Module's detailed information" of GX Developer. (Refer to GX Developer Operating Manual.)

## Functions changed from those of A1SD75M1/A1SD75M2/A1SD75M3

Changed functions	Descriptions
Software stroke limit function	<ol style="list-style-type: none"> <li>The limit check of arc address is carried out only when a sub point is designated. It is not carried out when a center point is designated.</li> <li>The software stroke limit check during speed control is carried out in the following cases: <ul style="list-style-type: none"> <li>When the software stroke limit is applied to the current feed value with <b>Pr.14</b> and the current feed value is updated with <b>Pr.21</b>.</li> <li>When the software stroke limit is applied to the machine feed value.</li> </ul> </li> <li>If an attempt is made to change the current value but the designated address is out of the software stroke limit range, the attempt is considered as an error and the current value is not changed.</li> <li>The conventional models feature three types of software stroke limit error codes for upper limit and lower limit respectively. With the QD75, errors for the software stroke upper limit are integrated into error code 507, and errors for the lower limit are integrated into error code 508. Error codes 509 to 512 are deleted.</li> </ol>
Current value changing M code function	<ol style="list-style-type: none"> <li>An error occurs when the designated new current value is out of the software stroke limit range.</li> <li>The M code setting value is valid during the positioning data current value changing instruction.</li> </ol>
Acceleration/deceleration control	Only two-word type (1 to 8388608ms) can be used as the setting value for the acceleration/deceleration time. (The switch between 1-word type and 2-word type is eliminated.)

Changed functions	Descriptions		
Stop process and restart after stop Positioning operation stop	1. "Peripheral side (emergency) stop" is deleted from the stop causes of Stop group 2 sudden stop selection. "Test mode fault" in the stop causes of Stop group 3 sudden stop selection is changed to be in the stop causes of Stop group 2 sudden stop selection. 2. "Stop (QD75 peripheral)" is added to the stop causes of Stop group 3 sudden stop selection. 3. Error code 100 (Peripheral device stop during operation) is deleted. 4. "PLC CPU error occurrence" is added to the stop causes of Stop group 2 sudden stop selection.		
READY signal (X0)	OFF	A1SD75	QD75
	OFF	Normal (READY)	Not READY/WDT error
	ON	Not READY/WDT error	Normal (READY)
Manual pulse generator operation	The No. of connectable manual pulse generator is changed from 1 generator/1 axis to 1 generator/1 module.		
Axis operation status	"Step stopped" is changed to "Stopped" and "Step error occurring" is changed to "Error occurring". "In position control for position-speed switching control" and "In speed control for position-speed switching control" are added.		
Continuous path control	A1SD75: If the reference axis operates in reverse direction, the control is internally changed into the continuous positioning control (restart after deceleration stop). QD75 : Even if the reference axis operates in reverse direction with interpolation, the control remains as the continuous path control. (In single-axis operation, the operation is the same as that of the A1SD75.)		
Near pass	For the continuous path control, only the near pass function is available.		
2-axis interpolation <ul style="list-style-type: none"> <li>• 2-axis linear interpolation</li> <li>• 2-axis fixed-feed</li> <li>• Circular interpolation</li> <li>• 2-axis speed control</li> </ul>	The interpolation target axis can be randomly set with a positioning identifier.		
Step function	1. "Step stopped" is changed to "Stopped" and "Step error occurring" is changed to "Error occurring" in the axis operation status parameters. 2. The restart command for step start information (02H) is deleted. 3. The step operation is restarted with the restart command.		
Command in-position function	The command in-position width is expanded. • A1SD75: 1 to 32767000 • QD75: 1 to 2147483647		
Control unit "degree" handling	The operating direction can be designated even for the ABS control in the unit of "degree".		

Changed functions	Descriptions		
Positioning start No.	No. 9004 (Multiple axes simultaneous start control) is added. Nos. 7004 to 7010 (block start designation) and 8000 to 8049 (indirect designation) are deleted.		
Block start data	With the QD75, the number of blocks is changed to 5 (7000 to 7004). (With the A1SD75, this data is called "positioning start information".)		
Special start data "Simultaneous start"	The simultaneous start is possible up to 4 axes.		
List of errors/warnings	Refer to the following "Error code comparisons" and "Warning code comparisons".		
Start history	The configuration of "start information" and "start No." is changed so that the start No. can be directly checked.		
Synchronization flag (X1)	When the PLC CPU starting method is set to asynchronous, interlock is established with the synchronization flag (X1) signal.		
Detailed parameters " [Pr.15] Software stroke limit valid/invalid setting"		A1SD75	QD75
	0 (Factory setting)	Software stroke limits invalid for manual operation	Software stroke limits valid for manual operation
	1	Software stroke limits valid for manual operation	Software stroke limits invalid for manual operation

Error code comparisons

Error name	Error code	
	A1SD75	QD75
Outside bias speed range	913	906
Illegal sudden stop deceleration time	962	961
Stop group 1 sudden stop selection error	963	962
Stop group 2 sudden stop selection error	964	963
Stop group 3 sudden stop selection error	965	964
Home position return (OPR) torque limit value error	991	995
Setting for the movement amount after near-point dog ON error	992	991
Home position return (OPR) acceleration time selection error	993	992
Home position return (OPR) deceleration time selection error	994	993

Error type	Added	Deleted
Fatal error	002	51, 52
Common	–	100, 108
OPR, Absolute position restoration	213, 214	208
JOG/Inching operation	301	–
Manual pulse generator operation	–	–
Positioning operation	523, 535, 545, 546	509 to 512
I/F	800 to 806	–
Parameter	920, 935, 990, 996	931, 933, 938, 971, 999
Error whose name is changed: Error code 967 A1SD75: External start selection error QD75: External command function selection error		



Warning code comparisons

Warning type	Added	Deleted
Fatal warning	–	51, 52
Common	110	101, 105 to 108, 115
OPR, Absolute position restoration	–	–
JOG operation/Inching operation	–	–
Manual pulse generator operation	–	402
Positioning operation	516, 517, 518	–
I/F	–	–
Parameter	–	900
Warning whose name is changed: Warning code 512		
A1SD75: Illegal external start function		
QD75: Illegal external command function		

\*: Refer to "Section 15.2 List of errors" and "Section 15.3 List of warnings" for details on error codes and warning codes.

(3) Input/output (X/Y) comparisons

Input (X)		
Name	A1SD75	QD75
(QD75/A1SD75) READY	X00*	X00*
Axis 1 Start complete	X01	X10
Axis 2 Start complete	X02	X11
Axis 3 Start complete	X03	X12
Axis 4 Start complete	–	X13
Axis 1 BUSY	X04	X0C
Axis 2 BUSY	X05	X0D
Axis 3 BUSY	X06	X0E
Axis 4 BUSY	–	X0F
Axis 1 Positioning complete	X07	X14
Axis 2 Positioning complete	X08	X15
Axis 3 Positioning complete	X09	X16
Axis 4 Positioning complete	–	X17
Axis 1 Error detection	X0A	X08
Axis 2 Error detection	X0B	X09
Axis 3 Error detection	X0C	X0A
Axis 4 Error detection	–	X0B
Axis 1 M code ON	X0D	X04
Axis 2 M code ON	X0E	X05
Axis 3 M code ON	X0F	X06
Axis 4 M code ON	–	X07
Synchronization flag	–	X01
Use prohibited	X10 to X1F	X02, X03 X18 to X1F

Output (Y)		
Name	A1SD75	QD75
Axis 1 Positioning start	Y10	Y10
Axis 2 Positioning start	Y11	Y11
Axis 3 Positioning start	Y12	Y12
Axis 4 Positioning start	–	Y13
Axis 1 Stop	Y13	Y04
Axis 2 Stop	Y14	Y05
Axis 3 Stop	Y1C	Y06
Axis 4 Stop	–	Y07
All axis servo ON	Y15	Y01
Axis 1 Forward run JOG start	Y16	Y08
Axis 1 Reverse run JOG start	Y17	Y09
Axis 2 Forward run JOG start	Y18	Y0A
Axis 2 Reverse run JOG start	Y19	Y0B
Axis 3 Forward run JOG start	Y1A	Y0C
Axis 3 Reverse run JOG start	Y1B	Y0D
Axis 4 Forward run JOG start	–	Y0E
Axis 4 Reverse run JOG start	–	Y0F
PLC READY	Y1D	Y00
Axis 1 Execution prohibition flag	–	Y14
Axis 2 Execution prohibition flag	–	Y15
Axis 3 Execution prohibition flag	–	Y16
Axis 4 Execution prohibition flag	–	Y17
Use prohibited	Y00 to Y0F Y1E to Y1F	Y02, Y03 Y18 to Y1F

\*: The ON/OFF statuses for READY are different between the QD75 and A1SD75.

	Not READY/WDT error	READY
QD75	OFF	ON
A1SD75	ON	OFF

## (4) Buffer memory address comparisons

The following table shows the buffer memory addresses of the QD75 (Axes 1 to 3) corresponding to the items of the A1SD75.

The shaded area shows the differences between the A1SD75 and QD75.

Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Pr.1 Unit setting	0	150	300	0	150	300
Pr.2 No. of pulses per rotation (AP)	1	151	301	2 3	152 153	302 303
Pr.3 Movement amount per rotation (AL)	2	152	302	4 5	154 155	304 305
Pr.4 Unit magnification (AM)	3	153	303	1	151	301
Pr.7 Speed limit value	6 7	156 157	306 307	10 11	160 161	310 311
Pr.8 Acceleration time 0	8 9	158 159	308 309	12 13	162 163	312 313
Pr.9 Deceleration time 0	10 11	160 161	310 311	14 15	164 165	314 315
Pr.10 Bias speed at start	12 13	162 163	312 313	6 7	156 157	306 307
Pr.12 Backlash compensation amount	15	165	315	17	167	317
Pr.13 Software stroke limit upper limit value	16 17	166 167	316 317	18 19	168 169	318 319
Pr.14 Software stroke limit lower limit value	18 19	168 169	318 319	20 21	170 171	320 321
Pr.15 Software stroke limit selection	20	170	320	22	172	322
Pr.16 Software stroke limit valid/invalid setting	21	171	321	23	173	323
Pr.17 Command in-position width	22 23	172 173	322 323	24 25	174 175	324 325
Pr.18 Torque limit setting value	24	174	324	26	176	326
Pr.19 M code ON signal output timing	25	175	325	27	177	327
Pr.20 Speed switching mode	26	176	326	28	178	328
Pr.21 Interpolation speed designation method	27	177	327	29	179	329
Pr.22 Current feed value during speed control	28	178	328	30	180	330
Pr.23 Manual pulse generator selection	29	179	329	–	–	–
Pr.25 Size selection for acceleration/deceleration time	31	181	331	–	–	–
Pr.200 Speed-position function selection	–	–	–	34	184	334
Pr.26 Acceleration time 1	36 37	186 187	336 337	36 37	186 187	336 337
Pr.27 Acceleration time 2	38 39	188 189	338 339	38 39	188 189	338 339
Pr.28 Acceleration time 3	40 41	190 191	340 341	40 41	190 191	340 341

Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Pr.29 Deceleration time 1	42	192	342	42	192	342
	43	193	343	43	193	343
Pr.30 Deceleration time 2	44	194	344	44	194	344
	45	195	345	45	195	345
Pr.31 Deceleration time 3	46	196	346	46	196	346
	47	197	347	47	197	347
Pr.32 JOG speed limit value	48	198	348	48	198	348
	49	199	349	49	199	349
Pr.33 JOG operation acceleration time selection	50	200	350	50	200	350
Pr.34 JOG operation deceleration time selection	51	201	351	51	201	351
Pr.35 Acceleration/deceleration process selection	52	202	352	52	202	352
Pr.36 S-pattern proportion	53	203	353	53	203	353
Pr.37 Sudden stop deceleration time	54	204	354	54	204	354
	55	205	355	55	205	355
Pr.38 Stop group 1 sudden stop selection	56	206	356	56	206	356
Pr.39 Stop group 2 sudden stop selection	57	207	357	57	207	357
Pr.40 Stop group 3 sudden stop selection	58	208	358	58	208	358
Pr.41 Positioning complete signal output time	59	209	359	59	209	359
Pr.42 Allowable circular interpolation error width	60	210	360	60	210	360
	61	211	361	61	211	361
Pr.43 External start function selection	62	212	362	62	212	362
(QD75: Pr.42 External command function selection)						
Pr.201 Restart allowable range when servo OFF to ON	64	214	364	64	214	364
	65	215	365	65	215	365
Pr.44 Near pass mode selection for path control	66	216	366	–	–	–
Pr.45 OPR method	70	220	370	70	220	370
Pr.46 OPR direction	71	221	371	71	221	371
Pr.47 OP address	72	222	372	72	222	372
	73	223	373	73	223	373
Pr.48 OPR speed	74	224	374	74	224	374
	75	225	375	75	225	375
Pr.49 Creep speed	76	226	376	76	226	376
	77	227	377	77	227	377
Pr.50 OPR retry	78	228	378	78	228	378
Pr.51 OPR dwell time	79	229	379	79	229	379
Pr.52 Setting for the movement amount after near-point dog ON	80	230	380	80	230	380
	81	231	381	81	231	381
Pr.53 OPR acceleration time selection	82	232	382	82	232	382
Pr.54 OPR deceleration time selection	83	233	383	83	233	383
Pr.55 OP shift amount	84	234	384	84	234	384
	85	235	385	85	235	385
Pr.56 OPR torque limit value	86	236	386	86	236	386
Pr.57 Speed designation during OP shift	88	238	388	88	238	388
Pr.58 Dwell time during OPR retry	89	239	389	89	239	389

Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Pr.100 Servo series	100	250	400	30100	30250	30400
Pr.101 Amplifier setting	101	251	401	30101	30251	30401
Pr.102 Regenerative brake resistor	102	252	402	30102	30252	30402
Pr.103 Motor type	103	253	403	30103	30253	30403
Pr.104 Motor capacity	104	254	404	30104	30254	30404
Pr.105 Servo motor speed	105	255	405	30105	30255	30405
Pr.106 Feed back pulse	106	256	406	30106	30256	30406
Pr.107 Rotation direction selection	107	257	407	30107	30257	30407
Pr.108 Auto tuning	108	258	408	30108	30258	30408
Pr.109 Servo response	109	259	409	30109	30259	30409
Pr.110 Maker setting	110	260	410	30110	30260	30410
Pr.111 Maker setting	111	261	411	30111	30261	30411
Pr.112 Load inertia ratio	112	262	412	30112	30262	30412
Pr.113 Position loop gain 1	113	263	413	30113	30263	30413
Pr.114 Speed loop gain 1	114	264	414	30114	30264	30414
Pr.115 Position loop gain 2	115	265	415	30115	30265	30415
Pr.116 Speed loop gain 2	116	266	416	30116	30266	30416
Pr.117 Speed integral compensation	117	267	417	30117	30267	30417
Pr.118 Machine resonance suppression filter	118	268	418	30118	30268	30418
Pr.119 Feed forward gain	119	269	419	30119	30269	30419
Pr.120 In-position range	120	270	420	30120	30270	30420
Pr.121 Electromagnetic brake sequence output	121	271	421	30121	30271	30421
Pr.122 Analog monitor output	122	272	422	30122	30272	30422
Pr.123 Optional function 1	123	273	423	30123	30273	30423
Pr.124 Optional function 2	124	274	424	30124	30274	30424
Pr.125 Adaptive vibration suppression control/ low pass filter	—	—	—	30125	30275	30425
Pr.126 Maker setting	—	—	—	30126	30276	30426
Pr.127 Monitor output 1 offset	127	277	427	30127	30277	30427
Pr.128 Monitor output 2 offset	128	278	428	30128	30278	30428

Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Pr.129 Pre-alarm data selection	129	229	429	30129	30229	30329
Pr.130 Zero speed	130	230	430	30130	30230	30330
Pr.131 Error excessive alarm level	131	231	431	30131	30231	30331
Pr.132 Optional function 5	132	232	432	30132	30232	30332
Pr.133 Optional function 6	133	233	433	30133	30233	30333
Pr.134 PI-PID control switch-over position droop	134	234	434	30134	30234	30334
Pr.135 Maker setting	135	235	435	30135	30235	30335
Pr.136 Speed differential compensation	136	236	436	30136	30236	30336
Pr.137 Maker setting	137	237	437	30137	30237	30337
Pr.138 Encoder output pulses	—	—	—	30138	30238	30338
Pr.139 Maker setting	—	—	—	30139	30239	30339
Pr.140 Maker setting	—	—	—	30140	30240	30340
Pr.141 Maker setting	—	—	—	30141	30241	30341
Pr.143 Slight vibration suppression control selection 1	—	—	—	30143	30243	30343
Pr.144 Slight vibration suppression control selection 2	—	—	—	30144	30244	30344
Pr.145 Induction voltage compensation	—	—	—	30145	30245	30345
Pr.146 Maker setting	—	—	—	30146	30246	30346
Pr.147 Maker setting	—	—	—	30147	30247	30347
Pr.148 Maker setting	—	—	—	30148	30248	30348
Pr.149 Gain changing selection	—	—	—	30149	30249	30349
Pr.150 Gain changing condition	—	—	—	30150	30250	30350
Pr.151 Gain changing time constant	—	—	—	30151	30251	30351
Pr.152 Ratio of load inertia moment to servomotor inertia moment 2	—	—	—	30152	30252	30352
Pr.153 Position loop gain 2 changing ratio	—	—	—	30153	30253	30353
Pr.154 Speed loop gain 2 changing ratio	—	—	—	30154	30254	30354
Pr.155 Speed integral compensation changing ratio	—	—	—	30155	30255	30355
Pr.156 Maker setting	—	—	—	30156	30256	30356
Pr.157 Maker setting	—	—	—	30157	30257	30357
Pr.158 Maker setting	—	—	—	30158	30258	30358
Pr.159 Maker setting	—	—	—	30159	30259	30359
Pr.160 Optional function C	—	—	—	30160	30260	30360
Pr.161 Machine resonance suppression filter 2	—	—	—	30161	30261	30361
Pr.162 Maker setting	—	—	—	30162	30262	30362
Pr.163 Maker setting	—	—	—	30163	30263	30363
Pr.164 Maker setting	—	—	—	30164	30264	30364
Pr.165 Maker setting	—	—	—	30165	30265	30365
Pr.166 Maker setting	—	—	—	30166	30266	30366

Items of A1SD75		Buffer memory address	
		A1SD75	QD75
		Common for axis 1, 2, 3	Common for axis 1, 2, 3, 4
Md.1	In test mode flag	450	1200
Md.2	Module name	451	—
Md.3	OS type	452 453 454 455	—
Md.4	OS version	456 457	—
Md.5	Clock data (hour: minute)	460	—
Md.6	Clock data (second: 100 ms)	461	—
(Pointer number)		(0) to (15)	
Md.7	Start axis (QD75: Md. 3 Start information)	462 to 537	1212 to 1287
Md.8	Operation type (QD75: Md. 4 Start No.)	463 to 538	1213 to 1288
Md.9	Start Hour: minute (QD75: Md. 5 Start Hour)	464 to 539	1214 to 1289
Md.10	Start Second: 100 ms (QD75: Md. 6 Start Minute: second)	465 to 540	1215 to 1290
Md.11	Error judgment	466 to 541	1216 to 1291
Md.12	Start history pointer	542	1292
(Pointer number)		(0) to (15)	
Md.13	Start axis	543 to 618	—
Md.14	Operation type	544 to 619	—
Md.15	Start Hour: minute	545 to 620	—
Md.16	Start Second: 100 ms	546 to 621	—
Md.17	Error judgment	547 to 622	—
Md.18	Start history storage during error	623	—
(Pointer number)		(0) to (15)	
Md.19	Axis in which the error occurred	624 to 684	1293 to 1353
Md.20	Axis error No.	625 to 685	1294 to 1354
Md.21	Axis error occurrence Hour: minute (QD75: Md. 11 Axis error occurrence (Hour) )	626 to 686	1295 to 1355
Md.22	Axis error occurrence Second: 100 ms (QD75: Md. 12 Axis error occurrence (Minute: second) )	627 to 687	1296 to 1356
Md.23	Error history pointer	688	1357

Items of A1SD75		Buffer memory address	
		A1SD75	QD75
		Common for axis 1, 2, 3	Common for axis 1, 2, 3, 4
(Pointer number)	Warning history	(0) to (15)	
Md.24 Axis in which the warning occurred		689 to 749	1358 to 1418
Md.25 Axis warning No.		690 to 750	1359 to 1419
Md.26 Axis warning occurrence Hour: minute		691 to 751	1360 to 1420
(QD75: Md. 16) Axis warning occurrence (Hour)			
Md.27 Axis warning occurrence Second: 100 ms		692 to 752	1361 to 1421
(QD75: Md. 17) Axis warning occurrence (Minute: second)			
Md.28 Warning history pointer		753	1422

Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Md.29 Current feed value	800	900	1000	800	900	1000
	801	901	1001	801	901	1001
Md.30 Machine feed value	802	902	1002	802	902	1002
	803	903	1003	803	903	1003
Md.31 Feedrate	804	904	1004	804	904	1004
	805	905	1005	805	905	1005
Md.32 Valid M code	806	906	1006	808	908	1008
Md.33 Axis error No.	807	907	1007	806	906	1006
Md.34 Axis warning No.	808	908	1008	807	907	1007
Md.35 Axis operation status	809	909	1009	809	909	1009
Md.36 Current speed	810	910	1010	810	910	1010
				811	911	1011
Md.37 Axis feedrate	812	912	1012	812	912	1012
	813	913	1013	813	913	1013
Md.38 Speed-position switching control positioning amount	814	914	1014	814	914	1014
	815	915	1015	815	915	1015
Md.39 External input/output signal	816	916	1016	816	916	1016
Md.40 Status	817	917	1017	817	917	1017
Md.41 Target value	818	918	1018	818	918	1018
	819	919	1019	819	919	1019
Md.42 Target speed	820	920	1020	820	920	1020
	821	921	1021	821	921	1021
Md.43 OP absolute position	822	922	1022	–	–	–
	823	923	1023			
Md.44 Movement amount after near-point dog ON	824	924	1024	824	924	1024
	825	925	1025	825	925	1025
Md.45 Torque limit stored value	826	926	1026	826	926	1026
Md.46 Special start data instruction code setting value	827	927	1027	827	927	1027
Md.47 Special start data instruction parameter setting value	828	928	1028	828	928	1028
Md.48 Start positioning data No. setting value	829	929	1029	829	929	1029
Md.49 In speed control flag	830	930	1030	830	930	1030
Md.50 In speed change processing flag	831	931	1031	831	931	1031
Md.51 Start data pointer being executed	832	932	1032	834	934	1034
Md.52 Last executed positioning data No.	833	933	1033	837	937	1037
Md.53 Repetition counter	834	934	1034	832	932	1032
(QD75: Md. 41 Special start repetition counter)						
Md.54 Positioning data No. being executed	835	935	1035	835	935	1035
Md.55 Block No. being executed	836	936	1036	836	936	1036
Md.56 Positioning data being executed	838 to	938 to	1038 to	838 to	938 to	1038 to
	847	947	1047	847	947	1047



Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Md.100 OPR re-travel value	—			848	948	1048
	—			849	949	1049
Md.101 Real current value	—			850	950	1050
	—			851	951	1051
Md.102 Deviation counter value	—			852	952	1052
	—			853	953	1053
Md.103 Motor rotation speed	—			854	954	1054
	—			855	955	1055
Md.104 Motor current value	—			856	956	1056
Md.105 Auto tuning	—			857	957	1057
Md.105 Load inertia ratio	—			858	958	1058
Md.105 Position loop gain 1	—			859	959	1059
Md.105 Speed loop gain 1	—			860	960	1060
Md.105 Position loop gain 2	—			861	961	1061
Md.105 Speed loop gain 2	—			862	962	162
Md.105 Speed integral compensation	—			863	963	1063
Md.106 Servo amplifier software No.	—			864	964	1064
	—			865	965	1065
	—			866	966	1066
	—			867	967	1067
	—			868	968	1068
Md.107 Parameter error No. (No.0 to 15)	—			869	969	1069
	—			870	970	1070
Md.107 Parameter error No. (No.16 to 31)	—			871	971	1071
Md.107 Parameter error No. (No.32 to 47)	—			872	972	1072
Md.107 Parameter error No. (No.48 to 63)	—			873	973	1073
Md.107 Parameter error No. (No.64 to 75)	—			874	974	1074
Maker setting	—			875	975	1075
	—			876	976	1076
Md.108 Servo status	—			877	977	1077
Md.109 Regenerative load ratio	—			878	978	1078
Md.110 Effective load torque	—			879	979	1079
Md.111 Peak torque ratio	—			880	980	1080
Md.112 Semi • full-closed control status	—			881	981	1081
Md.48 Deceleration start flag	—			899	999	1099

Items of A1SD75	Buffer memory address					
	A1SD75			QD75		
	Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3
Cd.1 Clock data setting (hour)	1100			-		
Cd.2 Clock data setting (minute, second)	1101			-		
Cd.3 Clock data writing	1102			-		
Cd.4 Target axis	1103			-		
Cd.5 Positioning data No.	1104			-		
Cd.6 Write pattern	1105			-		
Cd.7 Read/write request	1106			-		
Cd.8 Read/write positioning data I/F	1108 to 1137			-		
Cd.9 Flash ROM write request	1138			1900		
Cd.10 Parameter initialization request	1139			1901		
Cd.11 Positioning start No.	1150	1200	1250	1500	1600	1700
Cd.12 Axis error reset	1151	1201	1251	1502	1602	1702
Cd.13 Restart command	1152	1202	1252	1503	1603	1703
Cd.14 M code OFF request	1153	1203	1253	1504	1604	1704
Cd.15 New current value	1154	1204	1254	1506	1606	1706
	1155	1205	1255	1507	1607	1707
Cd.16 New speed value	1156	1206	1256	1514	1614	1714
	1157	1207	1257	1515	1615	1715
Cd.17 Speed change request	1158	1208	1258	1516	1616	1716
Cd.18 Positioning operation speed override	1159	1209	1259	1513	1613	1713
Cd.19 JOG speed	1160	1210	1260	1518	1618	1718
	1161	1211	1261	1519	1619	1719
Cd.20 Speed-position switching enable flag	1163	1213	1263	1528	1628	1728
Cd.21 Speed-position switching control movement amount change register	1164	1214	1264	1526	1626	1726
	1165	1215	1265	1527	1627	1727
Cd.22 Manual pulse generator enable flag	1167	1217	1267	1524	1624	1724
Cd.23 Manual pulse generator 1 pulse input magnification	1168	1218	1268	1522	1622	1722
	1169	1219	1269	1523	1623	1723
Cd.24 OPR return request flag OFF request	1170	1220	1270	1521	1621	1721
Cd.25 External start valid	1171	1221	1271	1505	1605	1705
(QD75: Cd. 8 External command valid)						
Cd.26 Step valid flag	1172	1222	1272	1545	1645	1745
Cd.27 Step mode	1173	1223	1273	1544	1644	1744
Cd.28 Step start information	1174	1224	1274	1546	1646	1746
Cd.29 Skip command	1175	1225	1275	1547	1647	1747
Cd.30 New torque value	1176	1226	1276	1525	1625	1725
Cd.31 Positioning starting point No.	1178	1228	1278	1501	1601	1701
Cd.32 Interrupt request during continuous operation	1181	1231	1281	1520	1620	1720
Cd.33 New acceleration time value	1184	1234	1284	1508	1608	1708
	1185	1235	1285	1509	1609	1709

Items of A1SD75		Buffer memory address							
		A1SD75			QD75				
		Axis 1	Axis 2	Axis 3	Axis 1	Axis 2	Axis 3		
Cd.34	New deceleration time value	1186	1236	1286	1510	1610	1710		
		1187	1237	1287	1511	1611	1711		
Cd.35	Acceleration/deceleration time change during speed change, enable/disable selection	1188	1238	1288	1512	1612	1712		
Cd.41	Deceleration start flag valid	—			1905				
Cd.42	Stop command processing for deceleration stop selection	—			1907				
Cd.100	Servo OFF command	—			1551	1651	1751		
Cd.101	Torque output setting value	—			1552	1652	1752		
Cd.102	Servo amplifier data read	—			1553	1653	1753		
Positioning data * 1	Da.1	No.1	1300	2300	3300	2000	8000	14000	
	Da.2								Control system
	Da.3		Acceleration time No.						
	Da.4		Deceleration time No.						
	Da.9		M code/condition data	1301	2301	3301	2001	8001	14001
	Da.8		Dwell time/JUMP destination positioning data No.	1302	2302	3302	2002	8002	14002
	Da.7		Command speed	1304	2304	3306	2004	8004	14004
				1305	2305	3307	2005	8005	14005
	Da.5		Positioning address/movement amount	1306	2306	3306	2006	8006	14006
				1307	2307	3307	2007	8007	14007
	Da.6		Arc address	1308	2308	3308	2008	8008	14008
				1309	2309	3309	2009	8009	14009
	No.2		1310 to 1319	2320 to 2329	3310 to 3319	2010 to 2019	8010 to 8019	14010 to 14019	
	No.3		1320 to 1329	2330 to 2339	3320 to 3329	2020 to 2029	8020 to 8029	14020 to 14029	
to		to	to	to	to	to	to		
No.100		2290 to 2299	3290 to 3299	4290 to 4299	2990 to 2999	8990 to 8999	14990 to 14999		

\* 1: With the QD75, the positioning data buffer memory addresses are Nos. 1 to 600.

Refer to Appendix 8 "List of buffer memory addresses" for details.

Items of A1SD75				Buffer memory address												
				A1SD75						QD75						
				Axis 1		Axis 2		Axis 3		Axis 1		Axis 2		Axis 3		
Positioning start information * 2	Start block data * 2	Da.10 Shape	1st point	4300	4350	4550	4600	4800	4850	26000	26050	27000	27050	28000	28050	
		Da.11 Start data No.		4301	4351	4551	4601	4801	4851	26001	26051	27001	27051	28001	28051	
		Da.12 Special start instruction		4302	4352	4552	4602	4802	4852	26002	26052	27002	27052	28002	28052	
		Da.13 Parameter		4303	4353	4553	4603	4803	4853	26003	26053	27003	27053	28003	28053	
	2nd point		4301	4351	4551	4601	4801	4851	26001	26051	27001	27051	28001	28051		
	3rd point		4302	4352	4552	4602	4802	4852	26002	26052	27002	27052	28002	28052		
	to		to	to	to	to	to	to	to	to	to	to	to	to		
	50th point		4349	4399	4599	4649	4849	4899	26049	26099	27049	27099	28049	28099		
	Condition data	Da.14 Condition target	No.1	4400		4650		4900		26100		27100		28100		
		Da.15 Condition operator		4402		4652		4902		26102		27102		28102		
		Da.16 Address		4403		4653		4903		26103		27103		28103		
		Da.17 Parameter 1		4404		4654		4904		26104		27104		28104		
		Da.18 Parameter 2		4405		4655		4905		26105		27105		28105		
		No.2		4410 to 4419		4660 to 4669		4910 to 4919		26110 to 26119		27110 to 27119		28110 to 28119		
		No.3		4420 to 4429		4670 to 4679		4920 to 4929		26120 to 26129		27120 to 27129		28120 to 28129		
		to		to		to		to		to		to		to		
		No.10		4490 to 4499		4740 to 4749		4990 to 4999		26190 to 26199		27190 to 27199		28190 to 28199		
		Positioning		Indirect designation	Start No. 8001		4500	4750	5000	-		-		-		
Start No. 8002			4501		4751	5001	-		-		-					
to			to		to	to	to		to		to					
Start No. 8050			4549		4799	5049	-		-		-					
PLC CPU memo area	Condition judgment target data of the condition data		5050						30000							
			to						to							
			5099						30099							
Target axis				5100						-						
Head positioning block No.				5101						-						
No. of read/write data items				5102						-						
Read/write request				5103						-						
Read/write block				5110 to 6109						-						

\*2: With the QD75, it is called "block start data".

\*3: With the QD75, the "block start data" and "condition data" in the shaded area are called "start block 0". There are five start blocks: 0 to 4.

Refer to Appendix 8 "List of buffer memory addresses" for details.

## (5) Input/output signal comparisons

## Input signal comparisons

Name	A1SD75		QD75	
	Logic (initial status)	Logic switch with parameters	Logic (initial status)	Logic switch with parameters
In-position signal	Negative logic	Not possible	–	–
Manual pulse generator A phase Manual pulse generator B phase * 1	Negative logic (multiple of 4)	Not possible	Negative logic (multiple of 4)	Possible
Near-point signal	Negative logic	Not possible	Negative logic	Possible
Stop signal	Negative logic	Not possible	Negative logic	Possible
Upper limit	Negative logic	Not possible	Negative logic	Possible
Lower limit	Negative logic	Not possible	Negative logic	Possible
External start *2	Negative logic	Not possible	Negative logic	Possible
Speed-position switching signal * 2	Negative logic	Not possible	Negative logic	Possible

\* 1: Comparisons about manual pulse generator A phase/B phase.

	A1SD75	QD75
No. of connectable manual pulse generators	1 generator/1 axis	1 generator/1 module
Mode selection (with parameter)	Not possible	Possible Multiple of 1 mode, multiple of 2 mode, multiple of 4 mode, PLS/SIGN mode

\* 2: With the QD75, the "external start signal" and "speed-position switching signal" are combined into the "external command signal/switching signal".

## Appendix 6 Positioning control troubleshooting

Trouble type	Questions/Trouble	Remedy	No.
Parameter	Display reads "FFFFH" when a parameter is read with GX Configurator-QP.	The PLC CPU power was turned OFF or the PLC CPU was reset, etc., during flash ROM writing, which deleted the data in the flash ROM. Initialize the parameters, and reset the required parameters. (Refer to Section 13.2 "Parameter initialization function" for details.)	1
	How can the parameters be returned to their initial values ?	Set the " Cd.2 Parameter initialization request" to "1". (Refer to Section 13.2 "Parameter initialization function" for details.)	2
	A parameter error occurred although the parameter was set correctly by GX Configurator-QP.	The parameter may have been overwritten in the PLC program. Review the PLC program.	3
Hardware stroke limit	The machine overruns if operating at high speeds when the hardware stroke limit range is exceeded.	In the QD75, deceleration stops are executed after the machine exceeds hardware stroke limit range. Because of this, more time is required for the deceleration stop as the speed increases, and the overrun becomes larger. (The deceleration time becomes shorter at lower speeds, so the overrun becomes smaller.)	4
	When the machine exceeded the hardware stroke limit range, positioning toward inside the range was started, but the machine did not start.	Use a "JOG operation", " Inching operation" or "Manual pulse generator operation" to return the machine to inside the hardware stroke limit range. (When the hardware stroke limit range is exceeded, positioning will not start toward inside the range even when so commanded. Once the range is exceeded, a return to inside the range can only be executed using a "JOG operation", "Inching operation" or "Manual pulse generator operation".)	5
Degree	Exactly one rotation is required, but the setting range for a "degree" unit setting is "0 to 359.999...". Won't the rotation deviate by "0.00...1"?	Designate "360.000" in the INC control. The motor will make exactly one rotation.	6
Movement amount per pulse	If the "movement amount per pulse" is calculated as written in the manual, settings smaller than the basic parameter setting range cannot be carried out.	Set "movement amount per pulse" in the QD75 using the three parameter values of Pr.2 to Pr.4 . Try setting the values following the explanations for each parameter.	7
Override	Will an override setting value written before starting be valid?	It will be valid.	8
	During path control, will the override still be valid after the point is passed?	It will still be valid.	9
	How can the override be canceled?	Set the " Cd.13 Positioning operation speed override" to "100".	10

Trouble type	Questions/Trouble	Remedy	No.
Acceleration/deceleration time	How can the deceleration stop time during stopping be shortened using the hardware stroke limit?	Set "1: Sudden stop" in the " Pr.37 Stop group 1 sudden stop selection", and reduce the setting value of " Pr.36 Sudden stop deceleration time".	11
	The motor does not operate at "60000ms" although the acceleration/deceleration time is set to "60000ms".	The value set for the acceleration/deceleration time is the time required for the machine to accelerate from speed "0" to the value set in " Pr.8 Speed limit value". Because of that, the acceleration/deceleration time will also be shorter than "60000ms" if the command speed value is smaller than the " Pr.8 Speed limit value". (Refer to the explanation for Pr.9 and Pr.10 for details.)	12
	Can each acceleration/deceleration time be individually set to trapezoidal or S-pattern acceleration/deceleration?	The trapezoidal and S-pattern acceleration/deceleration processing is a common setting for all acceleration/deceleration times, so individual setting is not possible. (Refer to Section 12.7.7 "Acceleration/deceleration process function".)	13
	The machine starts and stops suddenly when carrying out JOG operations and positioning operations. (Using an MR-J2S servo amplifier.)	Review the parameter settings for acceleration/deceleration time, speed limit value, JOG speed limit value, JOG acceleration/deceleration time, etc.	14
Simplified absolute value	Are simplified absolute values possible in the QD75P and QD75D Positional deviation models?	They are possible if the models are used in combination with a Mitsubishi "AC Servo". (Refer to "AC servo User's Manual" for details.)	15
Positional deviation	The physical position deviates from the commanded position, although the positioning is complete (and the monitored current position is correct).	If the deviation counter value is not "0", the servo side is still moving. Increase the torque.	16
Electronic gear	A setting of "1σm = 1PLS" is required in the following system. <ul style="list-style-type: none"> <li>⊖ Ball screw pitch = 10mm</li> <li>⊖ No. of feedback pulses = 8192PLS</li> </ul>	In this case, the following values will result. <ul style="list-style-type: none"> <li>⊖ No. of pulses per rotation = 8192</li> <li>⊖ Movement amount per rotation = 10000</li> <li>⊖ Unit magnification = 10</li> </ul> Therefore, the "Movement amount per pulse" will become "1.2207σm". This value is fixed by the machine system, so it cannot be changed. Thus, the setting "1σm = 1PLS" cannot be achieved.	17

Trouble type	Questions/Trouble	Remedy	No.
Error compensation	<p>The machine only moves to "10081230", although positioning with a command value of "10081234" carried out.</p> <p>How can the error be compensated?</p> <p>The following values are currently set.</p> <p>€ " [Pr.2] No. of pulses per rotation" = 8192PLS</p> <p>€ " [Pr.3] Movement amount per rotation" = 8000σm</p>	<p>Reset [Pr.3] and [Pr.2] in the following order.</p> <ol style="list-style-type: none"> <li>1) Calculate "8192/8000 Δ 10081234/10081230".</li> <li>2) Obtain the reduced value.</li> <li>3) Set the numerator in " [Pr.3] Movement amount per rotation", and the denominator in " [Pr.2] No. of pulses per rotation".</li> </ol>	18
OPR	<p>When carrying out a count-method machine OPR, the message "Leave Sufficient Distance From The OP Position To The Near-Point Dog OFF." appears. Is there a problem if the distance is short?</p>	<p>The near-point dog must be set to turn OFF at a position after the OP is passed.</p> <p>(When the OPR is started on the near-point dog ON in a count-method machine OPR, the machine enters a normal machine OPR operation after returning to the near-point dog OFF region.)</p> <p>(If the near-point dog is turned OFF before the OP, and the machine OPR is started between the near-point dog OFF position and the OP, the machine will mistakenly interpret that its current position is before the near-point dog ON position, and it will pass over the OP and continue moving.)</p>	19
	<p>In the near-point dog method machine OPR, the stop positions are not uniform.</p>	<p>Carry out the following measures.</p> <ol style="list-style-type: none"> <li>1) Separate the near-point dog signal and zero signal detection positions.</li> <li>2) Lower the values in " [Pr.46] OPR speed" and " [Pr.47] Creep speed".</li> <li>3) Confirm whether the zero signal and near-point dog signal turn ON normally.</li> <li>4) Check that there is no play (backlash) in the machine system.</li> </ol>	20
	<p>Can the machine OPR be carried out with the OPR retry function when it is started with the near-point dog ON and the upper/lower limit OFF?</p>	<p>A "Hardware stroke limit error" will occur and the operation will not be carried out.</p> <p>(The machine will interpret any position where the near-point dog is ON as being within the working range, and that the upper/lower limit is ON.)</p>	21
	<p>Are ABS and INC positioning possible without carrying out an OPR?</p>	<p>They are possible.</p> <p>In this case, the position where the power is turned ON is handled as the current feed value "0".</p>	22
	<p>After an OPR, the OPR request flag sometimes turns ON for no apparent reason.</p>	<p>The OPR request flag turns ON in the following cases.</p> <ol style="list-style-type: none"> <li>1) When the power is turned ON.</li> <li>2) When the absolute system has not been set.</li> <li>3) When the OPR has not been executed at the absolute position system.</li> <li>4) When an OPR operation starts.</li> </ol> <p>If no problem is found when the above are checked, then it is possible that the communication is being interrupted by "a fault in the bus cable", "noise influence", etc.</p>	23



Trouble type	Questions/Trouble	Remedy	No.
Start	The positioning start signal [Y10] is kept ON until the BUSY signal is OFF, but is there any problem with turning it OFF before the BUSY signal turns OFF?	After the BUSY signal turns ON, there is no problem with turning [Y10] OFF before the BUSY signal turns OFF. (The QD75 detects the rising edge (OFF → ON) of the positioning start signal [Y10].)	25
	The operation will not start even when the start signal is turned ON.	Check the " [Md.26] Axis operation status" and " [Md.23] Axis error No.".	26
Stop	How many milliseconds should the axis stop signal [Y4] be turned ON for?	The signal should be turned ON at 4ms or more. (If possible, set the signal so it does not turn ON only momentarily, but instead stays ON until the BUSY signal turns OFF. This will keep the stop signal from skipping.)	27
	How can a sudden stop be selected?	Set "1: Sudden stop" in the parameter from [Pr.37] to [Pr.39] corresponding to the stop group, and reduce the setting value of " [Pr.36] Sudden stop deceleration time".	28
	"Normal deceleration stop" was selected in " [Pr.39] Stop group 3 sudden stop", and Y stop was turned ON. If the " [Pr.39] "setting is changed to "sudden stop" during a deceleration stop, and the Y stop signal turns from OFF to ON, will the operation change to a sudden stop from that point?	The operation will not change. Even if the same stop factor is input again during the deceleration stop, it will be ignored. The same deceleration stop process used when the stop signal was first input will be continued. (This also applies for [Pr.37] and [Pr.38] .)	29
Circular interpolation	ABS system circular interpolation operates normally, but a vertically oblong circle results when INC system circular interpolation is carried out.	The address designation may be incorrect. When carrying out INC system circular interpolation, designate the relative addresses from the starting point of both the center point and end point.	30
Speed-position switching control	Can the speed be changed during speed control and position control by speed-position switching control?	No. The speed for the speed control and position control cannot be set differently.	31
JOG operation	Even if the JOG start signal is turned ON, the response until it turns ON is sometimes slow.	Either of the following is possible. 1) The PLC program may be incorrect. Check by creating a test program in which the JOG start signal is turned ON only. 2) If the machine is hitting something when the torque setting is low, it may be trying to move by JOG operation in the opposite direction. In this case, the machine will start moving only after the internal droop pulses have been reached 0 in the counter, even if the JOG start signal has been turned ON. This makes it seem that the response is slow.	32
	The operation is not carried out at the set JOG speed, although the speed limit value has not been reached.	Either of the following is possible. 1) The JOG start signal may be chattering. Monitor the JOG start signal to confirm whether it is chattering. (When using the "BUSY signal" in the JOG operation start circuit, check the position of the BUSY signal.) 2) The " [Pr.31] JOG speed limit value" may not be appropriate. Review the setting value and carry out the JOG operation again.	33

Trouble type	Questions/Trouble	Remedy	No.
JOG operation	When a JOG operation is attempted, an error results and the machine does not move.	The " Pr.31 JOG speed limit value" may be larger than the " Pr.8 Speed limit value". Review the parameters and carry out the JOG operation again.	34
	Why does the positioning complete signal turns ON during the JOG operation?	If a value other than "0" is set for " Cd.16 Inching movement amount", the inching operation is carried out and the positioning complete signal turns ON. Confirm that the " Cd.16 Inching movement amount" is set to "0".	35
Manual pulse generator operation	Is it possible to count the pulses when the B phase is set to "1", and only A phase pulses are input?	Possible. Set the " Pr.24 Manual pulse generator input selection" to "3: PLS/ SIGN mode". It is possible to count the pulses when only A phase pulses are input.	36
	Can a manual pulse generator other than the Mitsubishi MR-HDP01 be used?	Other manual pulse generators can be used if they conform to Section 3.4 "Specifications for input/output interfaces with external devices."	37
	Can one manual pulse generator be operated connected to several QD75 modules?	This is possible if the system conforms to the electrical specifications.	38
Current value changing	The BUSY signal is not canceled by the current value changing. How can it be canceled?	The BUSY signal may remain if the scan time is long. Use a complete signal to check whether the current value changing has been executed.	39
QD75 READY signal	The QD75 READY signal does not turn ON even when the PLC READY signal [Y0] is turned ON.	"A parameter error" has occurred. Confirm the error No. in the error history, and correct the parameter.	40
M code ON signal	Is there any problem with setting an M code ON signal OFF request in the next scan after the M code ON signal ON?	The QD75 checks the M code ON signal OFF request every "3.5ms", so there is a possibility that the M code ON signal OFF may be delayed by a maximum of "3.5ms" after the M code ON signal ON, even if an M code ON signal OFF request is set.	41
Servo ON	The servo amplifier LED remains "Ab" even if all axis servo Y1 is turned ON.	Set the motor capacity for servo parameter (30104, 30204, 30304, 30404).	42
Module	Error 537 (PLC READY signal OFF at positioning start) occurs after the QD75 is replaced. (The PLC program is the same.)	The internal parameters of the QD75 may be different. Check if the QD75 READY signal [X0] turns ON when the PLC READY signal [Y0] turns ON. When the PLC READY signal is ON but the QD75 READY signal is OFF, the parameter error has occurred. Check the error code and modify the parameter with the error.	45
Motor	The motor only rotates in one direction.	The parameter settings on the QD75 side may not match those on the servo side. Check the parameter settings.	46
	Can the current motor speed be monitored?	The speed shown on the QD75 monitor is calculated from the number of pulses output from the module. Thus, the actual motor speed cannot be monitored. ( " Md.22 Feedrate" monitors the commanded speed. It does not show the actual motor speed.)	47

Trouble type	Questions/Trouble	Remedy	No.
Error/warning	Error 920 (backlash compensation amount error) occurs even when the backlash compensation value is set to "1".	$0 \leq \frac{\text{Backlash compensation value}}{\text{Movement amount per pulse}} \leq 65535$ Setting is not possible if the above equation is not satisfied.	48
	When a JOG operation is attempted, errors such as error 104 (hardware stroke limit+) or error 105 (hardware stroke limit -) occur and the machine does not move.	The hardware stroke limit wiring has probably not been carried out. Refer to section "12.4.4 Hardware stroke limit function" for details, and wire accordingly.	49
	Error 997 (Speed selection at OP shift error) appears when the PLC READY signal [Y0] turns from OFF to ON.	A value besides "0" or "1" may be set in the [Pr.56] Speed designation during OP shift. Review the set PLC program, and reset the correct parameters.	50
	When the start signal was turned ON immediately after the stop signal ON, warning 100 (start during operation) was detected, and the start was ignored.	The QD75 starts the deceleration stop process when the stop signal ON is detected. Thus, the machine interprets that "positioning is still being executed" immediately after the stop signal ON. Even if the start signal is turned ON at that time, the start request will be ignored and warning 100 will occur.	51
	Does warning 500 (deceleration and stop speed change) occur only during "stop deceleration" and "automatically deceleration"? Is there any problem if the operation is continued in that state without resetting the error?	The warning occurs only at those times mentioned at the left. Because this is a warning, there is no problem if the operation can be continued without resetting the error. (When the speed is changed using the override, the new value will not be reflected on the data being executed, but will be reflected from the next start.)	52
Positioning completion signal	When the position control is carried out, the positioning completion signal is not turned ON.	The positioning may have not been completed properly by the occurrence of the stop factor. Check the axis monitor " [Md.26] axis operation state" after BUSY signal OFF. Stopped : The stop signal is turned ON during positioning. Check the condition of the stop signal (Y stop or external stop) ON. During error occurrence : An error occurred during positioning. Check the cause of error occurrence from " [Md.23] axis error number".	53
		The setting value for detailed parameter 2 "Positioning completion signal output time" is 0 or shorter than scan time. Set the properly detectable time using the PLC program.	54

## Appendix 7 List of buffer memory addresses

The following shows the relation between the buffer memory addresses and the various items.

Do not set other than the default value "0" of the "Maker setting".

Buffer memory address				Item	Memory area	
Axis 1	Axis 2	Axis 3	Axis 4		Basic parameters 1	Basic parameters 2
0	150	300	450	Pr.1 Unit setting		
2	152	302	452	Pr.2 No. of pulses per rotation (AP)		
3	153	303	453			
4	154	304	454	Pr.3 Movement amount per rotation (AL)		
5	155	305	455			
1	151	301	451	Pr.4 Unit magnification (AM)		
6	156	306	456	Pr.7 Bias speed at start		
7	157	307	457			
8	158	308	458	Maker setting		
9	159	309	459	Maker setting		
10	160	310	460	Pr.8 Speed limit value	Basic parameters 2	
11	161	311	461			
12	162	312	462	Pr.9 Acceleration time 0		
13	163	313	463			
14	164	314	464	Pr.10 Deceleration time 0		
15	165	315	465			
17	167	317	467	Pr.11 Backlash compensation amount	Detailed parameters 1	
18	168	318	468	Pr.12 Software stroke limit upper limit value		
19	169	319	469			
20	170	320	470	Pr.13 Software stroke limit lower limit value		
21	171	321	471			
22	172	322	472	Pr.14 Software stroke limit selection		
23	173	323	473	Pr.15 Software stroke limit valid/invalid selection		
24	174	324	474	Pr.16 Command in-position width		
25	175	325	475			
26	176	326	476	Pr.17 Torque limit setting value		
27	177	327	477	Pr.18 M code ON signal output timing		
28	178	328	478	Pr.19 Speed switching mode		
29	179	329	479	Pr.20 Interpolation speed designation method		
30	180	330	480	Pr.21 Current feed value during speed control		
31	181	331	481	Pr.22 Input signal logic selection		
33	—	—	—	Pr.24 Manual pulse generator input selection		
34	184	334	484	Pr.200 Speed-position function selection		
35	185	335	485	Maker setting		
36	186	336	486	Pr.25 Acceleration time 1	Detailed parameters 2	
37	187	337	487			
38	188	338	488	Pr.26 Acceleration time 2		
39	189	339	489			

Buffer memory address				Item	Memory area	
Axis 1	Axis 2	Axis 3	Axis 4			
40	190	340	490	Pr.27 Acceleration time 3	Detailed parameters 2	Positioning parameters
41	191	341	491			
42	192	342	492	Pr.28 Deceleration time 1		
43	193	343	493			
44	194	344	494	Pr.29 Deceleration time 2		
45	195	345	495			
46	196	346	496	Pr.30 Deceleration time 3		
47	197	347	497			
48	198	348	498	Pr.31 JOG speed limit value		
49	199	349	499			
50	200	350	500	Pr.32 JOG operation acceleration time selection		
51	201	351	501	Pr.33 JOG operation deceleration time selection		
52	202	352	502	Pr.34 Acceleration/deceleration process selection		
53	203	353	503	Pr.35 S-pattern proportion		
54	204	354	504	Pr.36 Sudden stop deceleration time		
55	205	355	505			
56	206	356	506	Pr.37 Stop group 1 sudden stop selection		
57	207	357	507	Pr.38 Stop group 2 sudden stop selection		
58	208	358	508	Pr.39 Stop group 3 sudden stop selection		
59	209	359	509	Pr.40 Positioning complete signal output time		
60	210	360	510	Pr.41 Allowable circular interpolation error width		
61	211	361	511			
62	212	362	512	Pr.42 External command function selection		
64	214	364	514	Pr.201 Restart allowable range when servo OFF to ON		
65	215	365	515			
70	220	370	520	Pr.43 OPR method	OPR basic parameters	OPR parameters
71	221	371	521	Pr.44 OPR direction		
72	222	372	522	Pr.45 OP address		
73	223	373	523			
74	224	374	524	Pr.46 OPR speed		
75	225	375	525			
76	226	376	526	Pr.47 Creep speed		
77	227	377	527			
78	228	378	528	Pr.48 OPR retry		
80	230	380	530	Pr.50 Setting for the movement amount after near-point dog ON	OPR detailed parameters	
81	231	381	531			
82	232	382	532	Pr.51 OPR acceleration time selection		
83	233	383	533	Pr.52 OPR deceleration time selection		
84	234	384	534	Pr.53 OP shift amount		
85	235	385	535			
86	236	386	536	Pr.54 OPR torque limit value		
88	238	388	538	Pr.56 Speed designation during OP shift		
89	239	389	539	Pr.57 Dwell time during OPR retry		

Buffer memory address															Item	Memory area			
Common to axes 1, 2, 3, and 4																			
1200															Md.1	In test mode flag	System monitor data		
1201															Maker setting				
1202																			
1203																			
1204																			
1205																			
1206																			
1207																			
1208																			
1209																			
1210																			
1211																			
(0)	(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)	(10)	(11)	(12)	(13)	(14)	(15)	(Pointer No.)		Start History	
1212	1217	1222	1227	1232	1237	1242	1247	1252	1257	1262	1267	1272	1277	1282	1287	Md.3			Start information
1213	1218	1223	1228	1233	1238	1243	1248	1256	1258	1263	1268	1273	1278	1283	1288	Md.4			Start No.
1214	1219	1224	1229	1234	1239	1244	1249	1254	1259	1264	1269	1274	1279	1284	1289	Md.5			Start Hour
1215	1220	1225	1230	1235	1240	1245	1250	1255	1260	1265	1270	1275	1280	1285	1290	Md.6			Start Minute: second
1216	1221	1226	1231	1236	1241	1246	1251	1256	1261	1266	1271	1276	1281	1286	1291	Md.7			Error judgment
1292															Md.8	Start history pointer			
(0)	(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)	(10)	(11)	(12)	(13)	(14)	(15)	(Pointer No.)	Error History		
1293	1297	1301	1305	1309	1313	1317	1321	1325	1329	1333	1337	1341	1345	1349	1353	Md.9		Axis in which the error occurred	
1294	1298	1302	1306	1310	1314	1318	1322	1326	1330	1334	1338	1342	1346	1350	1354	Md.10		Axis error No.	
1295	1299	1303	1307	1311	1315	1319	1323	1327	1331	1335	1339	1343	1347	1351	1355	Md.11		Axis error occurrence (Hour)	
1296	1300	1304	1308	1312	1316	1320	1324	1328	1332	1336	1340	1344	1348	1352	1356	Md.12		Axis error occurrence (Minute: second)	
1357															Md.13	Error history pointer			
(0)	(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)	(10)	(11)	(12)	(13)	(14)	(15)	(Pointer No.)	Warning history		
1358	1362	1366	1370	1374	1378	1382	1386	1390	1394	1398	1402	1406	1410	1414	1418	Md.14		Axis in which the warning occurred	
1359	1363	1367	1371	1375	1379	1383	1387	1391	1395	1399	1403	1407	1411	1415	1419	Md.15		Axis warning No.	
1360	1364	1368	1372	1376	1380	1384	1388	1392	1396	1400	1404	1408	1412	1416	1420	Md.16		Axis warning occurrence (Hour)	
1361	1365	1369	1373	1377	1381	1385	1389	1393	1397	1401	1405	1409	1413	1417	1421	Md.17		Axis warning occurrence (Minute: second)	
1422															Md.18	Warning history pointer			
1424															Md.19	No. of write accesses to flash ROM			
1425																			

Buffer memory address				Item	Memory area		
Axis 1	Axis 2	Axis 3	Axis 4				
800	900	1000	1100	Md.20	Current feed value	Axis monitor data	Monitor data
801	901	1001	1101				
802	902	1002	1102	Md.21	Machine feed value		
803	903	1003	1103				
804	904	1004	1104	Md.22	Feedrate		
805	905	1005	1105				
806	906	1006	1106	Md.23	Axis error No.		
807	907	1007	1107	Md.24	Axis warning No.		
808	908	1008	1108	Md.25	Valid M code		
809	909	1009	1109	Md.26	Axis operation status		
810	910	1010	1110	Md.27	Current speed		
811	911	1011	1111				
812	912	1012	1112	Md.28	Axis feedrate		
813	913	1013	1113				
814	914	1014	1114	Md.29	Speed-position switching control positioning amount		
815	915	1015	1115				
816	916	1016	1116	Md.30	External input/output signal		
817	917	1017	1117	Md.31	Status		
818	918	1018	1118	Md.32	Target value		
819	919	1019	1119				
820	920	1020	1120	Md.33	Target speed		
821	921	1021	1121				
824	924	1024	1124	Md.34	Movement amount after near-point dog ON		
825	925	1025	1125				
826	926	1026	1126	Md.35	Torque limit stored value		
827	927	1027	1127	Md.36	Special start data instruction parameter setting value		
828	928	1028	1128	Md.37	Special start data instruction No. setting value		
829	929	1029	1129	Md.38	Start positioning data No. setting value.		
830	930	1030	1130	Md.39	In speed control flag		
831	931	1031	1131	Md.40	In speed change processing flag		
832	932	1032	1132	Md.41	Special start repetition counter		
833	933	1033	1133	Md.42	Control system repetition counter		
834	934	1034	1134	Md.43	Start data pointer being executed		
835	935	1035	1135	Md.44	Positioning data No. being executed		
836	936	1036	1136	Md.45	Block No. being executed		
837	937	1037	1137	Md.46	Last executed positioning data No.		
838 to 847	938 to 947	1038 to 1047	1138 to 1147	Md.47	Positioning data being executed		

Buffer memory address				Item	Memory area	
Axis 1	Axis 2	Axis 3	Axis 4			
848	948	1048	1148	Md.100 OPR re-travel value	Axis monitor data	Monitor data
849	949	1049	1149			
850	950	1050	1150	Md.101 Real current value		
851	951	1051	1151			
852	952	1052	1152	Md.102 Deviation counter value		
853	953	1053	1153			
854	954	1054	1154	Md.103 Motor rotation speed		
855	955	1055	1155			
856	956	1056	1156	Md.104 Motor current value		
857	957	1057	1157	Md.105 Auto tuning		
858	958	1058	1158	Md.105 Load inertia ratio		
859	959	1059	1159	Md.105 Position loop gain 1		
860	960	1060	1160	Md.105 Speed loop gain 1		
861	961	1061	1161	Md.105 Position loop gain 2		
862	962	1062	1162	Md.105 Speed loop gain 2		
863	963	1063	1163	Md.105 Speed integral compensation		
864	964	1064	1164	Md.106 Servo amplifier software No.		
865	965	1065	1165			
866	966	1066	1166			
867	967	1067	1167			
868	968	1068	1168			
869	969	1069	1169			
870	970	1070	1170	Md.107 Parameter error No. (No.0 to 15)		
871	971	1071	1171	Md.107 Parameter error No. (No.16 to 31)		
872	972	1072	1172	Md.107 Parameter error No. (No.32 to 47)		
873	973	1073	1173	Md.107 Parameter error No. (No.48 to 63)		
874	974	1074	1174	Md.107 Parameter error No. (No.64 to 75)		
875	975	1075	1175	Maker setting		
876	976	1076	1176			
877	977	1077	1177	Md.108 Servo status		
878	978	1078	1178	Md.109 Regenerative load ratio		
879	979	1079	1179	Md.110 The continuous effective load torque is indicated.		
880	980	1080	1180	Md.111 Peak torque ratio		
899	999	1099	1199	Md.48 Deceleration start flag		



Buffer memory address				Item	Memory area		
Axis 1	Axis 2	Axis 3	Axis 4				
1500	1600	1700	1800	Cd.3	Positioning start No.	Axis control data	Control data
1501	1601	1701	1801	Cd.4	Positioning starting point No.		
1502	1602	1702	1802	Cd.5	Axis error reset		
1503	1603	1703	1803	Cd.6	Restart command		
1504	1604	1704	1804	Cd.7	M code OFF request		
1505	1605	1705	1805	Cd.8	External command valid		
1506	1606	1706	1806	Cd.9	New current value		
1507	1607	1707	1807				
1508	1608	1708	1808	Cd.10	New acceleration time value		
1509	1609	1709	1809				
1510	1610	1710	1810	Cd.11	New deceleration time value		
1511	1611	1711	1811				
1512	1612	1712	1812	Cd.12	Acceleration/deceleration time change during speed change, enable/disable selection		
1513	1613	1713	1813	Cd.13	Positioning operation speed override		
1514	1614	1714	1814	Cd.14	New speed value		
1515	1615	1715	1815				
1516	1616	1716	1816	Cd.15	Speed change request		
1517	1617	1717	1817	Cd.16	Inching movement amount		
1518	1618	1718	1818	Cd.17	JOG speed		
1519	1619	1719	1819				
1520	1620	1720	1820	Cd.18	Interrupt request during continuous operation		
1521	1621	1721	1821	Cd.19	OPR request flag OFF request		
1522	1622	1722	1822	Cd.20	Manual pulse generator 1 pulse input magnification		
1523	1623	1723	1823				
1524	1624	1724	1824	Cd.21	Manual pulse generator enable flag		
1525	1625	1725	1825	Cd.22	New torque value		
1526	1626	1726	1826	Cd.23	Speed-position switching control movement amount change register		
1527	1627	1727	1827				
1528	1628	1728	1828	Cd.24	Speed-position switching enable flag		
1529	1629	1729	1829	Maker setting			
1530	1630	1730	1830	Cd.25	Position-speed switching control speed change register		
1531	1631	1731	1831				
1532	1632	1732	1832	Cd.26	Position-speed switching enable flag		
1533	1633	1733	1833	Maker setting			
1534	1634	1734	1834	Cd.27	Target position change value (new address)		
1535	1635	1735	1835				
1536	1636	1736	1836	Cd.28	Target position change value (new speed)		
1537	1637	1737	1837				
1538	1638	1738	1838	Cd.29	Target position change request flag		
1539	1639	1739	1839	Maker setting			
1540	1640	1740	1840	Cd.30	Simultaneous starting axis start data No. (axis 1 start data No.)		

Buffer memory address				Item	Memory area	
Axis 1	Axis 2	Axis 3	Axis 4			
1541	1641	1741	1841	Cd.31 Simultaneous starting axis start data No. (axis 2 start data No.)	Axis control data	Control data
1542	1642	1742	1842	Cd.32 Simultaneous starting axis start data No. (axis 3 start data No.)		
1543	1643	1743	1843	Cd.33 Simultaneous starting axis start data No. (axis 4 start data No.)		
1544	1644	1744	1844	Cd.34 Step mode		
1545	1645	1745	1845	Cd.35 Step valid flag		
1546	1646	1746	1846	Cd.36 Step start information		
1547	1647	1747	1847	Cd.37 Skip command		
1548	1648	1748	1848	Cd.38 Teaching data selection		
1549	1649	1749	1849	Cd.39 Teaching positioning data No.		
1550	1650	1750	1850	Cd.40 ABS direction in degrees		
1551	1651	1751	1851	Cd.100 Servo OFF command		
1552	1652	1752	1852	Cd.101 Torque output setting value		
1553	1653	1753	1853	Cd.102 Servo amplifier data read		
1900				Cd.1 Flash ROM write request	System control data	
1901				Cd.2 Parameter initialization request		
1905				Cd.41 Deceleration start flag valid		
1907				Cd.42 Stop command processing for deceleration stop selection		

Buffer memory address				Item	Memory area		
Axis 1	Axis 2	Axis 3	Axis 4		No.1	Positioning data	Positioning data
2000	8000	14000	20000	Da.1 Operation pattern Da.2 Control system Da.3 Acceleration time No. Da.4 Deceleration time No. Da.5 Axis to be interpolated			
2001	8001	14001	20001	Da.10 M code/condition data No. /No. of LOOP to LEND repetitions			
2002	8002	14002	20002	Da.9 Dwell time/JUMP destination positioning data No.			
2003	8003	14003	20003	Maker setting			
2004 2005	8004 8005	14004 14005	20004 20005	Da.8 Command speed			
2006 2007	8006 8007	14006 14007	20006 20007	Da.6 Positioning address/movement amount			
2008 2009	8008 8009	14008 14009	20008 20009	Da.7 Arc address			
2010 to 2019	8010 to 8019	14010 to 14019	20010 to 20019	No.2			
2020 to 2029	8020 to 8029	14020 to 14029	20020 to 20020	No.3			
to	to	to	to	To			
7990 to 7999	13990 to 13999	19990 to 19999	25990 to 25999	No.600			

Buffer memory address								Item	Memory area		
Axis 1		Axis 2		Axis 3		Axis 4			1st point	Block start data	Starting block 0
26000	26050	27000	27050	28000	28050	29000	29050	Da.11 Shape Da.12 Start data No. Da.13 Special start instruction Da.14 Parameter			
26001	26051	27001	27051	28001	28051	29001	29051	2nd point			
26002	26052	27002	27052	28002	28052	29002	29052	3rd point			
to		to		to		to		to			
26049	26099	27049	27099	28049	28099	29049	29099	50th point			
26100		27100		28100		29100		Da.15 Condition target Da.16 Condition operator	Condition data	Starting block 0	
26102	26103	27102	27103	28102	28103	29102	29103	Da.17 Address			
26104	26405	27104	27405	28104	28405	29104	29405	Da.18 Parameter 1			
26106	26107	27106	27107	28106	28107	29106	29107	Da.19 Parameter 2			
26110 to 26119		27110 to 27119		28110 to 28119		29110 to 29119		No.2			
26120 to 26129		27120 to 27129		28120 to 28129		29120 to 29129		No.3			
to		to		to		to		to			
26190 to 26199		27190 to 27199		28190 to 28199		29190 to 29199		No.10			
26200 to 26299		27200 to 27299		28200 to 28299		29200 to 29299		Block start data	Starting block 1	Positioning data (Starting block data)	
26300 to 26399		27300 to 27399		28300 to 28399		29300 to 29399		Condition data			
26400 to 26499		27400 to 27499		28400 to 28499		29400 to 29499		Block start data	Starting block 2		
26500 to 26599		27500 to 27599		28500 to 28599		29500 to 29599		Condition data			
26600 to 26699		27600 to 27699		28600 to 28699		29600 to 29699		Block start data	Starting block 3		
26700 to 26799		27700 to 27799		28700 to 28799		29700 to 29799		Condition data			
26800 to 26899		27800 to 27899		28800 to 28899		29800 to 29899		Block start data	Starting block 4		
26900 to 26999		27900 to 27999		28900 to 28999		29900 to 29999		Condition data			


Buffer memory address				Item	Memory area	
Axis 1	Axis 2	Axis 3	Axis 4		PLC CPU memo area	Positioning data
30000				Condition judgement target data of the condition data	PLC CPU memo area	Positioning data
to						
30099						

Buffer memory address				Item	Memory area	
Axis 1	Axis 2	Axis 3	Axis 4			
30100	30200	30300	30400	Pr.100 Servo series	Servo basic parameters	Servo parameters
30101	30201	30301	30401	Pr.101 Amplifier setting		
30102	30202	30302	30402	Pr.102 Regenerative brake resistor		
30103	30203	30303	30403	Pr.103 Motor type		
30104	30204	30304	30404	Pr.104 Motor capacity		
30105	30205	30305	30405	Pr.105 Servo motor speed		
30106	30206	30306	30406	Pr.106 Feed back pulse		
30107	30207	30307	30407	Pr.107 Rotation direction selection		
30108	30208	30308	30408	Pr.108 Auto tuning		
30109	30209	30309	30409	Pr.109 Servo response		
30110	30210	30310	30410	Pr.110 Maker setting		
30111	30211	30311	30411	Pr.111 Maker setting	Servo adjustment parameters	
30112	30212	30312	30412	Pr.112 Load inertia ratio		
30113	30213	30313	30413	Pr.113 Position loop gain 1		
30114	30214	30314	30414	Pr.114 Speed loop gain 1		
30115	30215	30315	30415	Pr.115 Position loop gain 2		
30116	30216	30316	30416	Pr.116 Speed loop gain 2		
30117	30217	30317	30417	Pr.117 Speed integral compensation		
30118	30218	30318	30418	Pr.118 Machine resonance suppression filter		
30119	30219	30319	30419	Pr.119 Feed forward gain		
30120	30220	30320	30420	Pr.120 In-position range		
30121	30221	30321	30421	Pr.121 Electromagnetic brake sequence output		
30122	30222	30322	30422	Pr.122 Analog monitor output		
30123	30223	30323	30423	Pr.123 Optional function 1		
30124	30224	30324	30424	Pr.124 Optional function 2		
30125	30225	30325	30425	Pr.125 Adaptive vibration suppression control/ low pass filter		
30126	30226	30326	30426	Pr.126 Maker setting		
30127	30227	30327	30427	Pr.127 Monitor output 1 offset		
30128	30228	30328	30428	Pr.128 Monitor output 2 offset		
30129	30229	30329	30429	Pr.129 Pre-alarm data selection		
30130	30230	30330	30430	Pr.130 Zero speed		
30131	30231	30331	30431	Pr.131 Error excessive alarm level		
30132	30232	30332	30432	Pr.132 Optional function 5		
30133	30233	30333	30433	Pr.133 Optional function 6		
30134	30234	30334	30434	Pr.134 PI-PID control switch-over position droop		
30135	30235	30335	30435	Pr.135 Maker setting		
30136	30236	30336	30436	Pr.136 Speed differential compensation		
30137	30237	30337	30437	Pr.137 Maker setting		
30138	30238	30338	30438	Pr.138 Encoder output pulses		
30139	30239	30339	30439	Pr.139 Maker setting		

Buffer memory address				Item	Memory area		
Axis 1	Axis 2	Axis 3	Axis 4				
30140	30240	30340	30440	Pr.140	Maker setting	Servo expansion parameters 2	Servo parameters
30141	30241	30341	30441	Pr.141	Maker setting		
30142	30242	30342	30442	Pr.142	Maker setting		
30143	30243	30343	30443	Pr.143	Slight vibration suppression control selection 1		
30144	30244	30344	30444	Pr.144	Slight vibration suppression control selection 2		
30145	30245	30345	30445	Pr.145	Induction voltage compensation		
30146	30246	30346	30446	Pr.146	Maker setting		
30147	30247	30347	30447	Pr.147	Maker setting		
30148	30248	30348	30448	Pr.148	Maker setting		
30149	30249	30349	30449	Pr.149	Gain changing selection		
30150	30250	30350	30450	Pr.150	Gain changing condition		
30151	30251	30351	30451	Pr.151	Gain changing time constant		
30152	30252	30352	30452	Pr.152	Ratio of load inertia moment to servo motor inertia moment 2		
30153	30253	30353	30453	Pr.153	Position loop gain 2 changing ratio		
30154	30254	30354	30454	Pr.154	Speed loop gain 2 changing ratio		
30155	30255	30355	30455	Pr.155	Speed integral compensation changing ratio		
30156	30256	30356	30456	Pr.156	Maker setting		
30157	30257	30357	30457	Pr.157	Maker setting		
30158	30258	30358	30458	Pr.158	Maker setting		
30159	30259	30359	30459	Pr.159	Maker setting		
30160	30260	30360	30460	Pr.160	Optional function C		
30161	30261	30361	30461	Pr.161	Machine resonance suppression filter 2		
30162	30262	30362	30462	Pr.162	Maker setting		
30163	30263	30363	30463	Pr.163	Maker setting		
30164	30264	30364	30464	Pr.164	Maker setting		
30165	30265	30365	30465	Pr.165	Maker setting		
30166	30266	30366	30466	Pr.166	Maker setting		

Appendix 8 External dimension drawing

[1] QD75M1/QD75M2/QD75M4

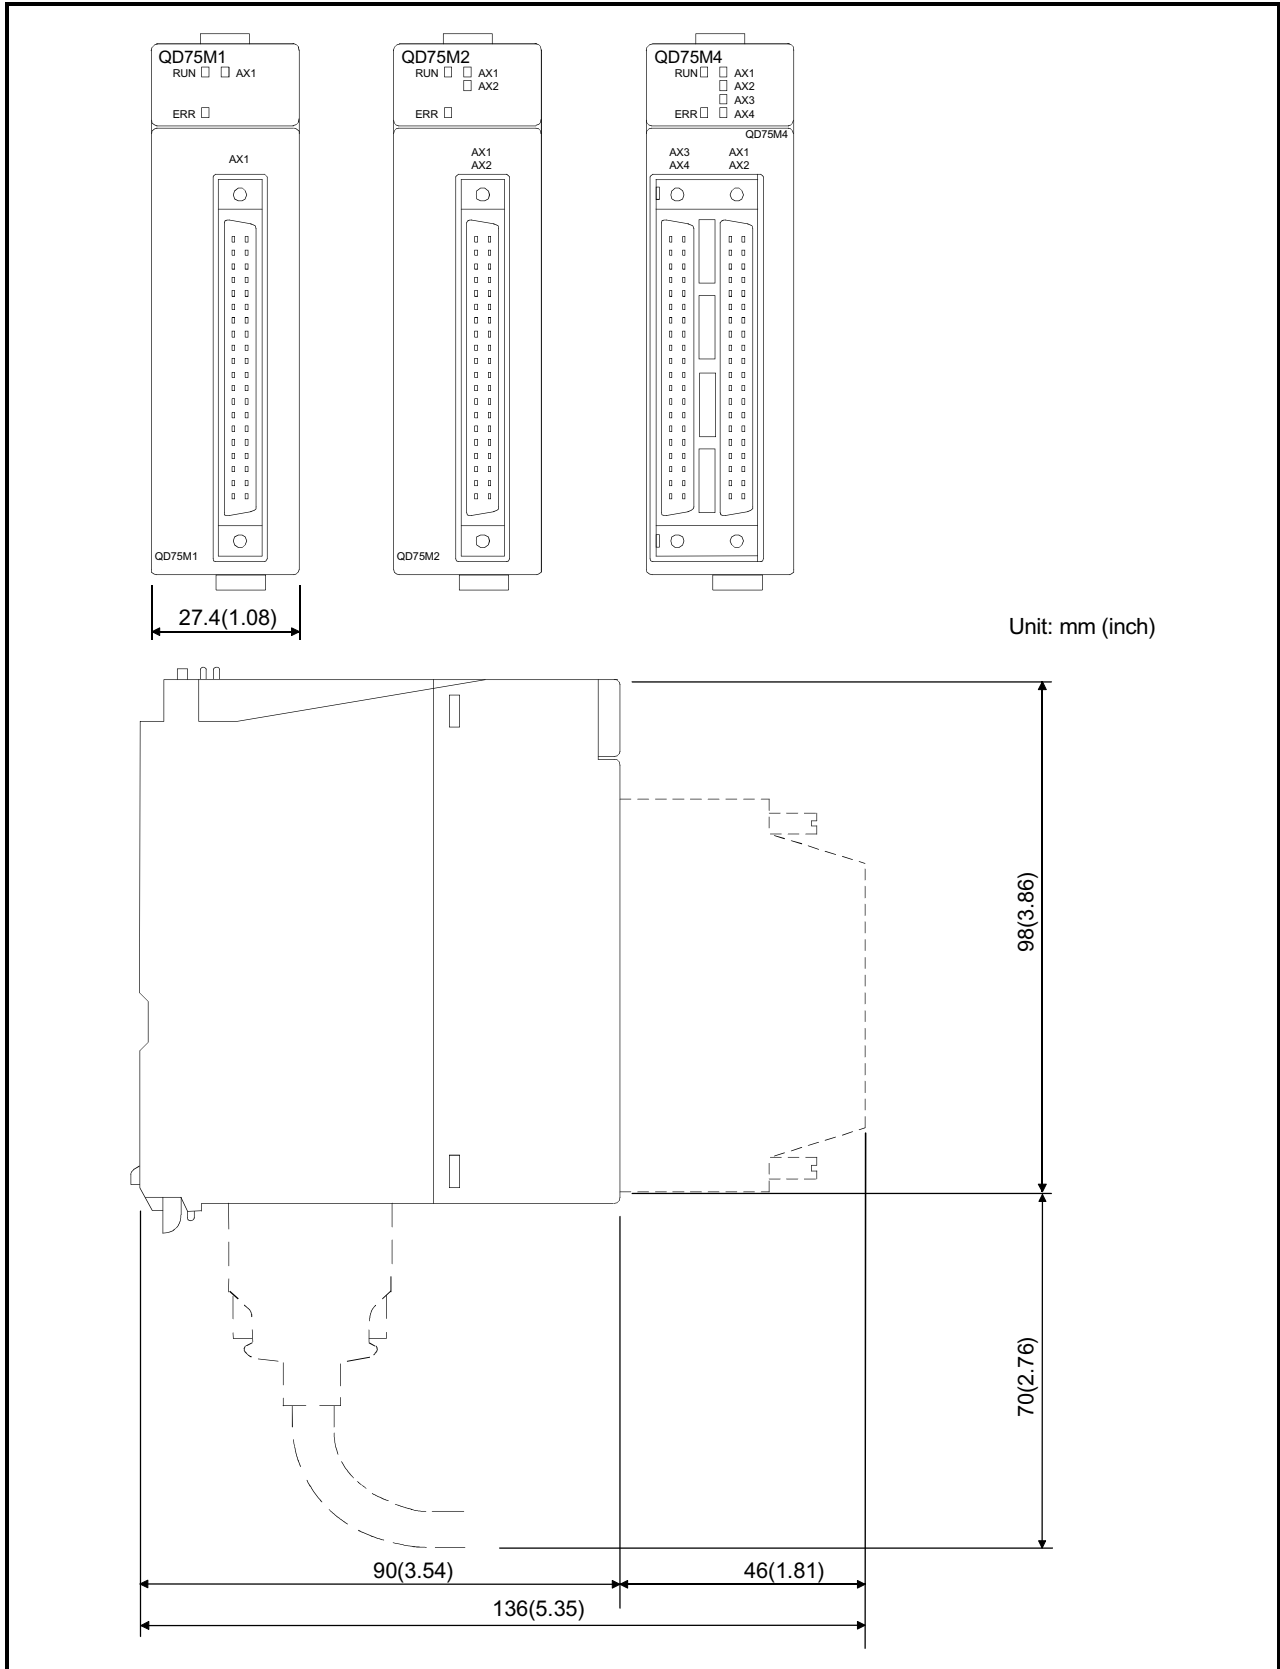





## INDEX

### [Number]

1-axis fixed-feed control .....	9-43
1-axis linear control (ABS linear 1) .....	9-27
1-axis linear control (INC linear 1) .....	9-28
1-axis speed control .....	9-68
2-axis circular interpolation control with sub point designation (ABS circular sub) .....	9-54
2-axis circular interpolation control with sub point designation (INC circular sub) .....	9-57
2-axis circular interpolation control with center point designation (ABS circular right/ABS circular left) .....	9-62
2-axis circular interpolation control with center point designation (INC circular right/INC circular left) .....	9-65
2-axis fixed-feed control (interpolation) .....	9-46
2-axis linear interpolation control (ABS linear 2) .....	9-29
2-axis linear interpolation control (INC linear 2) .....	9-31
2-axis speed control .....	9-71
3-axis fixed-feed control (interpolation) .....	9-48
3-axis linear interpolation control (ABS linear 3) .....	9-33
3-axis linear interpolation control (INC linear 3) .....	9-36
3-axis speed control .....	9-74
4-axis fixed-feed control (interpolation) .....	9-52
4-axis linear interpolation control (ABS linear 4) .....	9-39
4-axis linear interpolation control (INC linear 4) .....	9-42
4-axis speed control .....	9-78

### [A]

ABS direction in degrees ( [Cd.40] ) .....	5-158
Absolute system .....	9-15
Acceleration time 0 ( [Pr.9] ) .....	5-26
Acceleration time 1 ( [Pr.25] ) .....	5-36

Acceleration time 2 ( [Pr.26] ) .....	5-36
Acceleration time 3 ( [Pr.27] ) .....	5-36
Acceleration time No. ( [Da.3] ) .....	5-84
Acceleration/deceleration process selection ( [Pr.34] ) .....	5-38
Acceleration/deceleration processing function .....	12-81
Acceleration/deceleration time change during speed change, enable/disable selection ( [Cd.12] ) .....	5-144
Acceleration/deceleration time change function .....	12-47
Acceleration/deceleration time change program .....	6-45
Actual acceleration/deceleration time .....	5-26
Adaptive vibration suppression control/low pass filter ( [Pr.125] ) .....	5-72
Address ( [Da.17] ) .....	5-107
AFTER mode .....	12-65
Allowable circular interpolation error width ( [Pr.41] ) .....	5-42
Amplifier setting ( [Pr.101] ) .....	5-58
Analog monitor output ( [Pr.122] ) .....	5-68
Applicable system .....	2-5
Applicable wire size .....	3-3
Arc address ( [Da.7] ) .....	5-92
Auto tuning ( [Pr.108] ) .....	5-62
Automatic trapezoidal acceleration/deceleration processing method .....	12-81
Axis display LED .....	4-3
Axis error No. ( [Md.10] , [Md.23] ) .....	5-116, 120
Axis error occurrence (Hour) ( [Md.11] ) .....	5-116
Axis error occurrence (Minute: second) ( [Md.12] ) .....	5-116
Axis error reset ( [Cd.5] ) .....	5-140
Axis feed rate ( [Md.28] ) .....	5-124
Axis in which the error occurred ( [Md.9] ) .....	5-116
Axis in which the warning occurred ( [Md.14] ) .....	5-118
Axis monitor data .....	5-120

Axis operation status ( [Md.26] )	5-122
Axis stop signal	3-17
Axis to be interpolated ( [Da.5] )	5-84
Axis warning detection	5-126
Axis warning No. ( [Md.15] , [Md.24] )	5-118
Axis warning occurrence (Hour) ( [Md.16] )	5-118
Axis warning occurrence (Minute: second) ( [Md.17] )	5-118

## [B]

Backlash compensation amount ( [Pr.11] )	5-28
Backlash compensation function	12-11
Basic parameters 1	5-22
Basic parameters 2	5-26
Block	10-2
Block No. being executed ( [Md.45] )	5-132
Block start (Normal start)	10-2
Block start data	10-7
Block start data area (Nos. 7000 to 7004)	7-3
Buffer memory	7-2
Buffer memory area configuration	7-5
BUSY signal	3-14

## [C]

Cable clamp	4-12
Combination of functions	3-12
Combination of main functions and sub functions	3-12
Command in-position flag	5-126
Command in-position function	12-78
Command in-position width ( [Pr.16] )	5-30
Command speed ( [Da.8] )	5-94
Common functions	3-10, 13-4
Communicating signals between QD75 and each module	1-19
Composite speed	5-32
Condition data	10-16
Condition operator	10-17
Condition operator ( [Da.16] )	5-107
Condition start	10-10
Condition target ( [Da.15] )	5-107
Conditional JUMP	9-112
Configuration and roles of QD75 memory	7-2
Confirming the current value	9-16
Confirming the installation and wiring	4-14

Connection confirmation	4-14
Connector	4-3
Continuous operation interrupt program	6-48
Continuous path control	9-8
Continuous positioning control	9-7
Control data area	7-3
Control functions	3-4
Control system ( [Da.2] )	5-84
Control system repetition counter ( [Md.42] )	5-132
Count method 1)	8-8
Count method 2)	8-10
Creep speed ( [Pr.47] )	5-52
Current feed value	9-16
Current feed value ( [Md.20] )	5-120
Current feed value during speed control ( [Pr.21] )	5-32
Current speed ( [Md.27] )	5-122

## [D]

Data set method	8-12
Data transmission process	7-8
Deceleration stop	6-71
Deceleration curve	12-93
Deceleration curve re-processing	12-93
Deceleration curve configuration	12-94
Deceleration start flag ( [Md.48] )	5-134
Deceleration start flag function	12-89
Deceleration start flag valid ( [Cd.41] )	5-138
Deceleration time 0 ( [Pr.10] )	5-26
Deceleration time 1 ( [Pr.28] )	5-36
Deceleration time 2 ( [Pr.29] )	5-36
Deceleration time 3 ( [Pr.30] )	5-36
Deceleration time No. ( [Da.4] )	5-84
Detailed parameters 1	5-28
Detailed parameters 2	5-36
Details of input signals (QD75 → PLC CPU)	3-15
Details of output signals (PLC CPU → QD75)	3-17
Deviation counter clear	3-19
Deviation counter value ( [Md.102] )	5-134
Disposal instructions	4-15
DOS/V personal computer	A-14
Drive unit (Servo amplifier)	A-14

Dwell time (JUMP destination positioning data No.) ( [Da.9] )	5-94
Dwell time during OPR retry ( [Pr.57] )	5-56
<b>[E]</b>	
Effective load torque ( [Md.110] )	5-136
Electrical specifications	3-18
Electrical specifications sequence ( [Pr.121] )	5-68
Electronic gear function	12-13
Emergency stop	6-70
Error and warning details	15-2
Error detection signal	3-14
Error history	5-116
Error history pointer ( [Md.13] )	5-116
Error judgment ( [Md.7] )	5-114
Error reset program	6-51
Execution data backup function	13-5
Execution prohibition flag	3-14
External command	3-16
External command function selection ( [Pr.42] )	5-42
External command function valid setting program	6-36
External command valid ( [Cd.8] )	5-142
External device connector	4-3
External dimension drawing	Appendix-63
External input/output signal ( [Md.30] )	5-124
External I/O signal logic switching function	13-7
External I/O signal monitor function	13-8
<b>[F]</b>	
Fast OPR	8-13
Fatal stop	6-70
Features of QD75	1-2
Feed forward gain ( [Pr.119] )	5-66
Feed back pulse ( [Pr.106] )	5-60
Feedrate ( [Md.22] )	5-120
Flash ROM	7-2
Flash ROM write program	6-50
Flash ROM write request ( [Cd.1] )	5-138
Flow of all processes	1-22
Flow of system operation	1-22
Follow up function	6-89
For creating program	6-2
For installation	4-7
For maintenance	4-15

For restarting	6-69
For starting "fast OPR"	6-60
For starting "machine OPR"	6-59
For starting "major positioning control"	6-60
For starting "position-speed switching control"	6-61
For starting "speed-position switching control"	6-61
For starting with external command signal	6-64
For wiring	4-9
Forced stop	6-70
Front-loading speed switching mode	9-13
Functions for compensating the control	12-11
Functions to change the control details	12-37
Functions to limit the control	12-23
Functions	Appendix-3
<b>[G]</b>	
Gain changing selection 2 ( [Pr.149] )	5-78
Gain changing condition ( [Pr.150] )	5-78
Gain changing time constant ( [Pr.151] )	5-78
General configuration of program	6-20
General image of system	2-2
GX Configurator-QP	A-14, 2-4
GX Developer	A-14
<b>[H]</b>	
Handling	4-5
Hardware stroke limit function	12-35
High-level positioning control	10-2
<b>[I]</b>	
In speed change processing flag ( [Md.40] )	5-130
In speed control flag	5-126
In speed control flag ( [Md.39] )	5-130
In test mode flag ( [Md.1] )	5-110
Inching movement amount ( [Cd.16] )	5-148
Inching operation setting program	6-41
Inching operation start time chart	11-23
Inching operation timing and processing times	11-19
Inching operation	11-17
Incremental system	9-15
Independent positioning control	9-6
Initialization program	6-53
In-position range ( [Pr.120] )	5-68

Input signal logic selection ( [Pr.22] )	5-32
Interface internal circuit	3-21
Intentional stop	6-70
Internal circuit	3-19
Internal current consumption	3-3
Interpolation axis	9-21
Interpolation control	9-21
Interpolation speed designation method ( [Pr.20] )	5-32
Interruption request during continuous operation ( [Cd.18] )	5-148

## [J]

JOG operation	11-4
JOG operation acceleration time selection ( [Pr.32] )	5-36
JOG operation deceleration time selection ( [Pr.33] )	5-36
JOG operation setting program	6-41
JOG operation start time chart	11-11
JOG operation timing and processing times	11-6
JOG speed ( [Cd.17] )	5-148
JOG speed limit value ( [Pr.31] )	5-36
JOG start signal	3-15
JUMP instruction	9-112

## [K]

## [L]

Last executed positioning data No. ( [Md.46] )	5-132
LED display functions	15-106
LEND	9-115
List of block start data	5-98
List of condition data	5-104
List of configuration devices	2-4
List of control data	5-138
List of dedicated instructions	14-2
List of devices used	6-5
List of errors	15-6
List of functions	3-4
List of input/output signal details	3-20
List of input/output signals	3-14
List of monitor data	5-110
List of parameters	5-22
List of positioning data	5-82

List of warnings	15-90
Load inertia ( [Pr.112] )	5-64
LOOP	9-114
Lower limit	3-21

## [M]

M code (Condition data No., No. of LOOP to LEND repetitions) ( [Da.10] )	5-94
M code OFF request	12-65
M code OFF request ( [Cd.7] )	5-140
M code ON signal	3-15
M code ON signal output timing	12-64
M code ON signal output timing ( [Pr.18] )	5-30
M code output function	12-64
Machine feed value	9-16
Machine feed value ( [Md.21] )	5-120
Machine OPR	8-4
Machine response suppression filter ( [Pr.118] )	5-66
Machine response suppression filter 2 ( [Pr.161] )	5-80
Main functions	3-6
Major positioning controls	9-2
Manual control	11-2
Manual pulse generator	2-4
Manual pulse generator	A-14
Manual pulse generator cable	Appendix-24
Manual pulse generator 1 pulse input magnification ( [Cd.20] )	5-150
Manual pulse generator enable flag ( [Cd.21] )	5-150
Manual pulse generator input selection ( [Pr.24] )	5-32
Manual pulse generator operation	11-27
Manual pulse generator operation program	6-42
Manual pulse generator operation start time chart	11-34
Manual pulse generator operation timing and processing times	11-29
Mechanism of positioning control	1-7
Monitor data area	7-3
Movement amount after near-point dog ON ( [Md.34] )	5-128
Monitor output 1 offset ( [Pr.127] )	5-74
Monitor output 2 offset ( [Pr.128] )	5-74
Motor capacity ( [Pr.104] )	5-60

Motor current value ( [Md.104] ) .....	5-134
Motor rotation speed ( [Md.103] ) .....	5-134
Motor type ( [Pr.103] ) .....	5-60
Monitor output offset ( [Pr.127] ) .....	5-74
Movement amount per pulse ( [Pr.2] to [Pr.4] ) .....	5-22
Movement amount per rotation ( [Pr.3] ) .....	5-22
Multiple axes simultaneous start control ....	10-20
Multiple PLC .....	2-5

## [N]

Names of each part.....	4-3
Near pass function .....	12-20
Near pass .....	12-20
Near-point dog method machine OPR .....	8-6
Near-point dog signal .....	3-18
New acceleration time value ( [Cd.10] ) .....	5-144
New current value .....	9-106
New current value ( [Cd.9] ) .....	5-142
New deceleration time value ( [Cd.11] ) .....	5-144
New speed value ( [Cd.14] ) .....	5-146
New torque value ( [Cd.22] ) .....	5-150
NEXT start .....	10-15
No. of control axes .....	3-2
No. of modules can be mounted.....	2-5
No. of occupied I/O points.....	3-3
No. of pulses per rotation ( [Pr.2] ) .....	5-22
No. of write accesses to flash ROM ( [Md.19] ) .....	5-118
NOP instruction .....	9-111
Normal start .....	10-8

## [O]

OP address ( [Pr.45] ) .....	5-50
OP shift amount ( [Pr.53] ) .....	5-56
OP shift function .....	12-8
Operating principle .....	1-7
Operation pattern ( [Da.1] ) .....	5-84
Operation patterns.....	9-5
Operation timing and processing time during position-speed switching control.....	9-94
Operation timing and processing time during speed-position switching control (ABS mode) .....	9-94

Operation timing and processing time during speed-position switching control (INC mode) .....	9-86
Operation timing and processing time of fast OPR.....	8-14
OPR acceleration time selection ( [Pr.51] ) ..	5-54
OPR basic parameters .....	5-48
OPR complete flag.....	5-126
OPR deceleration time selection ( [Pr.52] ) ..	5-54
OPR detailed parameters .....	5-54
OPR direction ( [Pr.44] ) .....	5-50
OPR method .....	8-5
OPR method ( [Pr.43] ) .....	5-48
OPR method (1): Near-point dog method .....	8-6
OPR method (2): Count method 1) .....	8-8
OPR method (3): Count method 2) .....	8-10
OPR method (4): Data set method .....	8-12
OPR OFF request program .....	6-35
OPR request .....	8-2
OPR request flag .....	5-126
OPR request flag OFF request ( [Cd.19] ) .....	5-150
OPR retry ( [Pr.48] ) .....	5-52
OPR re-travel value ( [Md.100] ) .....	5-134
OPR retry function .....	12-4
OPR speed ( [Pr.46] ) .....	5-50
OPR torque limit value ( [Pr.54] ) .....	5-56
Optional function 1 ( [Pr.123] ) .....	5-70
Optional function 2 ( [Pr.124] ) .....	5-72
Optional function 5 ( [Pr.132] ) .....	5-74
Optional function 6 ( [Pr.133] ) .....	5-74
Optional function C ( [Pr.160] ) .....	5-82
Order of priority for stop process.....	6-72
Outline design of positioning system.....	1-18
Outline of installation, wiring and maintenance .....	4-2
Outline of OPR control.....	8-2
Outline for restarting .....	1-27
Outline of starting.....	1-24
Outline of stopping .....	1-26
Override function.....	12-44
Override program.....	6-44

[P]

Parameter ( [Da.14] ) .....	5-101
Parameter 1 ( [Da.18] ) .....	5-107
Parameter 2 ( [Da.19] ) .....	5-107
Parameter area .....	7-3
Parameter initialization program .....	6-50
Parameter initialization request ( [Cd.2] ) .....	5-138
Performance specifications .....	3-2
Peripheral device .....	A-14
Personal computer .....	A-14
PFWRT .....	14-11
PINIT .....	14-2
PLC CPU .....	A-14
PLC CPU memo area .....	7-3
PLC CPU module .....	2-5
PLC READY signal .....	3-17
PLC READY signal [Y0] ON program .....	6-36
Position loop gain 1 ( [Pr.113] ) .....	5-64
Position loop gain 2 ( [Pr.115] ) .....	5-64
Position loop gain change ratio ( [Pr.153] ) .....	5-78
Position-speed switching control .....	9-99
Position-speed switching control speed change register ( [Cd.25] ) .....	5-152
Position-speed switching control enable flag ( [Cd.26] ) .....	5-154
Position-speed switching latch flag .....	5-126
Position-speed switching signal .....	3-21
Positioning address/movement amount ( [Da.6] ) .....	5-86
Positioning complete signal .....	3-15
Positioning complete signal output time ( [Pr.40] ) .....	5-42
Positioning control operation program .....	6-16
Positioning complete .....	9-6
Positioning data area (No.1 to 600) .....	7-3
Positioning data being executed ( [Md.47] ) .....	5-132
Positioning data No. being executed ( [Md.44] ) .....	5-132
Positioning operation speed override ( [Cd.13] ) .....	5-146
Positioning program examples .....	6-20
Positioning start No. ( [Cd.3] ) .....	5-140
Positioning start No. setting program .....	6-36
Positioning start program .....	6-39

Positioning start signal .....	3-17
Positioning starting point No. ( [Cd.4] ) .....	5-140
Precautions	
• Disposal instructions .....	4-15
• Handling precautions .....	4-5
• Precautions for creating program .....	6-2
• Precautions for installation .....	4-7
• Precautions for maintenance .....	4-15
• Precautions for MR-J2M-B connection .....	12-98
• Precautions for SSCNET cable wiring .....	4-7
• Precautions for using stepping motor .....	1-22
• Precautions for wiring .....	4-10
Pre-alarm data selection ( [Pr.129] ) .....	5-74
Pre-reading start function .....	12-84
Process time	
• Inching operation timing and processing time .....	11-19
• JOG operation timing and processing time .....	11-6
• Machine OPR operation timing and process time .....	6-62
• Manual pulse generator operation timing and processing times .....	11-29
• Operation timing and processing time during position-speed switching control .....	9-94
• Operation timing and processing time during speed-position switching control (ABS mode) .....	9-94
• Operation timing and processing time during speed-position switching control (INC mode) .....	9-86
• Operation timing and processing time of fast OPR .....	8-14
• Position control operation timing and process time .....	6-63
Program details .....	6-53
Program examples	
• Acceleration/deceleration time change program .....	6-45
• Continuous operation interrupt program .....	6-48
• Error reset program .....	6-51
• External command function valid setting program .....	6-36
• Flash ROM write program .....	6-50
• Inching operation setting program .....	6-42
• JOG operation setting program .....	6-42

• JOG operation/inching operation execution program .....	6-24
• M code OFF program.....	6-41
• Manual pulse generator operation program .....	6-42
• OPR request OFF program .....	6-35
• Override program .....	6-44
• Parameter initialization program .....	6-50
• Parameter setting program .....	6-20
• PLC READY signal [Y0] ON program ....	6-36
• Positioning start No. setting program ....	6-36
• Positioning start program .....	6-39
• Restart program .....	6-49
• Servo on [Y1] program.....	6-36
• Servo parameter read program .....	6-51
• Skip program .....	6-47
• Speed change program .....	6-43
• Step operation program .....	6-46
• Stop program.....	6-52
• Target position change program.....	6-48
• Teaching program .....	6-47
• Torque change program .....	6-45
• Unit setting program.....	6-21
PSTRT1 .....	14-3
PSTRT2.....	14-3
PSTRT3.....	14-3
PSTRT4.....	14-3
Purpose and applications of positioning control .....	1-5

#### [Q]

QD75 .....	A-14
QD75 READY signal.....	3-15

#### [R]

Ratio of load inertia moment to servomotor inertia moment 2 ( [Pr.152] ) .....	5-78
Read current value ( [Md.101] ).....	5-134
Reference axis .....	9-21
Reference axis speed .....	5-33
Regenerative brake resistor ( [Pr.102] ) .....	5-58
Regenerative load ratio ( [Md.109] ).....	5-140
Relatively safe stop .....	6-70
Remote I/O station .....	2-5
Repeated start (FOR condition).....	10-14
Repeated start (FOR loop).....	10-13
Restart command ( [Cd.6] ) .....	5-140
Restart operation.....	6-67
Restart program .....	6-67

Rotation direction ( [Pr.107] ).....	5-60
--------------------------------------	------

#### [S]

Servo adjustment parameter .....	5-64
Servo expansion parameter .....	5-74
Servo expansion parameter 2 .....	5-78
Servo amplifier data read ( [Cd.102] ) .....	5-160
Servo amplifier S/W No. ( [Md.106] ).....	5-134
Servo basic parameter .....	5-58
Servo OFF command ( [Cd.100] ).....	5-160
Servo ON/OFF .....	12-89
Servo parameter ( [Md.105] ).....	5-134
Servo response ( [Pr.109] ).....	5-62
Servo series ( [Pr.100] ).....	5-58
Servo status ( [Md.108] ).....	5-136
Setting data .....	5-2
Setting for the movement amount after near-point dog ON ( [Pr.50] ) .....	5-54
Setting items for block start data .....	5-12
Setting items for condition data .....	5-13
Setting items for servo parameters .....	5-7
Setting items for OPR parameters .....	5-6
Setting items for positioning data .....	5-9
Setting items for positioning parameters.....	5-4
Setting the positioning data .....	9-22
Setting the torque limit function .....	12-27
Shape ( [Da.11] ) .....	5-101
Signal layout of connector .....	3-19
Signal name .....	3-14
Signals	
• Axis stop signal .....	3-17
• BUSY signal.....	3-15
• Error detection signal.....	3-15
• Execution prohibition flag signal.....	3-17
• JOG start signal .....	3-17
• M code ON signal .....	3-15
• PLC READY signal.....	3-17
• Positioning complete signal.....	3-15
• Positioning start signal.....	3-15
• QD75 READY signal .....	3-15
• Start complete signal .....	3-15
• Synchronization flag signal.....	3-15
Simultaneous start .....	10-12
Simultaneous starting axis start data No. (Axis 1 start data No.) ( [Cd.30] ).....	5-156
Simultaneous starting axis start data No. (Axis 2 start data No.)( [Cd.31] ).....	5-156



Simultaneous starting axis start data No. (Axis 3 start data No.) ( [Cd.32] ) .....	5-156
Simultaneous starting axis start data No. (Axis 4 start data No.) ( [Cd.33] ) .....	5-156
Skip command ( [Cd.37] ) .....	5-158
Skip function .....	12-61
Skip operation program .....	6-47
Slot .....	2-5
Software stroke limit function .....	12-29
Software stroke limit lower limit value ( [Pr.13] ) .....	5-28
Software stroke limit selection ( [Pr.14] ) .....	5-28
Software stroke limit upper limit value ( [Pr.12] ) .....	5-28
Software stroke limit valid/invalid setting ( [Pr.15] ) .....	5-28
S-pattern acceleration/deceleration processing method .....	12-82
S-pattern proportion ( [Pr.35] ) .....	5-38
Special start instruction ( [Da.13] ) .....	5-101
Special start data instruction code setting value ( [Md.36] ) .....	5-130
Special start data instruction parameter setting value ( [Md.37] ) .....	5-130
Special start repetition counter ( [Md.41] ) .....	5-132
Specifications of input/output interfaces .....	3-18
Specifications of input/output signals .....	3-14
Speed change 0 flag .....	5-126
Speed change function .....	12-37
Speed change program .....	6-20
Speed change request ( [Cd.15] ) .....	5-107
Speed designation during OP shift ( [Pr.56] ) .....	5-56
Speed differential compensation ( [Pr.138] ) .....	5-76
Speed integral compensation ( [Pr.117] ) .....	5-64
Speed integral compensation changing ratio ( [Pr.155] ) .....	5-78
Speed limit function .....	12-23
Speed limit value ( [Pr.8] ) .....	5-26
Stop command processing for deceleration stop selection ( [Cd.42] ) .....	5-64
Speed loop gain 1 ( [Pr.114] ) .....	5-64
Speed loop gain 2 ( [Pr.116] ) .....	5-64
Speed loop gain changing ratio ( [Pr.154] ) .....	5-78
Speed-position function selection ( [Pr.200] ) .....	5-32
Speed switching mode ( [Pr.19] ) .....	5-32
Speed-position switching control (ABS mode) .....	9-91
Speed-position switching control (INC mode) .....	9-86
Speed-position switching control movement amount change register ( [Cd.23] ) .....	5-152
Speed-position switching control positioning amount ( [Md.29] ) .....	5-124
Speed-position switching enable flag ( [Cd.24] ) .....	5-148
Speed-position switching latch flag .....	5-126
Speed-position switching signal .....	3-18
Spiral interpolation .....	9-61
SSCNET .....	A-14
SSCNET cable over all length .....	3-3
Standard speed switching mode .....	9-12
Start Hour ( [Md.5] ) .....	5-112
Start complete signal .....	3-15
Start data No. ( [Da.12] ) .....	5-101
Start data pointer being executed ( [Md.43] ) .....	5-132
Start details setting program .....	6-54
Start history .....	5-112
Start history pointer ( [Md.8] ) .....	5-114
Start information ( [Md.3] ) .....	5-112
Start Minute: second ( [Md.6] ) .....	5-112
Start No. ( [Md.4] ) .....	5-112
Start positioning data No. setting value ( [Md.38] ) .....	5-130
Start program .....	6-56
Start program for high-level positioning control .....	10-23
Status ( [Md.31] ) .....	5-126
Step function .....	12-56
Step mode .....	12-57
Step mode ( [Cd.34] ) .....	5-156
Step operation program .....	6-46
Step start information .....	12-58
Step start information ( [Cd.36] ) .....	5-158

Step valid flag ( [Cd.35] )	5-156
Stop cause	6-72
Stop command processing for deceleration stop function	12-93
Stop command processing for deceleration stop selection( [Cd.42] )	5-140
Stop group 1 sudden stop selection ( [Pr.37] )	5-38
Stop group 2 sudden stop selection ( [Pr.38] )	5-38
Stop group 3 sudden stop selection ( [Pr.39] )	5-38
Stop process	6-72
Stop program	6-72
Stop signal	3-18
Sub functions	12-2
Sub functions specifically for machine OPR	12-4
Sudden stop	6-43
Sudden stop deceleration time ( [Pr.36] )	5-38
Synchronization flag (X1)	3-15
System control data	5-138
System monitor data	5-110
[T]	
Tact time	12-86
Target position change function	12-74
Target position change request flag ( [Cd.29] )	5-154
Target position change value (new address) ( [Cd.27] )	5-154
Target position change value (new speed) ( [Cd.28] )	5-154
Target speed ( [Md.33] )	5-128
Target value ( [Md.32] )	5-126
TEACH1	14-7
TEACH2	14-7
TEACH3	14-7
TEACH4	14-7
Teaching data selection ( [Cd.38] )	5-158
Teaching function	12-68
Teaching positioning data No. ( [Cd.39] )	5-158
Teaching program	6-47
Time chart	
• Inching operation start time chart	11-23
• JOG operation start time chart	11-11

• Time chart for restarting	6-39
• Time chart for starting "fast OPR"	6-60
• Time chart for starting machine "OPR" ...	6-59
• Time chart for starting "major positioning control"	6-60
• Time chart for starting "position-speed switching control"	6-61
• Time chart for starting "speed-position switching control"	6-61
• Time chart for starting with external command signal	6-64
Time chart for changing the speed from the PLC CPU	12-41
Time chart for changing the speed using an external command signal	12-42
Time chart for changing the speed using the override function	12-45
Torque change function	12-51
Torque change program	6-45
Torque limit function	12-25
Torque limit setting value ( [Pr.17] )	5-30
Torque limit stored value ( [Md.35] )	5-128
Torque output setting value ( [Cd.101] )	5-160
Types and roles of control data	5-18
Types and roles of monitor data	5-14
Types of data	5-2
Types of errors	15-2
Types of stop processes	6-71
Types of warnings	15-3
[U]	
Unconditional JUMP	9-112
Unit magnification ( [Pr.4] )	5-22
Unit setting ( [Pr.1] )	5-22
Upper limit	3-21
[V]	
Valid M code ( [Md.25] )	5-122
[W]	
Wait start	10-11
Warning history	5-118
Warning history pointer ( [Md.18] )	5-118
Writing to the Flash ROM	13-6
WITH mode	12-64
Work piece	A-14

[X]  
X0 (QD75 READY)..... 3-15  
X1 (Synchronization flag)..... 3-15

[Z]  
Zero speed ( Pr.130 ) ..... 5-74

# WARRANTY

Please confirm the following product warranty details before starting use.

## 1. Gratis Warranty Term and Gratis Warranty Range

If any faults or defects (hereinafter "failure") found to be the responsibility of Mitsubishi occurs during use of the product within the gratis warranty term, the product shall be repaired at no cost via the dealer or Mitsubishi Service Company. Note that if repairs are required at a site overseas, on a detached island or remote place, expenses to dispatch an engineer shall be charged for.

### [Gratis Warranty Term]

The gratis warranty term of the product shall be for one year after the date of purchase or delivery to a designated place.

Note that after manufacture and shipment from Mitsubishi, the maximum distribution period shall be six (6) months, and the longest gratis warranty term after manufacturing shall be eighteen (18) months. The gratis warranty term of repair parts shall not exceed the gratis warranty term before repairs.

### [Gratis Warranty Range]

- (1) The range shall be limited to normal use within the usage state, usage methods and usage environment, etc., which follow the conditions and precautions, etc., given in the instruction manual, user's manual and caution labels on the product.
- (2) Even within the gratis warranty term, repairs shall be charged for in the following cases.
  1. Failure occurring from inappropriate storage or handling, carelessness or negligence by the user. Failure caused by the user's hardware or software design.
  2. Failure caused by unapproved modifications, etc., to the product by the user.
  3. When the Mitsubishi product is assembled into a user's device, failure that could have been avoided if functions or structures, judged as necessary in the legal safety measures the user's device is subject to or as necessary by industry standards, had been provided.
  4. Failure that could have been avoided if consumable parts (battery, backlight, fuse, etc.) designated in the instruction manual had been correctly serviced or replaced.
  5. Failure caused by external irresistible forces such as fires or abnormal voltages, and failure caused by force majeure such as earthquakes, lightning, wind and water damage.
  6. Failure caused by reasons unpredictable by scientific technology standards at time of shipment from Mitsubishi.
  7. Any other failure found to not be the responsibility of Mitsubishi or the user.

## 2. Onerous repair term after discontinuation of production

- (1) Mitsubishi shall accept onerous product repairs for seven (7) years after production of the product is discontinued. Discontinuation of production shall be notified with Mitsubishi Technical Bulletins, etc.
- (2) Product supply (including repair parts) is not possible after production is discontinued.

## 3. Overseas service

Overseas, repairs shall be accepted by Mitsubishi's local overseas FA Center. Note that the repair conditions at each FA Center may differ.

## 4. Exclusion of chance loss and secondary loss from warranty liability

Regardless of the gratis warranty term, Mitsubishi shall not be liable for compensation to damages caused by any cause found not to be the responsibility of Mitsubishi, chance losses, lost profits incurred to the user by failures in Mitsubishi products, damages and secondary damages caused from special reasons regardless of Mitsubishi's expectations, compensation for accidents, and compensation for damages to products other than Mitsubishi products and other duties.

## 5. Changes in product specifications

The specifications given in the catalogs, manuals or technical documents are subject to change without prior notice.

## 6. Product application

- (1) In using the Mitsubishi MELSEC programmable logic controller, the usage conditions shall be that the application will not lead to a major accident even if any problem or fault should occur in the programmable logic controller device, and that backup and fail-safe functions are systematically provided outside of the device for any problem or fault.
- (2) The Mitsubishi general-purpose programmable logic controller has been designed and manufactured for applications in general industries, etc. Thus, applications in which the public could be affected such as in nuclear power plants and other power plants operated by respective power companies, and applications in which a special quality assurance system is required, such as for each Japan Railways company or the Department of Defense shall be excluded from the programmable logic controller applications.

Note that even with these applications, if the user approves that the application is to be limited and a special quality is not required, application shall be possible.

When considering use in aircraft, medical applications, railways, incineration and fuel devices, manned transport devices, equipment for recreation and amusement, and safety devices, in which human life or assets could be greatly affected and for which a particularly high reliability is required in terms of safety and control system, please consult with Mitsubishi and discuss the required specifications.

Microsoft Windows and Windows NT are registered trademarks of Microsoft Corporation in the United States and other countries.

Other company and product names herein may be either trademarks or registered trademarks of their respective owners.

**HEADQUARTERS**

MITSUBISHI ELECTRIC EUROPE B.V. EUROPA  
German Branch  
Gothaer Straße 8  
**D-40880 Ratingen**  
Telefon: 02102 / 486-0  
Telefax: 02102 / 486-1120  
E-Mail: megfamail@meg.mee.com

MITSUBISHI ELECTRIC EUROPE B.V. FRANKREICH  
French Branch  
25, Boulevard des Bouvets  
**F-92471 Nanterre Cedex**  
Telefon: +33 1 55 68 55 68  
Telefax: +33 1 55 68 56 85  
E-Mail: factory.automation@framee.com

MITSUBISHI ELECTRIC EUROPE B.V. IRLAND  
Irish Branch  
Westgate Business Park, Ballymount  
**IRL-Dublin 24**  
Telefon: +353 (0) 1 / 419 88 00  
Fax: +353 (0) 1 / 419 88 90  
E-Mail: sales.info@meir.mee.com

MITSUBISHI ELECTRIC EUROPE B.V. ITALIEN  
Italian Branch  
Via Paracelso 12  
**I-20041 Agrate Brianza (MI)**  
Telefon: +39 039 6053 1  
Telefax: +39 039 6053 312  
E-Mail: factory.automation@itmee.com

MITSUBISHI ELECTRIC EUROPE B.V. SPANIEN  
Spanish Branch  
Carretera de Rubí 76-80  
**E-08190 Sant Cugat del Vallés**  
Telefon: +34 9 3 / 565 3131  
Telefax: +34 9 3 / 589 2948  
E-Mail: industrial@sp.mee.com

MITSUBISHI ELECTRIC EUROPE B.V. UK  
UK Branch  
Travellers Lane  
**GB-Hatfield Herts. AL10 8 XB**  
Telefon: +44 (0) 1707 / 27 61 00  
Telefax: +44 (0) 1707 / 27 86 95  
E-Mail: automation@meuk.mee.com

MITSUBISHI ELECTRIC CORPORATION JAPAN  
Office Tower "Z" 14 F  
8-12, 1 chome, Harumi Chuo-Ku  
**Tokyo 104-6212**  
Telefon: +81 3 6221 6060  
Telefax: +81 3 6221 6075

MITSUBISHI ELECTRIC AUTOMATION USA  
500 Corporate Woods Parkway  
**Vernon Hills, IL 60061**  
Telefon: +1 847 / 478 21 00  
Telefax: +1 847 / 478 22 83

**KUNDEN-TECHNOLOGIE-CENTER DEUTSCHLAND**

MITSUBISHI ELECTRIC EUROPE B.V. Kunden-Technologie-Center Nord  
Revierstraße 5  
**D-44379 Dortmund**  
Telefon: (02 31) 96 70 41-0  
Telefax: (02 31) 96 70 41-41

MITSUBISHI ELECTRIC EUROPE B.V. Kunden-Technologie-Center Süd-West  
Kurze Straße 40  
**D-70794 Filderstadt**  
Telefon: (07 11) 77 05 98-0  
Telefax: (07 11) 77 05 98-79

MITSUBISHI ELECTRIC EUROPE B.V. Kunden-Technologie-Center Süd-Ost  
Am Söldnermoos 8  
**D-85399 Hallbergmoos**  
Telefon: (08 11) 99 87 40  
Telefax: (08 11) 99 87 410

**EUROPÄISCHE VERTRETUNGEN**

Getronics b.v. BELGIEN  
Control Systems  
Pontbeeklaan 43  
**BE-1731 Asse-Zellik**  
Telefon: +32 (0) 2 / 467 17 51  
Telefax: +32 (0) 2 / 467 17 45  
E-Mail: infoautomation@getronics.com

TELECON CO. BULGARIEN  
4, A. Ljapchev Blvd.  
**BG-1756 Sofia**  
Telefon: +359 (0) 2 / 97 44 05 8  
Telefax: +359 (0) 2 / 97 44 06 1  
E-Mail: —

louis poulsen DÄNEMARK  
industri & automation  
Geminivej 32  
**DK-2670 Greve**  
Telefon: +45 (0) 70 / 10 15 35  
Telefax: +45 (0) 43 / 95 95 91  
E-Mail: lpia@lpmail.com

UTU Elektrotehnika AS ESTLAND  
Pärnu mnt.160i  
**EE-11317 Tallinn**  
Telefon: +372 (0) 6 / 51 72 80  
Telefax: +372 (0) 6 / 51 72 88  
E-Mail: utu@utu.ee

Beijer Electronics OY FINNLAND  
Ansatie 6a  
**FI-01740 Vantaa**  
Telefon: +358 (0) 9 / 886 77 500  
Telefax: +358 (0) 9 / 886 77 555  
E-Mail: info@beijer.fi

UTECO A.B.E.E. GRIECHENLAND  
5, Mavrogenous Str.  
**GR-18542 Piraeus**  
Telefon: +302 (0) 10 / 42 10 050  
Telefax: +302 (0) 10 / 42 12 033  
E-Mail: sales@uteco.gr

INEA CR d.o.o. KROATIEN  
LJosinjska 4a  
**HR-10000 Zagreb**  
Telefon: +385 (0)1 / 36 940 01  
Telefax: +385 (0)1 / 36 940 03  
E-Mail: —

SIA POWEL LETTLAND  
Lienes iela 28  
**LV-1009 Riga**  
Telefon: +371 784 / 2280  
Telefax: +371 784 / 2281  
E-Mail: utu@utu.lv

UAB UTU POWEL LITAUEN  
Savanoriu pr. 187  
**LT-2053 Vilnius**  
Telefon: +370 (0) 52323-101  
Telefax: +370 (0) 52322-980  
E-Mail: powel@utu.lt

Intehsis srl MOLDAWIEN  
Cuza-Voda 36/1-81  
**MD-2061 Chisinau**  
Telefon: +373 (0)2 / 562263  
Telefax: +373 (0)2 / 562263  
E-Mail: intehsis@mdl.net

Getronics b.v. NIEDERLANDE  
Control Systems  
Donauweg 2 B  
**NL-1043 AJ Amsterdam**  
Telefon: +31 (0) 20 / 587 67 00  
Telefax: +31 (0) 20 / 587 68 39  
E-Mail: info.gia@getronics.com

Beijer Electronics AS NORWEGEN  
Teglværksveien 1  
**N-3002 Drammen**  
Telefon: +47 (0) 32 / 24 30 00  
Telefax: +47 (0) 32 / 84 85 77  
E-Mail: info@beijer.no

GEVA ÖSTERREICH  
Wiener Straße 89  
**AT-2500 Baden**  
Telefon: +43 (0) 2252 / 85 55 20  
Telefax: +43 (0) 2252 / 488 60  
E-Mail: office@geva.at

**EUROPÄISCHE VERTRETUNGEN**

MPL Technology Sp. z o.o. POLEN  
ul. Sliczna 36  
**PL-31-444 Kraków**  
Telefon: +48 (0) 12 / 632 28 85  
Telefax: +48 (0) 12 / 632 47 82  
E-Mail: krakow@mpl.pl

Sirius Trading & Services srl RUMÄNIEN  
Str. Biharia Nr. 67-77  
**RO-013981 Bucuresti 1**  
Telefon: +40 (0) 21 / 201 1146  
Telefax: +40 (0) 21 / 201 1148  
E-Mail: sirius@siriustrading.ro

Beijer Electronics AB SCHWEDEN  
Box 426  
**S-20124 Malmö**  
Telefon: +46 (0) 40 / 35 86 00  
Telefax: +46 (0) 40 / 35 86 02  
E-Mail: info@beijer.se

ECONOTEC AG SCHWEIZ  
Postfach 282  
**CH-8309 Nürensdorf**  
Telefon: +41 (0) 1 / 838 48 11  
Telefax: +41 (0) 1 / 838 48 12  
E-Mail: info@econotec.ch

INEA d.o.o. SLOWENIEN  
Stegne 11  
**SI-1000 Ljubljana**  
Telefon: +386 (0) 1-513 8100  
Telefax: +386 (0) 1-513 8170  
E-Mail: inea@inea.si

AutoCont TSCHECHISCHE REPUBLIK  
Control Systems s.r.o.  
Nemocnicni 12  
**CZ-702 00 Ostrava 2**  
Telefon: +420 59 / 6152 111  
Telefax: +420 59 / 6152 562  
E-Mail: consys@autocont.cz

GTS TÜRKIEI  
Darülaceze Cad. No. 43 Kat. 2  
**TR-80270 Okmeydani-Istanbul**  
Telefon: +90 (0) 212 / 320 1640  
Telefax: +90 (0) 212 / 320 1649  
E-Mail: gts@turk.net

CSC Automation Ltd. UKRAINE  
15, M. Raskova St., Fl. 10, Office 1010  
**UA-02002 Kiev**  
Telefon: +380 (0) 44 / 238-83-16  
Telefax: +380 (0) 44 / 238-83-17  
E-Mail: csc-a@csc-a.kiev.ua

Meltrade Automatika Kft. UNGARN  
55, Harmat St.  
**HU-1105 Budapest**  
Telefon: +36 (0)1 / 2605 602  
Telefax: +36 (0)1 / 2605 602  
E-Mail: office@meltrade.hu

Tehnikon WEISSRUSSLAND  
Oktjabrskaya 16/5, Ap 704  
**BY-220030 Minsk**  
Telefon: +375 (0) 17 / 22 75 704  
Telefax: +375 (0) 17 / 22 76 669  
E-Mail: tehnikon@belsonet.net

**VERTRETUNG MITTLERER OSTEN**

Ilan & Gavish Ltd. ISRAEL  
Automation Service  
24 Shenkar St., Kiryat Arie  
**IL-49001 Petah-Tiqva**  
Telefon: +972 (0) 3 / 922 18 24  
Telefax: +972 (0) 3 / 924 07 61  
E-Mail: iandg@internet-zahav.net

**VERTRETUNGEN EURASIEN**

Avtomatika Sever Ltd. RUSSLAND  
Lva Tolstogo St. 7, Off. 311  
**RU-197376 St Petersburg**  
Telefon: +7 812 / 11 83 238  
Telefax: +7 812 / 11 83 239  
E-Mail: as@avtsev.spb.ru

CONSYS RUSSLAND  
Promyshlennaya St. 42  
**RU-198099 St Petersburg**  
Telefon: +7 812 / 325 36 53  
Telefax: +7 812 / 147 20 55  
E-Mail: consys@consys.spb.ru

Electrotechnical RUSSLAND  
Systems Siberia  
Partizanskaya St. 27, Office 306  
**RU-121355 Moscow**  
Telefon: +7 095 / 416-4321  
Telefax: +7 095 / 416-4321  
E-Mail: info@eltechsystems.ru

Electrotechnical RUSSLAND  
Systems Siberia  
Shetinkina St. 33, Office 116  
**RU-630088 Novosibirsk**  
Telefon: +7 3832 / 22-03-05  
Telefax: +7 3832 / 22-03-05  
E-Mail: info@eltechsystems.ru

Elektrostyle RUSSLAND  
ul. Garschina 11  
**RU-140070 Moscow Oblast**  
Telefon: +7 095 / 514 9316  
Telefax: +7 095 / 514 9317  
E-Mail: info@estl.ru

Elektrostyle RUSSLAND  
Krasnij Prospekt 220-1  
Office No. 312  
**RU-630049 Novosibirsk**  
Telefon: +7 3832 / 10 66 18  
Telefax: +7 3832 / 10 66 26  
E-Mail: info@estl.ru

ICOS RUSSLAND  
Industrial Computer Systems Zao  
Ryazanskij Prospekt 8a, Office 100  
**RU-109428 Moscow**  
Telefon: +7 095 / 232 - 0207  
Telefax: +7 095 / 232 - 0327  
E-Mail: mail@icos.ru

NPP Uralelektra RUSSLAND  
ul. Sverdlowa 11a  
**RU-620027 Ekaterinburg**  
Telefon: +7 34 32 / 53 27 45  
Telefax: +7 34 32 / 53 27 45  
E-Mail: elektra@etel.ru

SSMP Rosgidromontazh Ltd. RUSSLAND  
23, Lesoparkovaya Str.  
**RU-344041 Rostov On Don**  
Telefon: +7 8632 / 36 00 22  
Telefax: +7 8632 / 36 00 26  
E-Mail: —

STC Drive Technique RUSSLAND  
ul. Bajkalskaja 239, Office 2 - 23  
**RU-664075 Irkutsk**  
Telefon: +7 3952 / 24 38 16  
Telefax: +7 3952 / 23 02 98  
E-Mail: privod@irk.ru

STC Drive Technique RUSSLAND  
Poslannikov Per. 9, str.1  
**RU-107005 Moscow**  
Telefon: +7 095 / 790-72-10  
Telefax: +7 095 / 790-72-12  
E-Mail: info@privod.ru

**VERTRETUNG AFRIKA**

CBI Ltd. SÜDAFRIKA  
Private Bag 2016  
**ZA-1600 Isando**  
Telefon: +27 (0) 11 / 928 2000  
Telefax: +27 (0) 11 / 392 2354  
E-Mail: cbi@cbi.co.za